

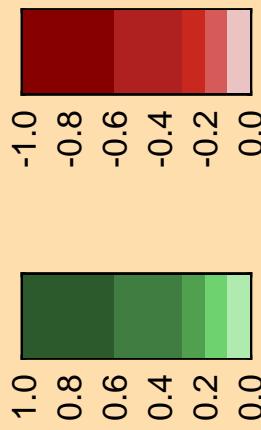


Ordinate scales are % relative  
standard deviation and barns.  
Abscissa scales are energy (eV).


Correlation Matrix

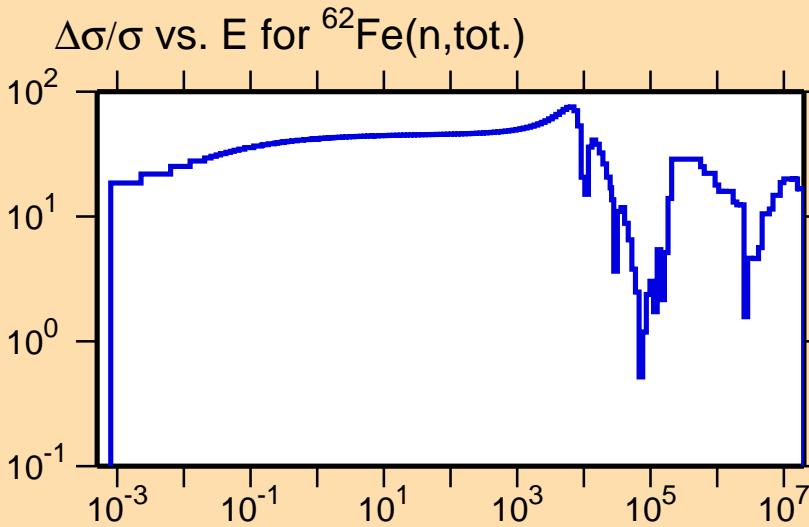

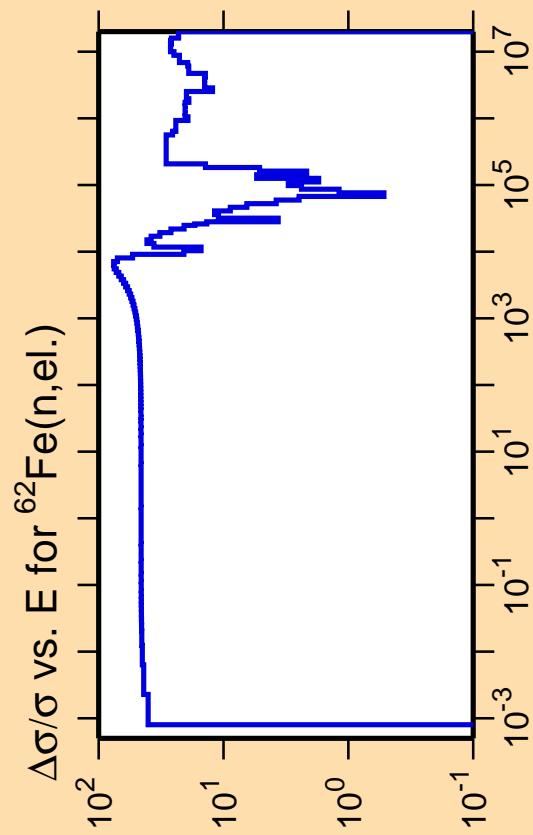




Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).

Correlation Matrix

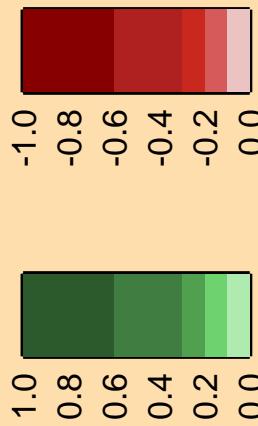


Ordinate scale is % relative standard deviation.

Abscissa scales are energy (eV).

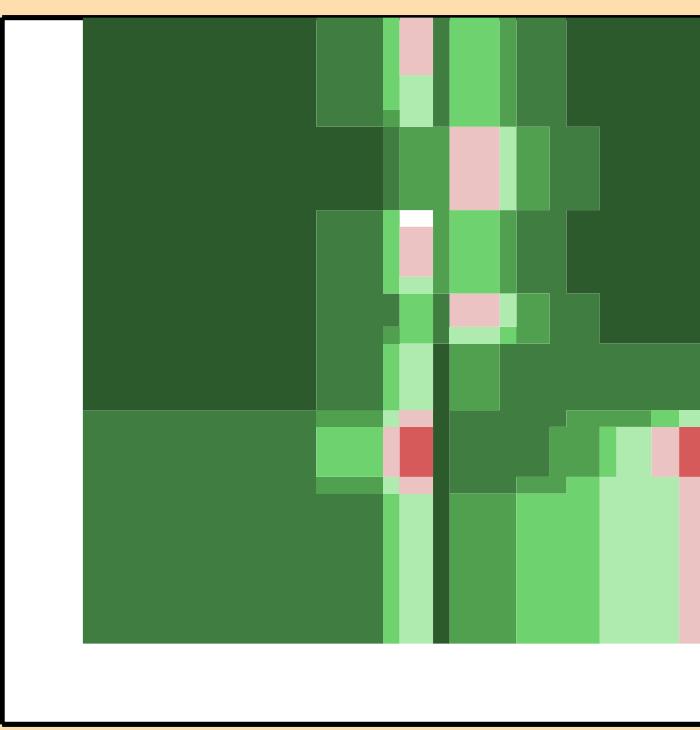
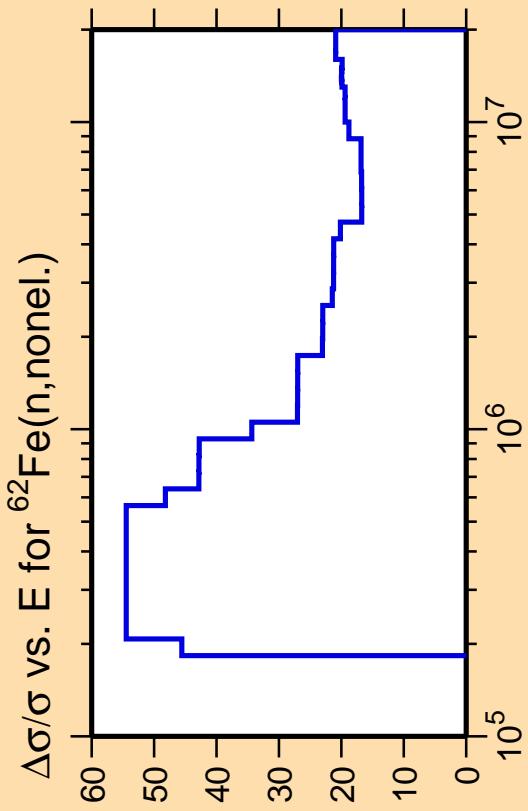
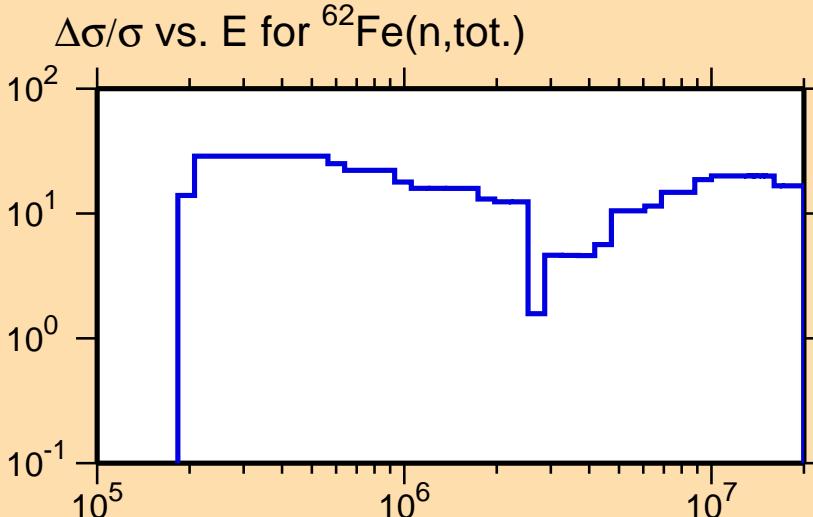


## Correlation Matrix

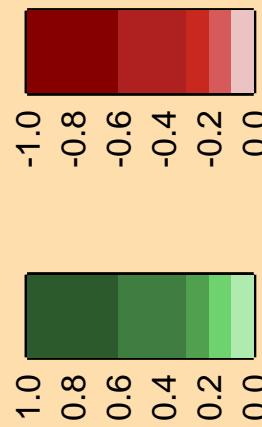


Ordinate scale is % relative standard deviation.


Abscissa scales are energy (eV).

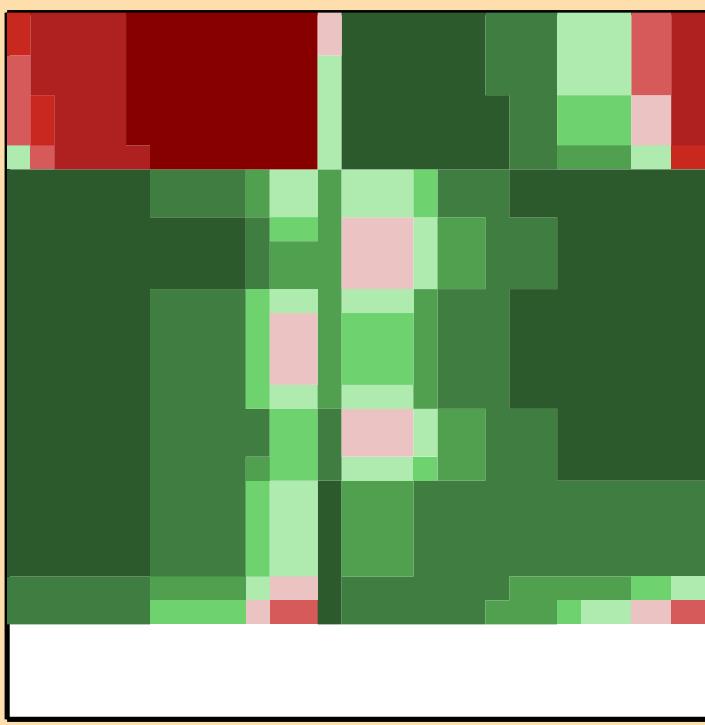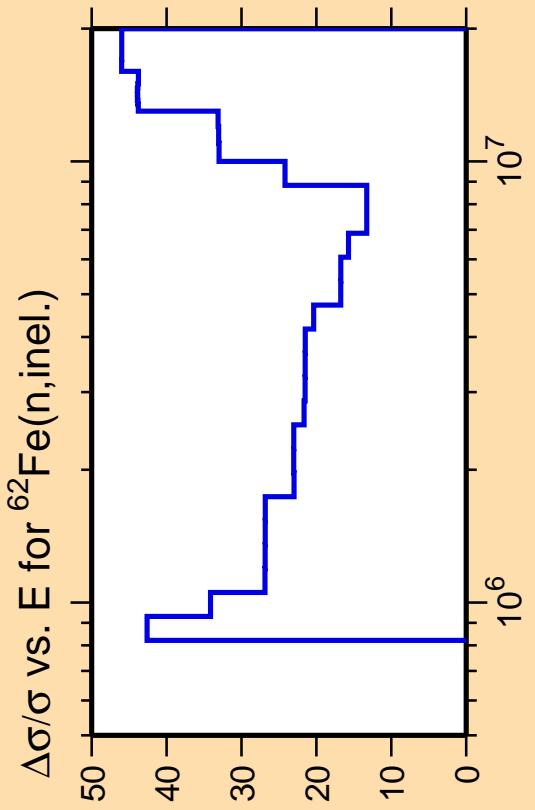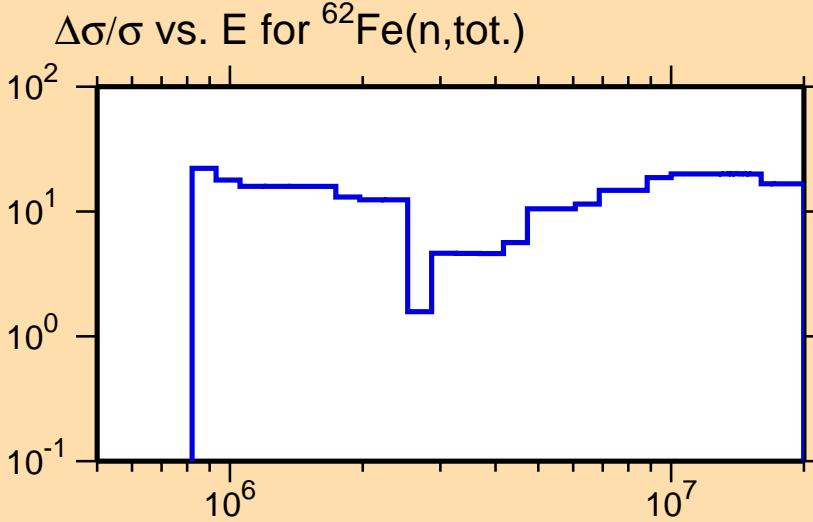

## Correlation Matrix

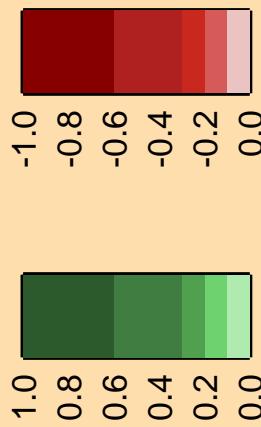


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,2n)$

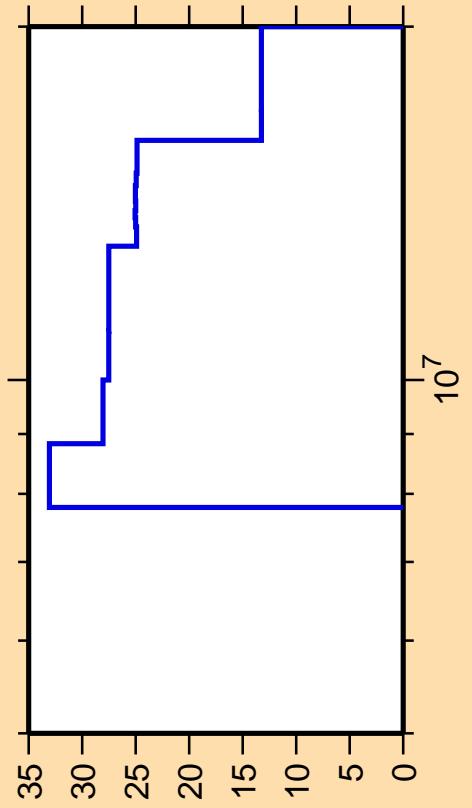

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{tot.})$

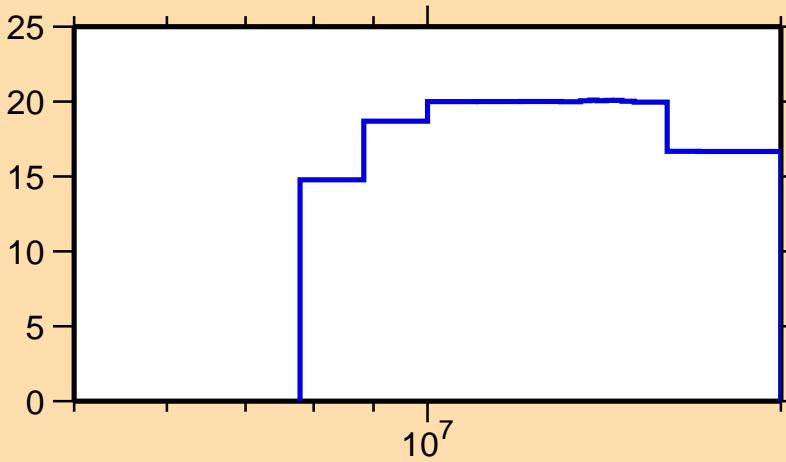

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{n}_1)$


Ordinate scale is %  
relative standard deviation.



Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{n}_1)$

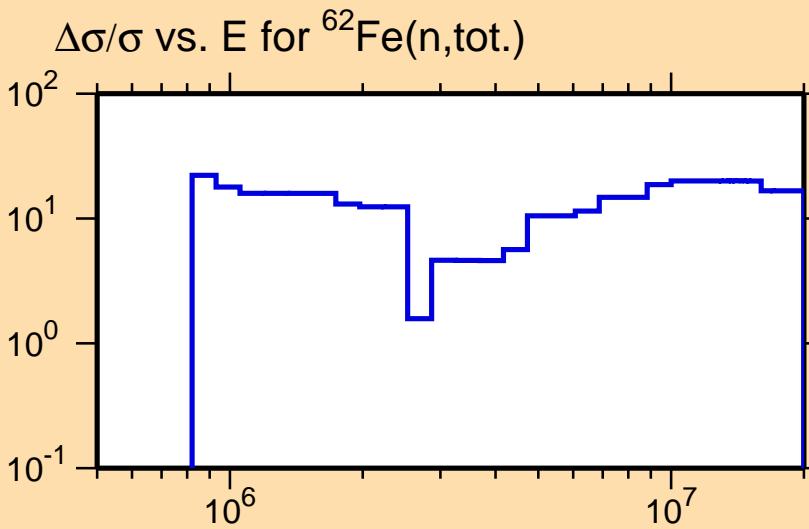


Correlation Matrix

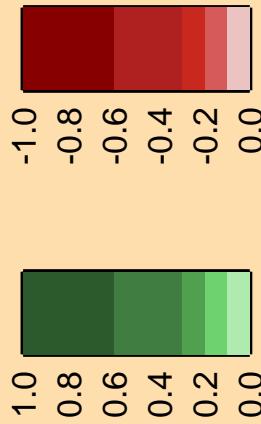


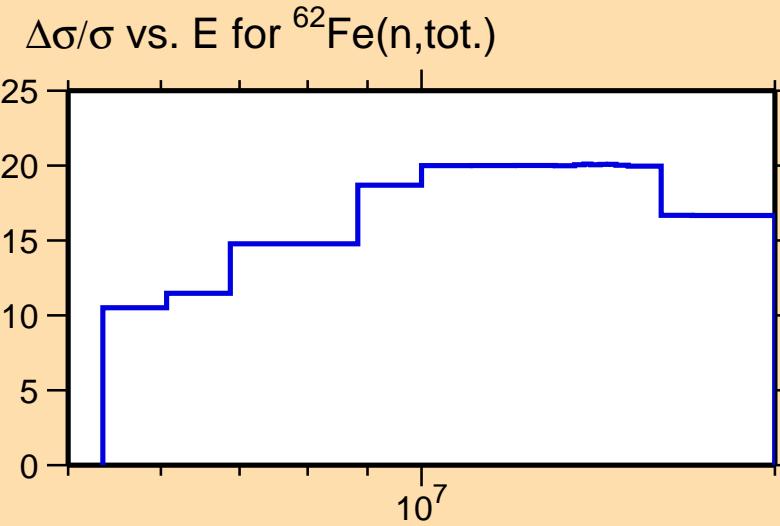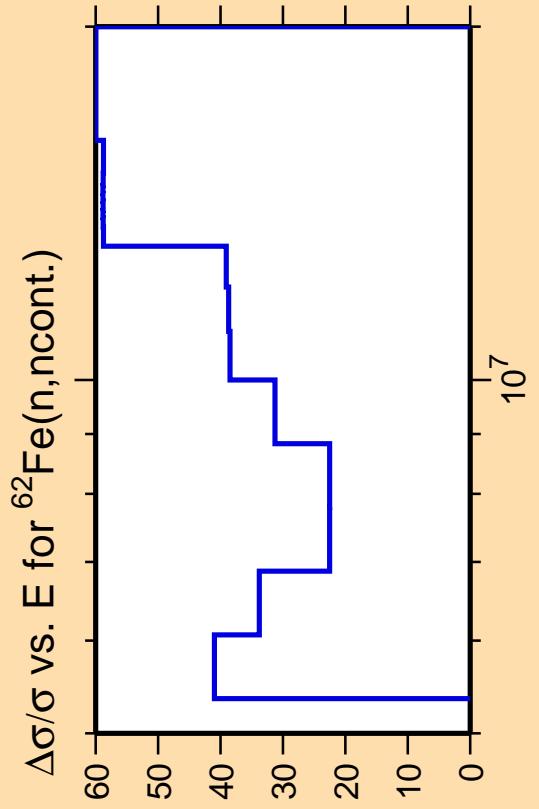


Correlation Matrix

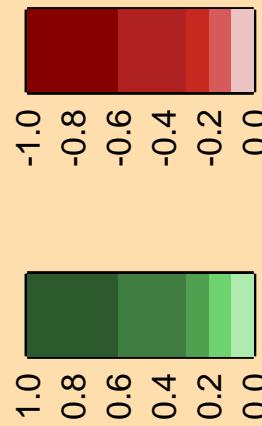


Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

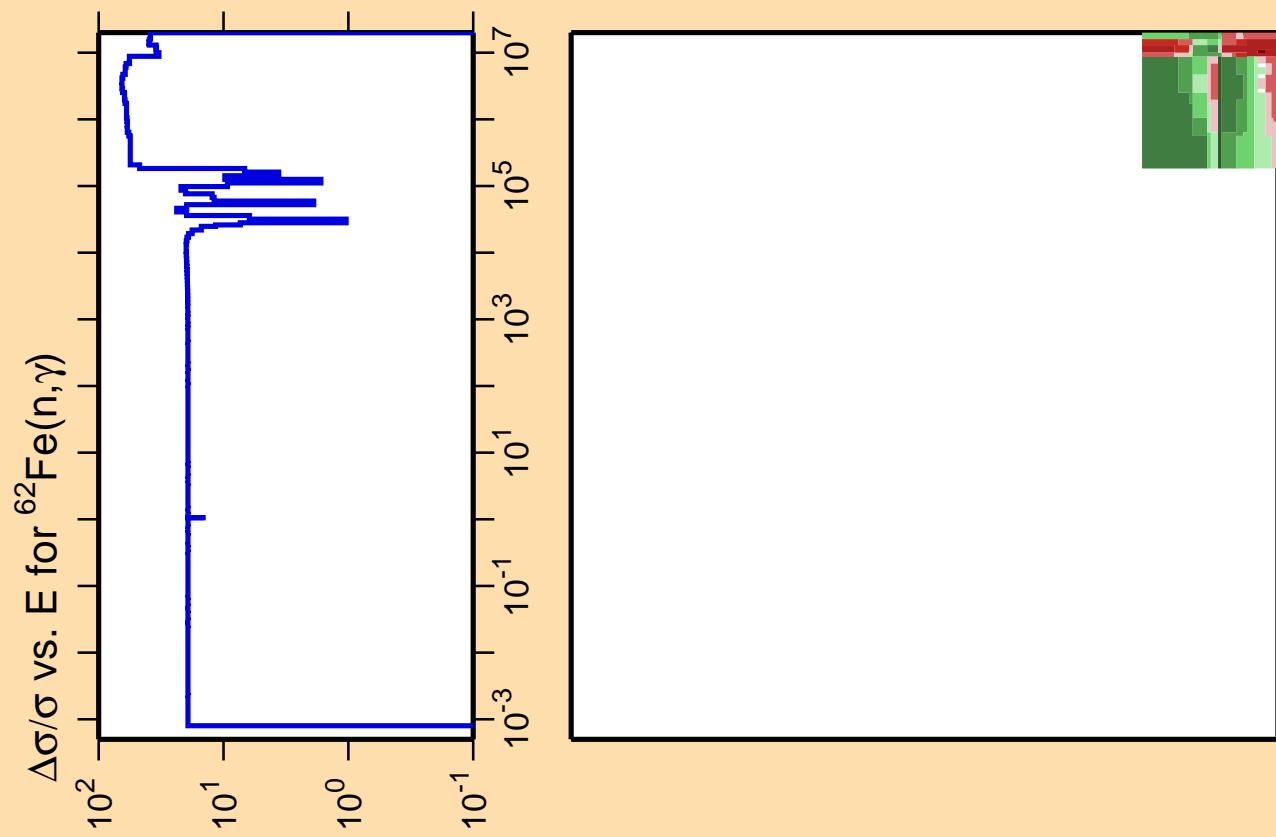

Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).

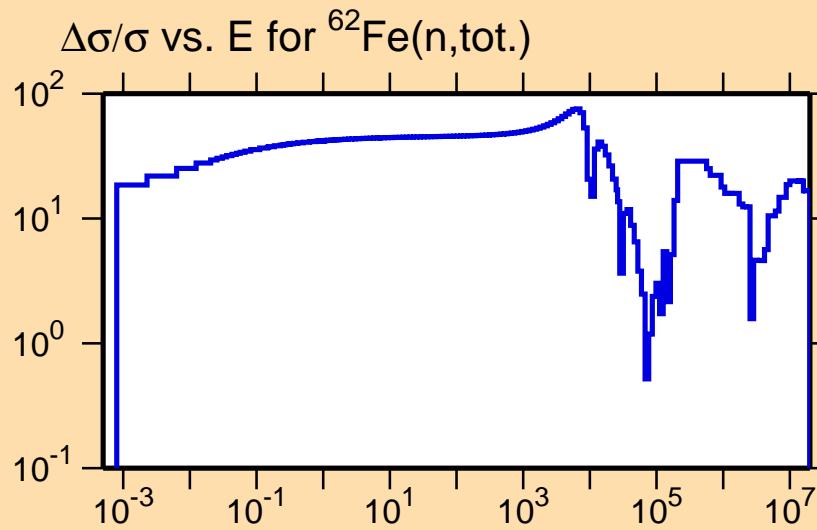

Correlation Matrix

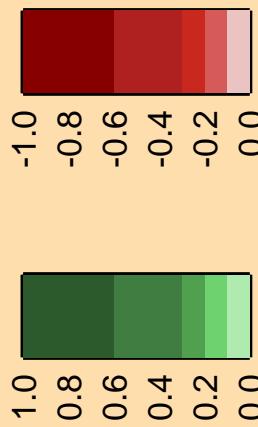


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{p})$


10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

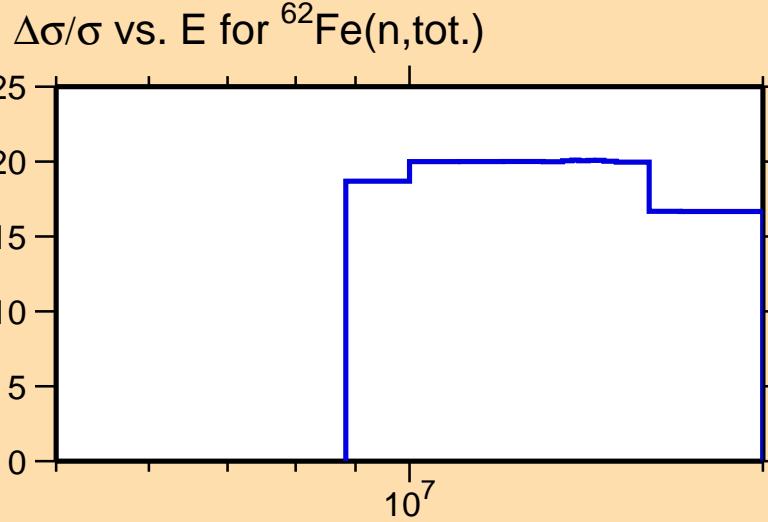

Correlation Matrix

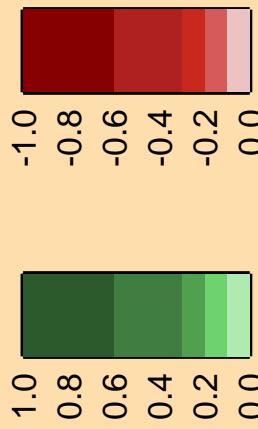


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\alpha)$

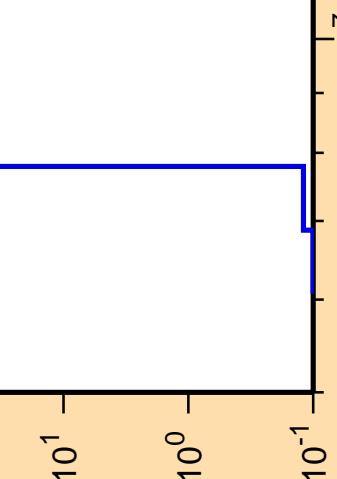


Ordinate scale is %  
relative standard deviation.



Abcissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

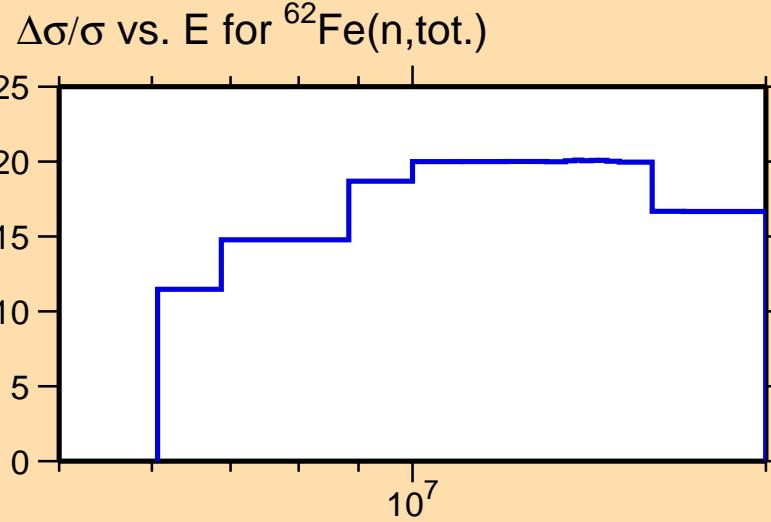

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{tot.})$

Correlation Matrix

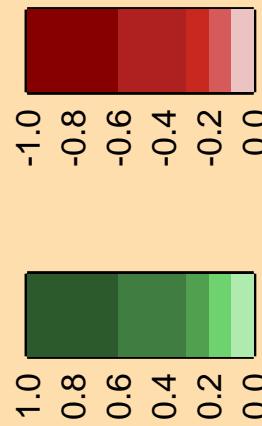


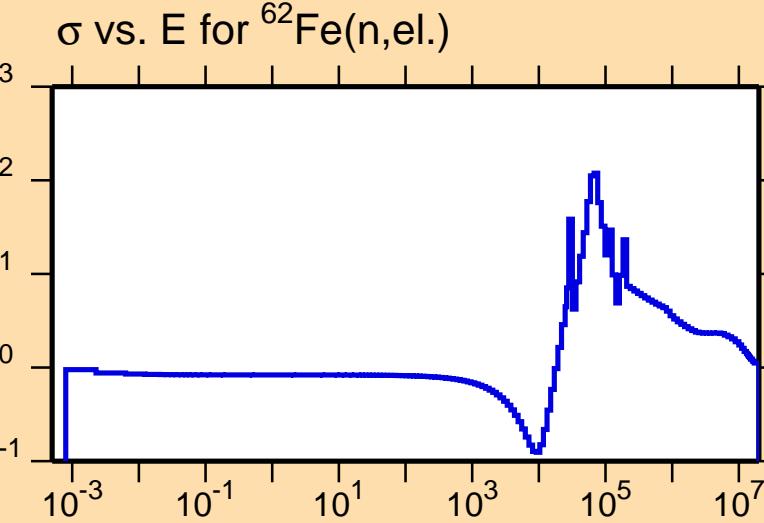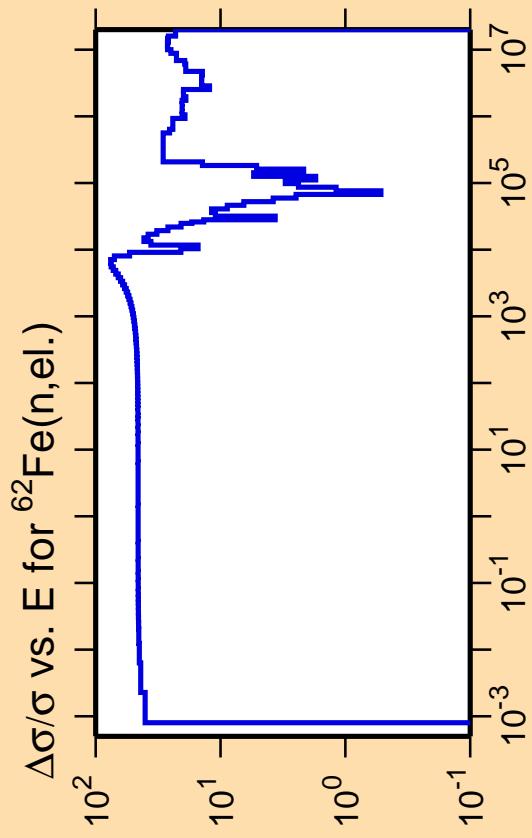


Ordinate scales are % relative  
standard deviation and barns.  
Abscissa scales are energy (eV).


Correlation Matrix



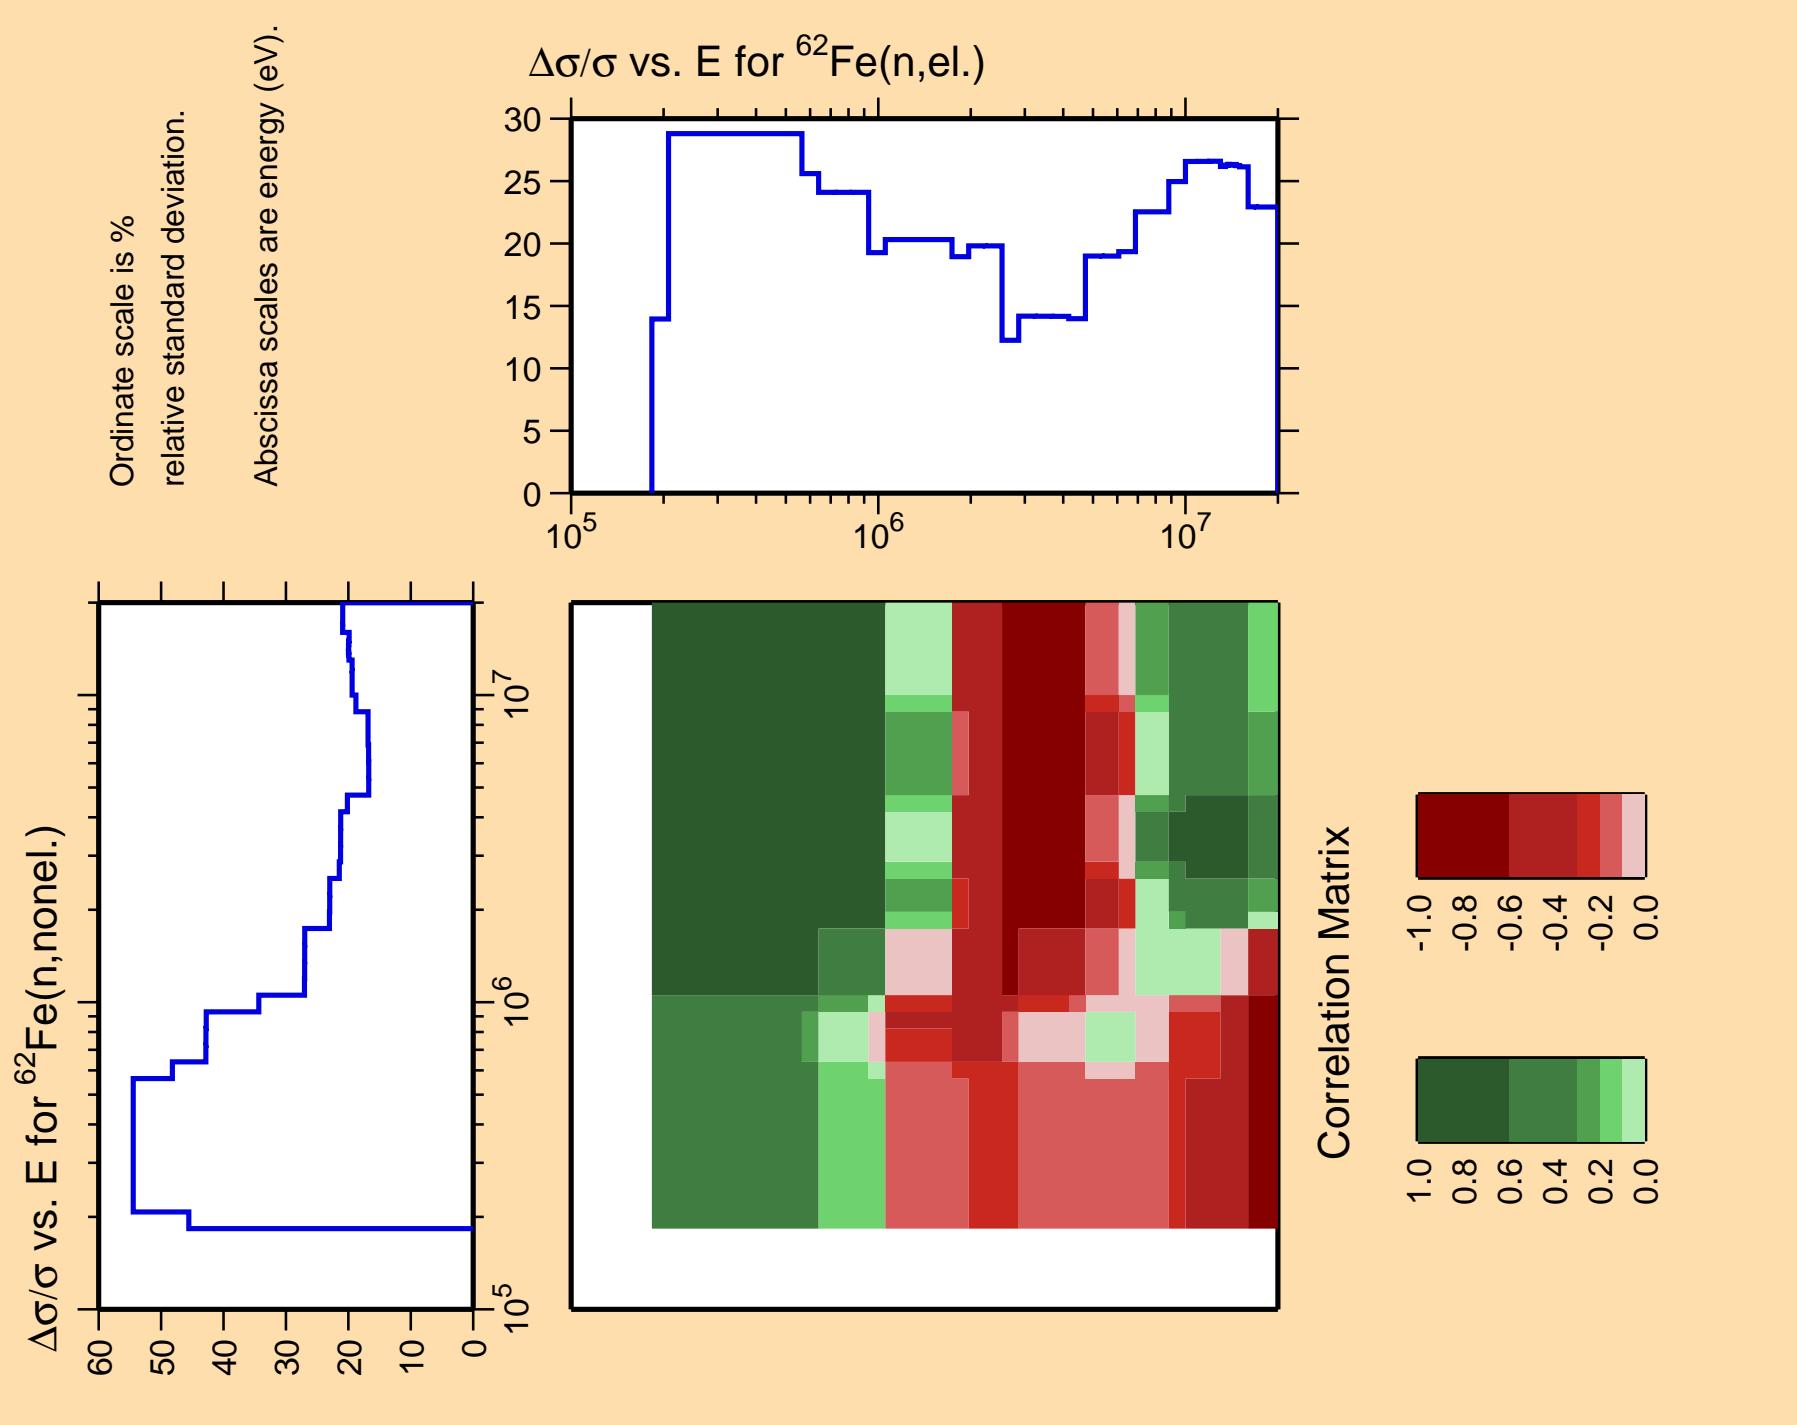

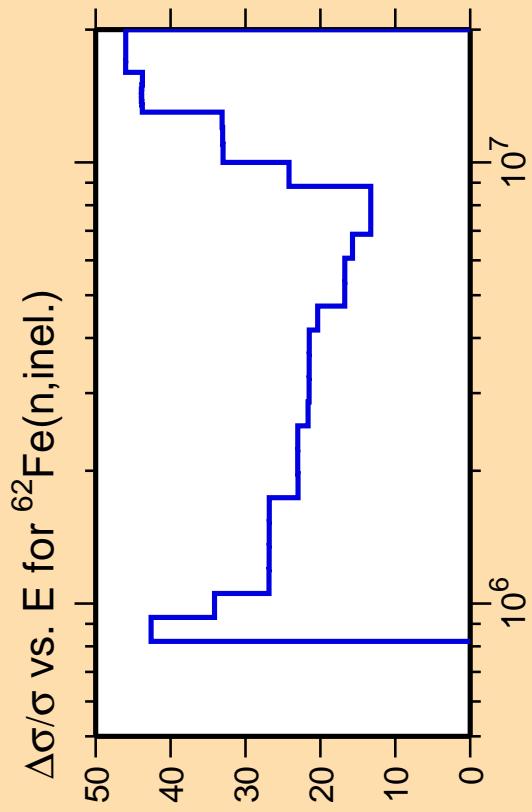

Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).

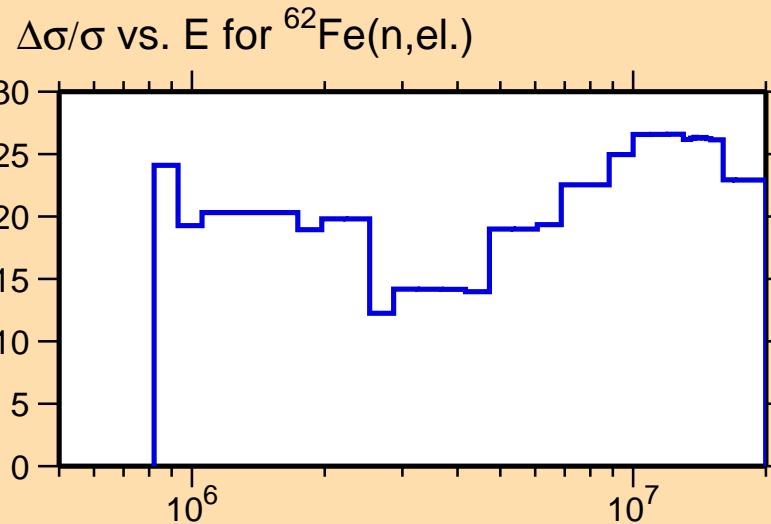

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,2n)$


Ordinate scale is %  
relative standard deviation.



Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{el.})$

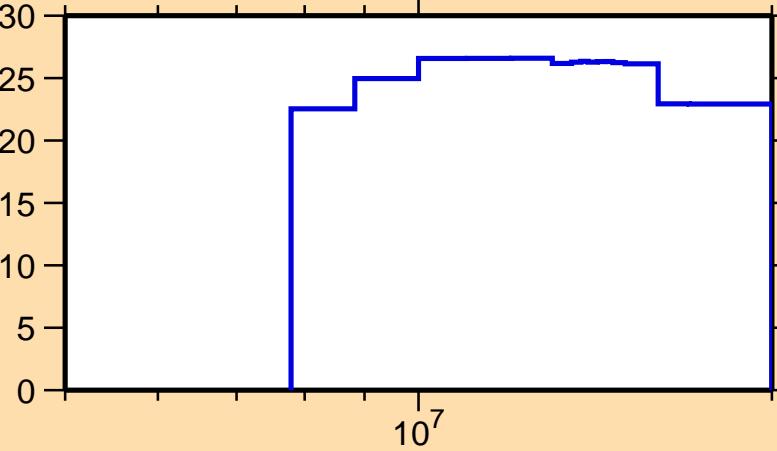


Correlation Matrix


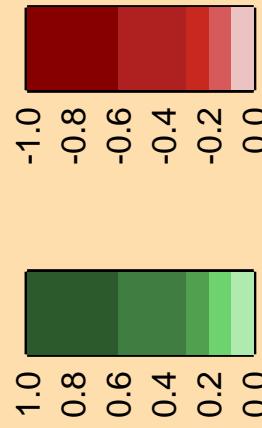


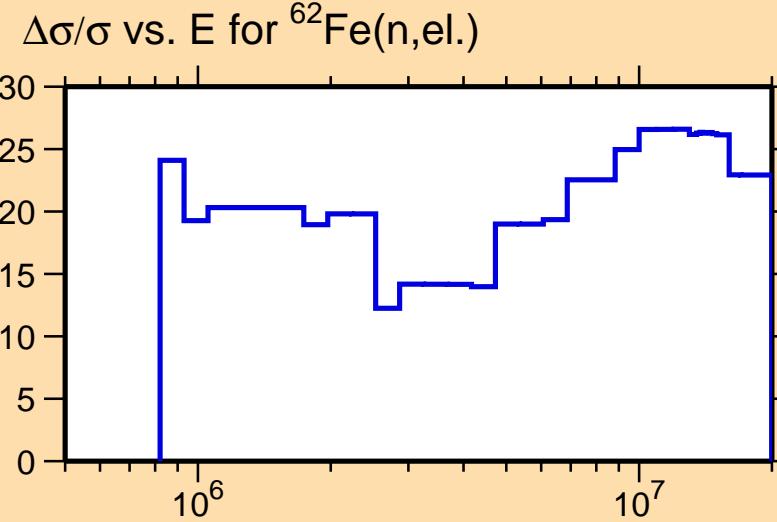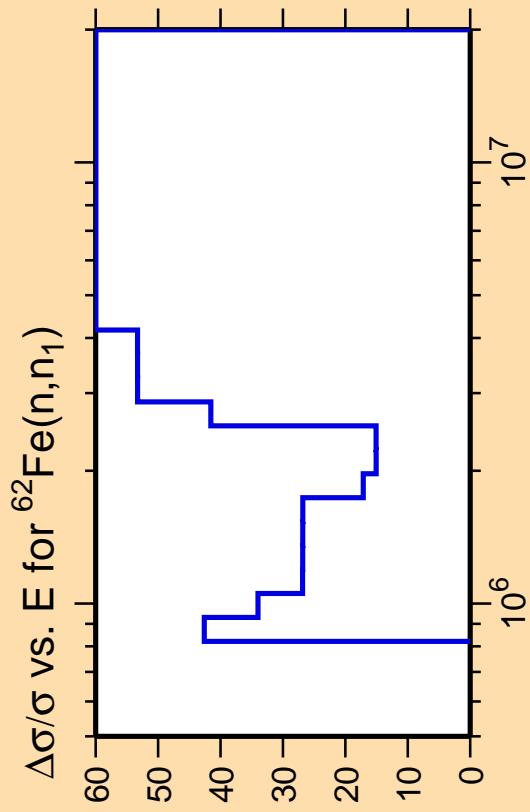

Correlation Matrix

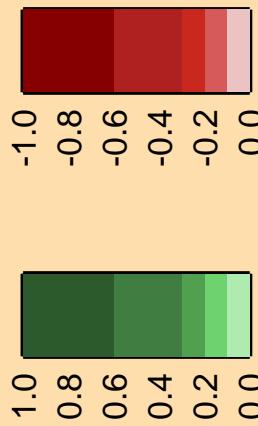


Ordinate scale is % relative standard deviation.  
Abscissa scales are energy (eV).  
Warning: some uncertainty data were suppressed.

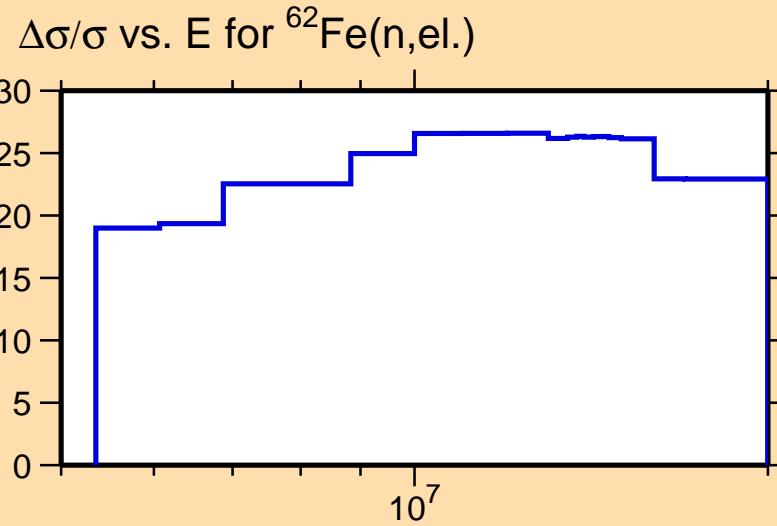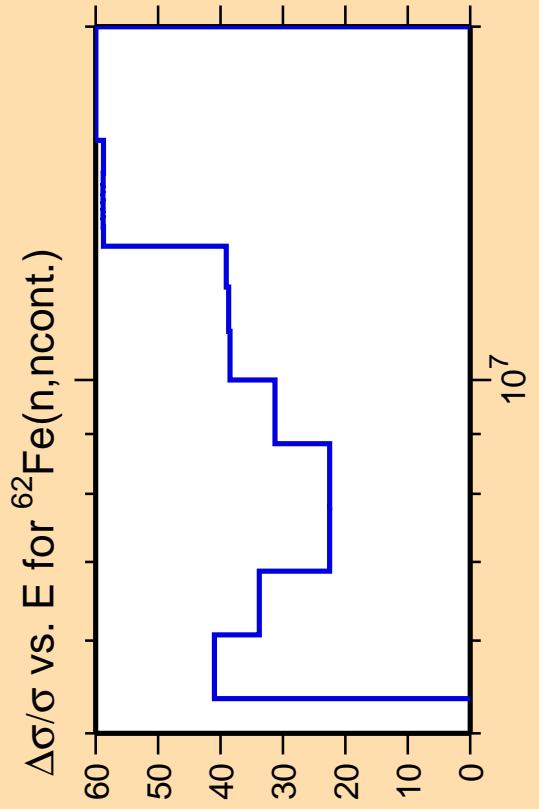


Correlation Matrix



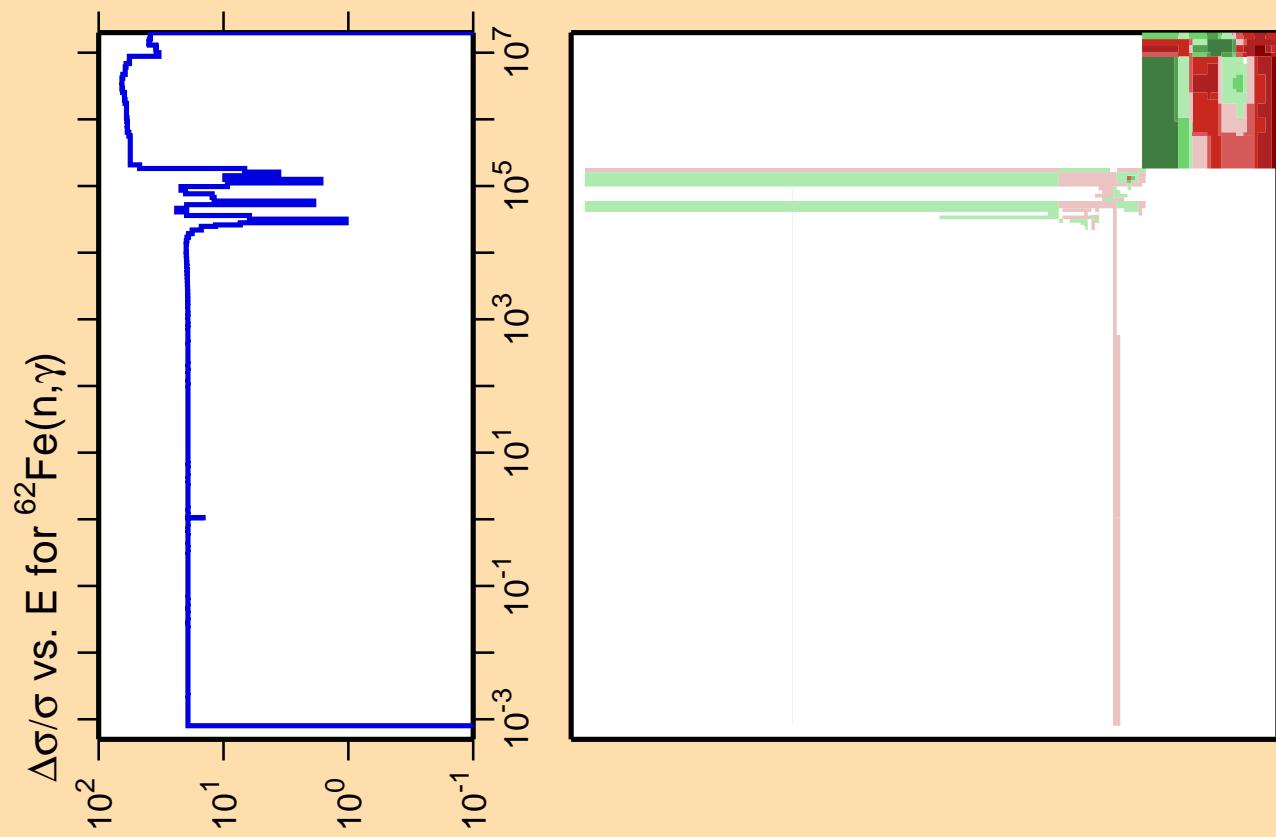

Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).

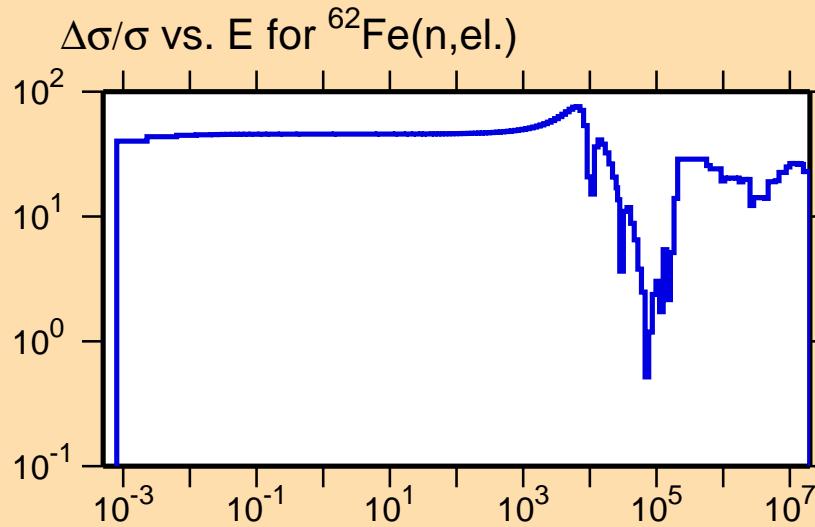

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{p})$


10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

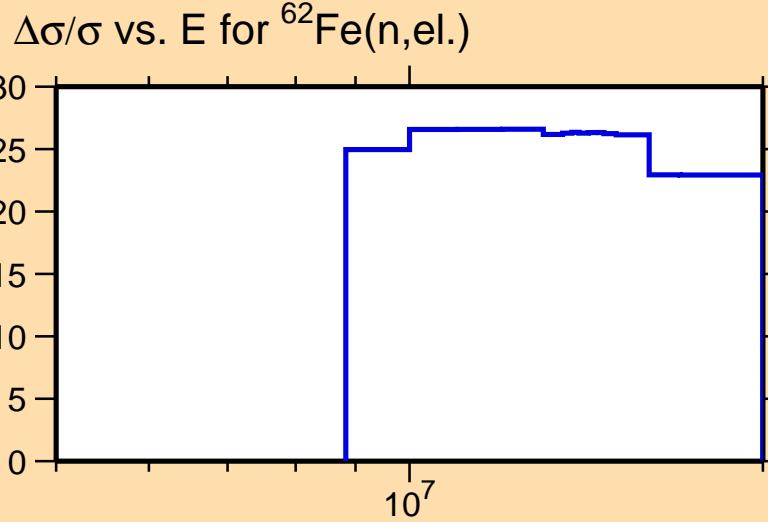

Correlation Matrix

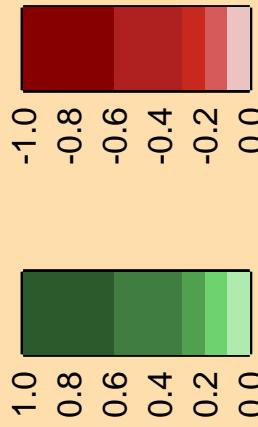


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\alpha)$

10<sup>2</sup>  
10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>


10<sup>7</sup>


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

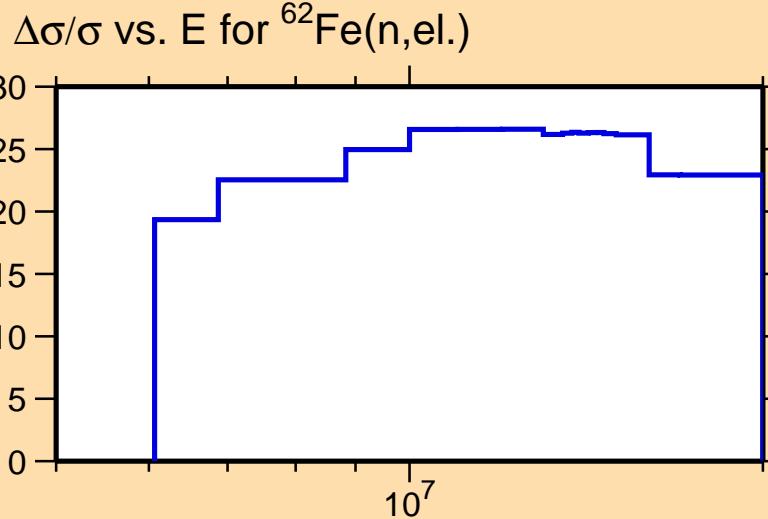


Correlation Matrix

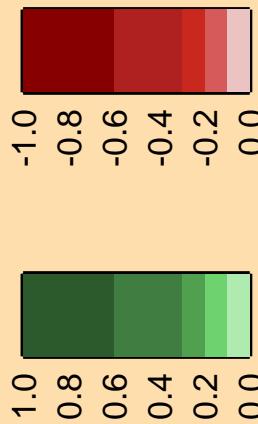

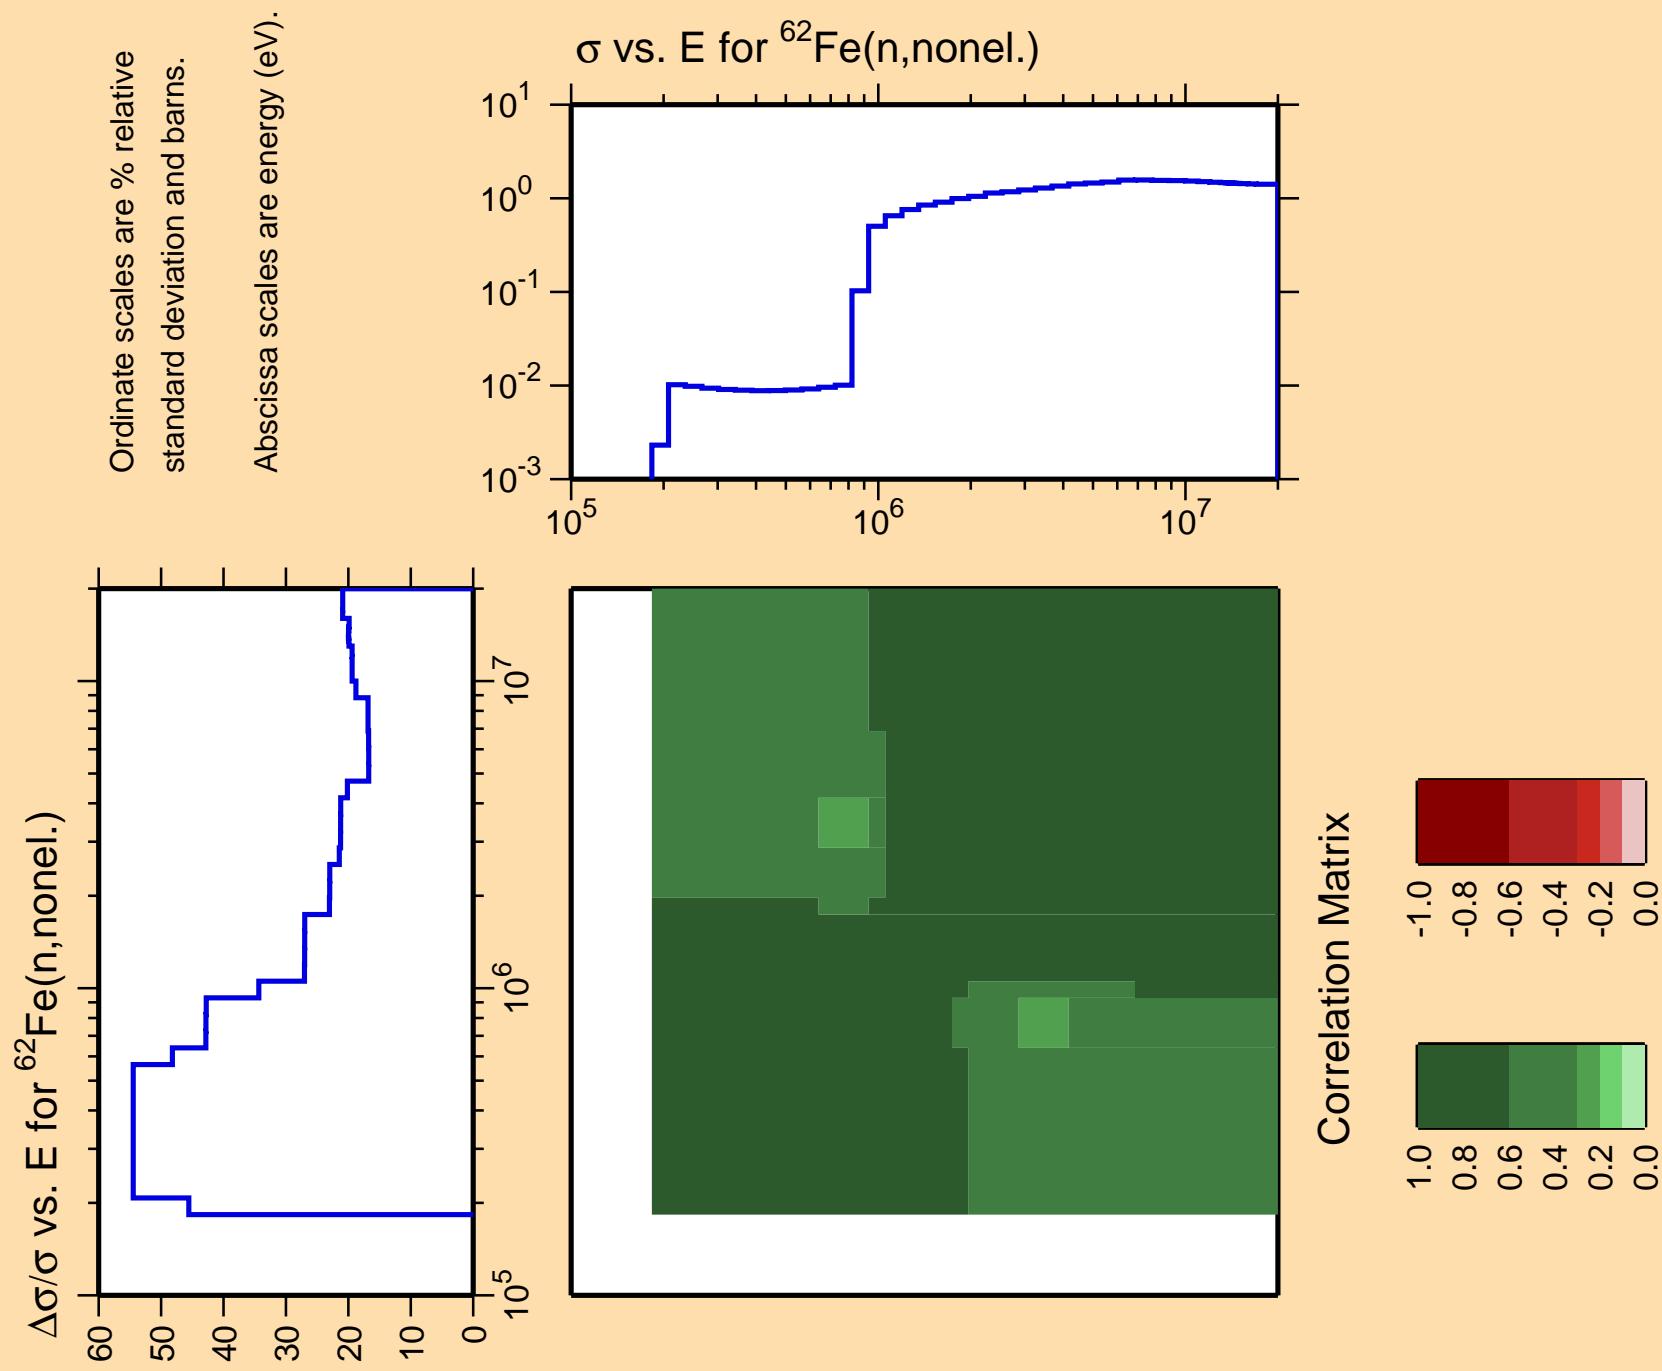

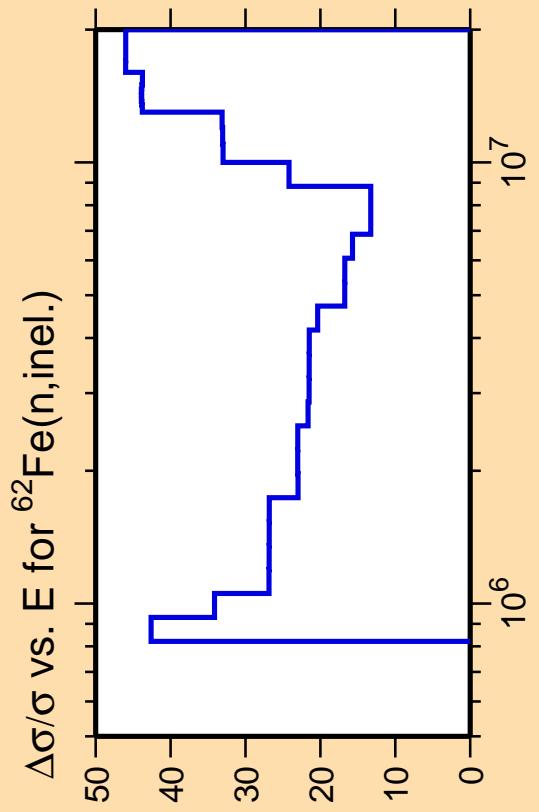


Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).

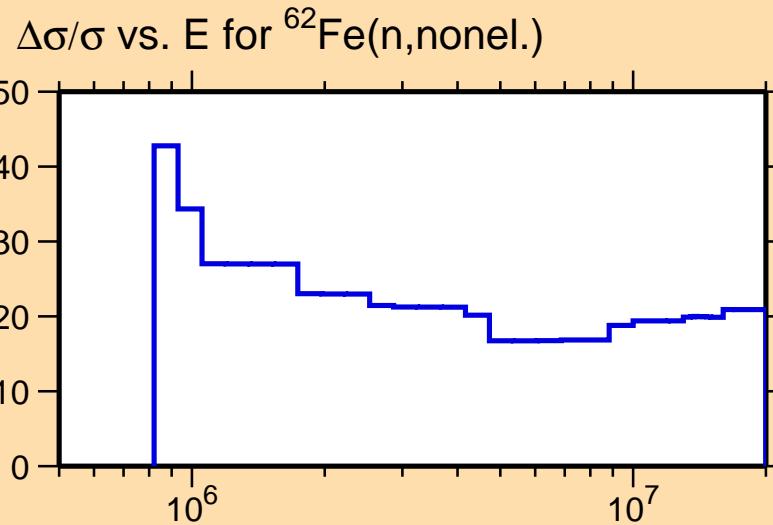

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,2n)$

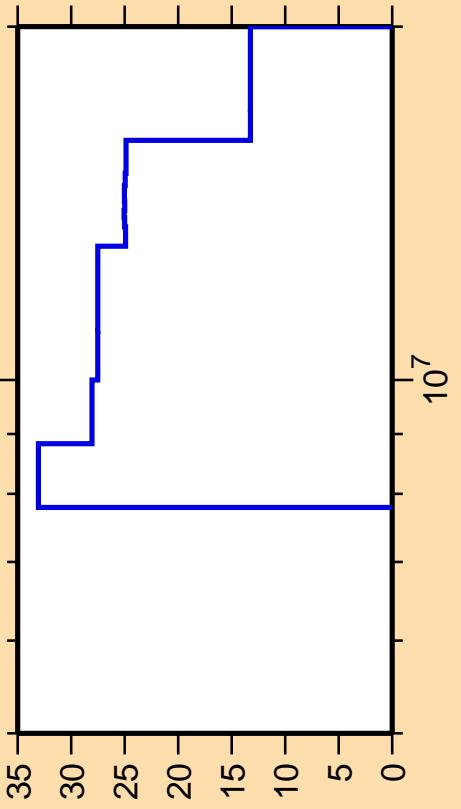

Ordinate scale is %  
relative standard deviation.



Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{nonel.})$

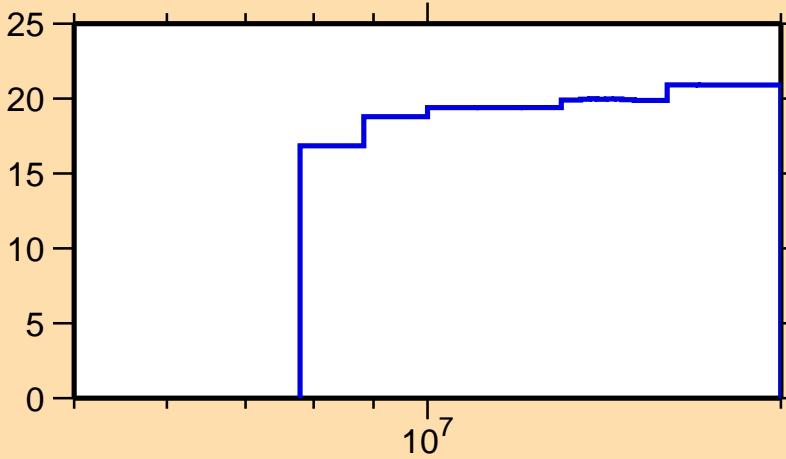


Correlation Matrix




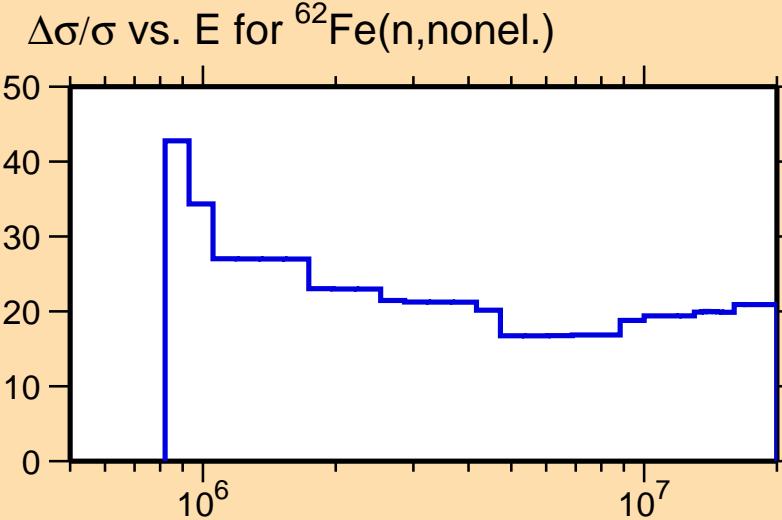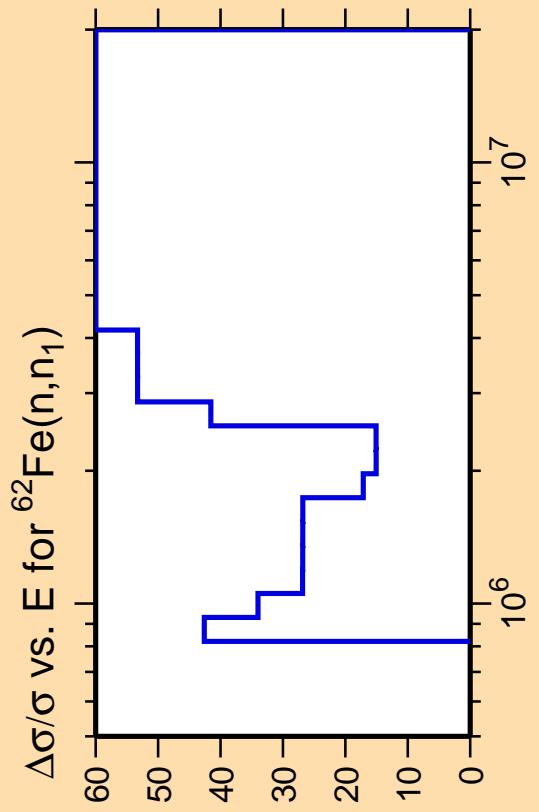

Correlation Matrix

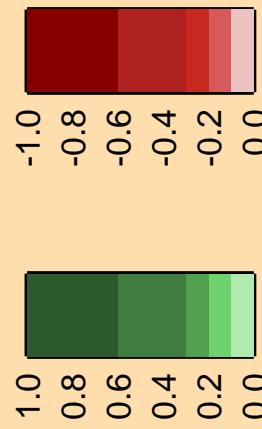


Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

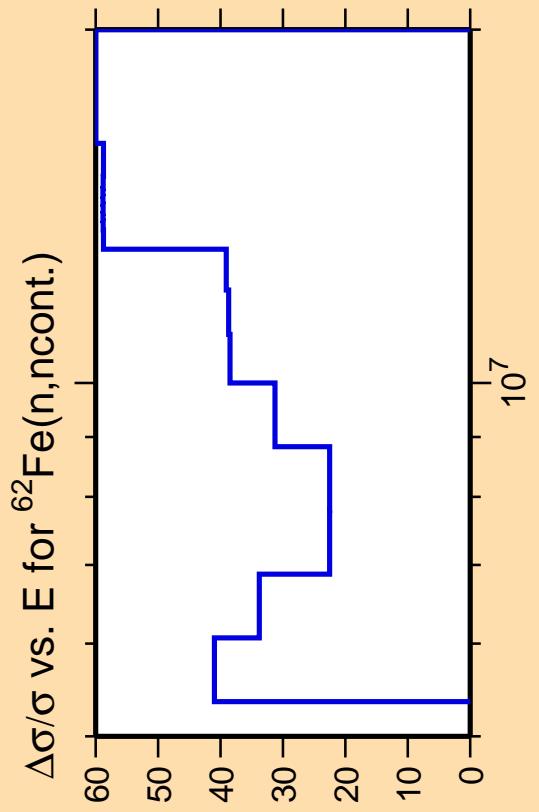



Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

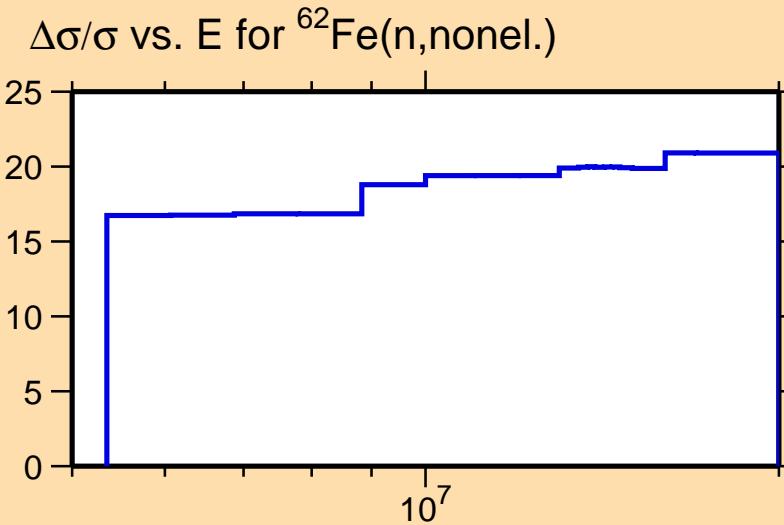


Correlation Matrix



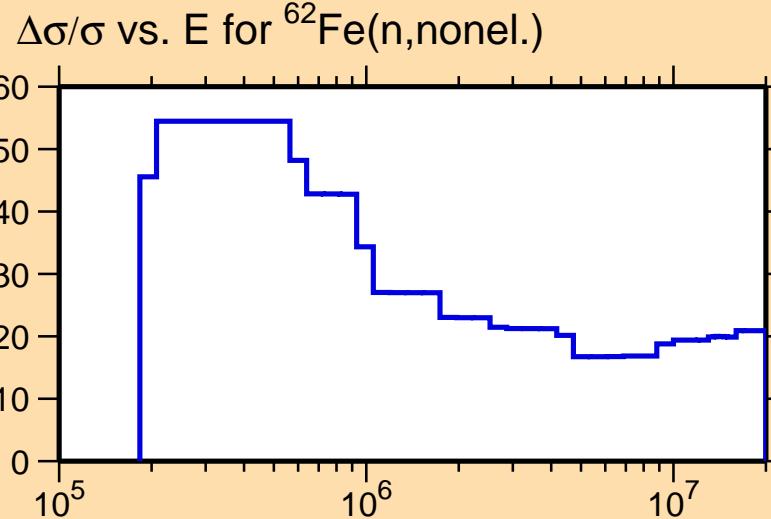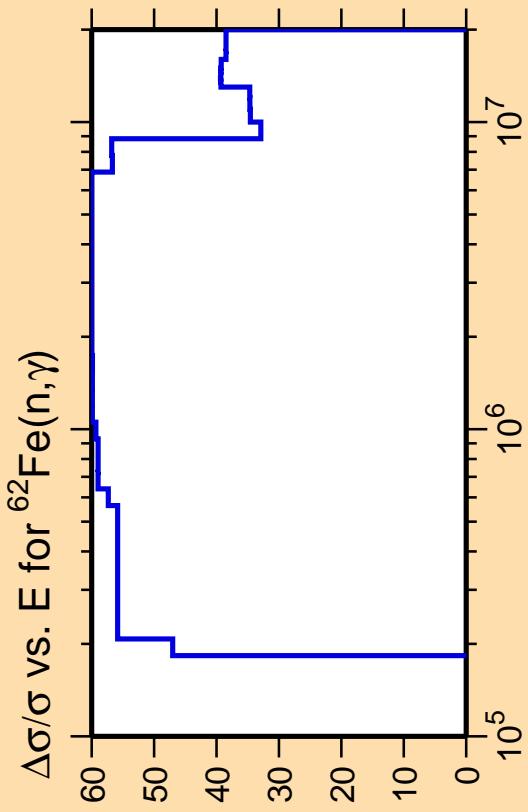



Correlation Matrix

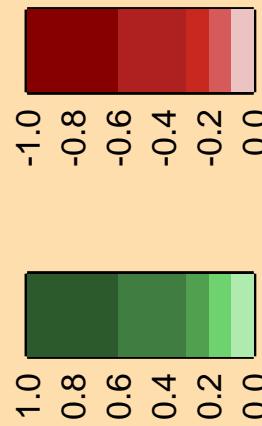

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

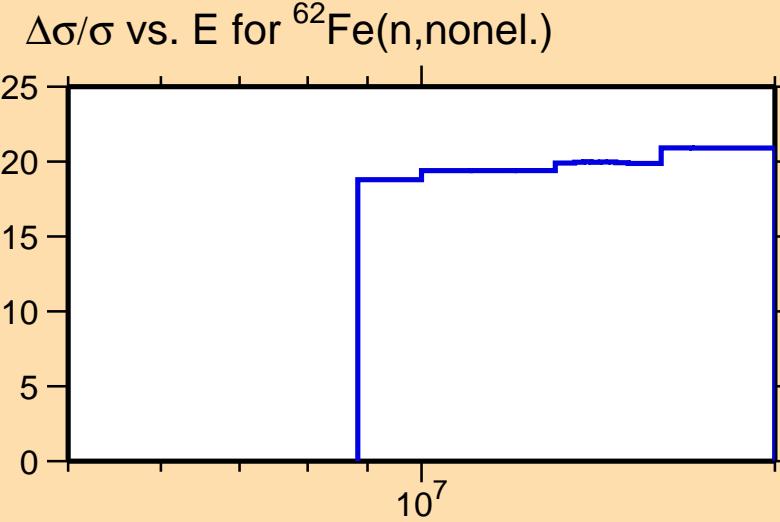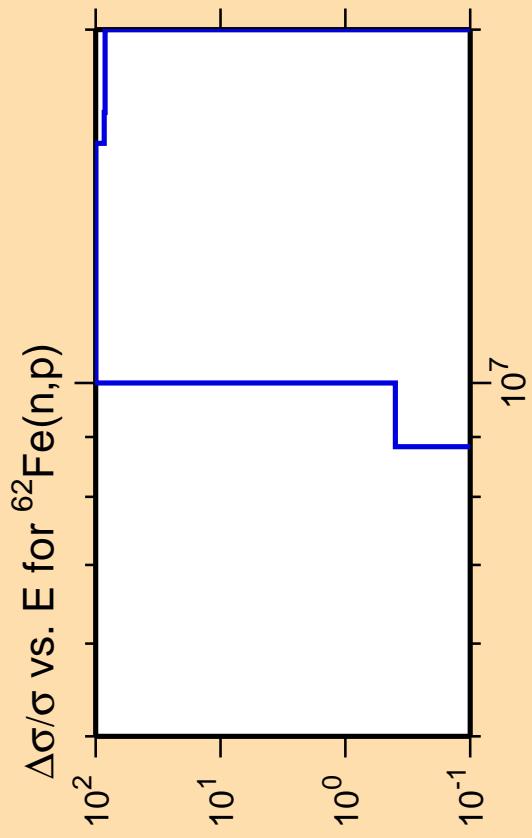

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

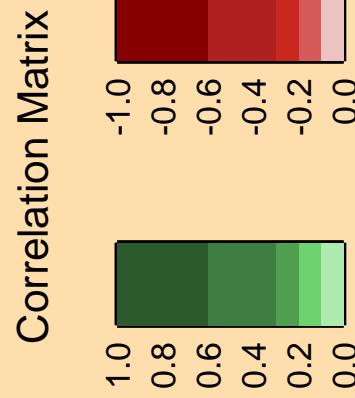

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\alpha)$


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

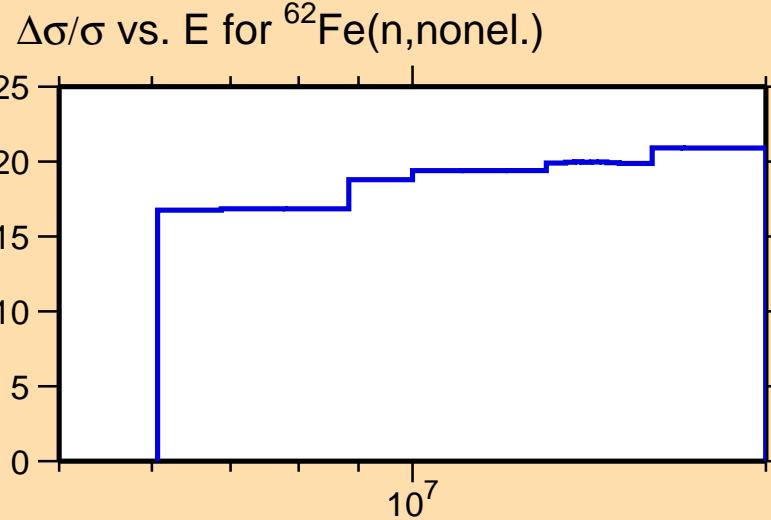


Correlation Matrix



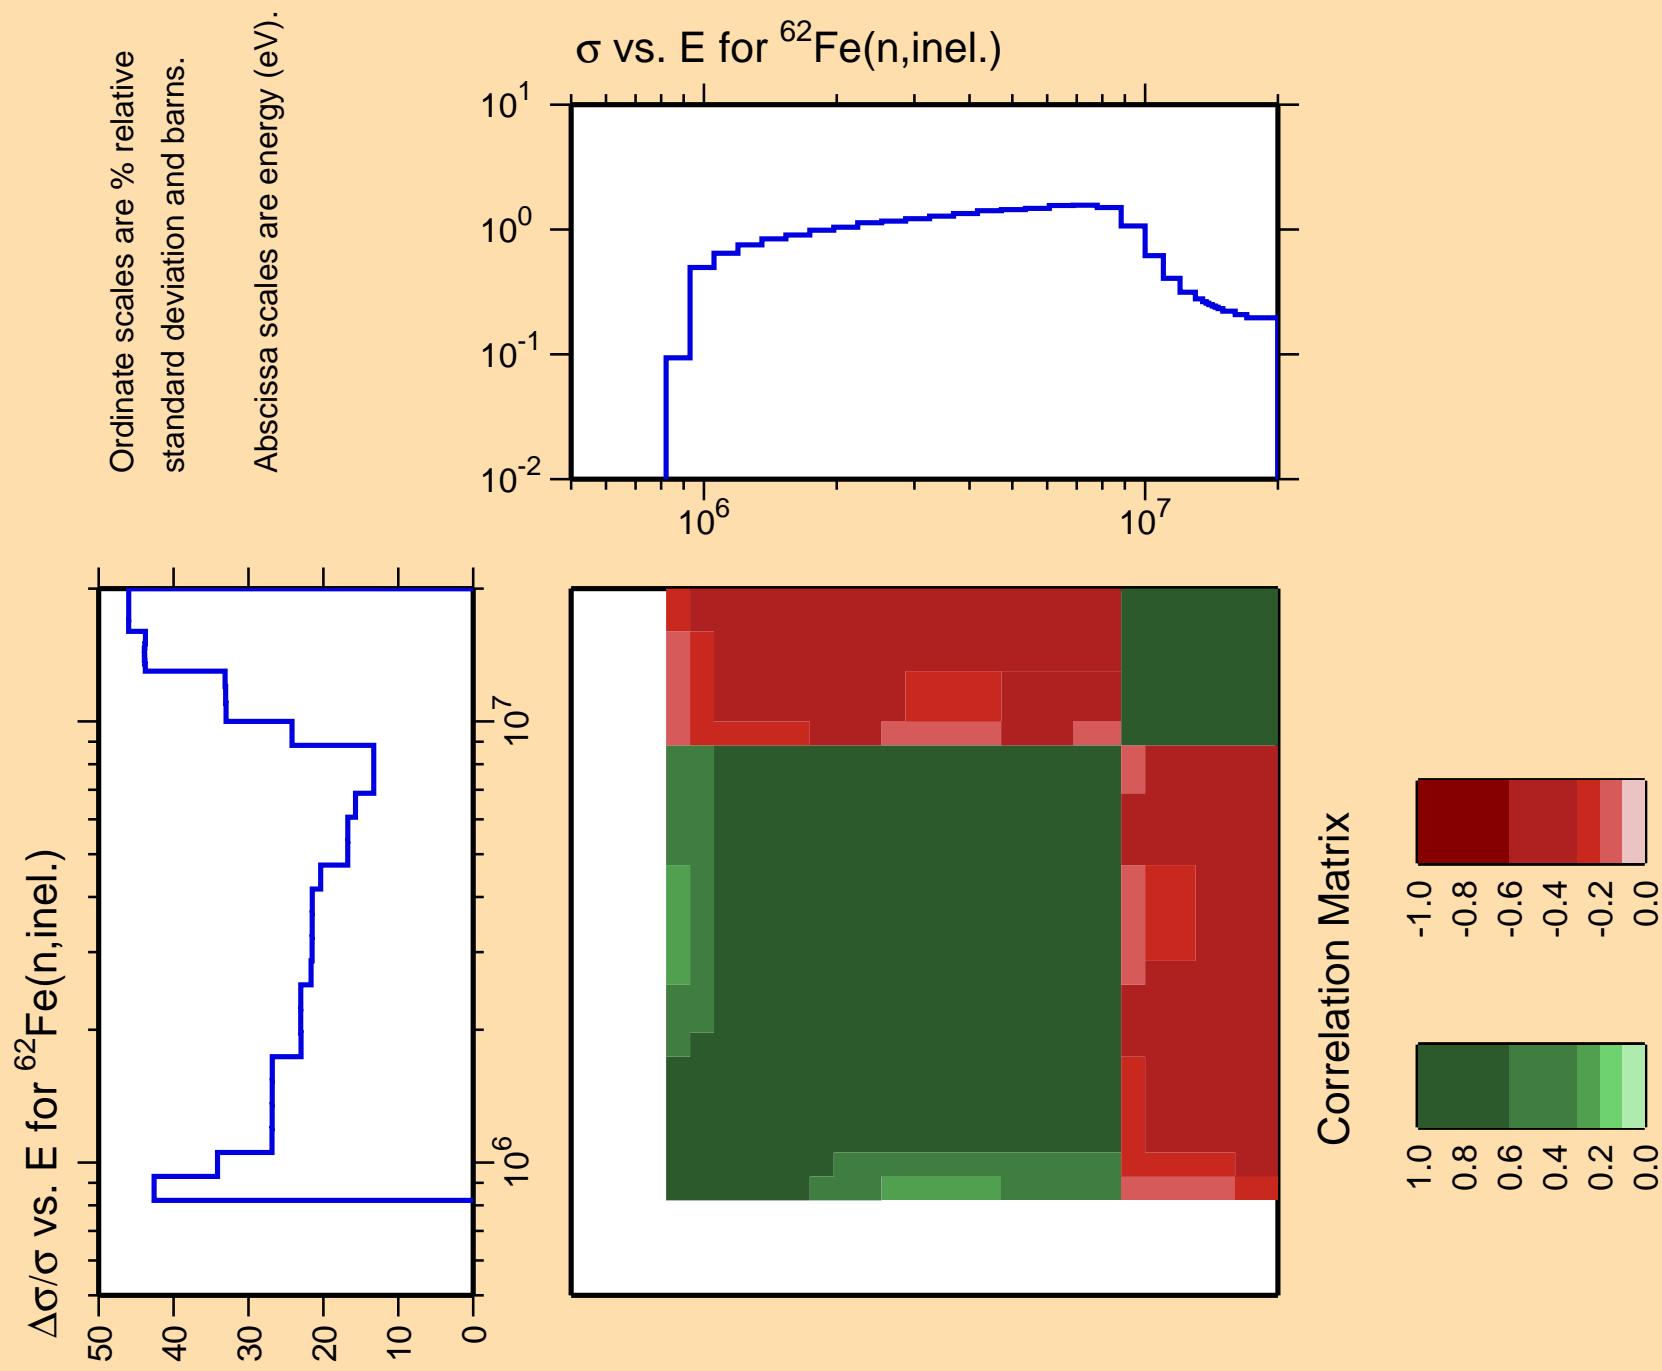


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,2n)$

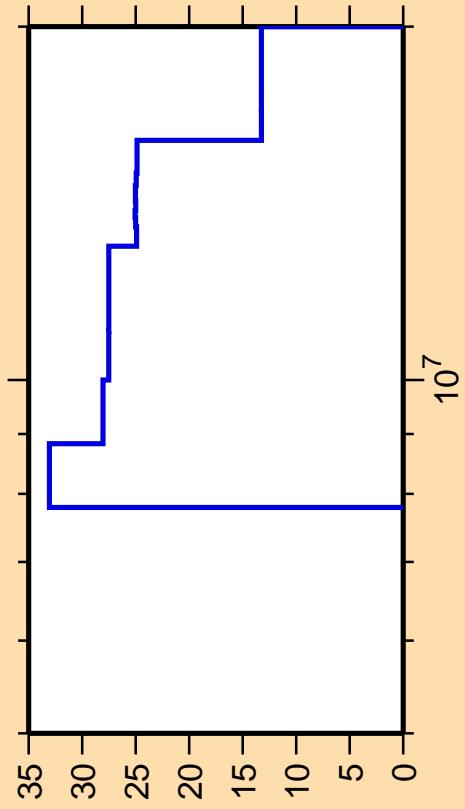

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{inel.})$

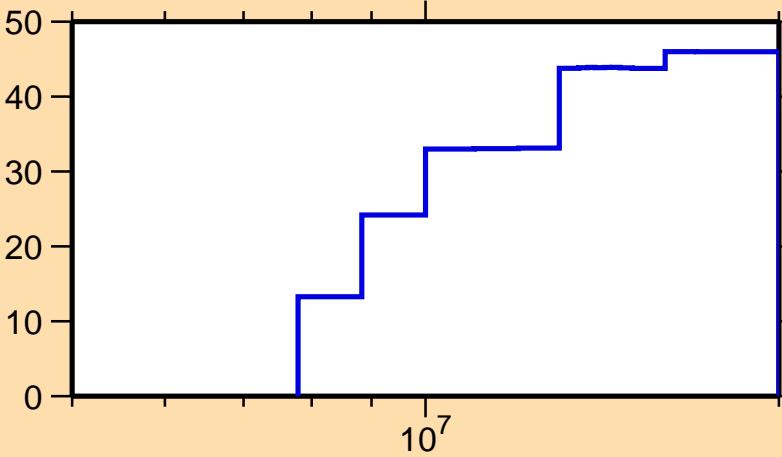


Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,n_1)$


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.


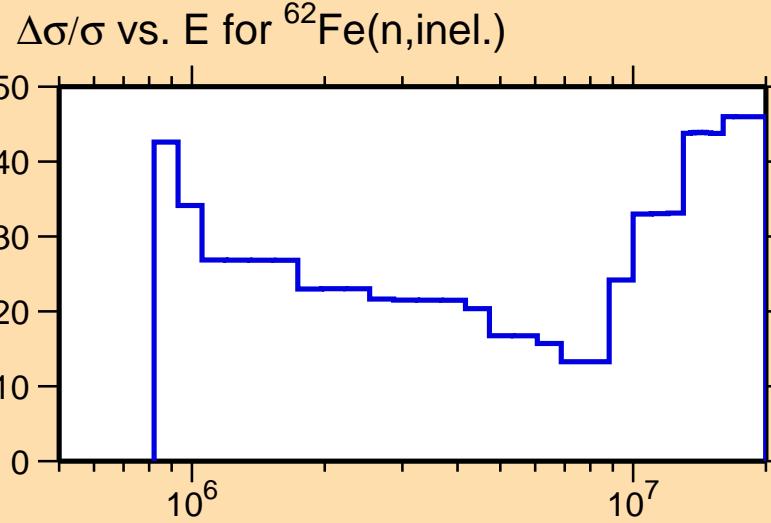




Correlation Matrix

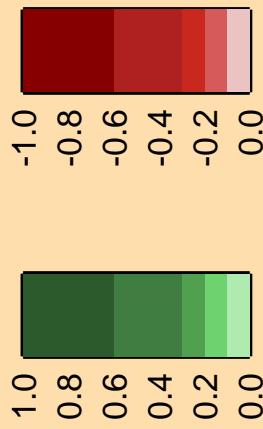

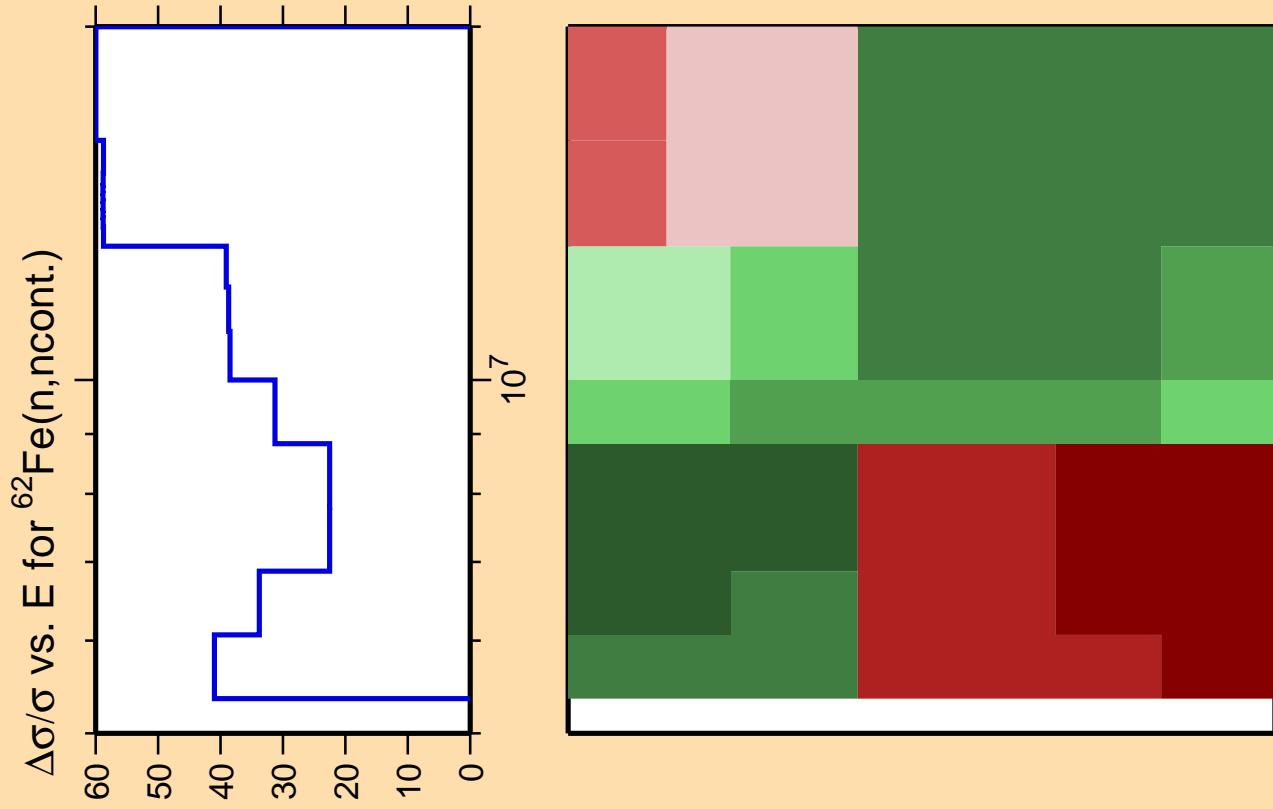


Correlation Matrix

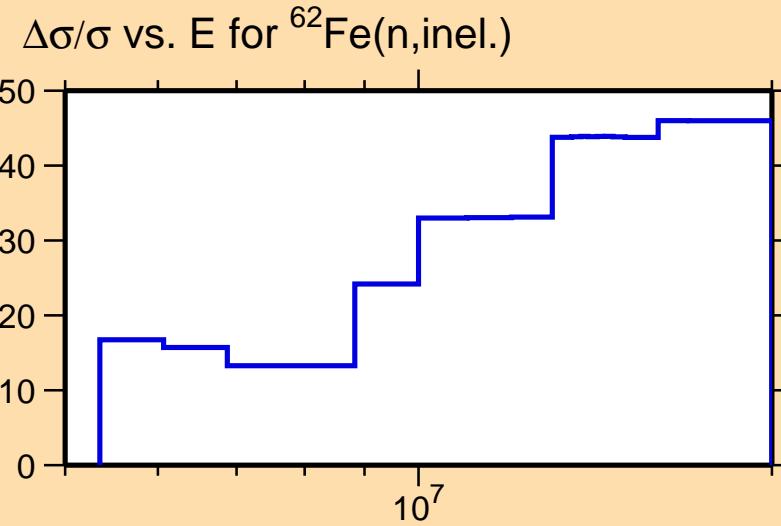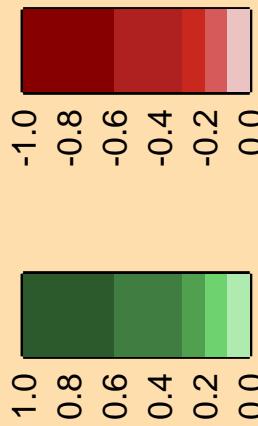

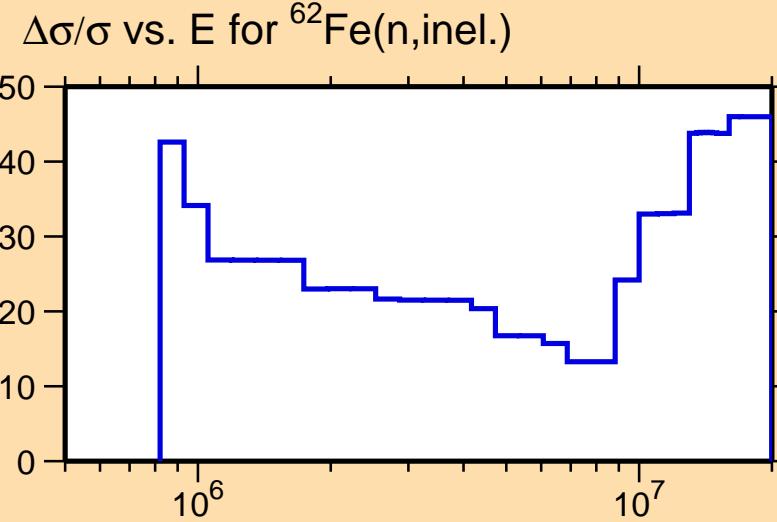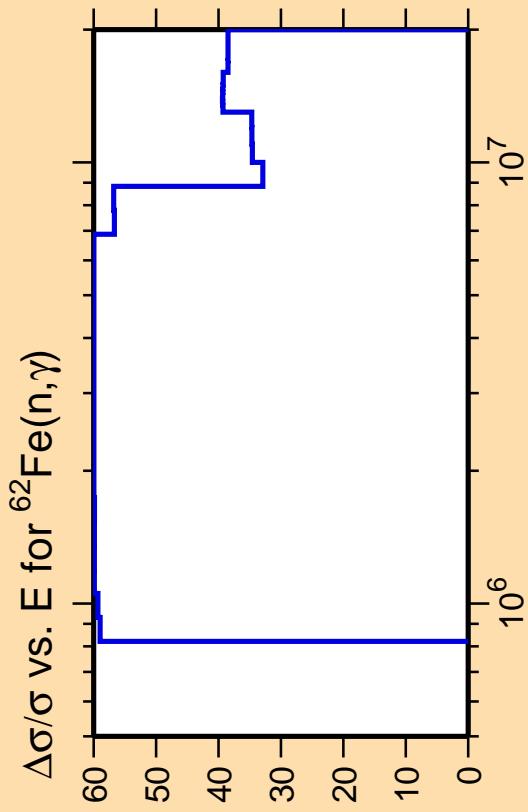

Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

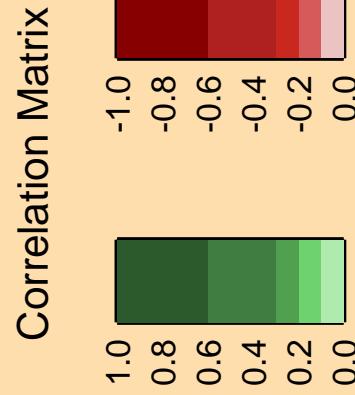

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{p})$

10<sup>2</sup>  
10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>

10<sup>7</sup>

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n,inel.})$

50  
40  
30  
20  
10  
0

10<sup>7</sup>


Correlation Matrix

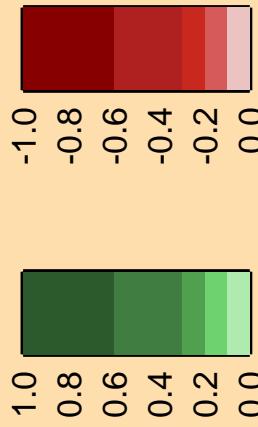

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\alpha)$

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

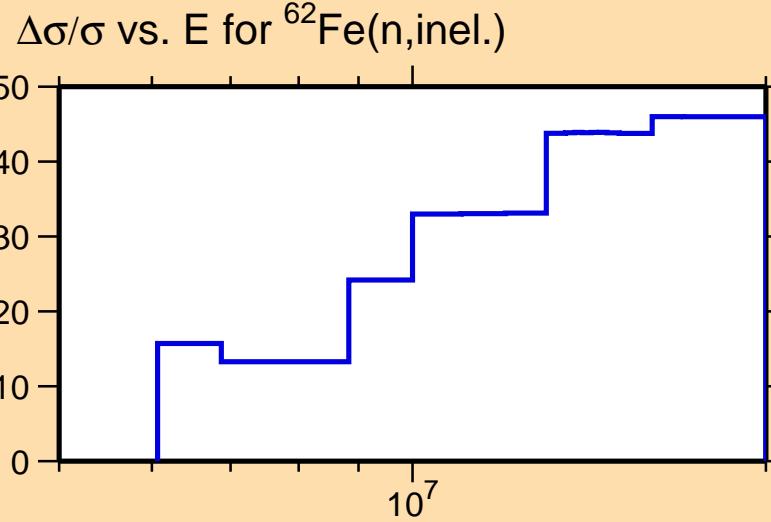


Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,2n)$

Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).

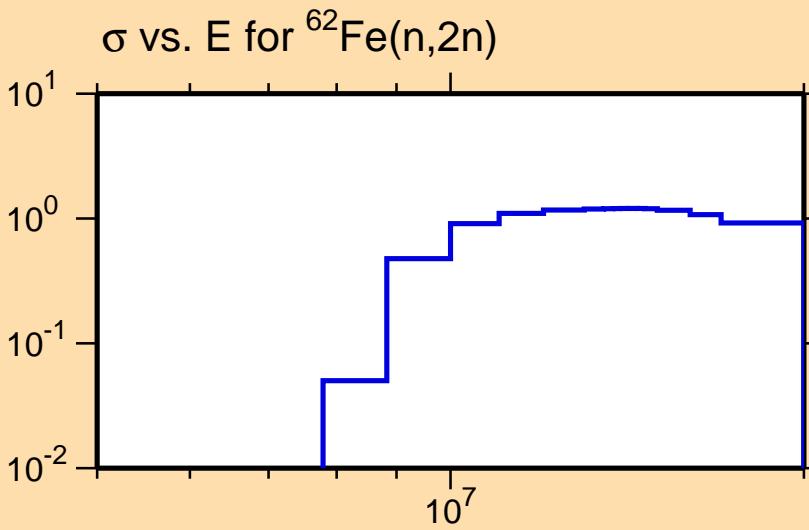

Correlation Matrix

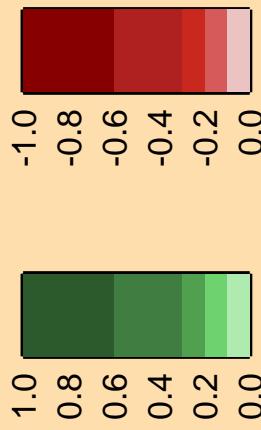


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,n_1)$

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).



Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,2n)$

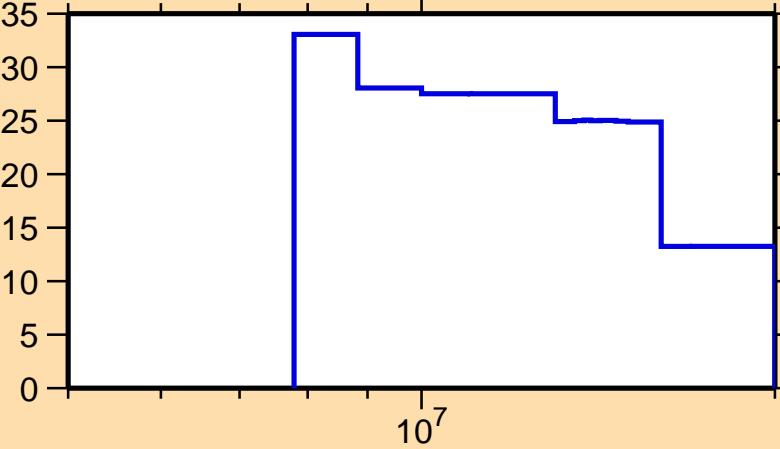


Correlation Matrix



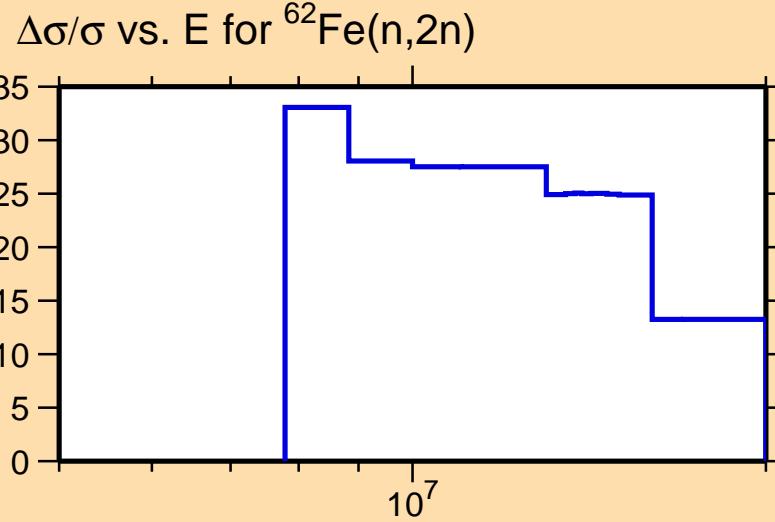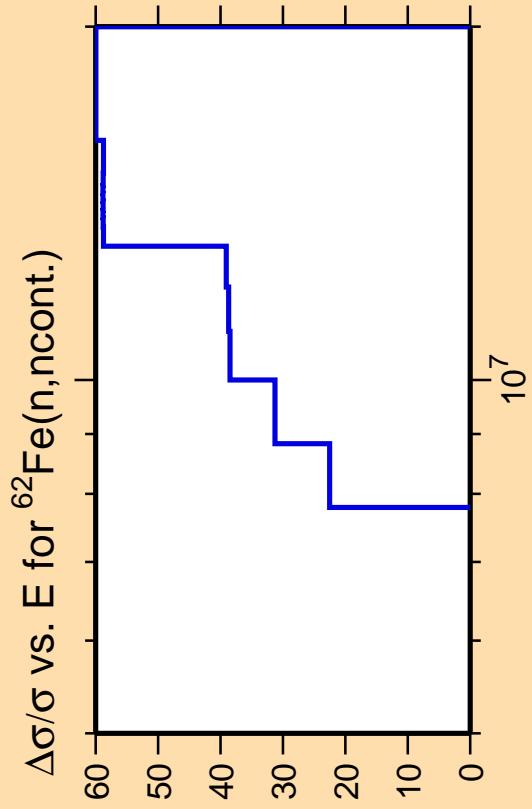

Correlation Matrix

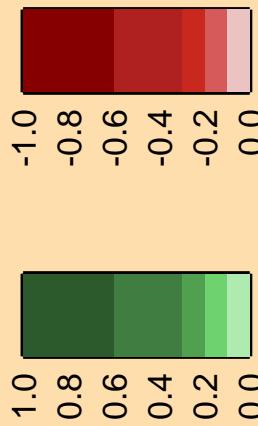


Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\gamma)$


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,2n)$

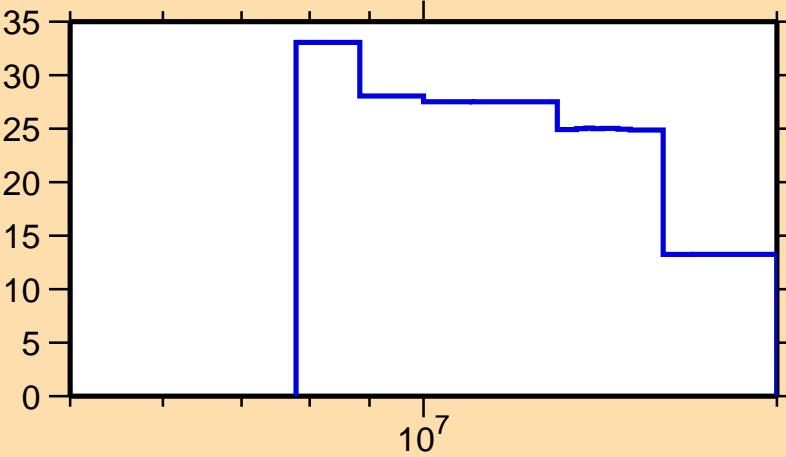

Correlation Matrix

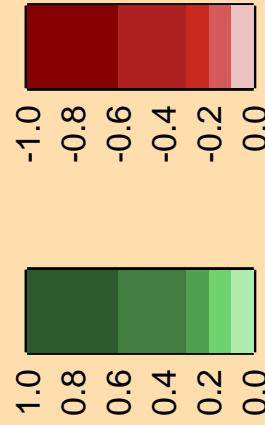


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{p})$

10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},2\text{n})$

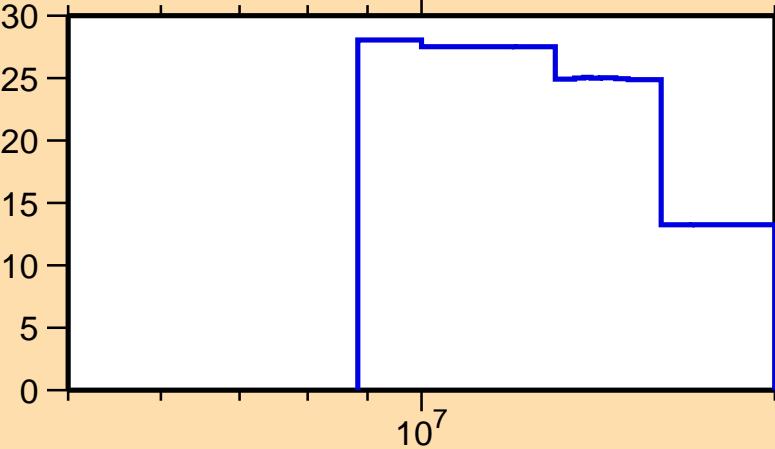


Correlation Matrix

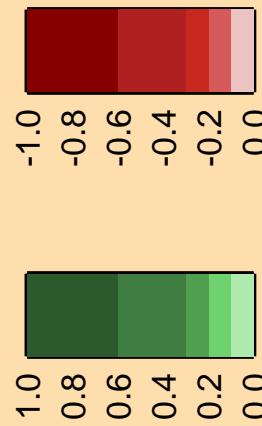

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\alpha)$

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

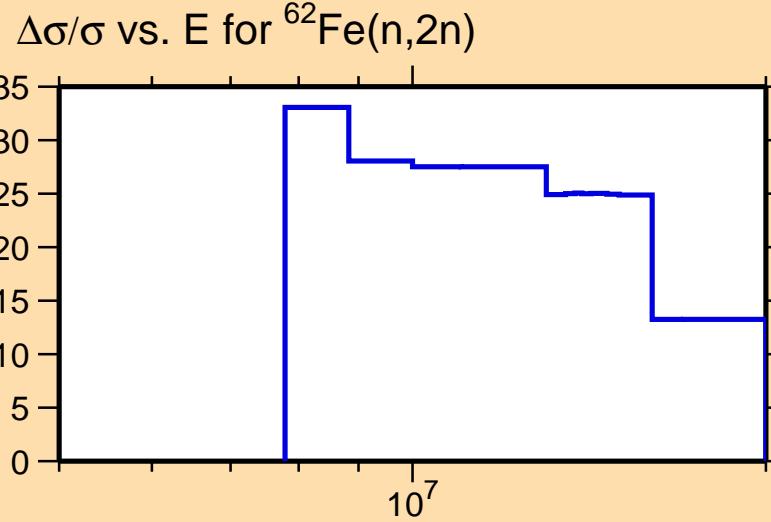


Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,3n)$

Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).

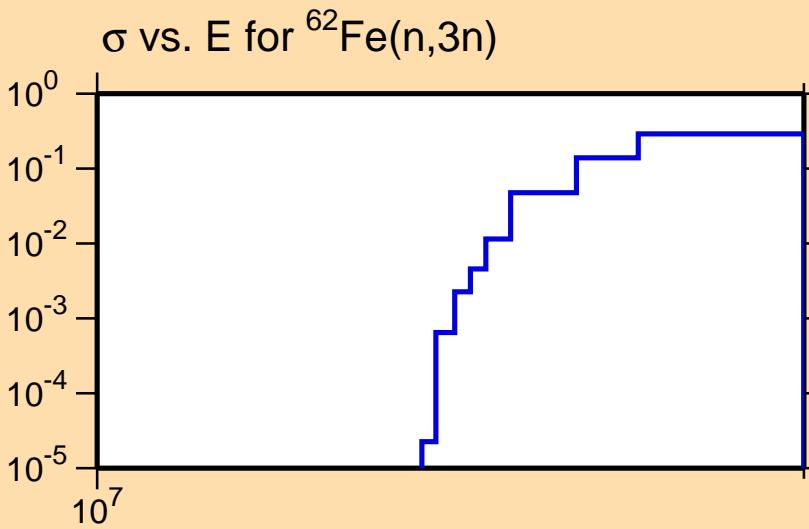

Correlation Matrix

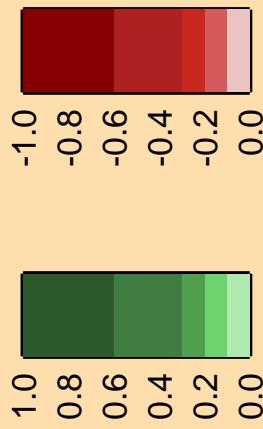

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\alpha)$

10<sup>2</sup>  
10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>

Ordinate scales are % relative  
standard deviation and barns.


Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

$10^{-4}$   
 $10^{-6}$   
 $10^{-8}$   
 $10^{-10}$   
 $10^{-12}$

$\sigma$  vs. E for  $^{62}\text{Fe}(n,\alpha)$

$10^7$

Correlation Matrix

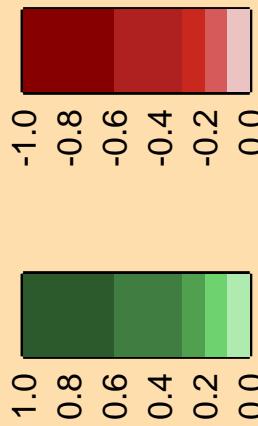

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{np})$

10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>  
10<sup>7</sup>


Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

10<sup>-3</sup>  
10<sup>-5</sup>  
10<sup>-7</sup>  
10<sup>-9</sup>  
10<sup>-11</sup>  
10<sup>7</sup>

$\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{np})$

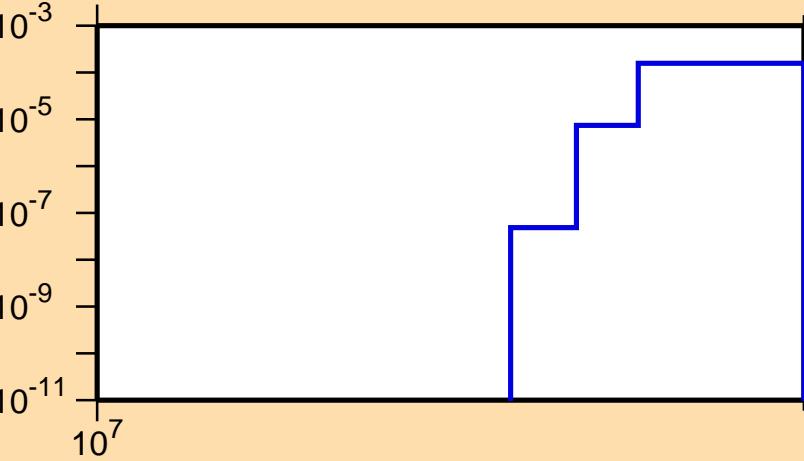



Correlation Matrix

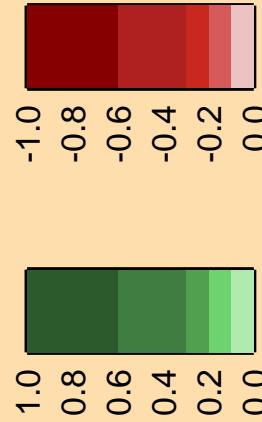


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\text{nt})$

Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).

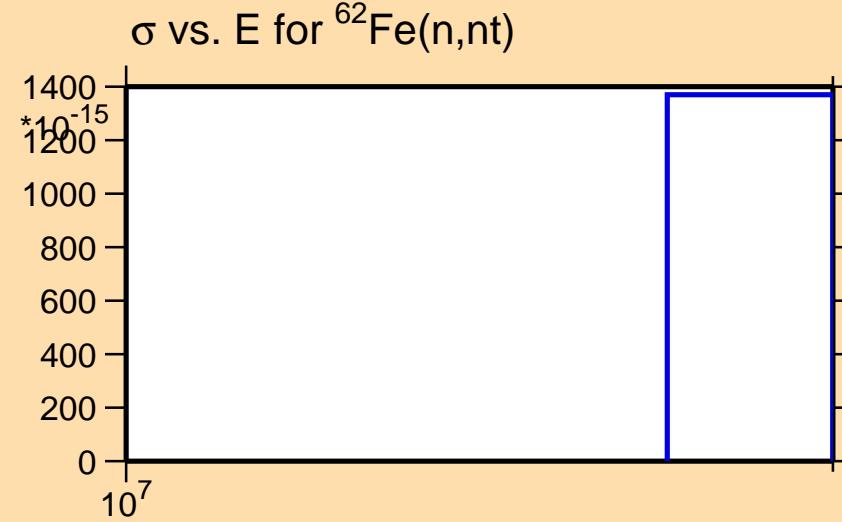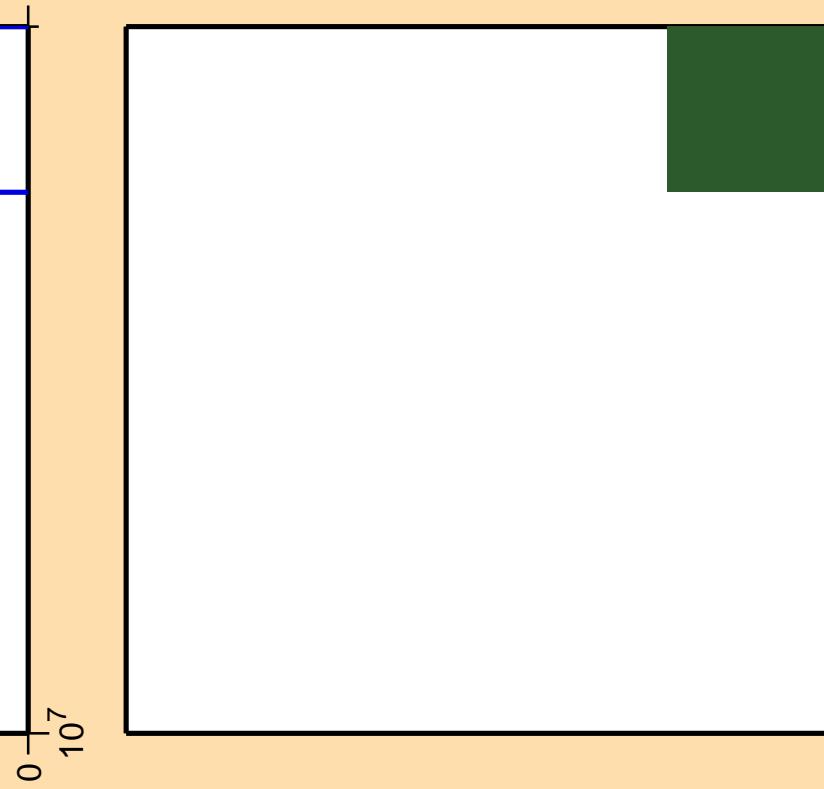

Correlation Matrix

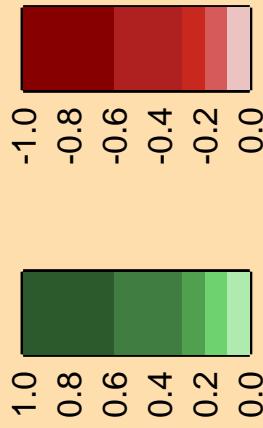


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,n_1)$


Ordinate scales are % relative  
standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

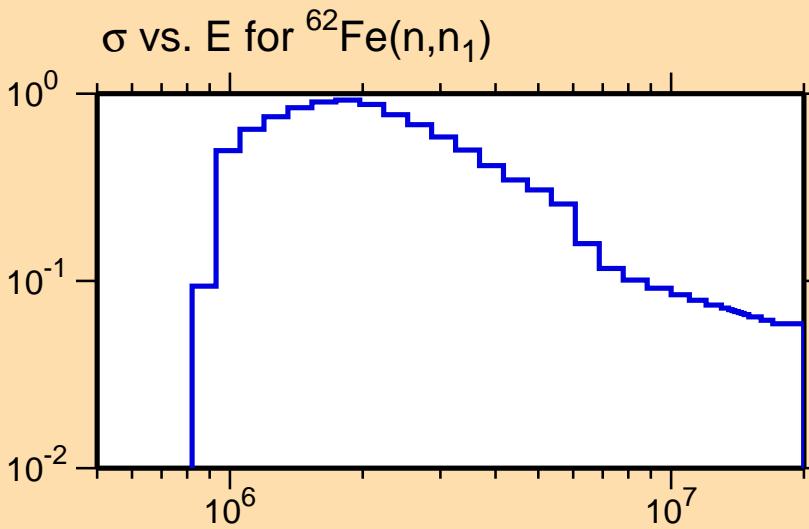


Correlation Matrix

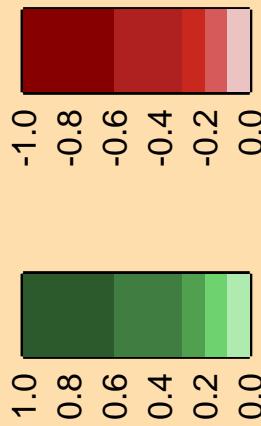

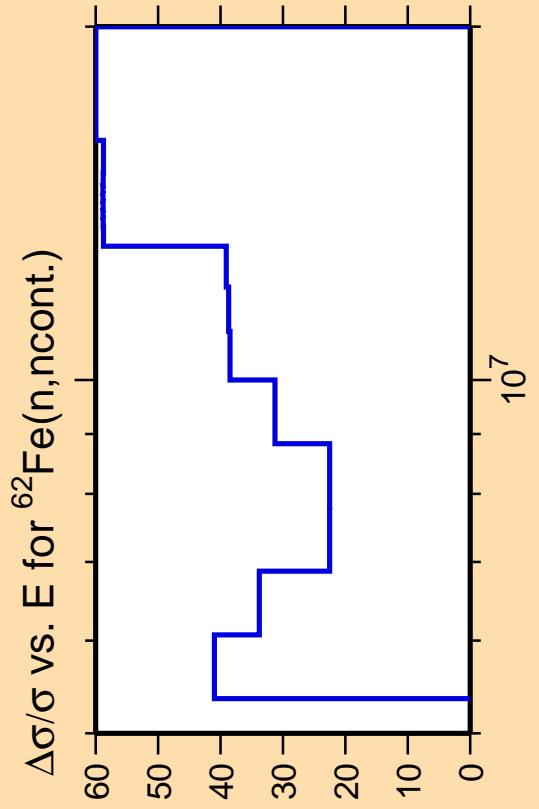


Ordinate scale is %  
relative standard deviation.



Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

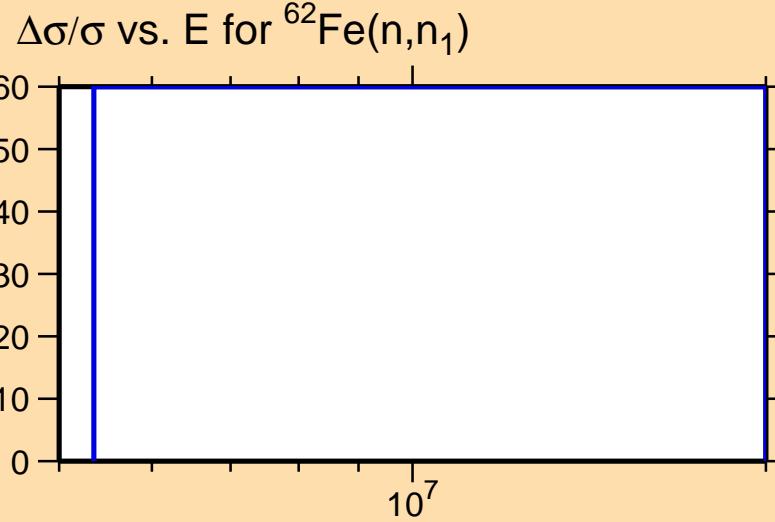


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{n}_1)$

Correlation Matrix

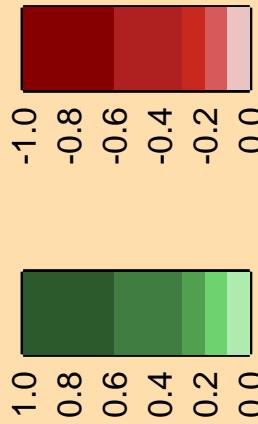

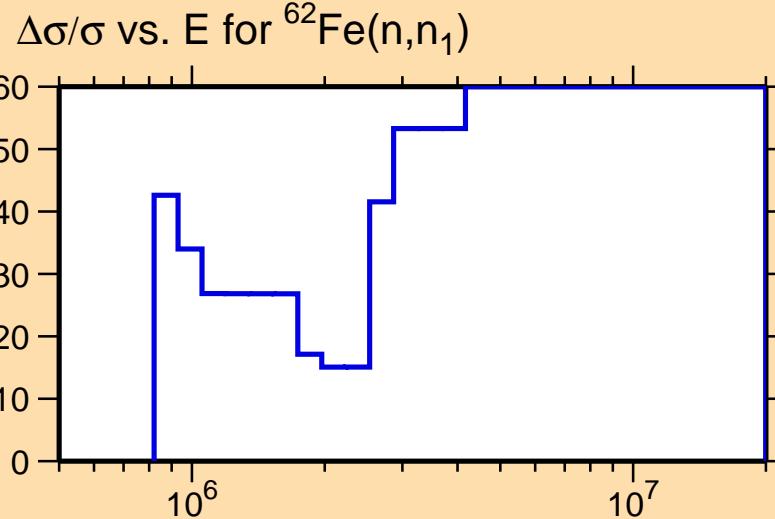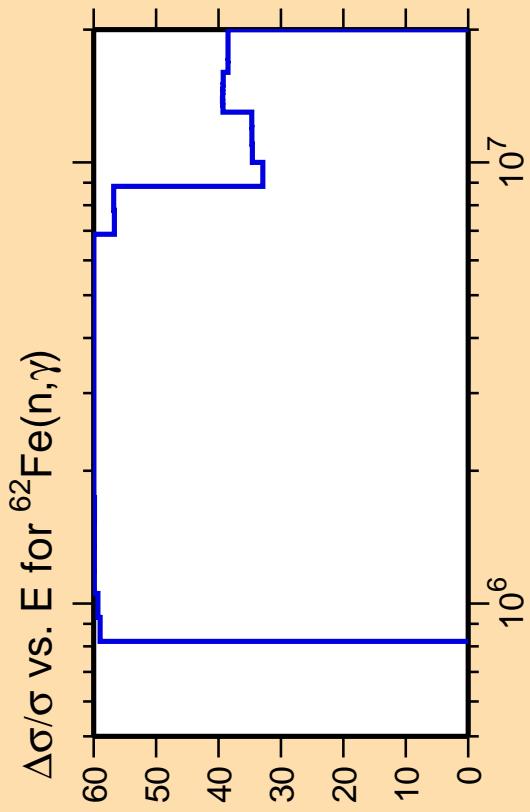


Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

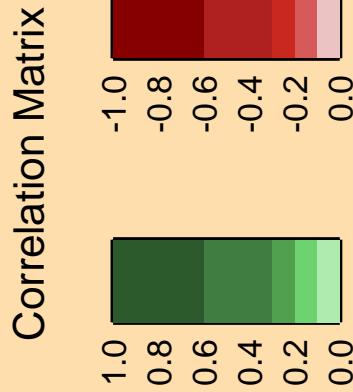


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{p})$

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

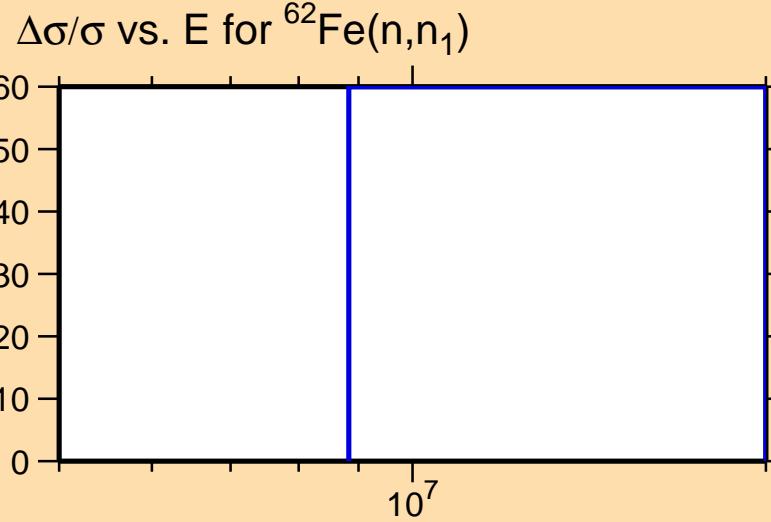


Correlation Matrix

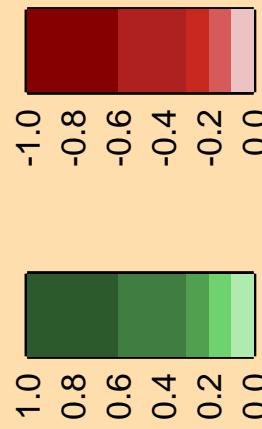


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\alpha)$

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

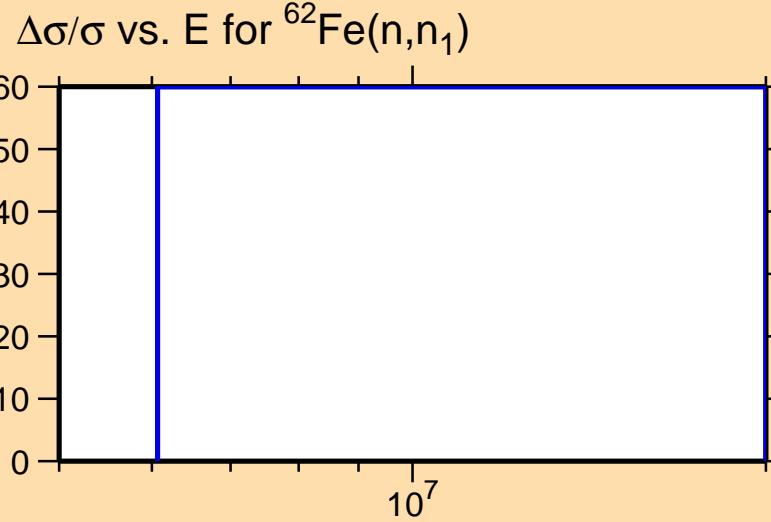

Correlation Matrix

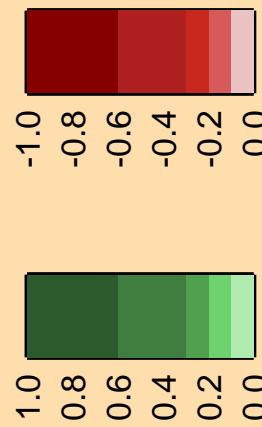


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,n_2)$


Ordinate scales are % relative  
standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

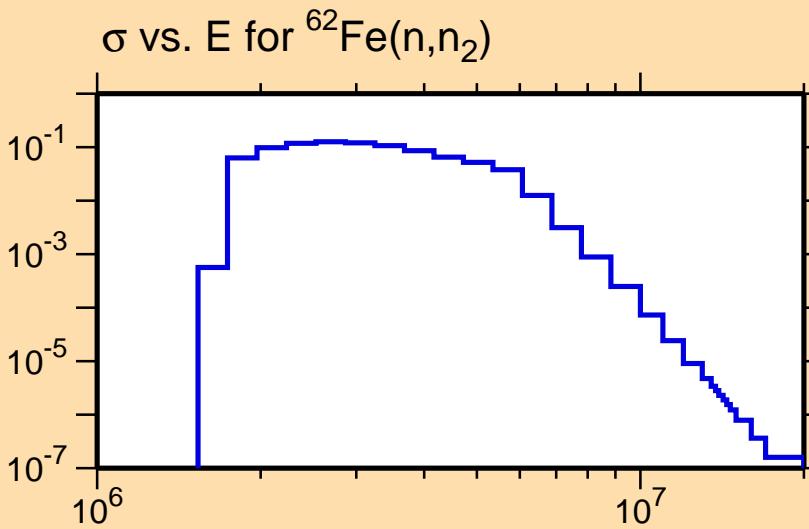

Correlation Matrix

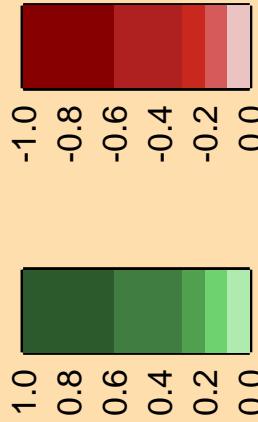

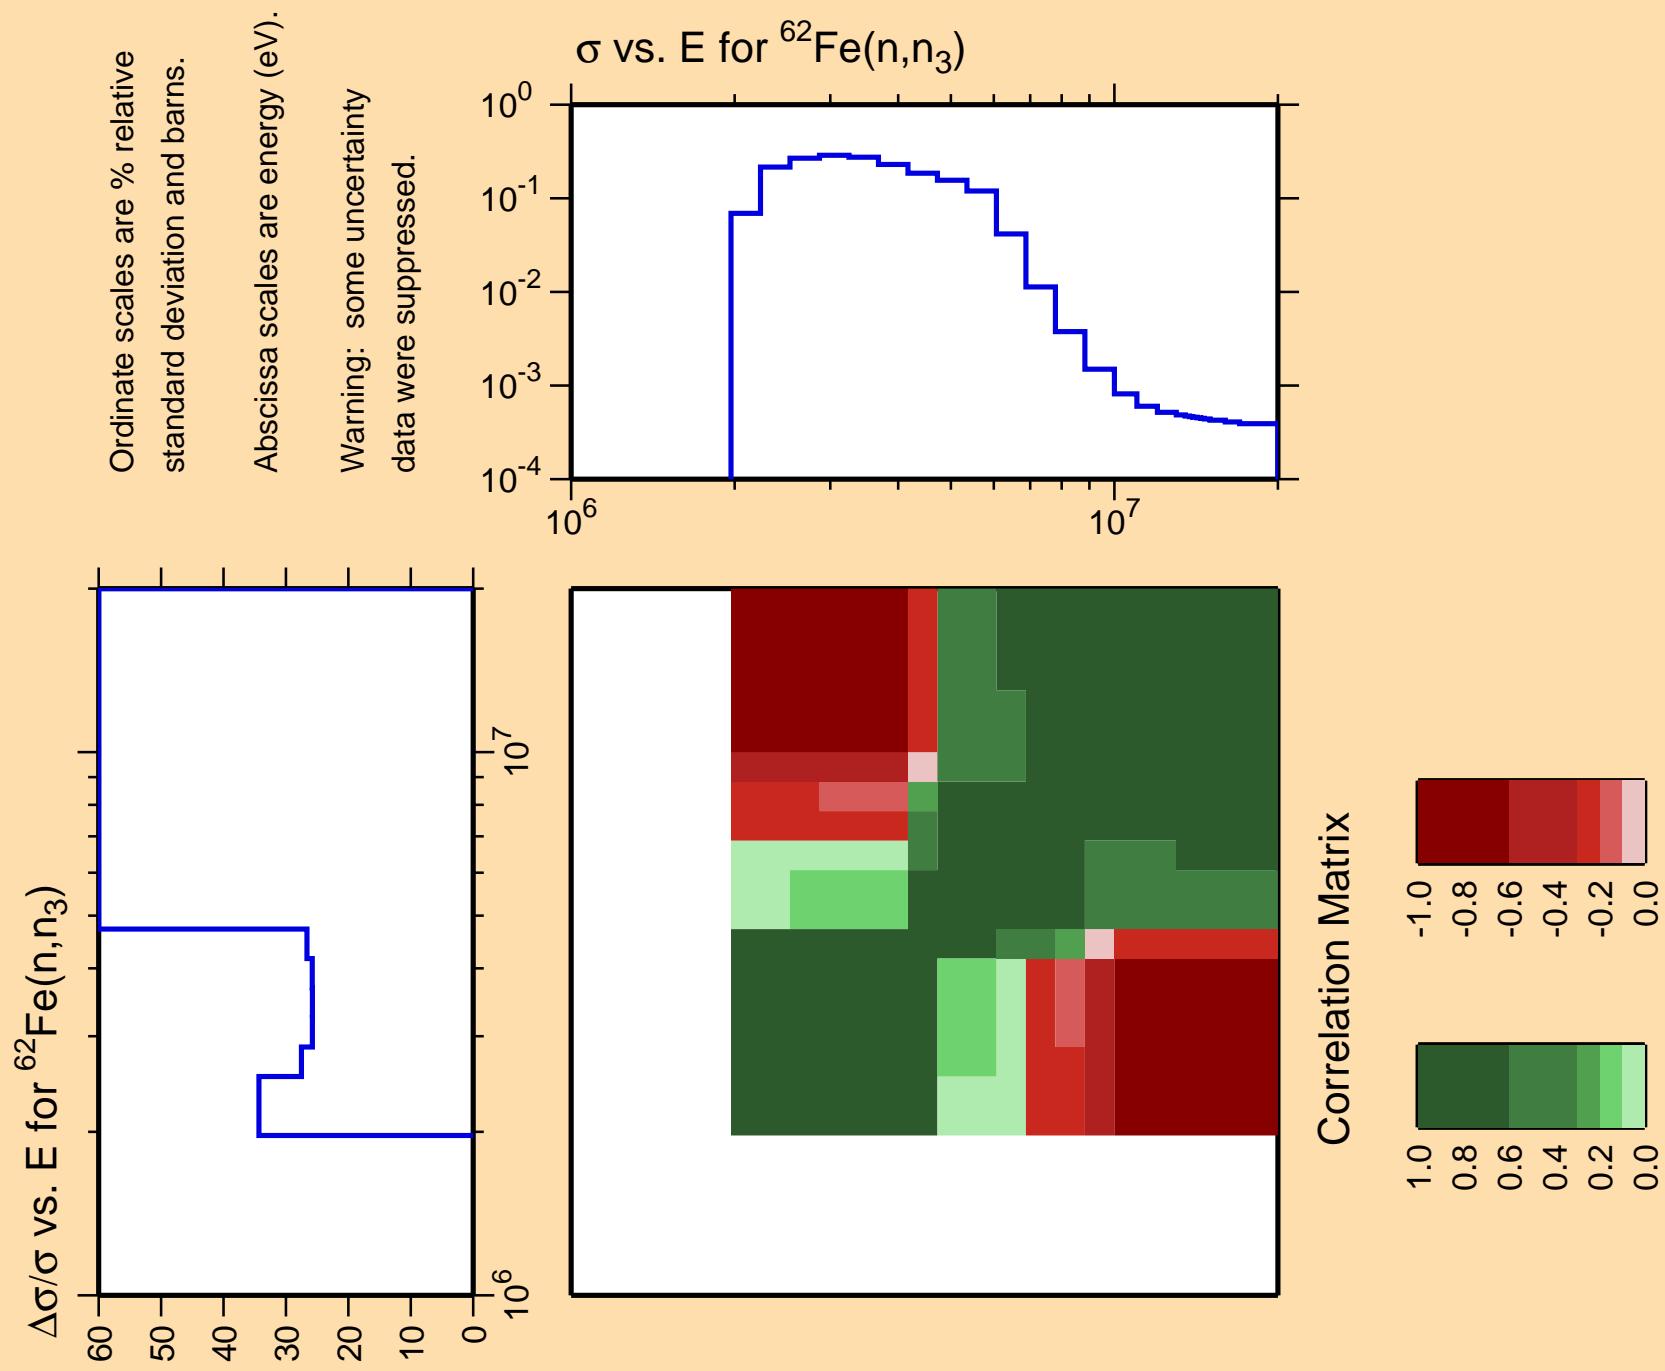


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,n_4)$


Ordinate scales are % relative  
standard deviation and barns.


Abscissa scales are energy (eV).



Warning: some uncertainty  
data were suppressed.

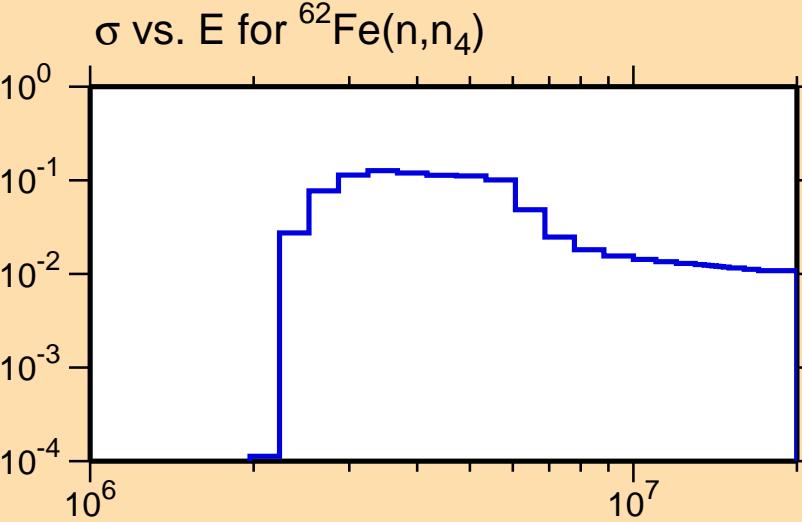


Correlation Matrix

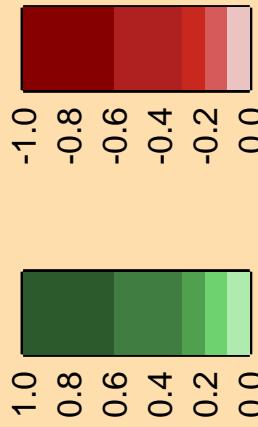

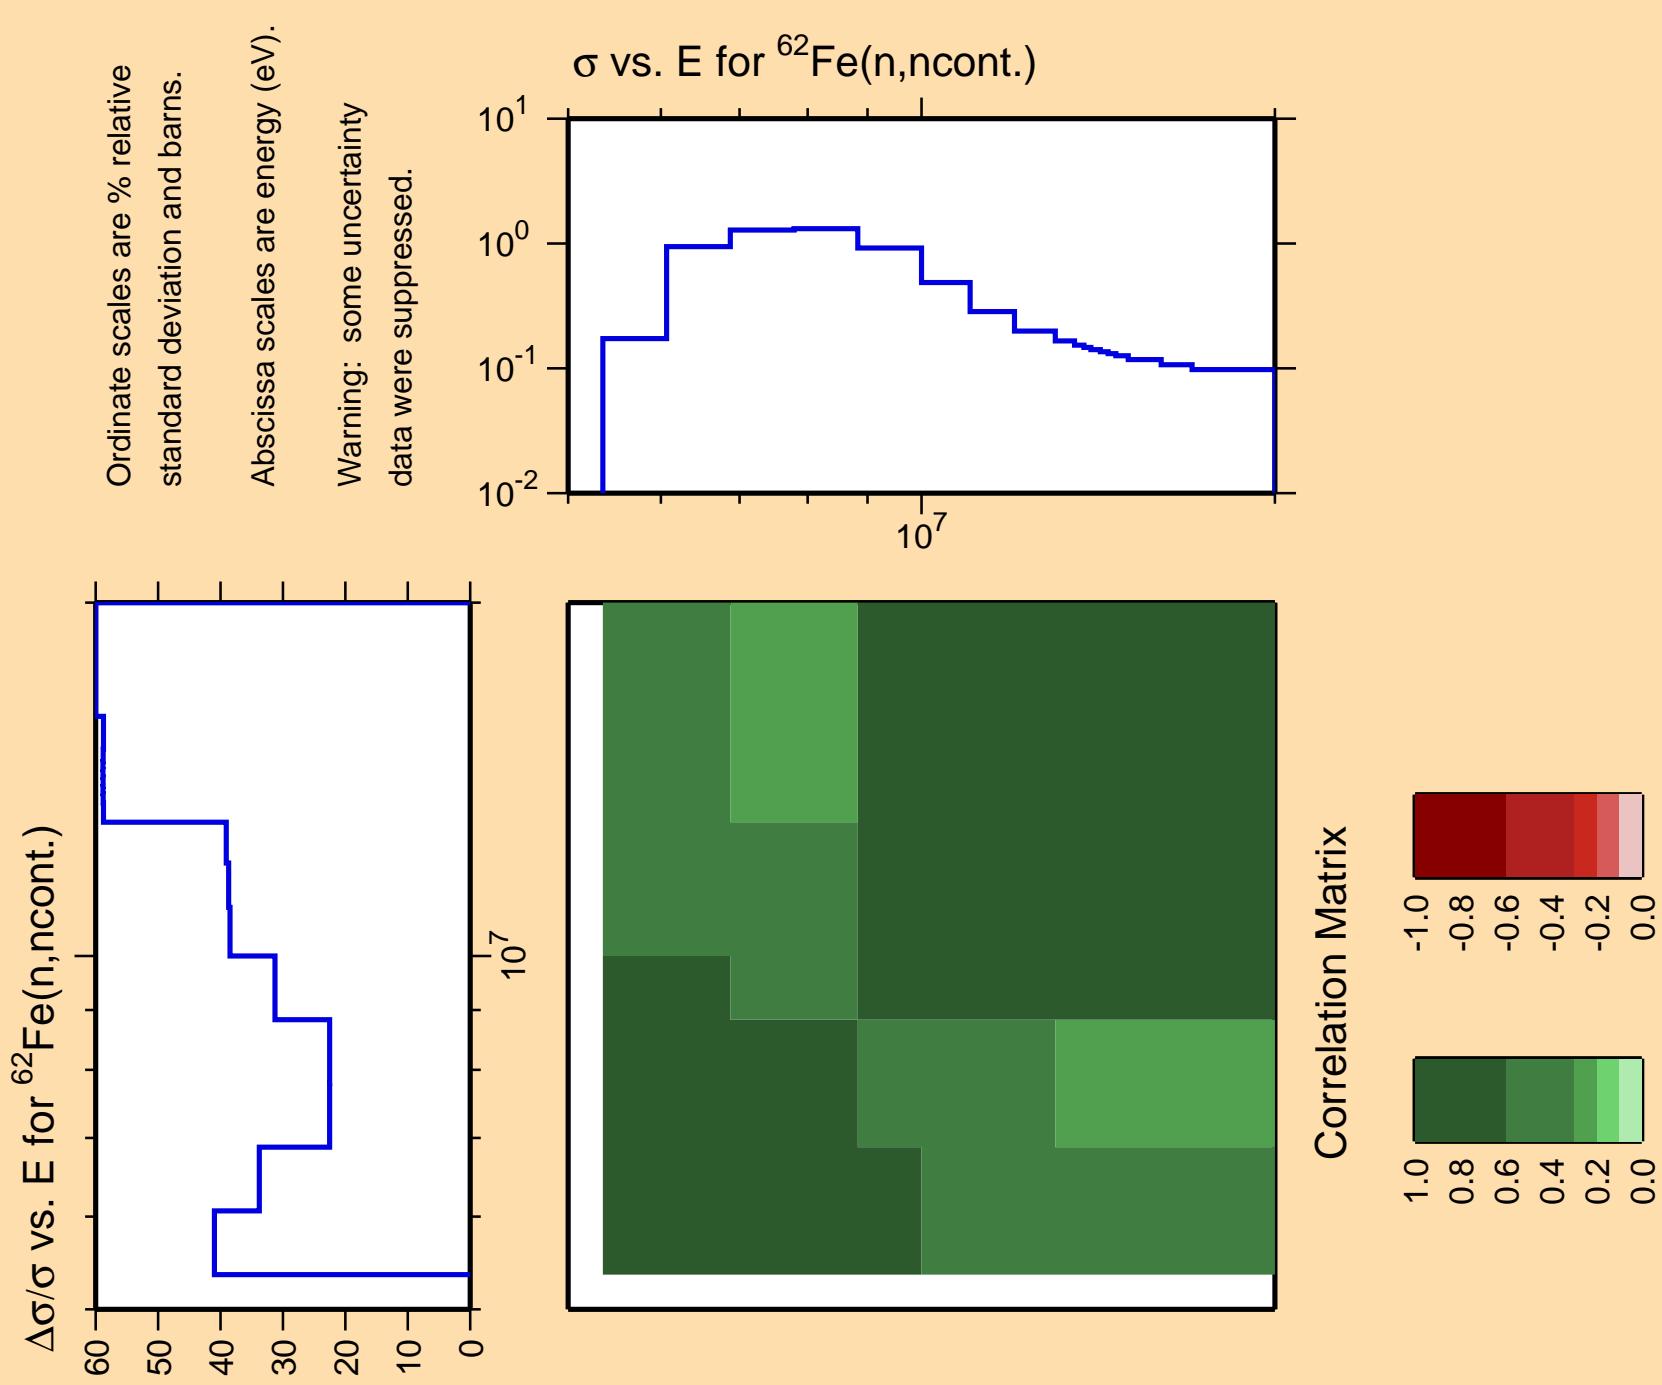

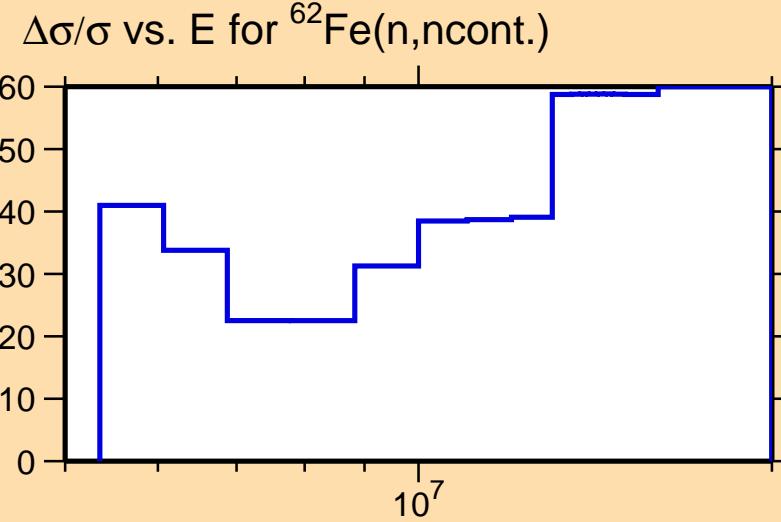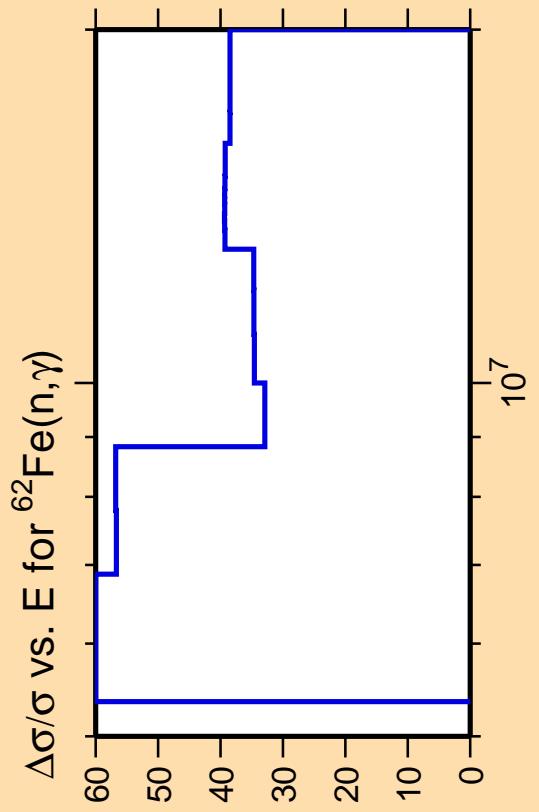

Ordinate scale is %  
relative standard deviation.  
Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

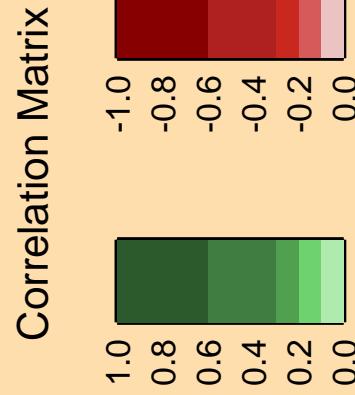


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{p})$

10<sup>2</sup>  
10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>


10<sup>7</sup>

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

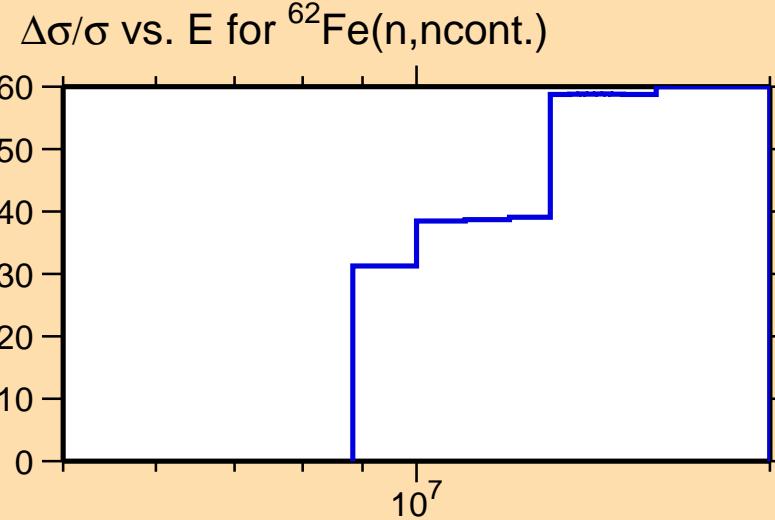


Correlation Matrix

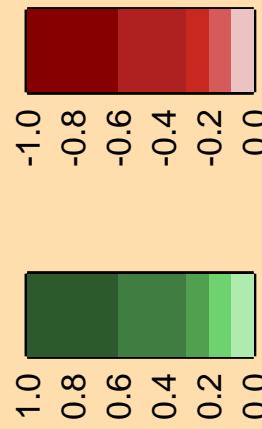


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\alpha)$


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

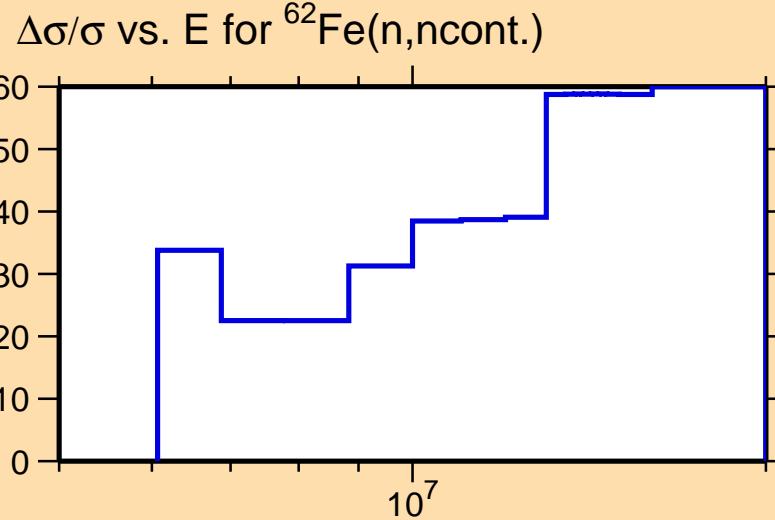


Correlation Matrix

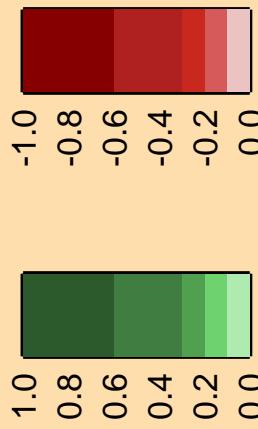

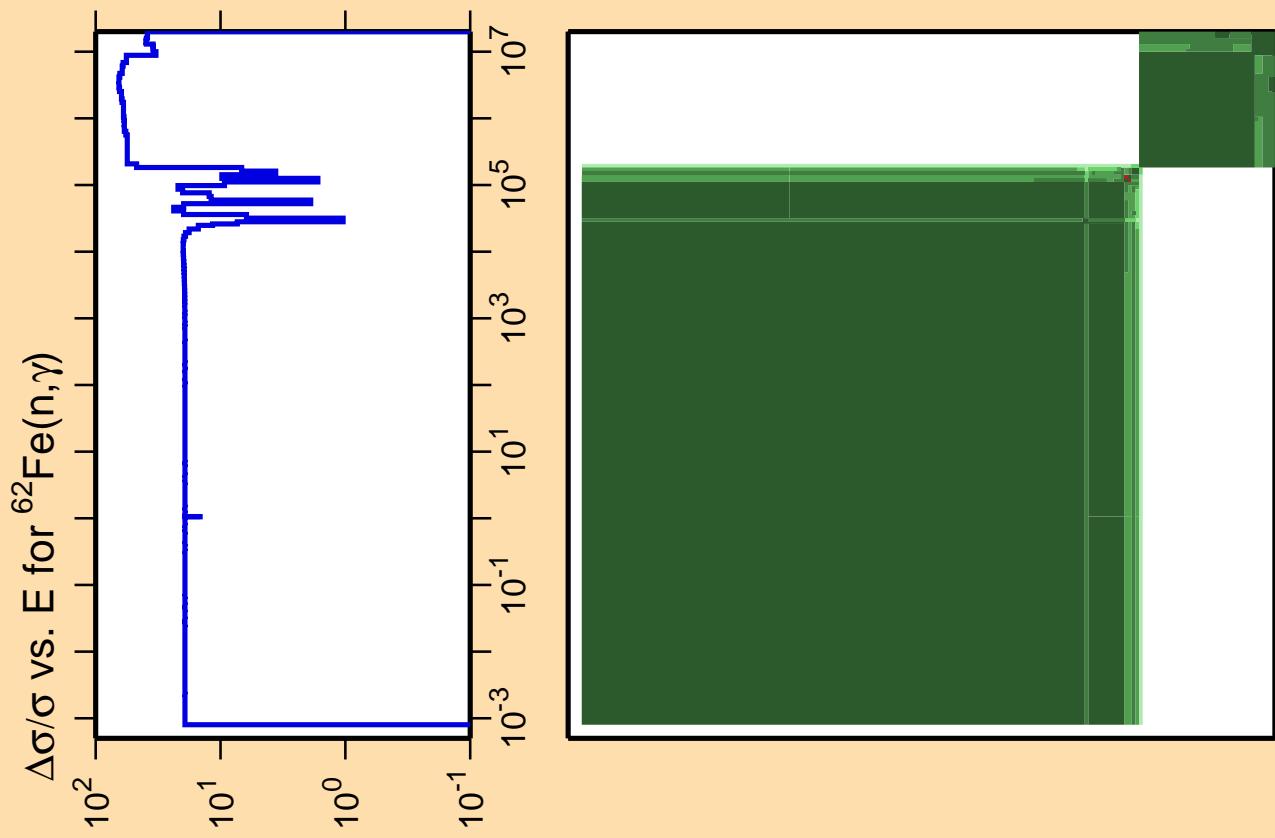

Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).

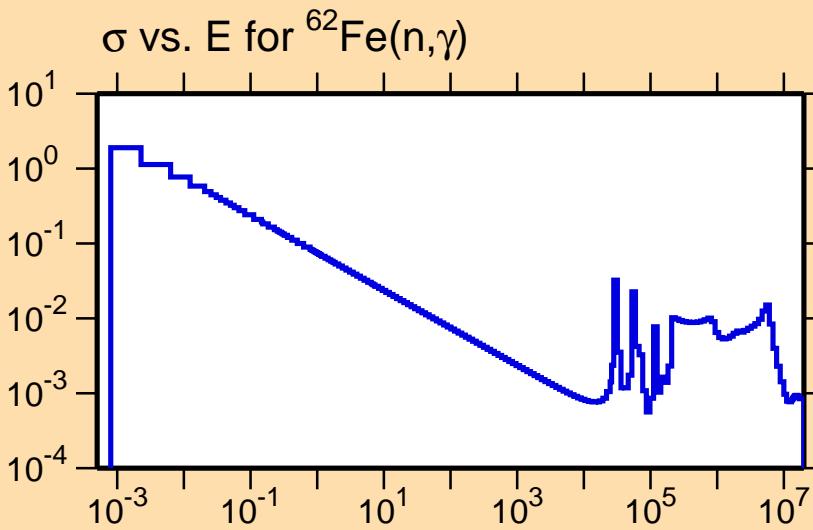


Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{p})$

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

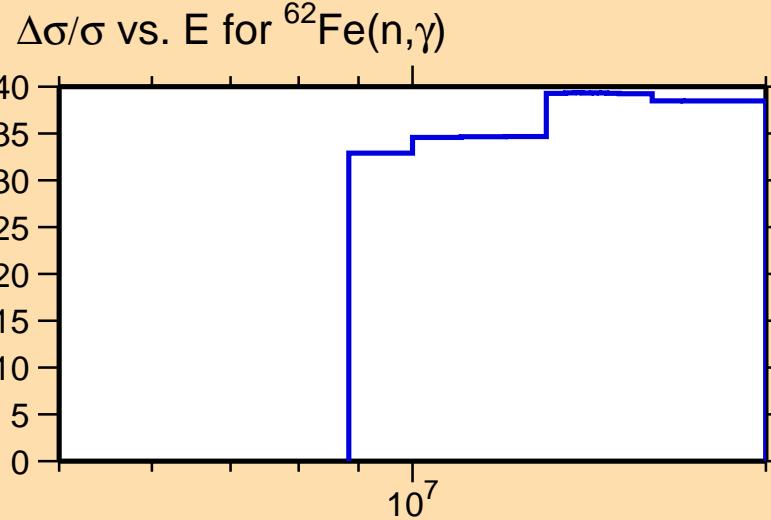

Correlation Matrix

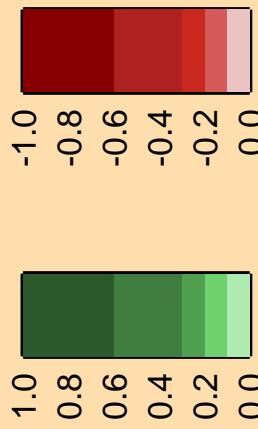


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\alpha)$

10<sup>2</sup>  
10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>


10<sup>7</sup>

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

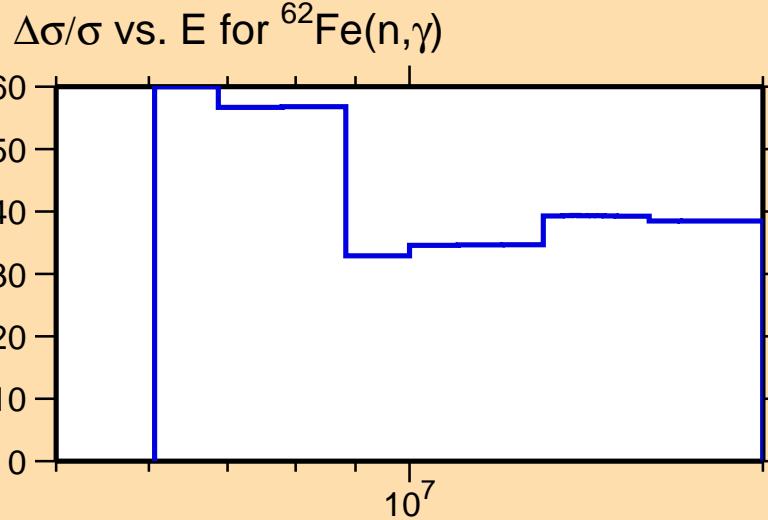

Correlation Matrix

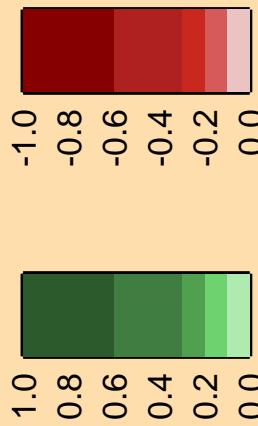

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,p)$

10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>

Ordinate scales are % relative  
standard deviation and barns.


Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

10<sup>-2</sup>  
10<sup>-4</sup>  
10<sup>-6</sup>  
10<sup>-8</sup>  
10<sup>-10</sup>

$\sigma$  vs. E for  $^{62}\text{Fe}(n,p)$

10<sup>7</sup>


Correlation Matrix

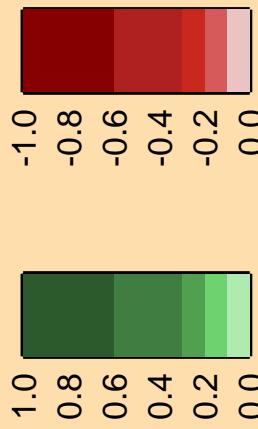


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\alpha)$

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).  
Warning: some uncertainty  
data were suppressed.

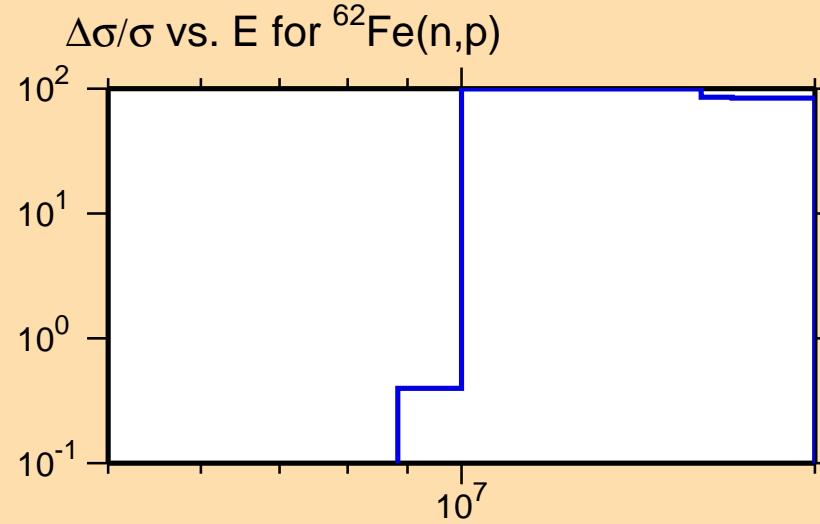

Correlation Matrix

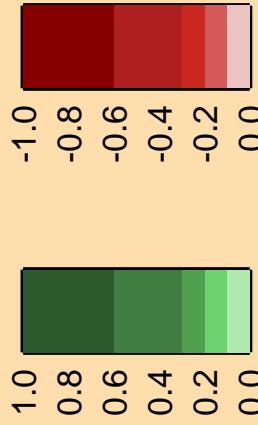

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{d})$

10<sup>2</sup>  
10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>  
10<sup>7</sup>


Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

10<sup>-3</sup>  
10<sup>-5</sup>  
10<sup>-7</sup>  
10<sup>-9</sup>  
10<sup>-11</sup>  
10<sup>7</sup>

$\sigma$  vs. E for  $^{62}\text{Fe}(\text{n},\text{d})$

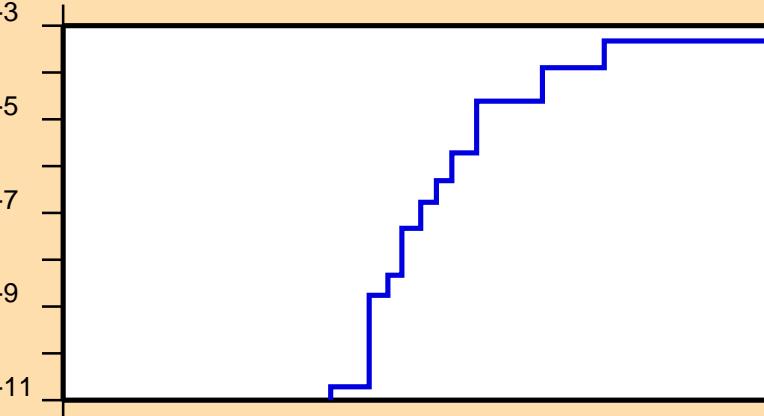

Correlation Matrix

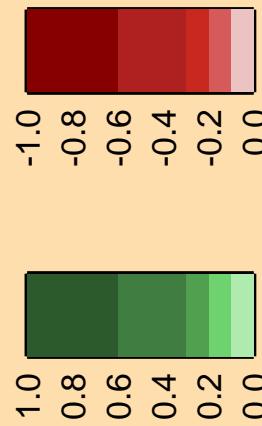

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,t)$

10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>  
10<sup>7</sup>

Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

10<sup>-4</sup>  
10<sup>-6</sup>  
10<sup>-8</sup>  
10<sup>-10</sup>  
10<sup>-12</sup>

$\sigma$  vs. E for  $^{62}\text{Fe}(n,t)$

10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>  
10<sup>7</sup>

Correlation Matrix

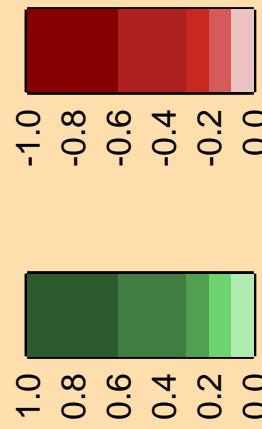

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Fe}(n,\alpha)$


10<sup>2</sup>  
10<sup>1</sup>  
10<sup>0</sup>  
10<sup>-1</sup>

Ordinate scales are % relative  
standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\sigma$  vs. E for  $^{62}\text{Fe}(n,\alpha)$

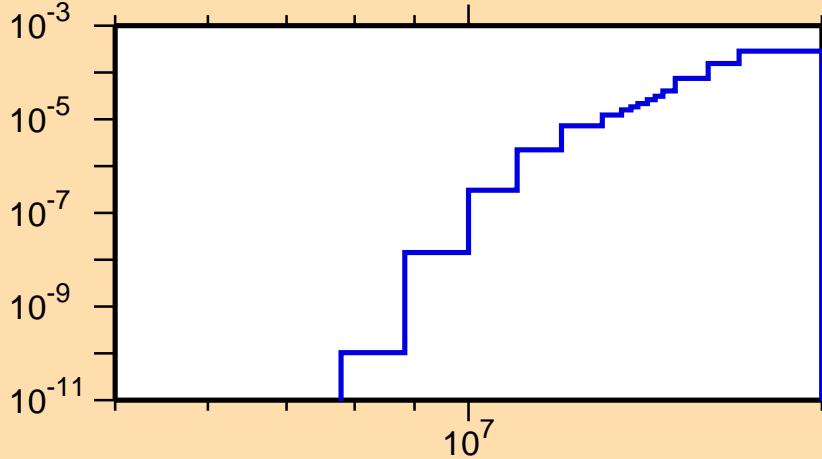

Correlation Matrix

