




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

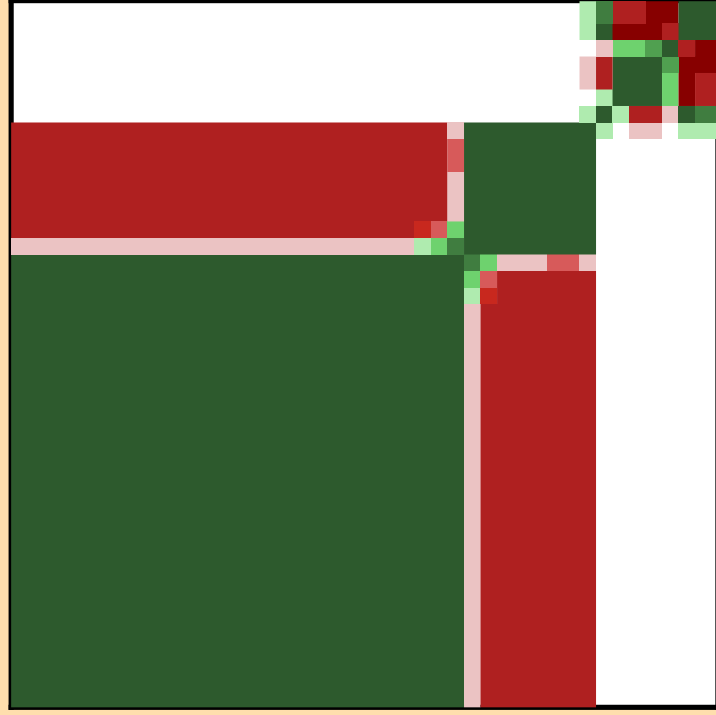

Correlation Matrix


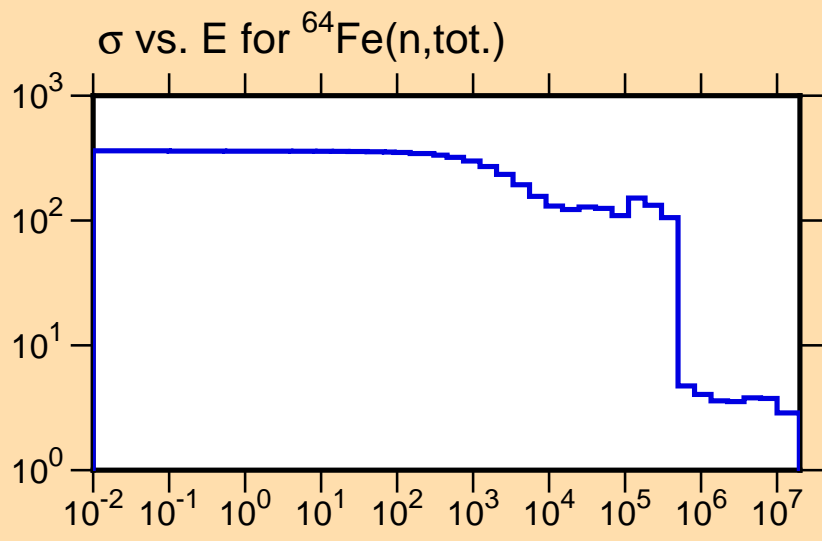


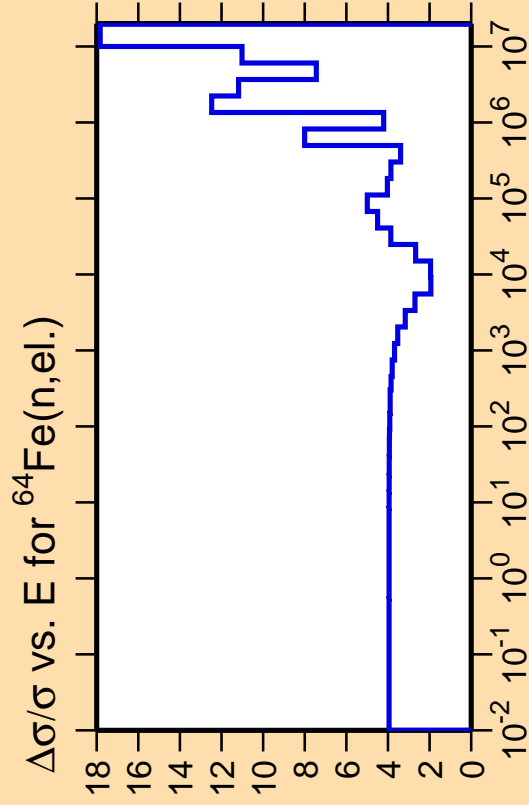

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

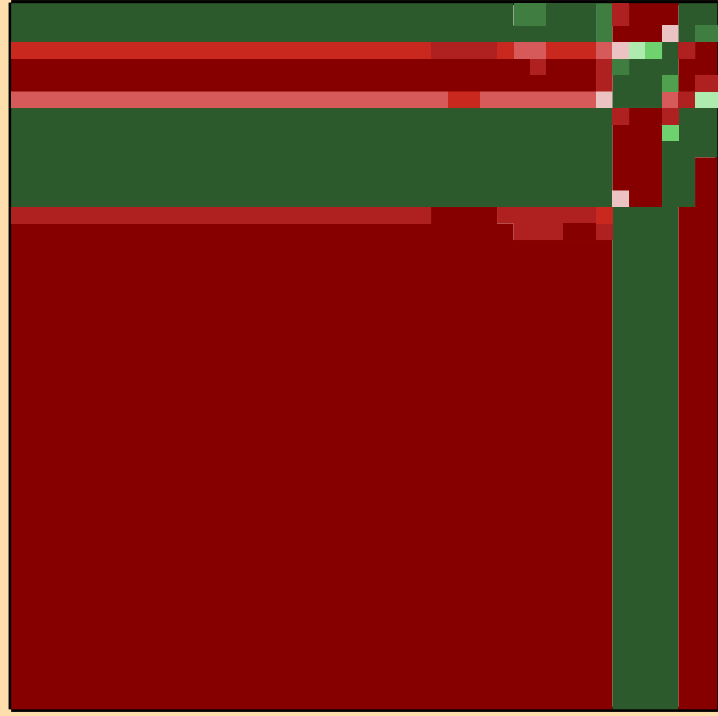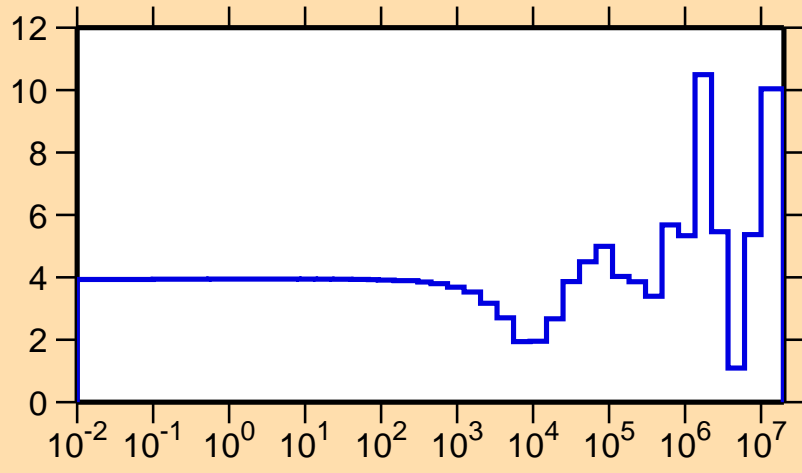

Correlation Matrix





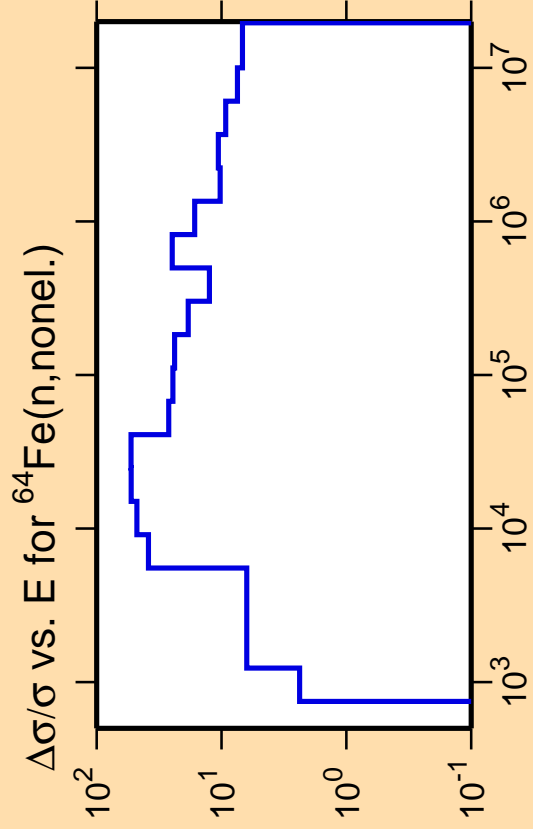

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

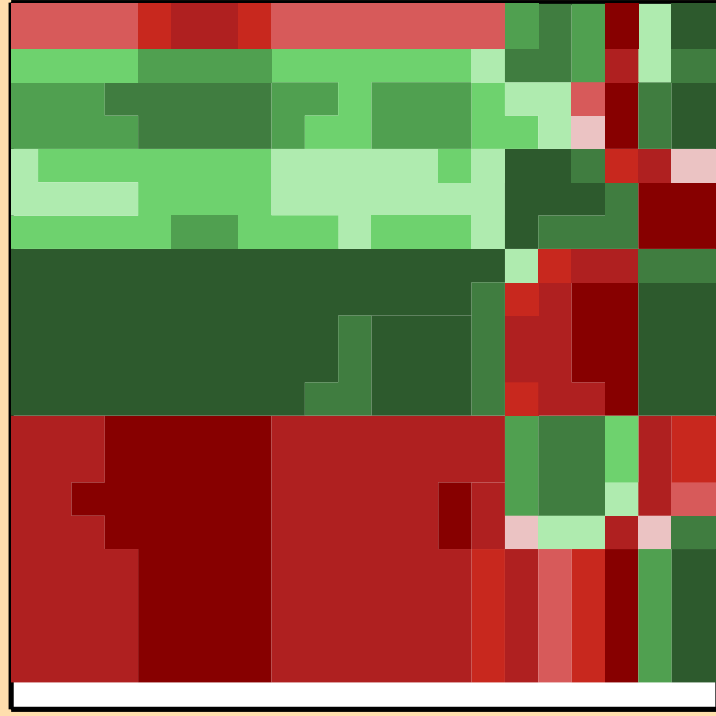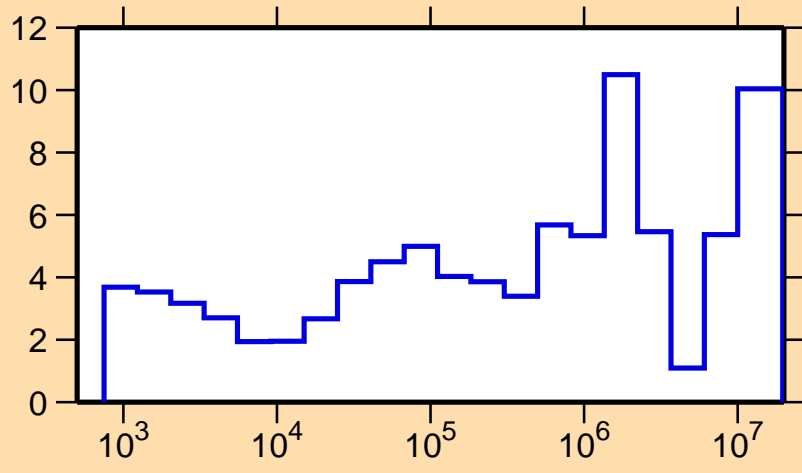

Correlation Matrix





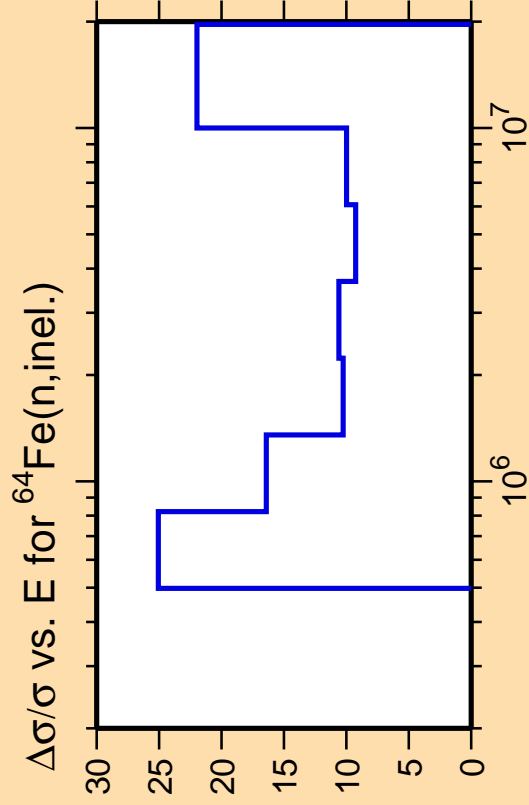

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

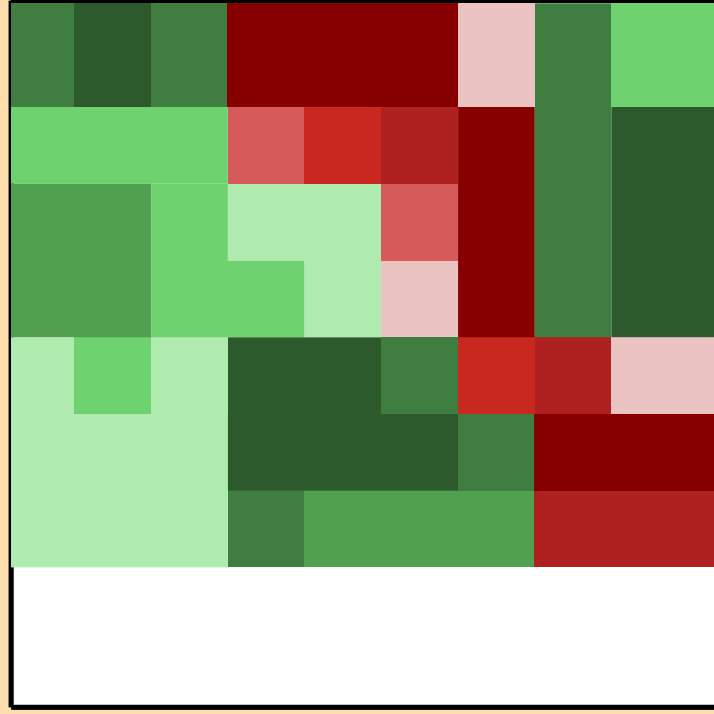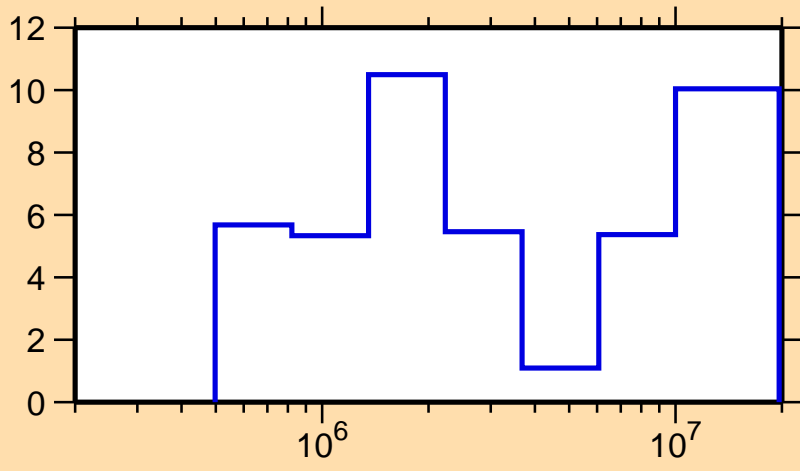

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

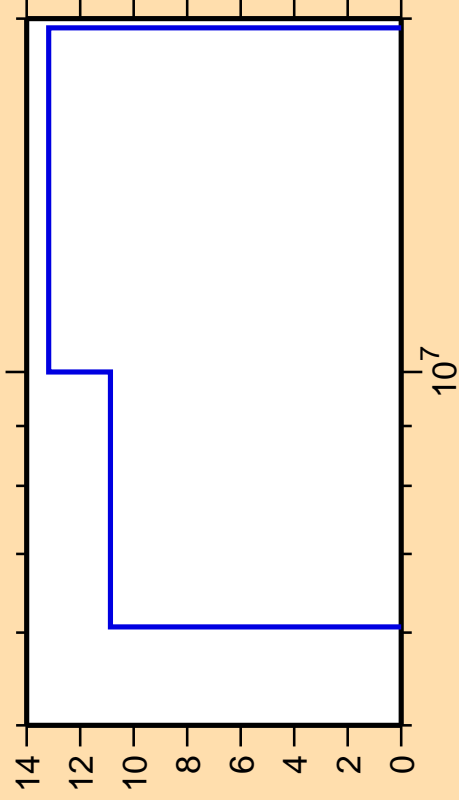

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

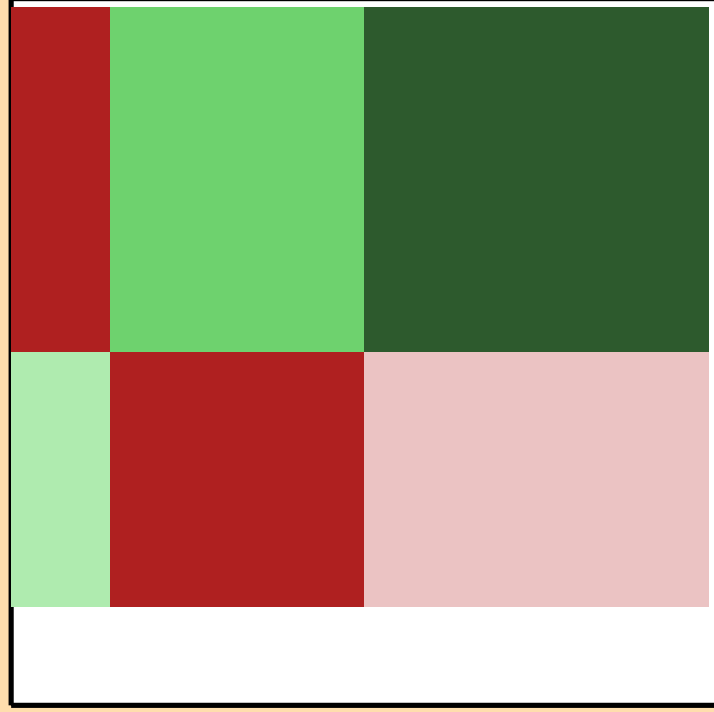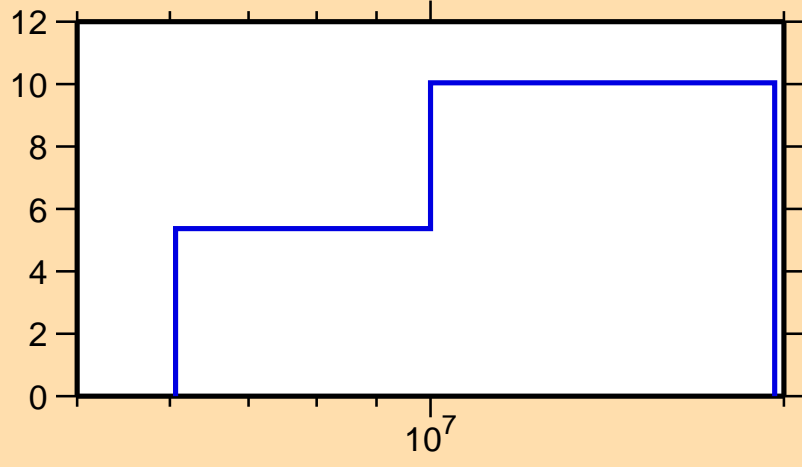

Correlation Matrix





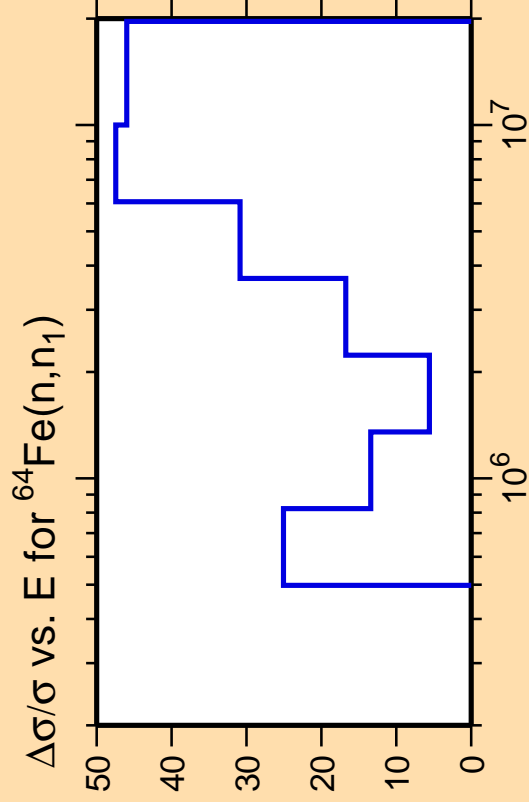

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

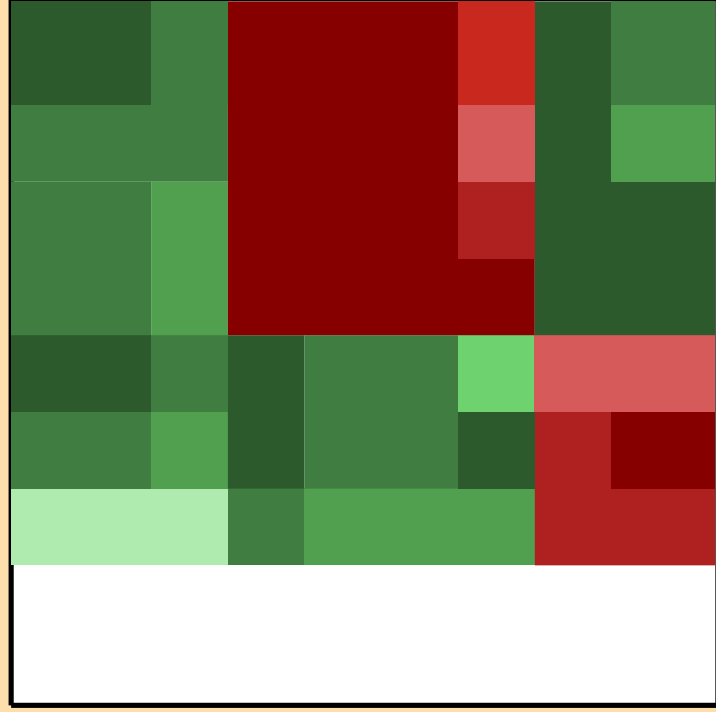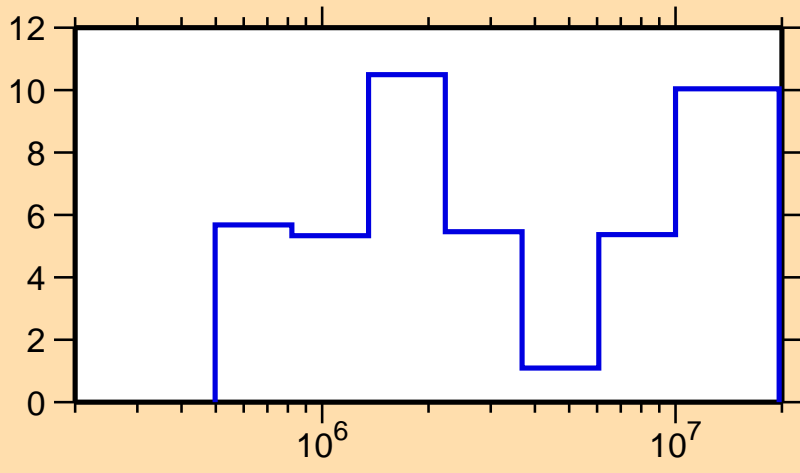

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

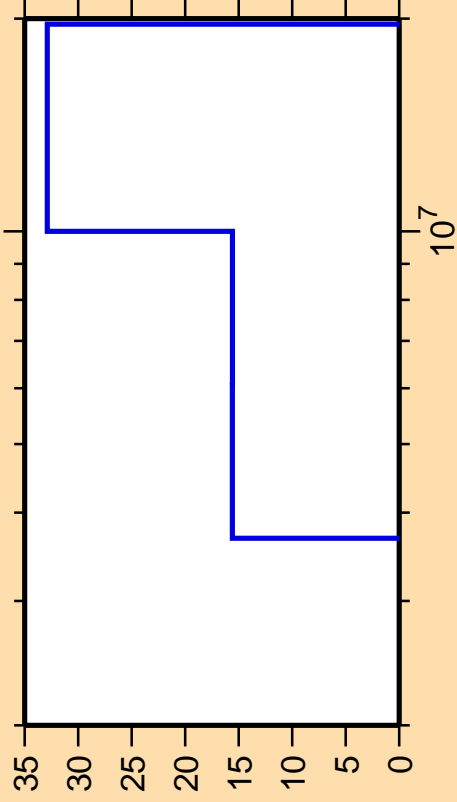

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

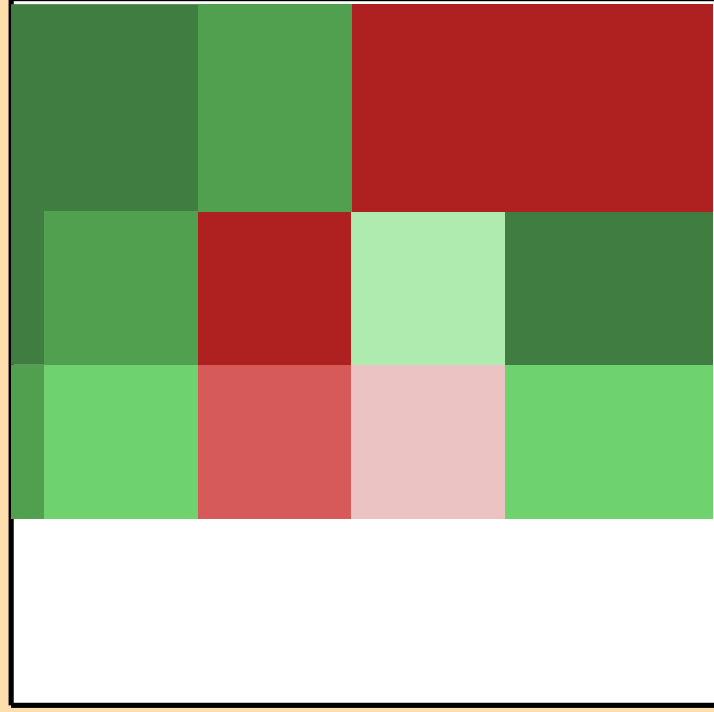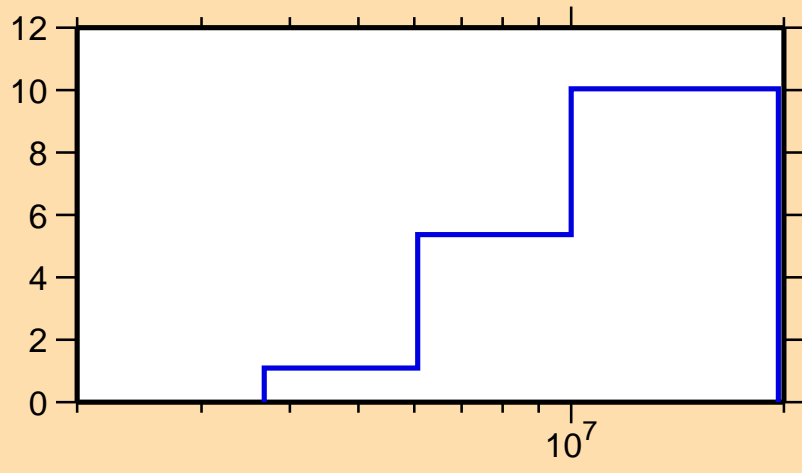

Correlation Matrix





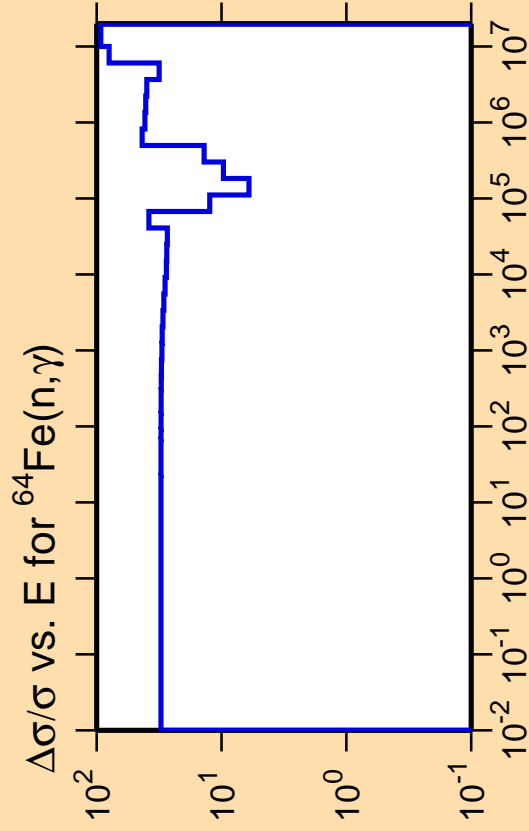

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

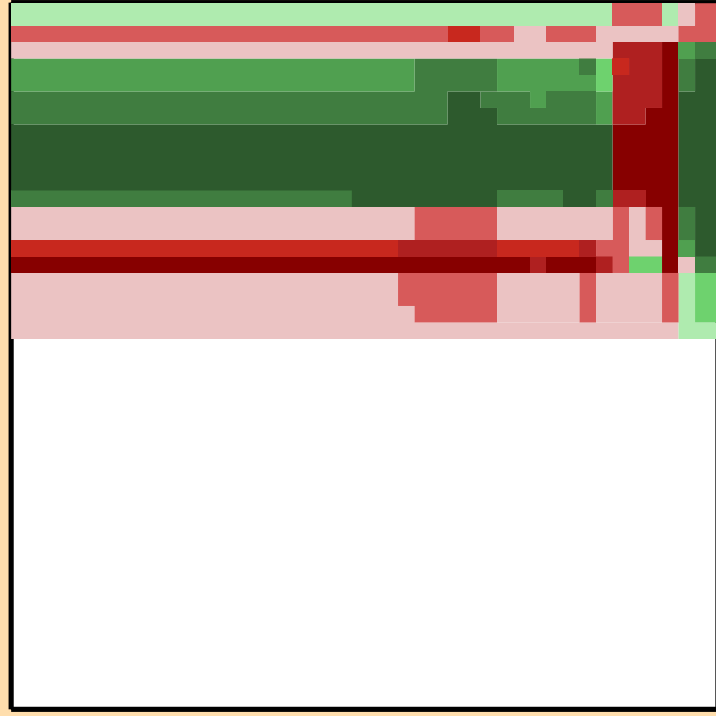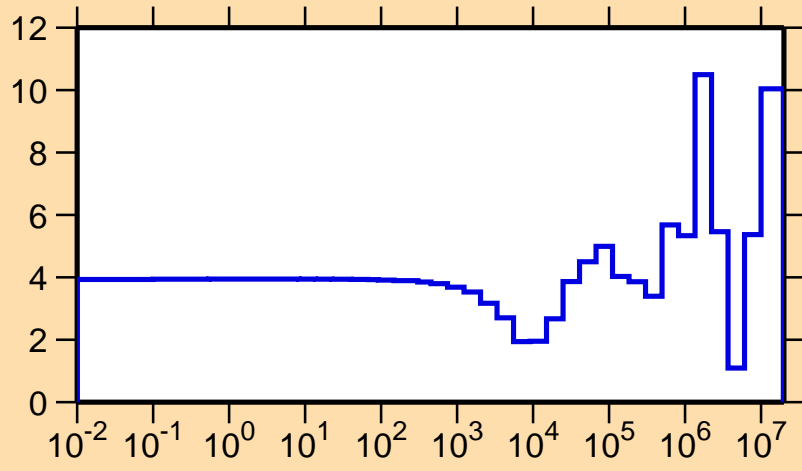

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$




Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

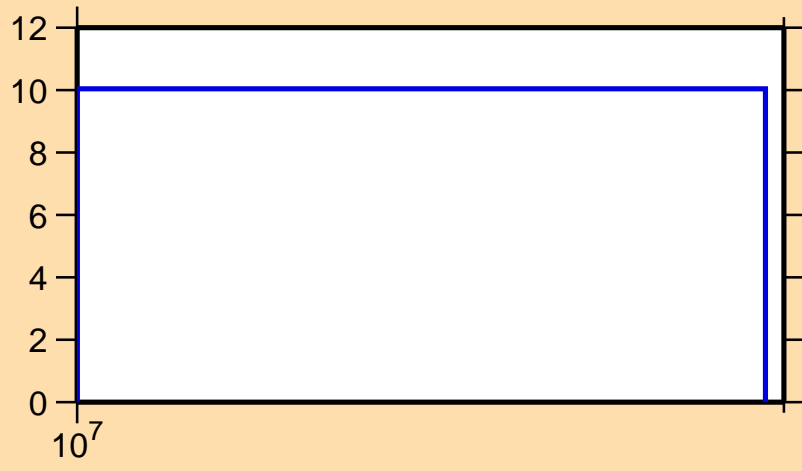

Correlation Matrix




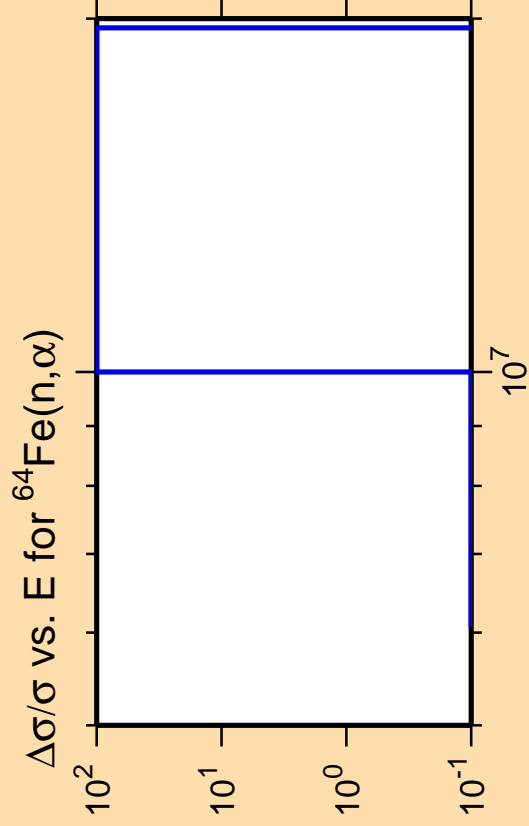


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{tot.})$

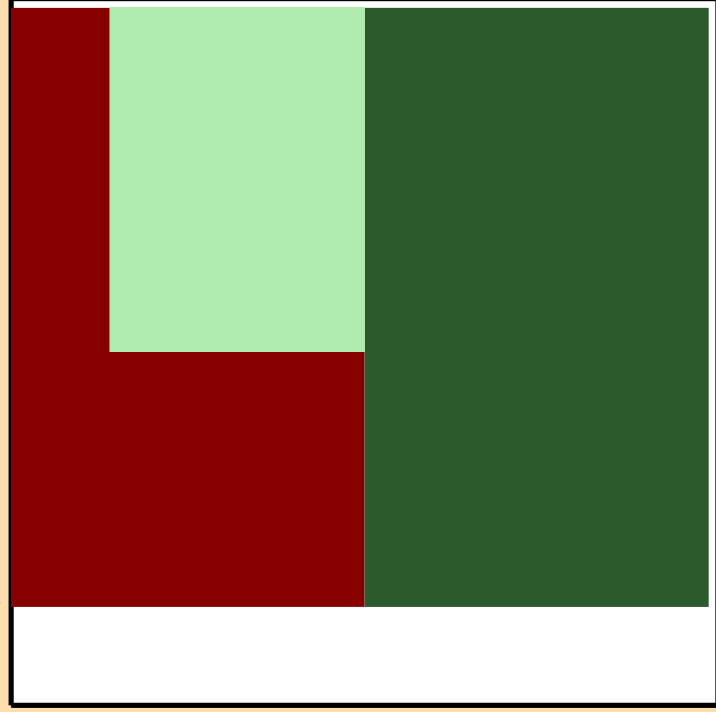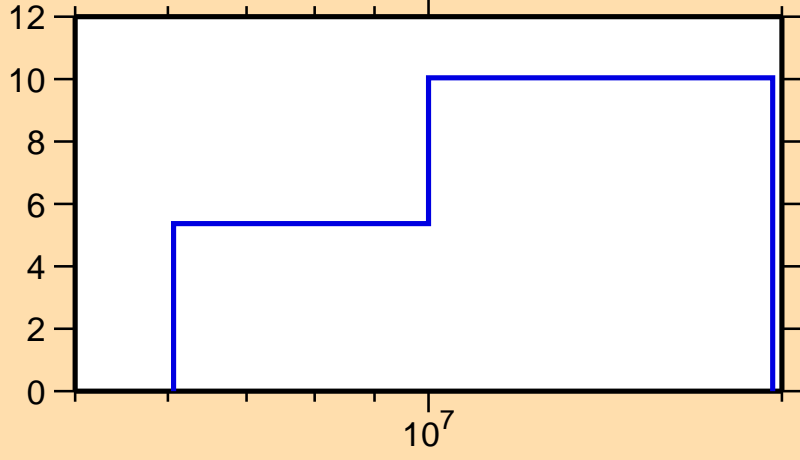

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{el.})$

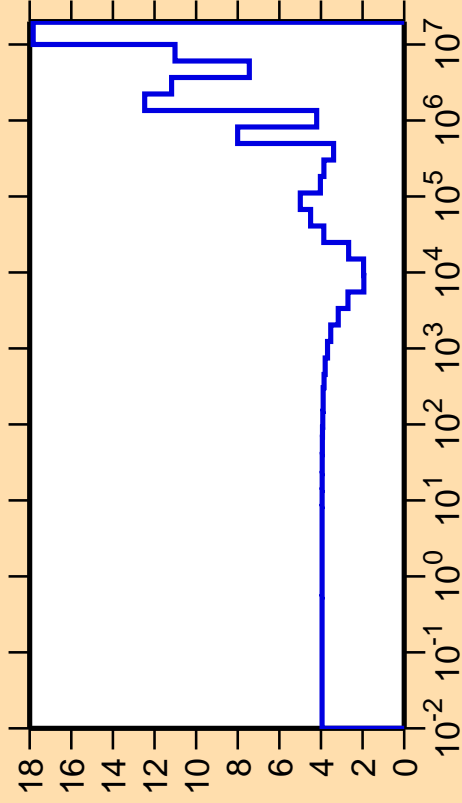


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

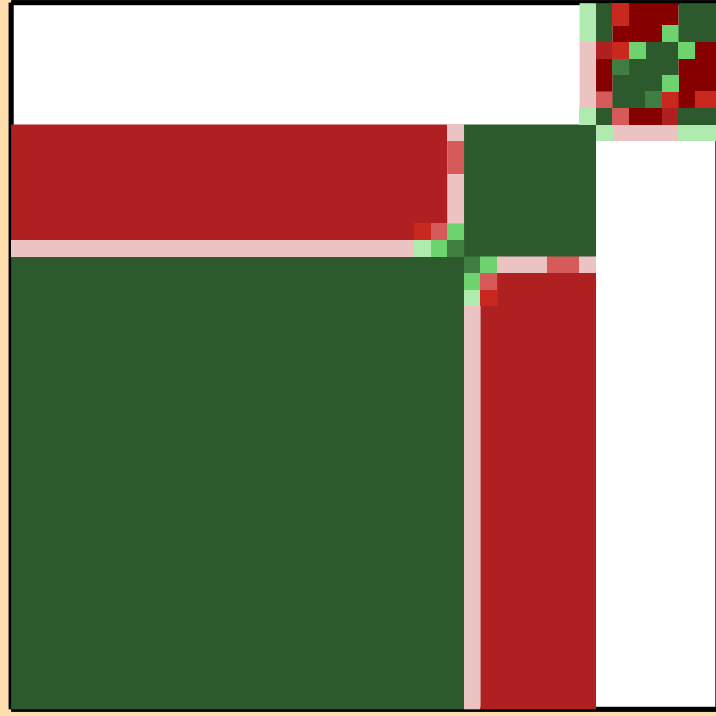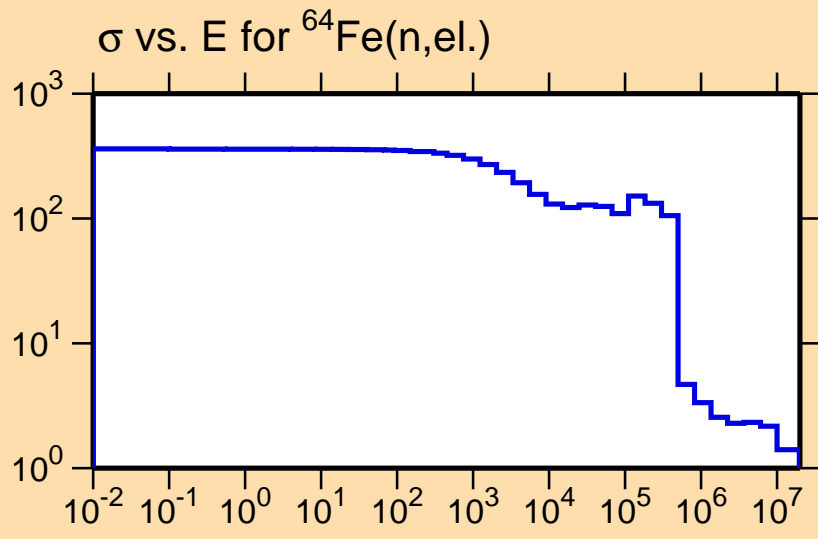

Correlation Matrix





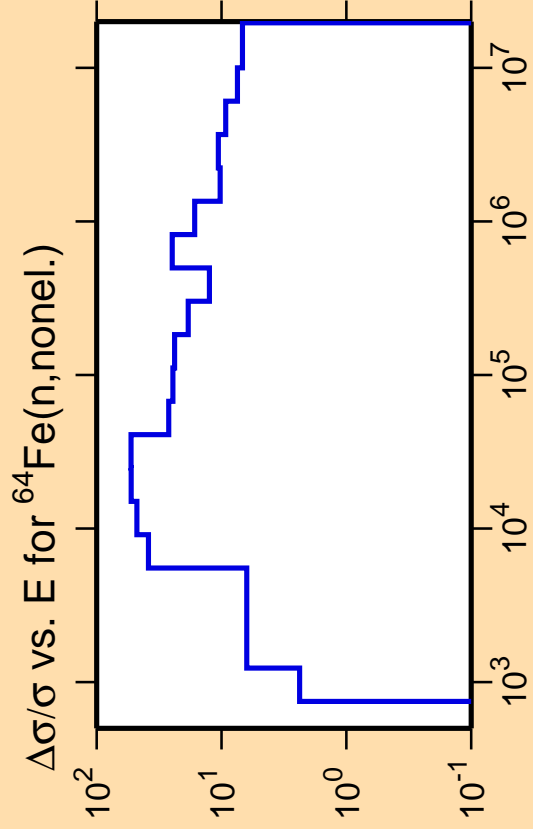

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{el.})$

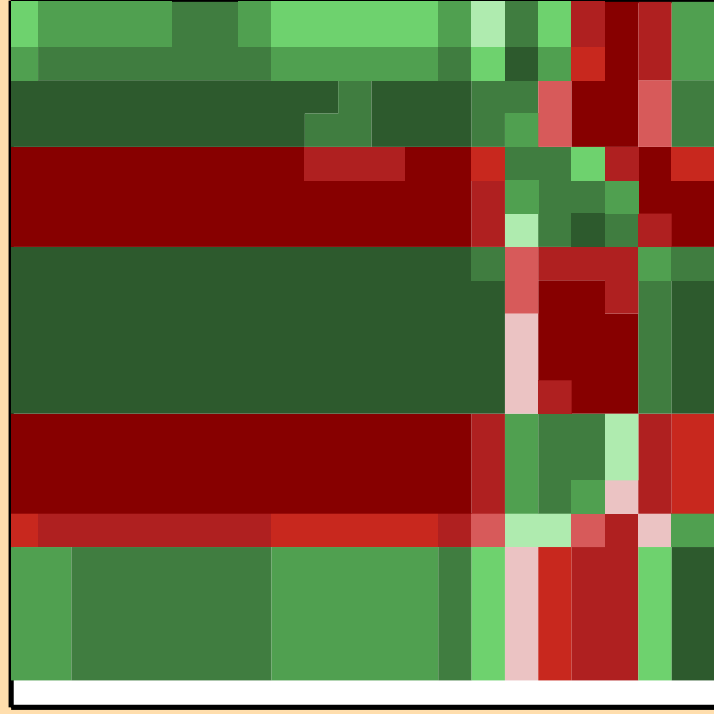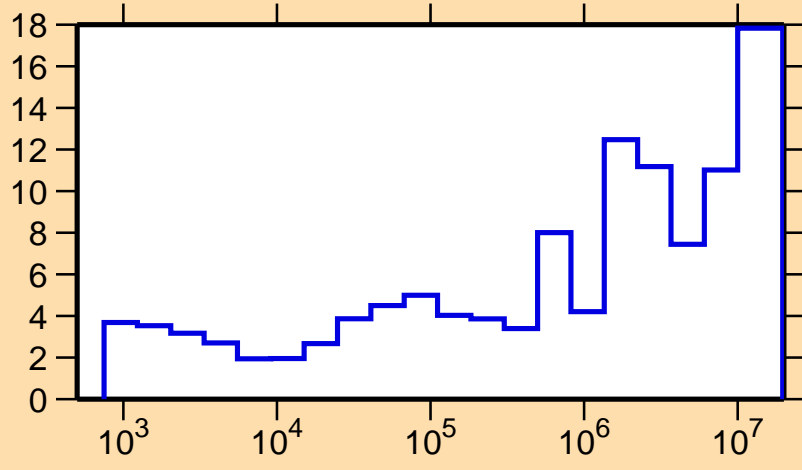

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{inel.})$

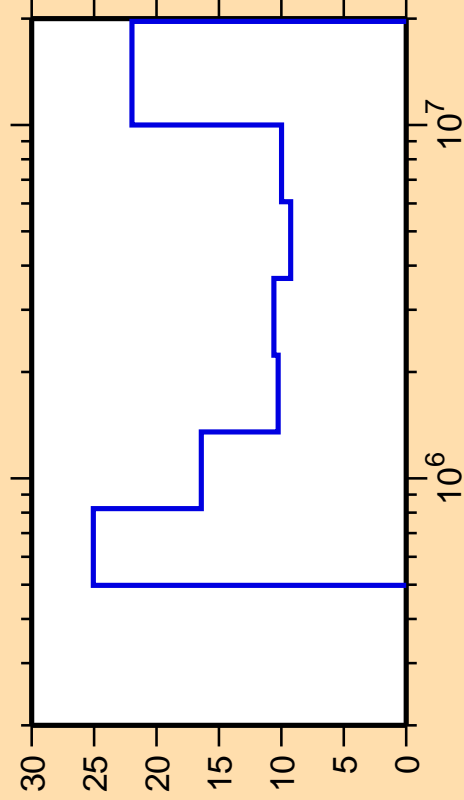

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{el.})$

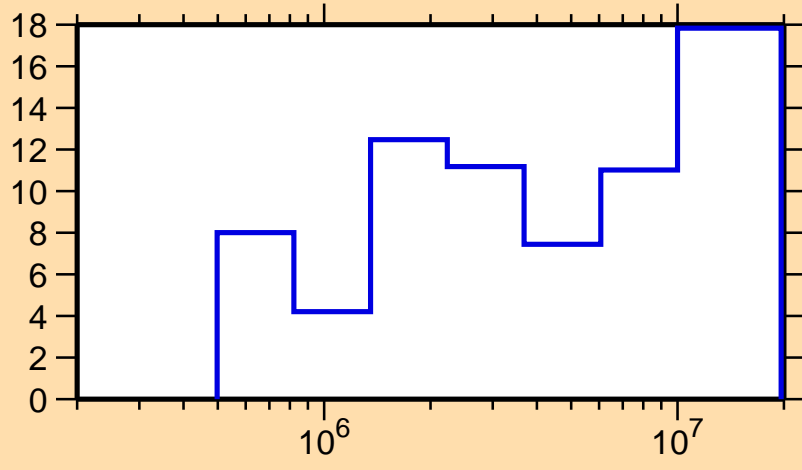

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

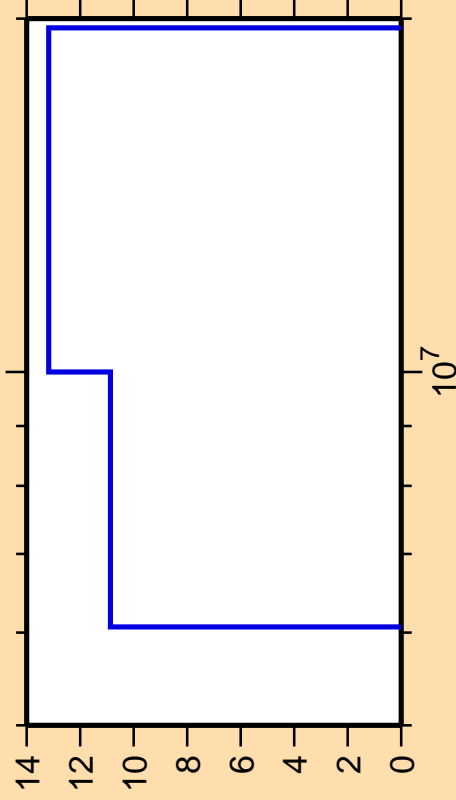

Ordinate scale is %  
relative standard deviation.





Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{el.})$

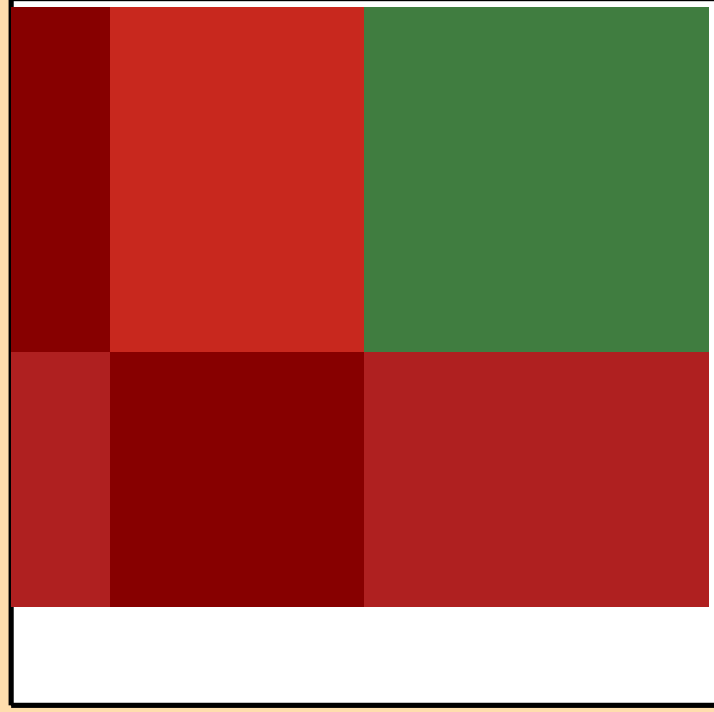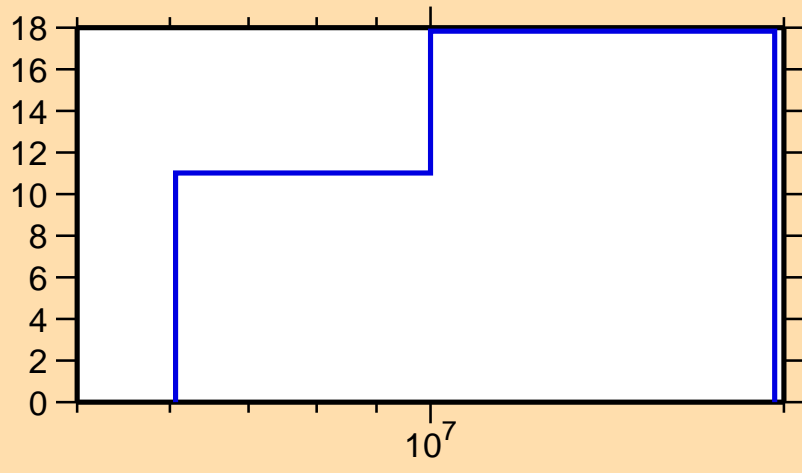


Correlation Matrix



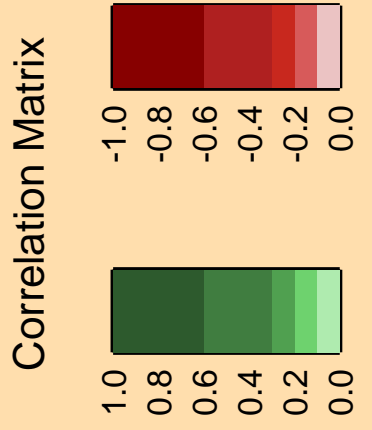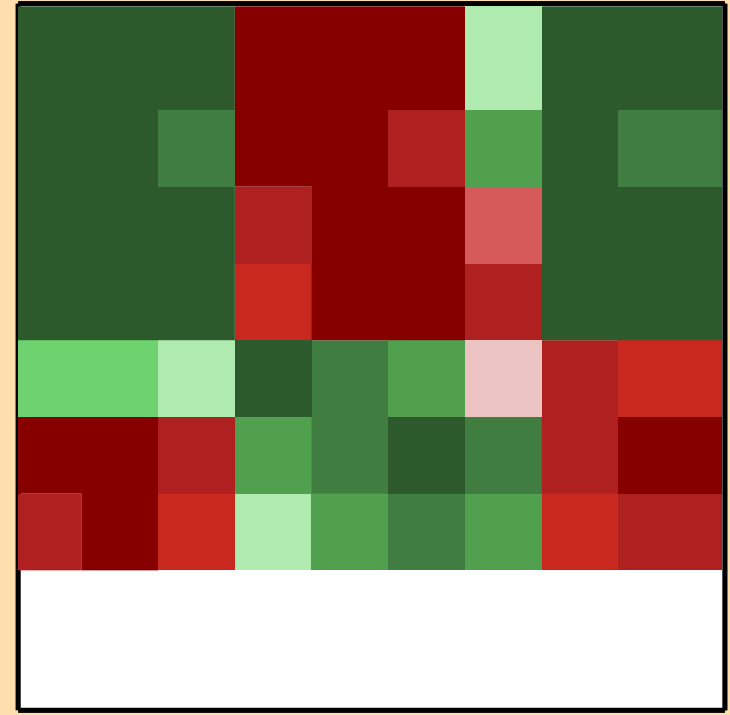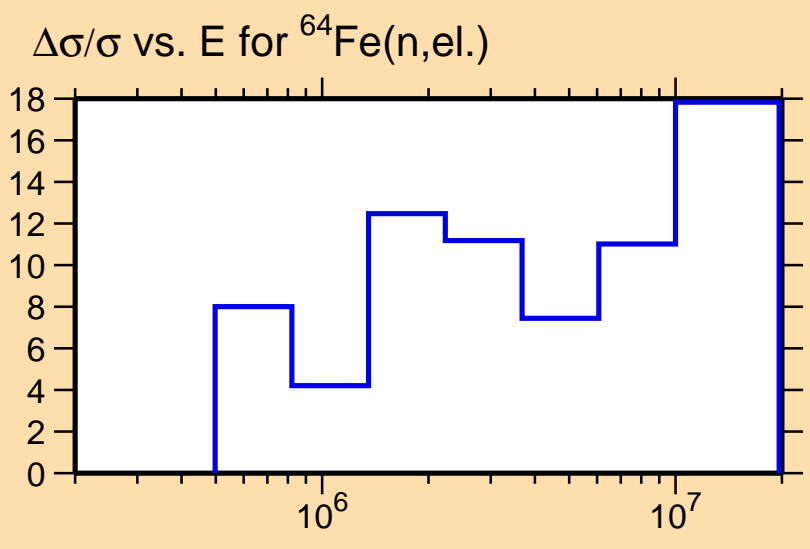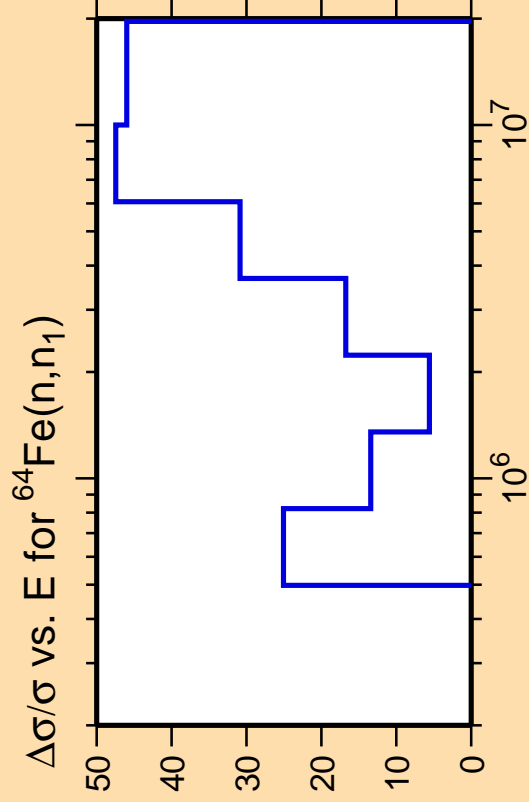



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

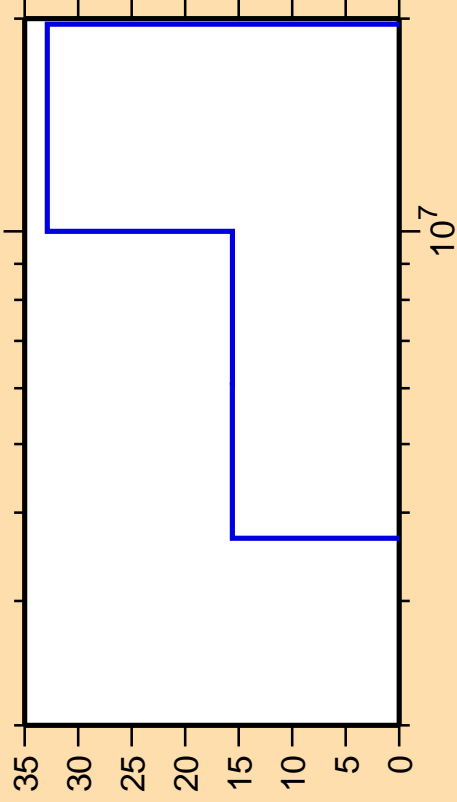

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{el.})$

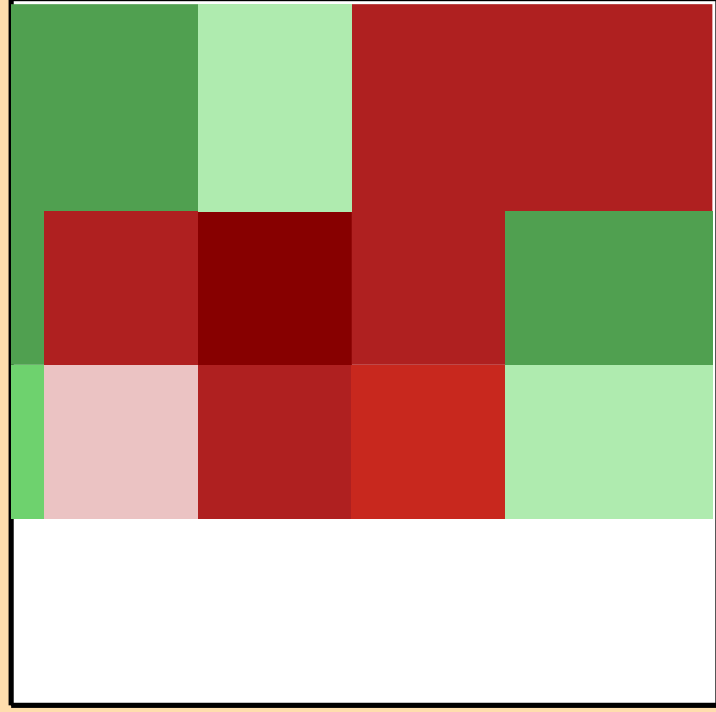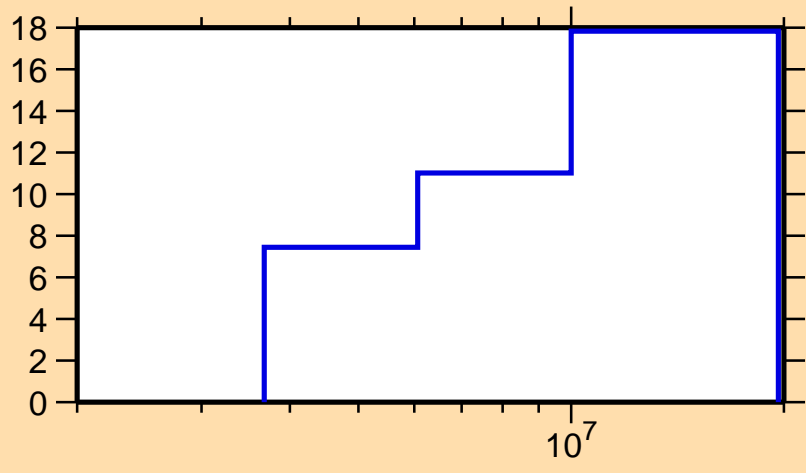

Correlation Matrix







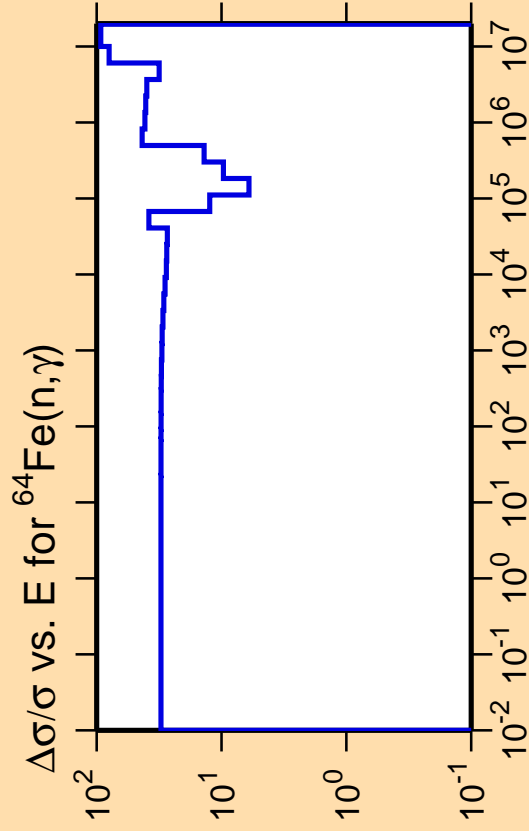

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{el.})$

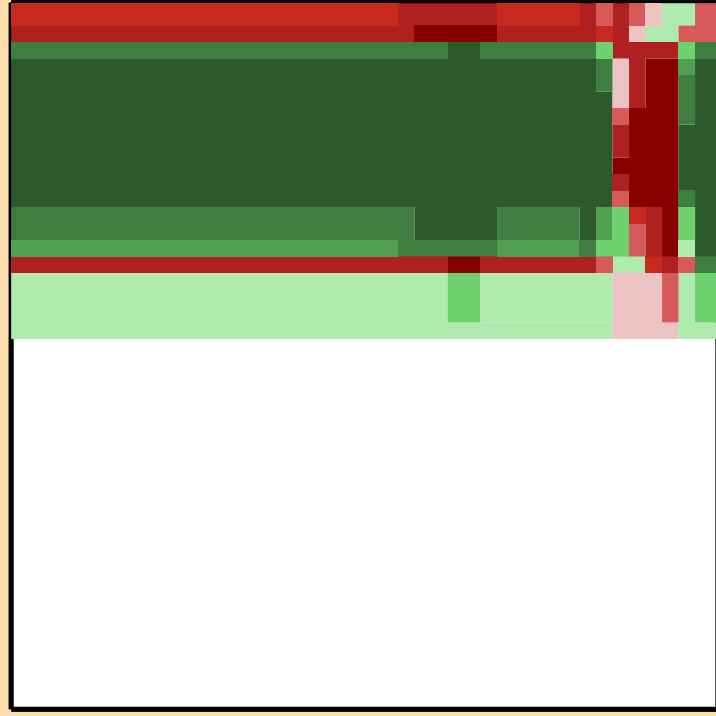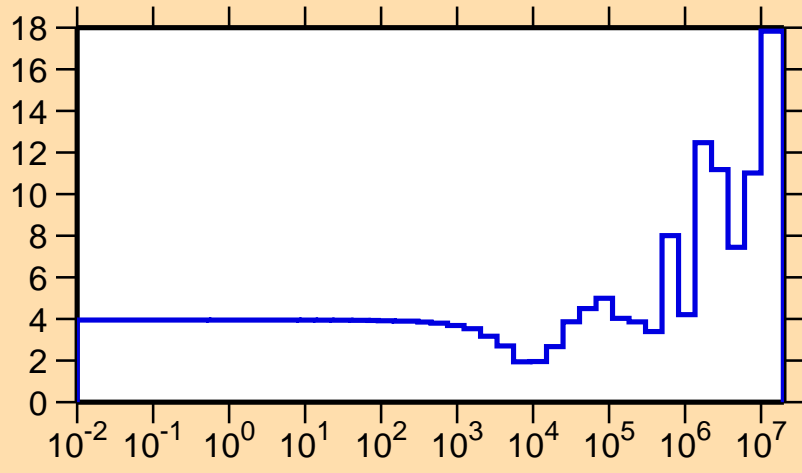

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$




Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,el.)$

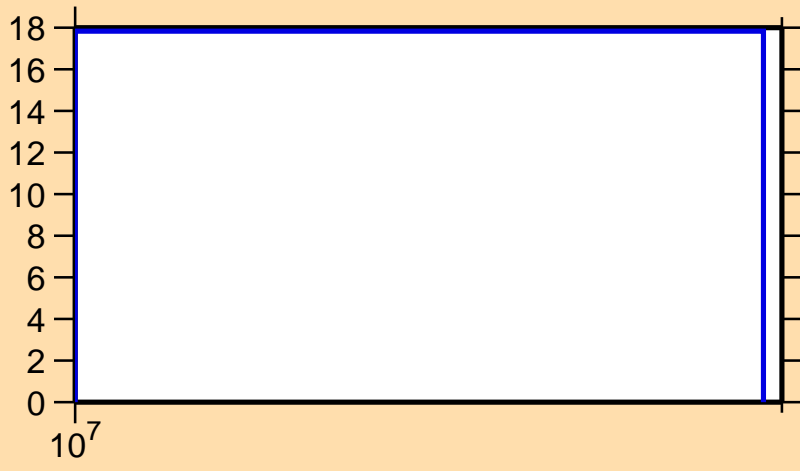

Correlation Matrix




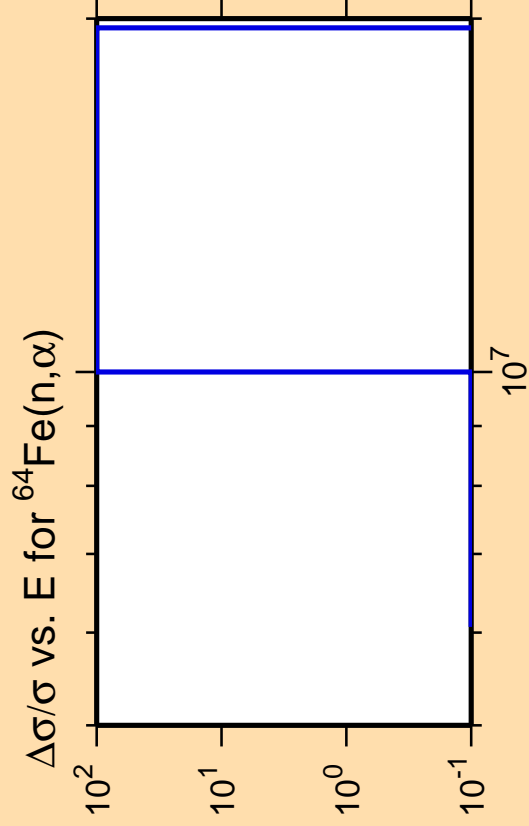


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{el.})$

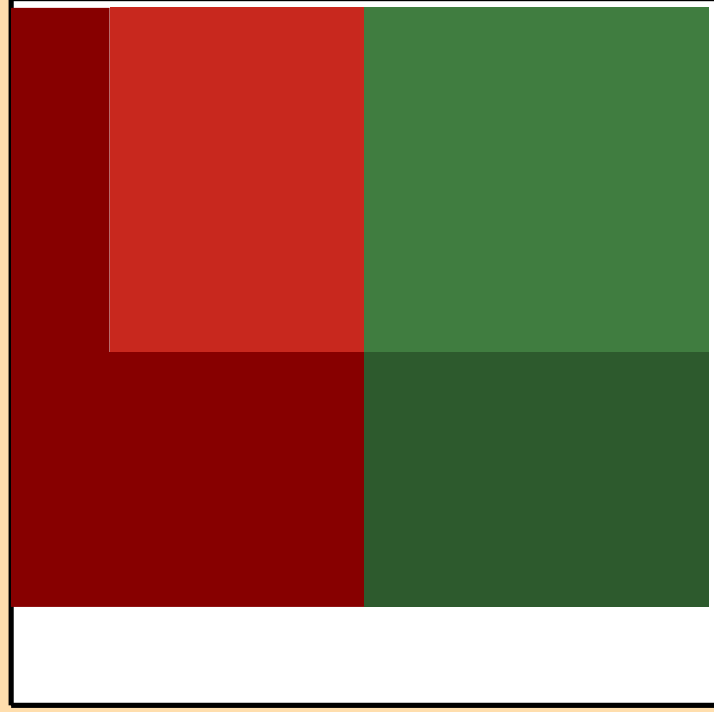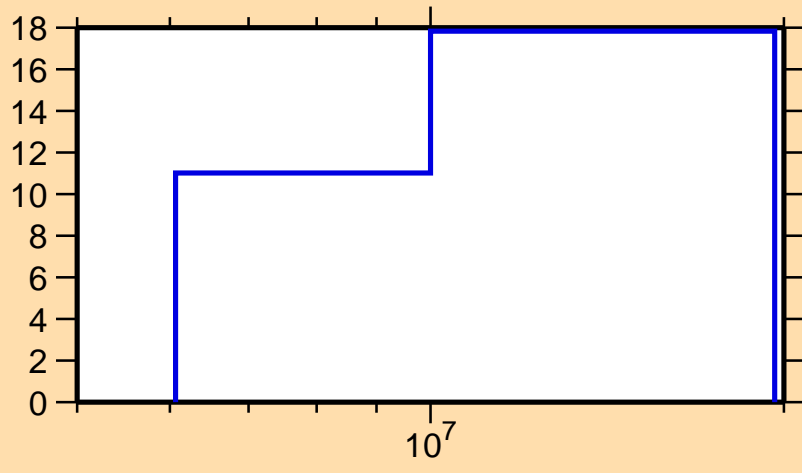



Correlation Matrix



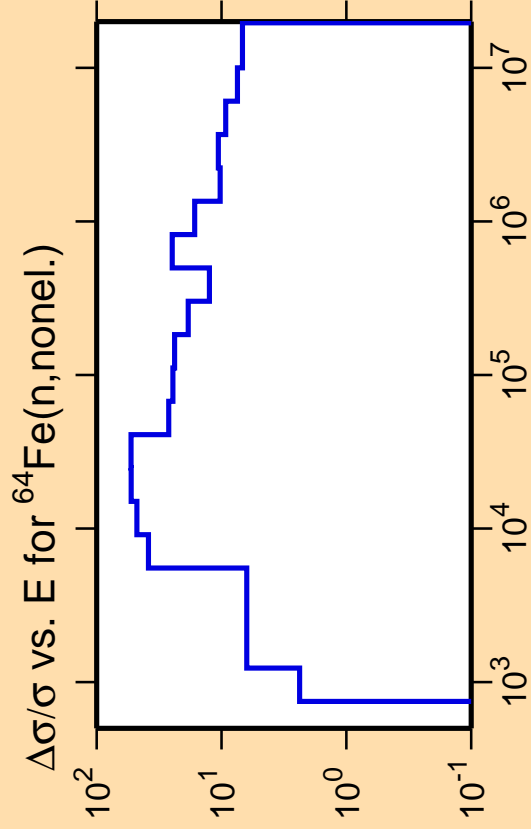


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

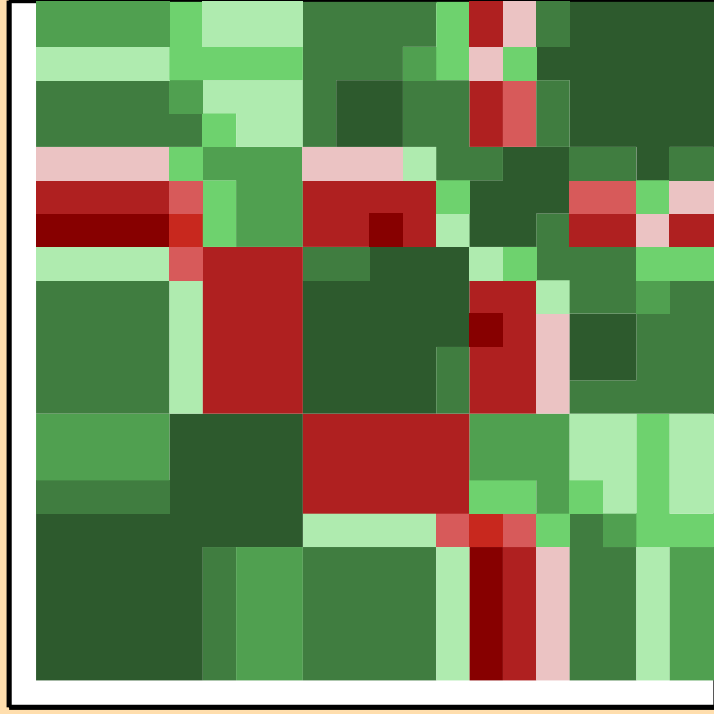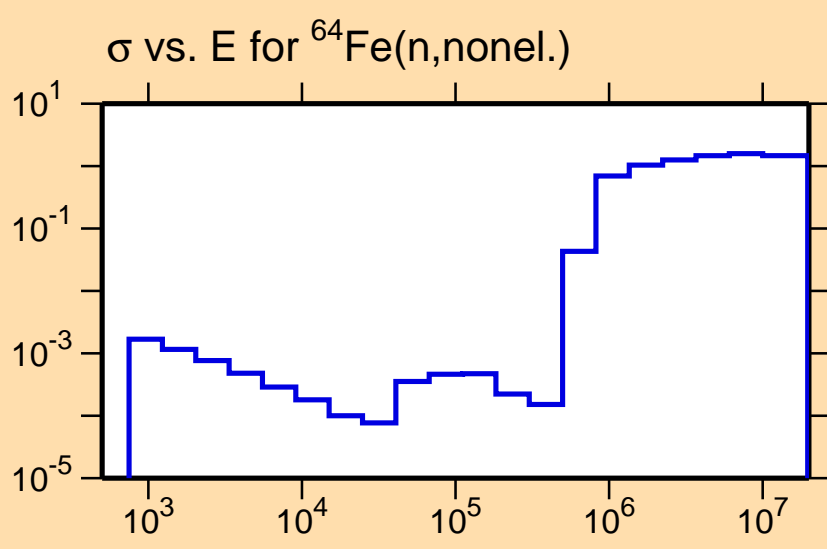



Correlation Matrix



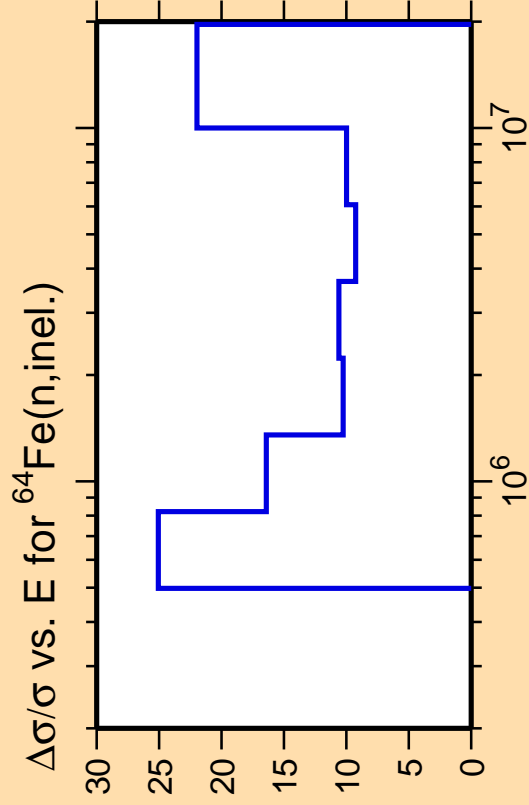

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

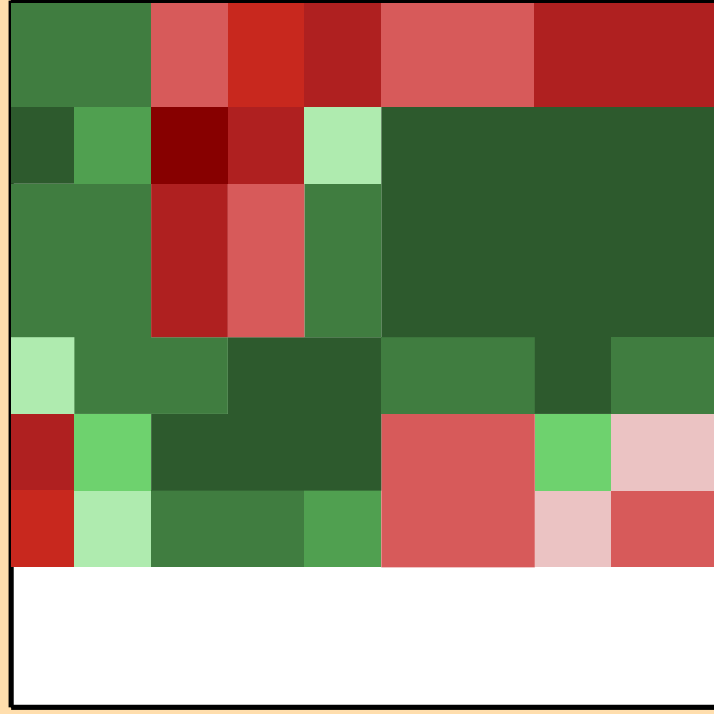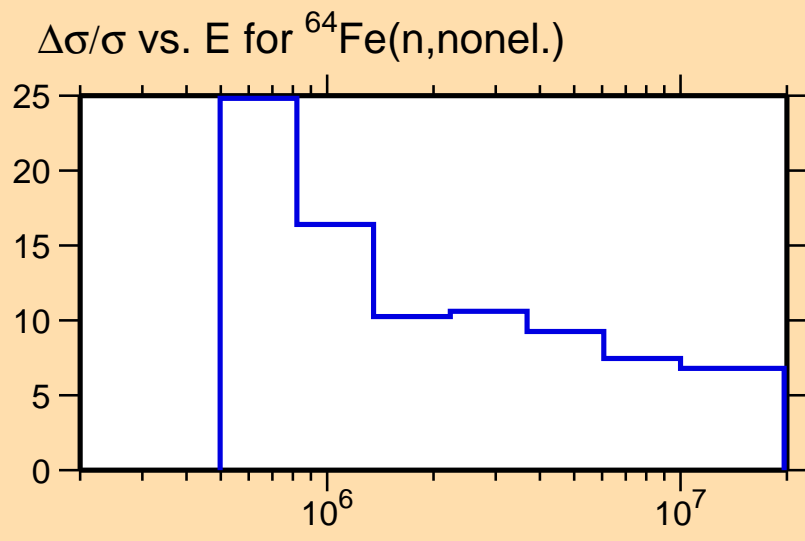

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

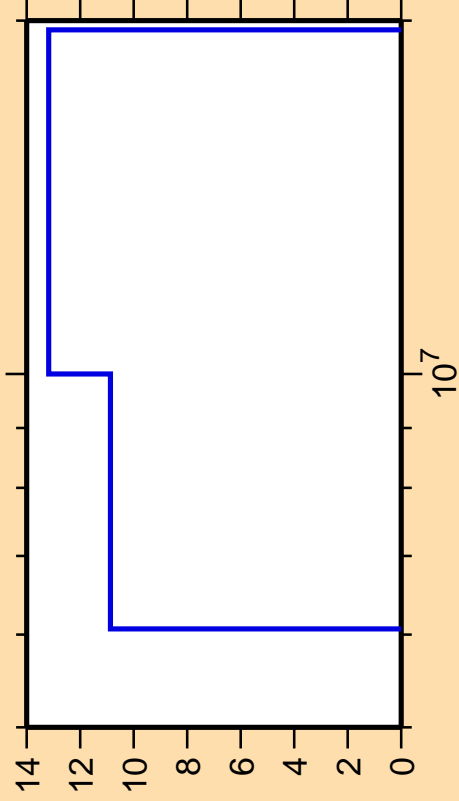

Ordinate scale is %  
relative standard deviation.




Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{nonel.})$

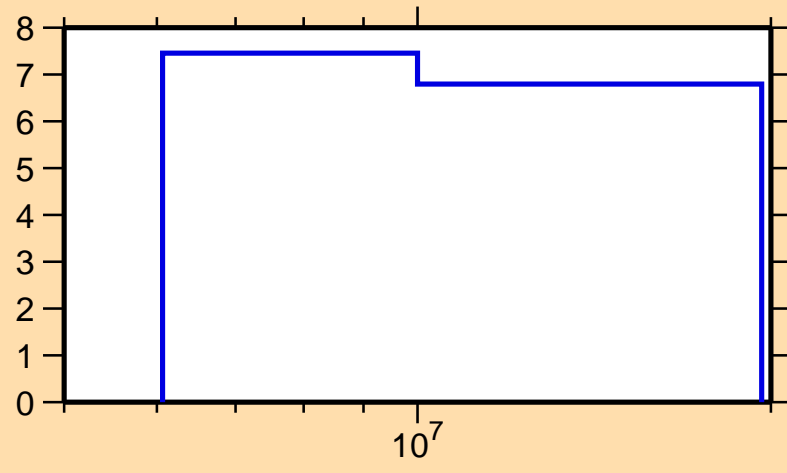


Correlation Matrix



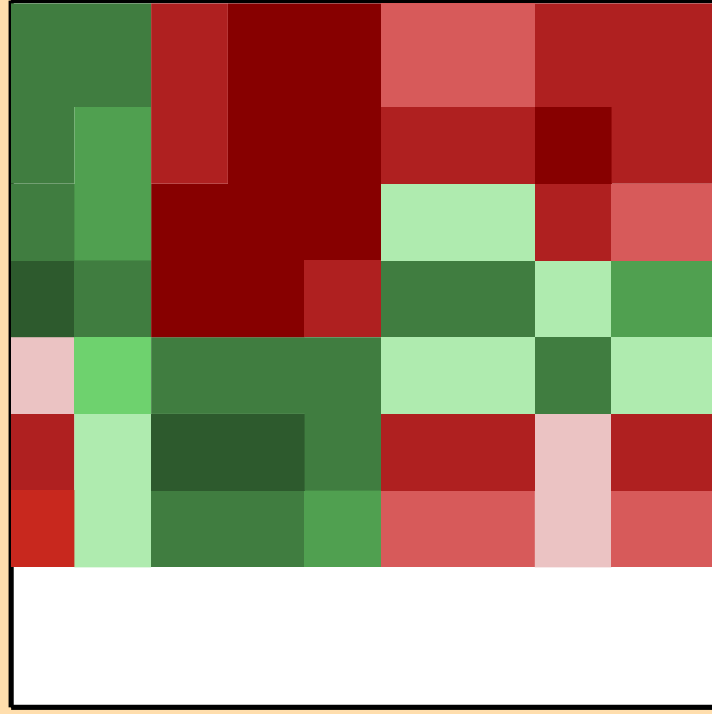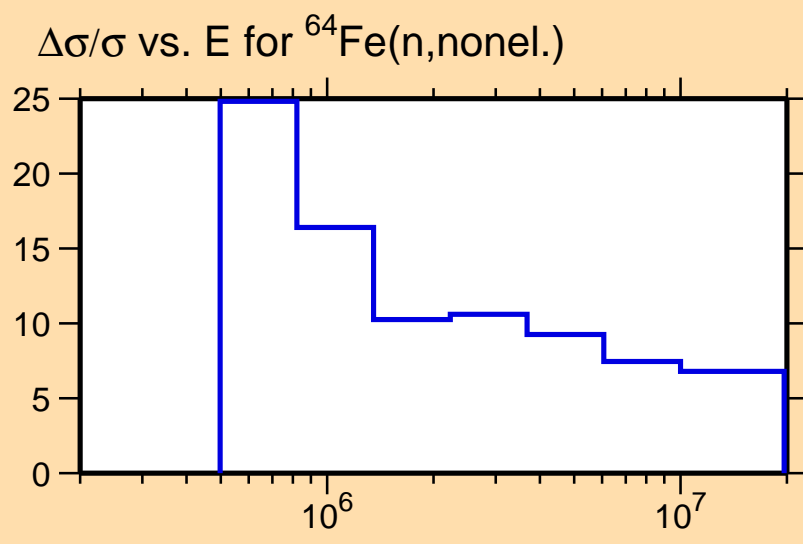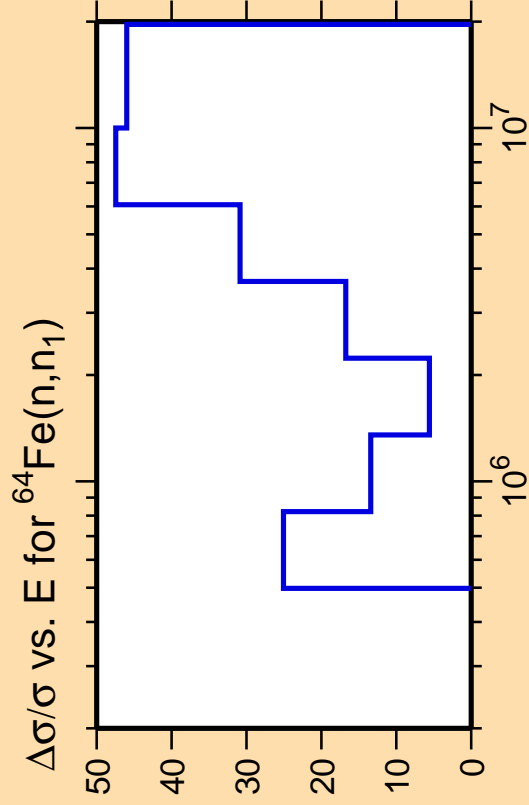



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

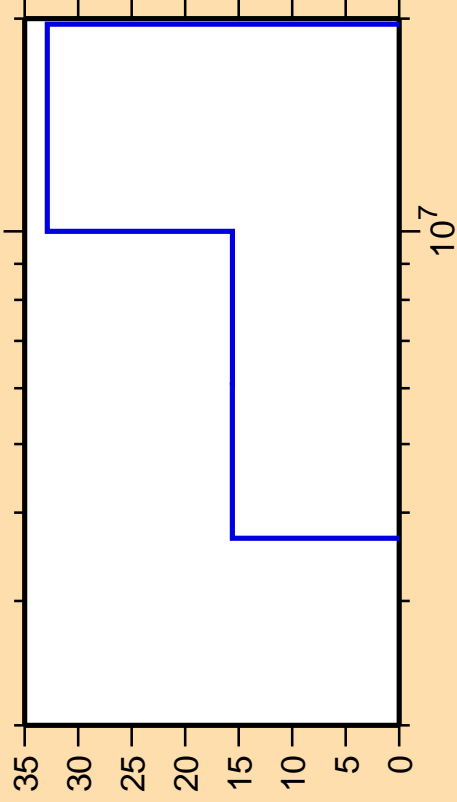

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{nonel.})$

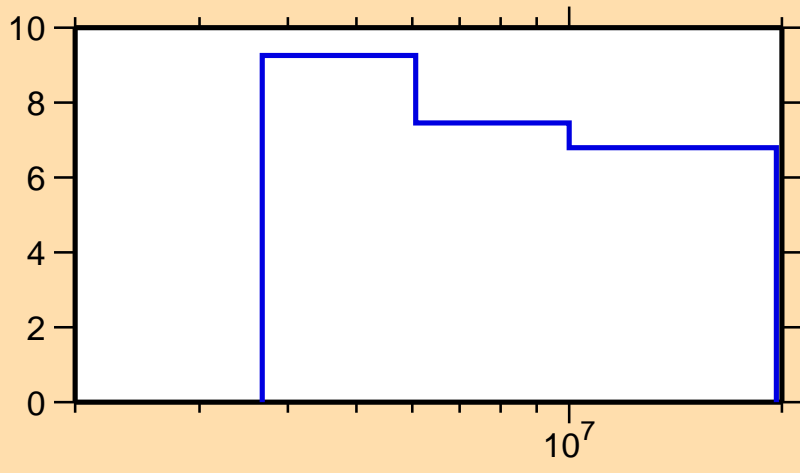

Correlation Matrix







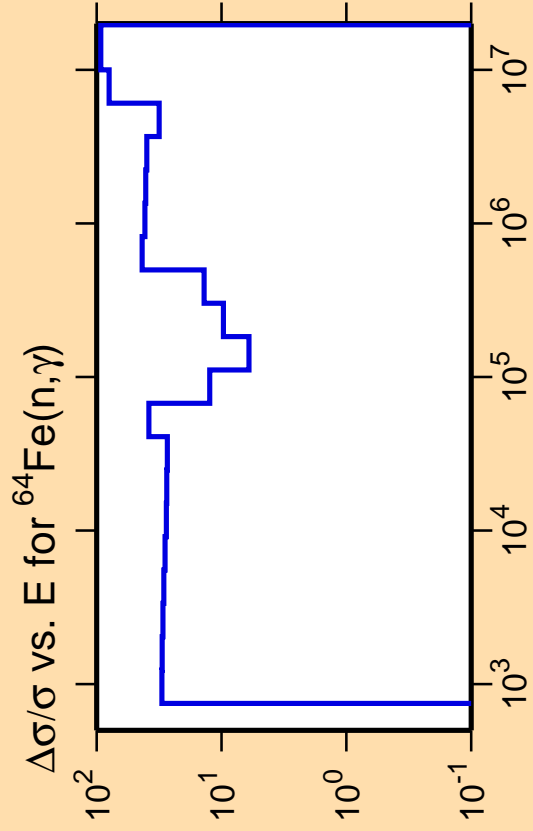

Ordinate scale is %  
relative standard deviation.

Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{nonel.})$

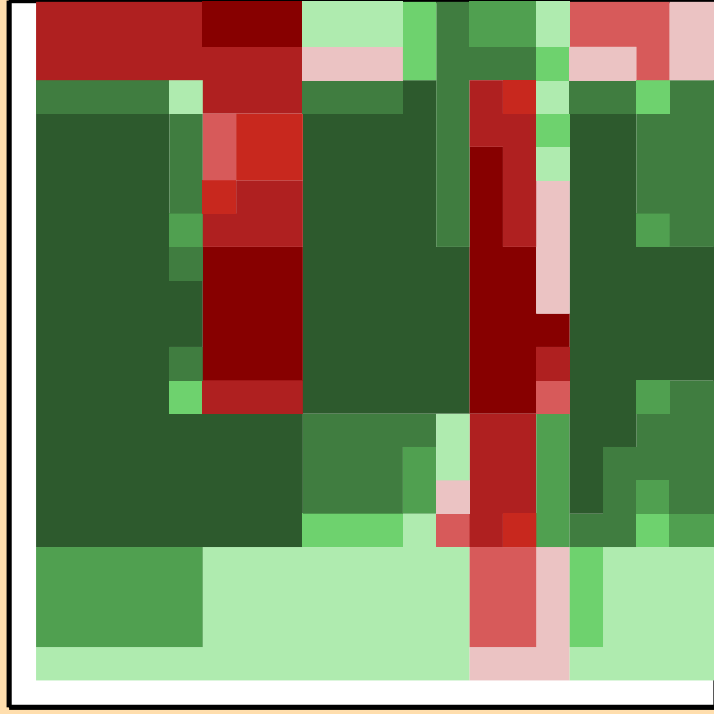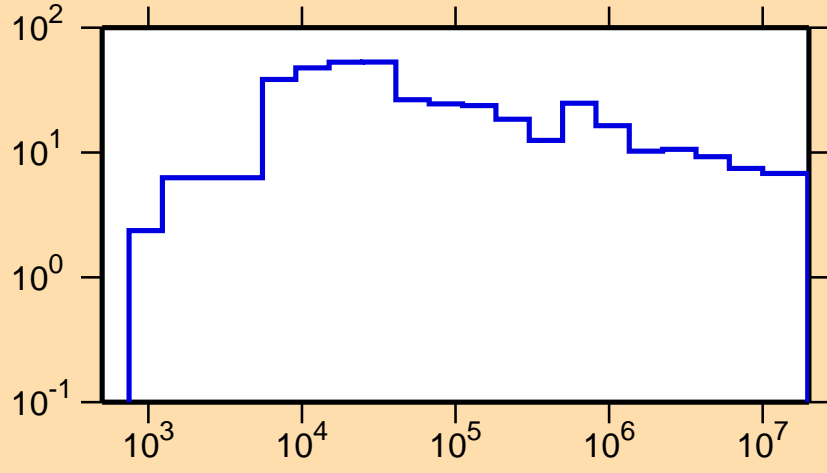

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$





Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{nonel.})$

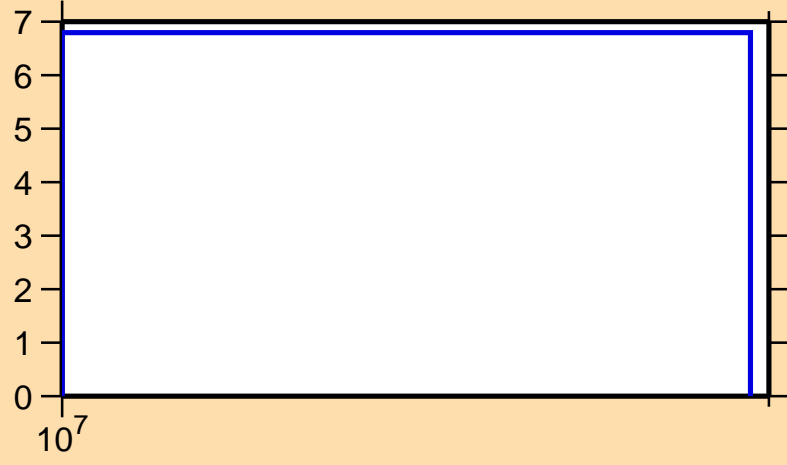

Correlation Matrix




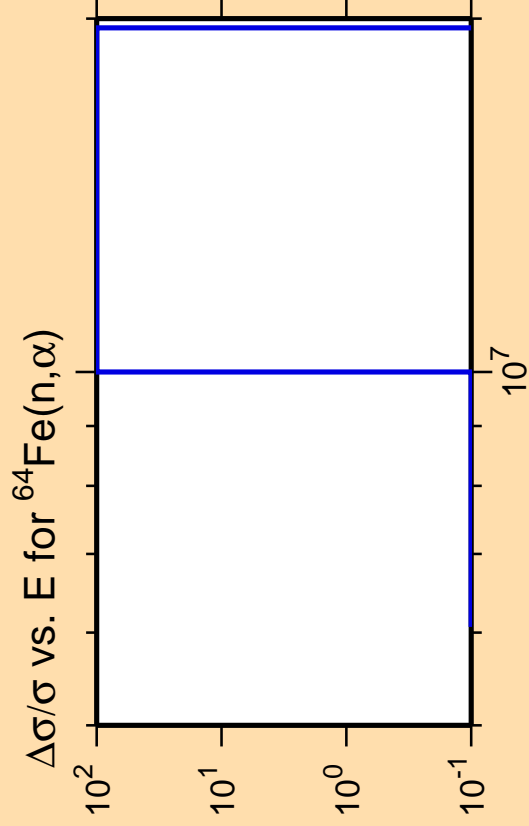


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{nonel.})$

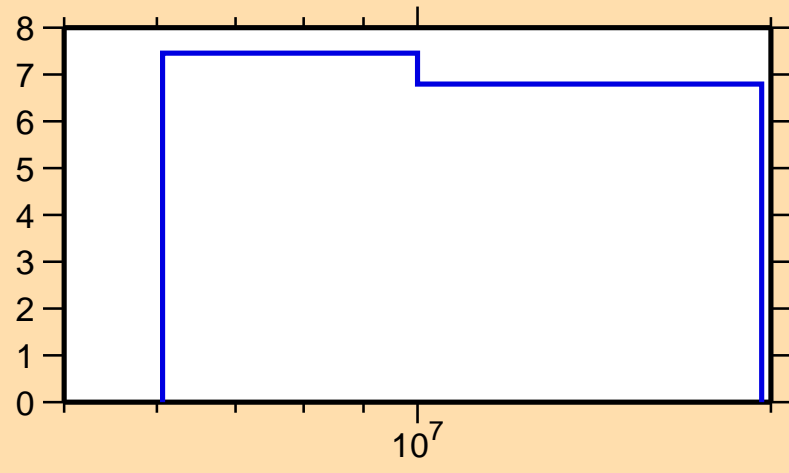

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{inel.})$

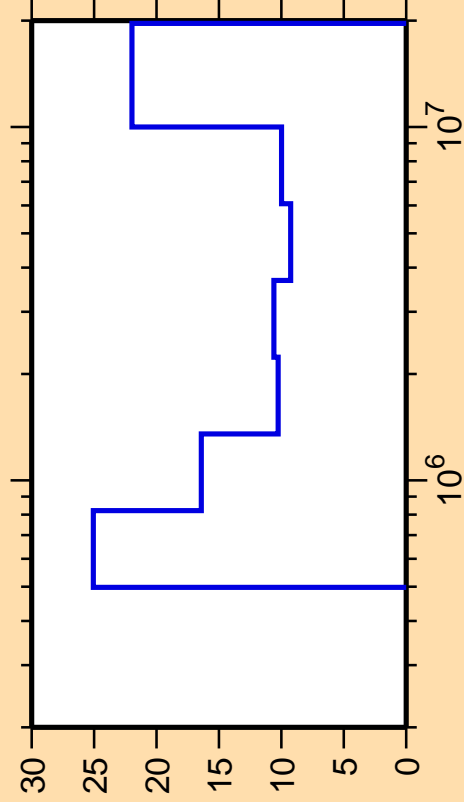

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{inel.})$

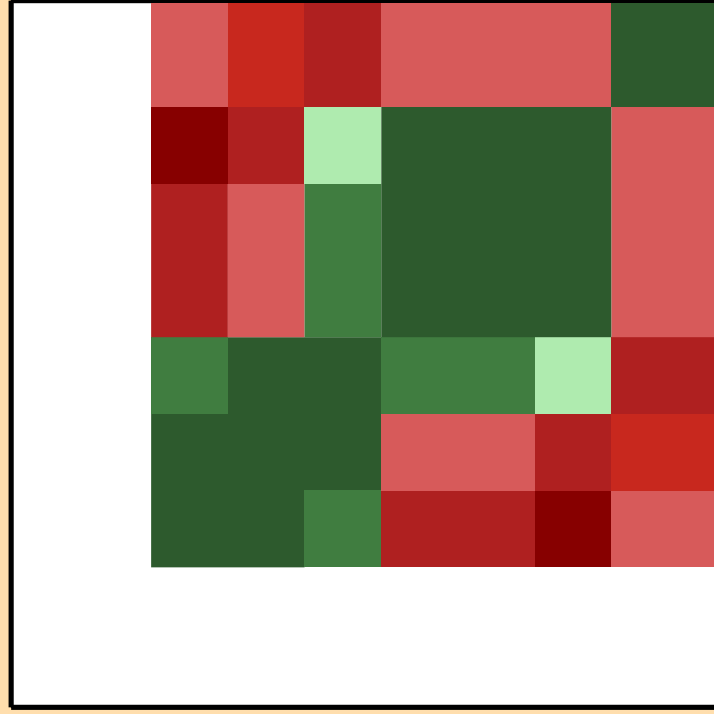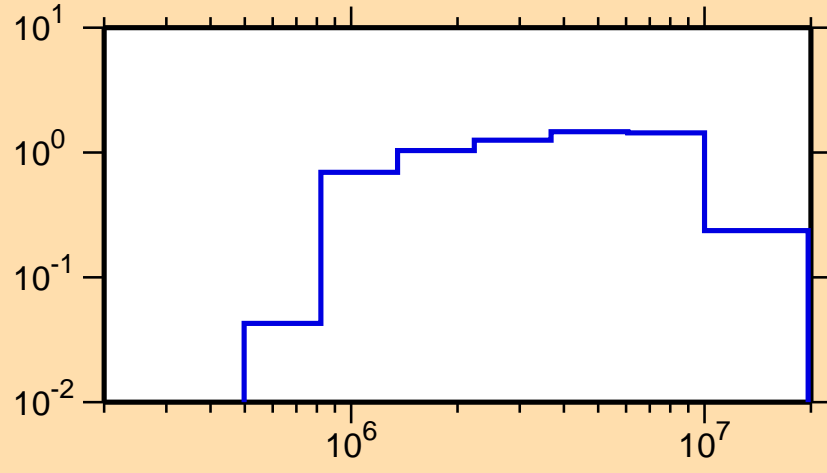

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

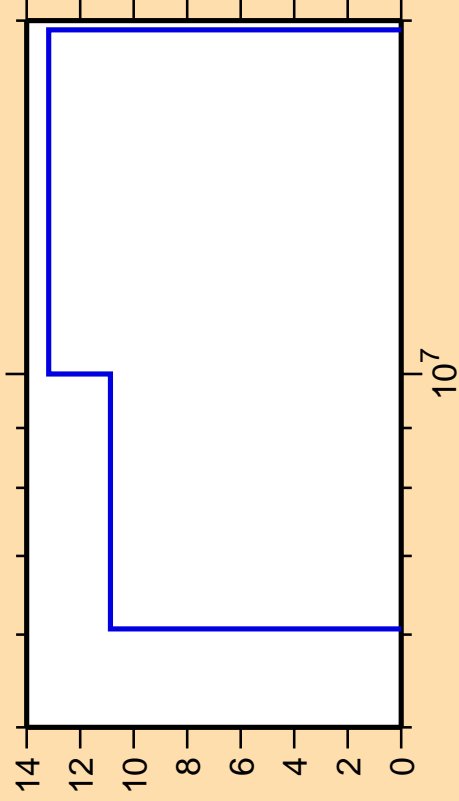

Ordinate scale is %  
relative standard deviation.




Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{inel.})$

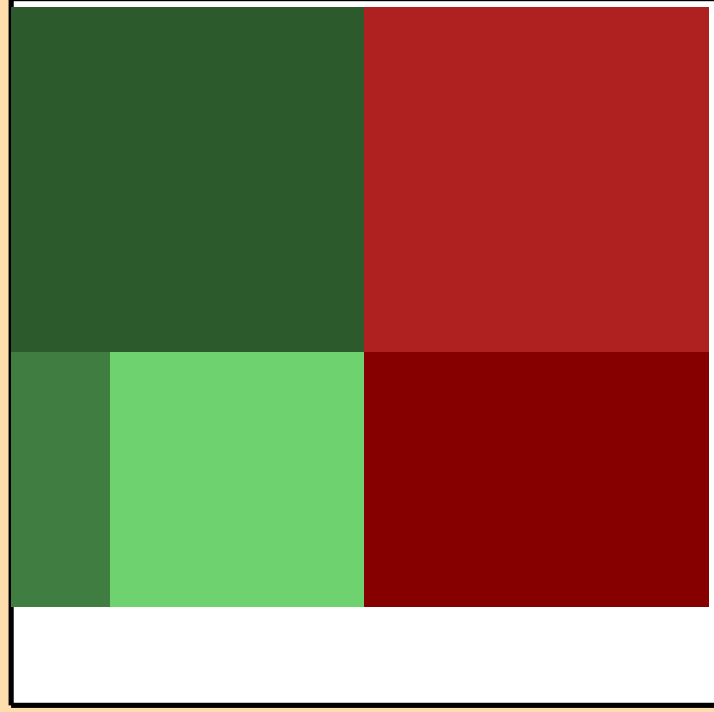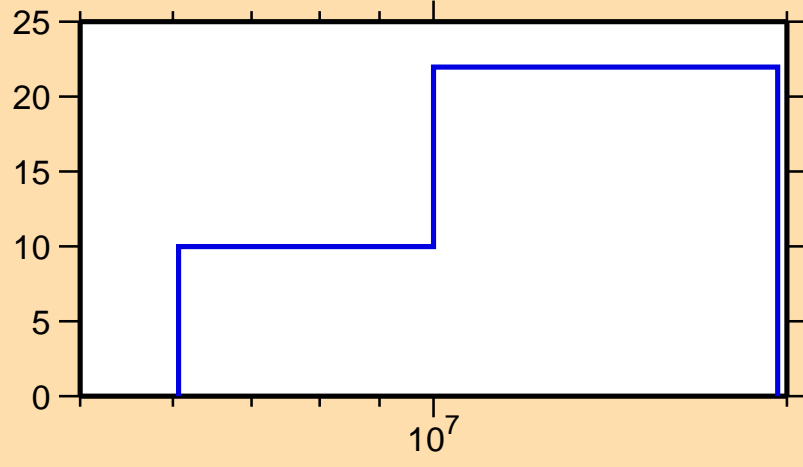


Correlation Matrix



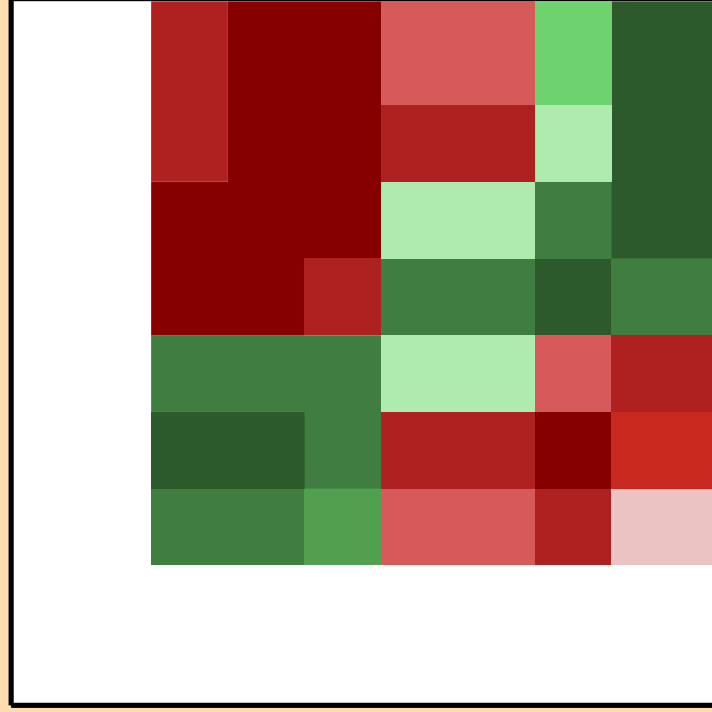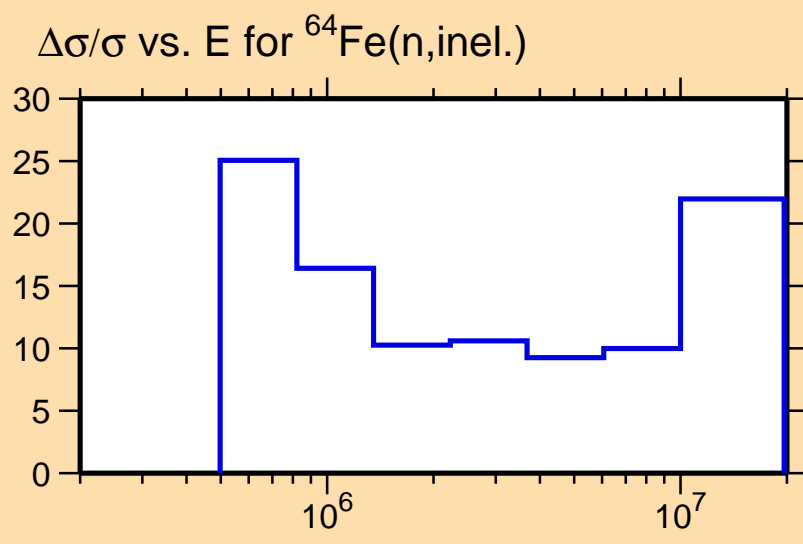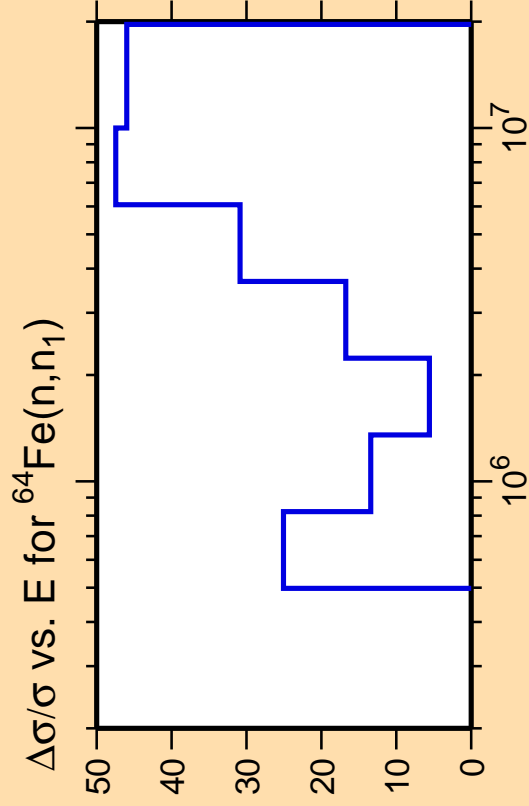



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

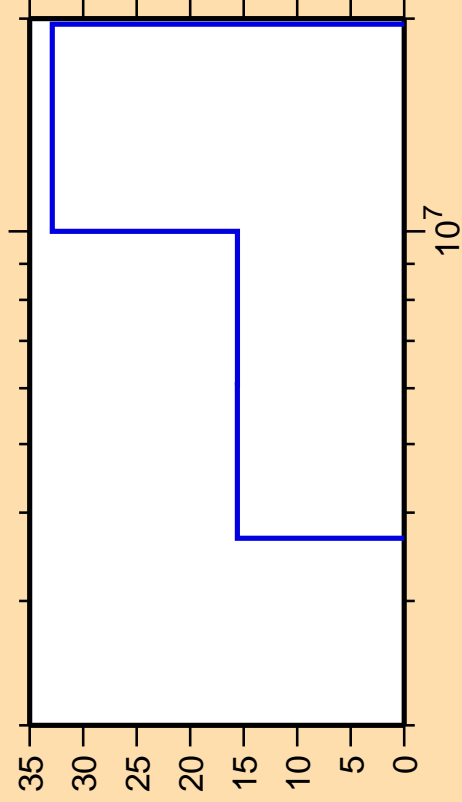

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{inel.})$

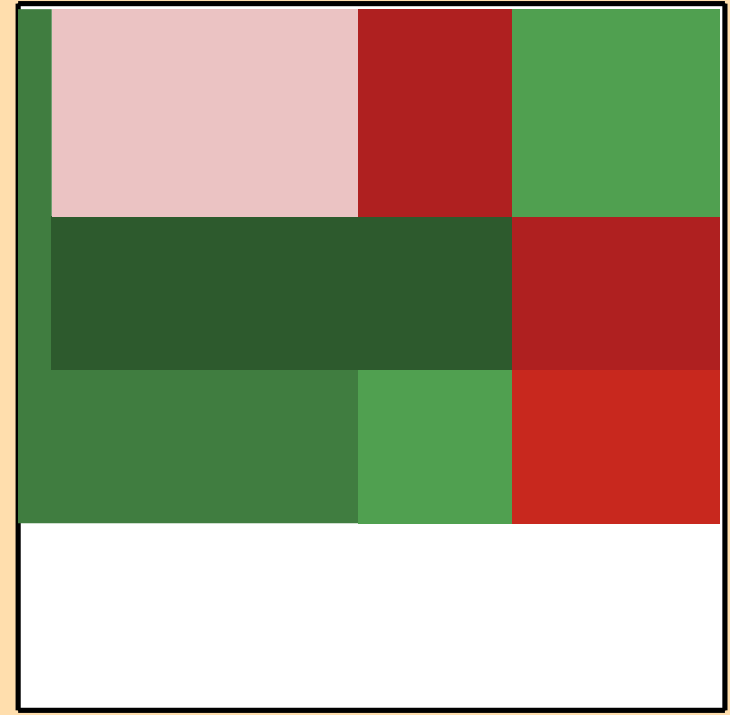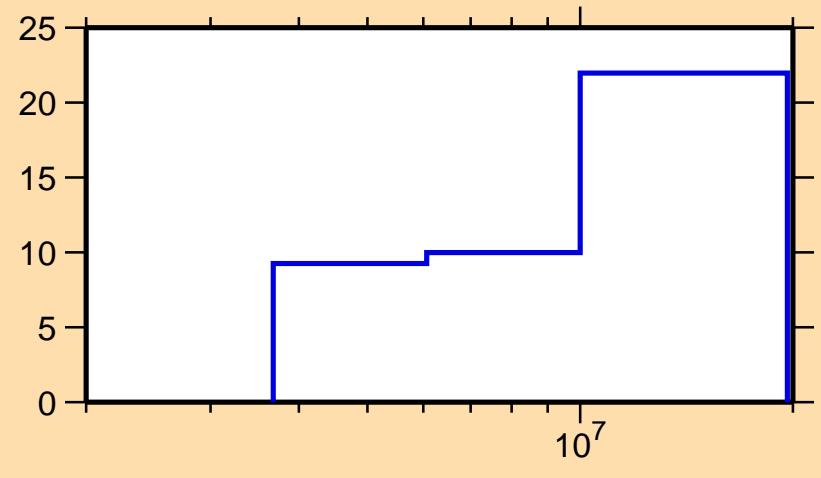

Correlation Matrix




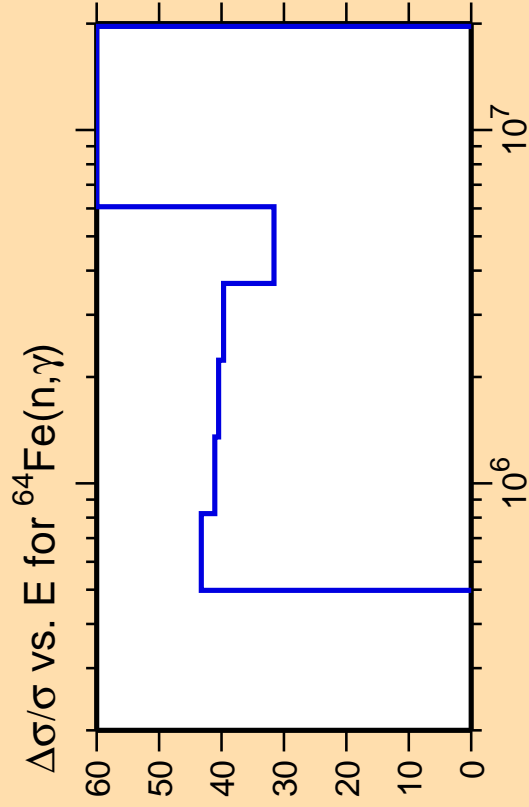


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{inel.})$

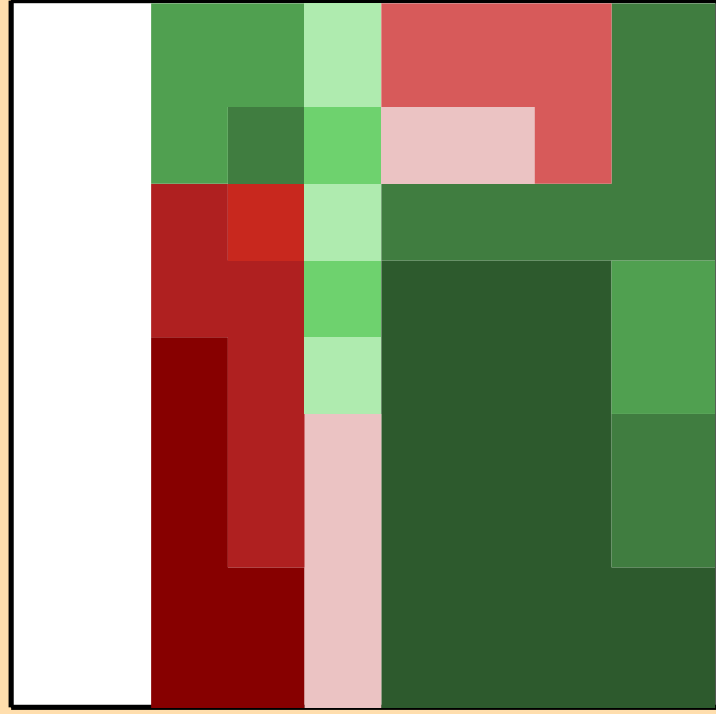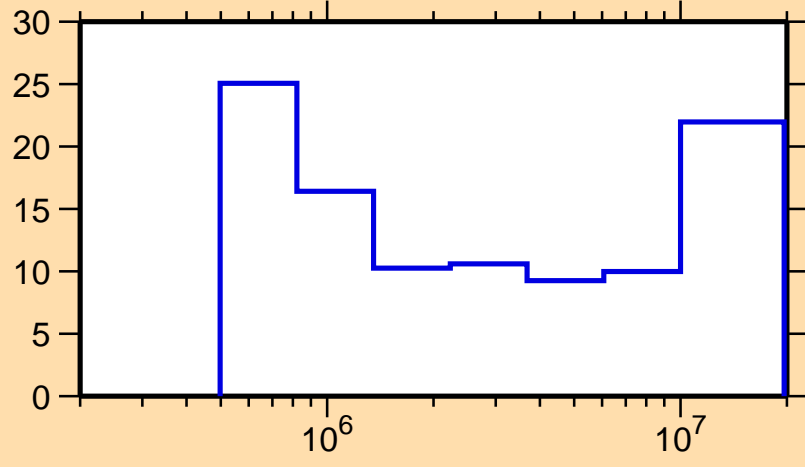

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$





Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\text{inel.})$

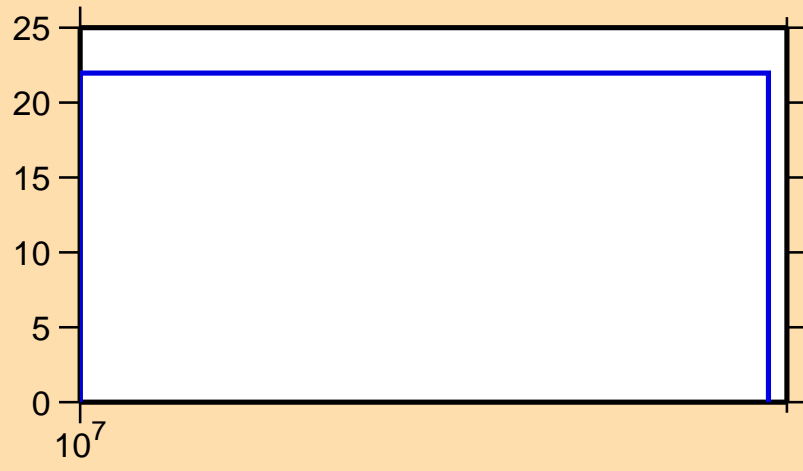

Correlation Matrix





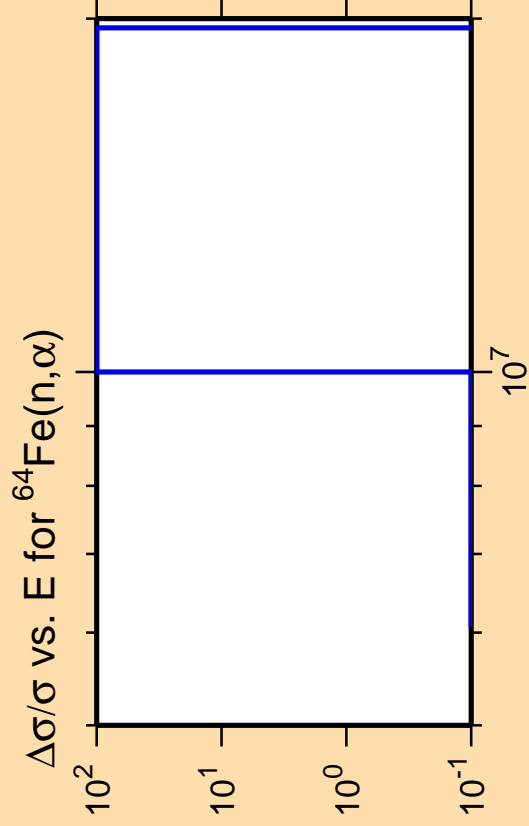

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

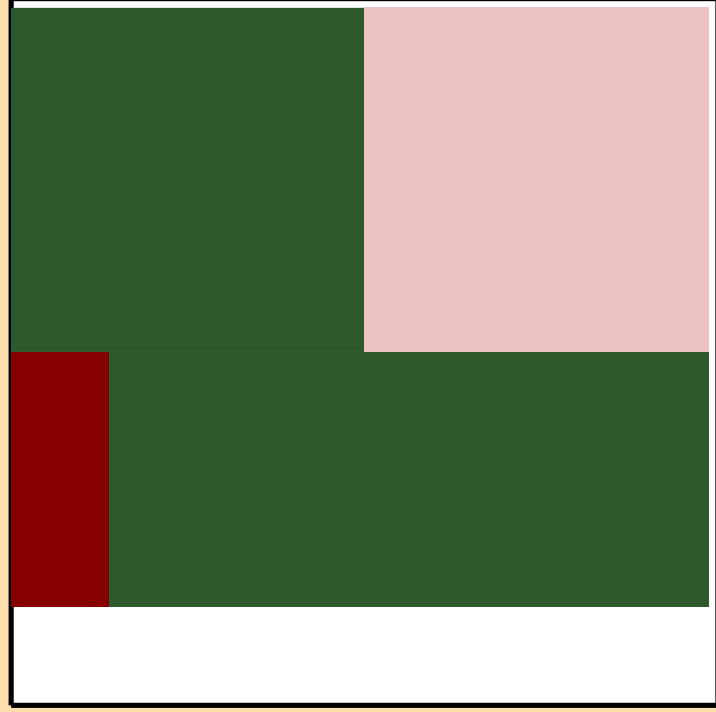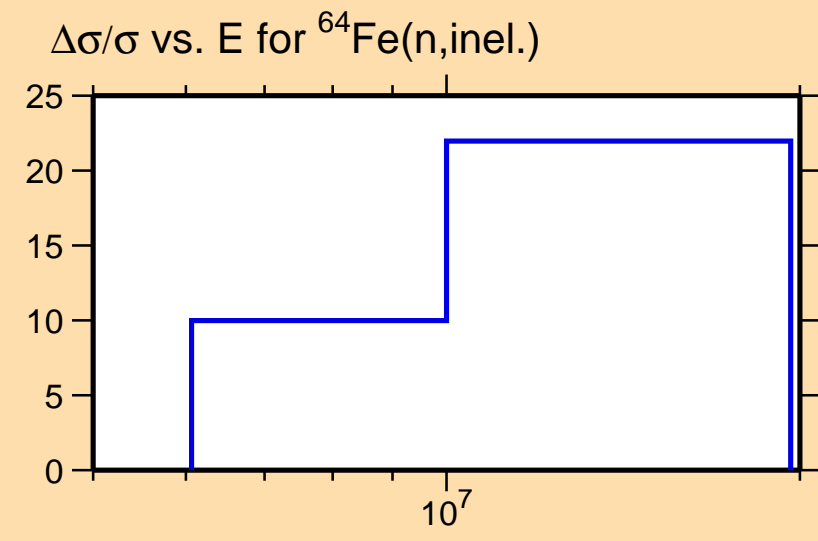

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

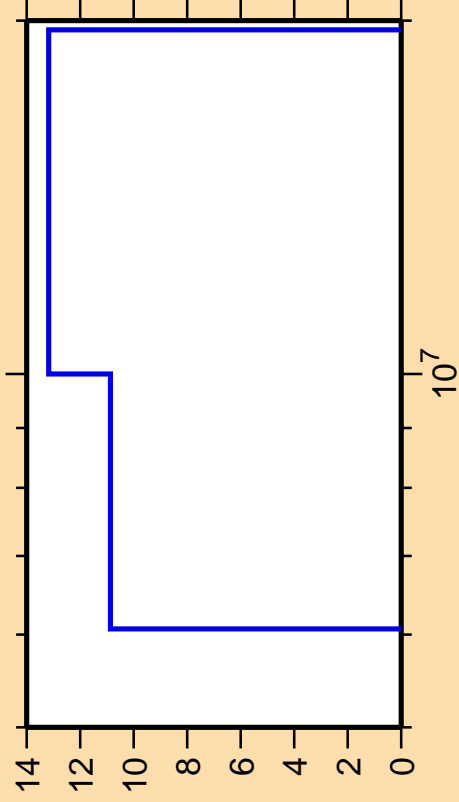

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

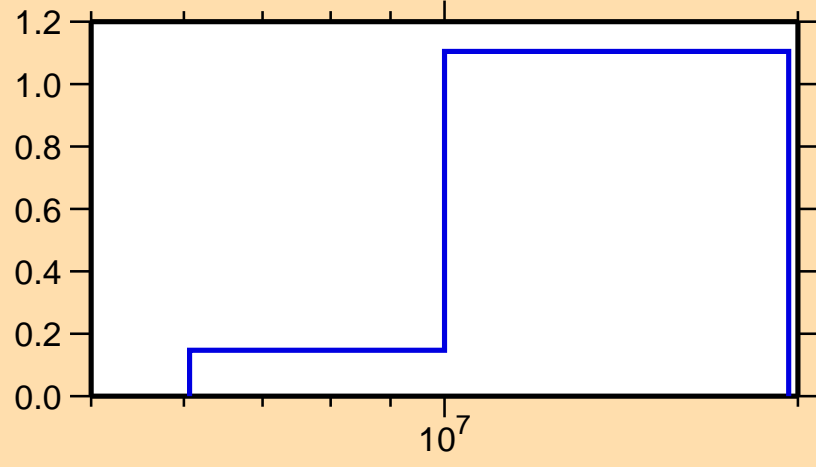

Correlation Matrix





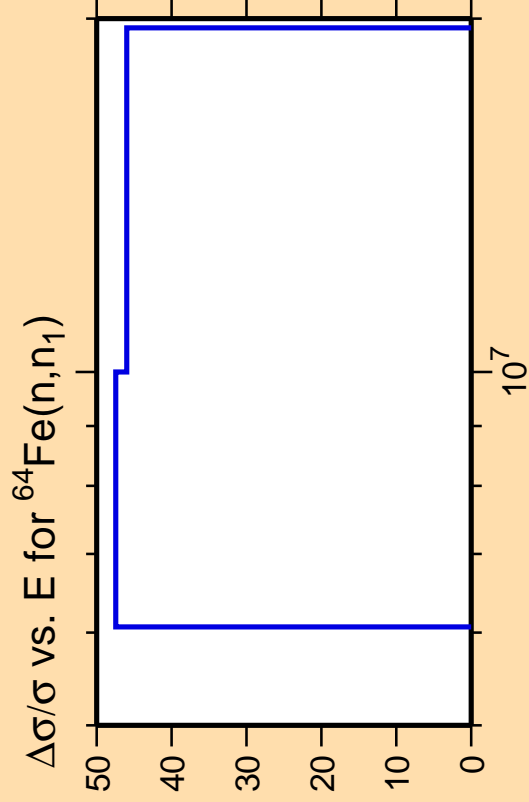

Ordinate scale is %  
relative standard deviation.

Abcissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

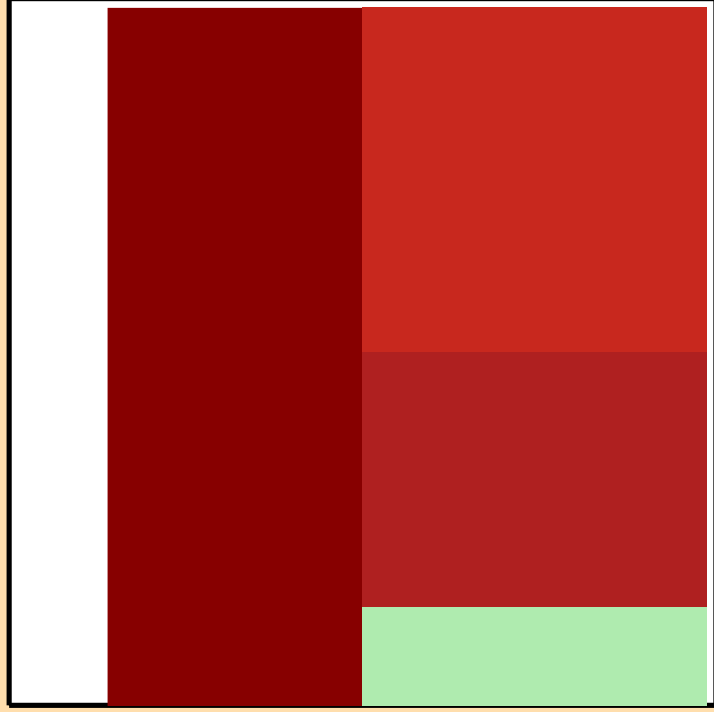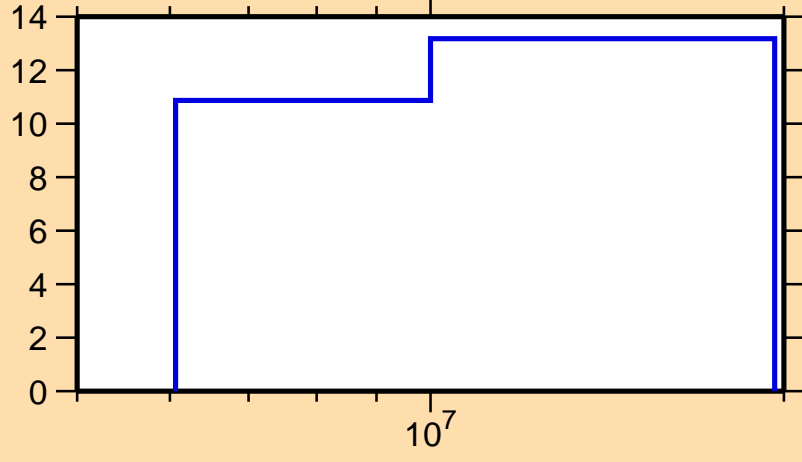

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

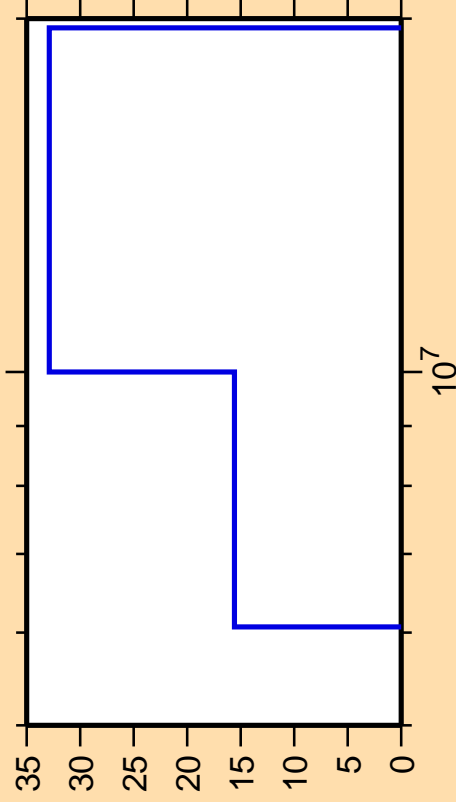

Ordinate scale is %  
relative standard deviation.

Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

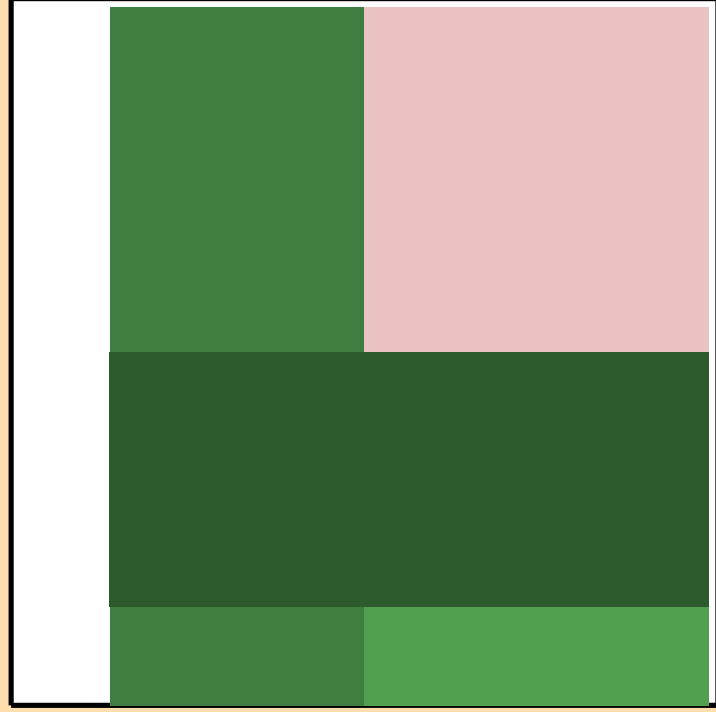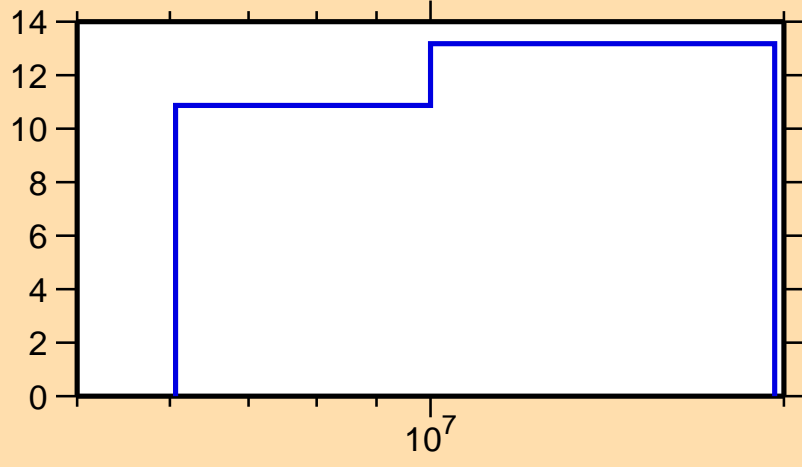

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\gamma)$





Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

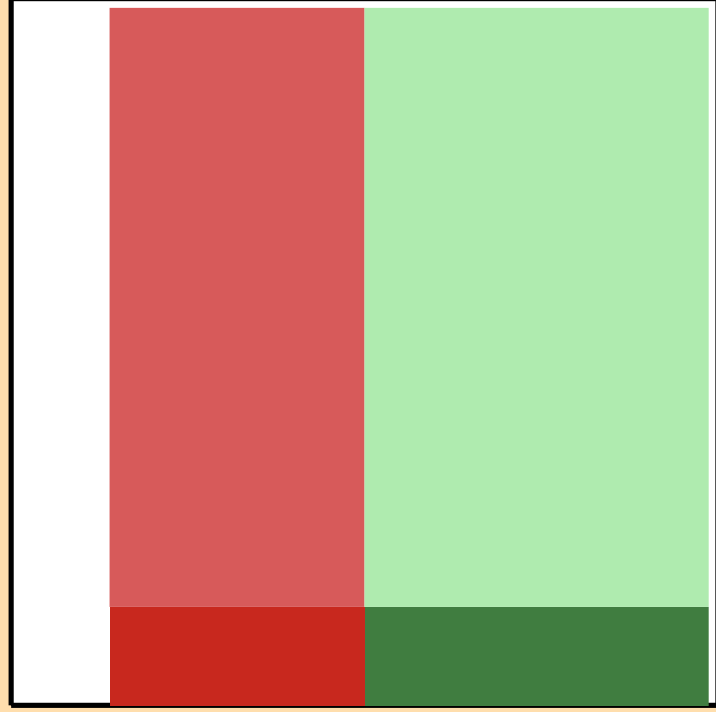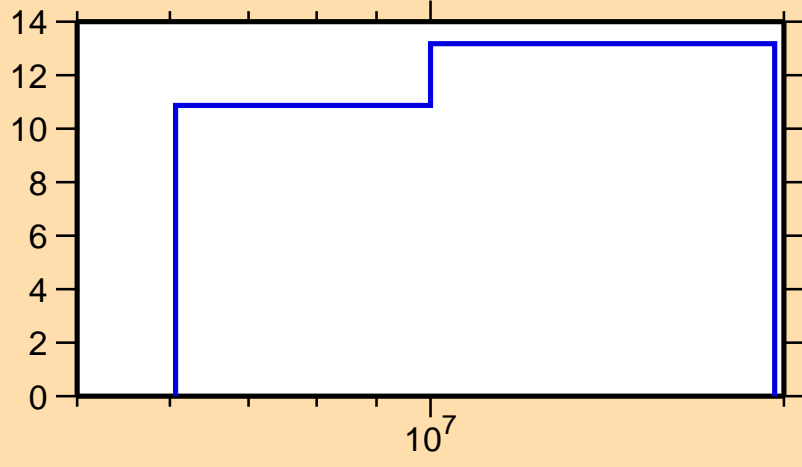

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$





Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

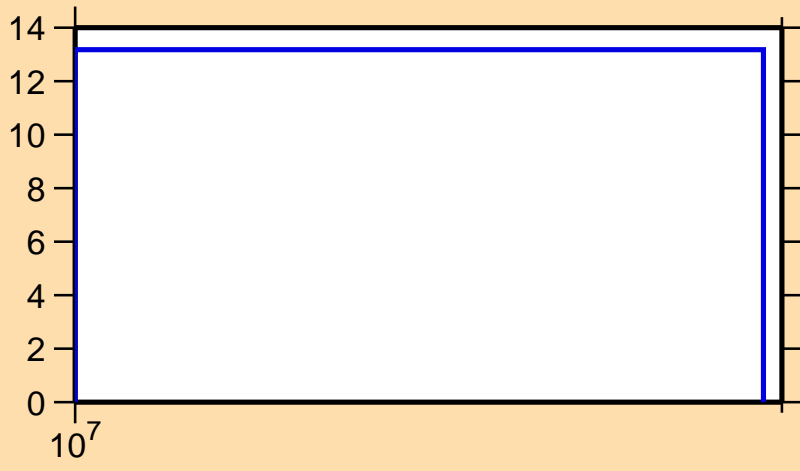

Correlation Matrix




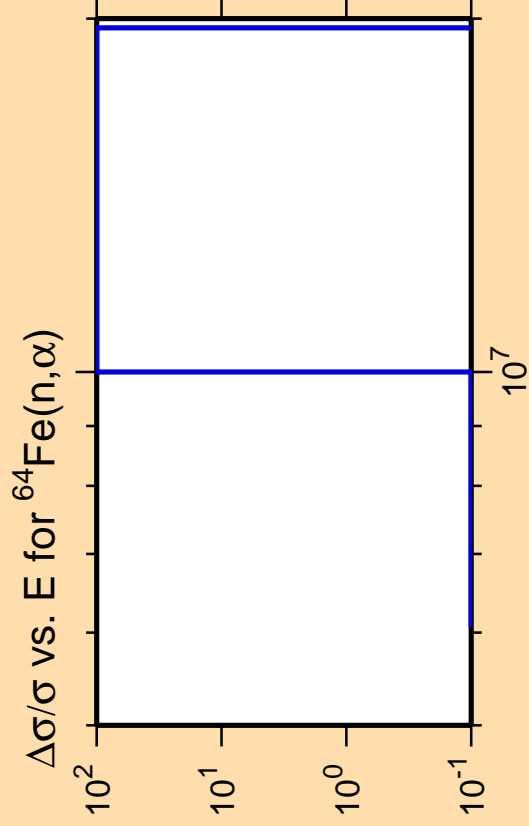


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,2n)$

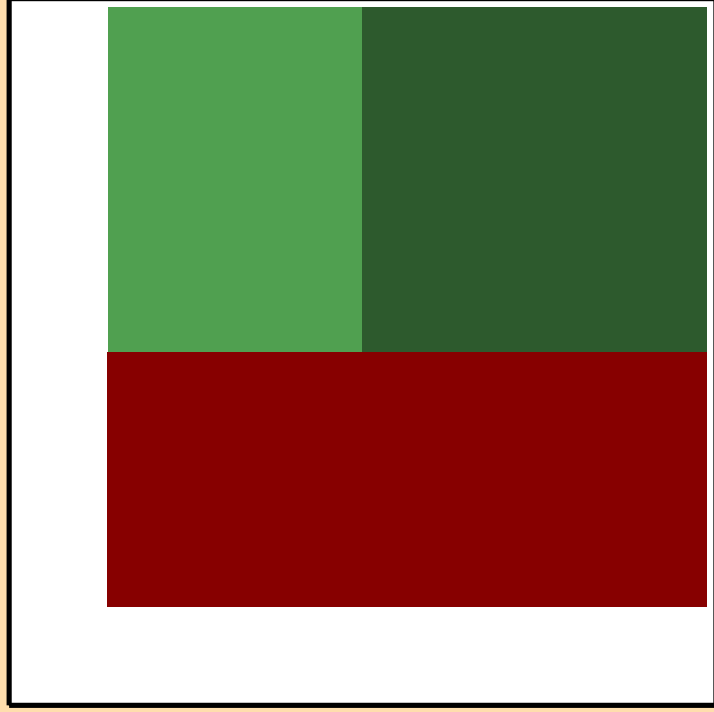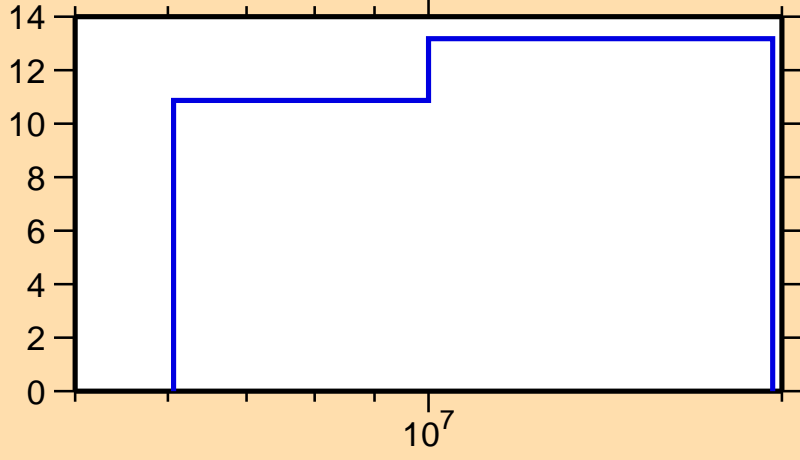


Correlation Matrix






$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,3n)$

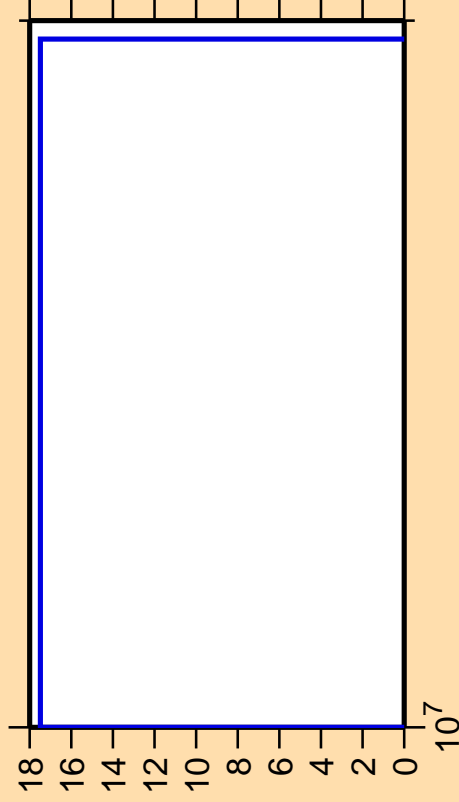

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{64}\text{Fe}(n,3n)$

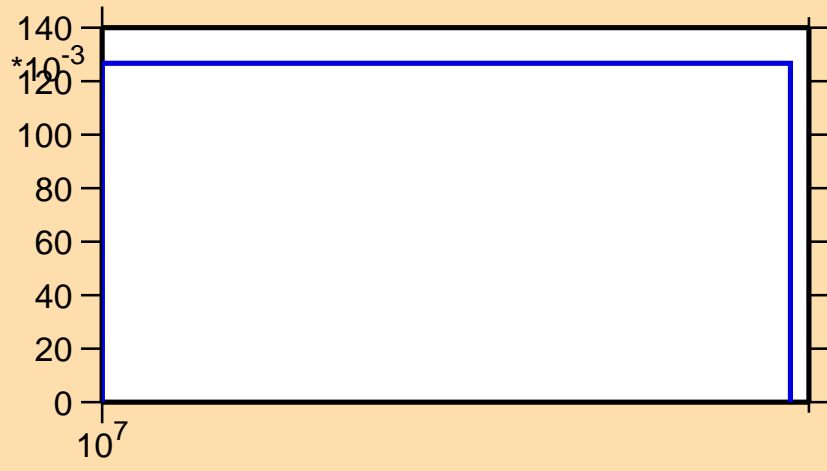

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\alpha)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{64}\text{Fe}(n,n\alpha)$

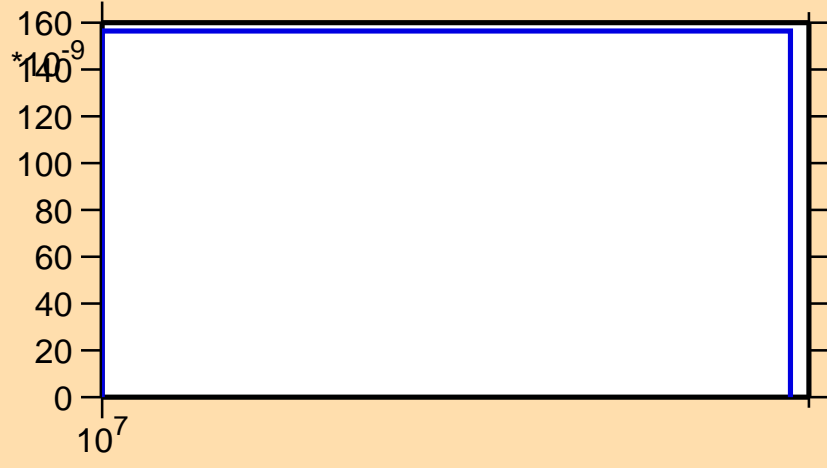

$10^7$



Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,np)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{64}\text{Fe}(n,np)$

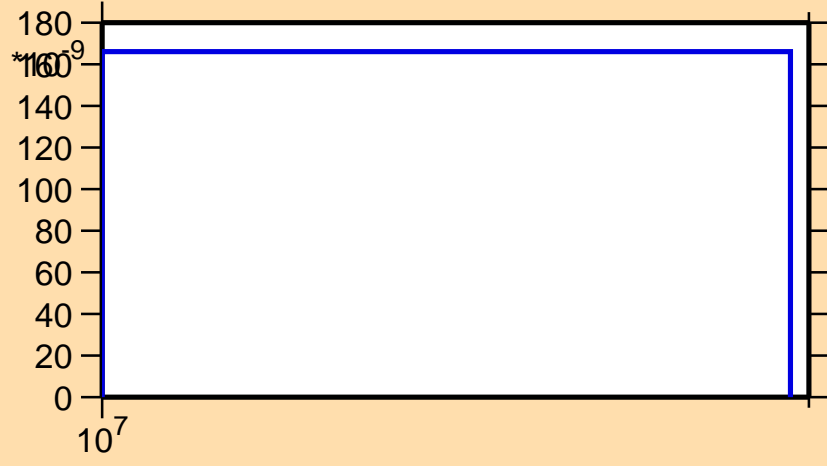


$10^7$



Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,nt)$

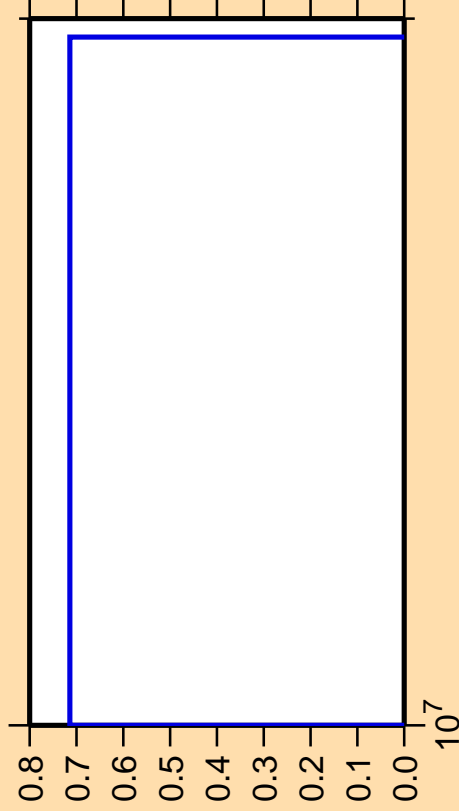

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{64}\text{Fe}(n,nt)$

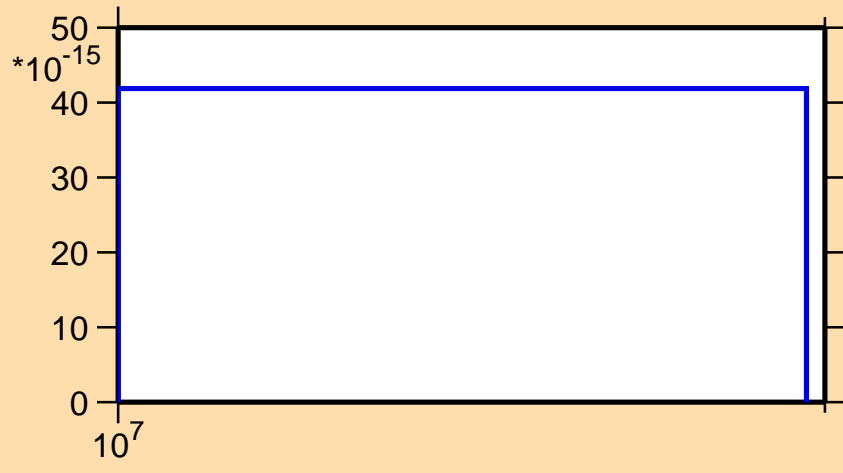



Correlation Matrix



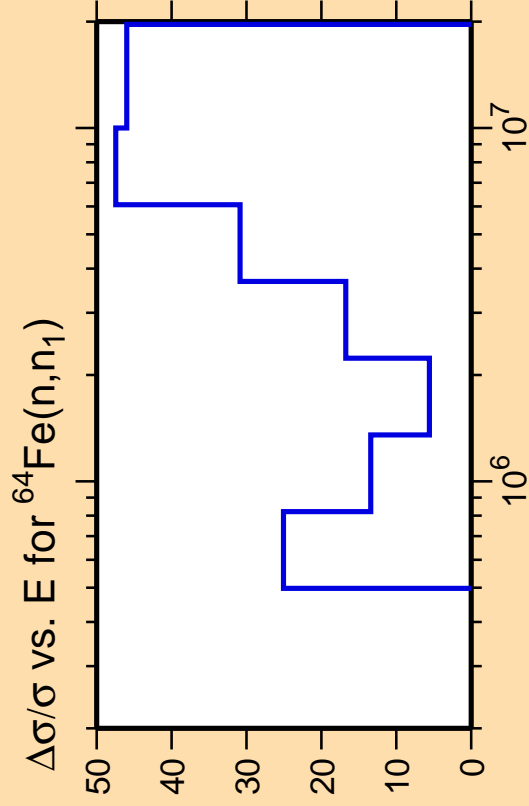




Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

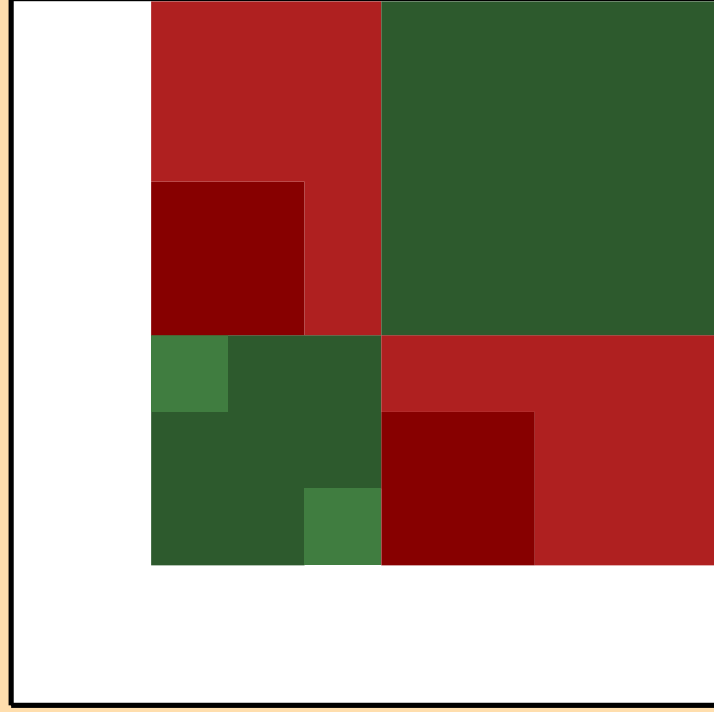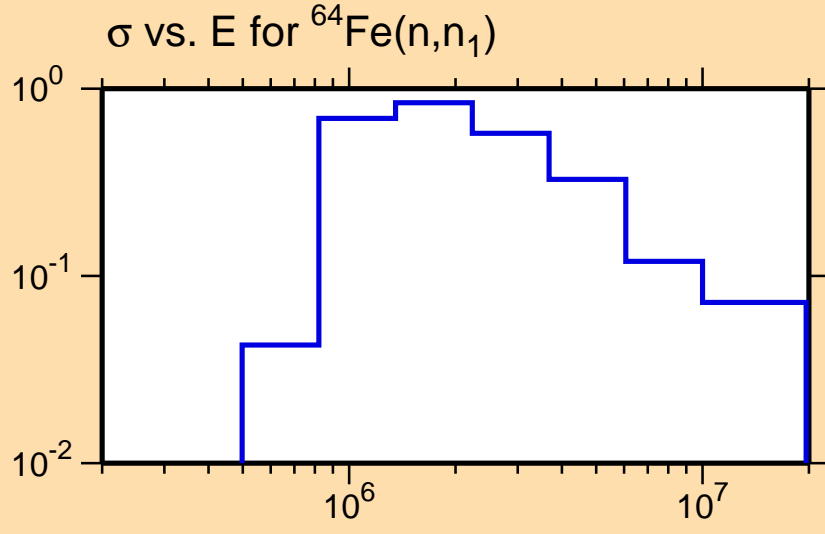

Correlation Matrix



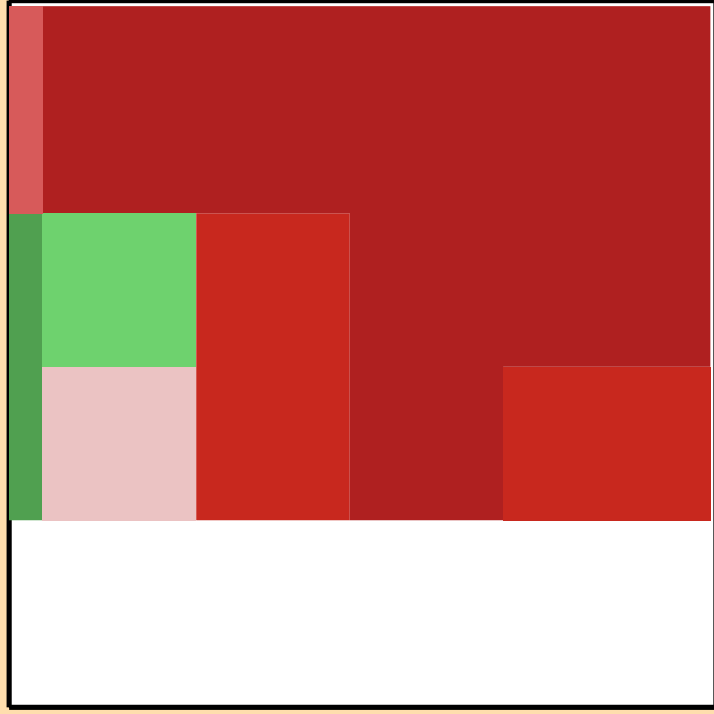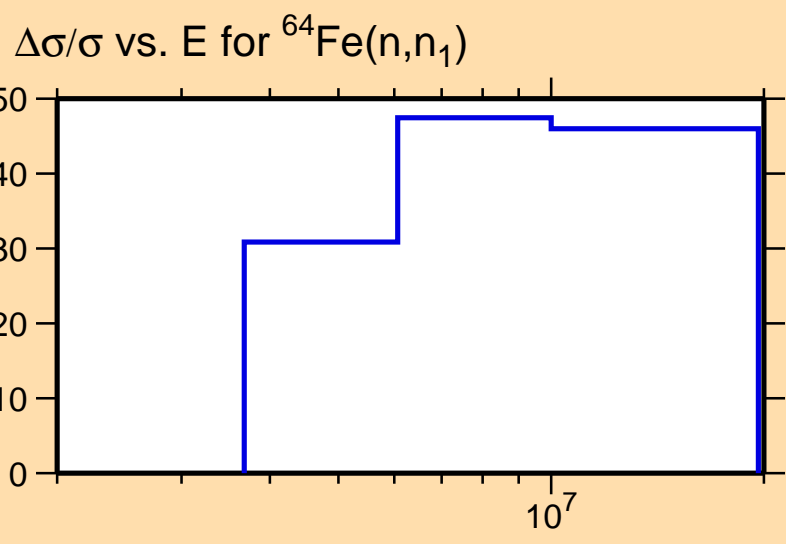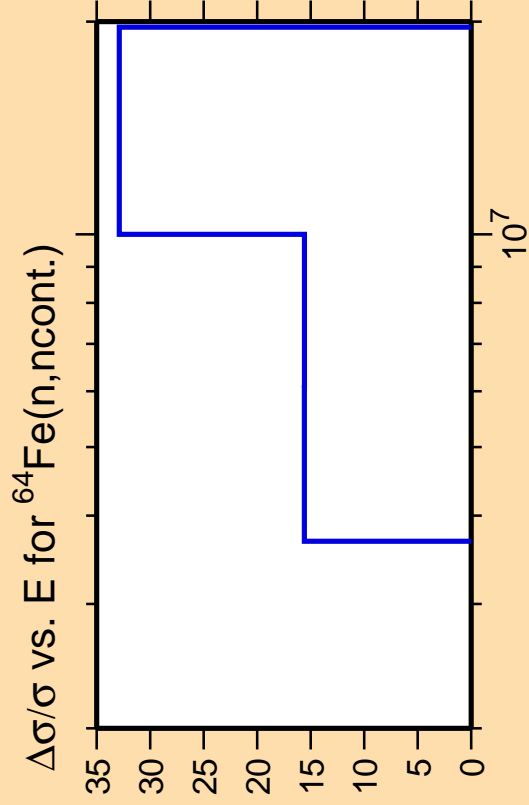


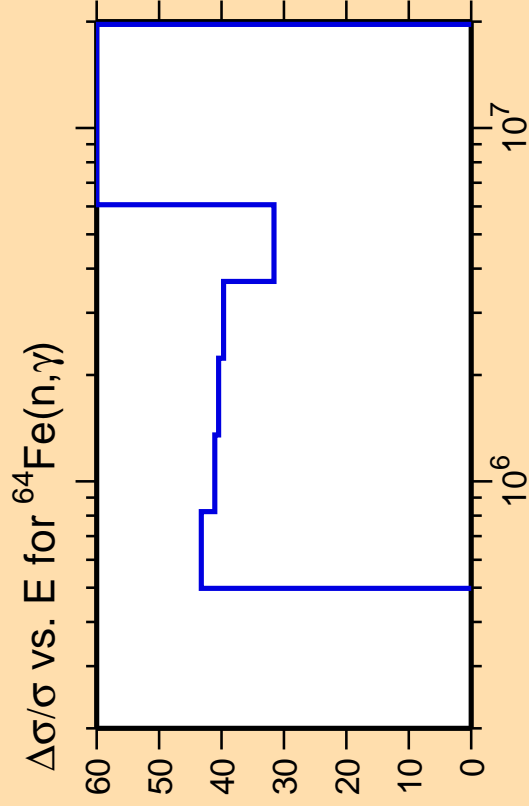


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n_1)$

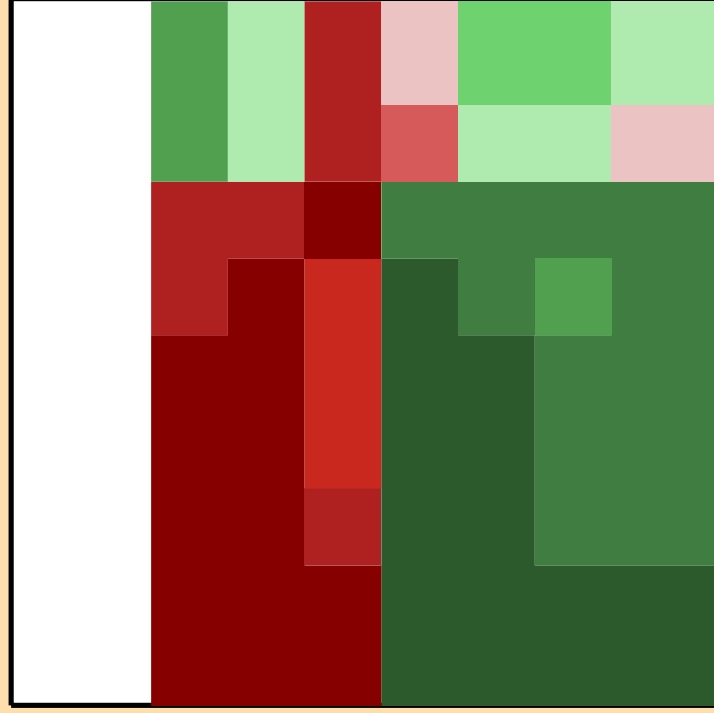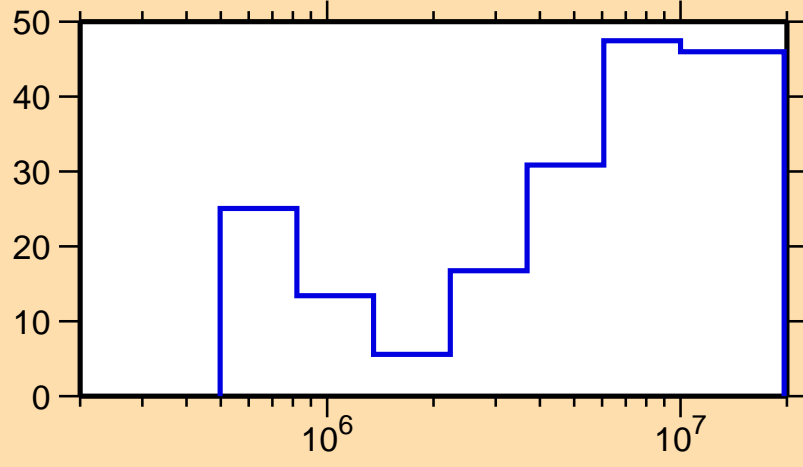

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$




Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n_1)$

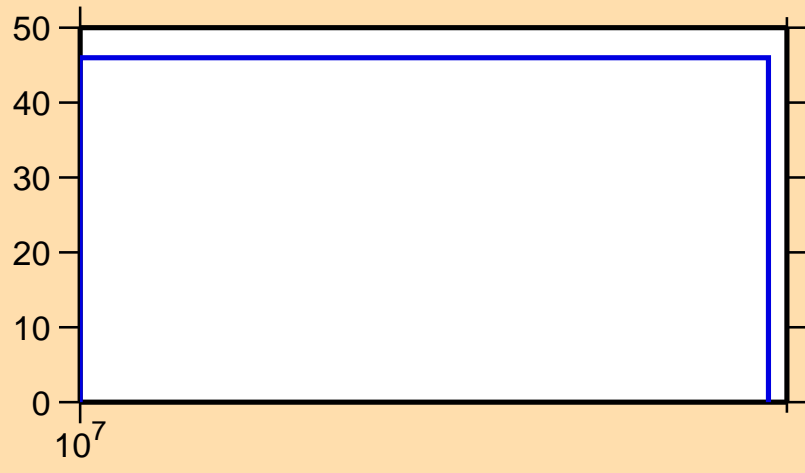

Correlation Matrix






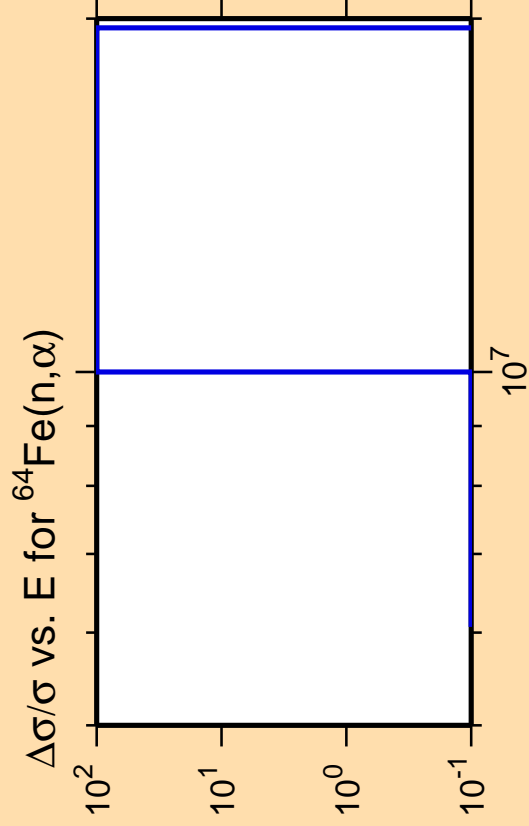


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n_1)$

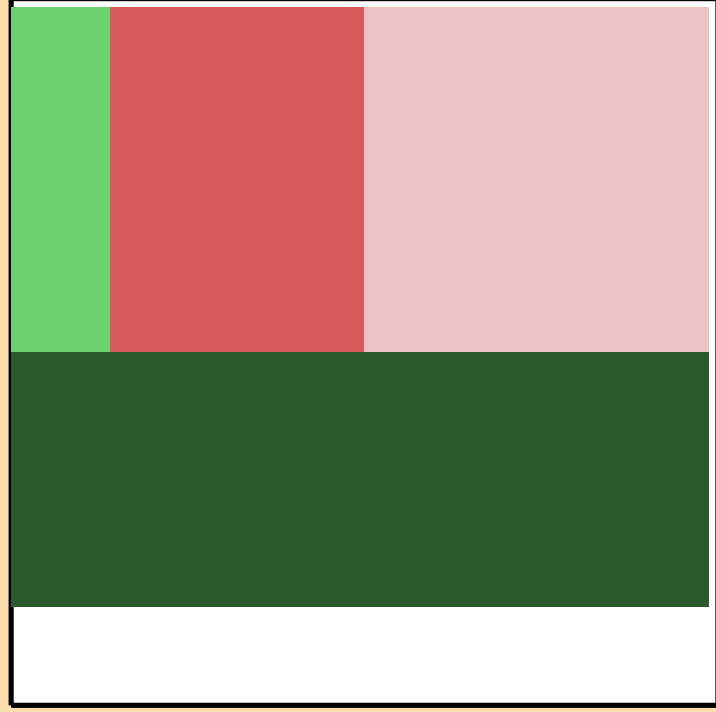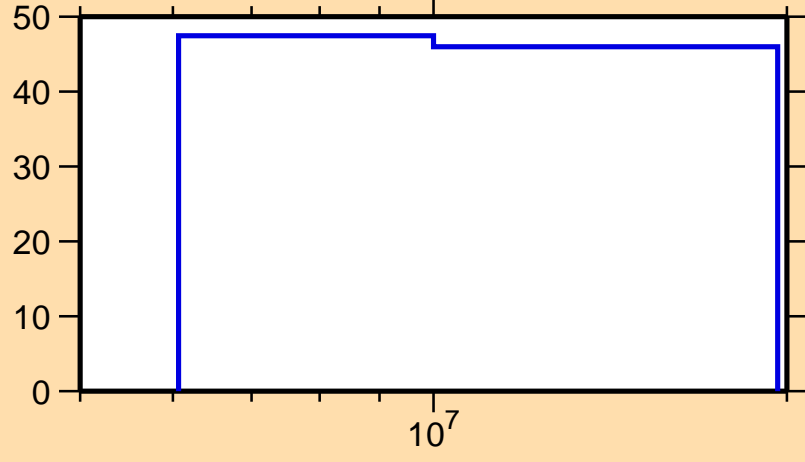

Correlation Matrix





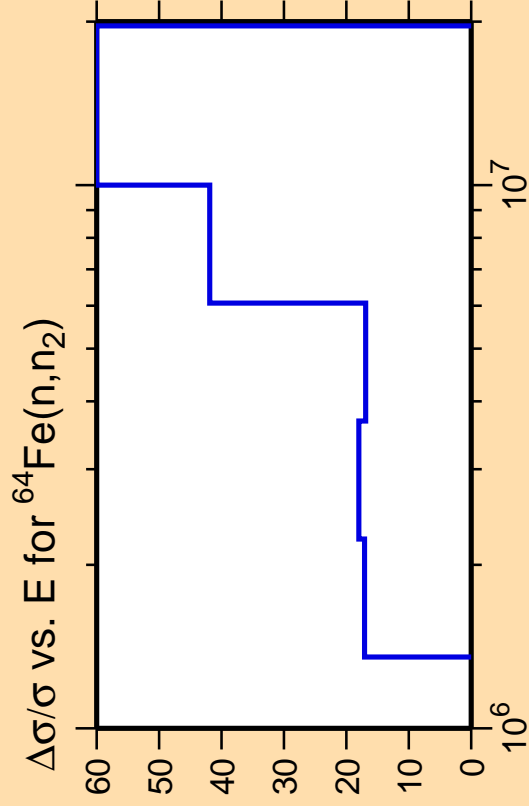

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

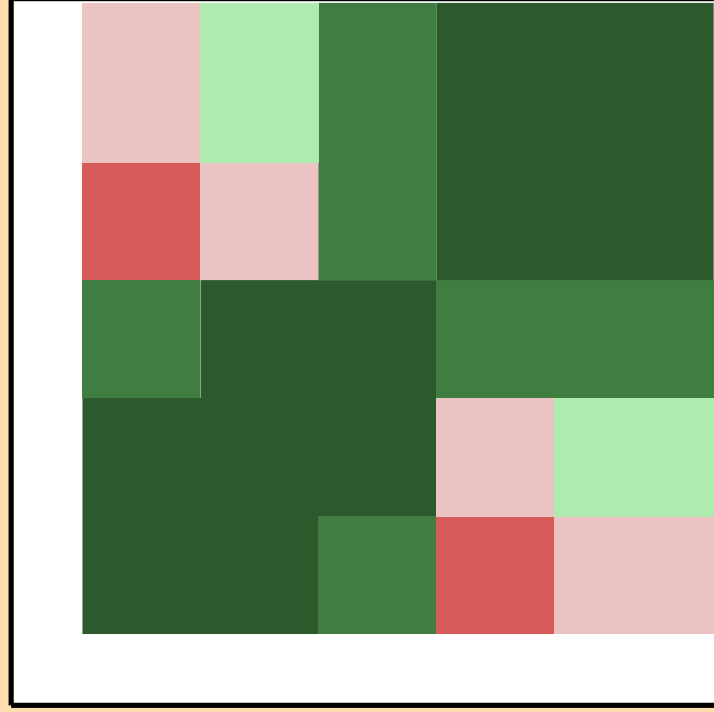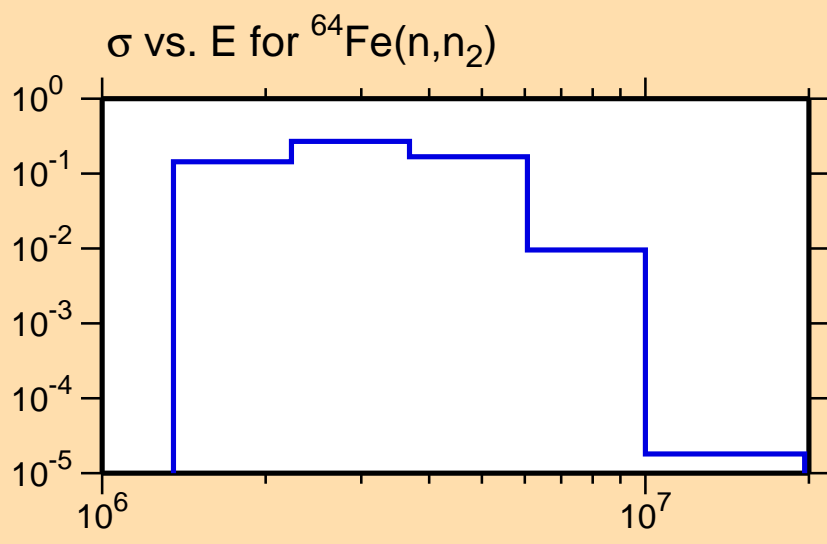



Correlation Matrix



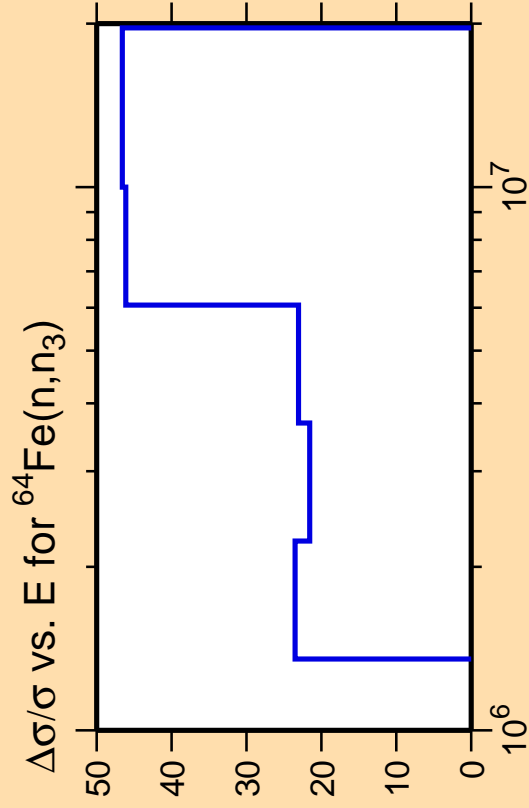



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

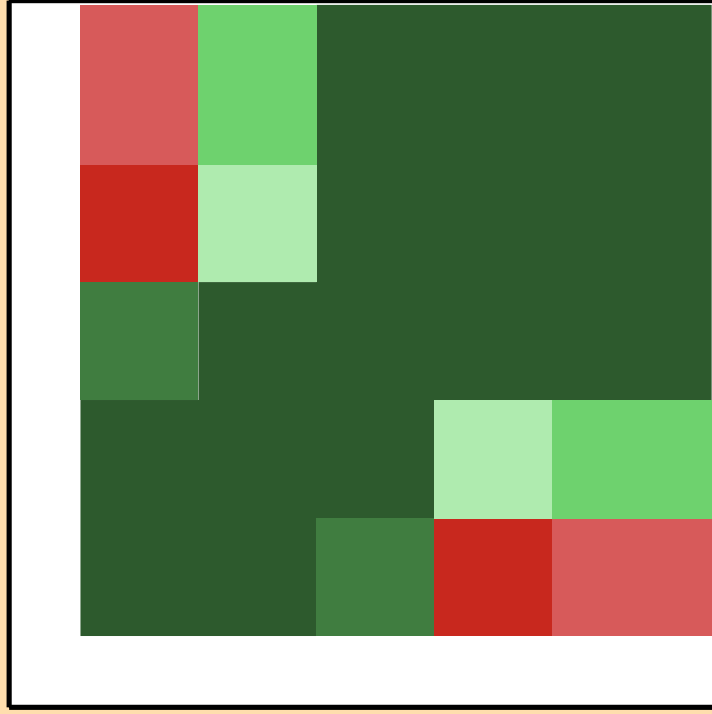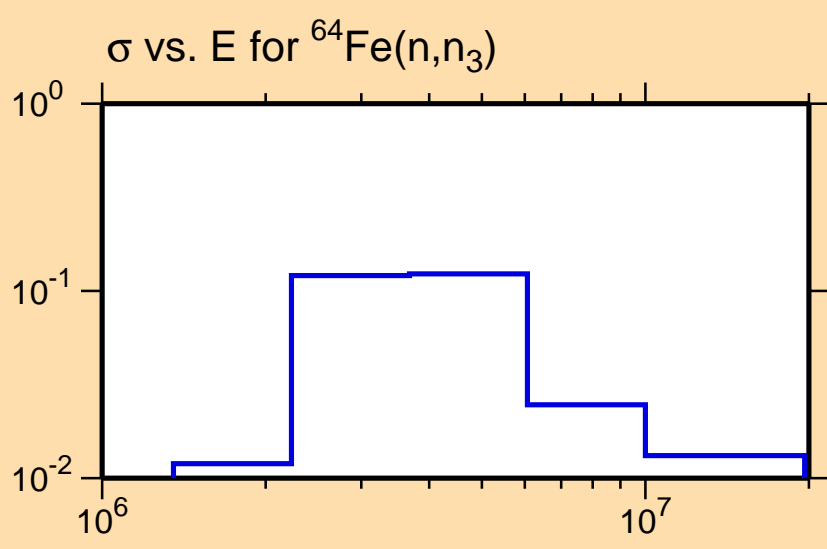

Correlation Matrix


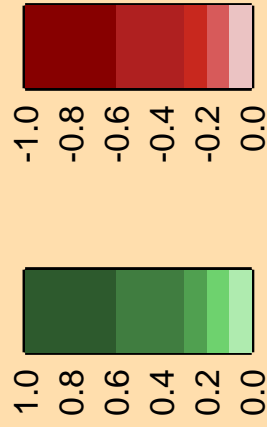


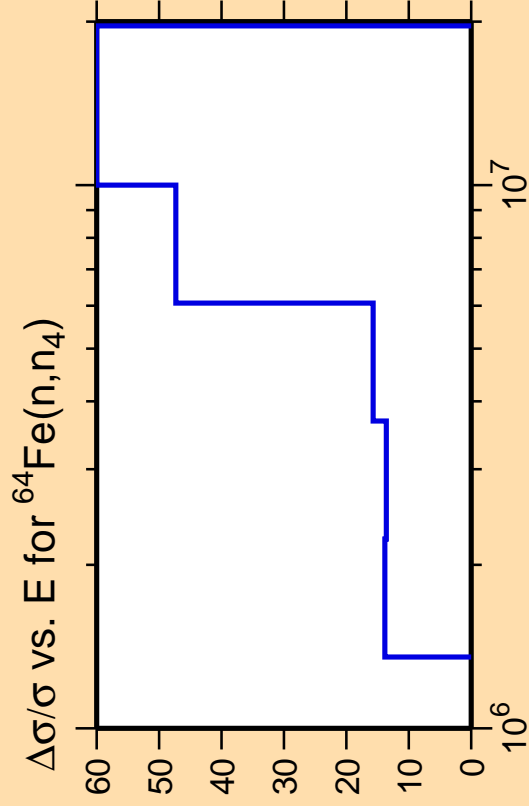

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

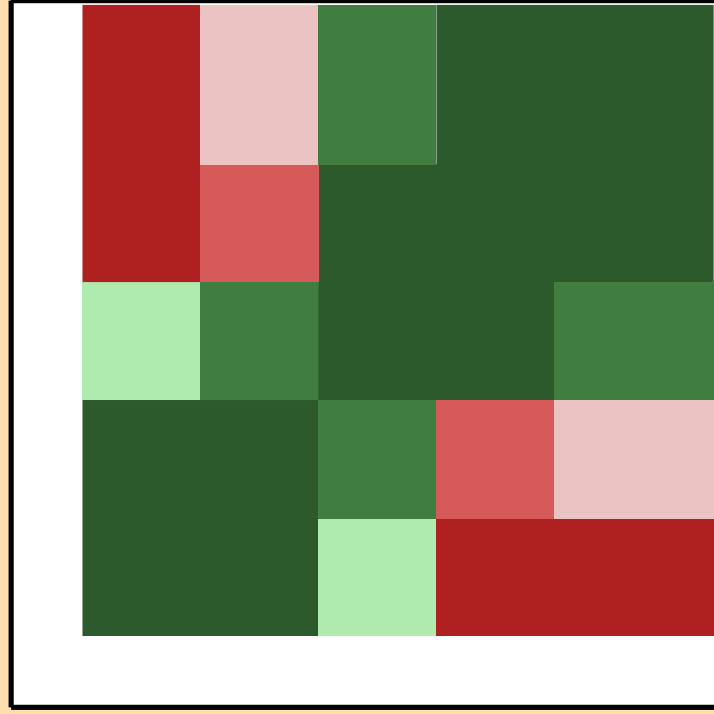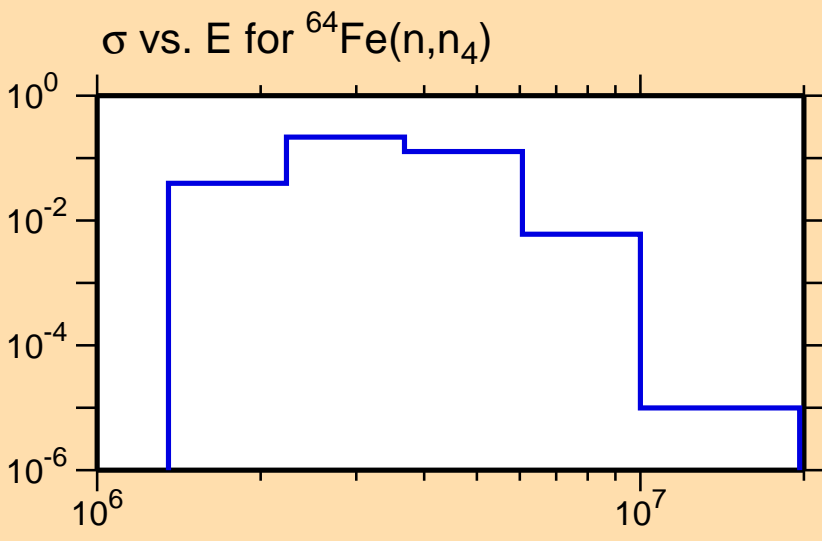

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

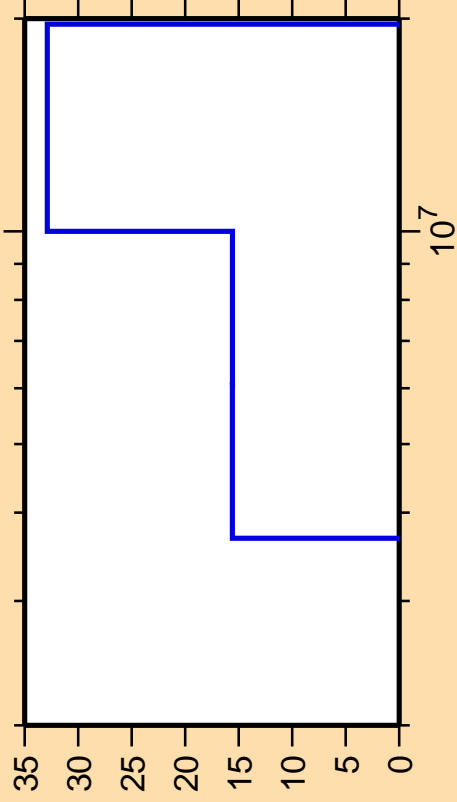

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

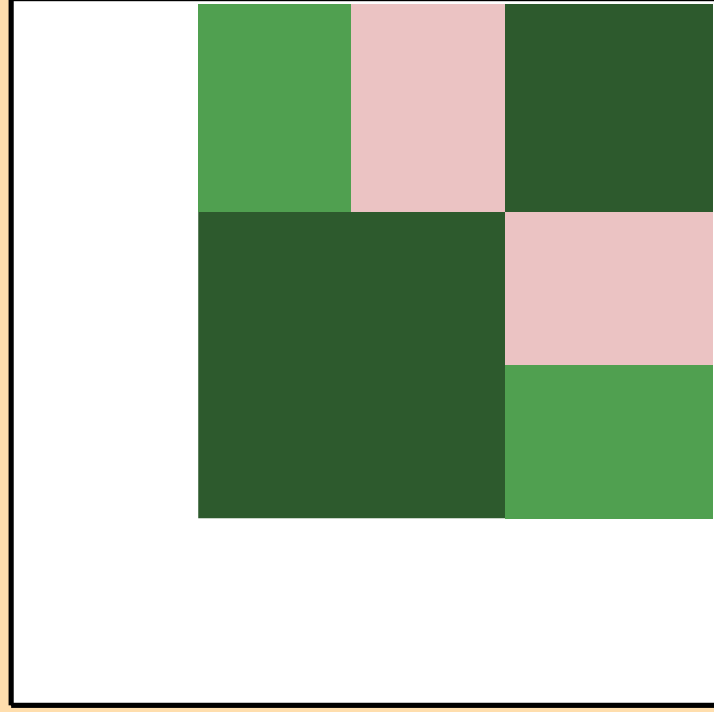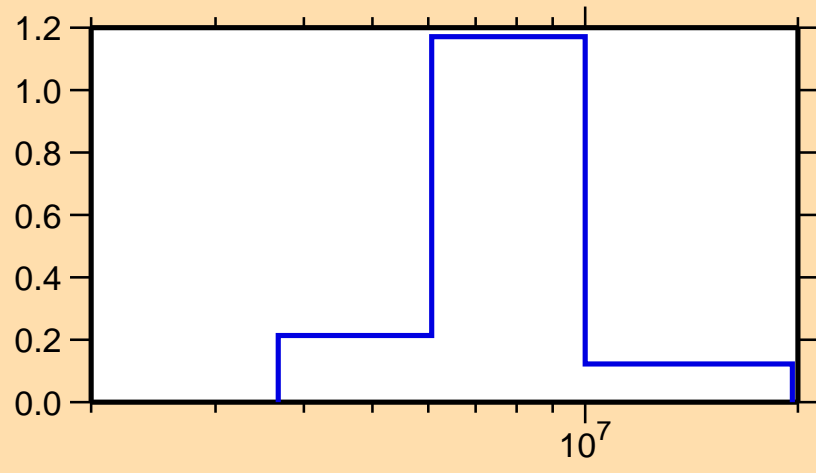

Correlation Matrix




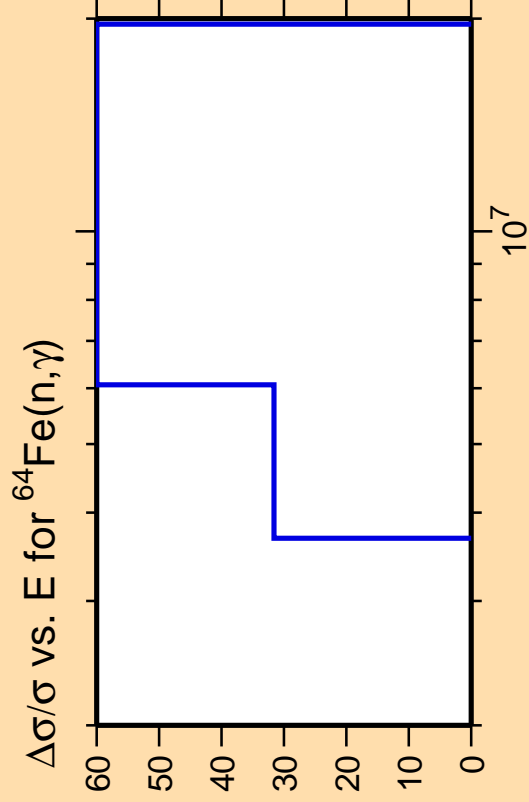


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

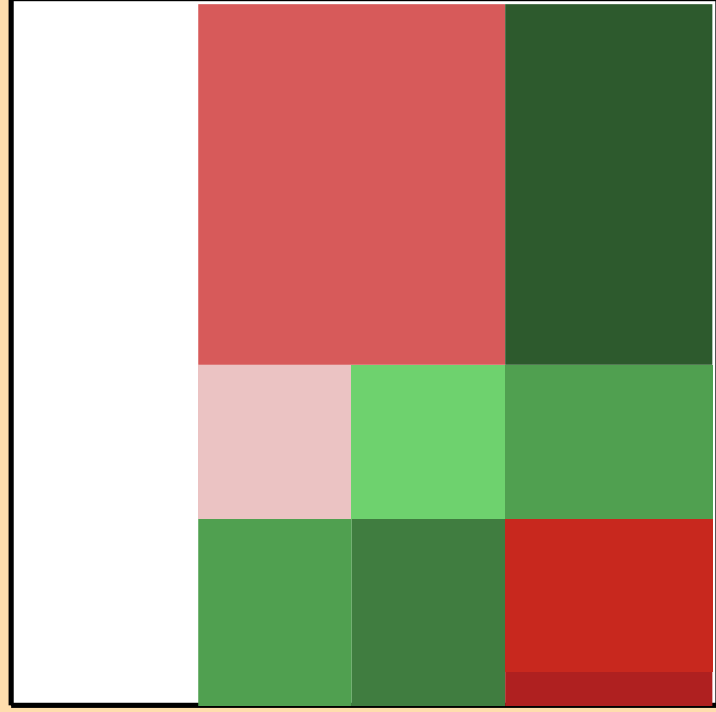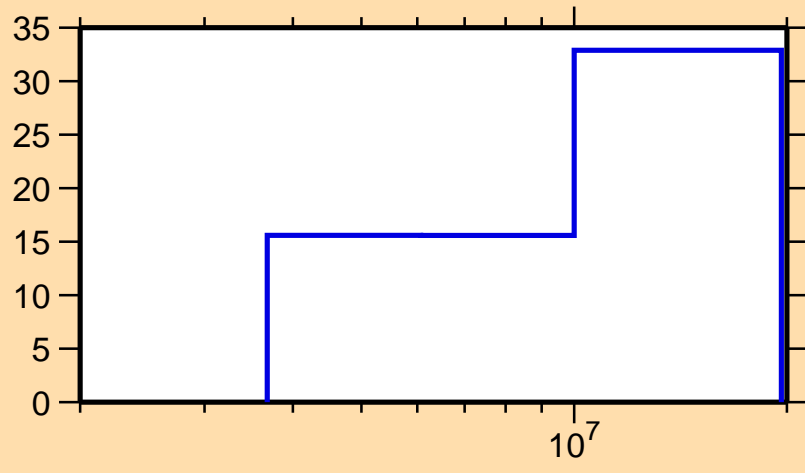

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$




Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,ncont.)$

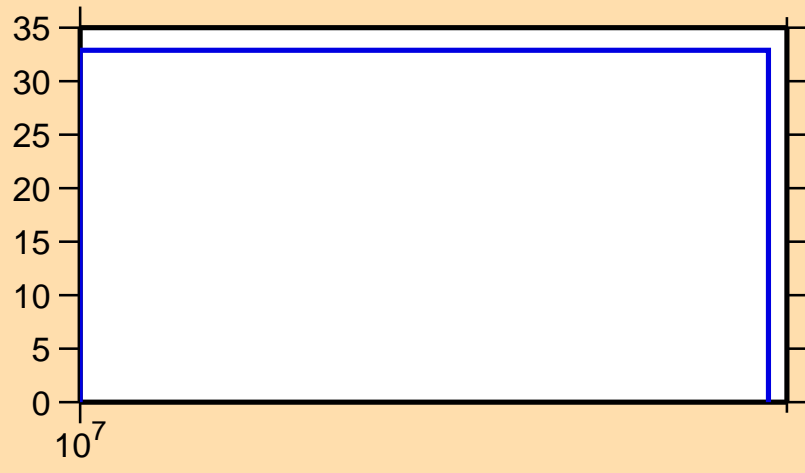


$10^7$



Correlation Matrix




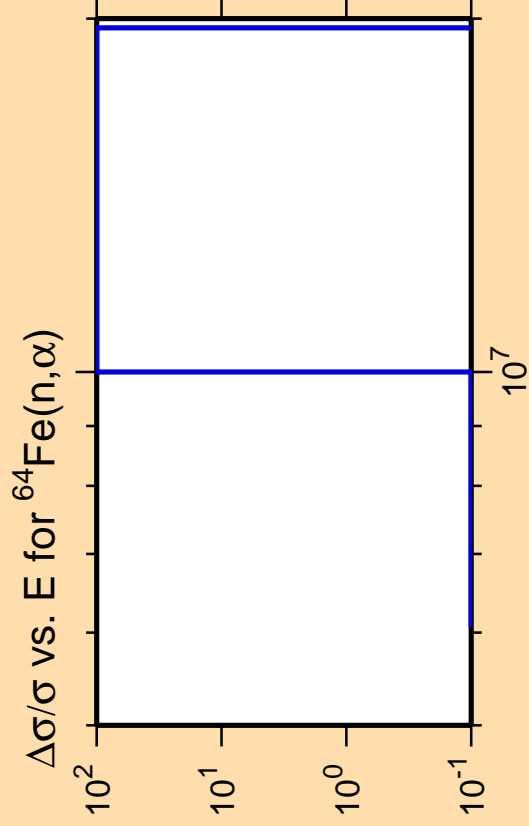


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,n\text{cont.})$

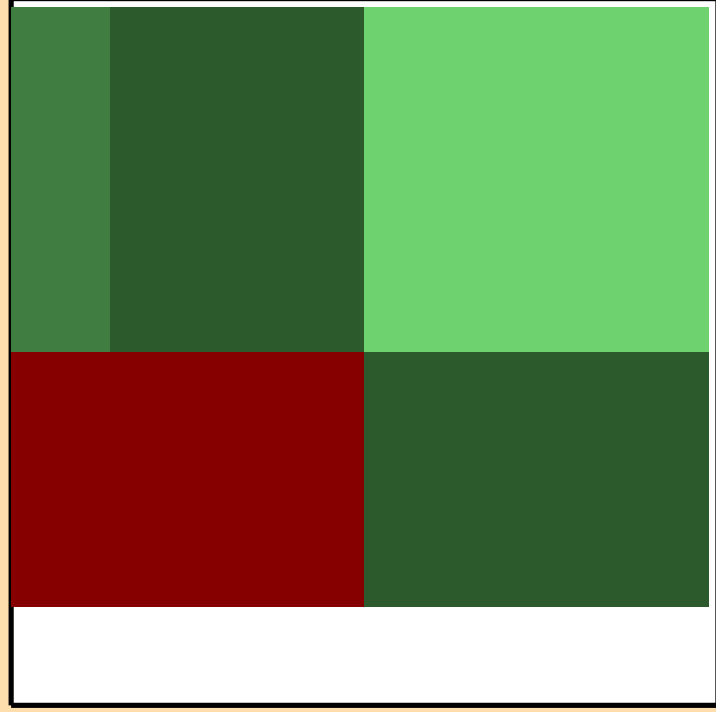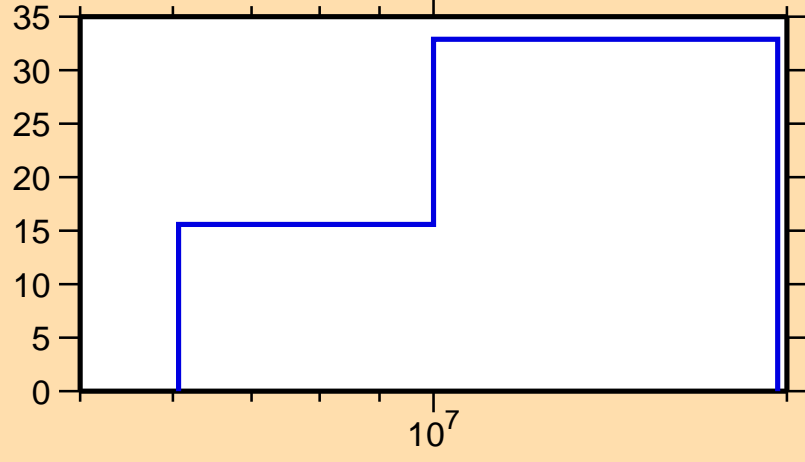

Correlation Matrix







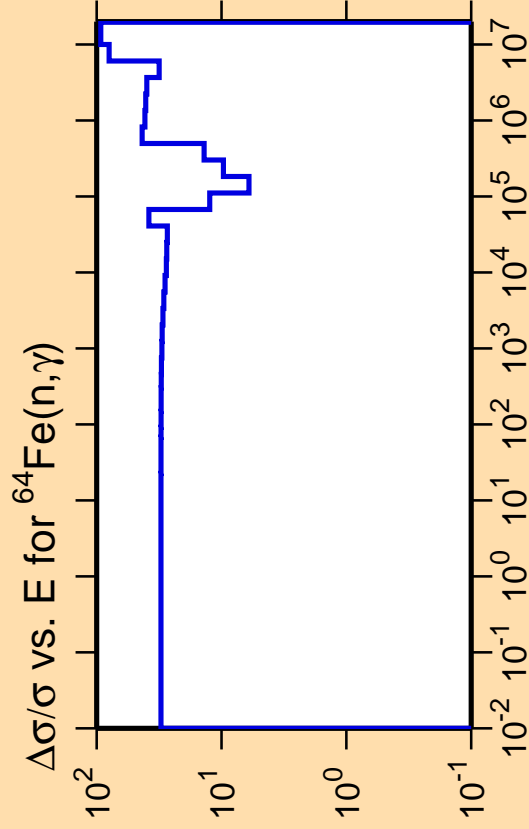

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

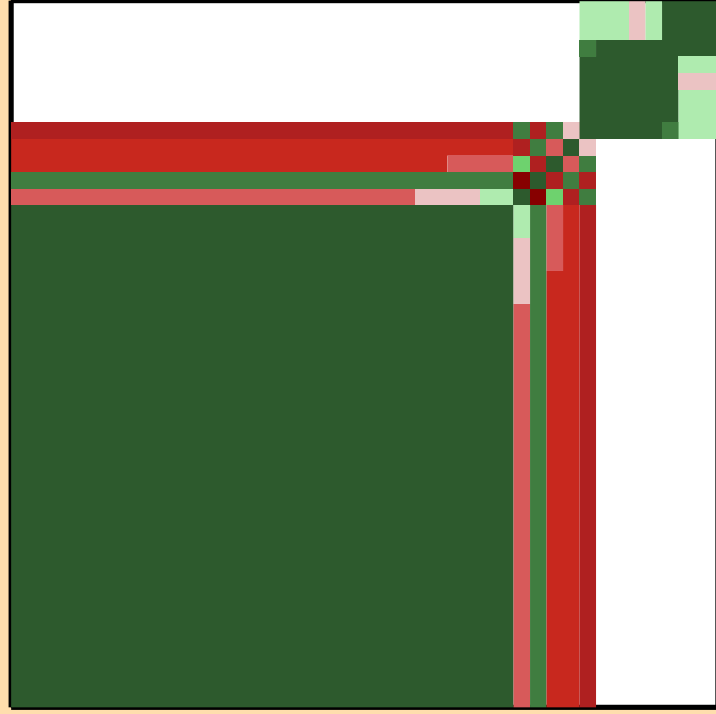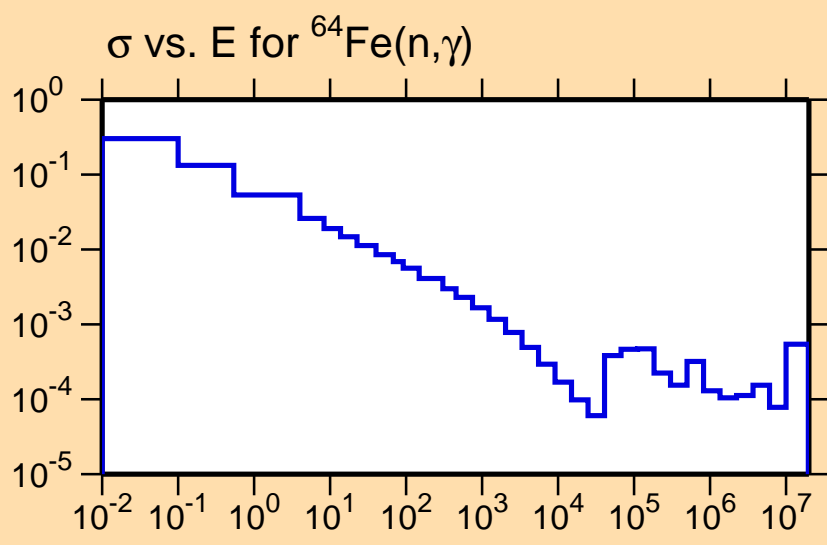

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$

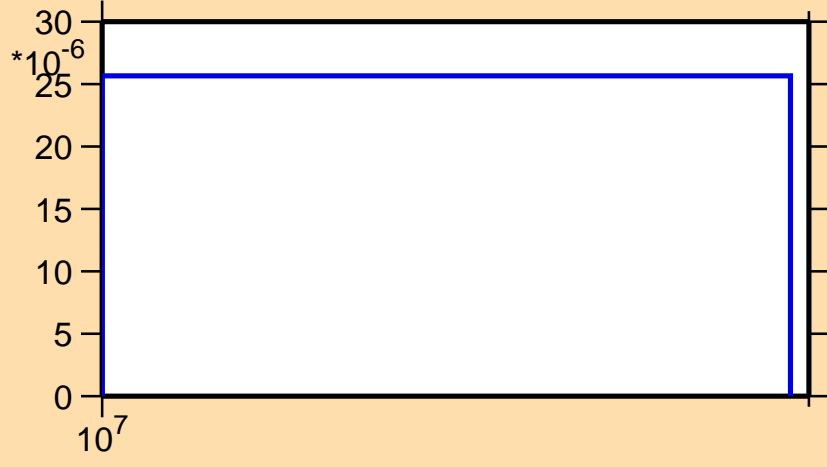

$10^7$



Correlation Matrix



-1.0  
-0.8  
-0.6  
-0.4  
-0.2  
0.0

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,\alpha)$





Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,p)$

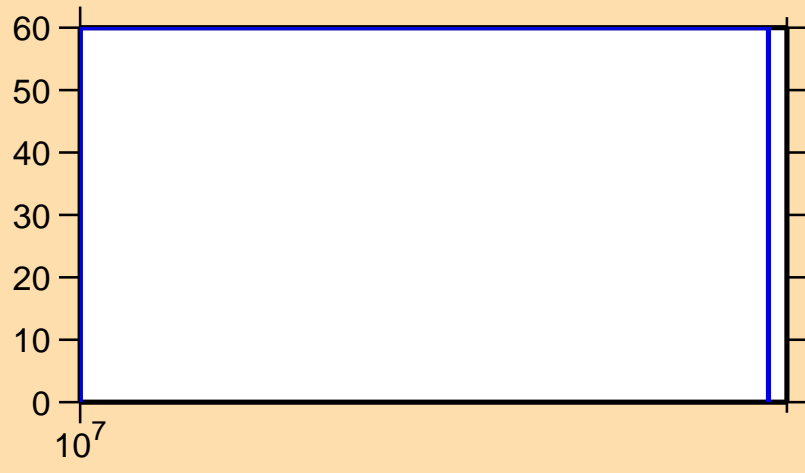

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,d)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{64}\text{Fe}(n,d)$

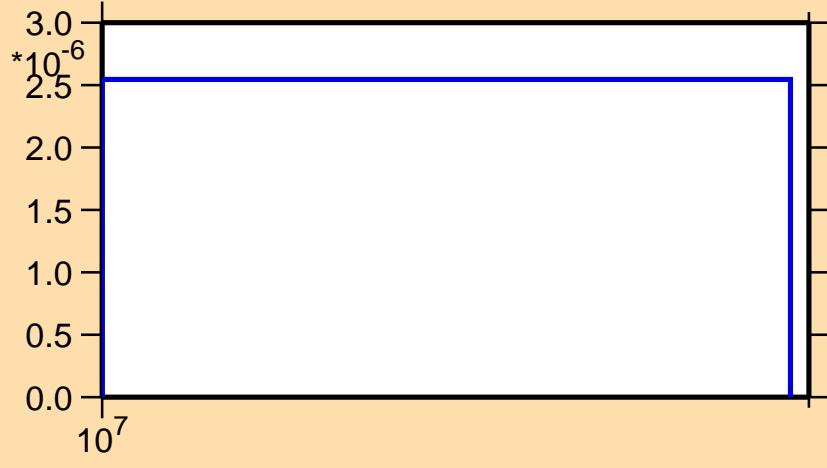

$10^7$



Correlation Matrix



-1.0  
-0.8  
-0.6  
-0.4  
-0.2  
0.0

$\Delta\sigma/\sigma$  vs. E for  $^{64}\text{Fe}(n,t)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{64}\text{Fe}(n,t)$

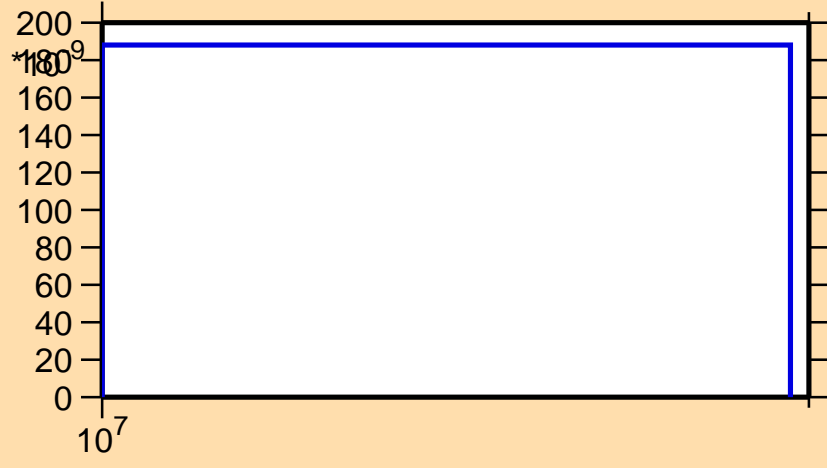


$10^7$



Correlation Matrix



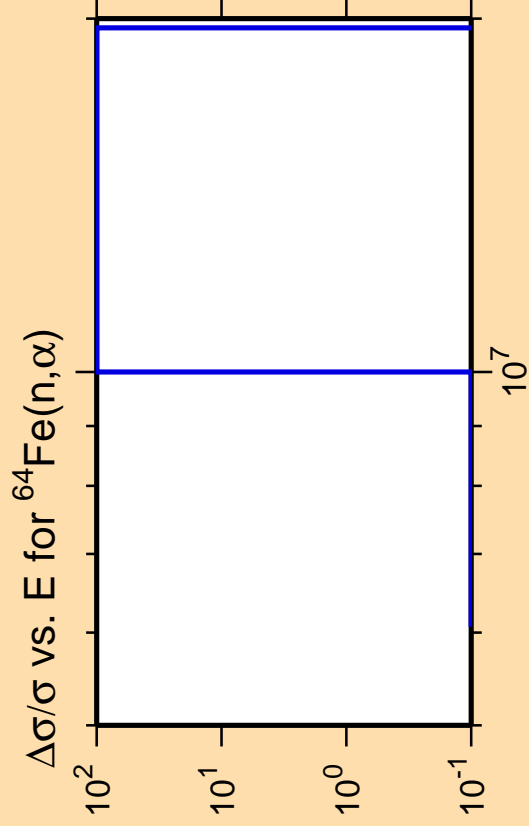

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.



Correlation Matrix



$\sigma$  vs. E for  $^{64}\text{Fe}(n,\alpha)$

