




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

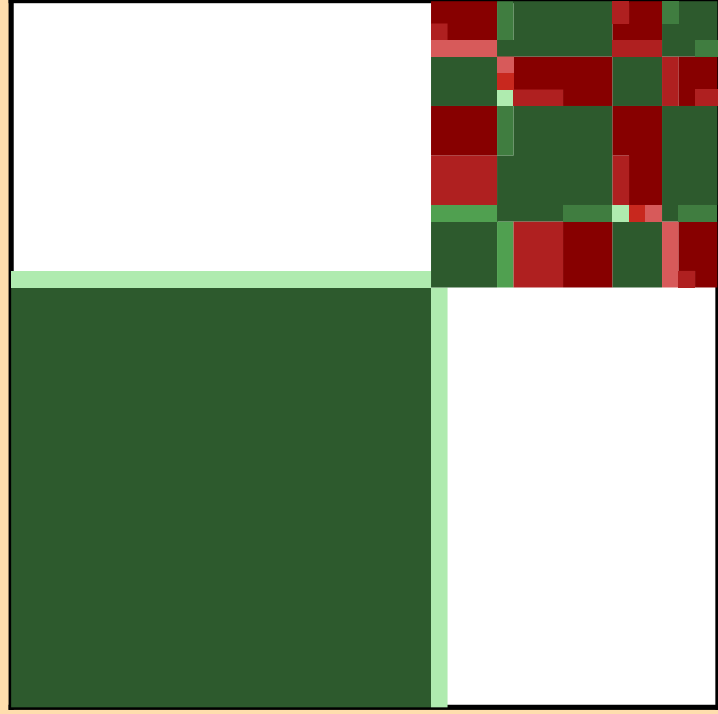

Correlation Matrix


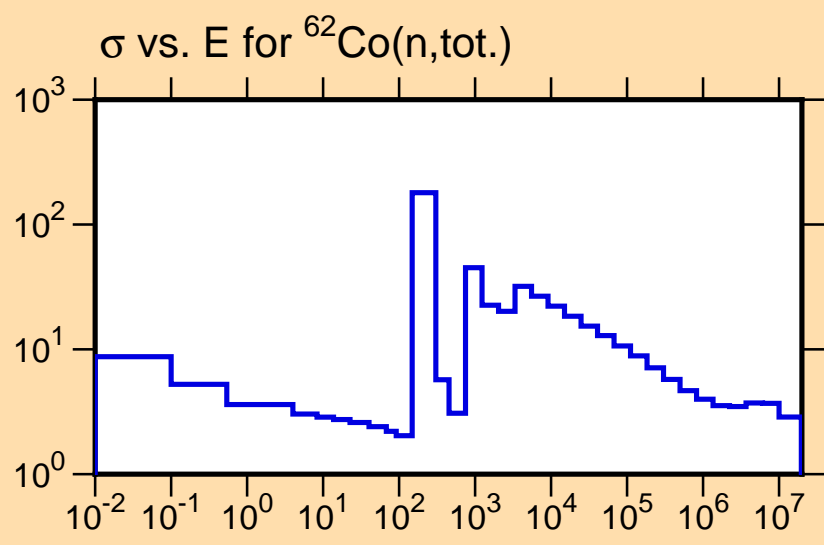


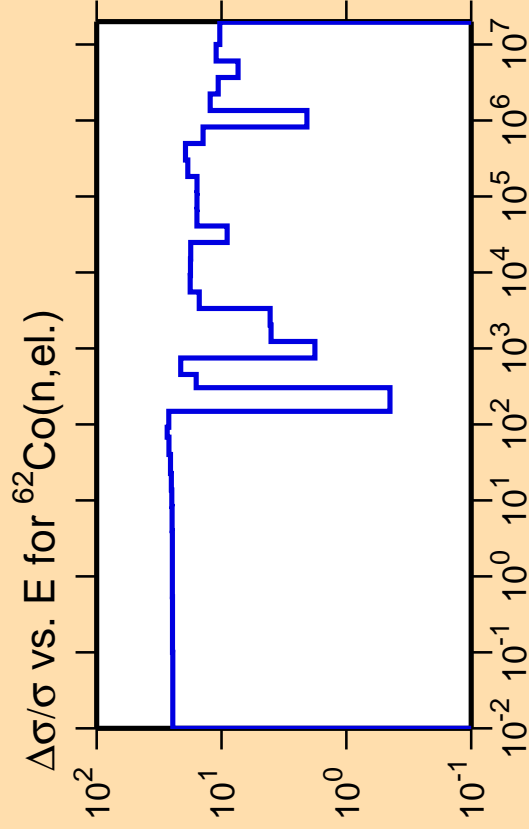

Ordinate scale is %  
relative standard deviation.





Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{tot.})$

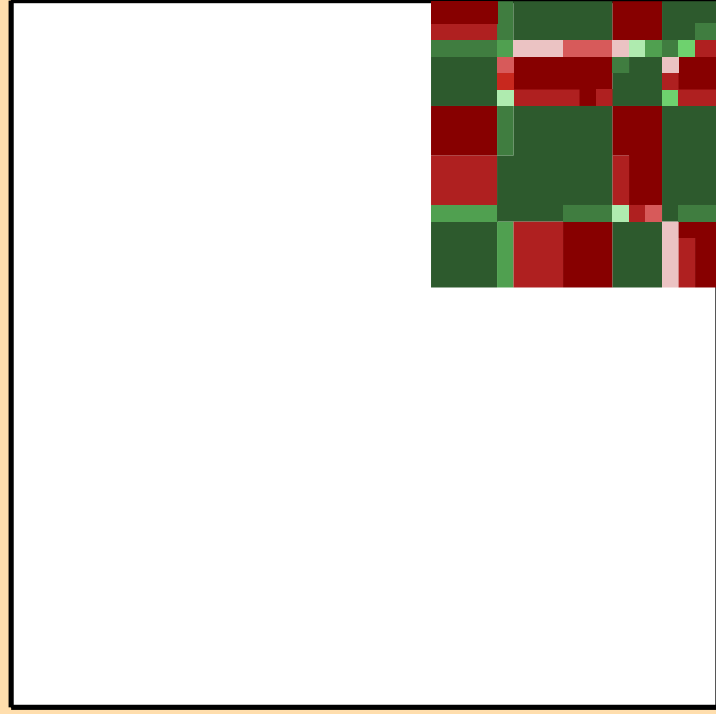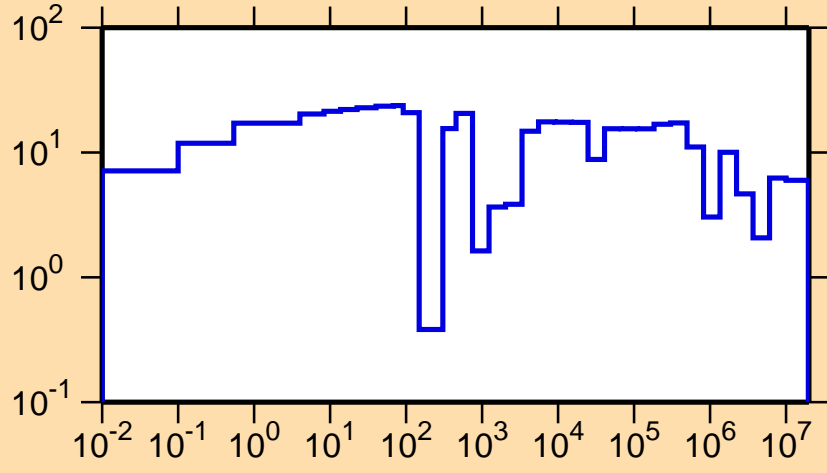

Correlation Matrix



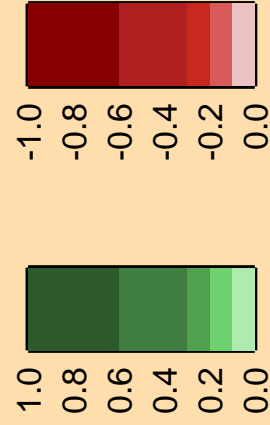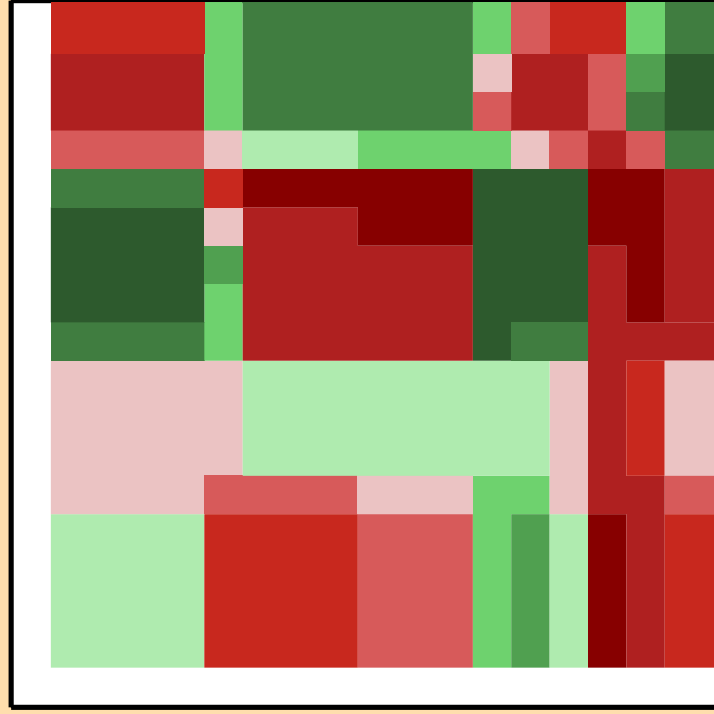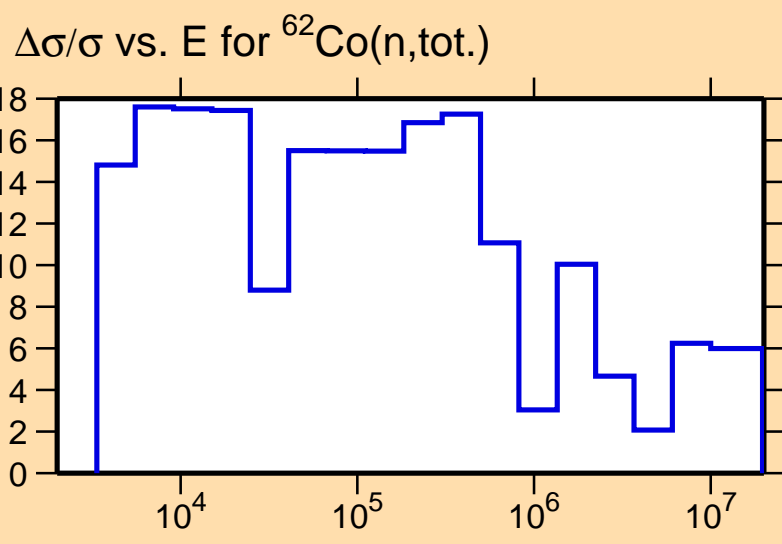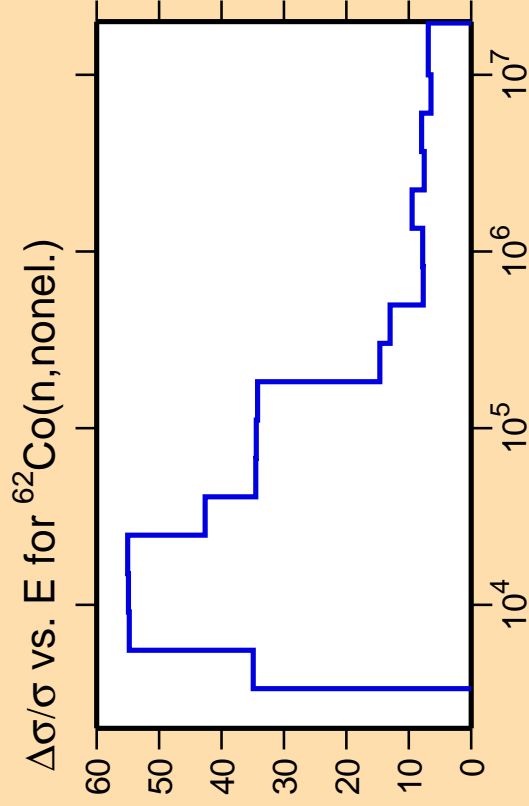


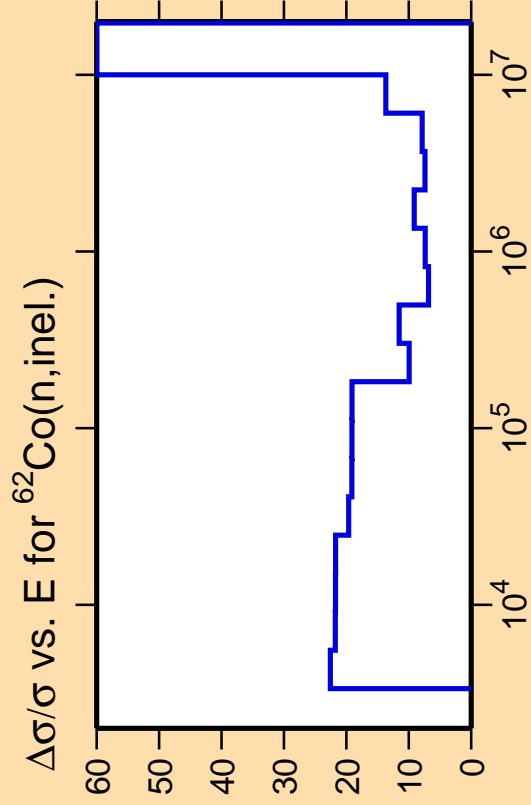


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{tot.})$

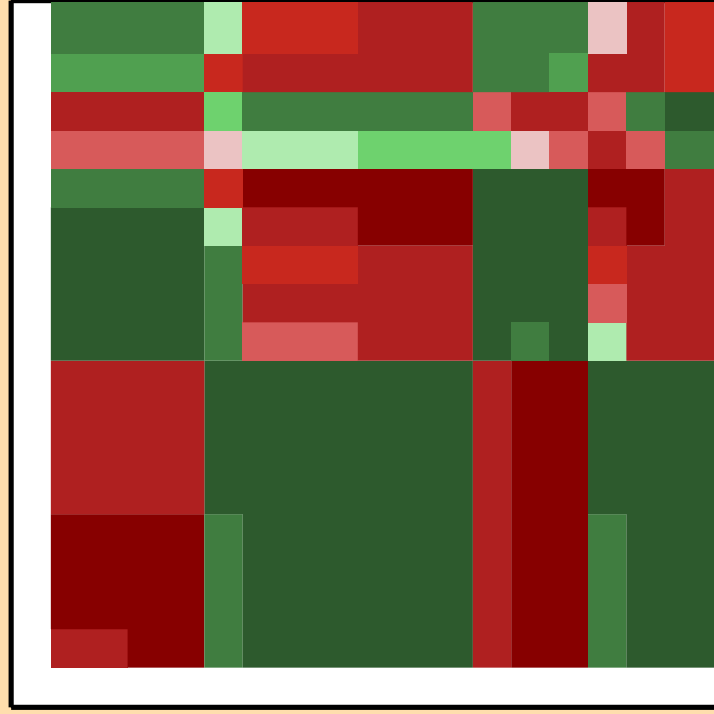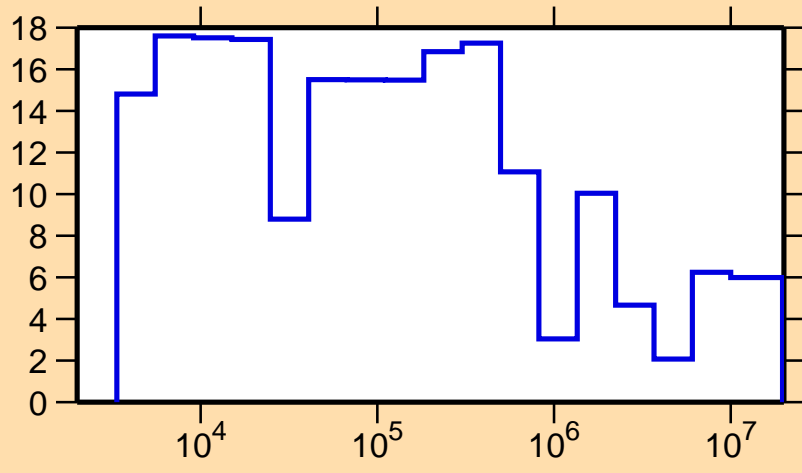

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

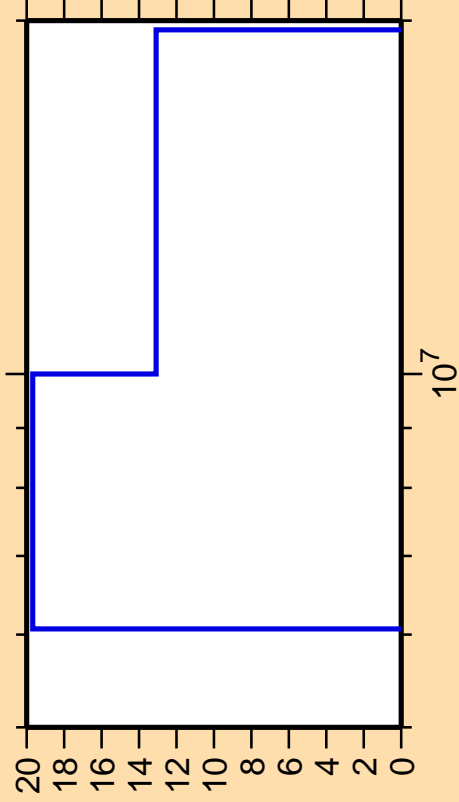

Ordinate scale is %  
relative standard deviation.


Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{tot.})$

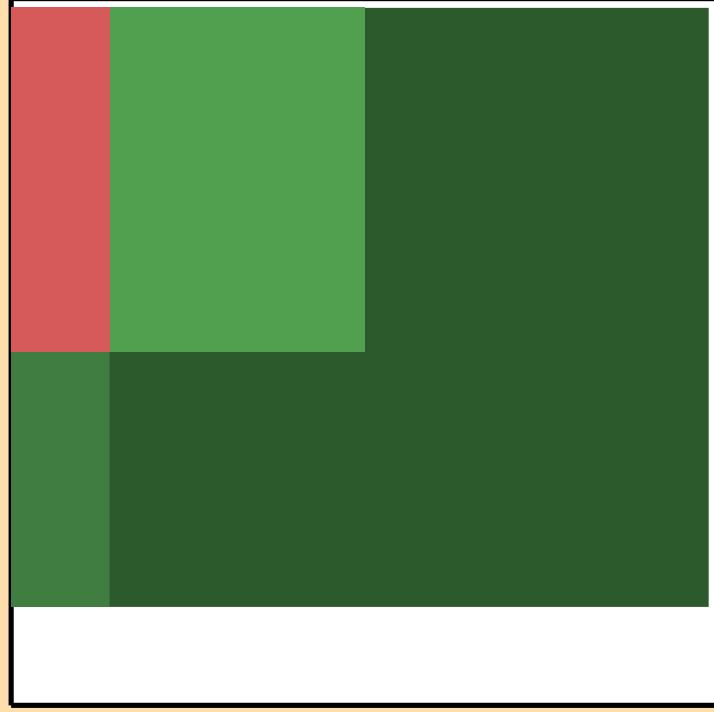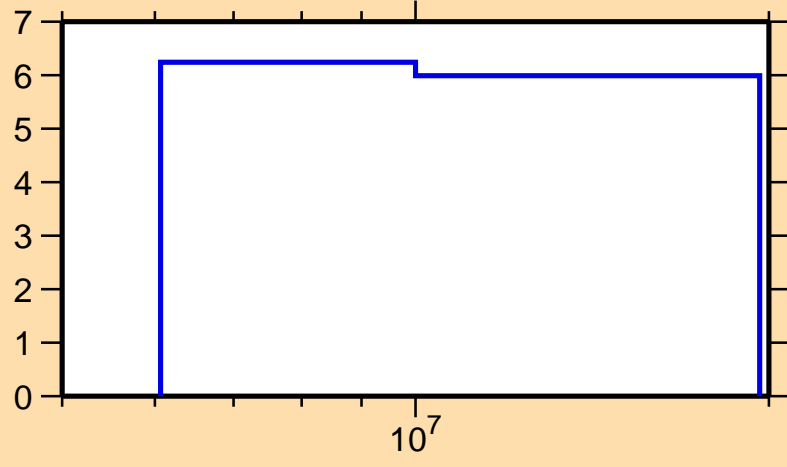

Correlation Matrix





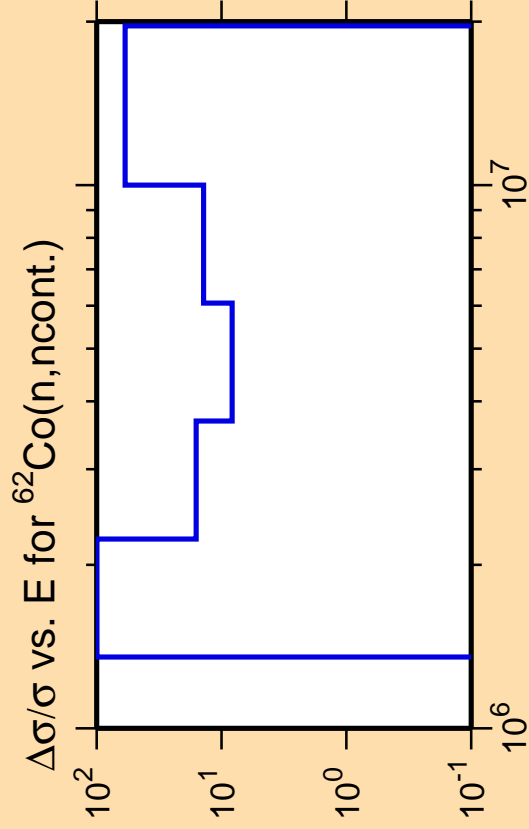

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

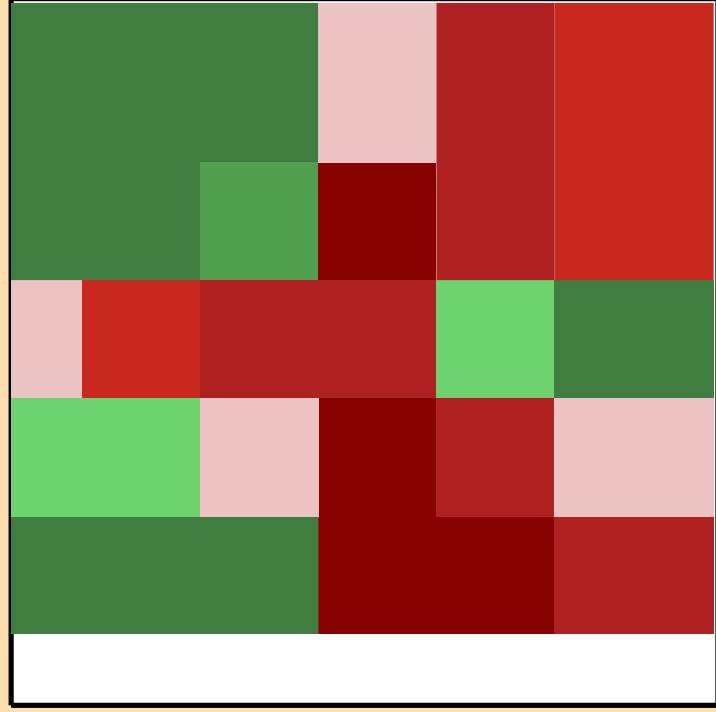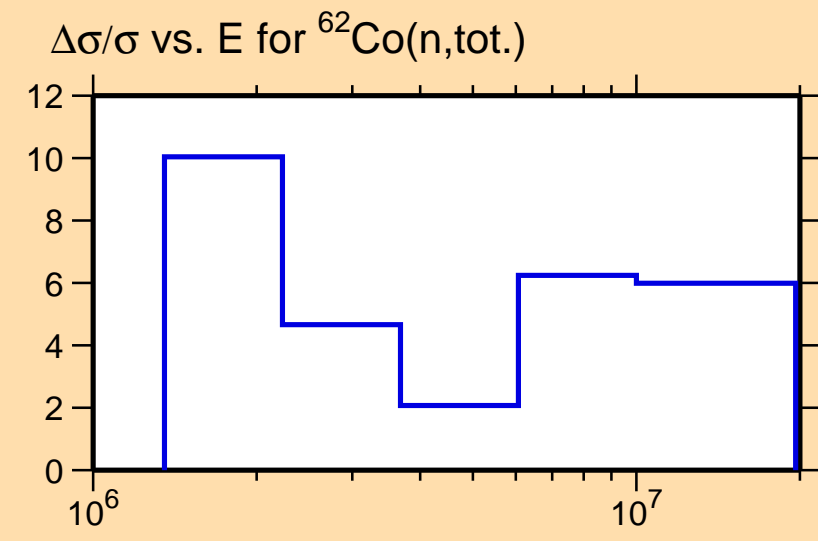

Correlation Matrix




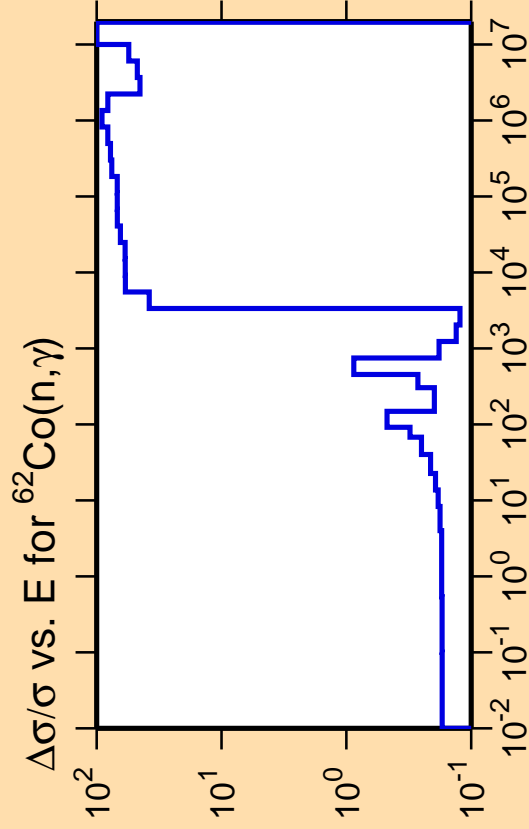


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{tot.})$

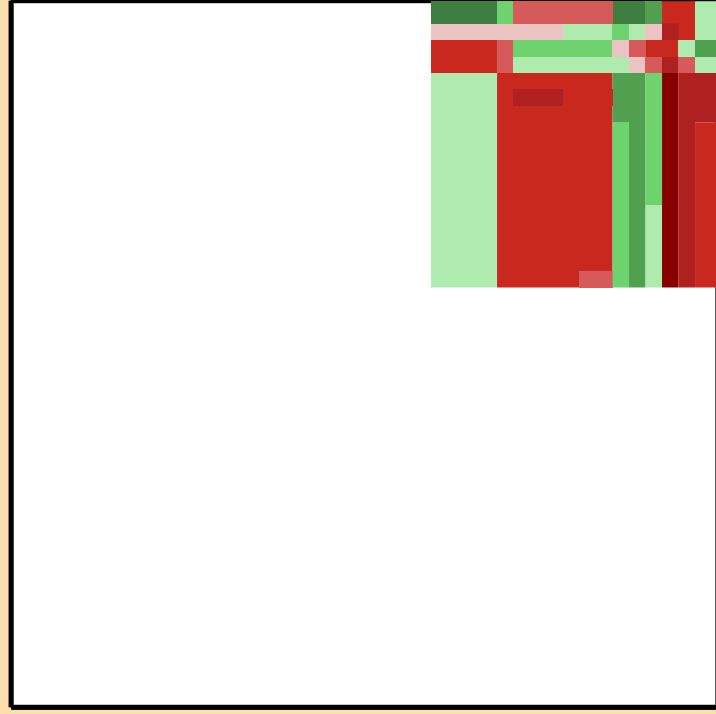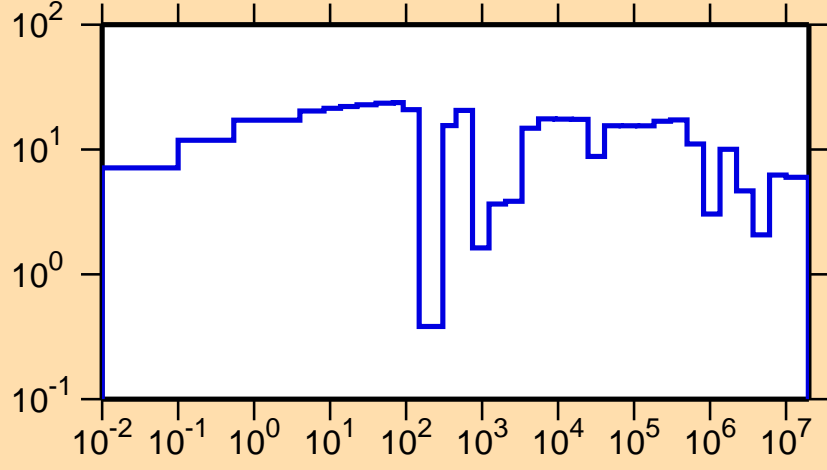

Correlation Matrix





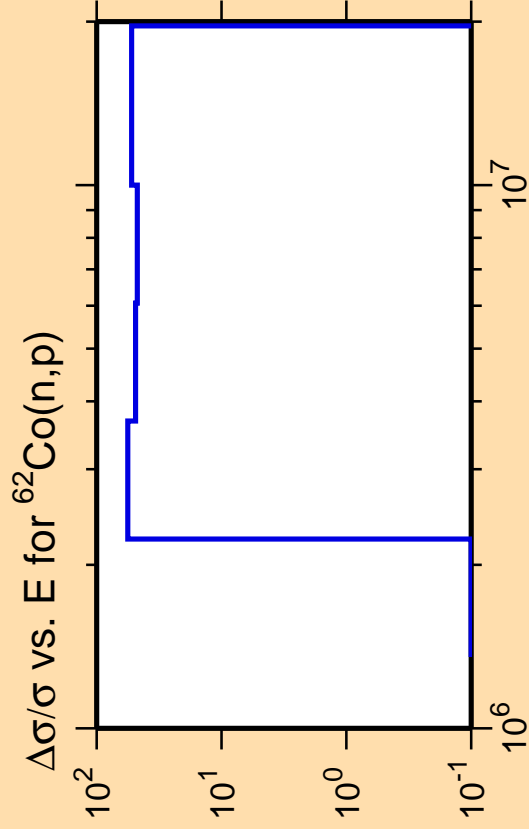

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

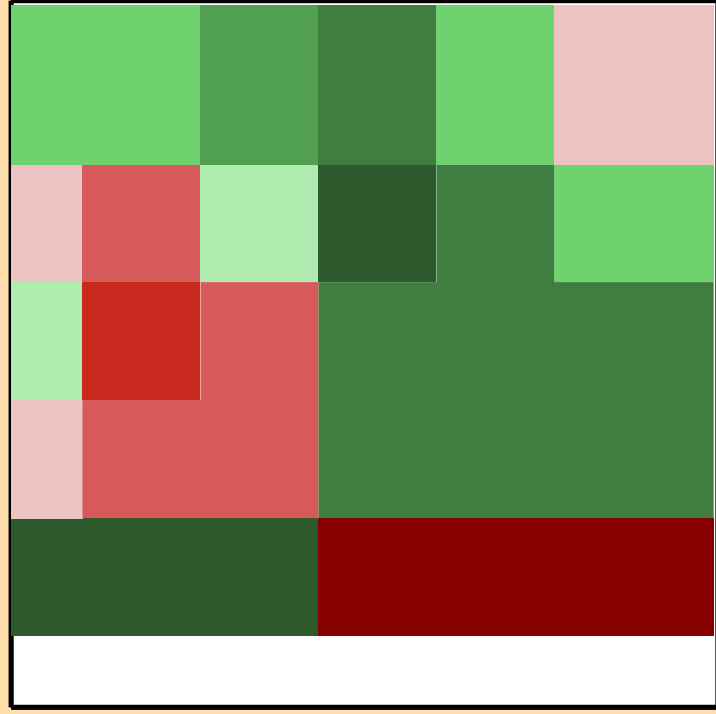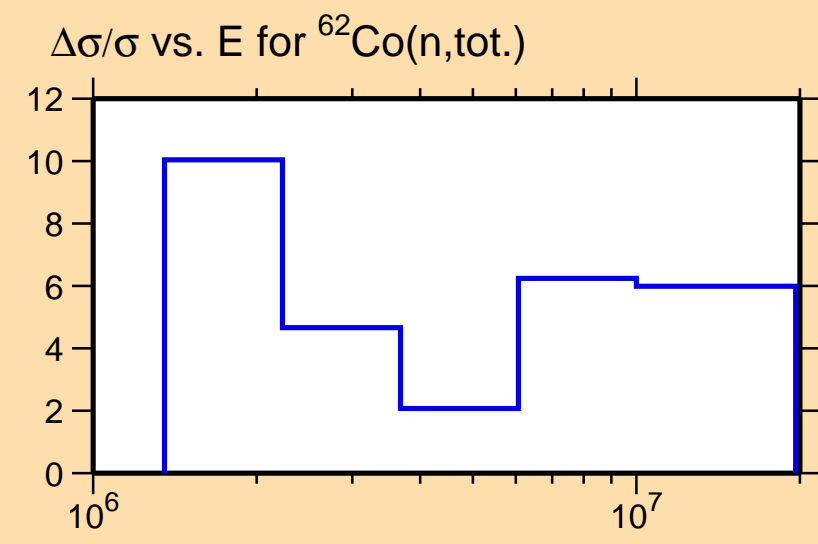

Correlation Matrix






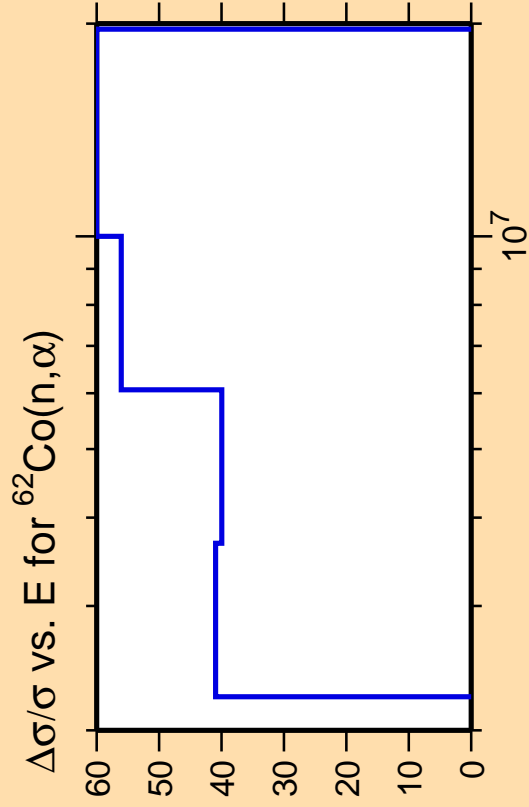


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{tot.})$

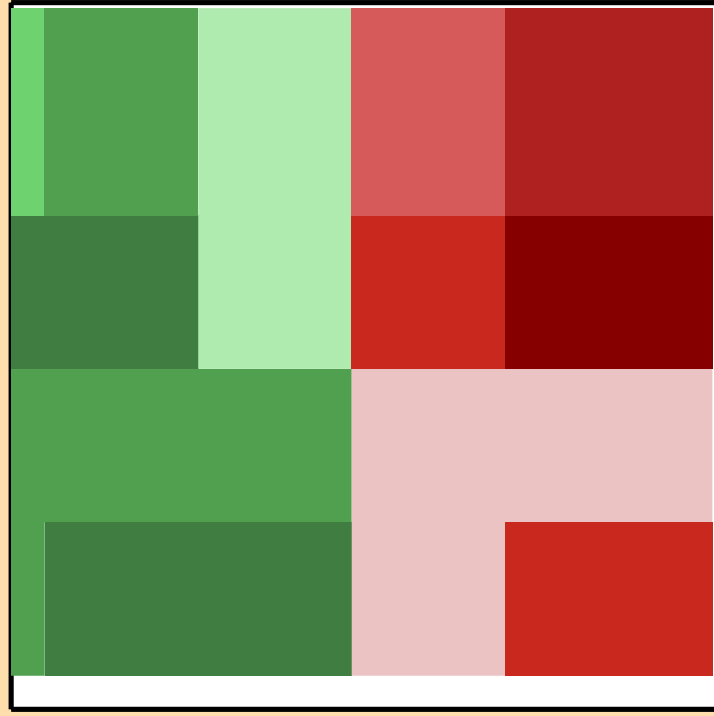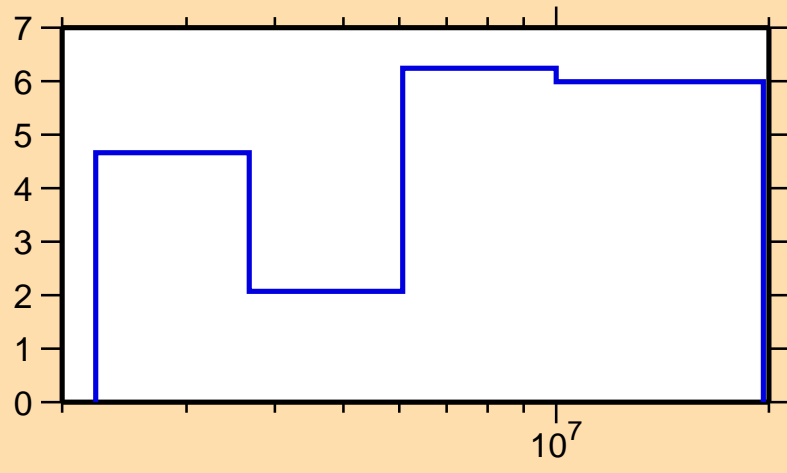



Correlation Matrix



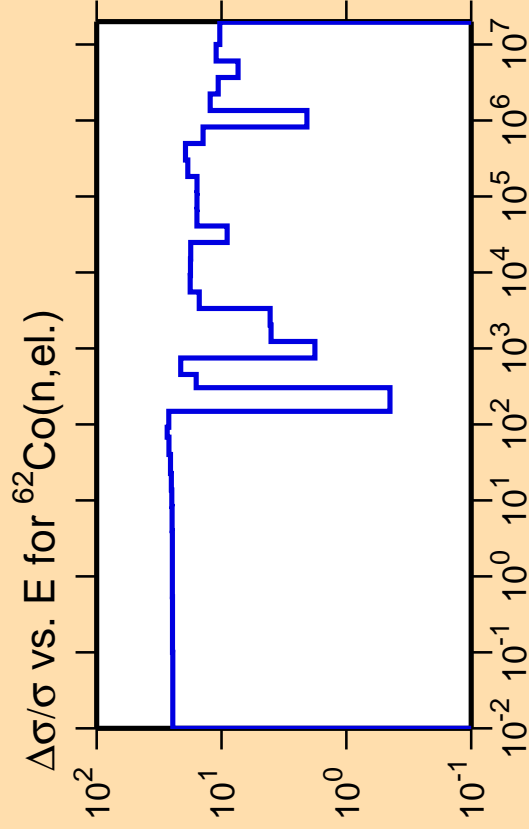


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

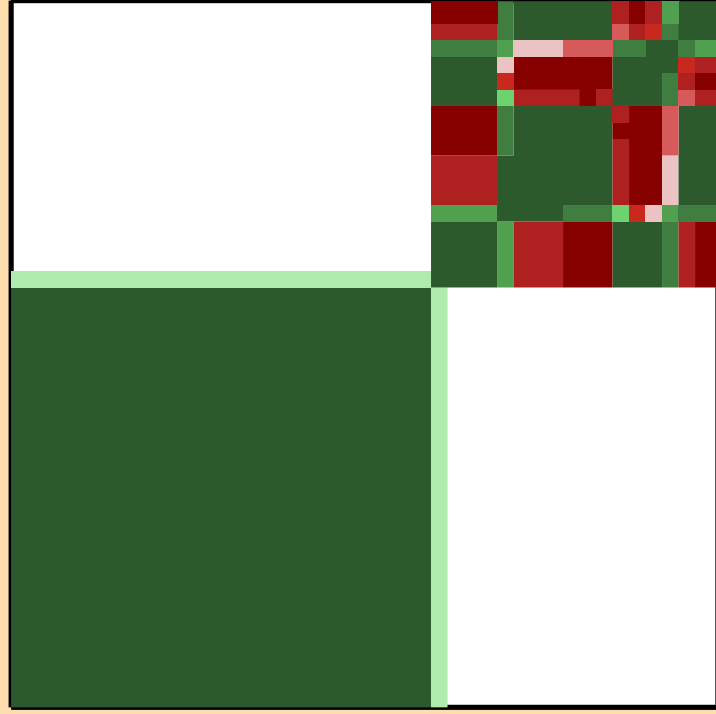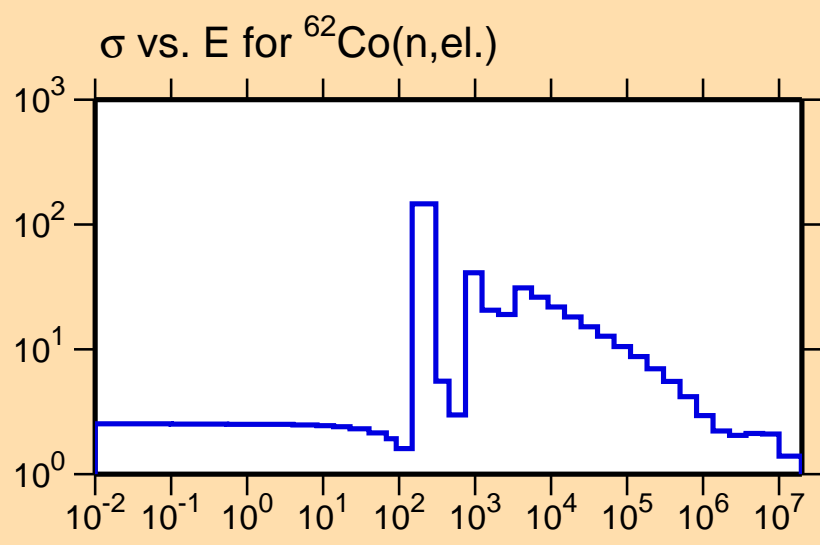

Correlation Matrix





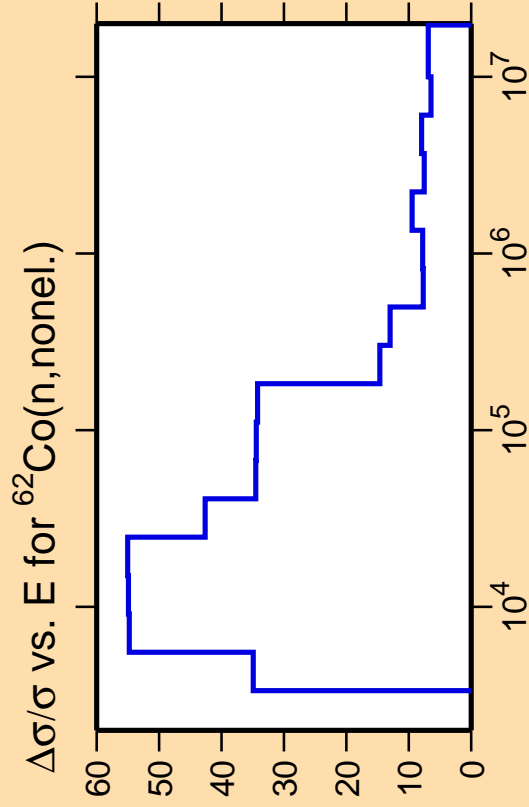

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{el.})$

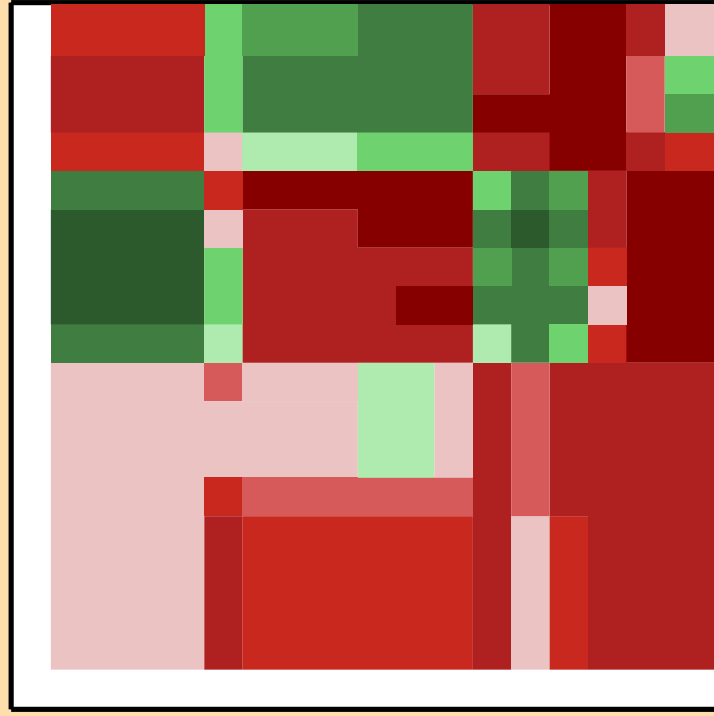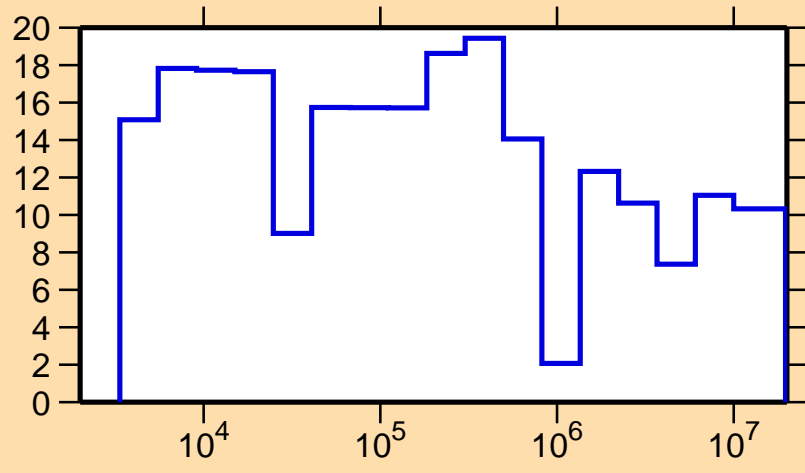

Correlation Matrix




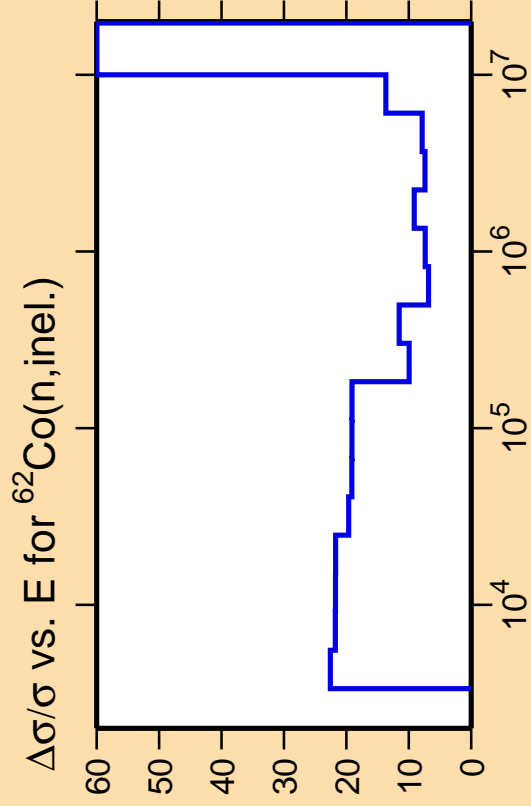


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{el.})$

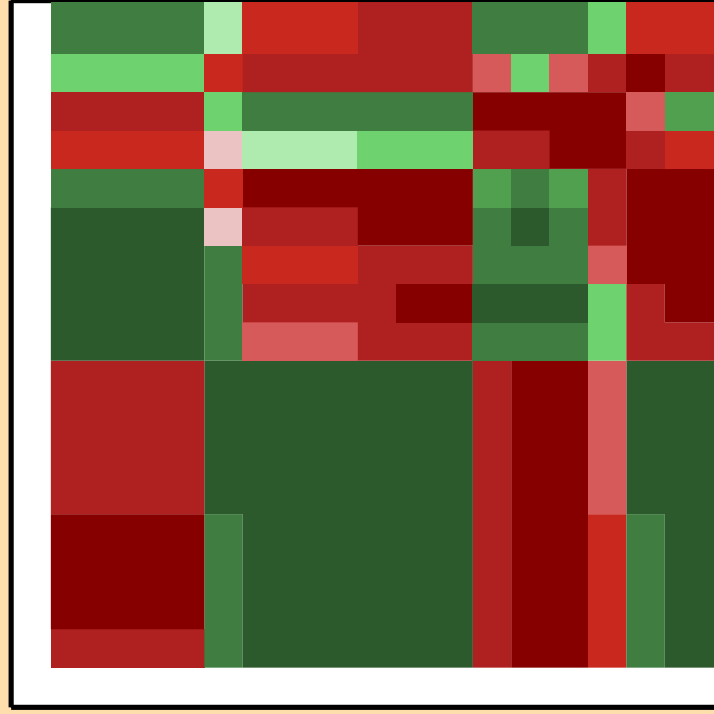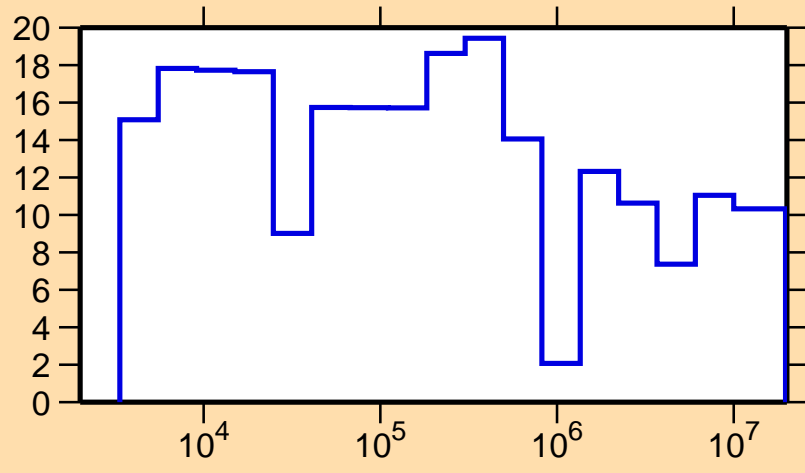

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

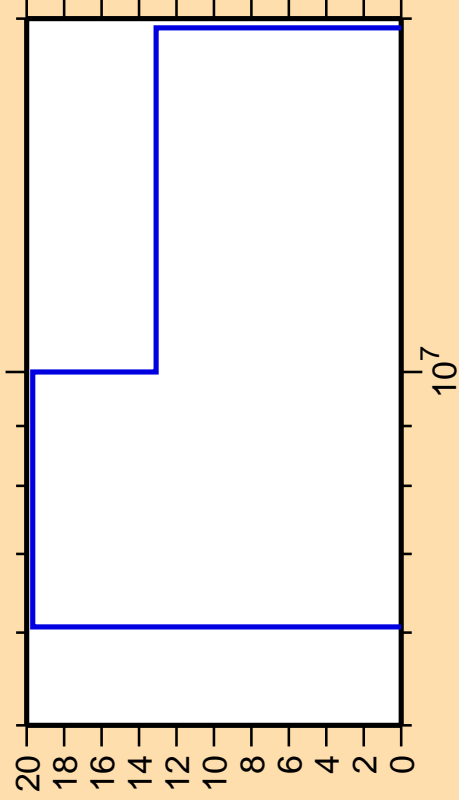

Ordinate scale is %  
relative standard deviation.


Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{el.})$

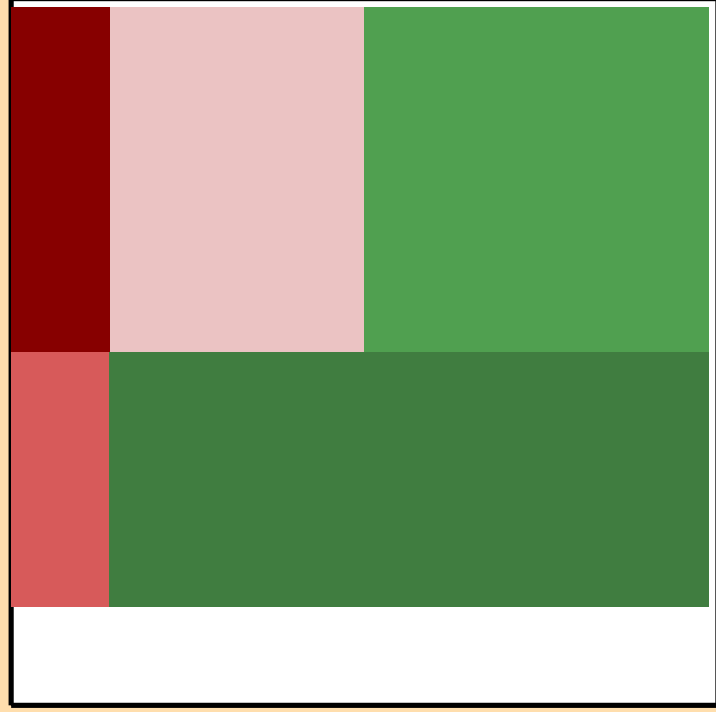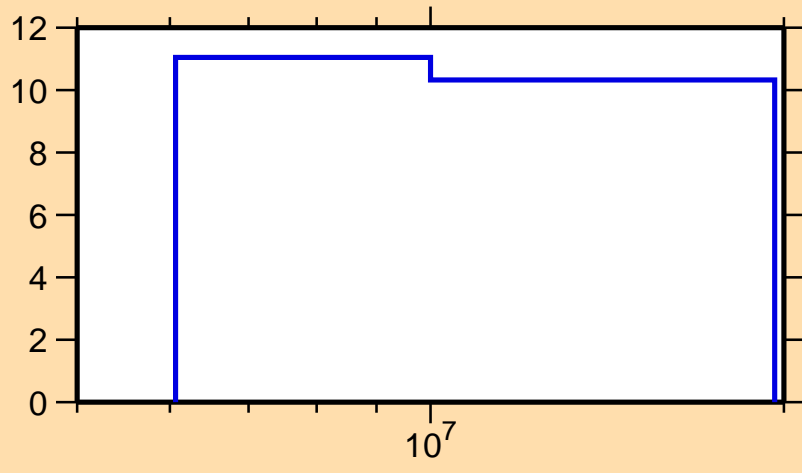

Correlation Matrix




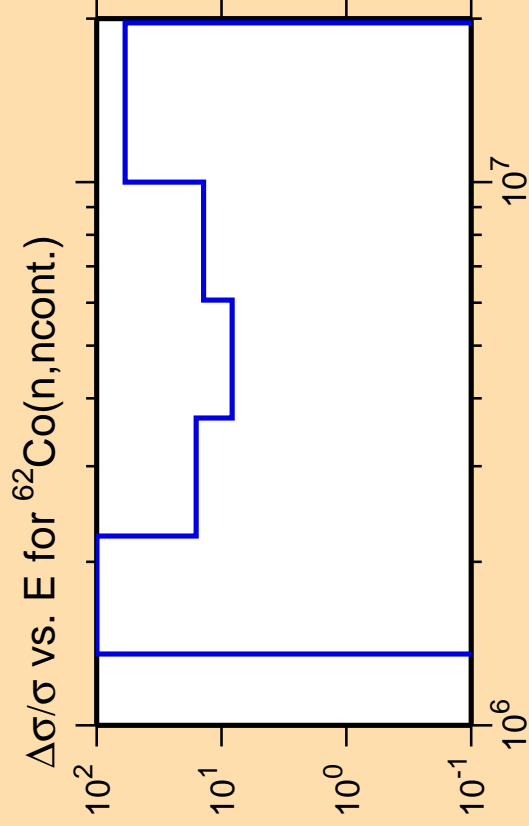


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{el.})$

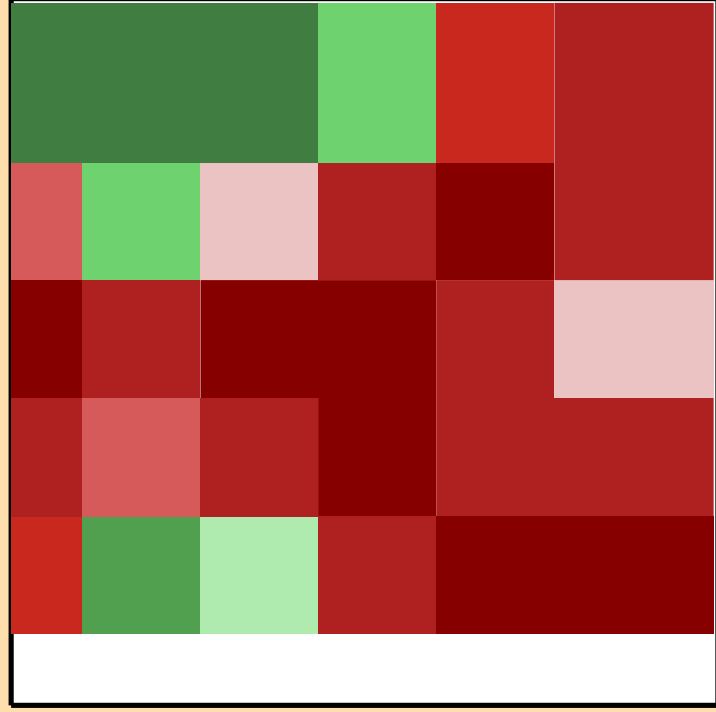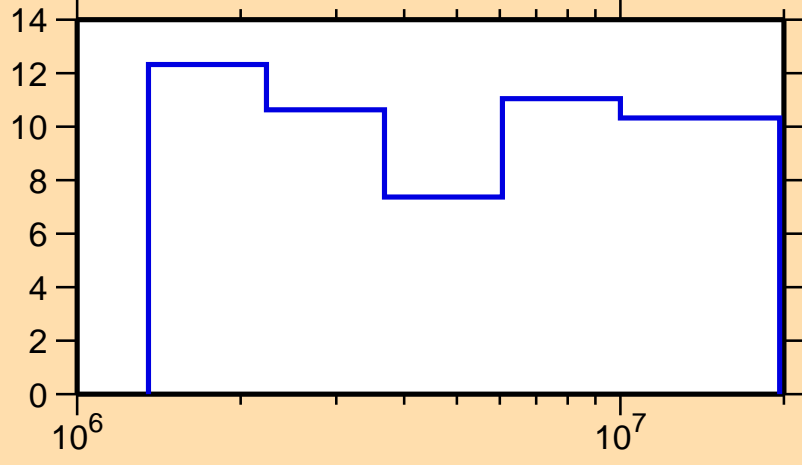

Correlation Matrix




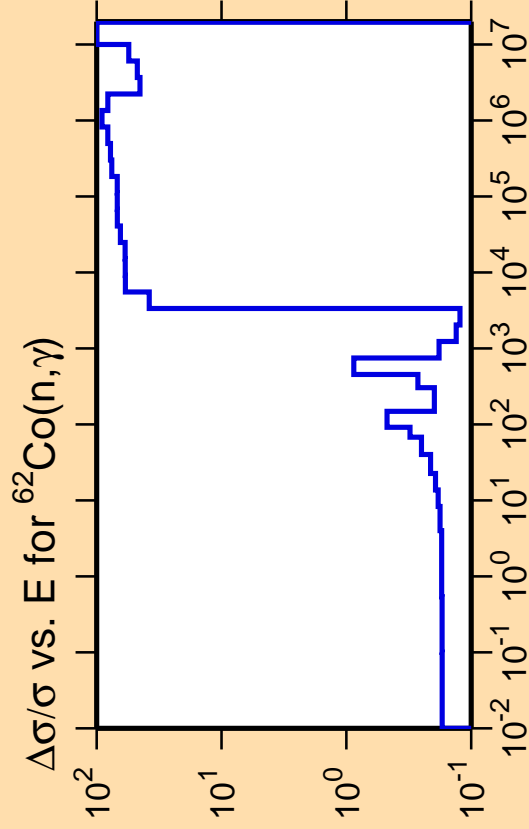


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{el.})$

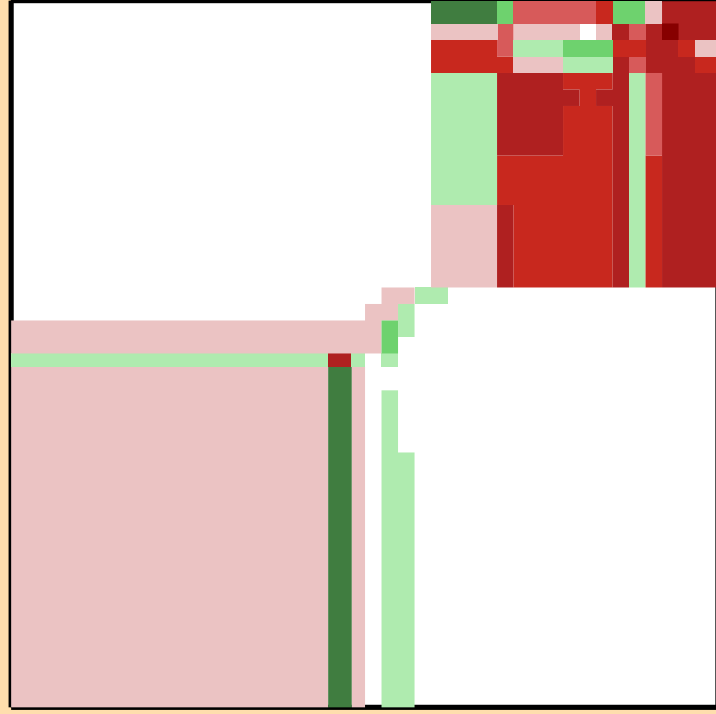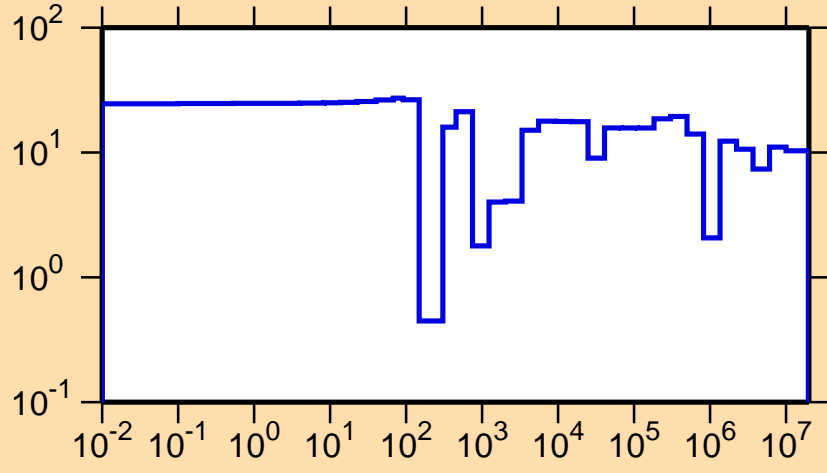

Correlation Matrix





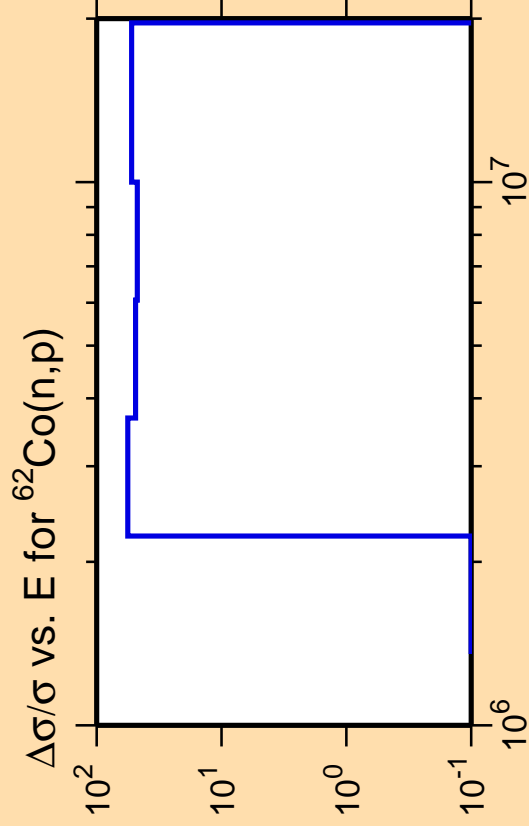

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

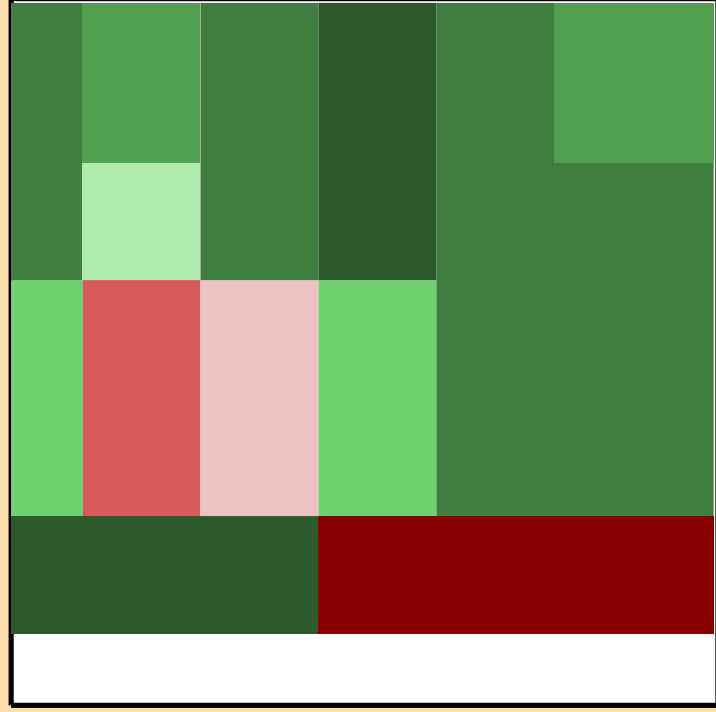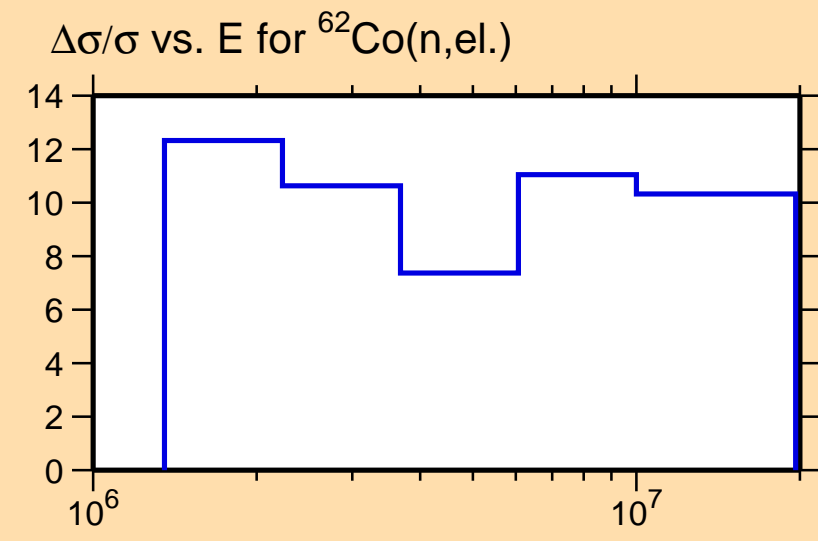

Correlation Matrix







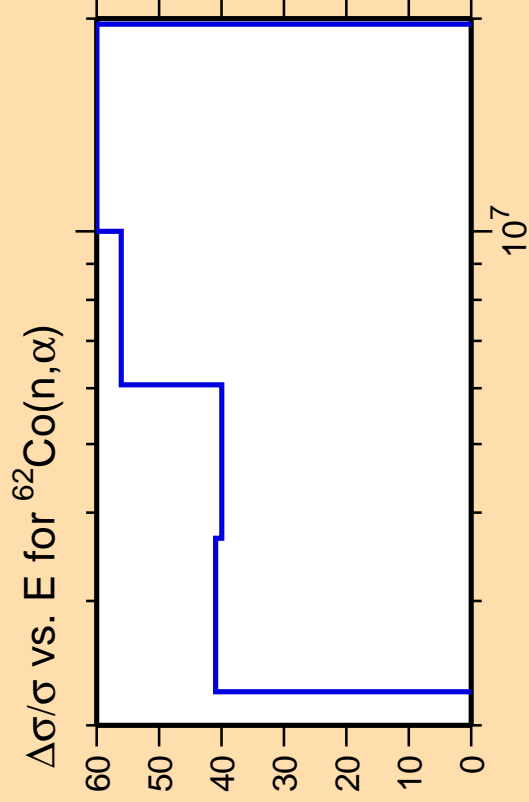

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

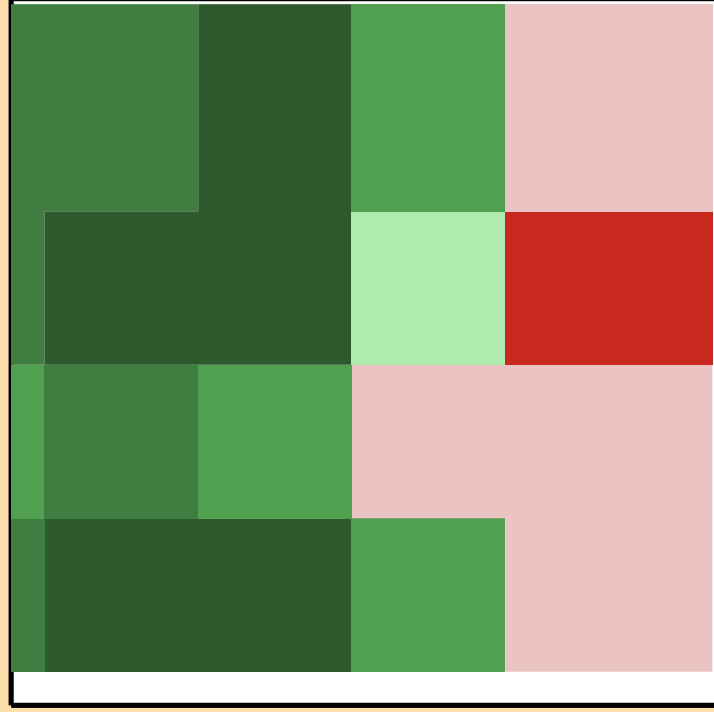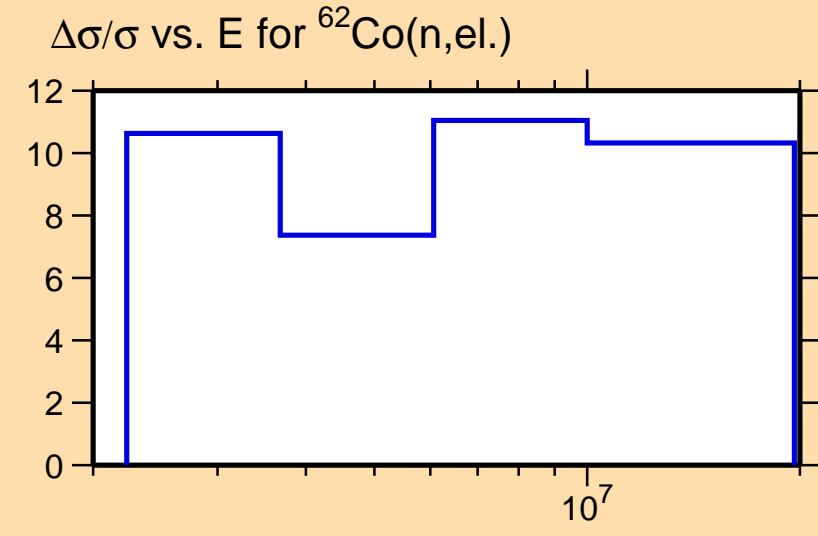

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nonel.})$

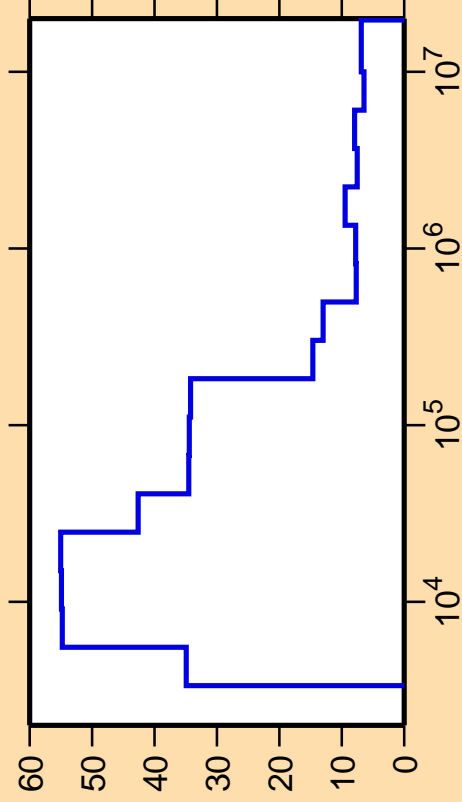

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nonel.})$

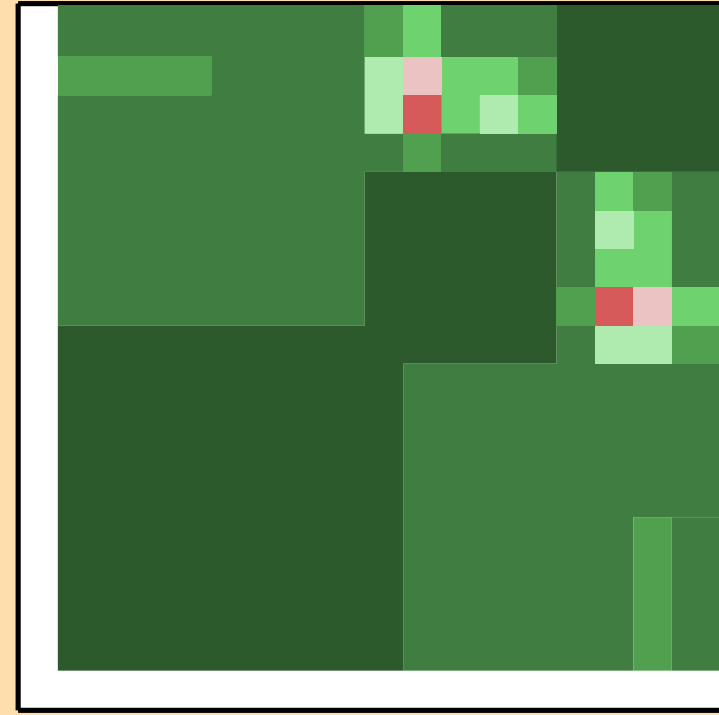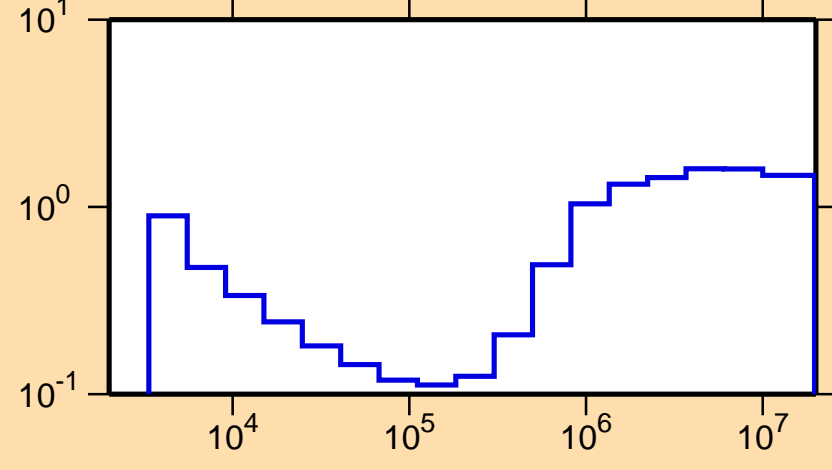

Correlation Matrix




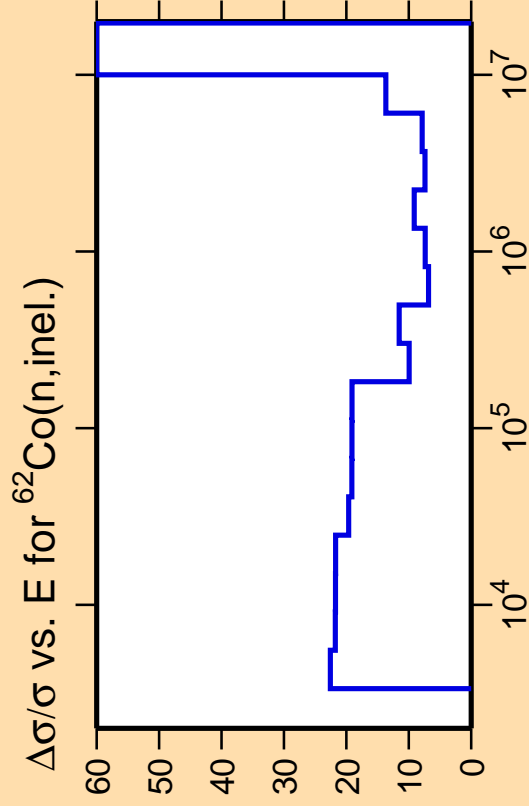


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nonel.})$

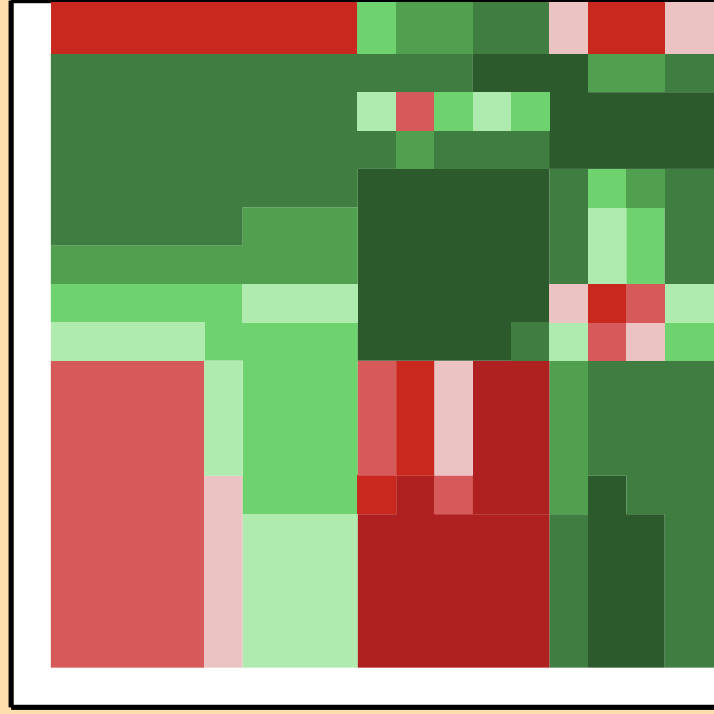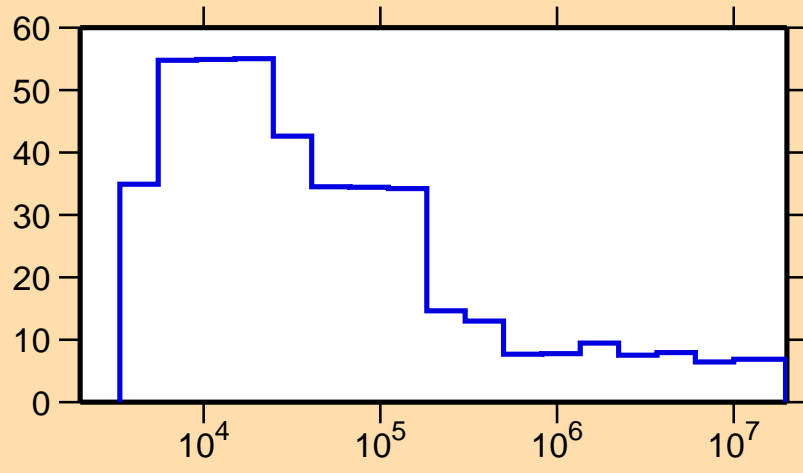

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

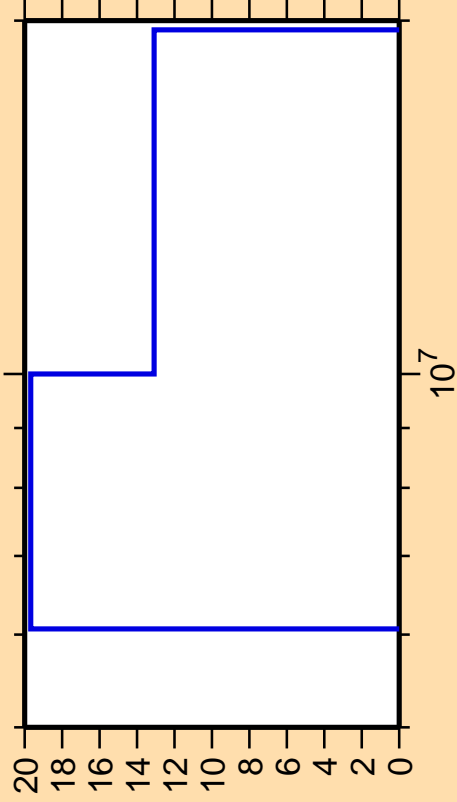

Ordinate scale is %  
relative standard deviation.


Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nonel.})$

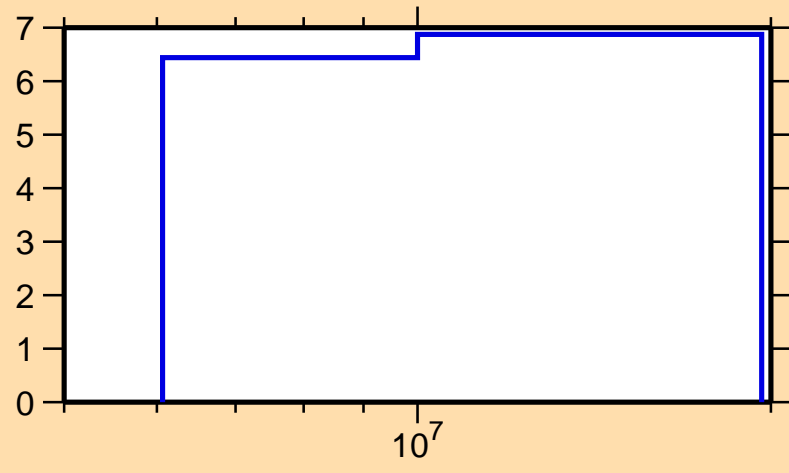

Correlation Matrix





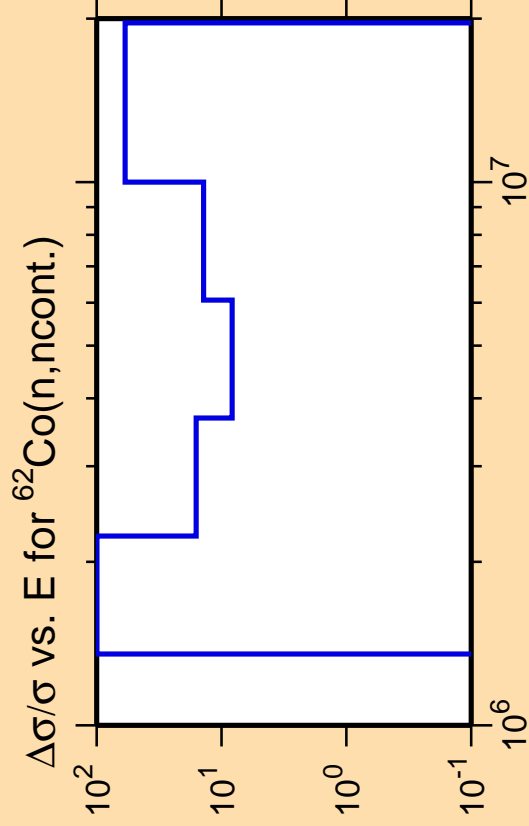

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

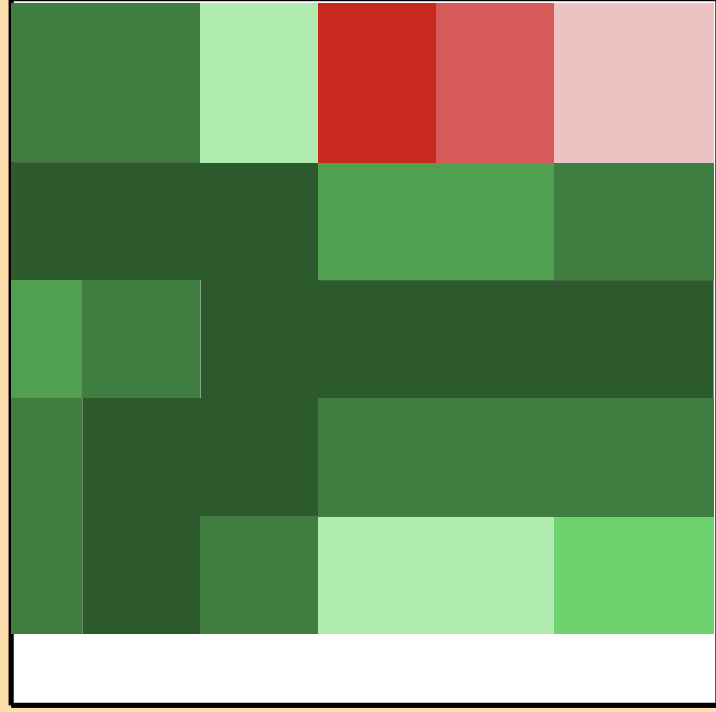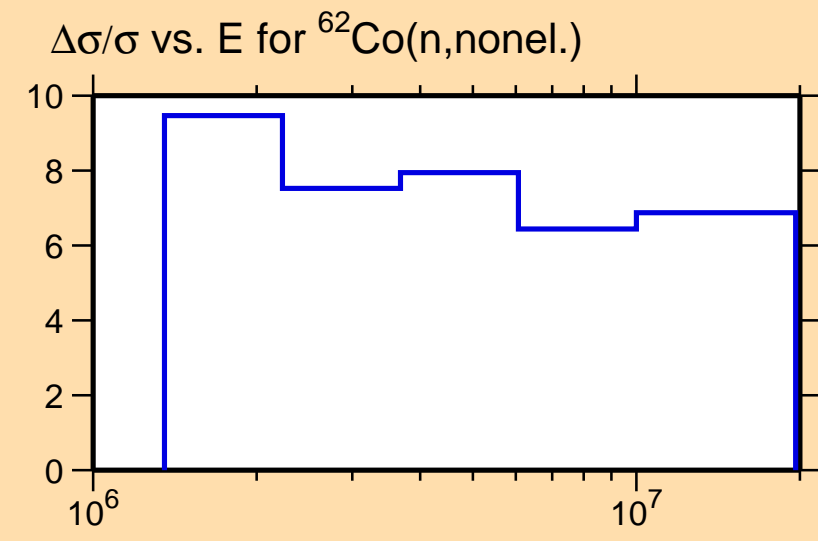

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\gamma)$


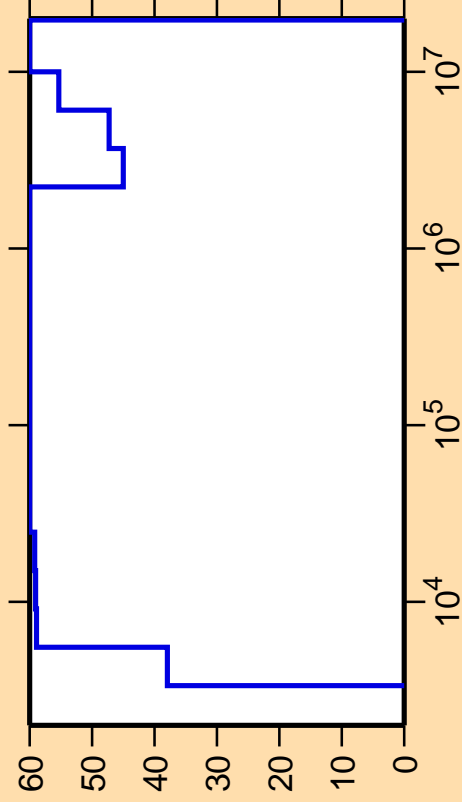


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nonel.})$

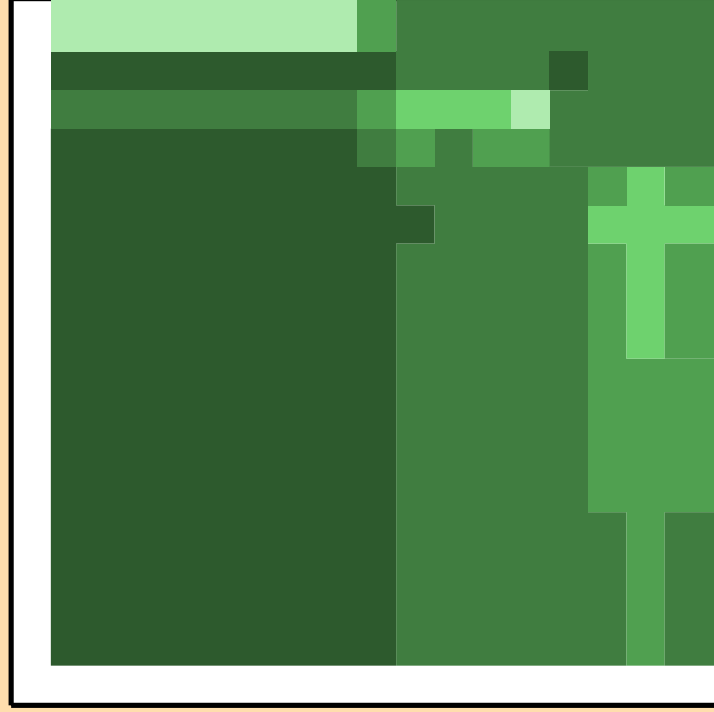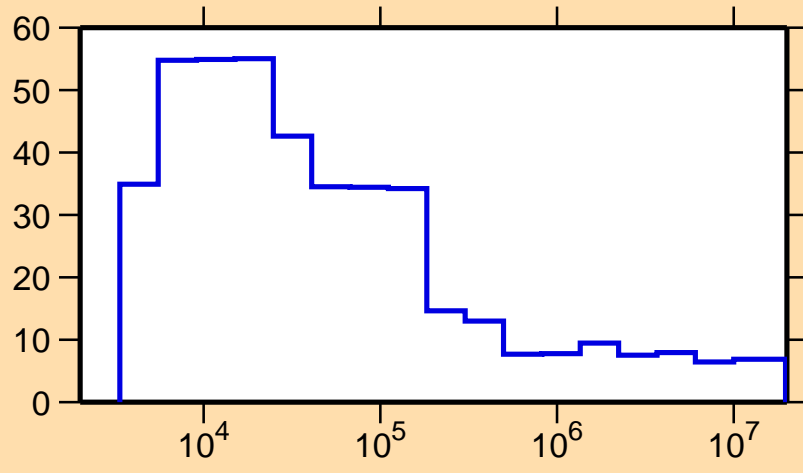

Correlation Matrix




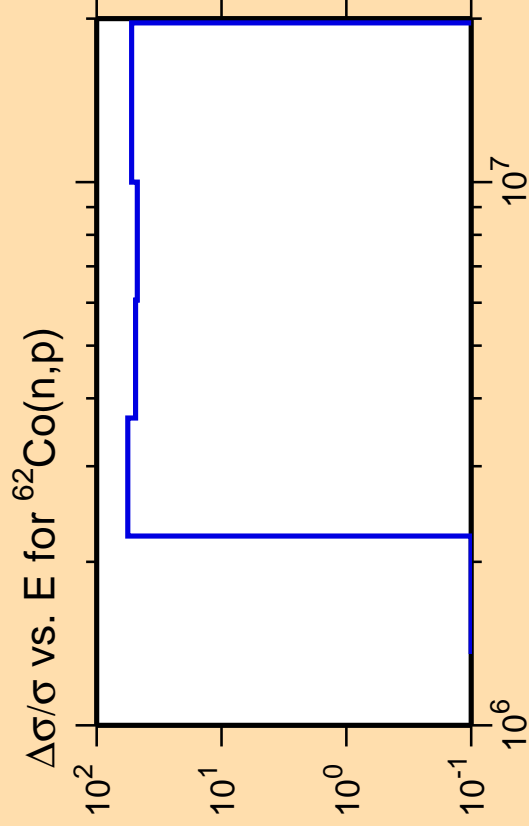


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nonel.})$

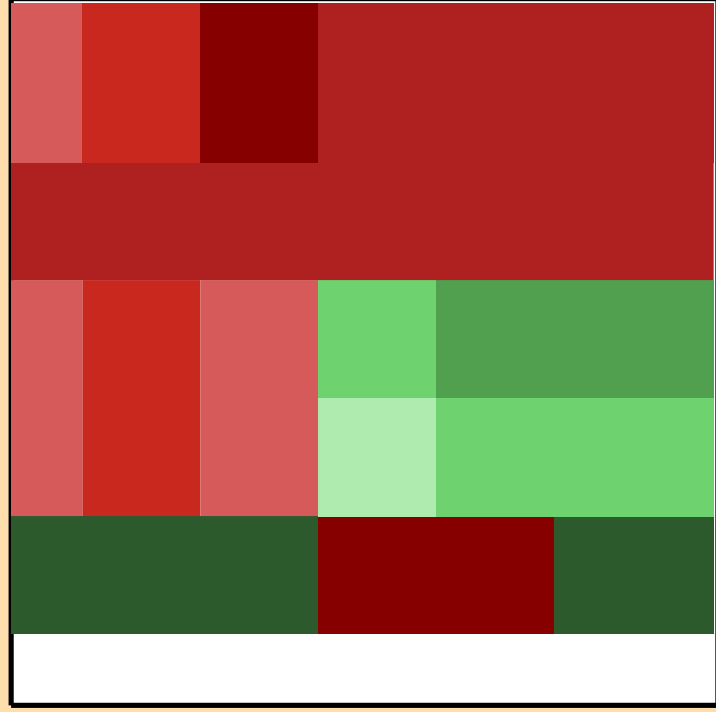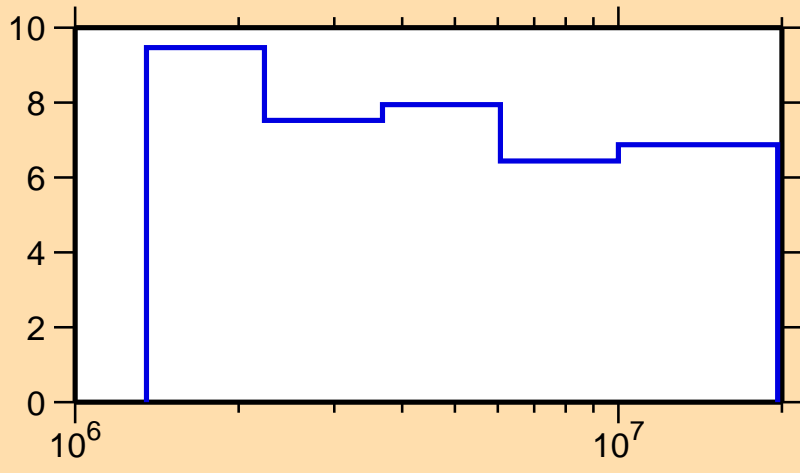

Correlation Matrix




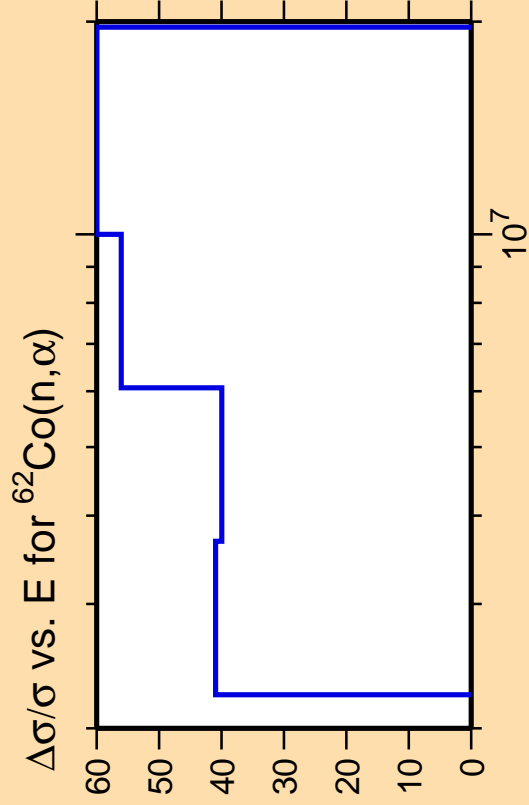


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nonel.})$

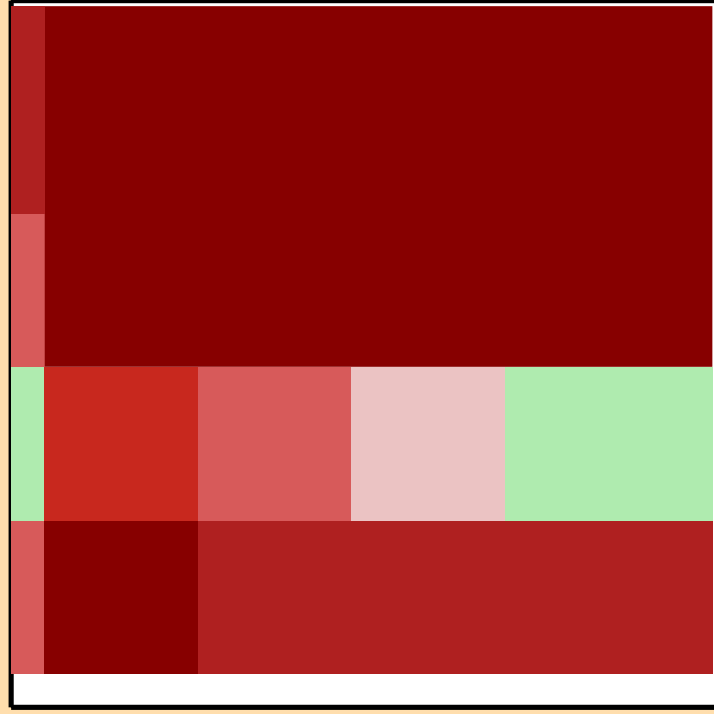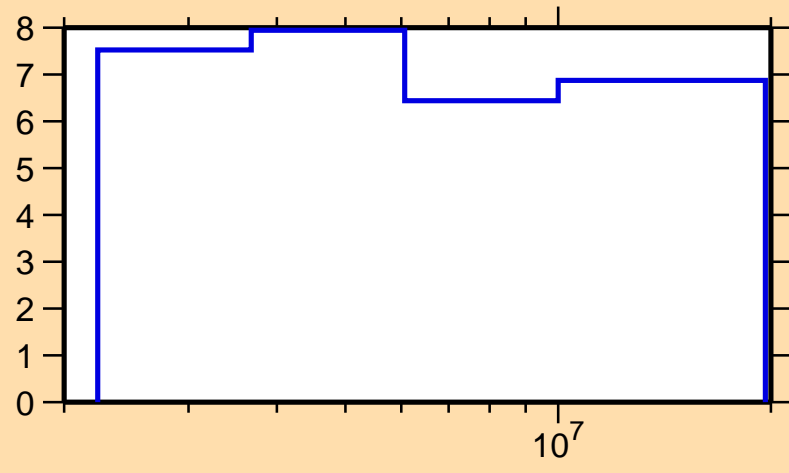

Correlation Matrix







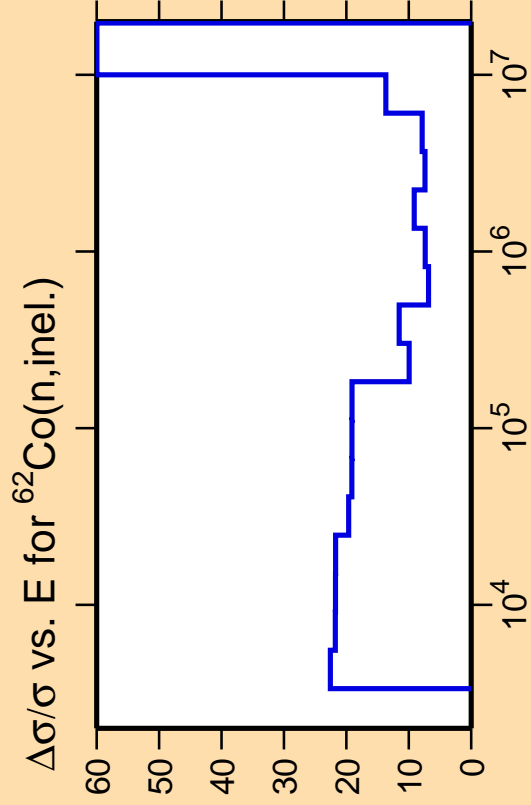

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

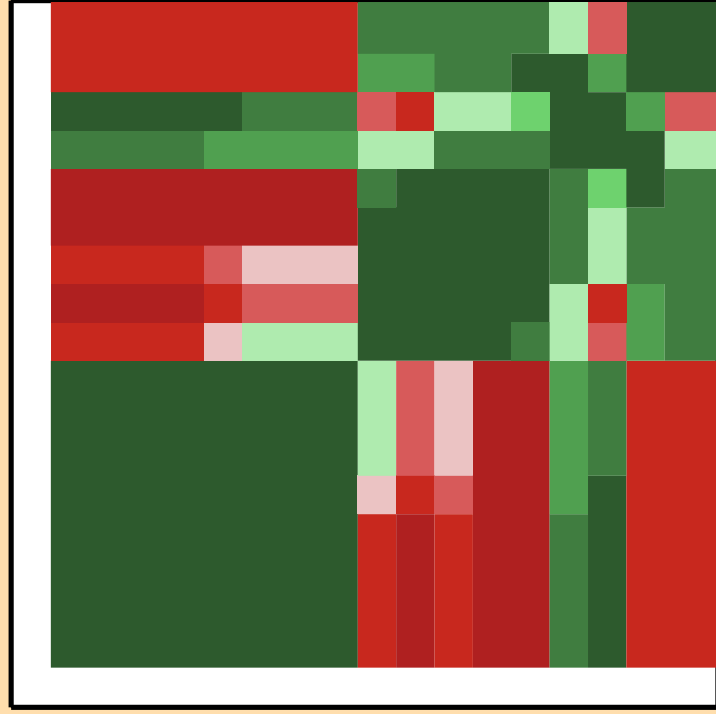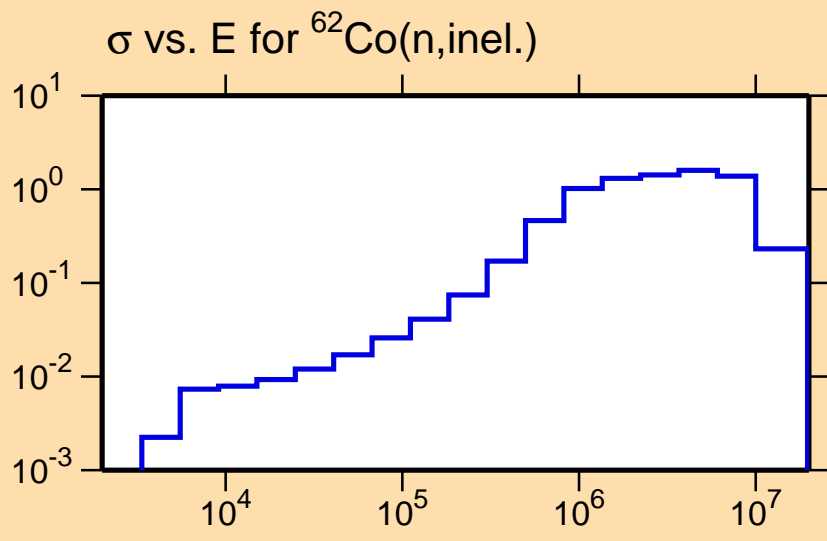

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

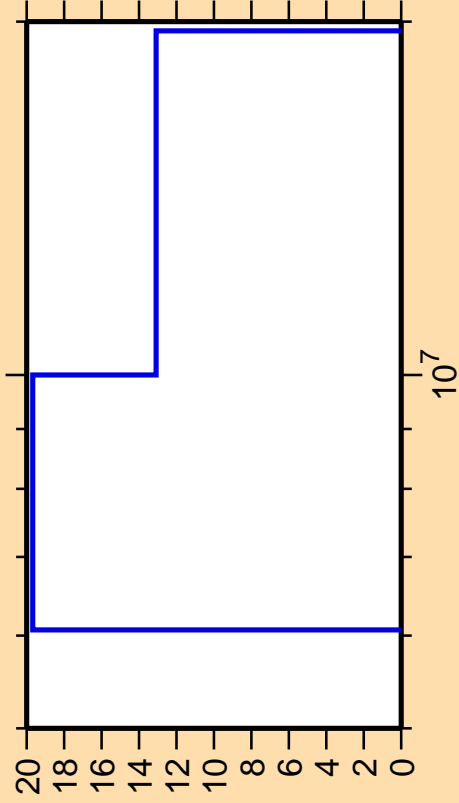

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

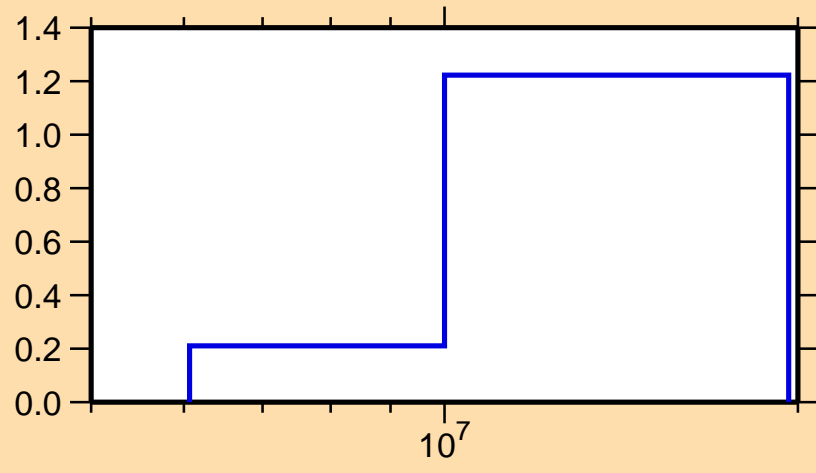

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,n\text{cont.})$

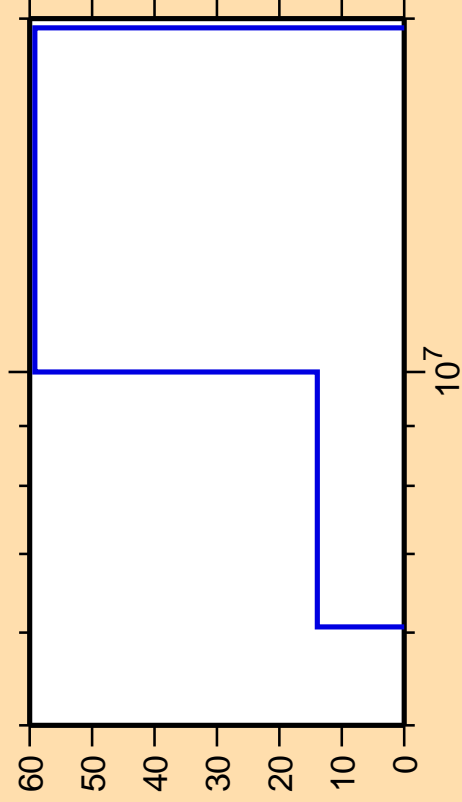


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

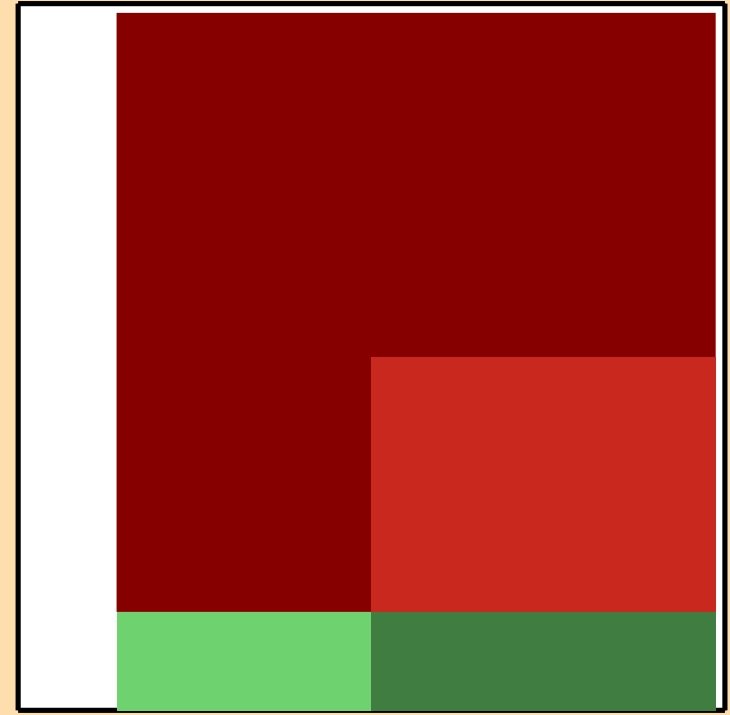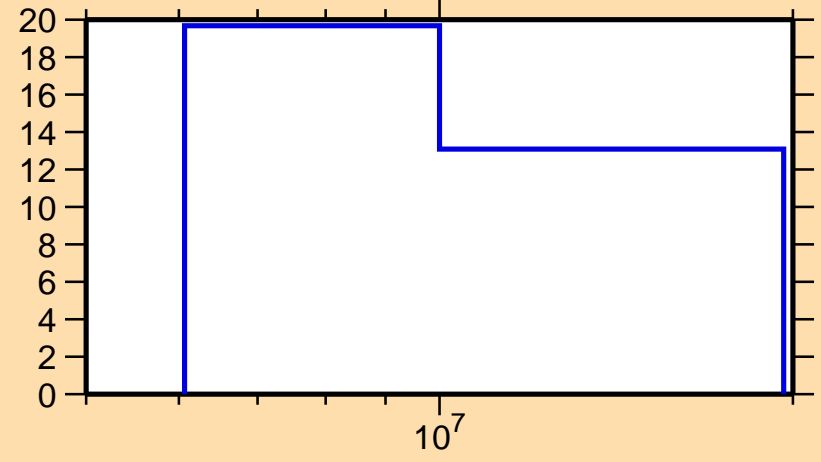

Correlation Matrix


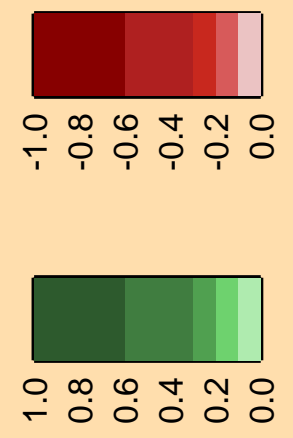


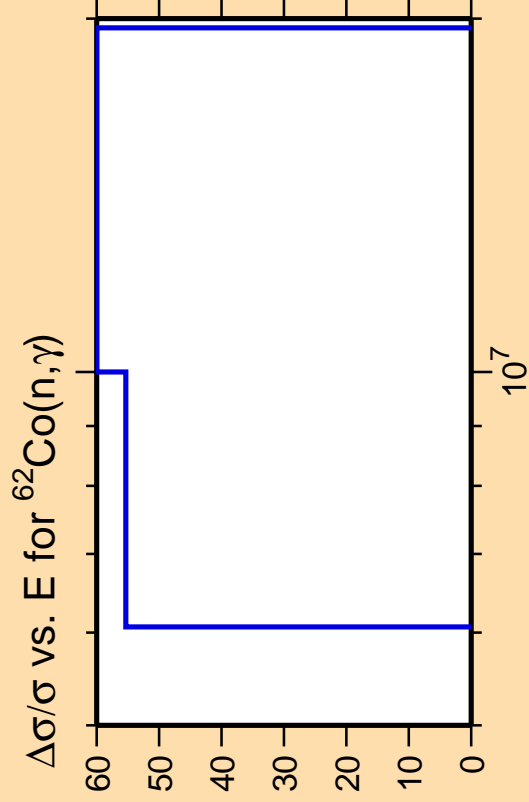

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

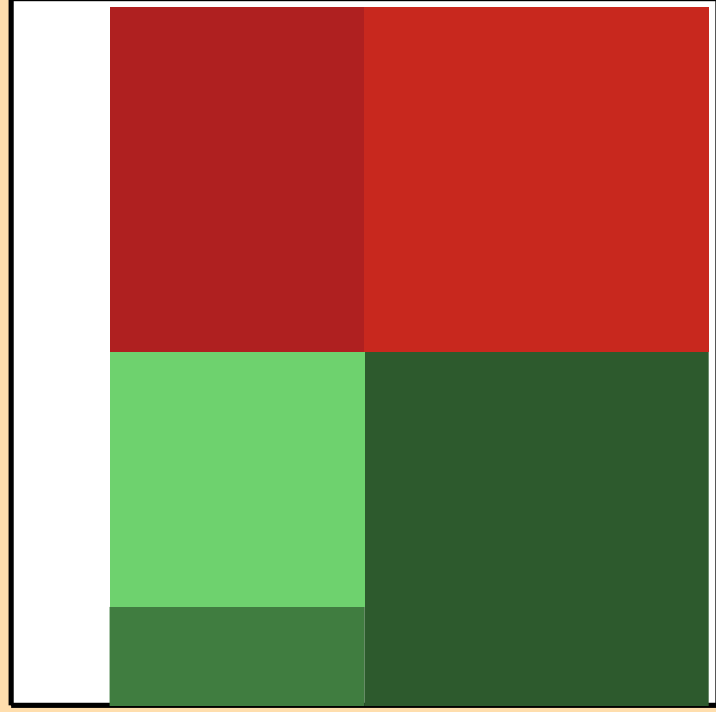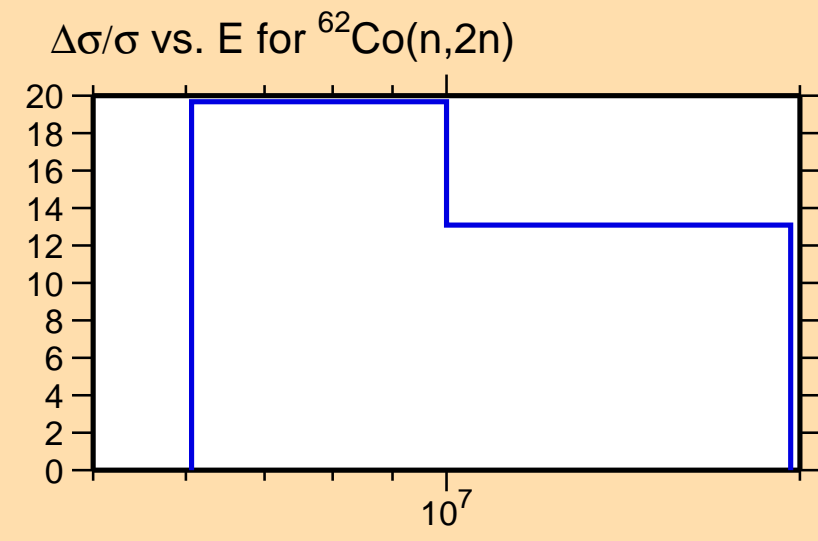

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,p)$

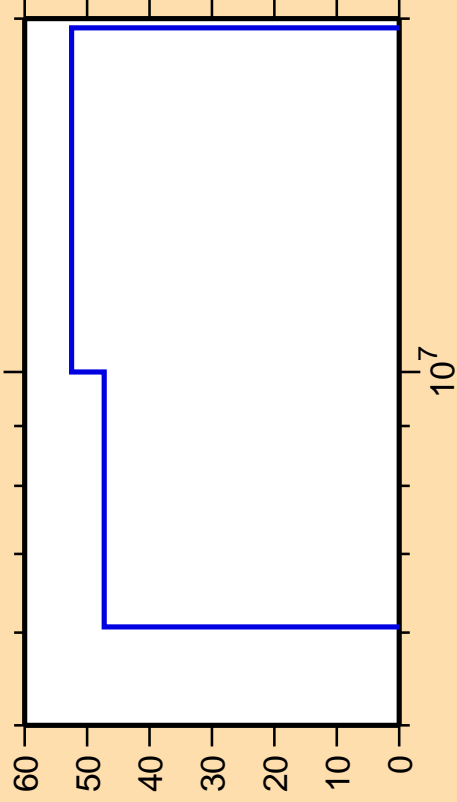

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

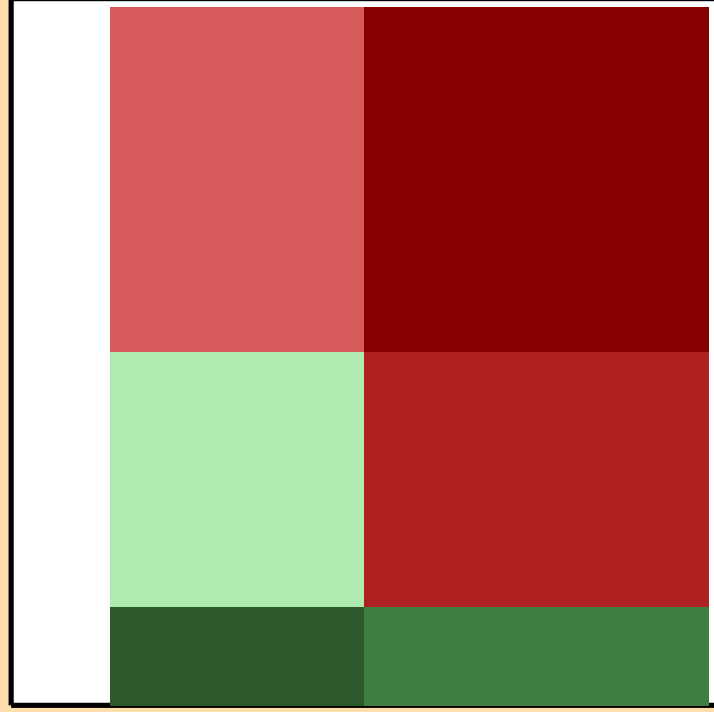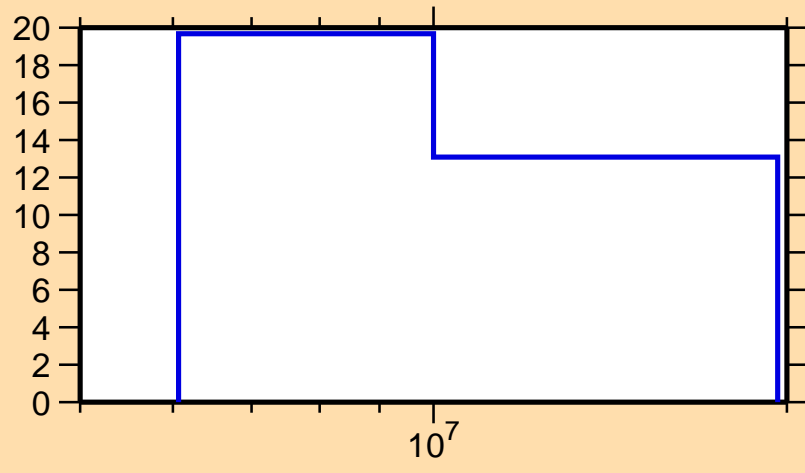

Correlation Matrix




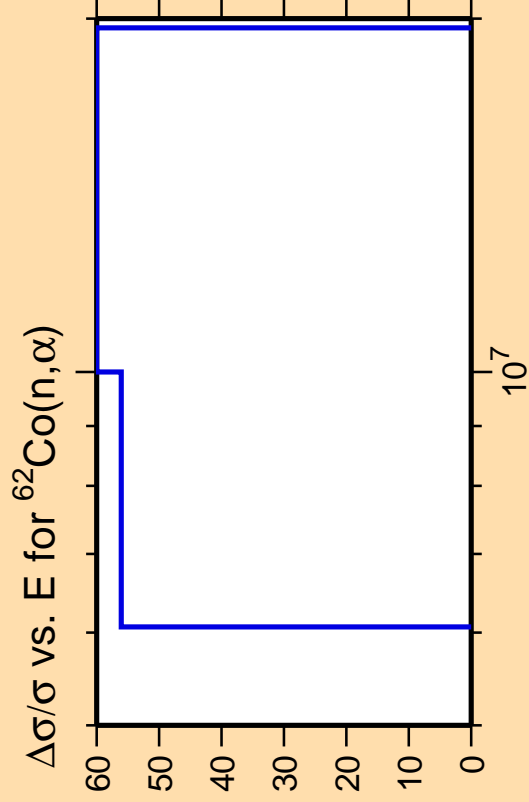


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n)$

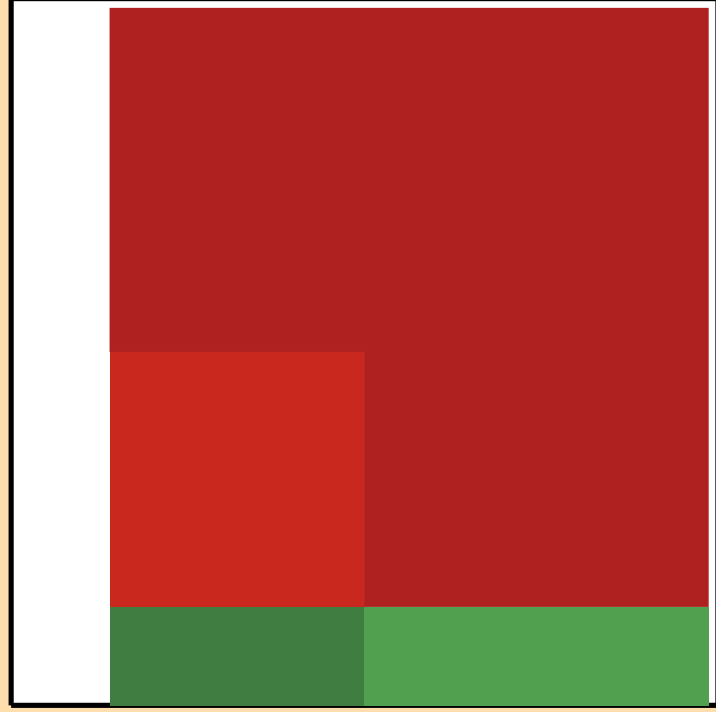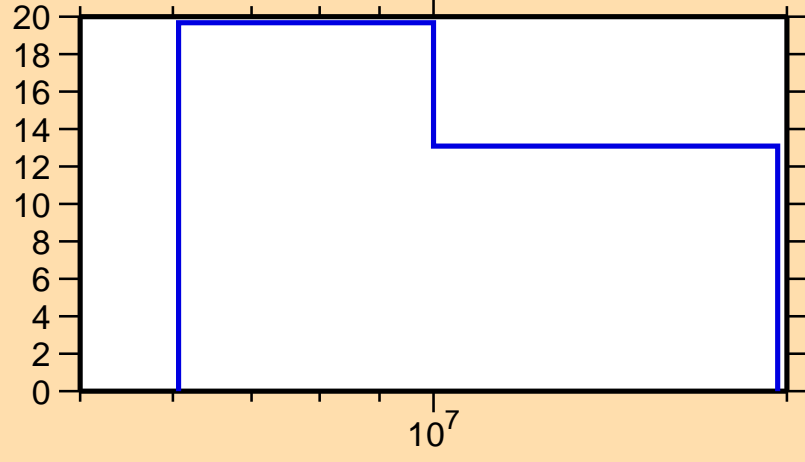

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,3n)$

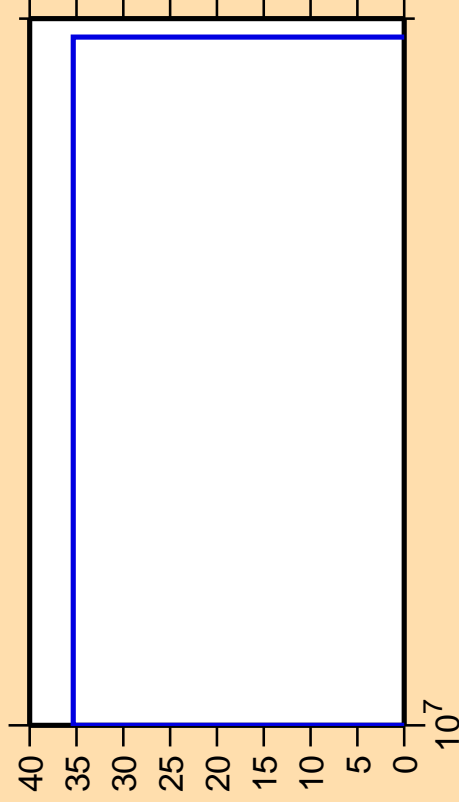

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{62}\text{Co}(n,3n)$

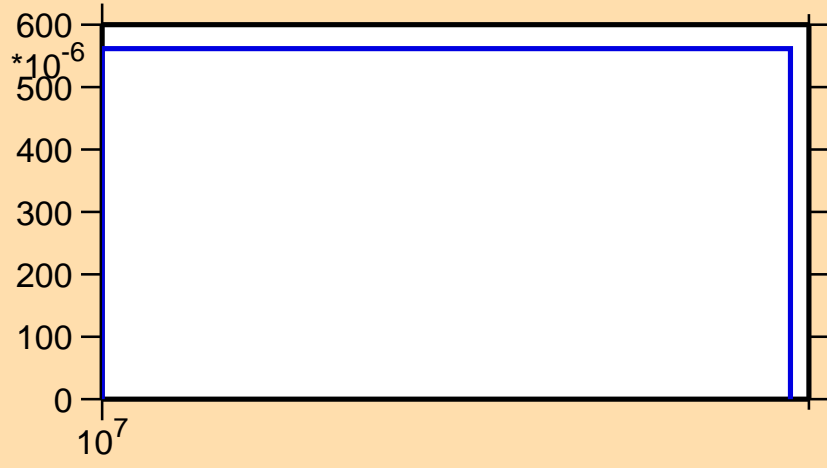


$10^7$



Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,n\alpha)$

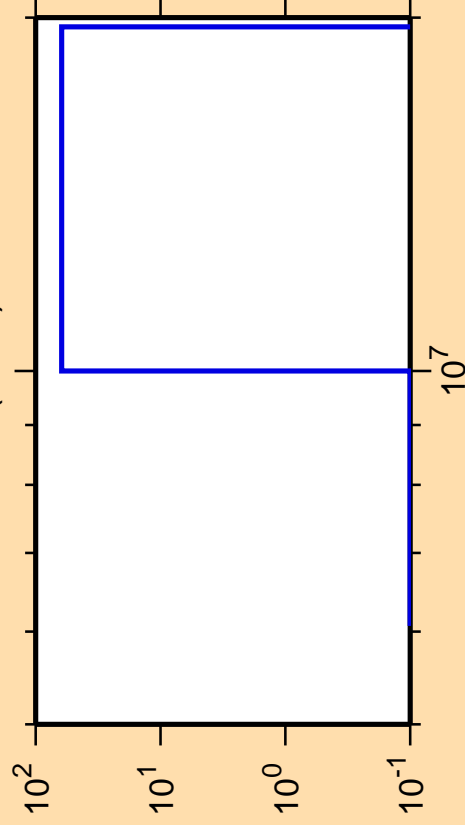


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{62}\text{Co}(n,n\alpha)$

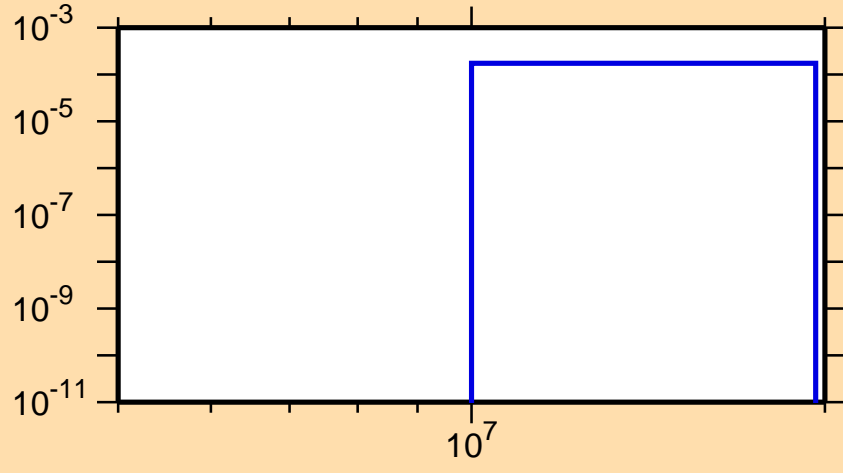


Correlation Matrix

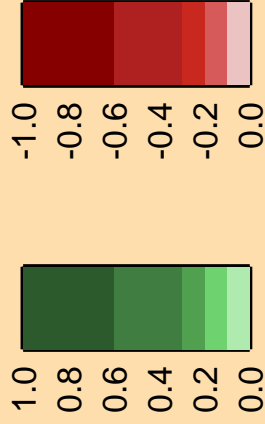




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2n\alpha)$

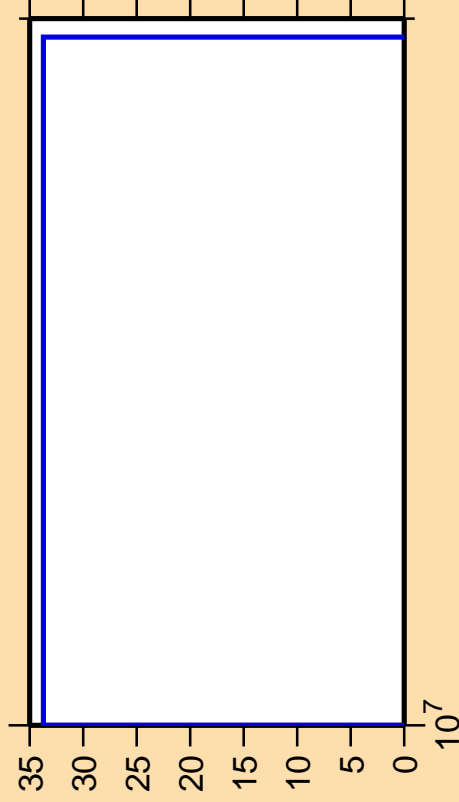

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{62}\text{Co}(n,2n\alpha)$

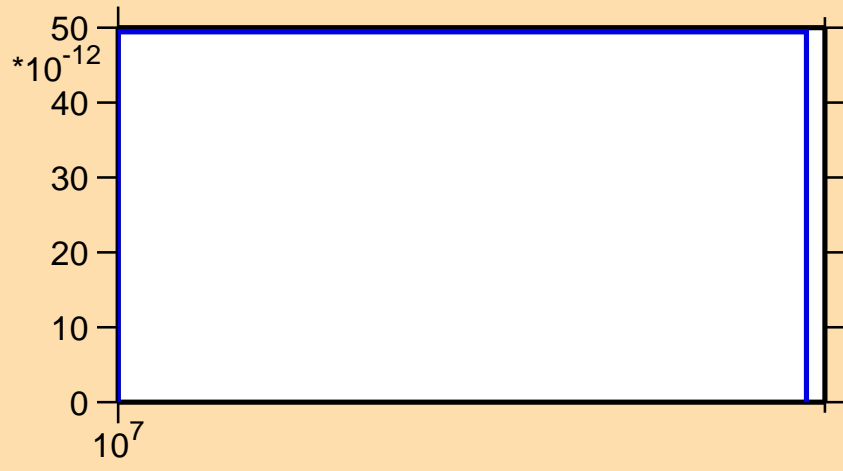

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,np)$

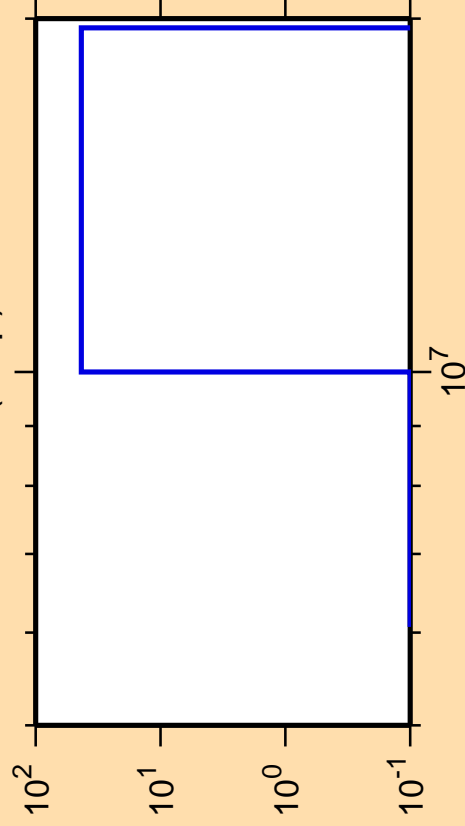


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{62}\text{Co}(n,np)$

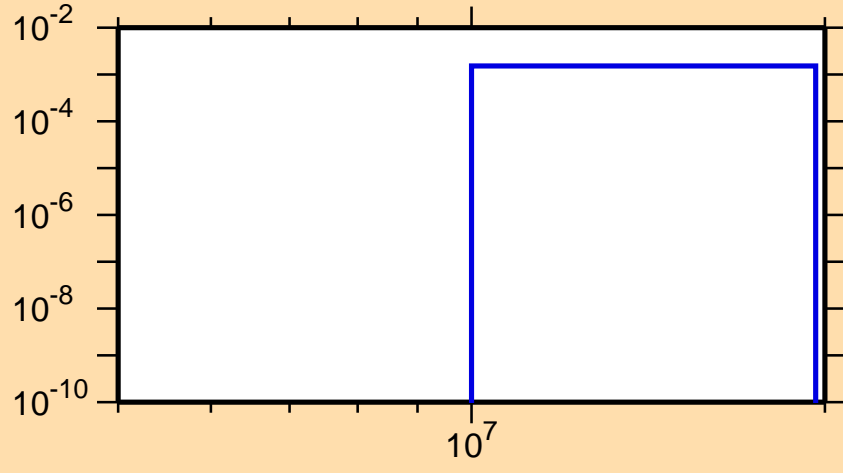

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nd})$



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{62}\text{Co}(n,\text{nd})$



$10^7$



Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,nt)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


$\sigma$  vs. E for  $^{62}\text{Co}(n,nt)$

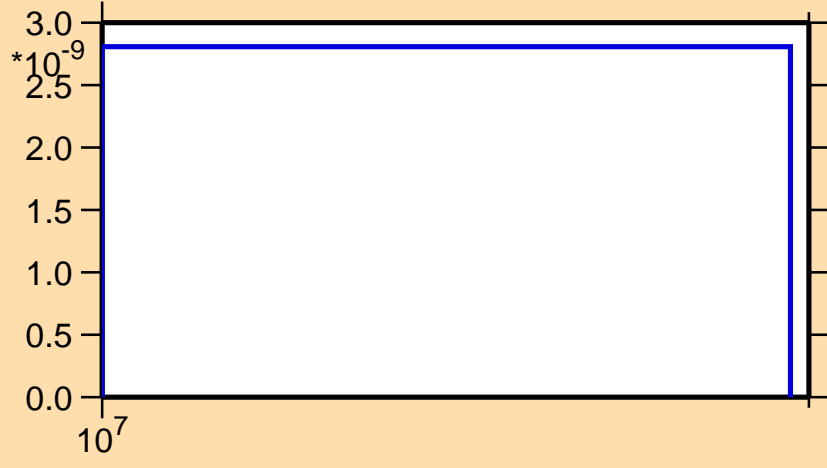

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,2np)$

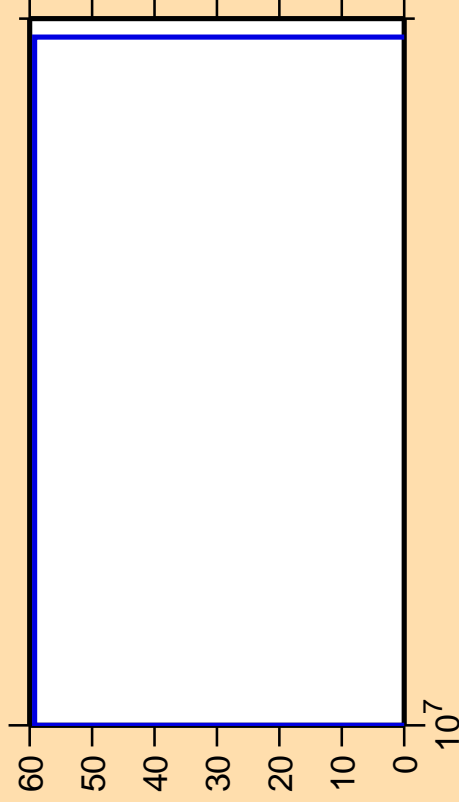

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{62}\text{Co}(n,2np)$

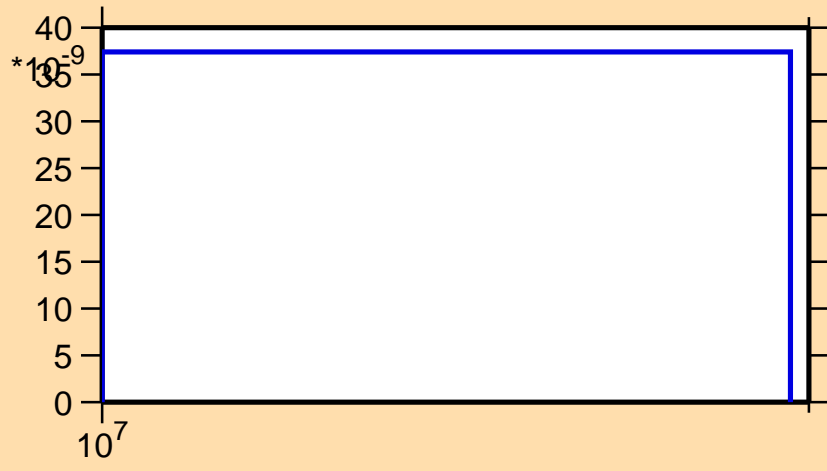


$10^7$





Correlation Matrix



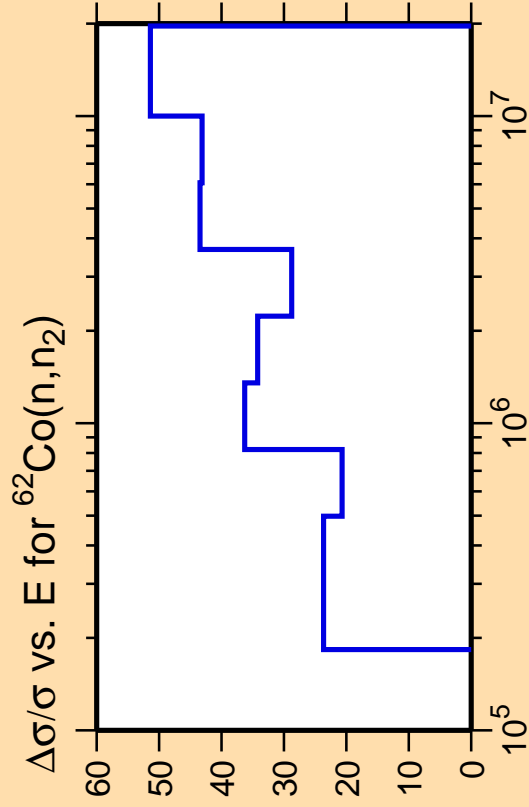


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

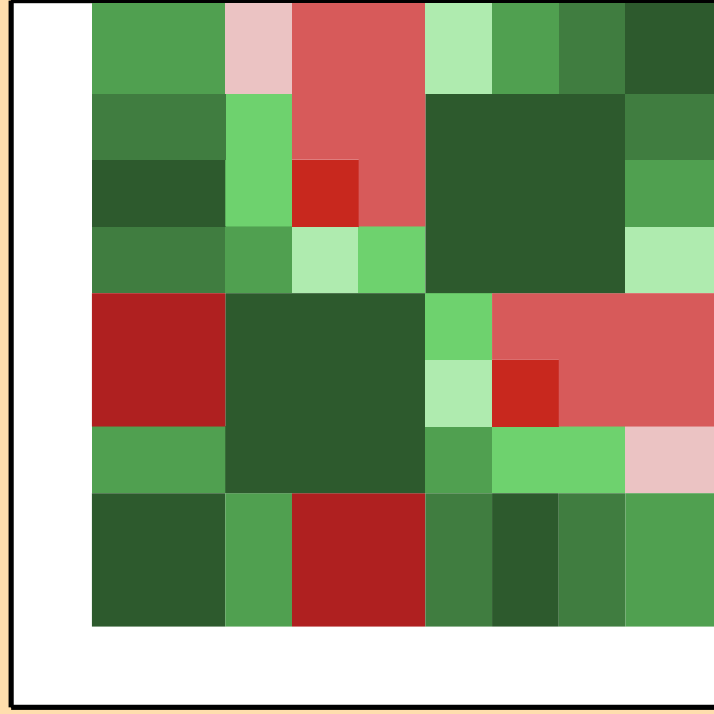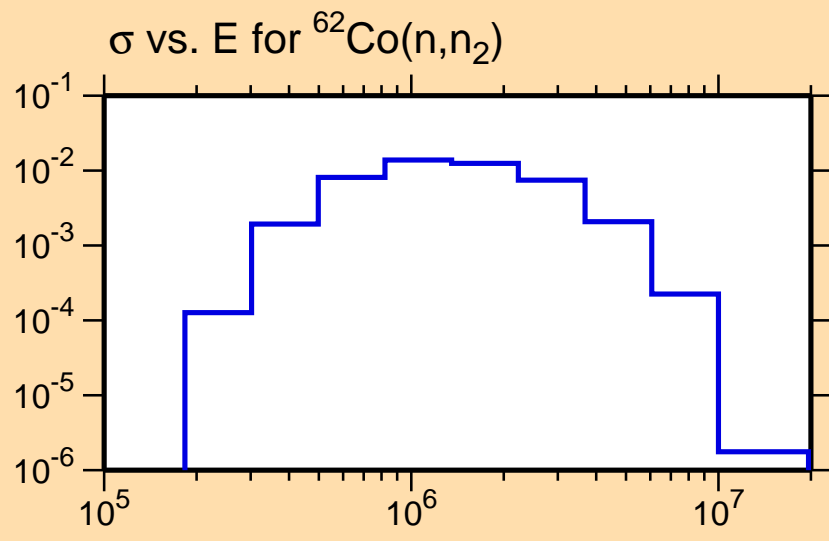



Correlation Matrix



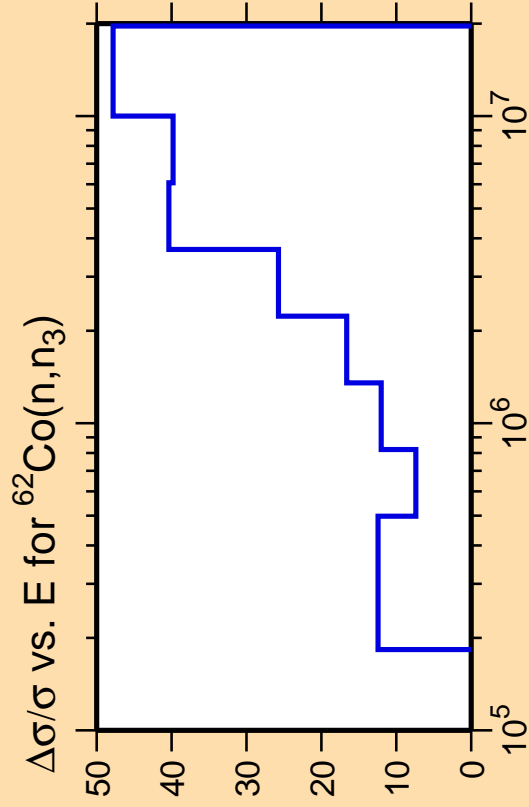


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

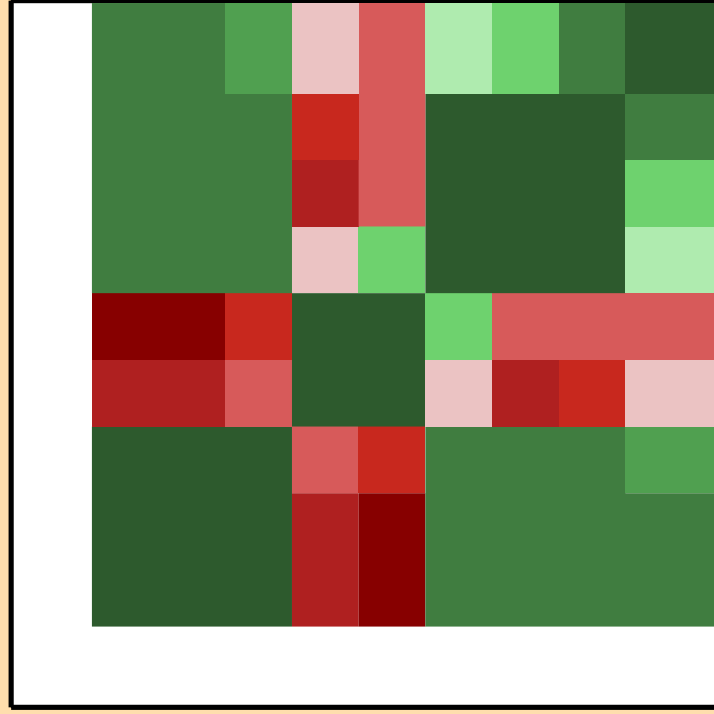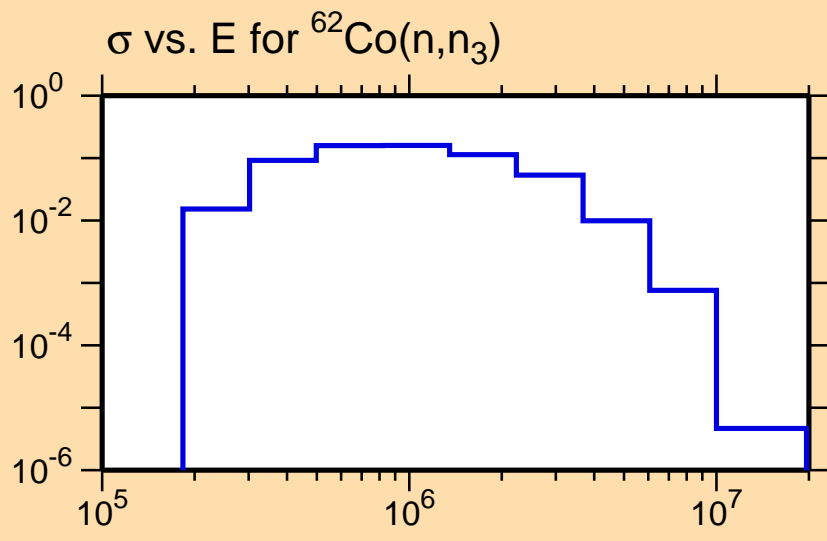



Correlation Matrix



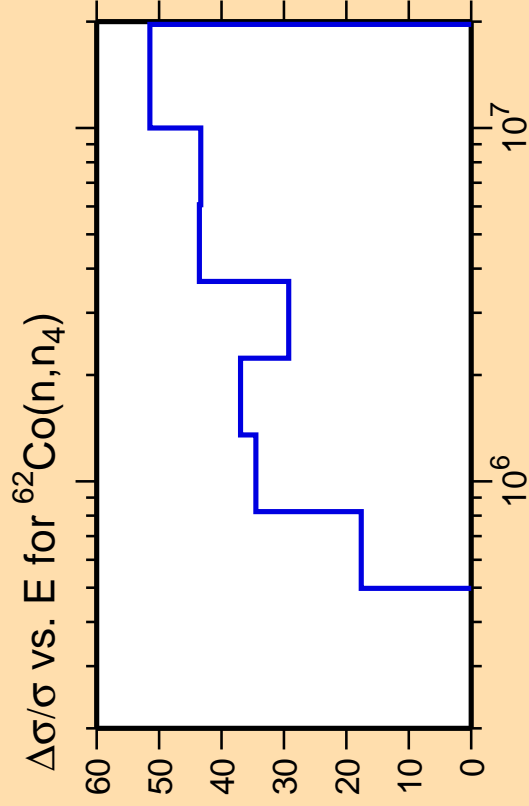

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

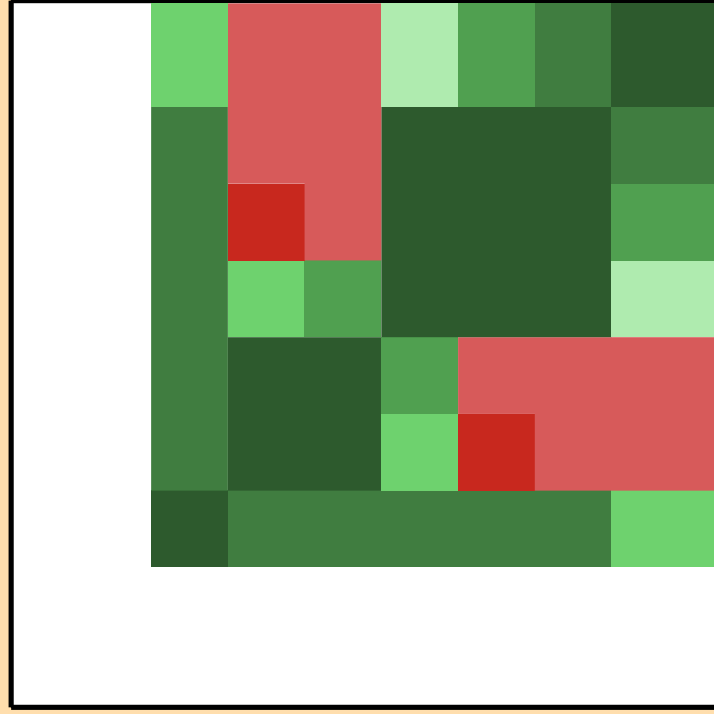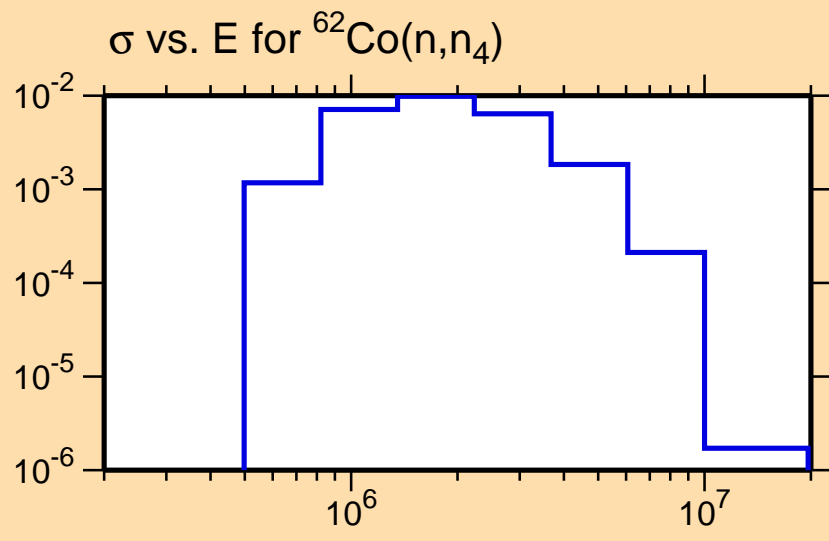

Correlation Matrix







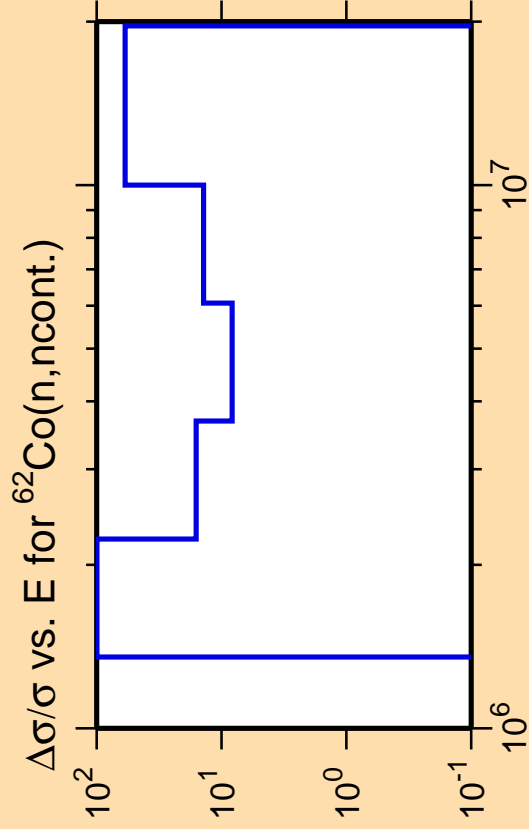

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

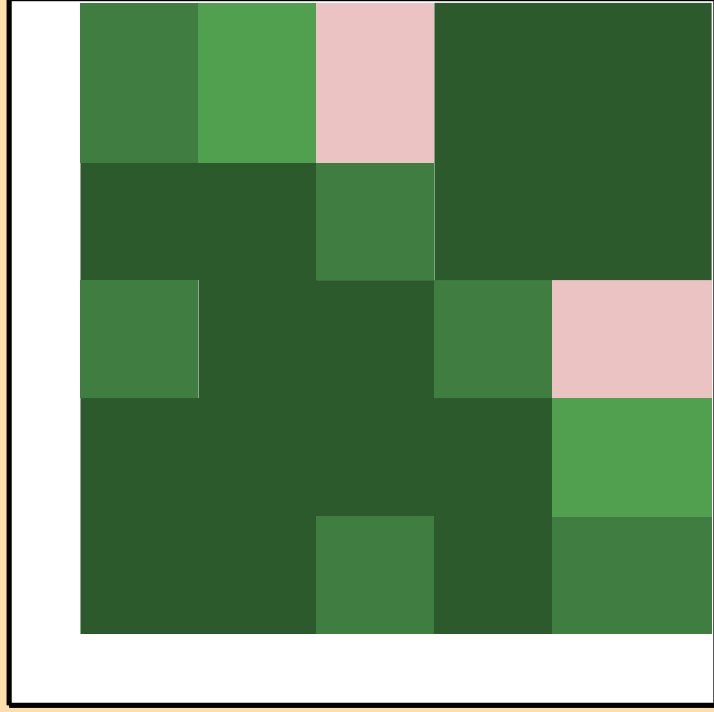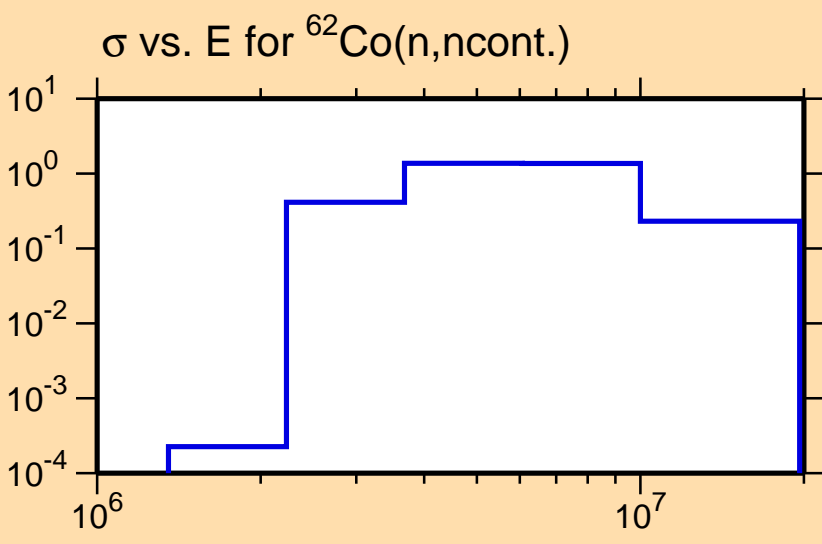

Correlation Matrix





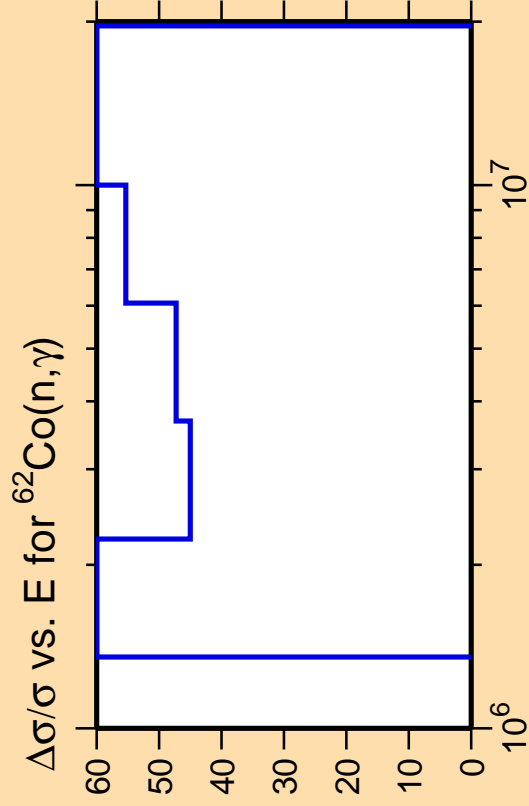

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

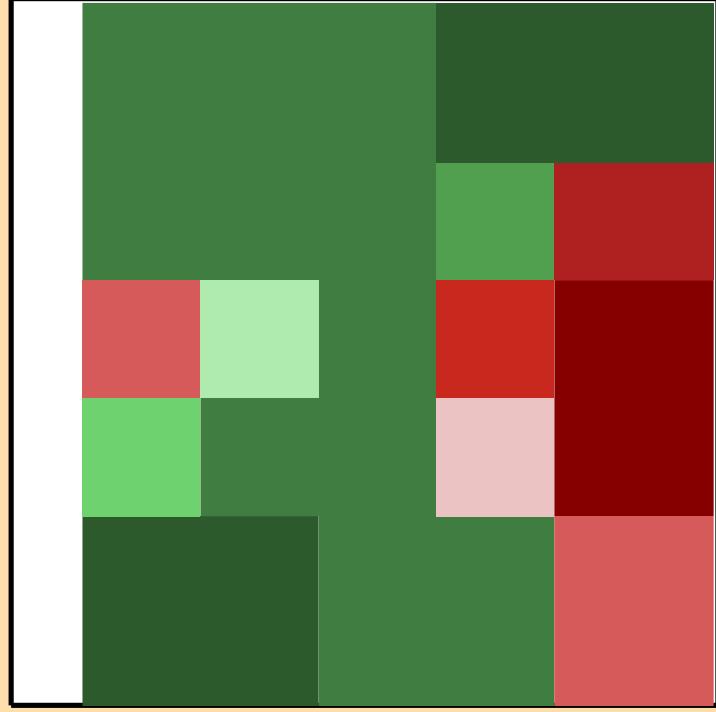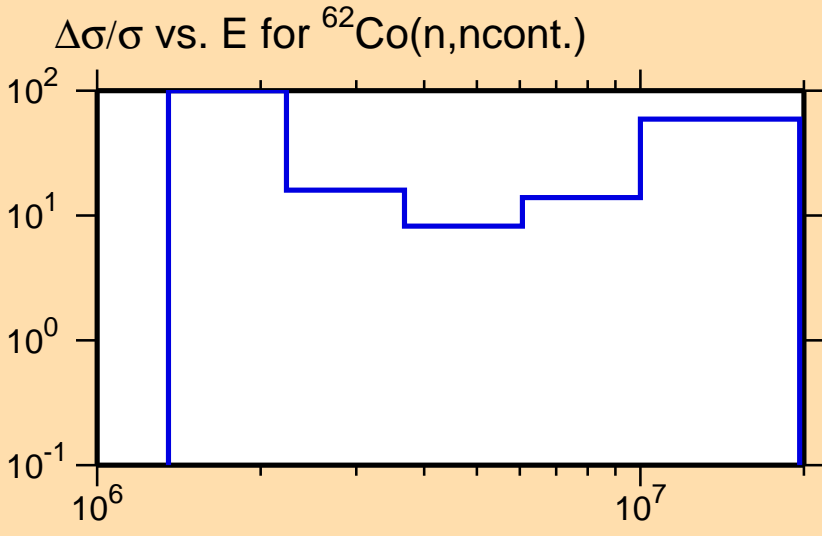

Correlation Matrix





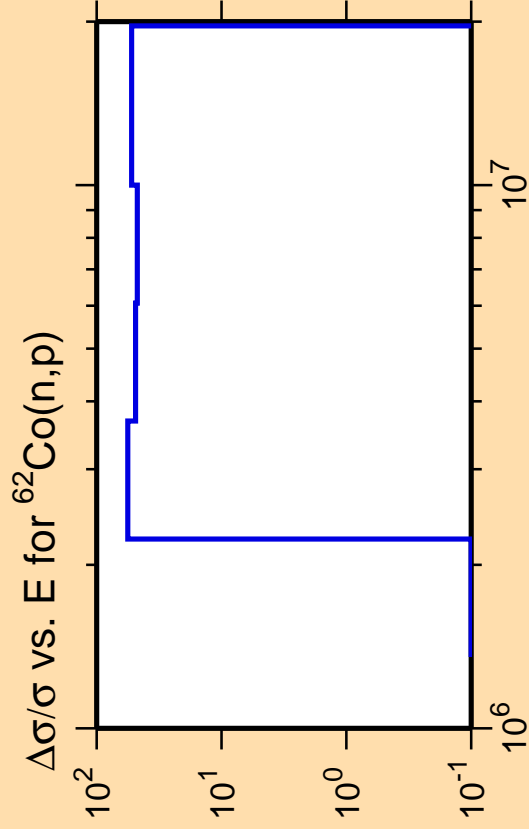

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

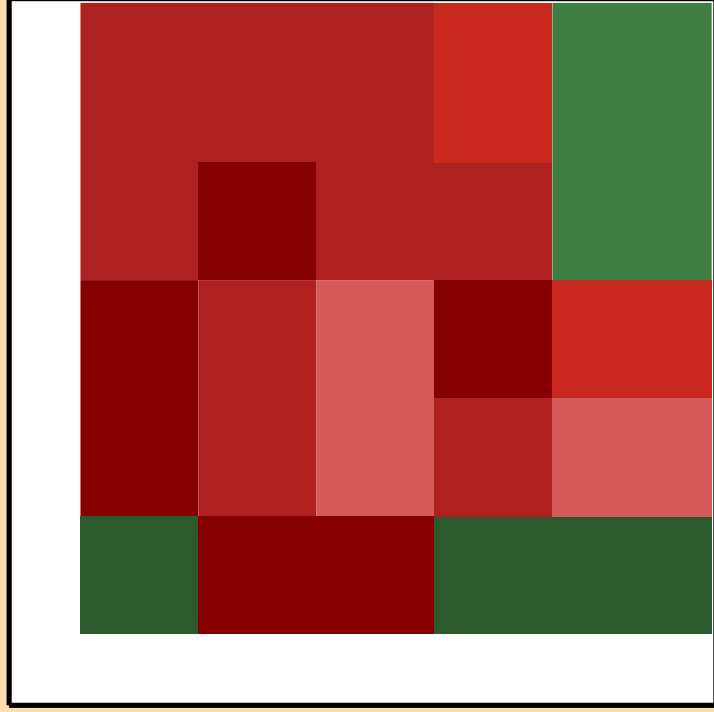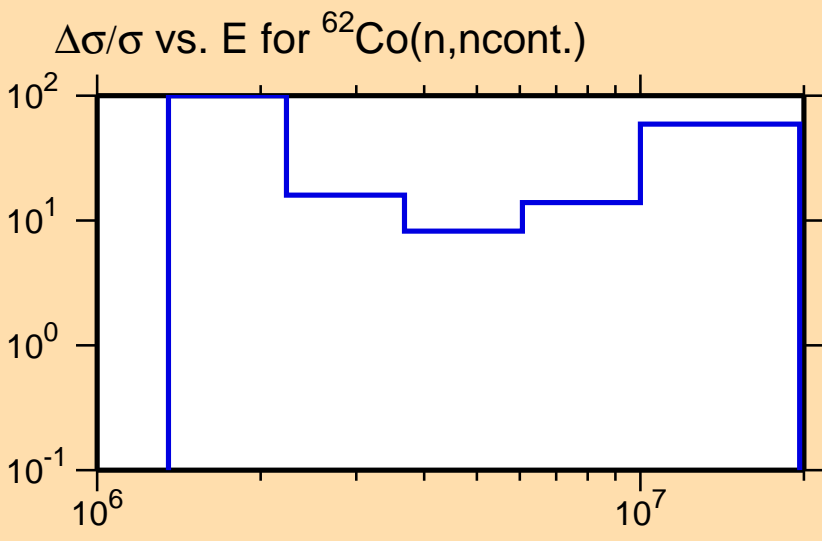

Correlation Matrix





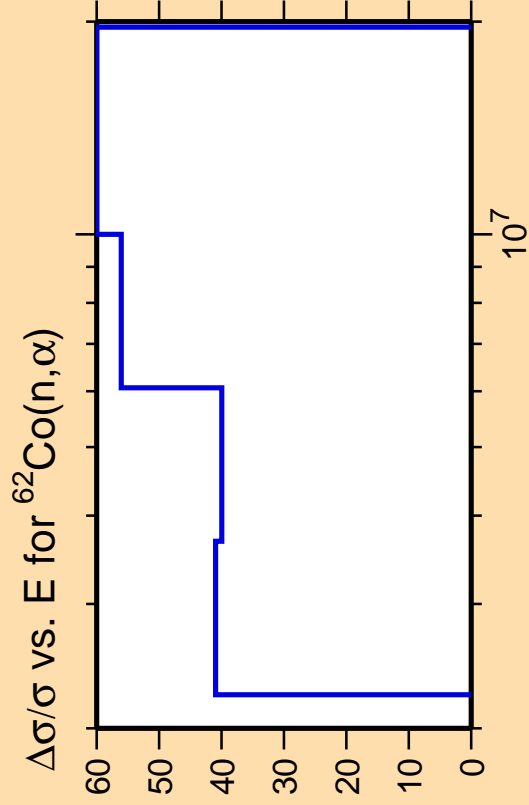

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

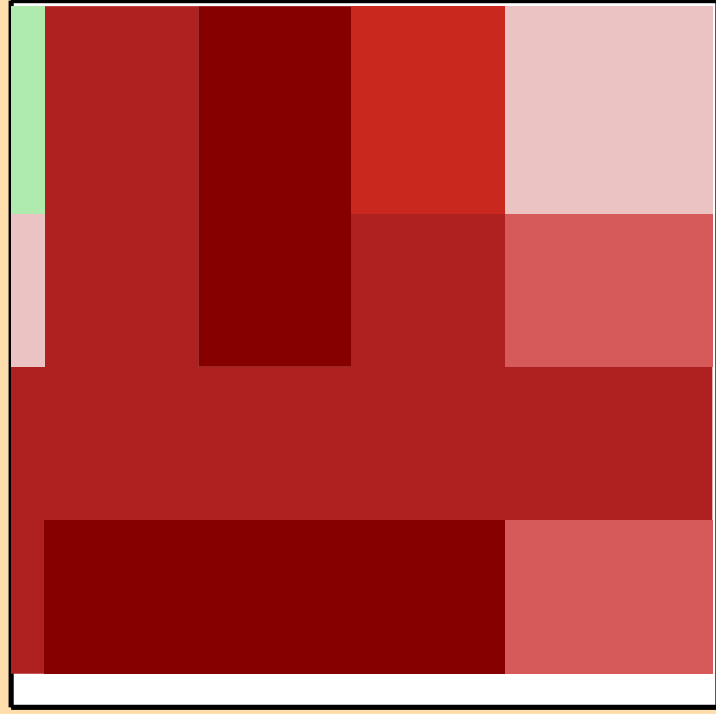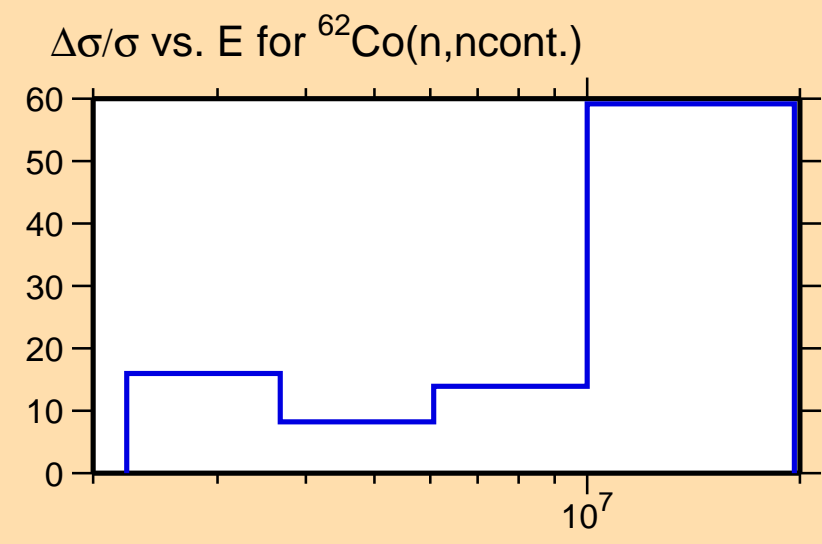

Correlation Matrix





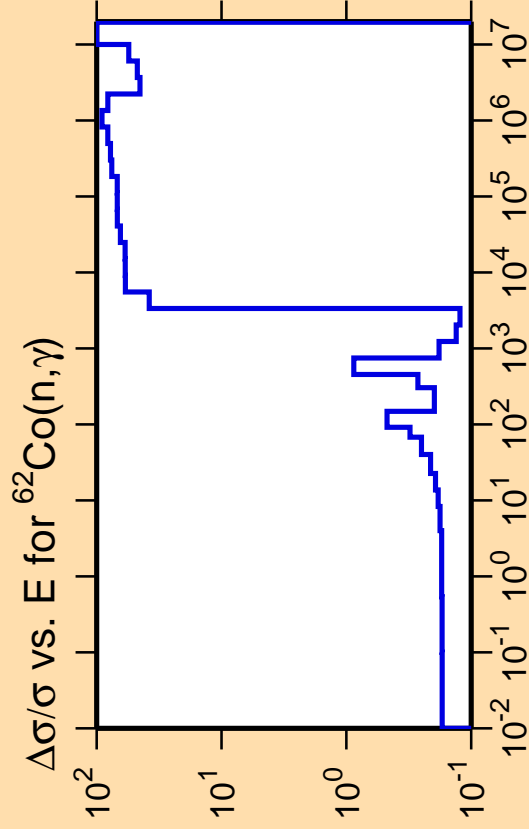

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

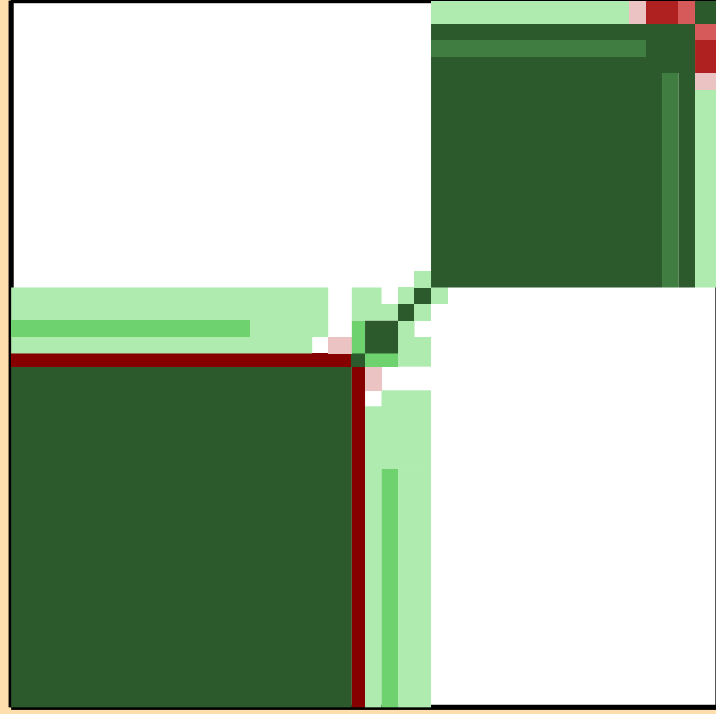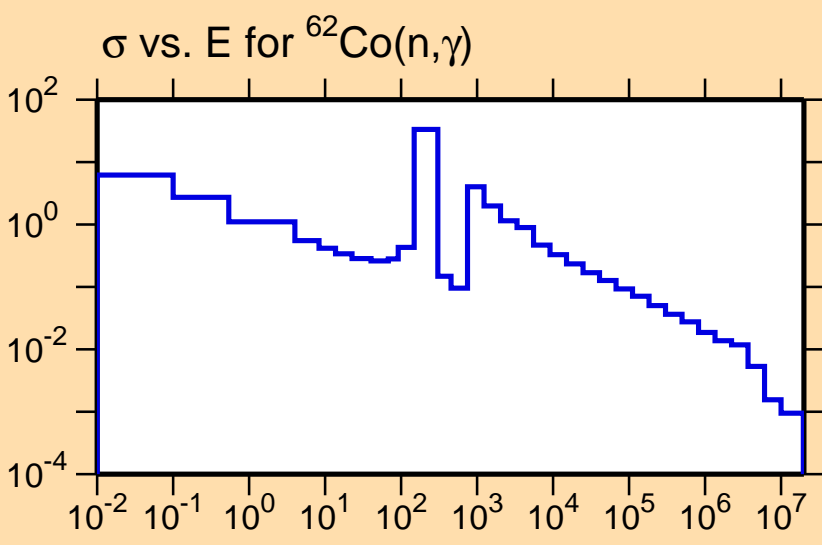

Correlation Matrix




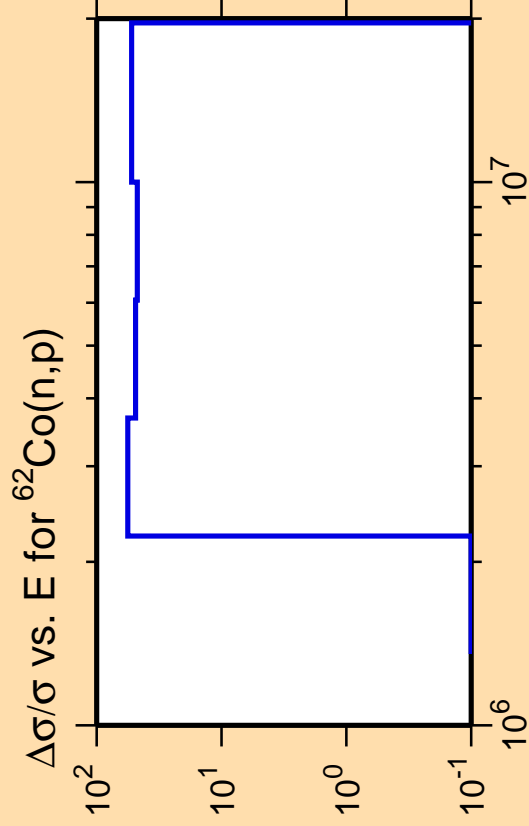


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\gamma)$

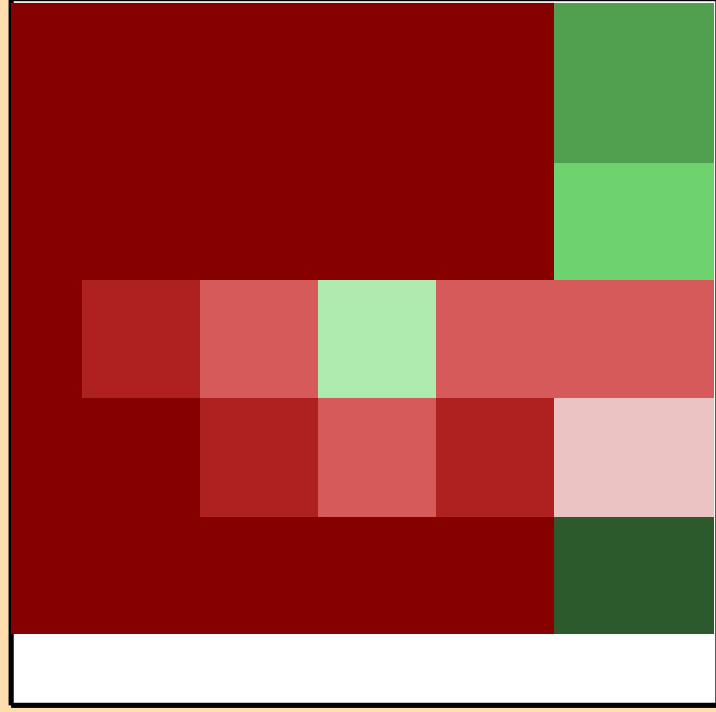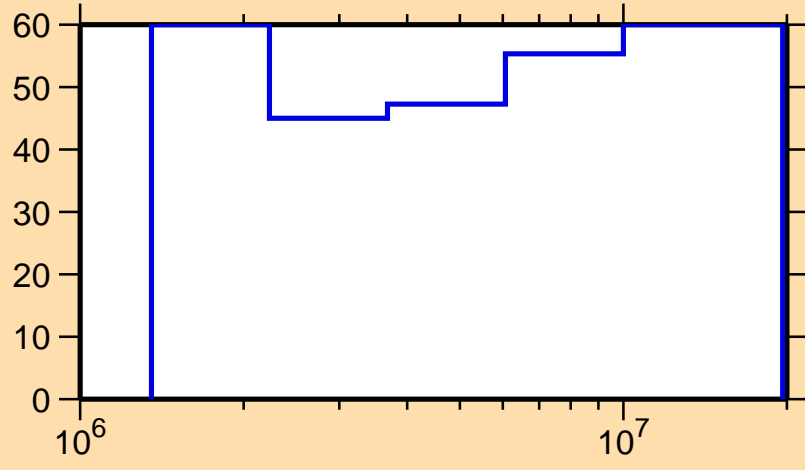

Correlation Matrix



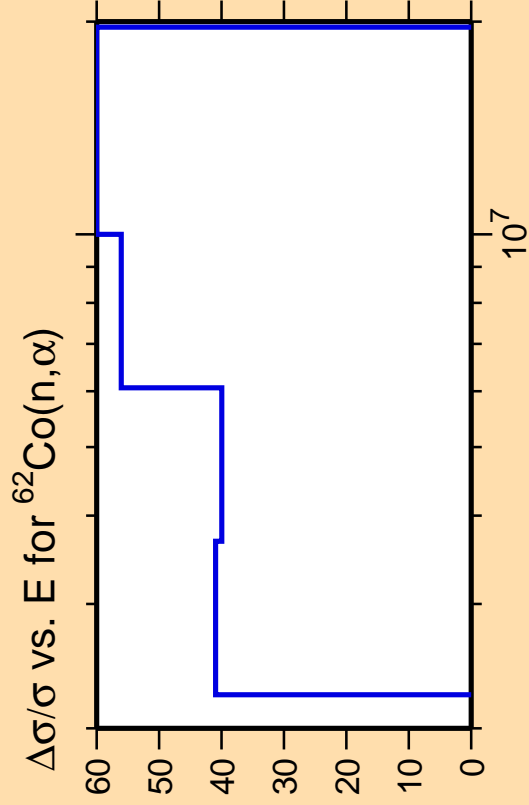


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\gamma)$

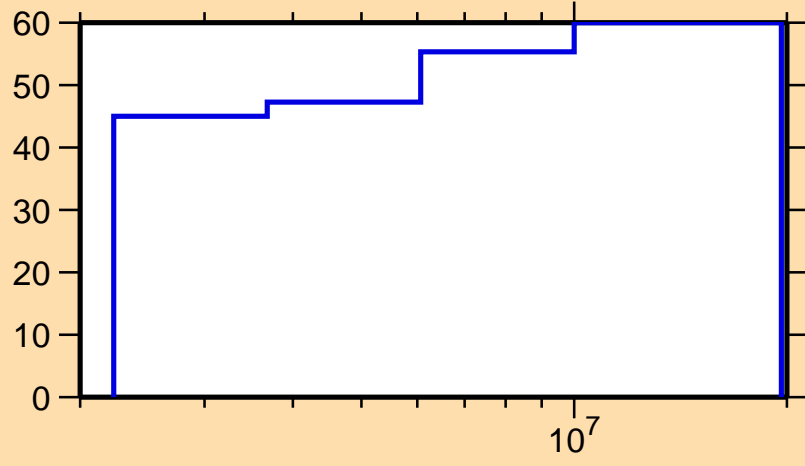


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\alpha)$

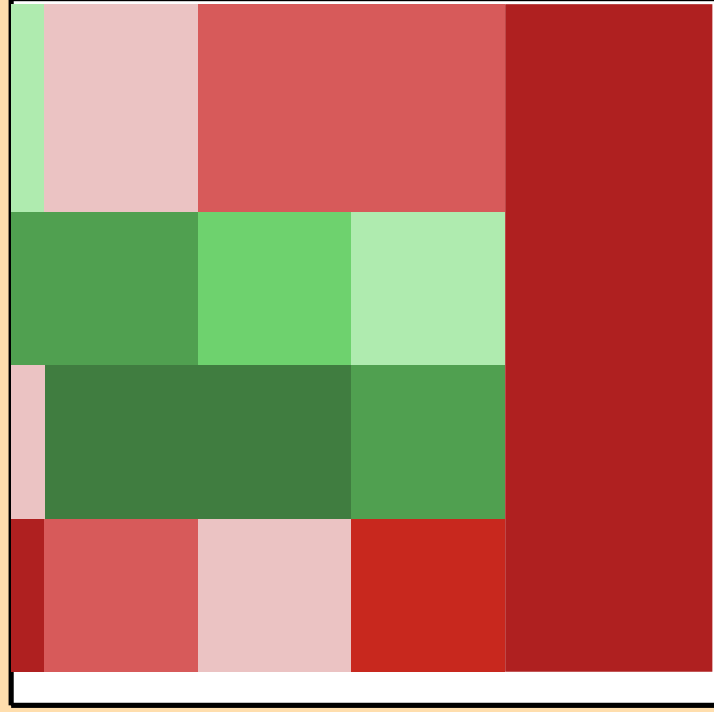

Correlation Matrix





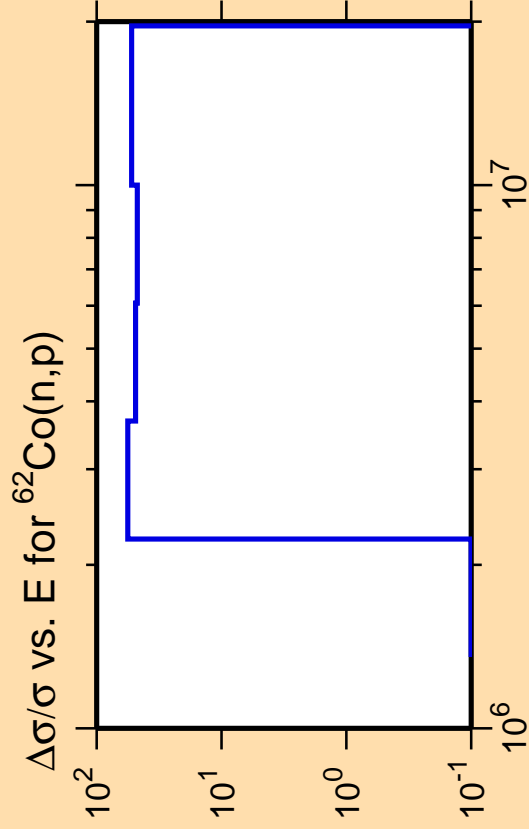

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

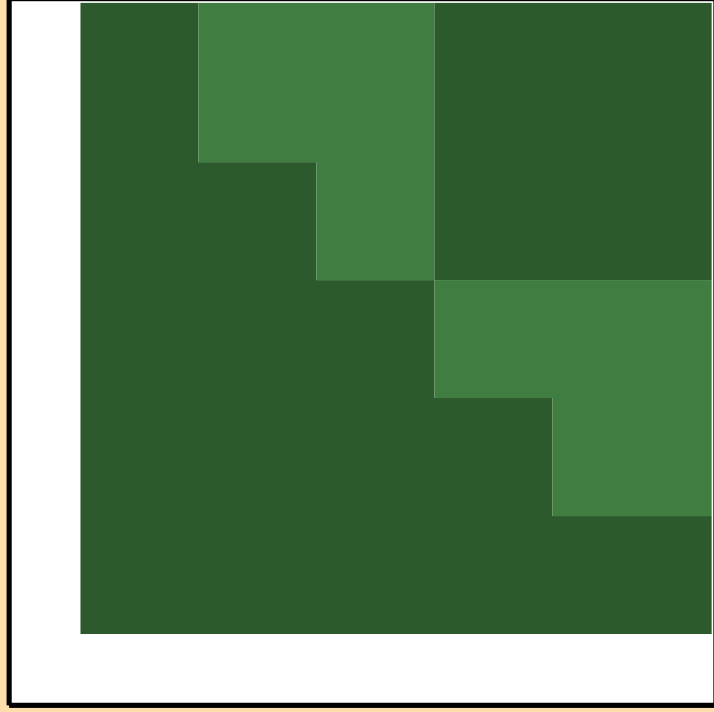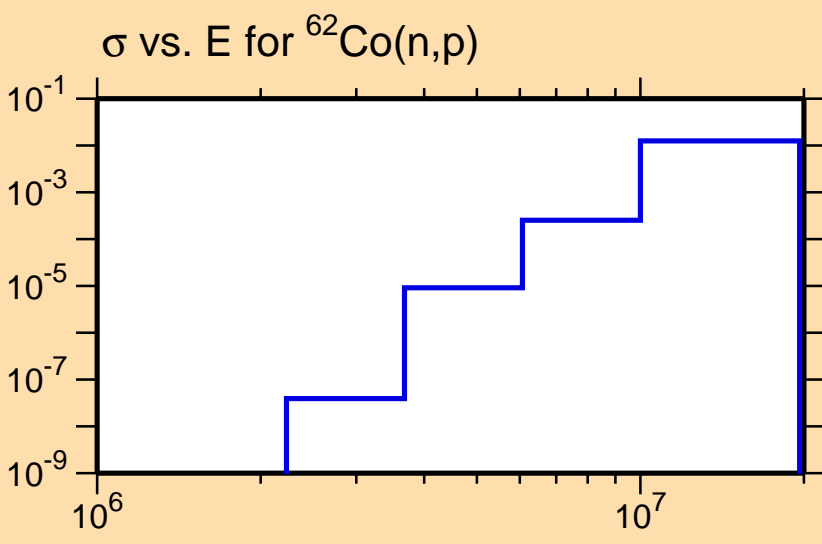

Correlation Matrix







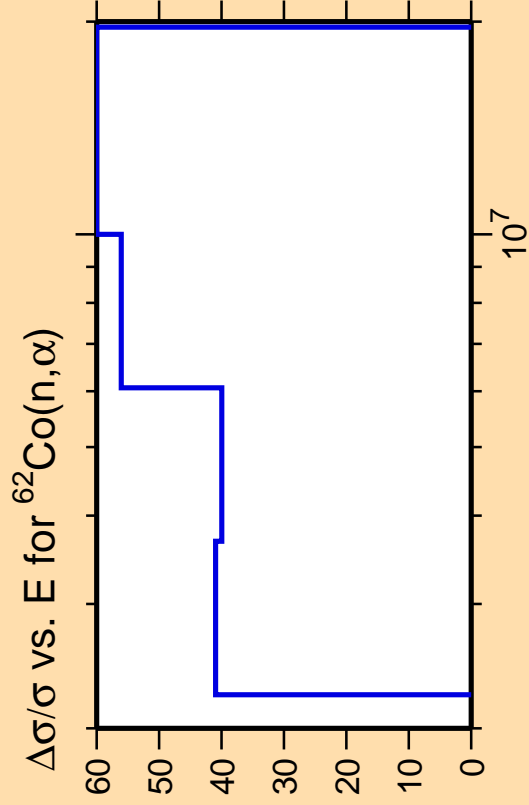

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

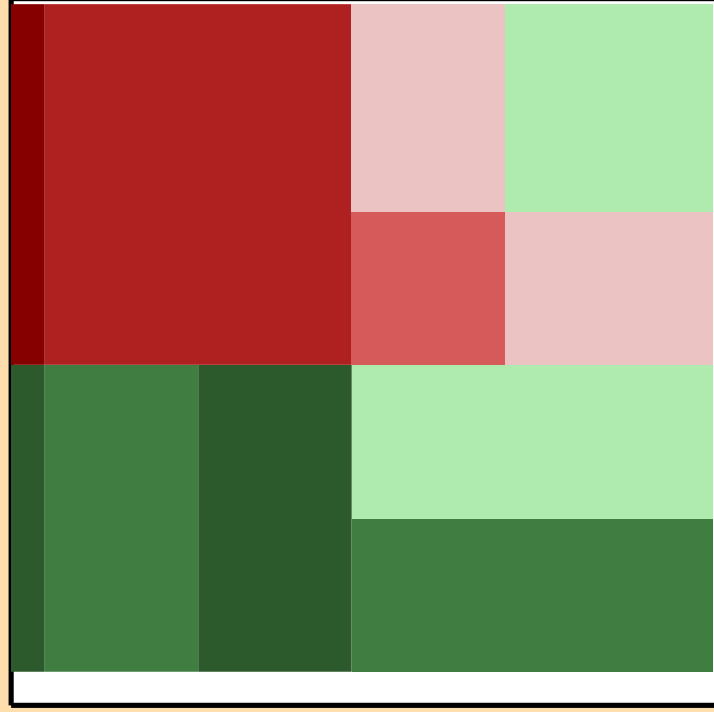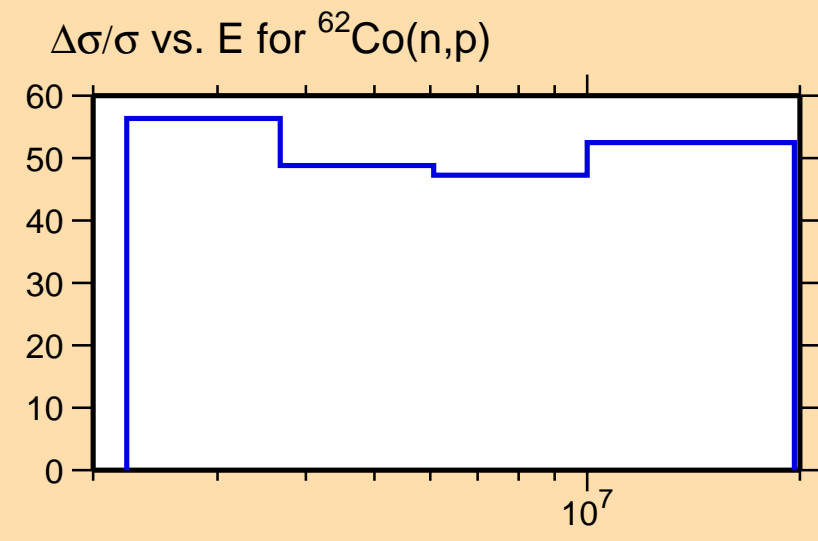

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,d)$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{62}\text{Co}(n,d)$

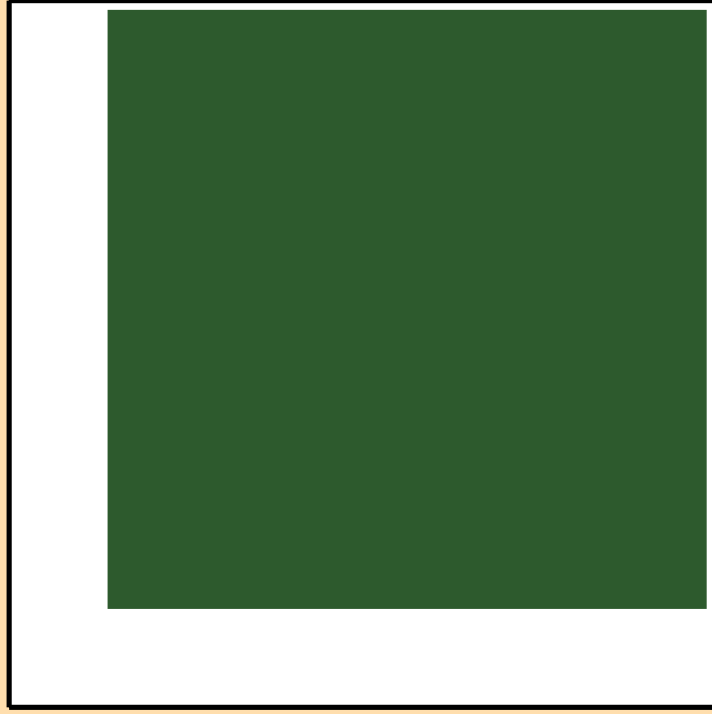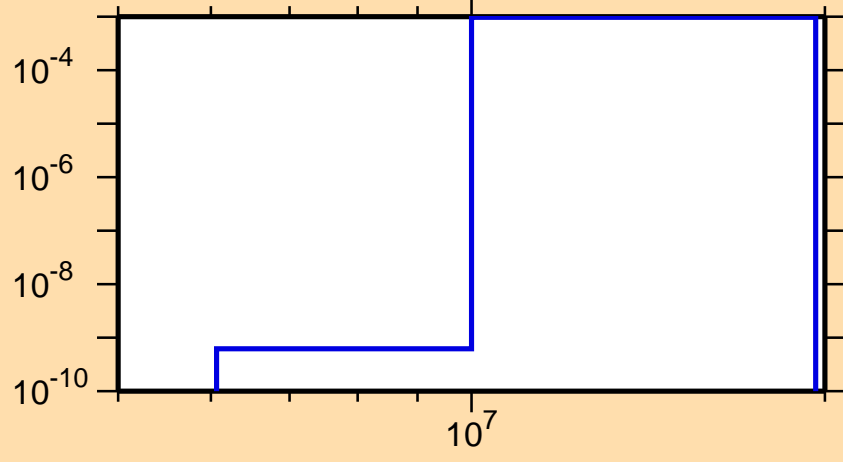

Correlation Matrix





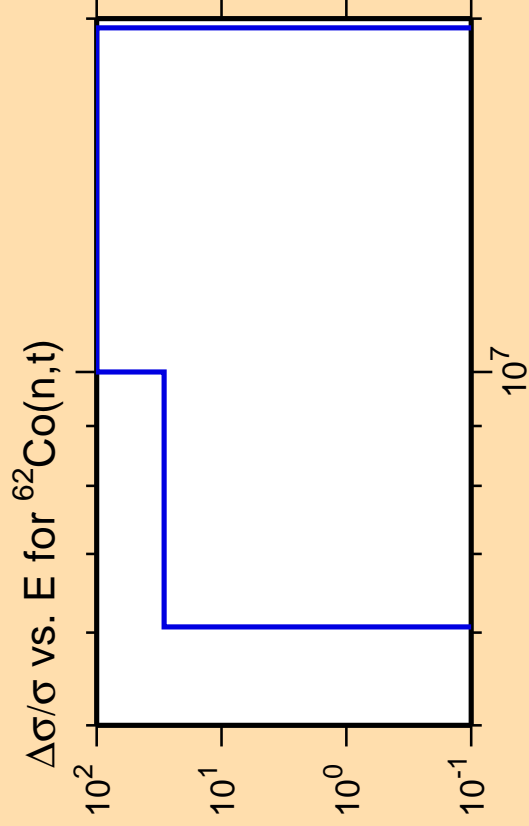


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

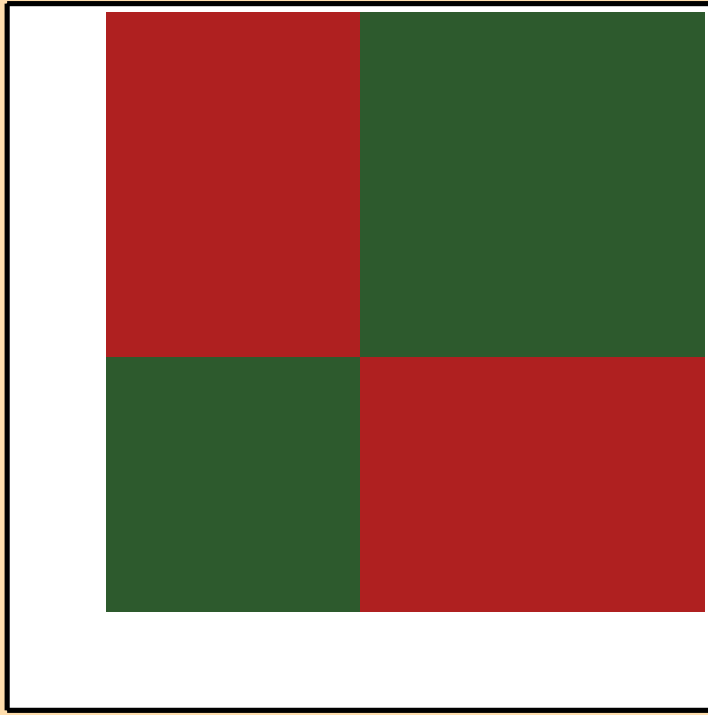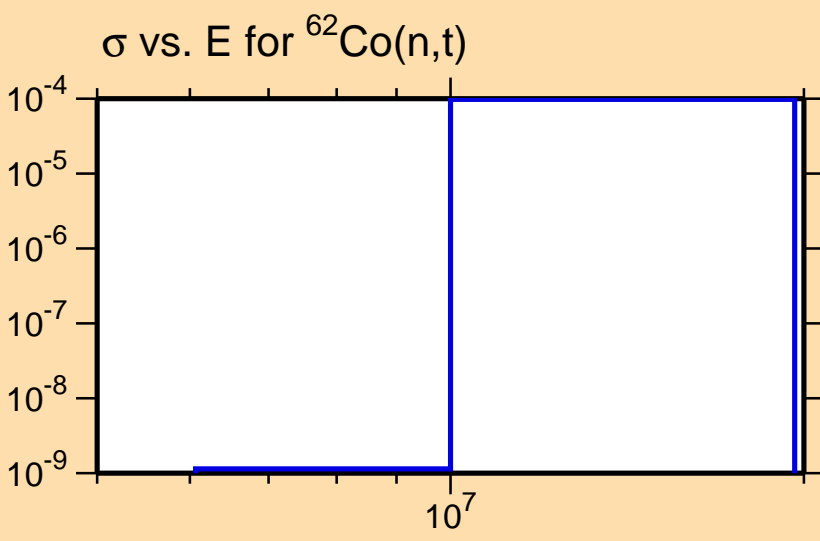

Correlation Matrix

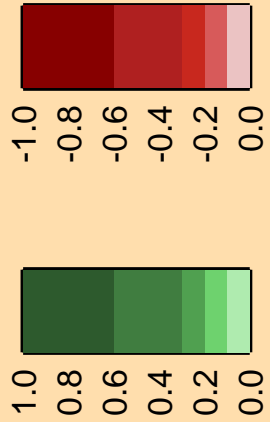


$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,\text{He}3)$

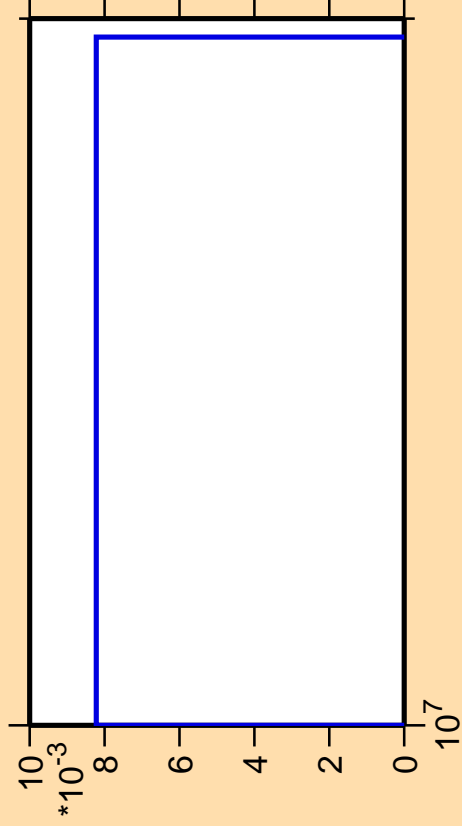

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{62}\text{Co}(n,\text{He}3)$

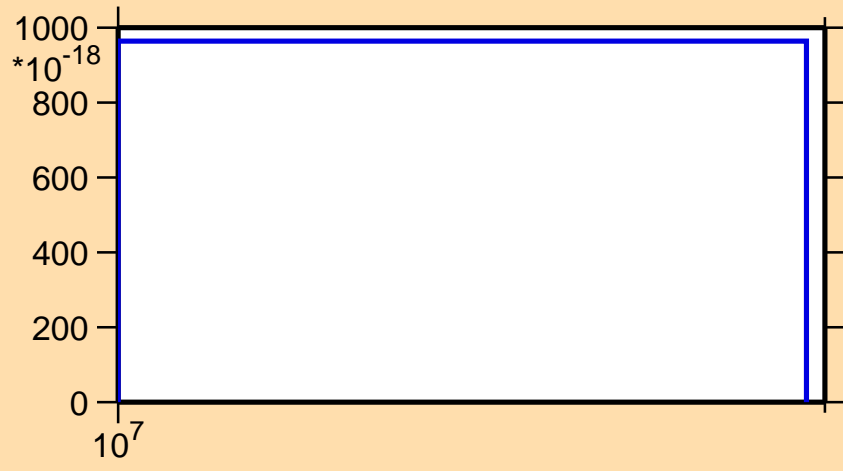

Correlation Matrix





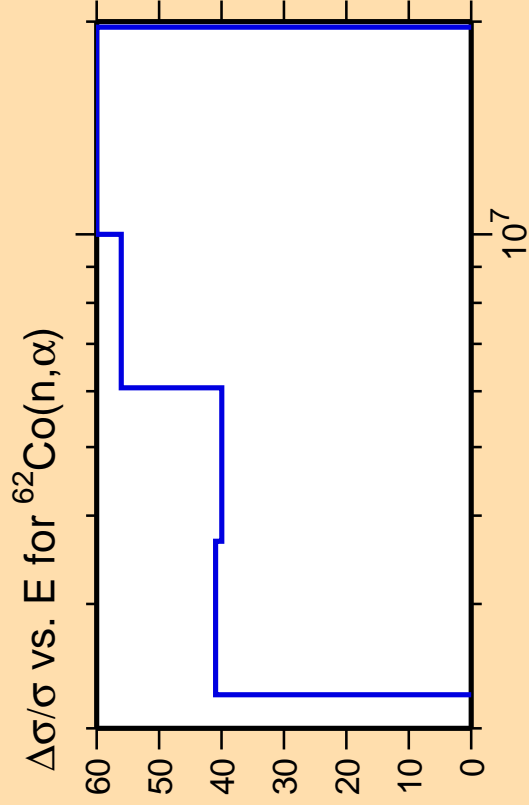

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

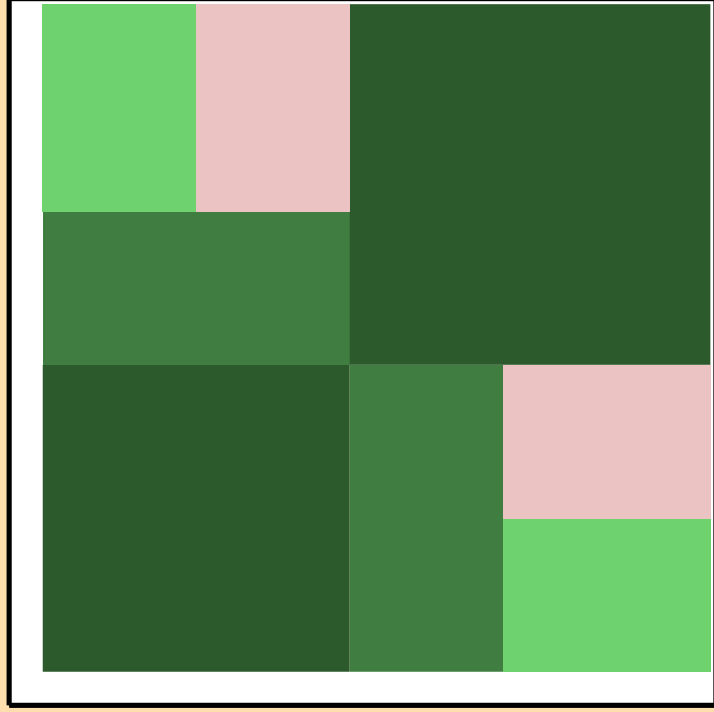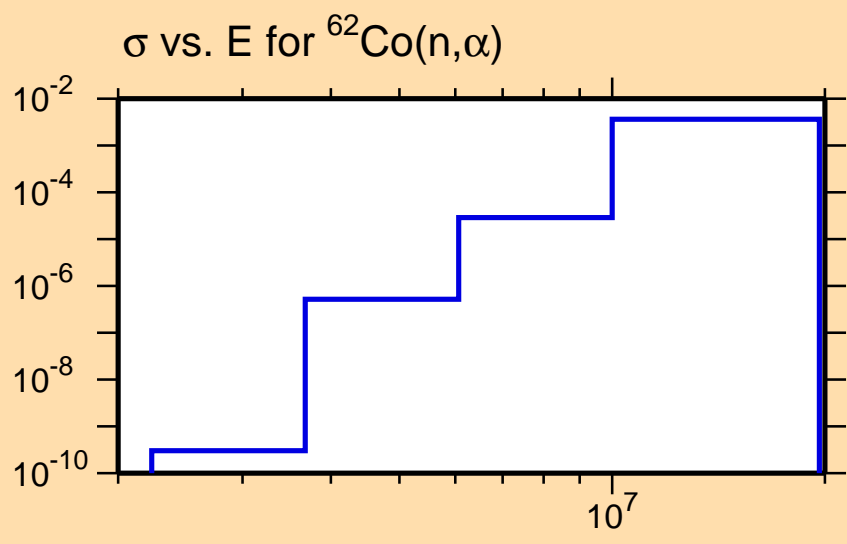

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{62}\text{Co}(n,p\alpha)$

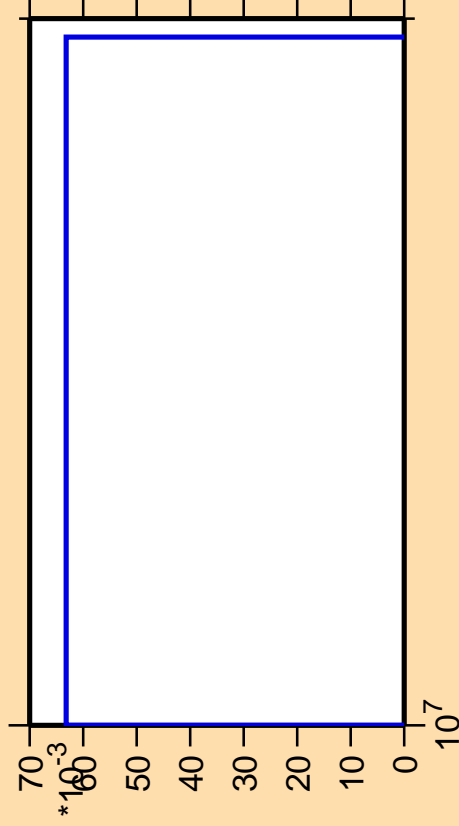

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{62}\text{Co}(n,p\alpha)$

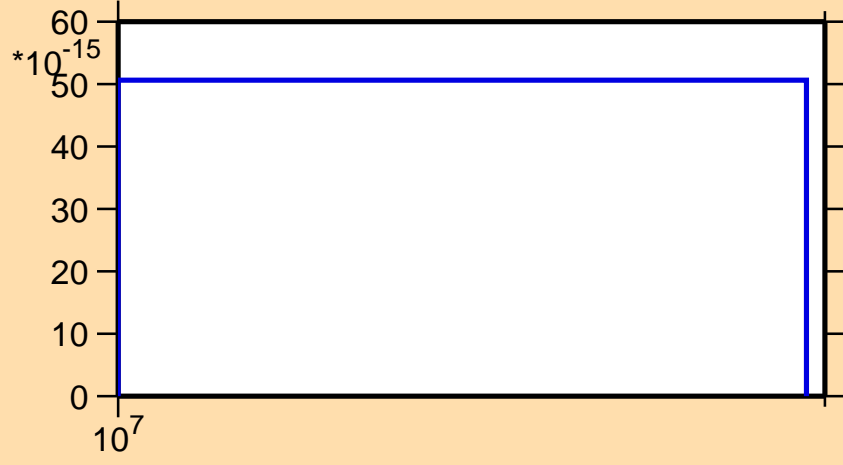

$10^7$

$\times 10^{-15}$

Correlation Matrix

