



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).



Correlation Matrix


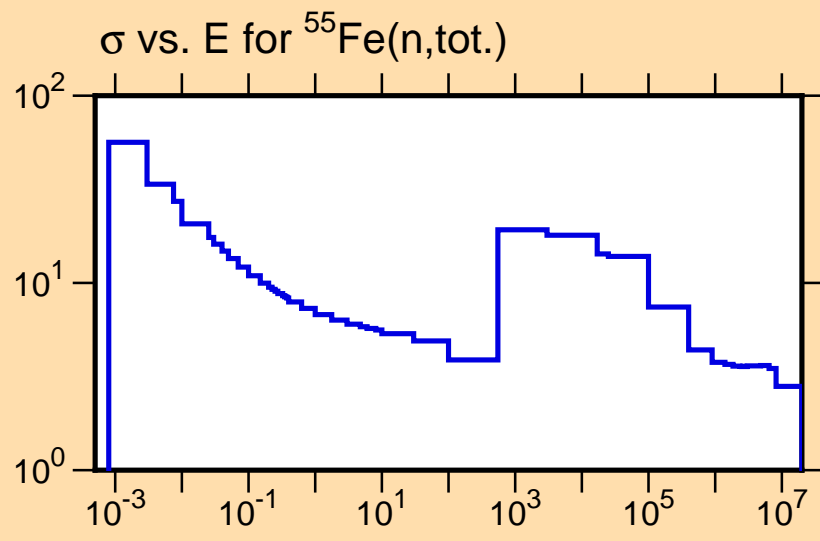


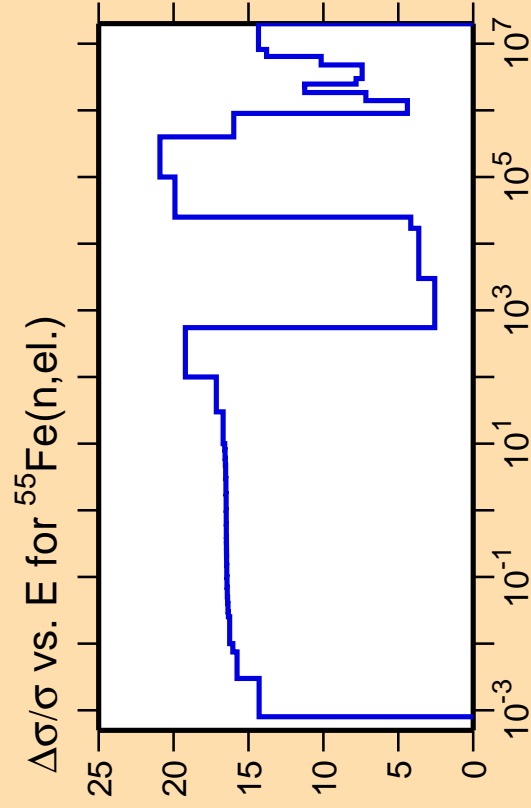

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

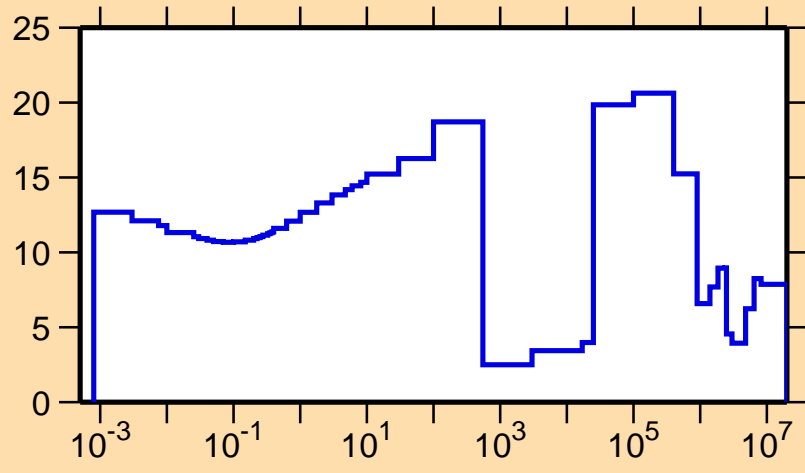

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

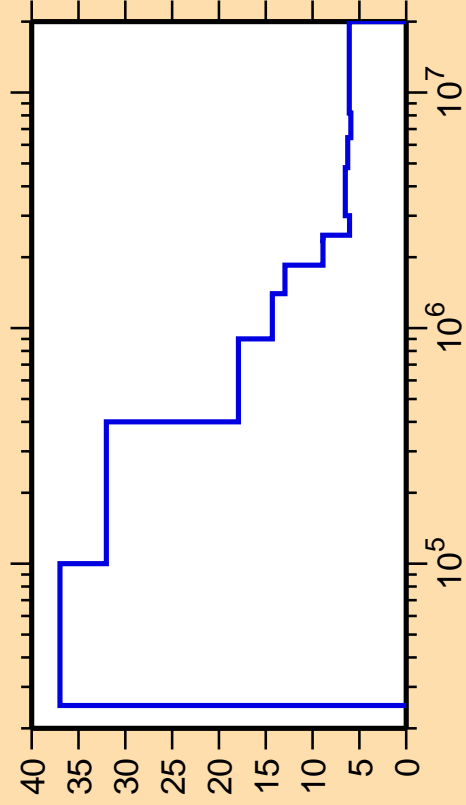

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

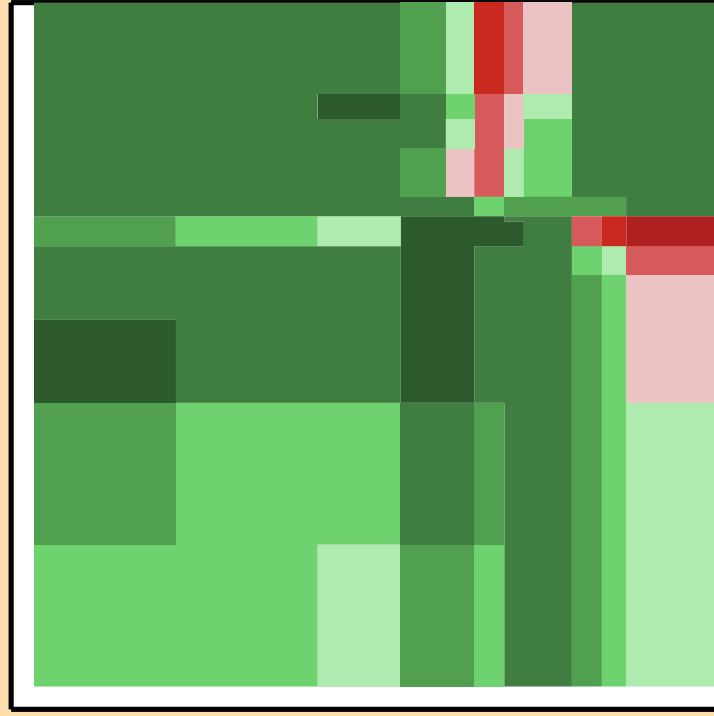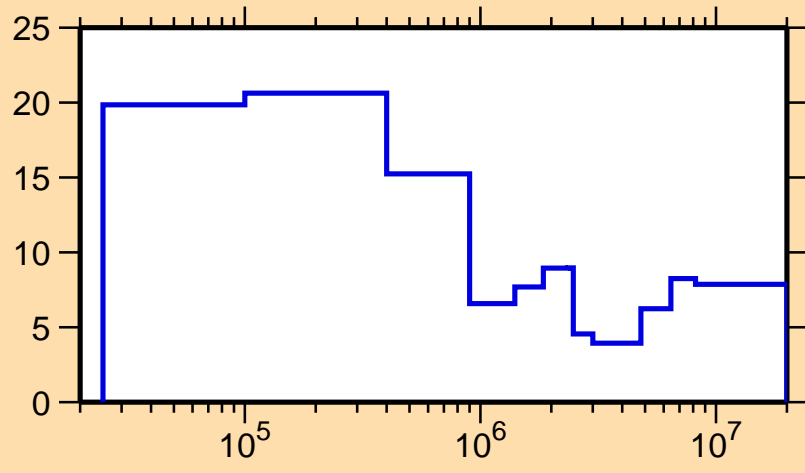

Correlation Matrix





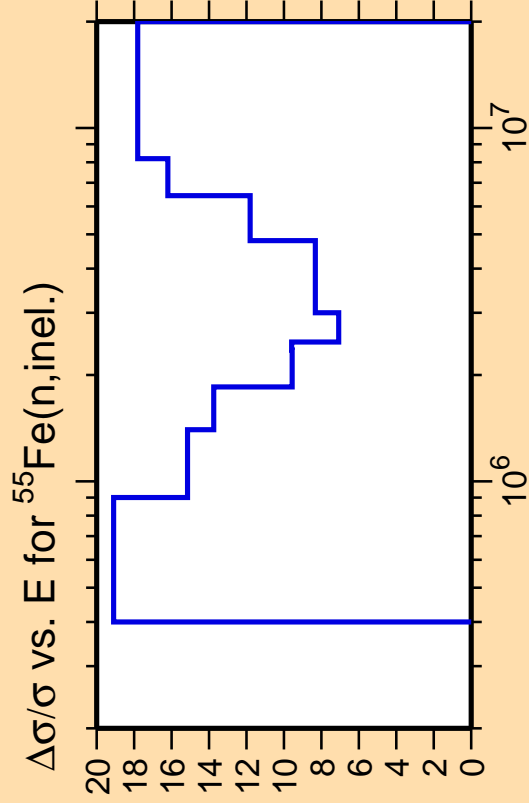

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

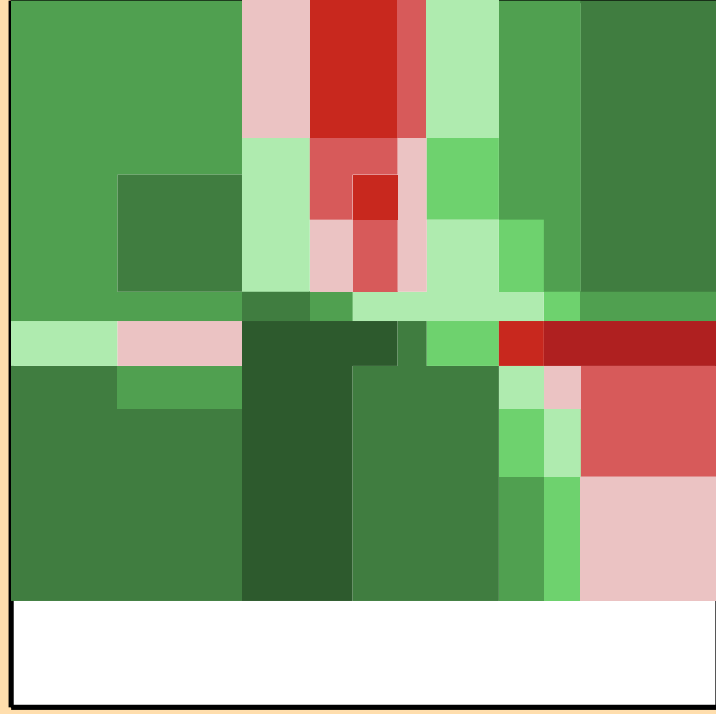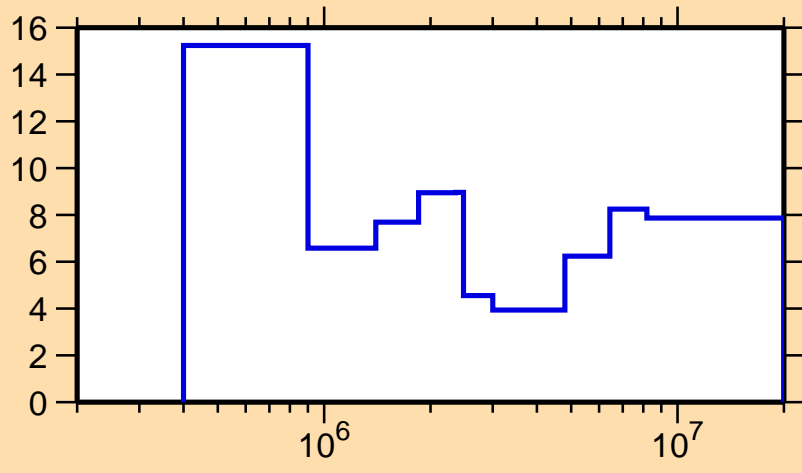

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

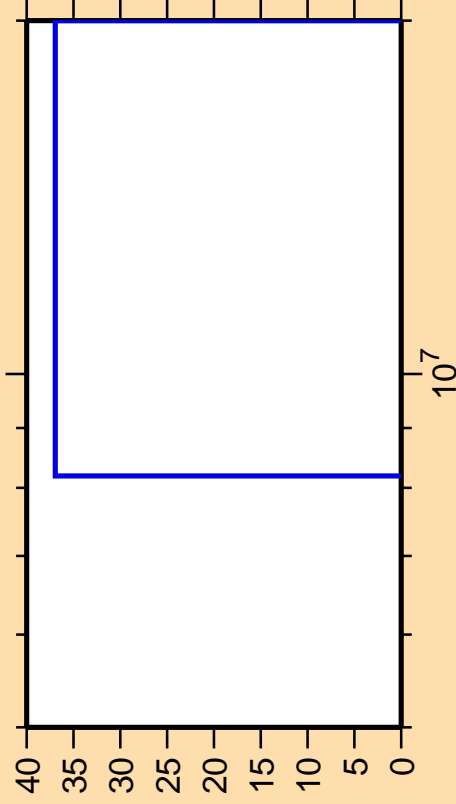

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

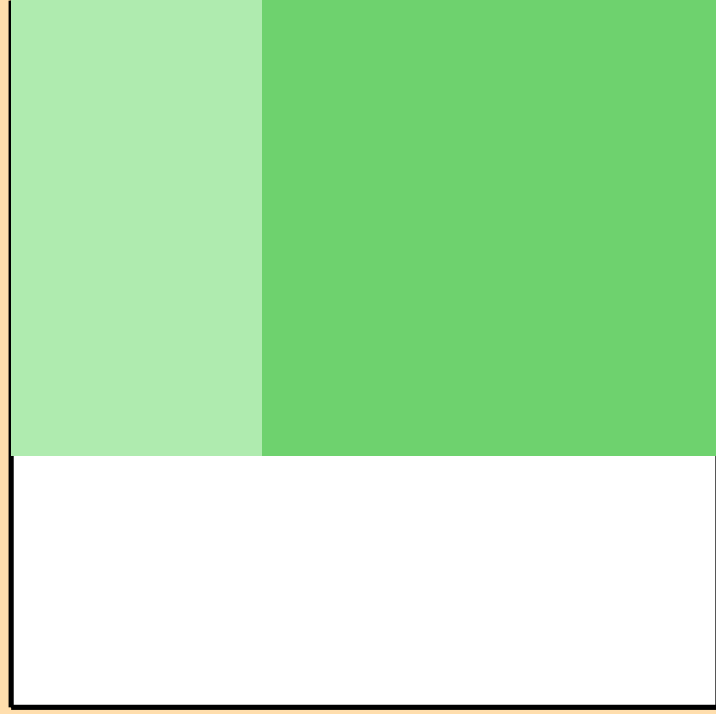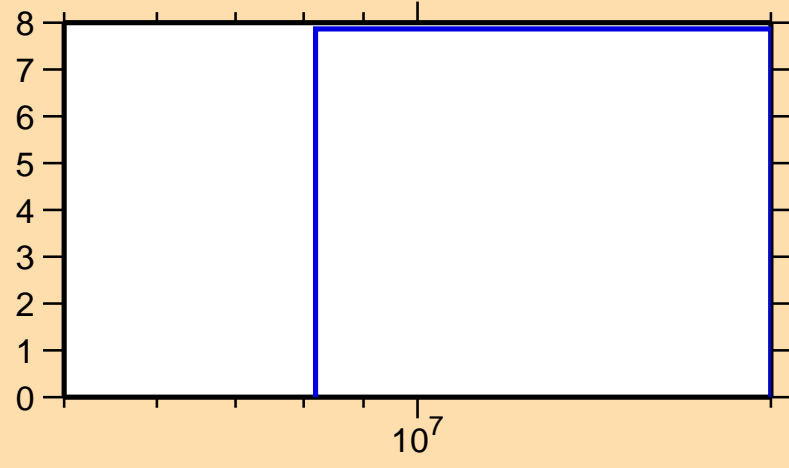

Correlation Matrix





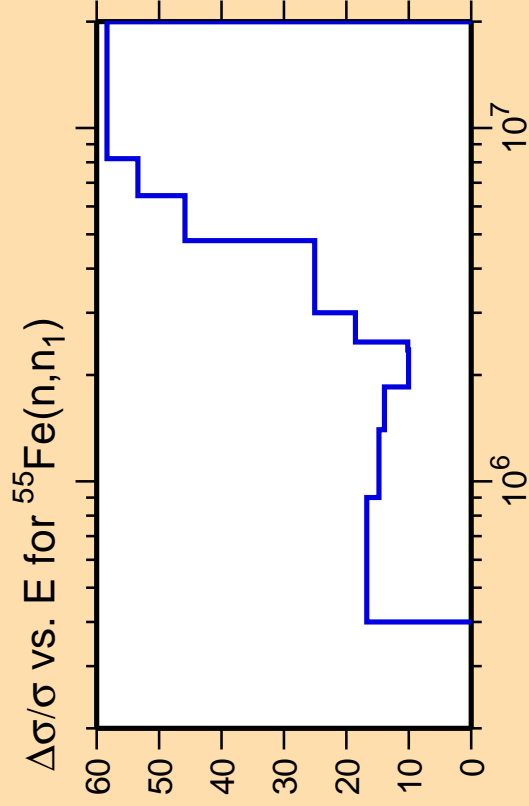

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

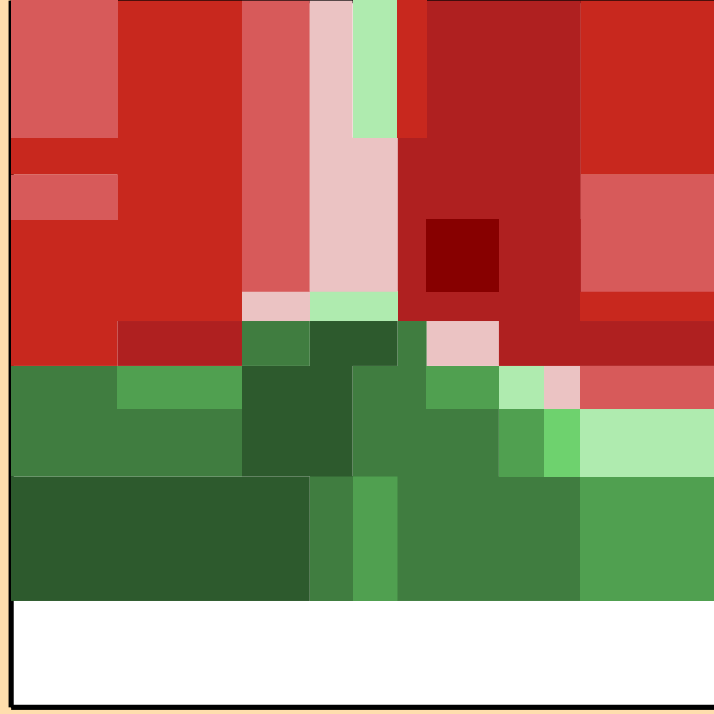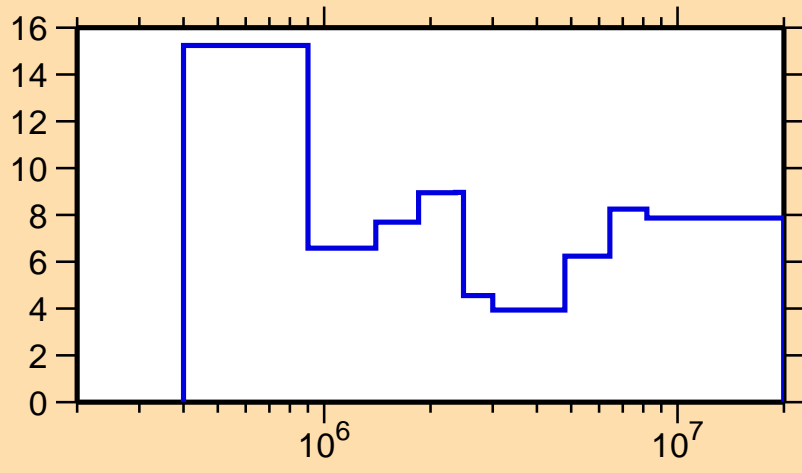

Correlation Matrix





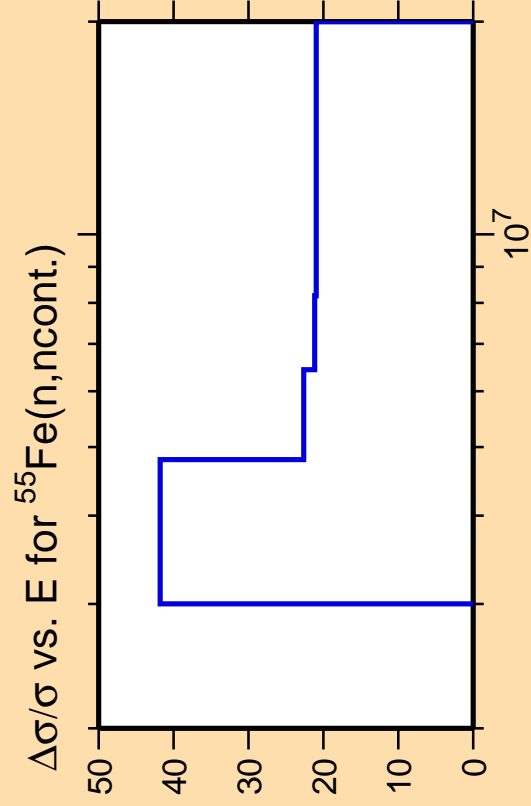

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

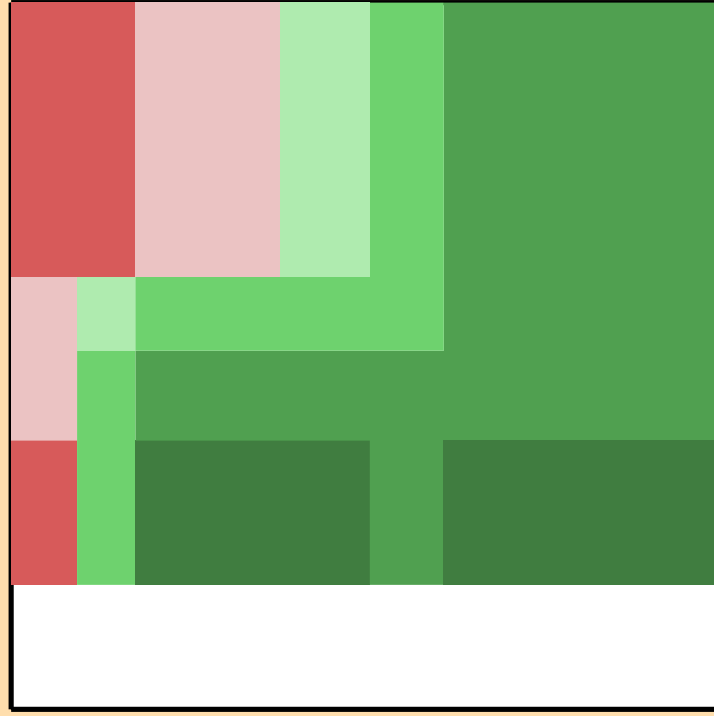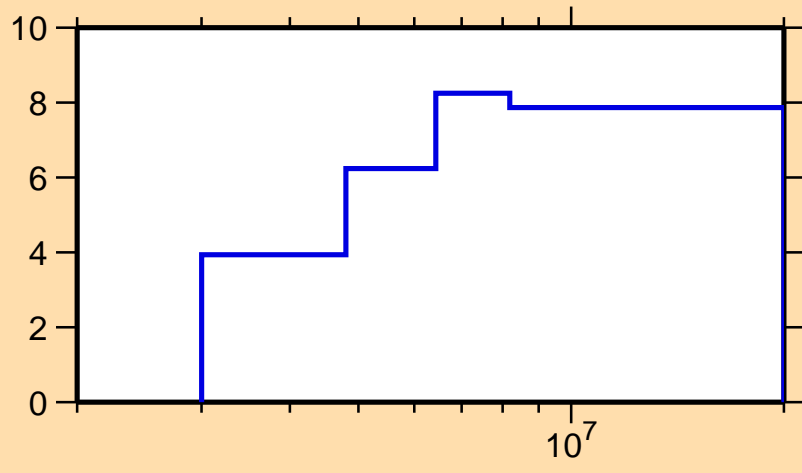

Correlation Matrix




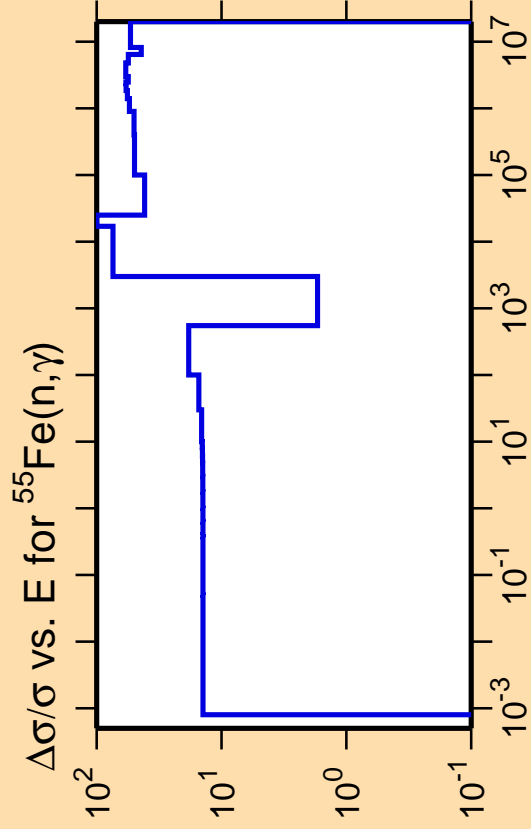


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

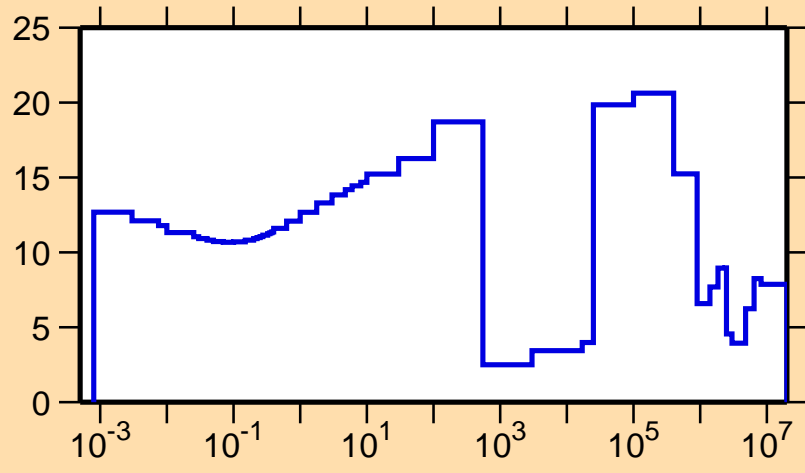

Correlation Matrix




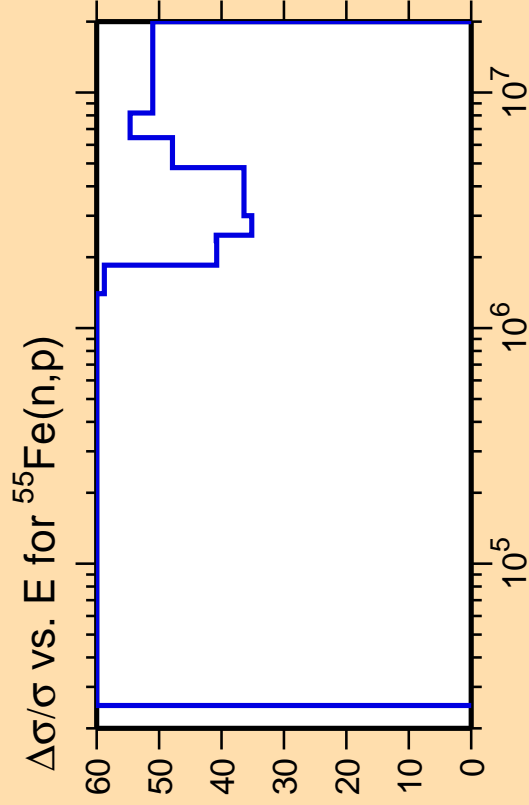


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

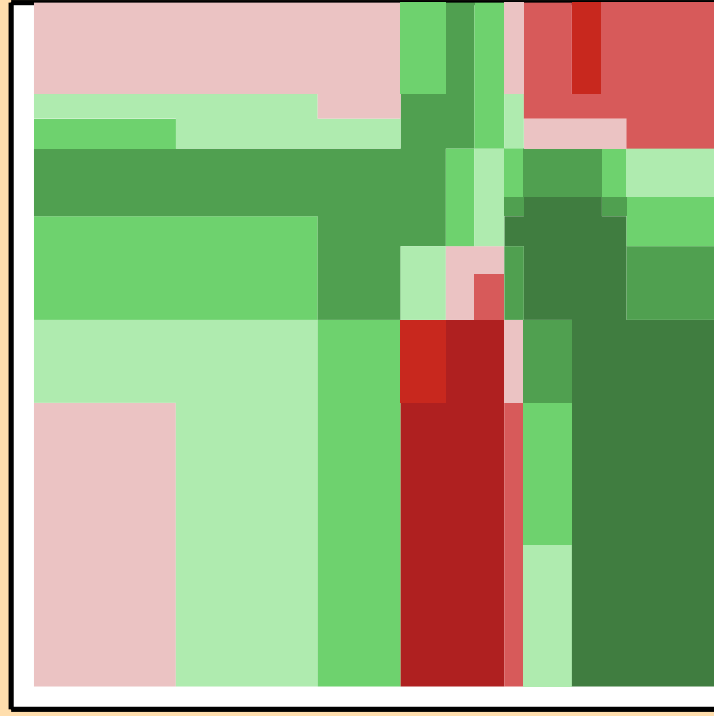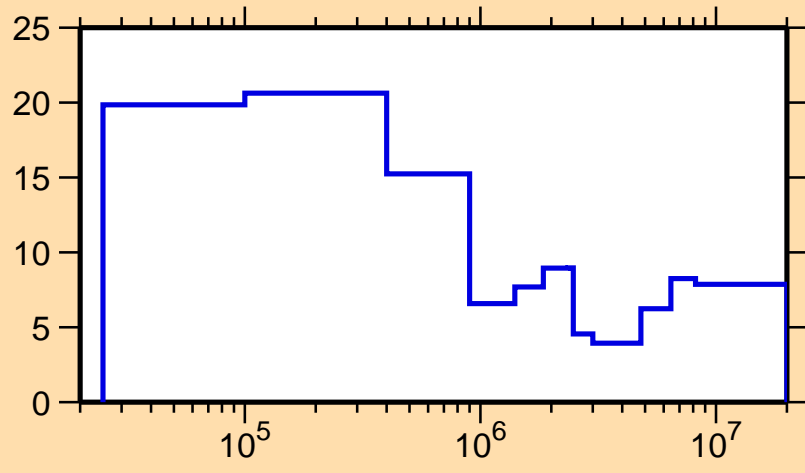

Correlation Matrix




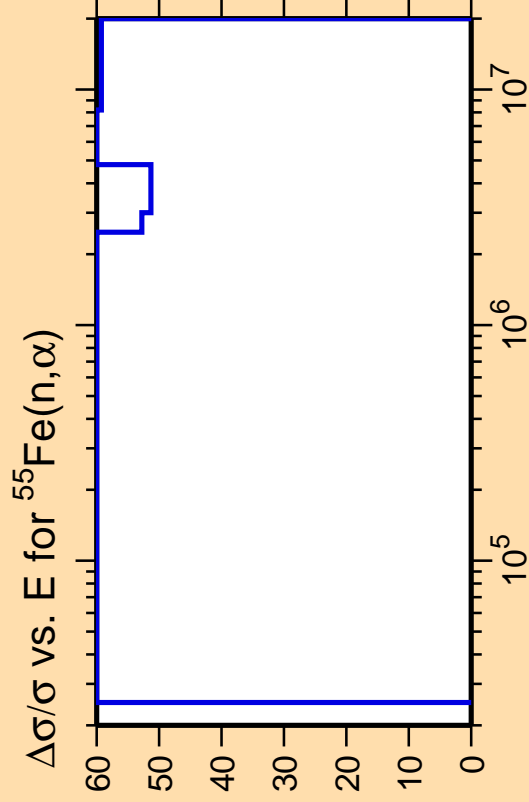


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{tot.})$

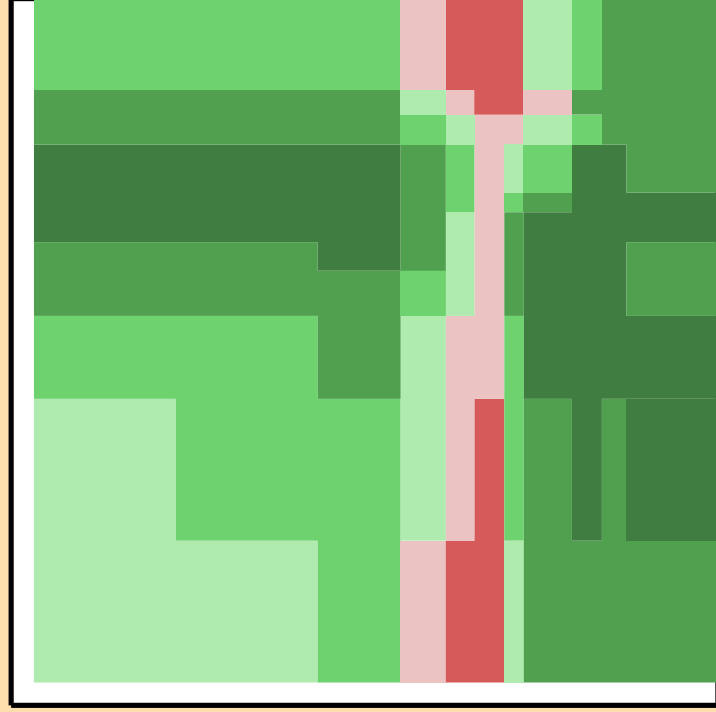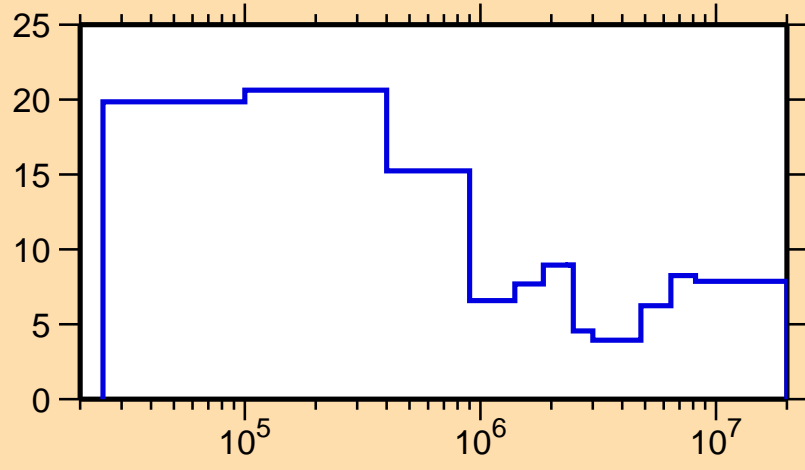



Correlation Matrix



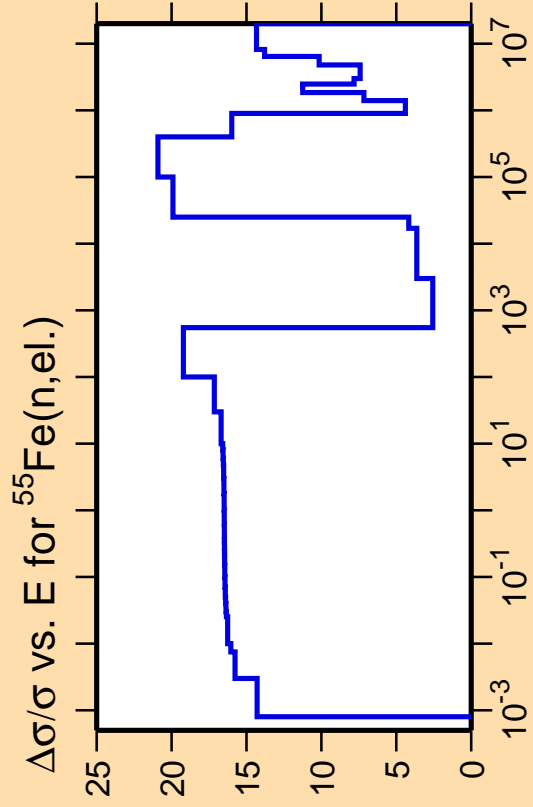

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

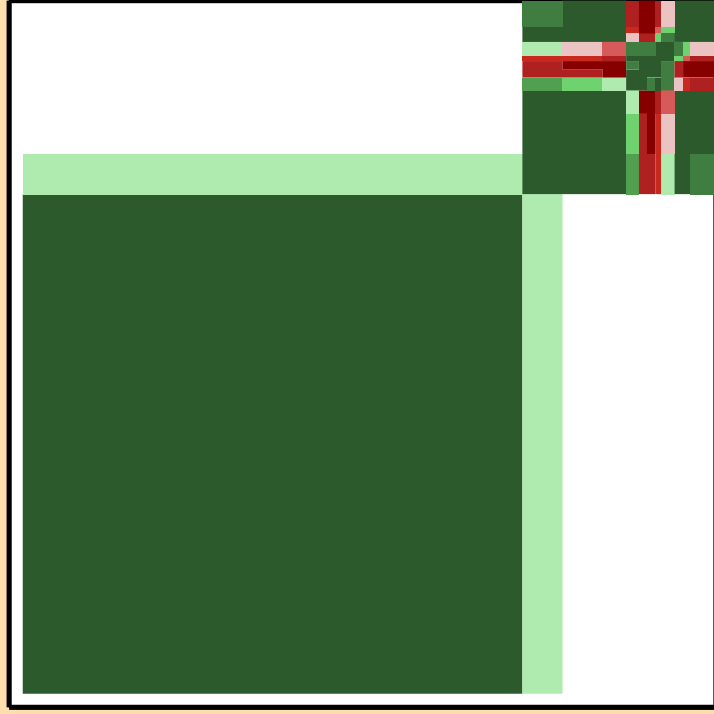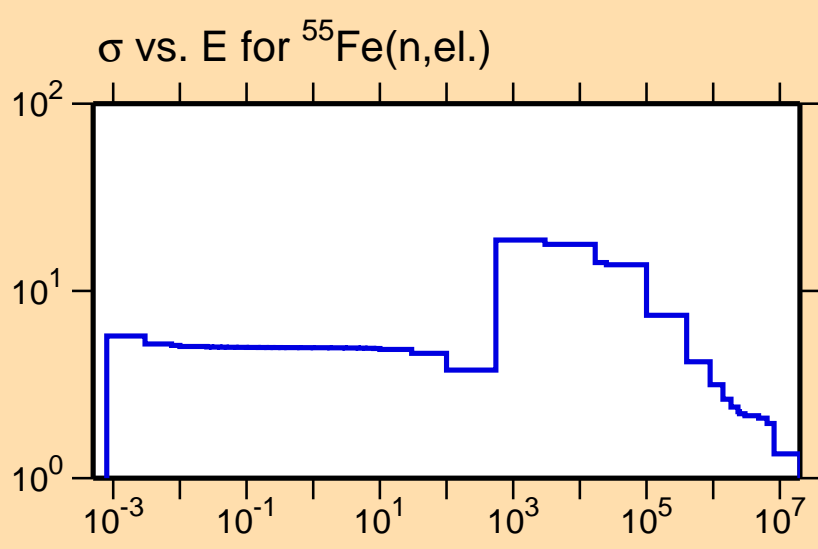

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

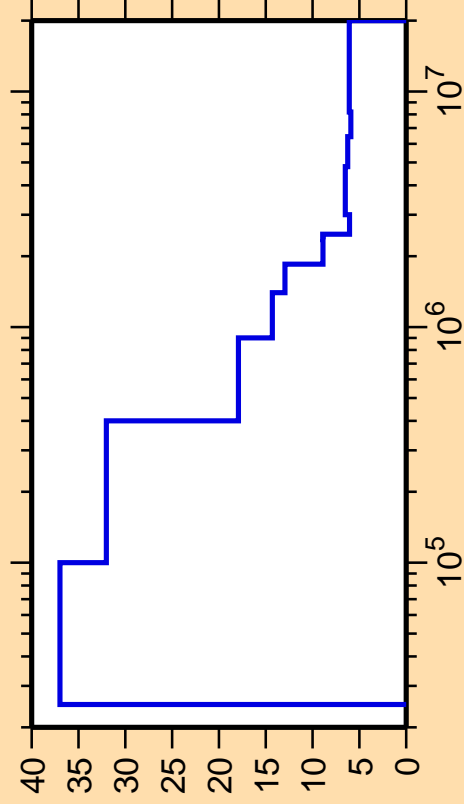

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{el.})$

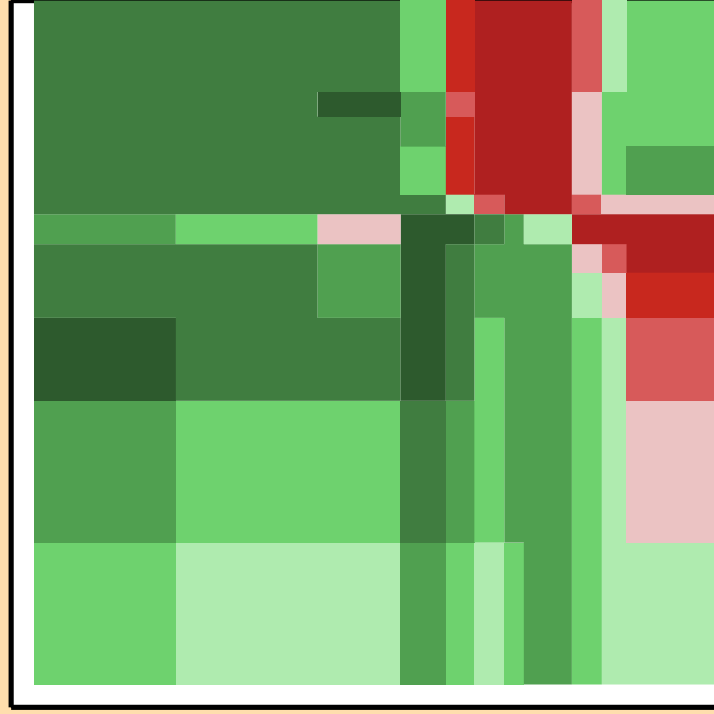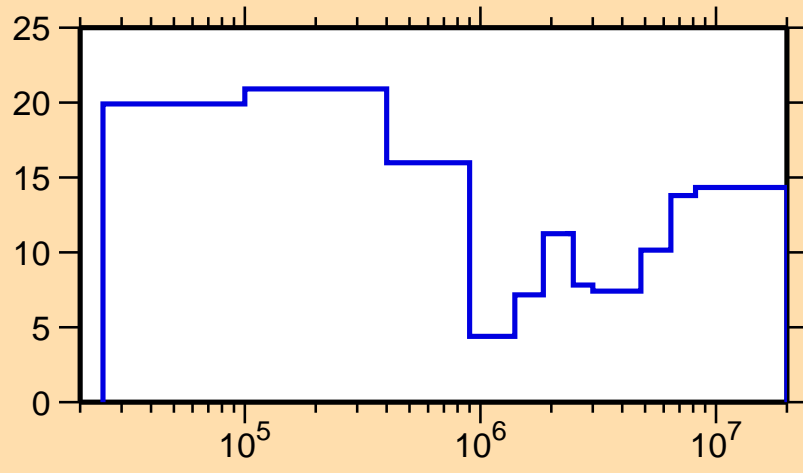

Correlation Matrix





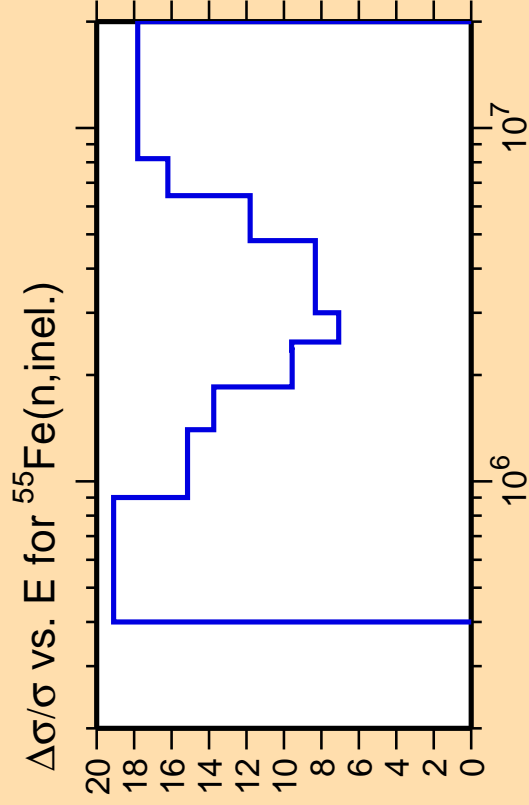

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{el.})$

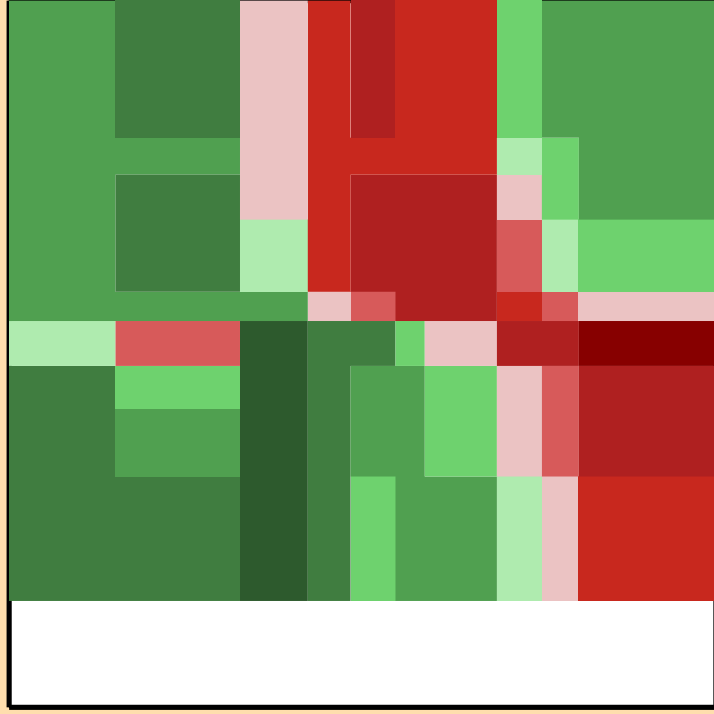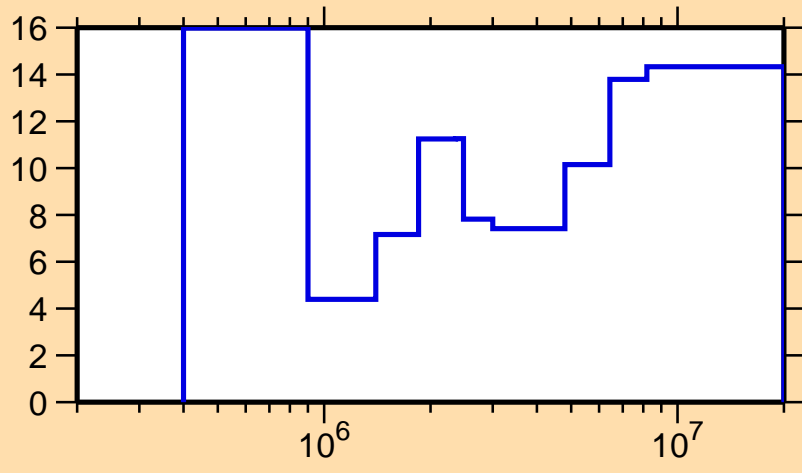

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

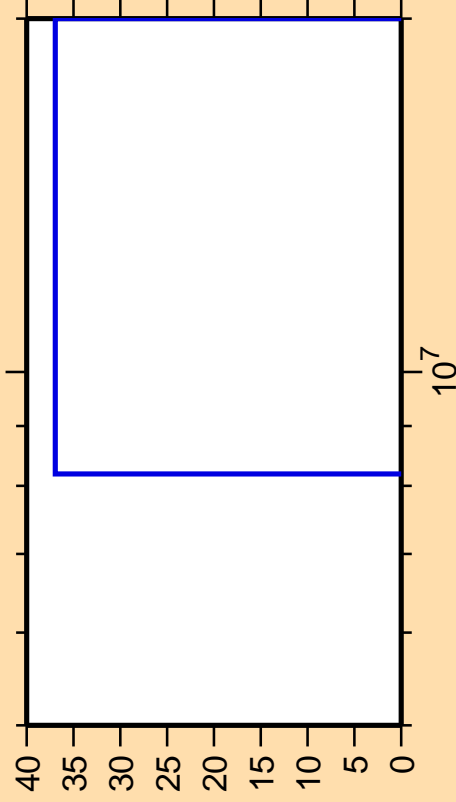

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{el.})$

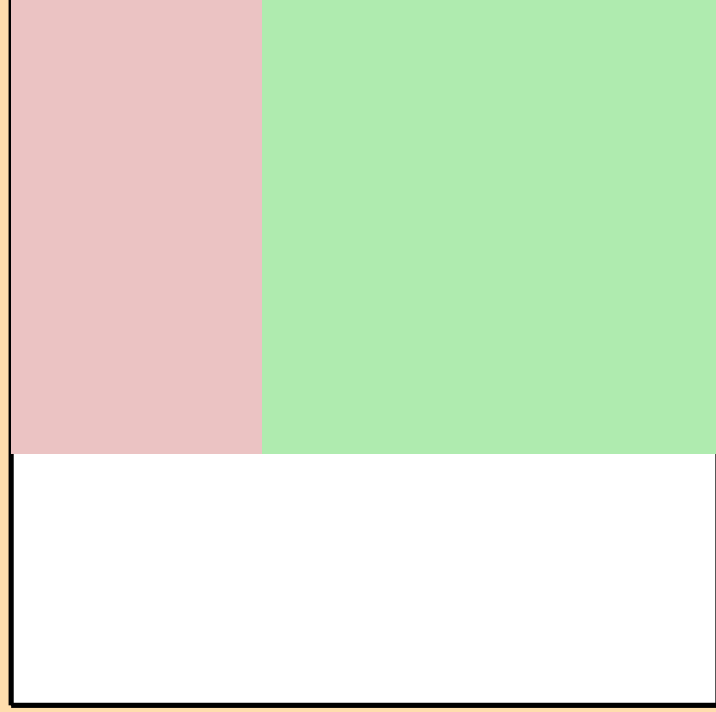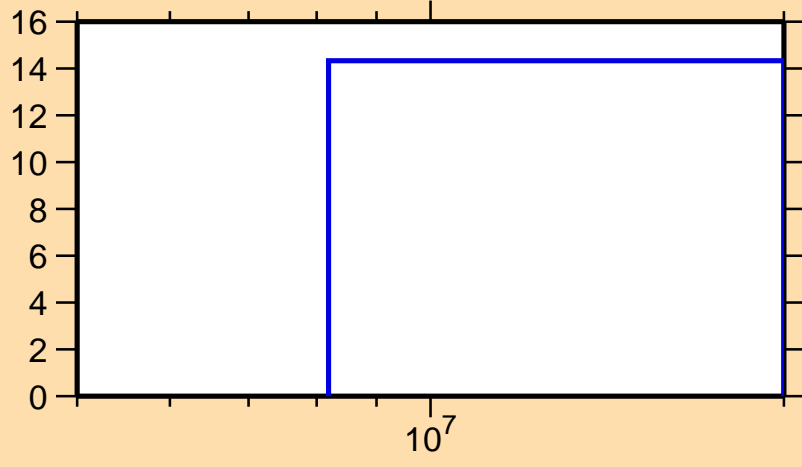

Correlation Matrix





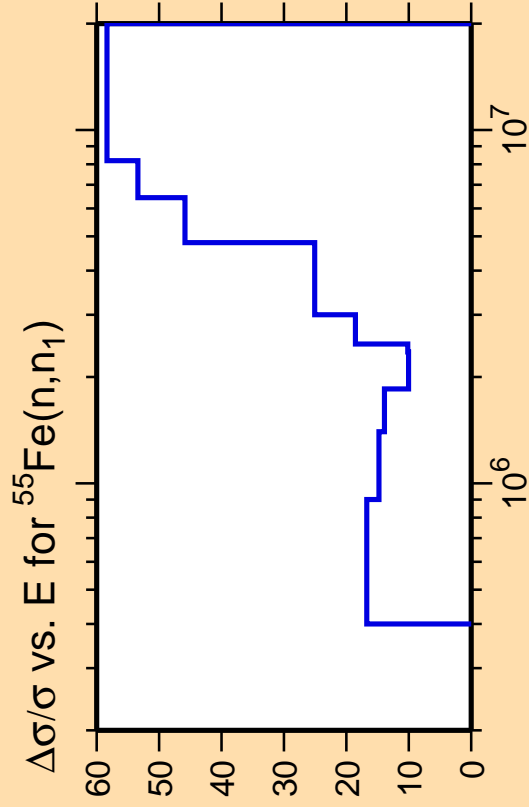

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{el.})$

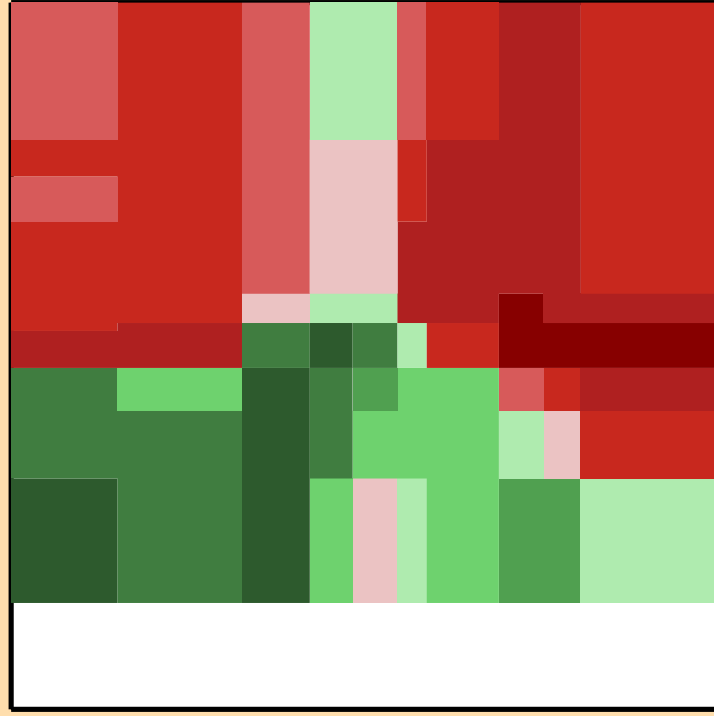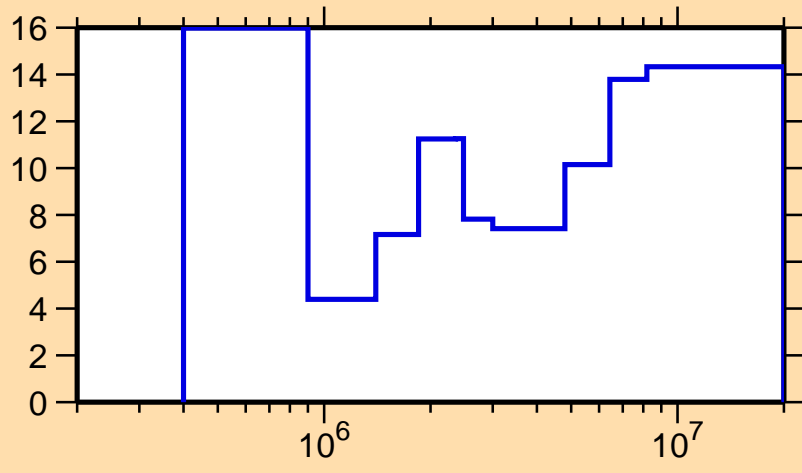

Correlation Matrix





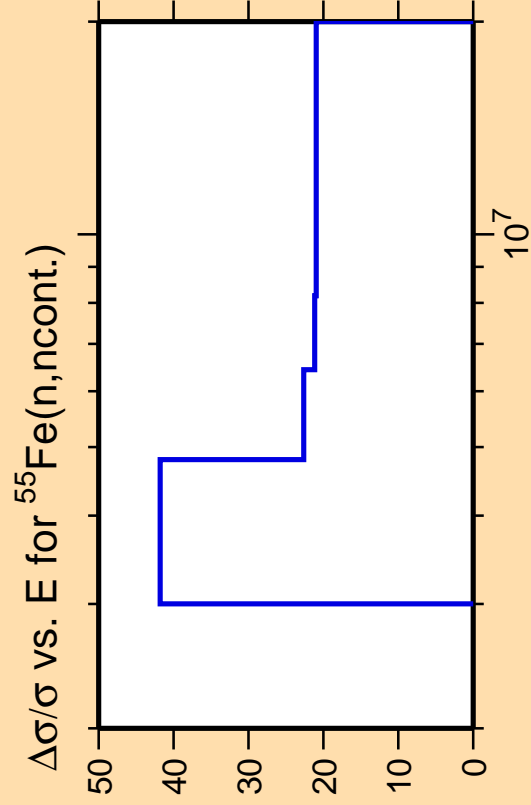

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{el.})$

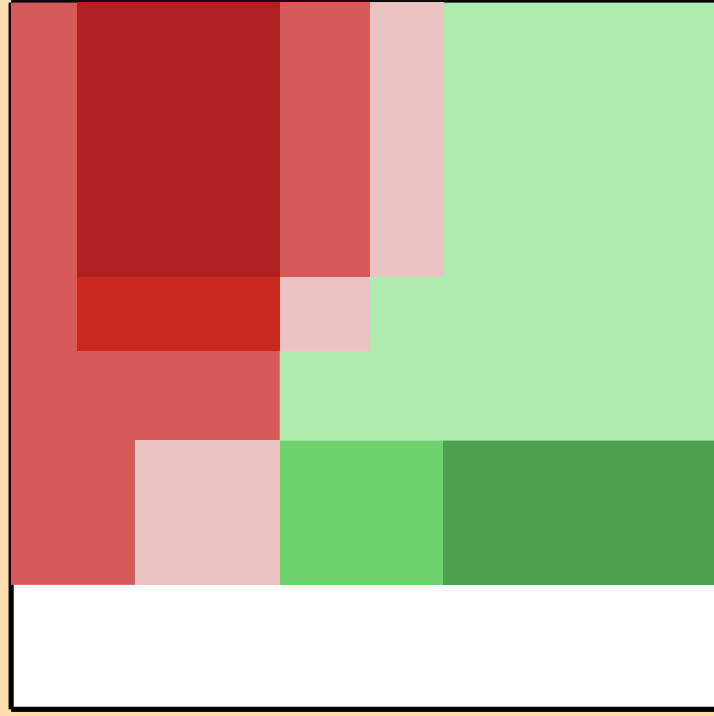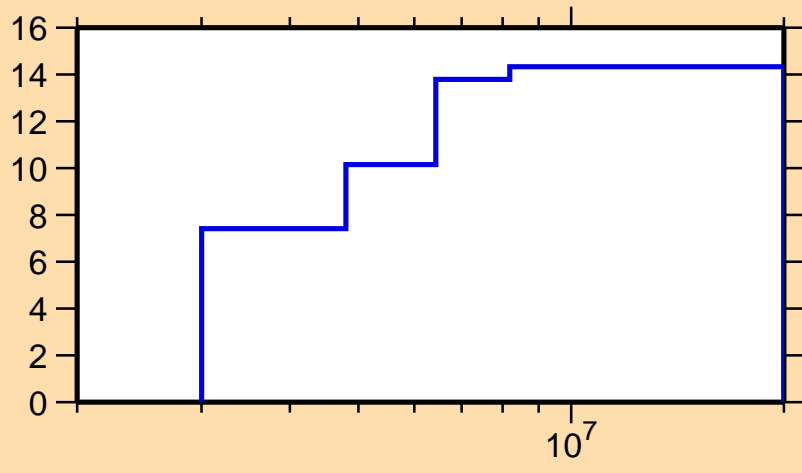

Correlation Matrix




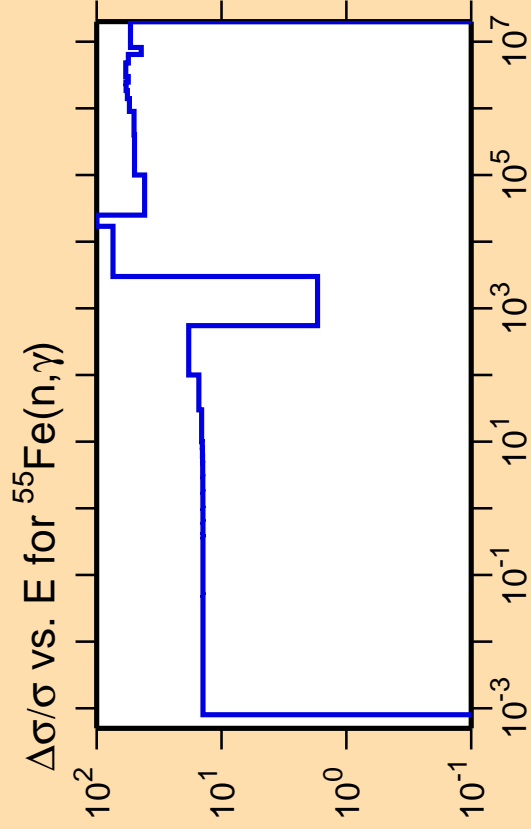


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{el.})$

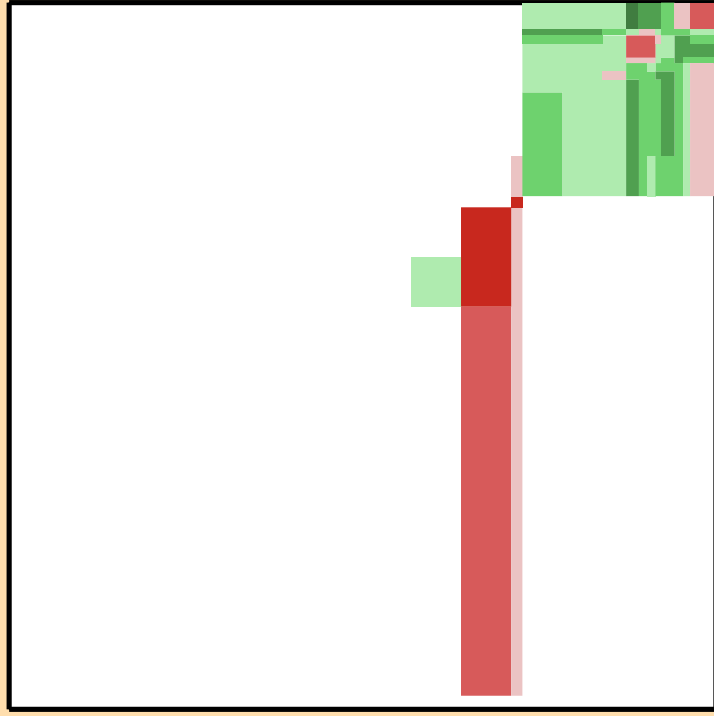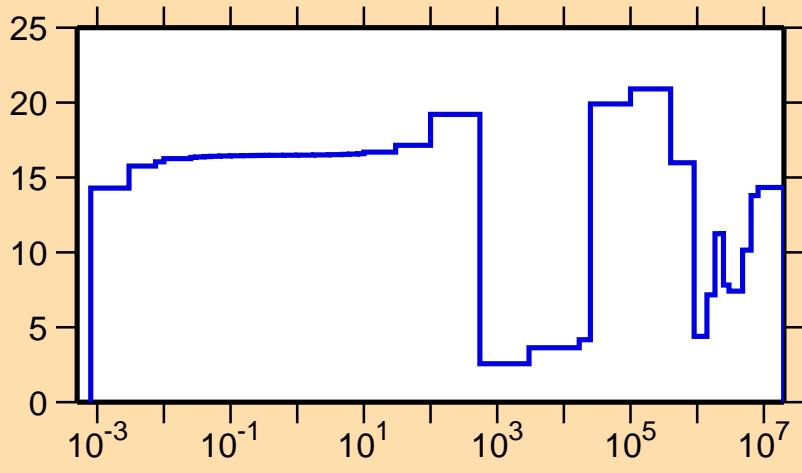

Correlation Matrix




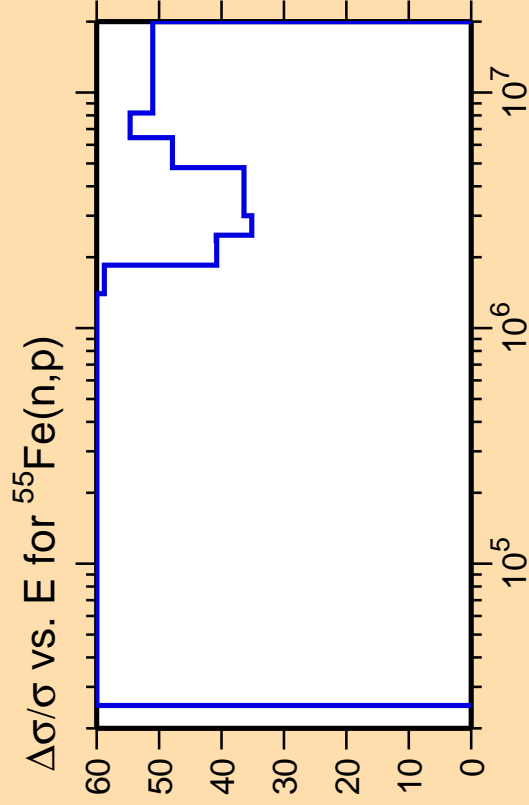


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,el.)$

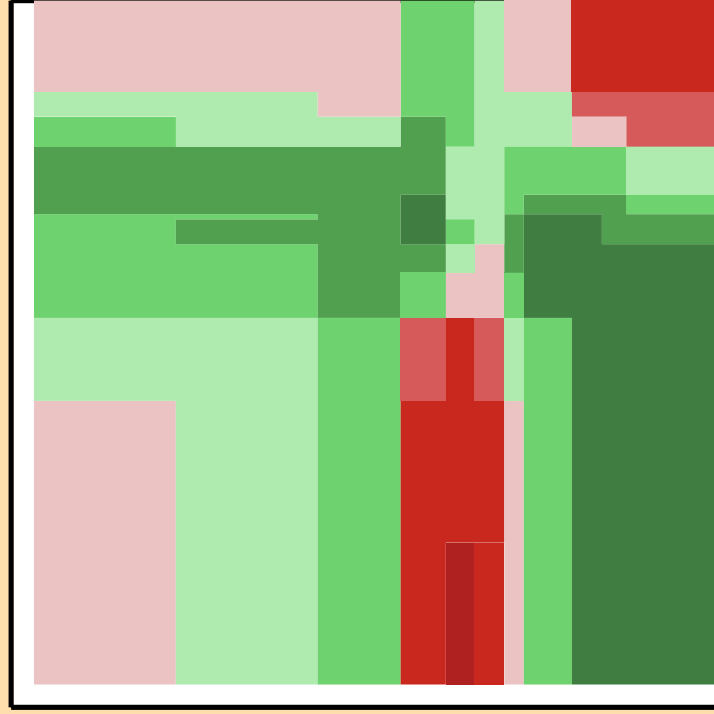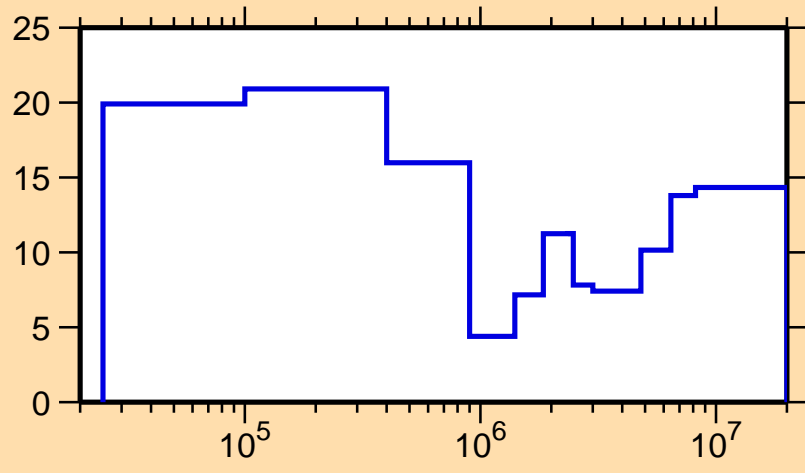

Correlation Matrix




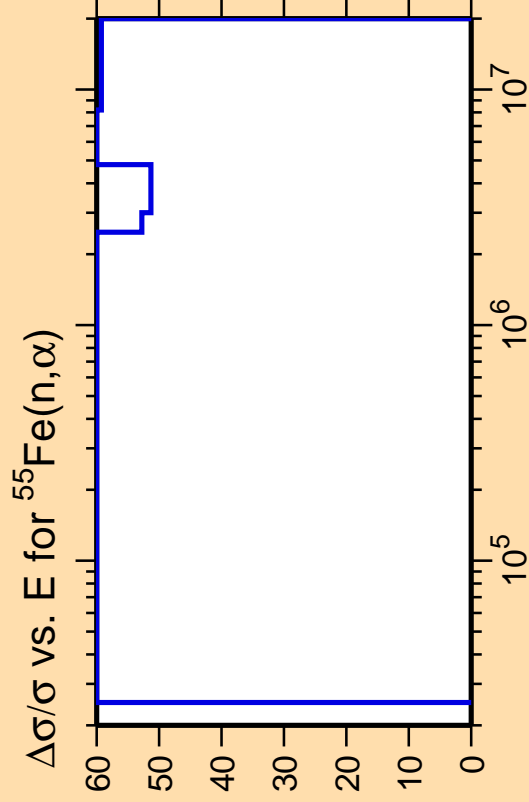


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{el.})$

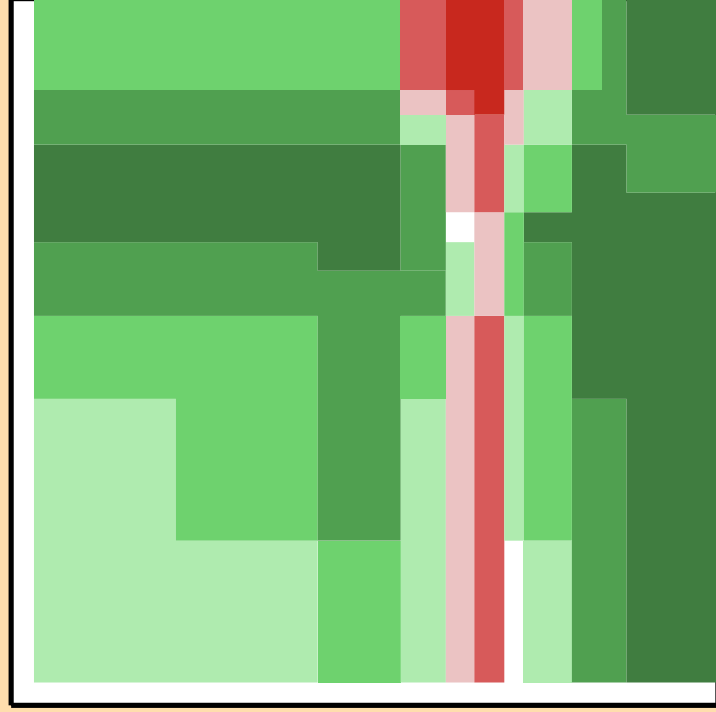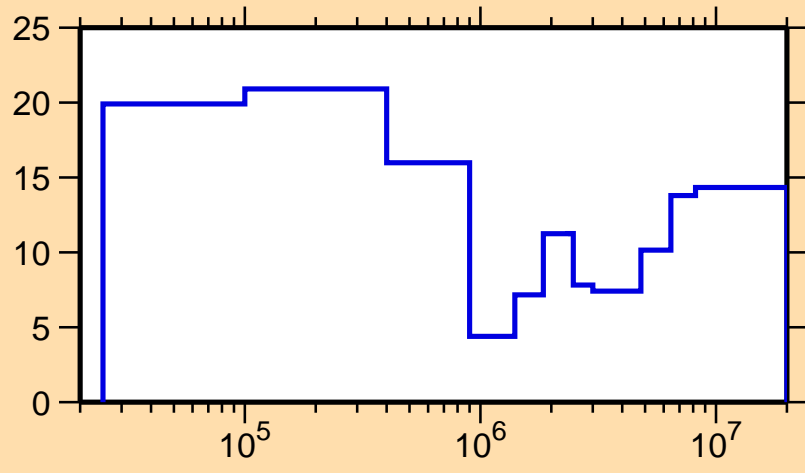

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

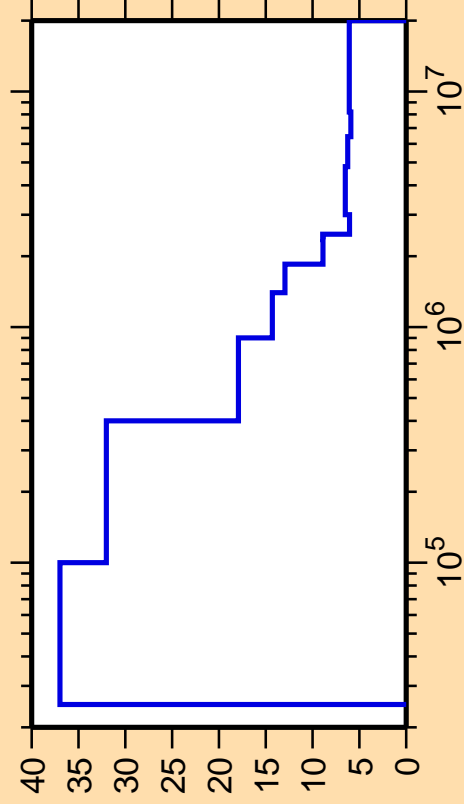

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

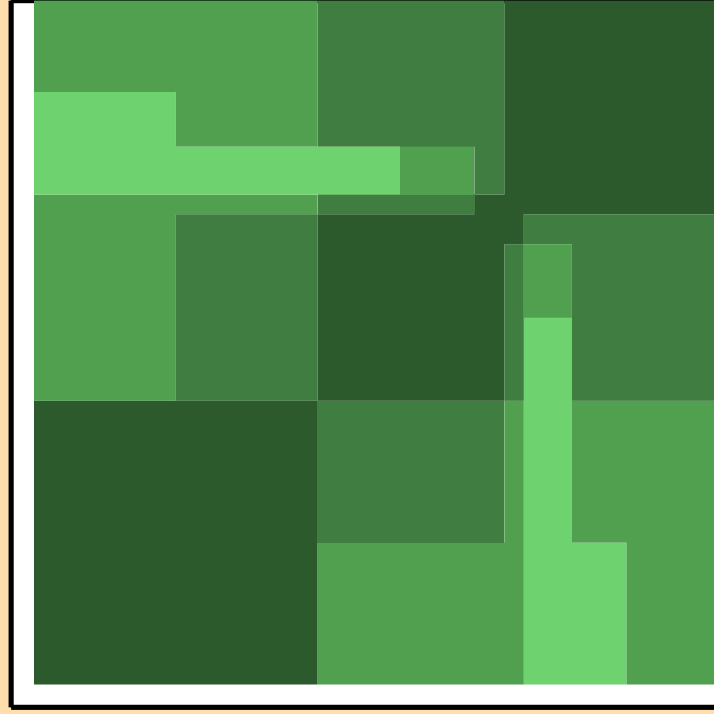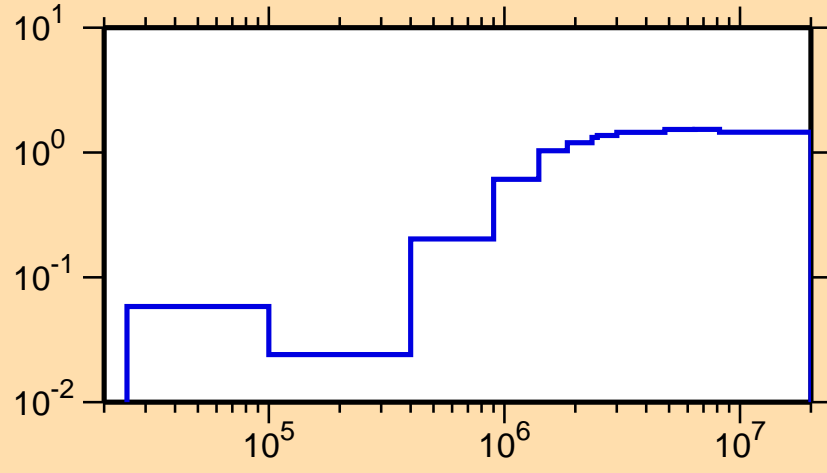

Correlation Matrix





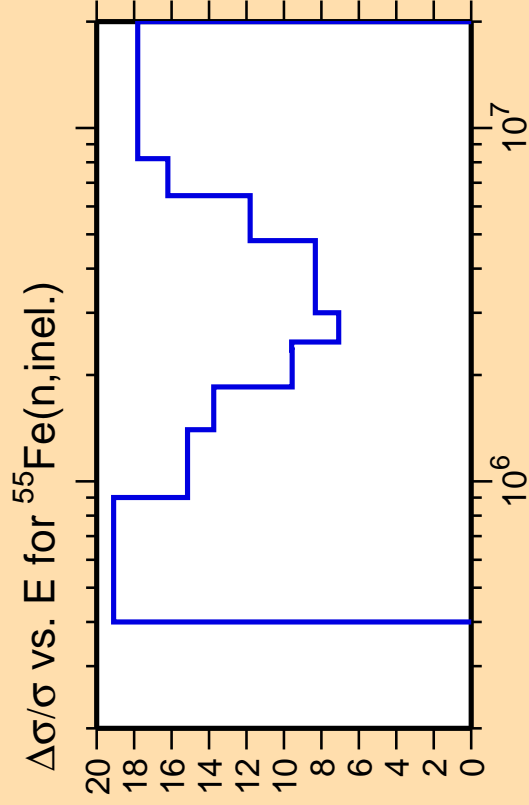

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

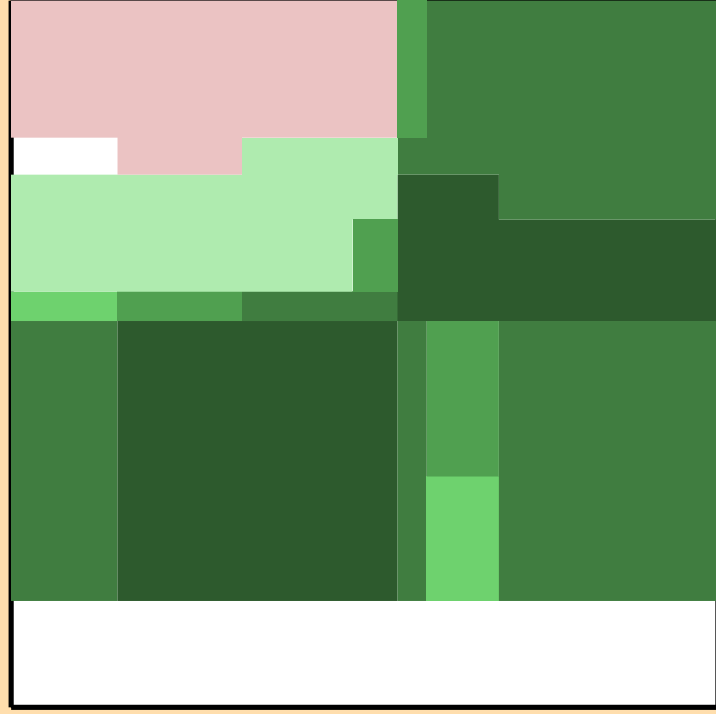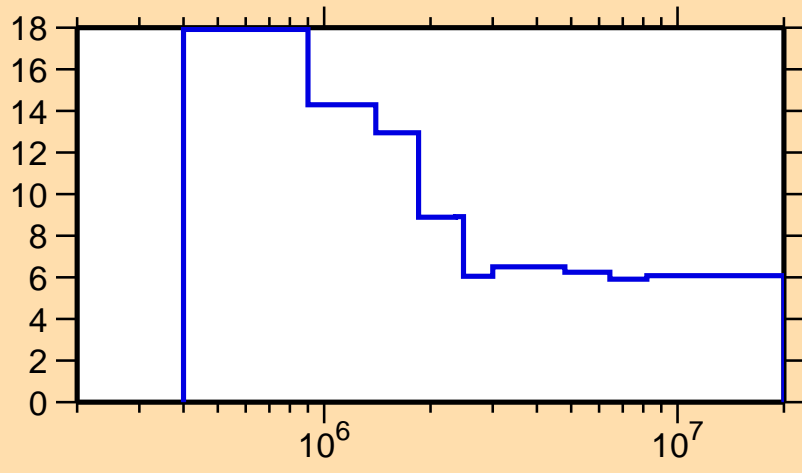



Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

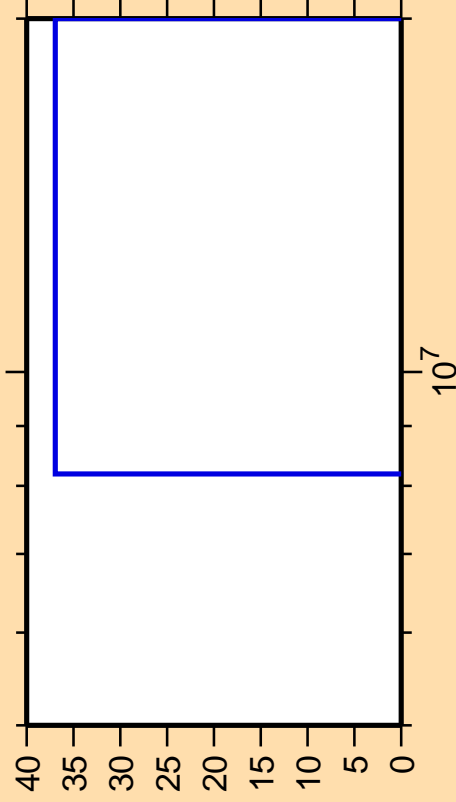


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

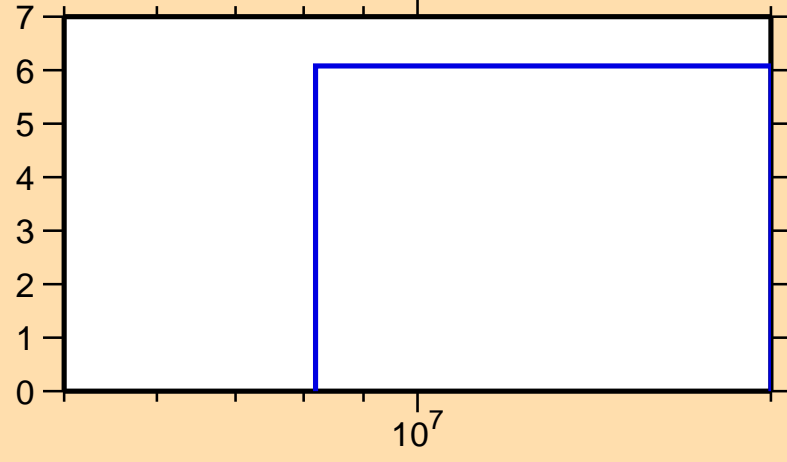

Correlation Matrix


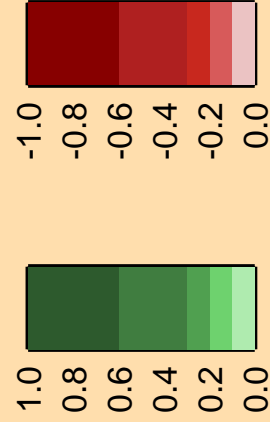


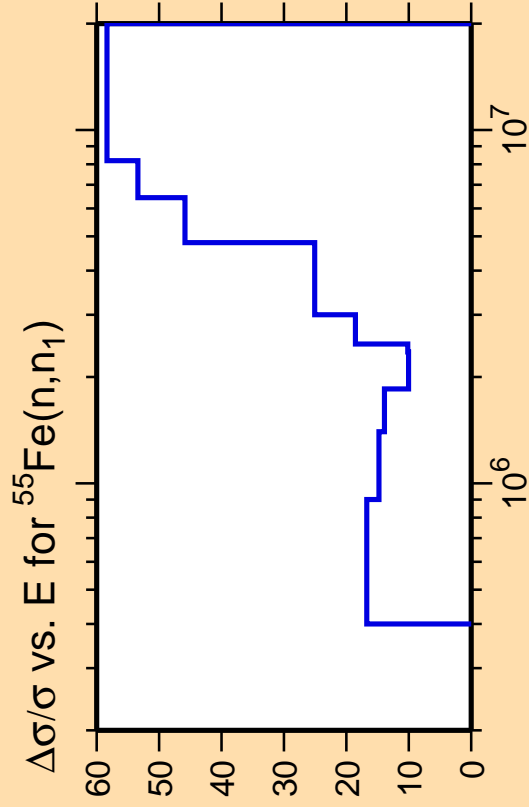

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

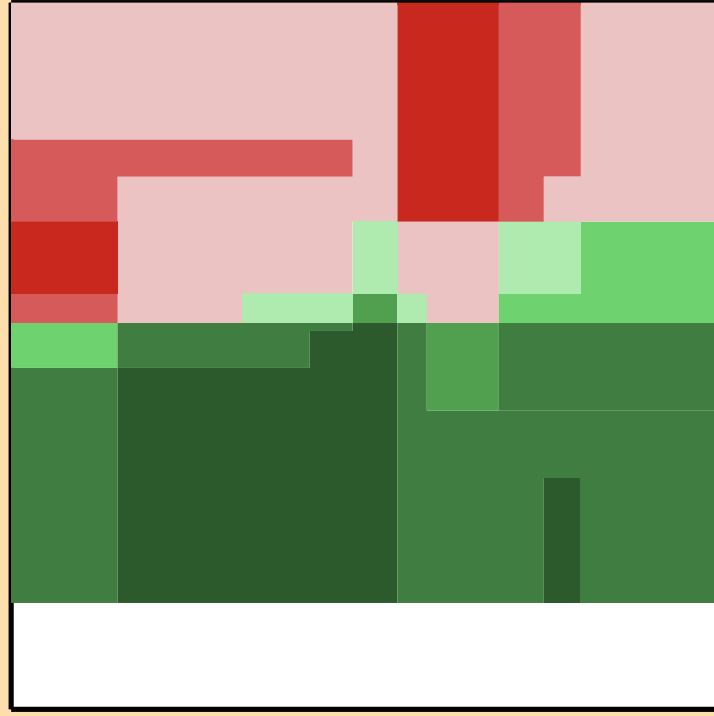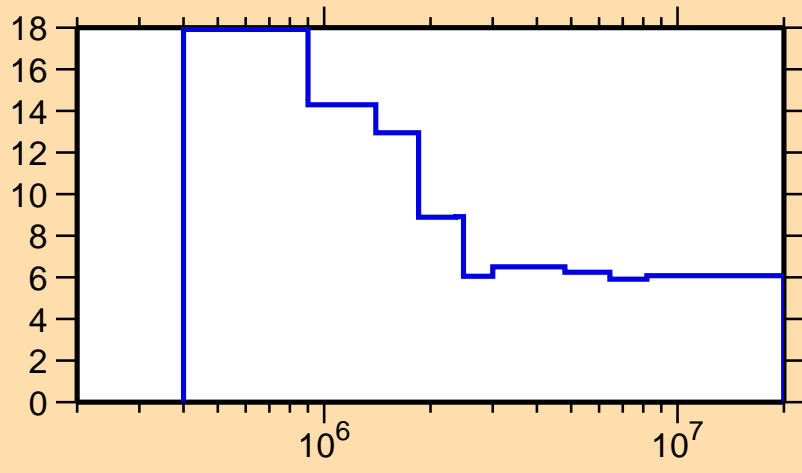

Correlation Matrix





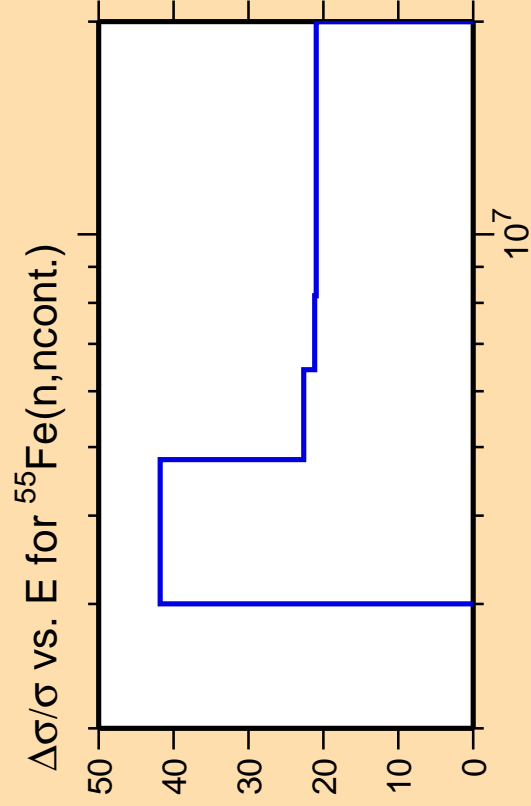

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

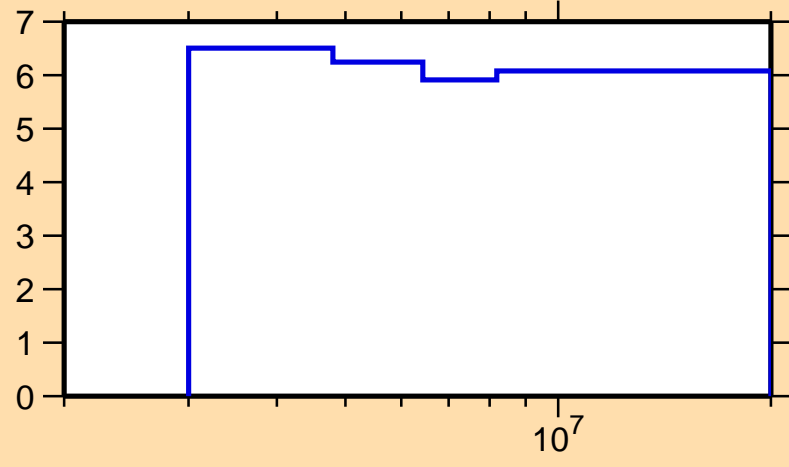

Correlation Matrix





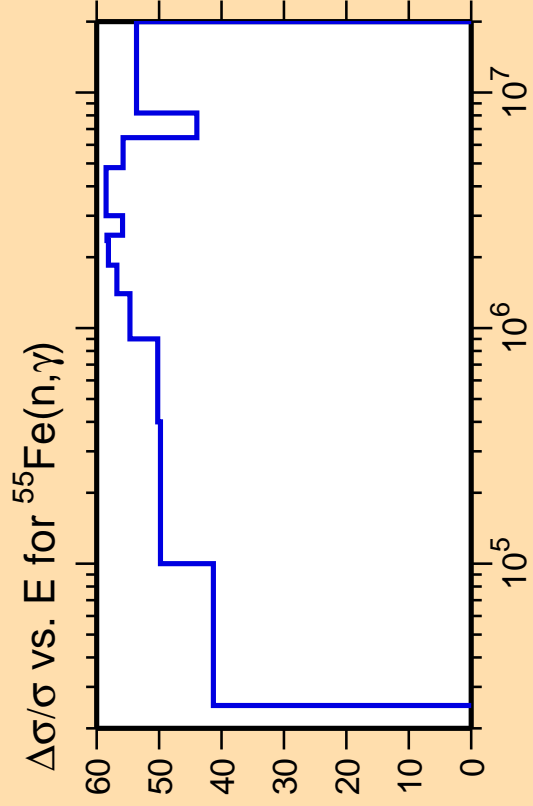

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

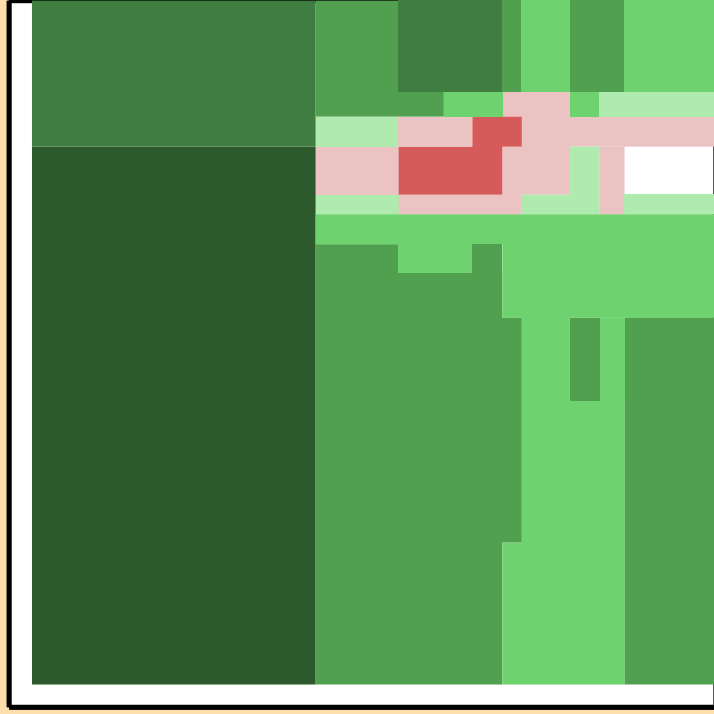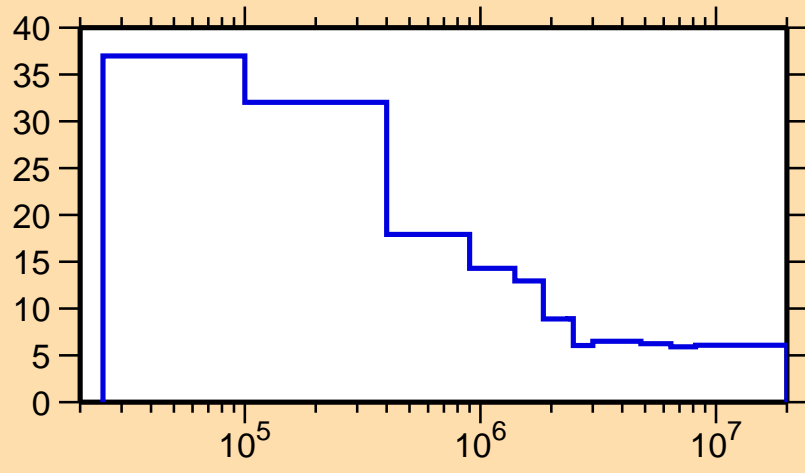

Correlation Matrix




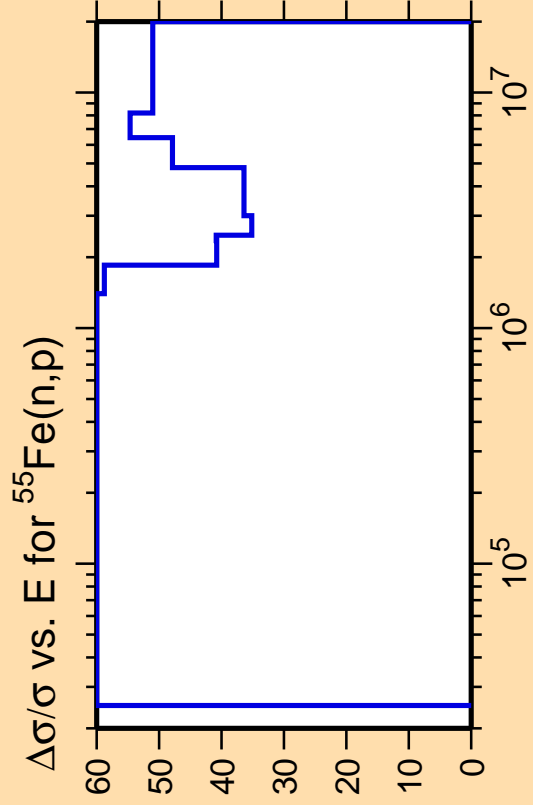


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

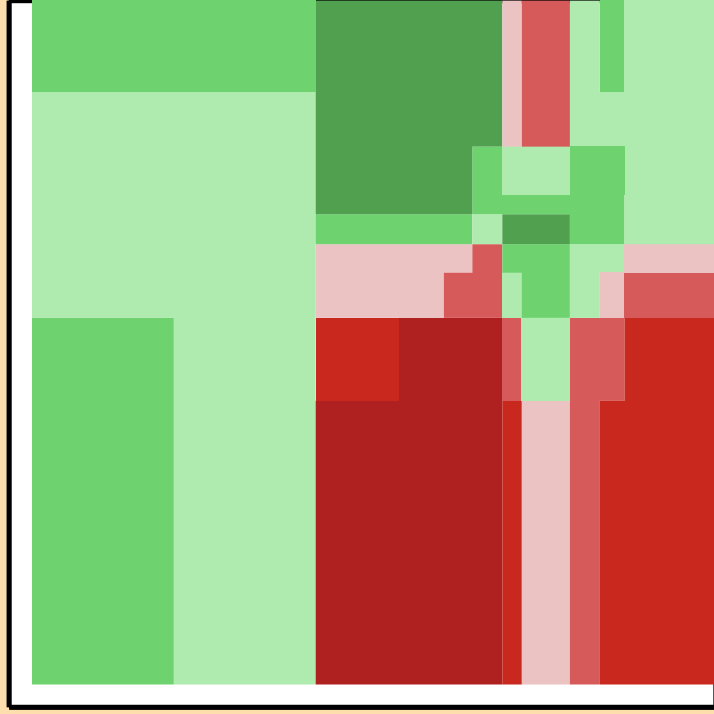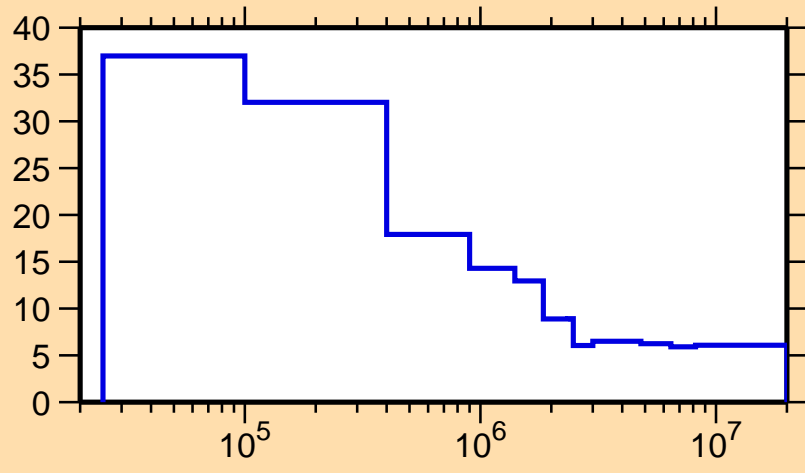

Correlation Matrix




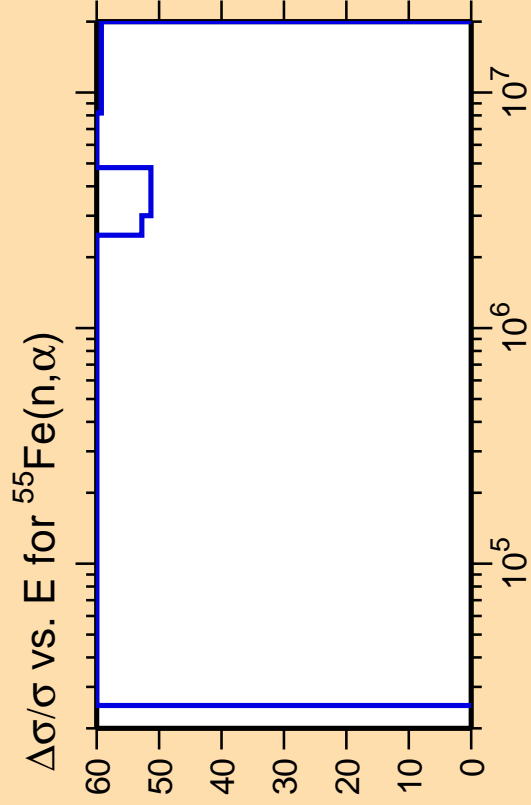


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nonel.})$

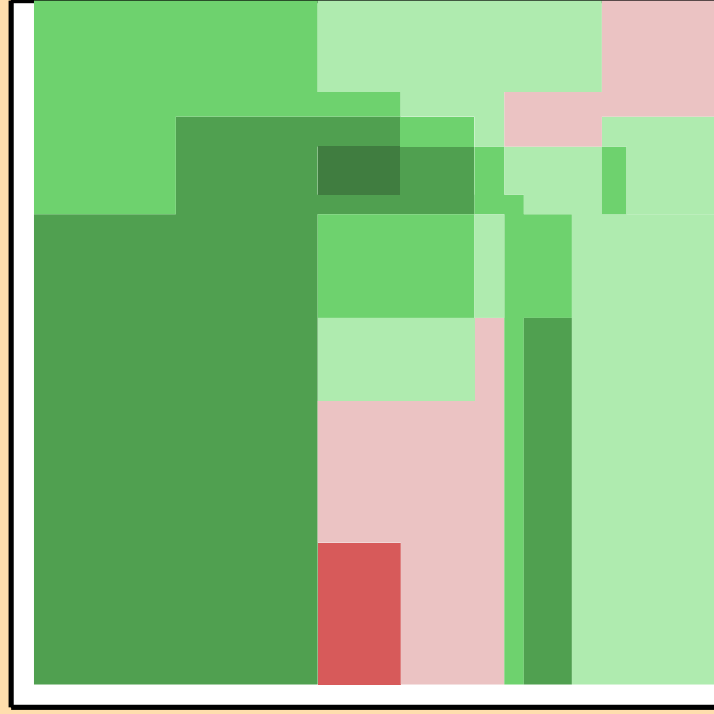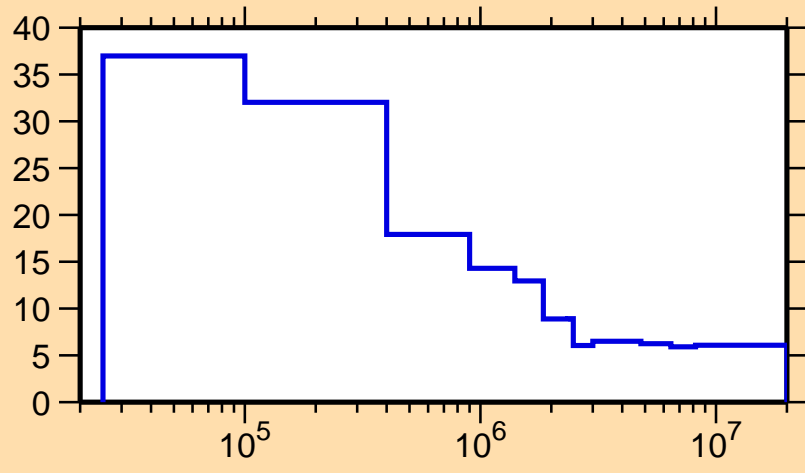



Correlation Matrix



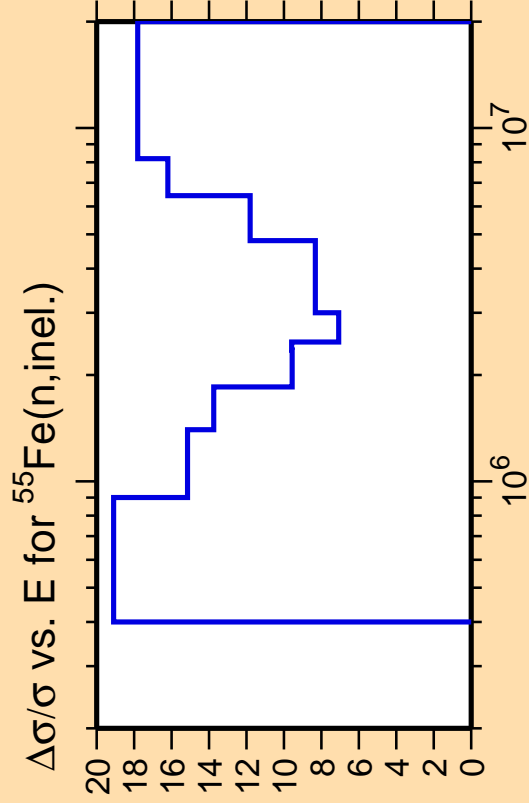


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

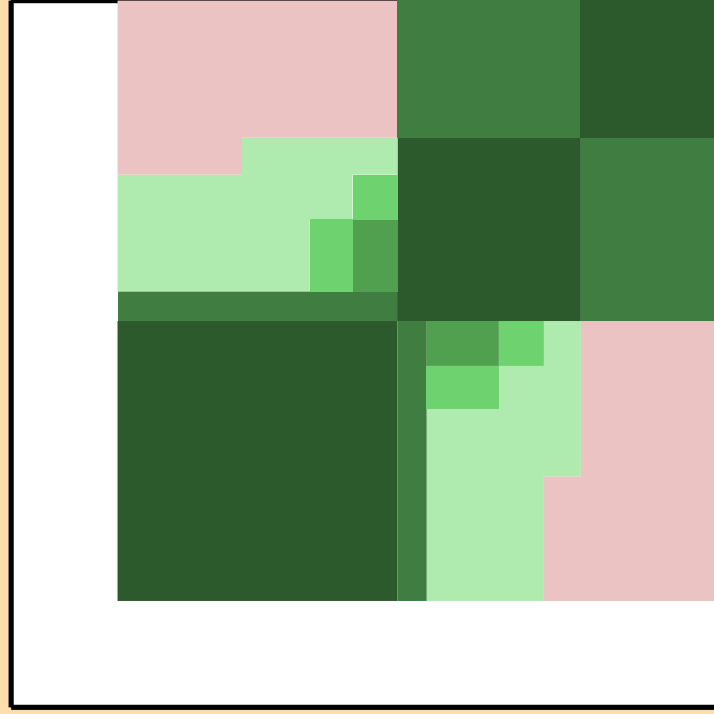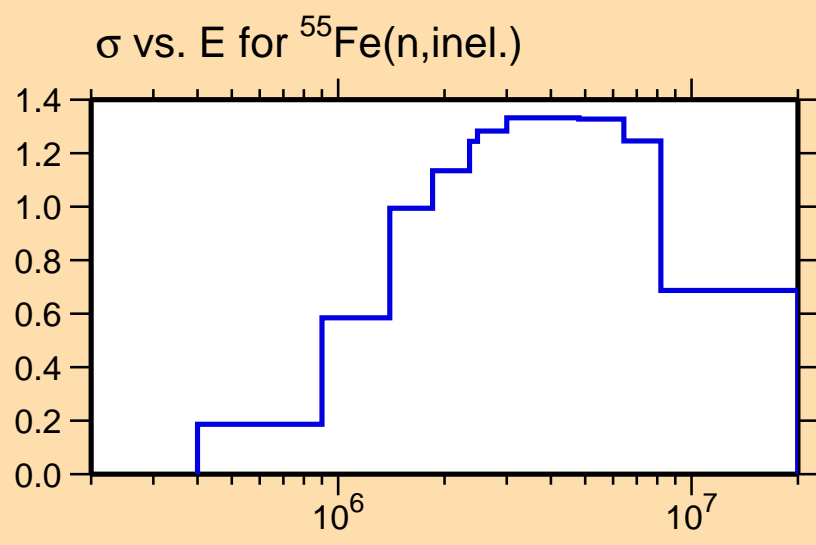

Correlation Matrix

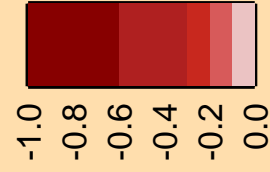



$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

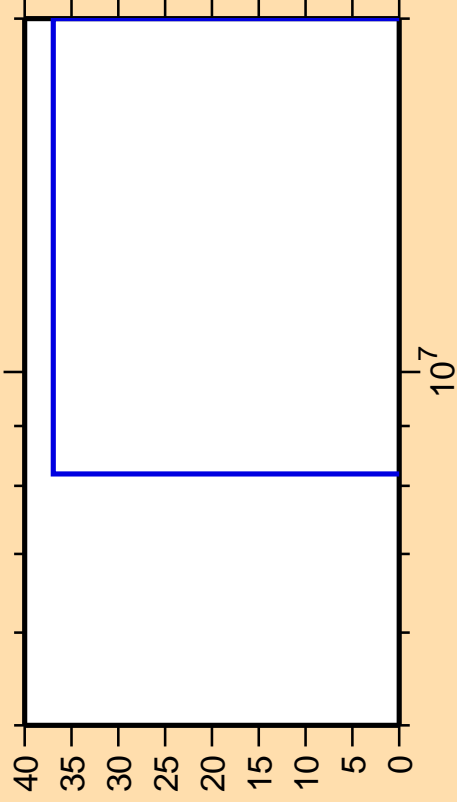

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{inel.})$

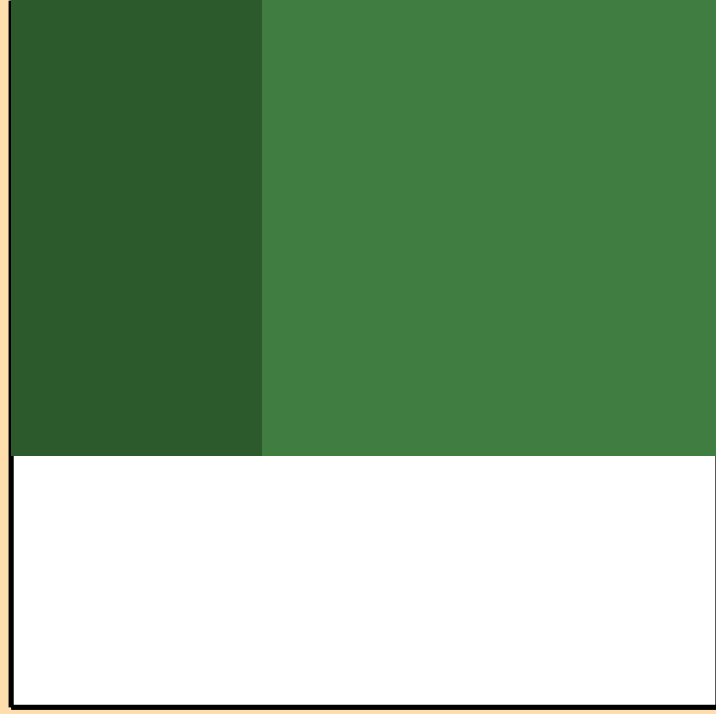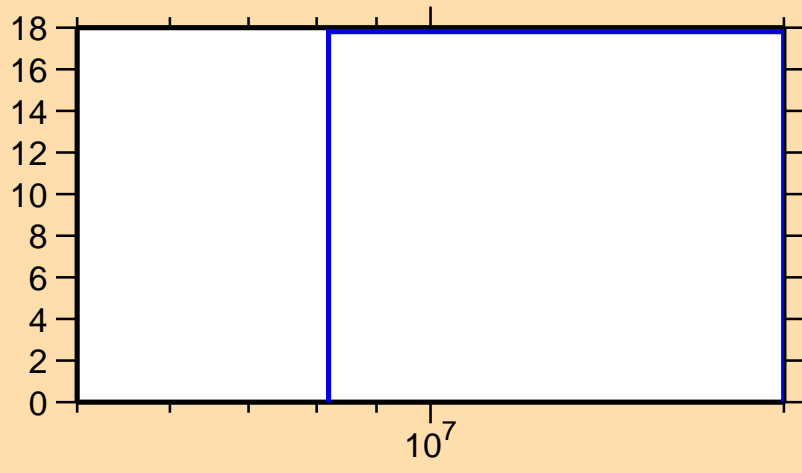

Correlation Matrix





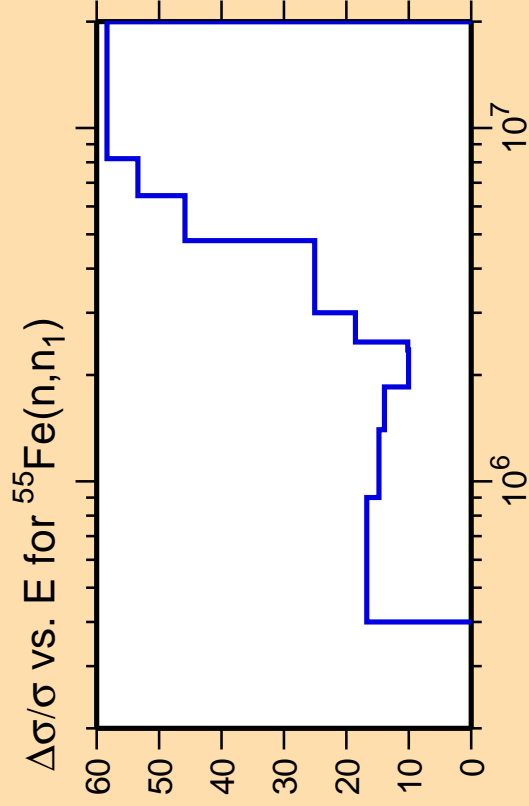

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{inel.})$

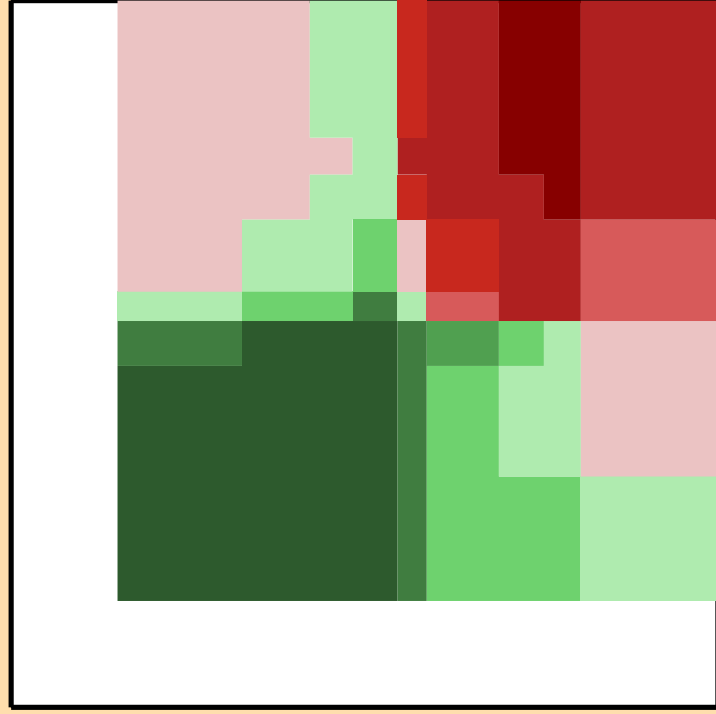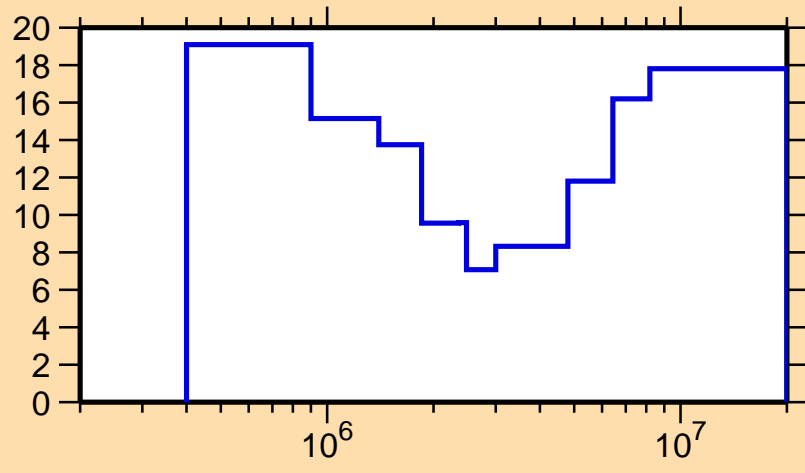

Correlation Matrix





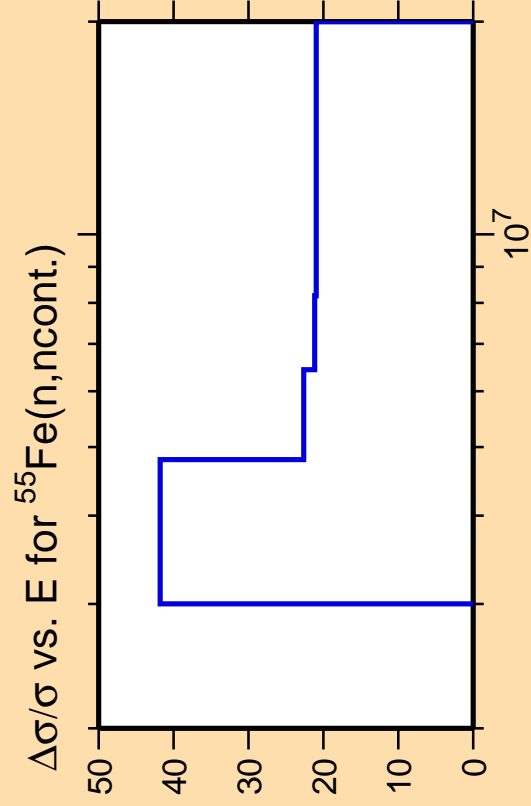

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{inel.})$

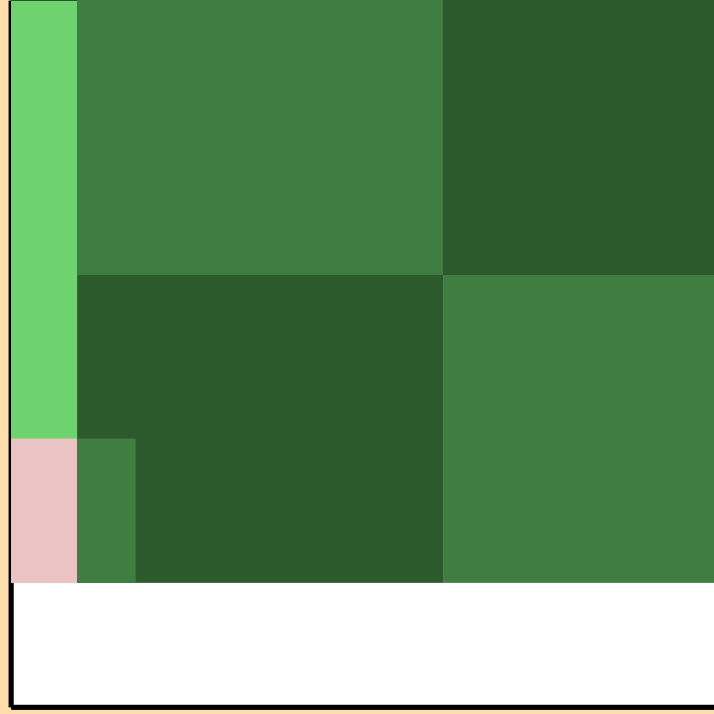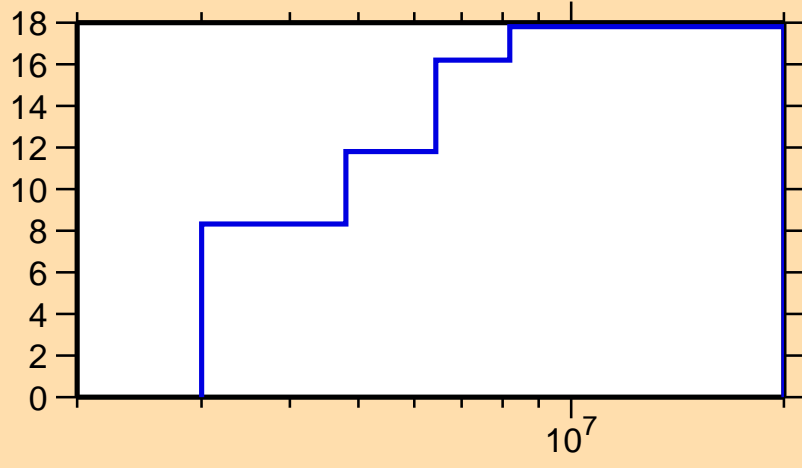



Correlation Matrix



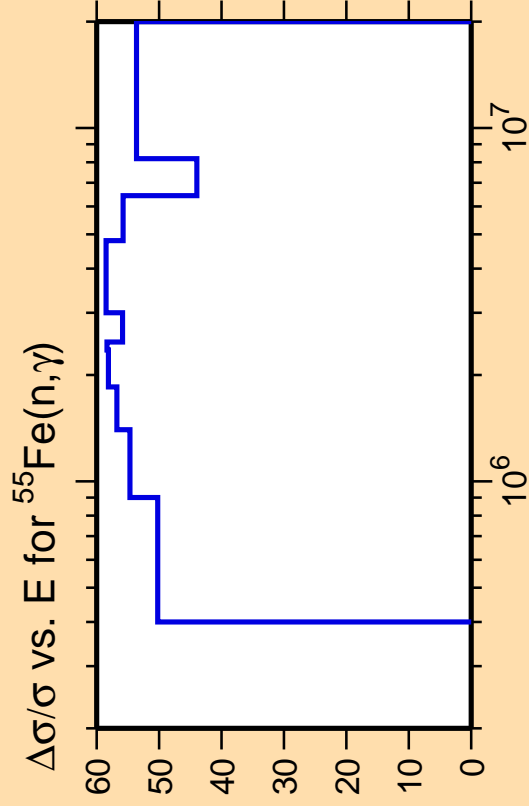


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

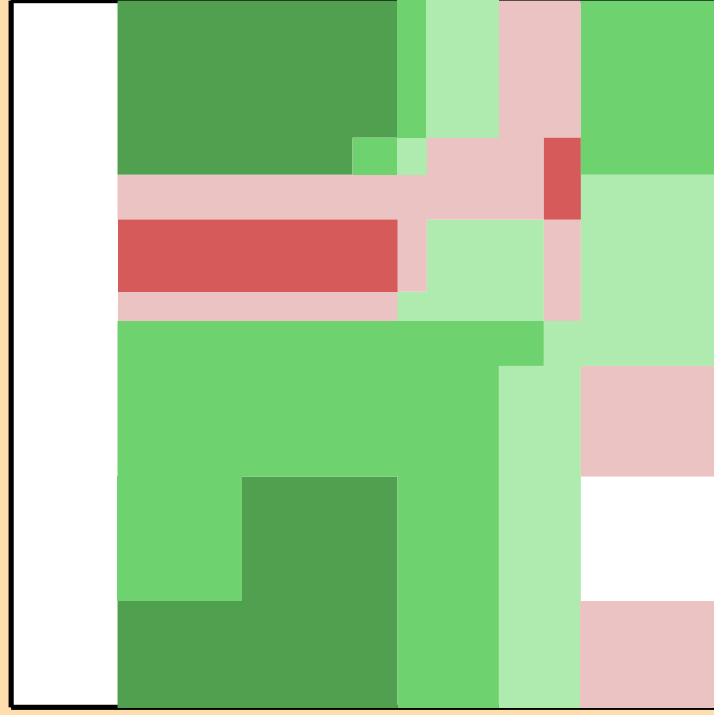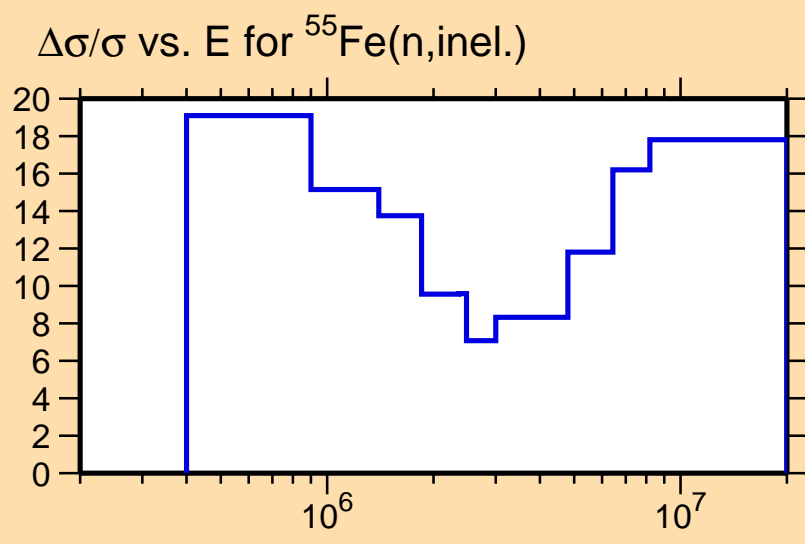

Correlation Matrix





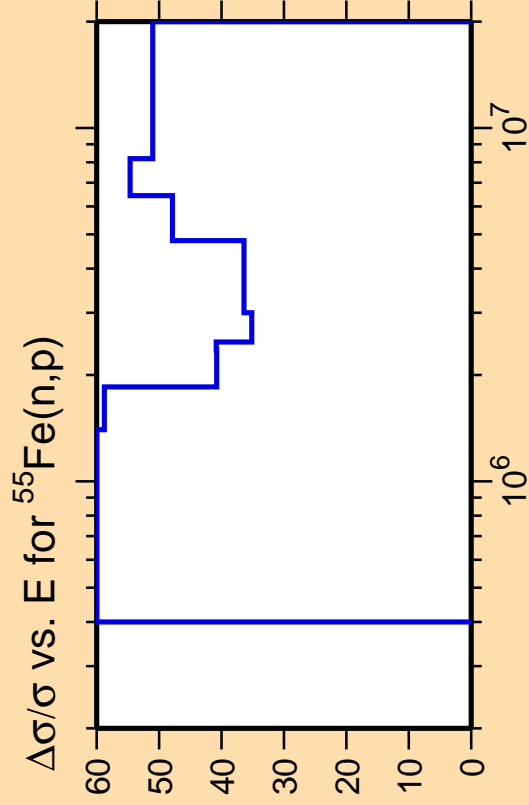


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

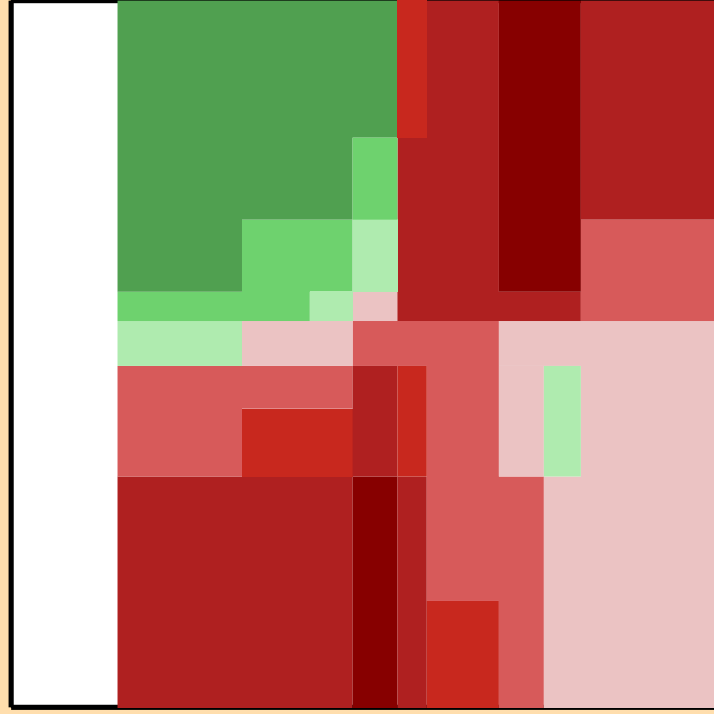
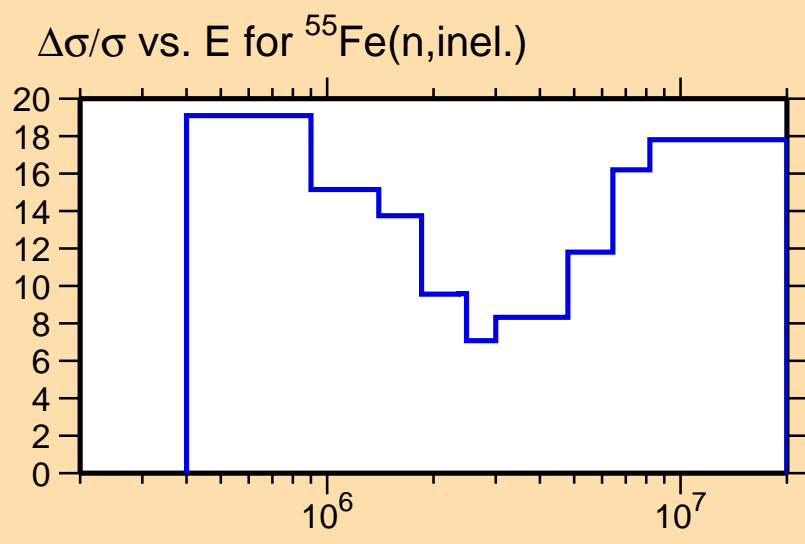


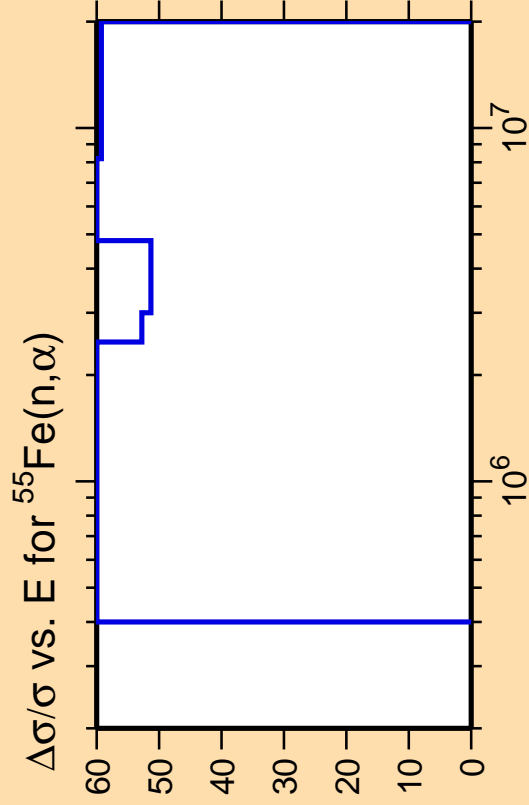

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

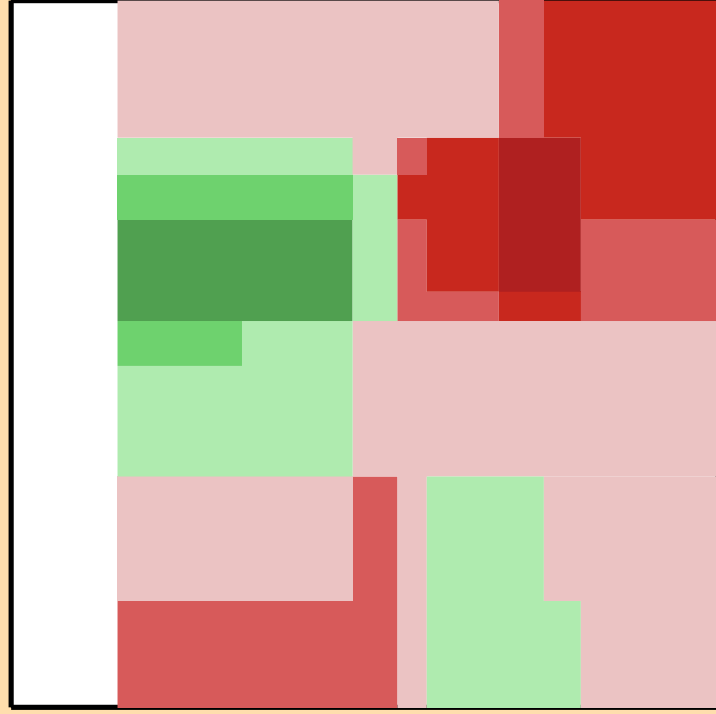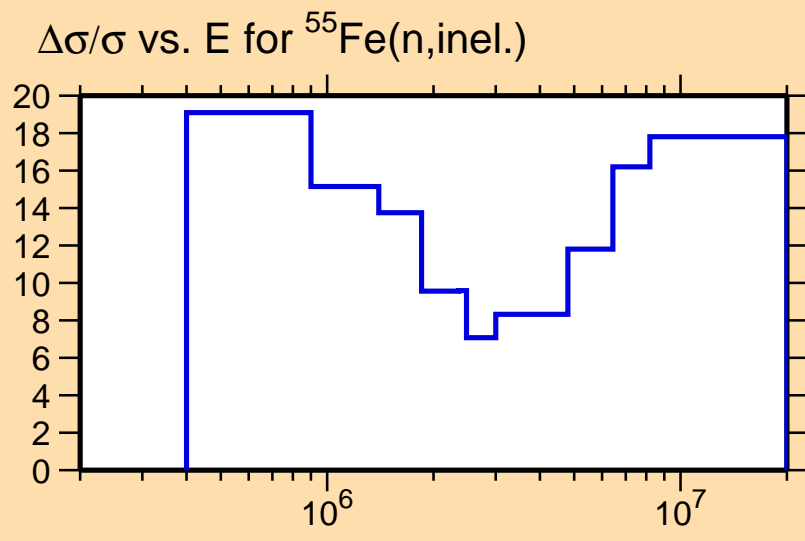

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

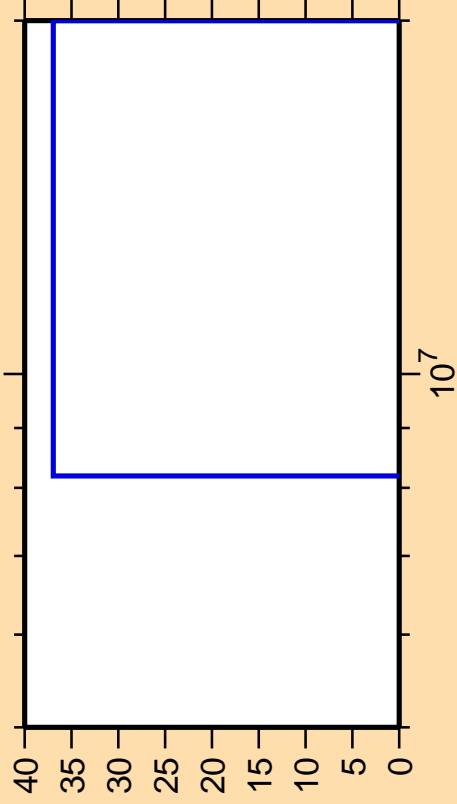

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{55}\text{Fe}(n,2n)$

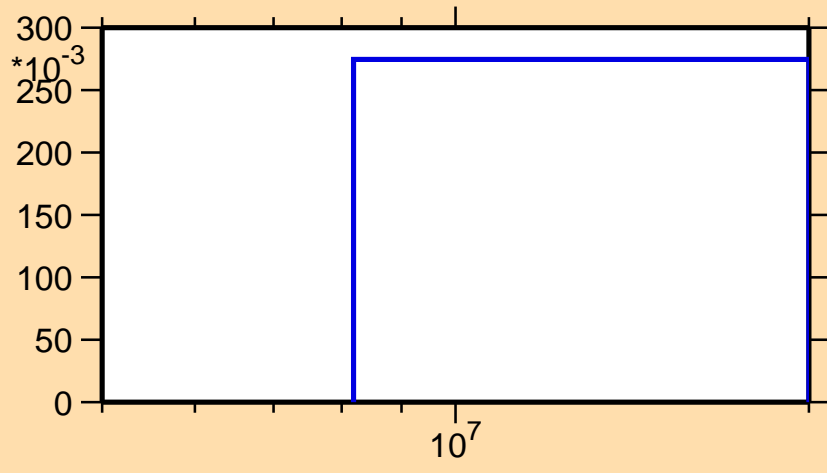

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,n_1)$

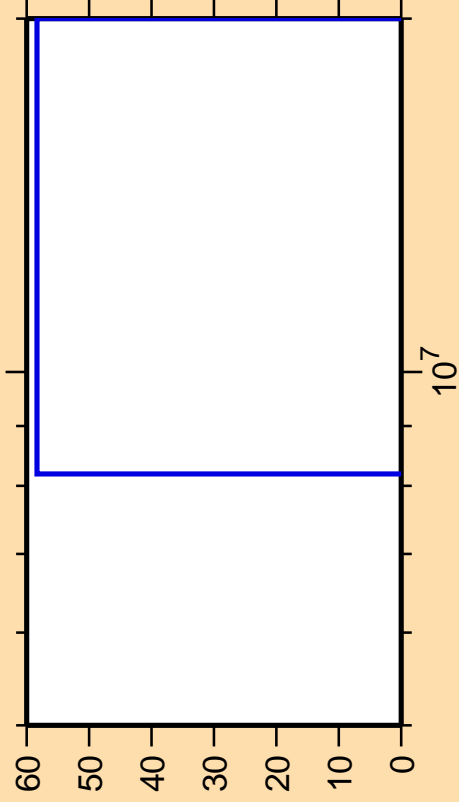

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

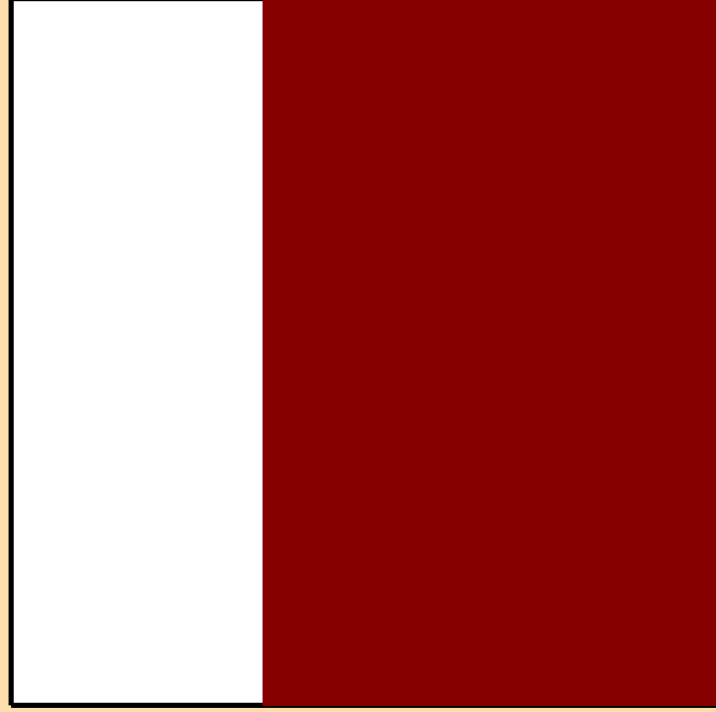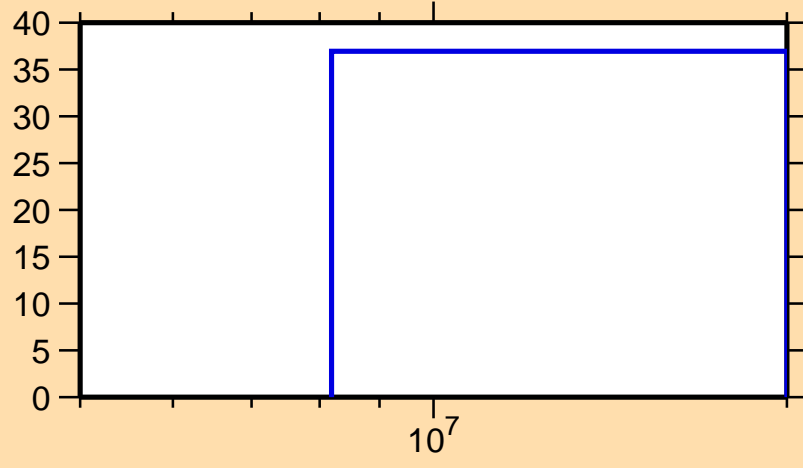

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,n\text{cont.})$

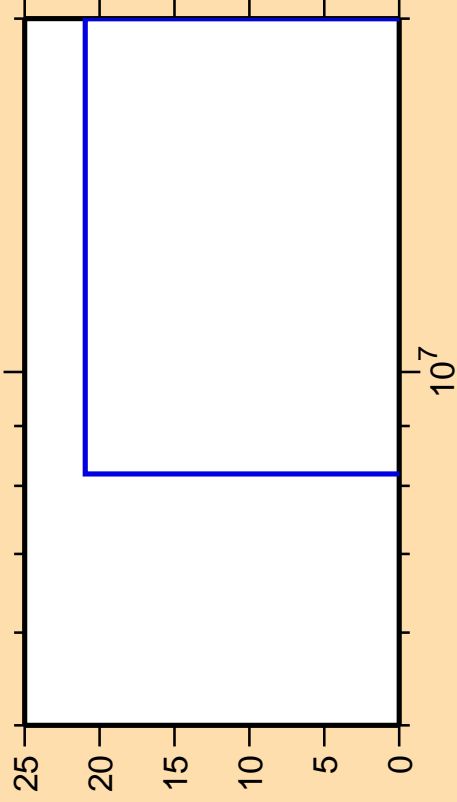

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

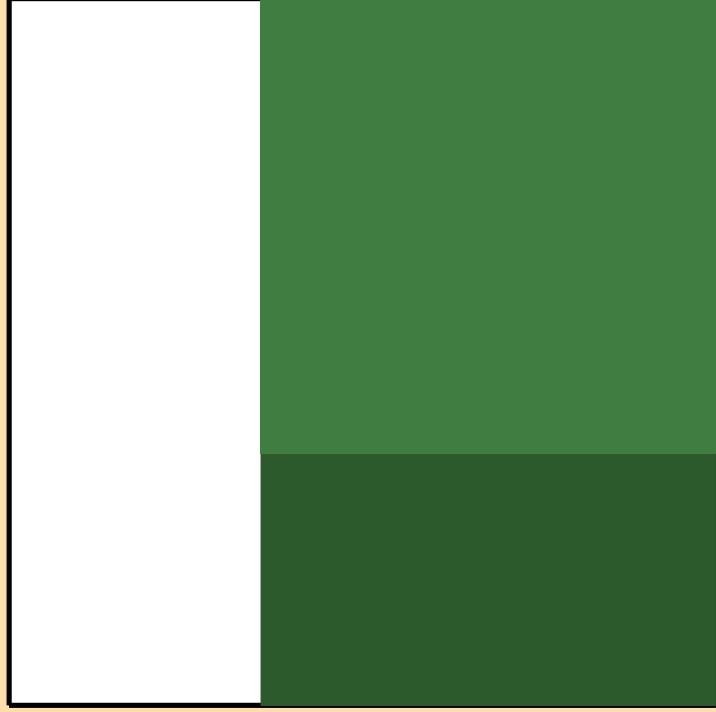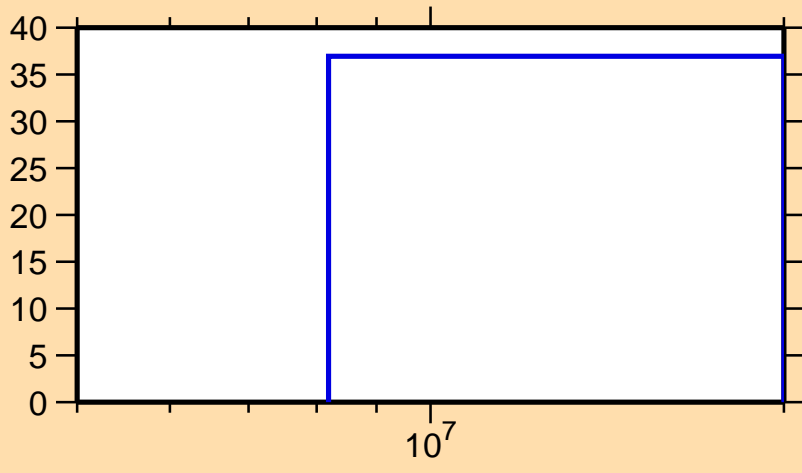

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\gamma)$

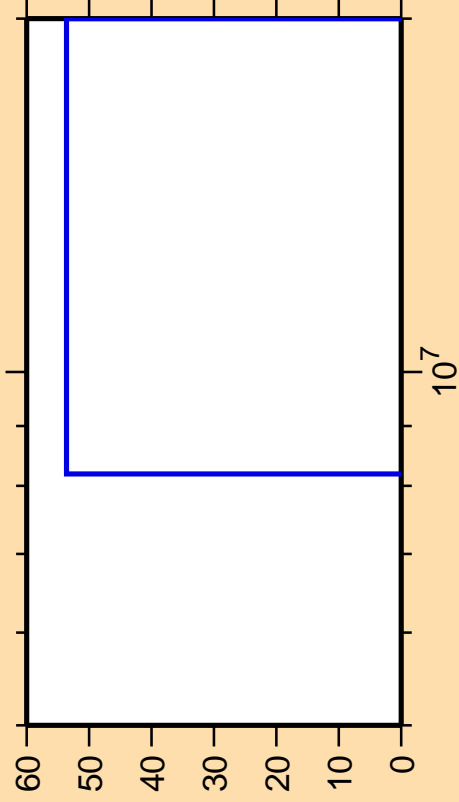

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

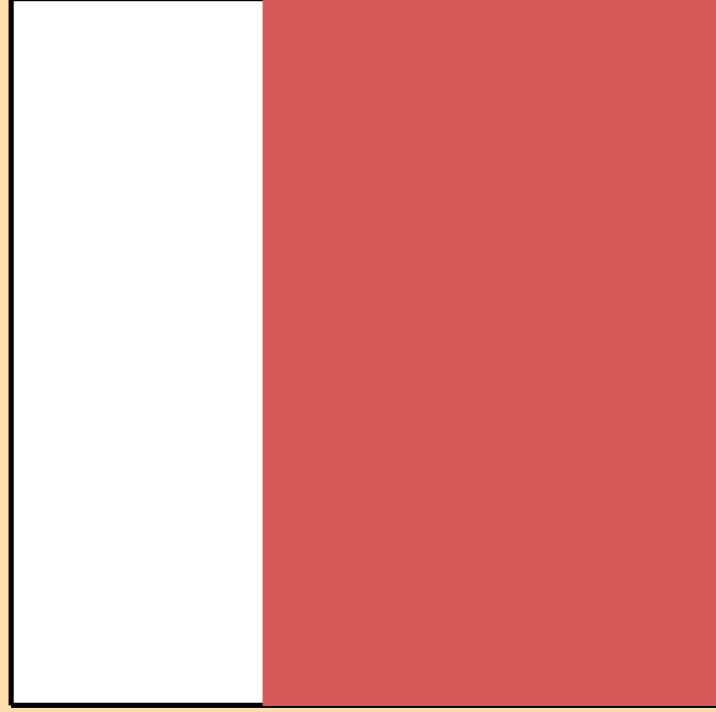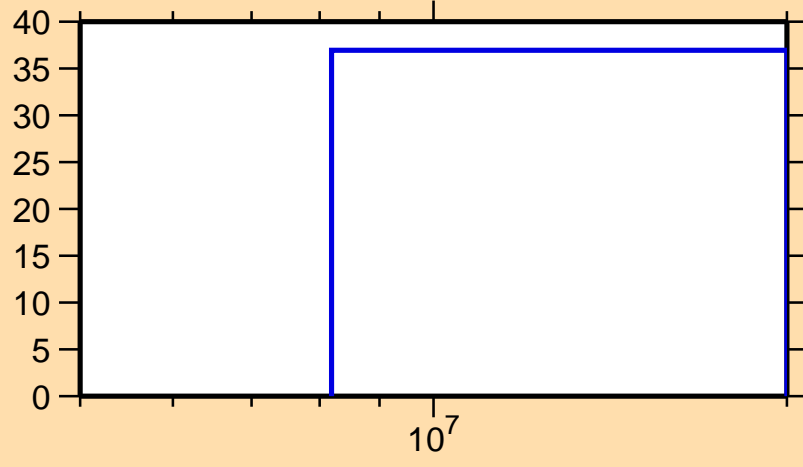

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,p)$

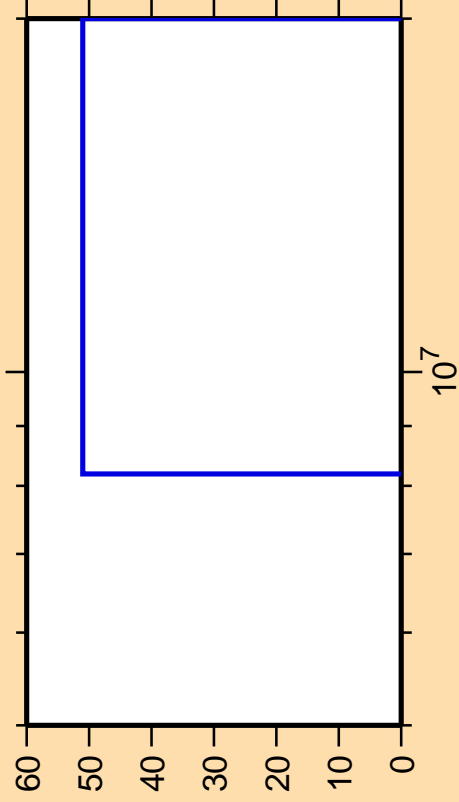

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

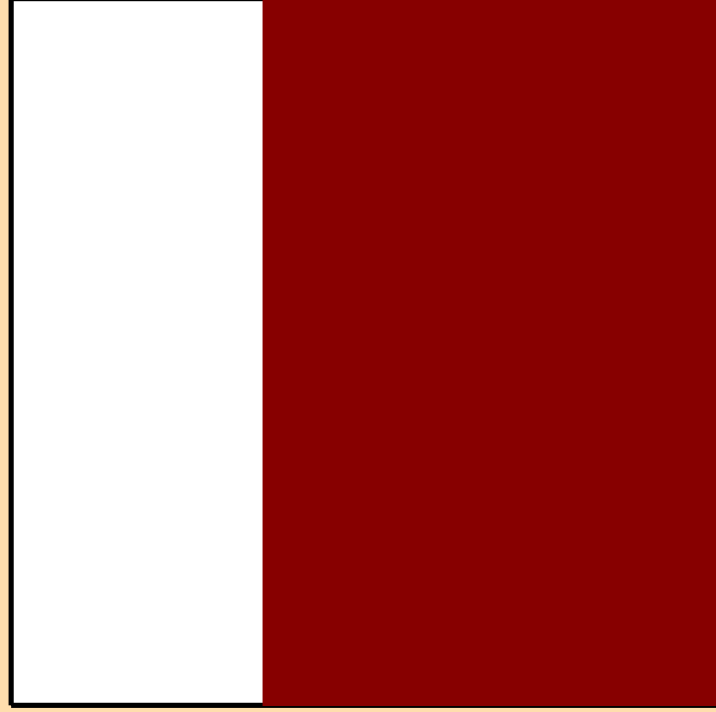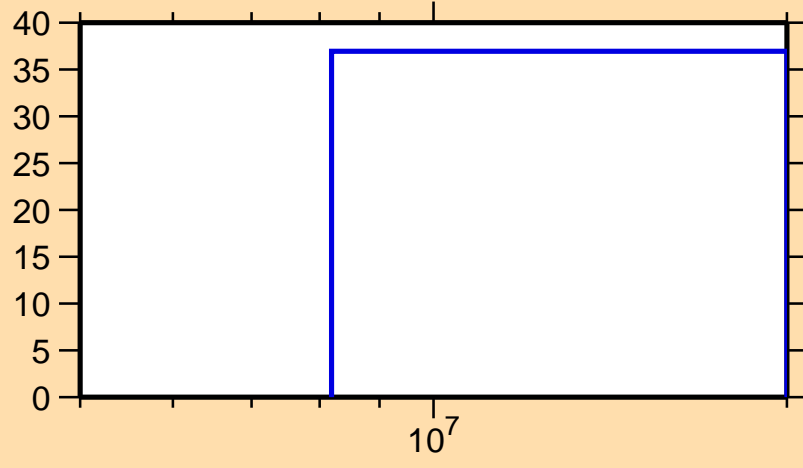

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\alpha)$

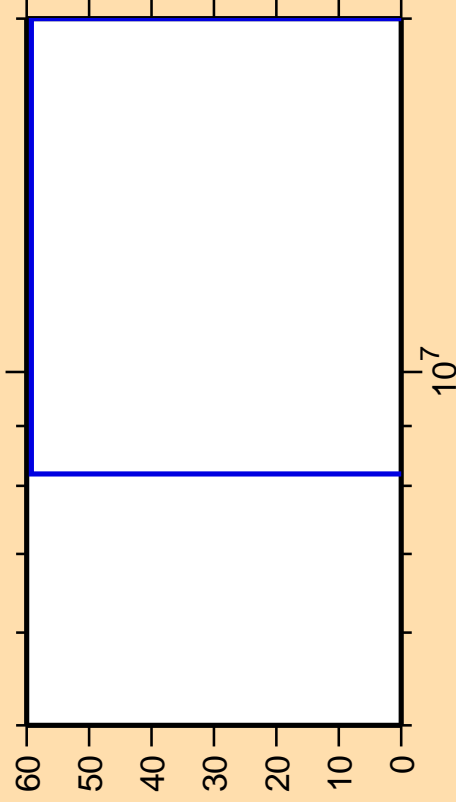

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2n)$

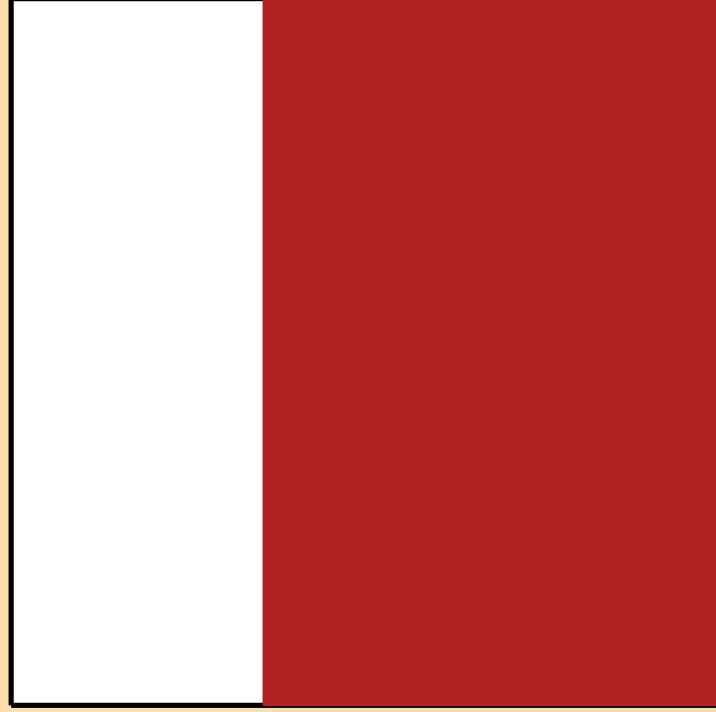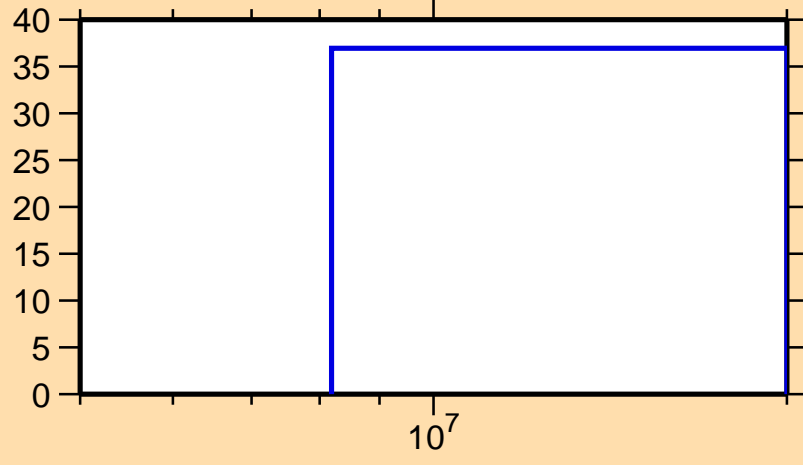

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\alpha)$

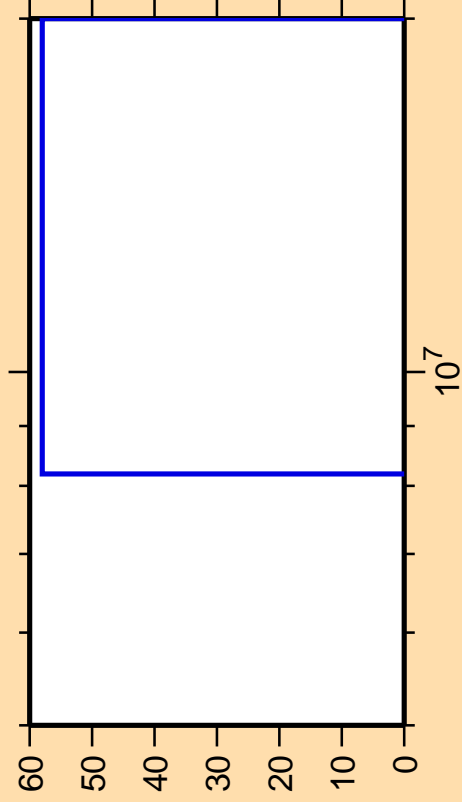

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{55}\text{Fe}(n,\alpha)$

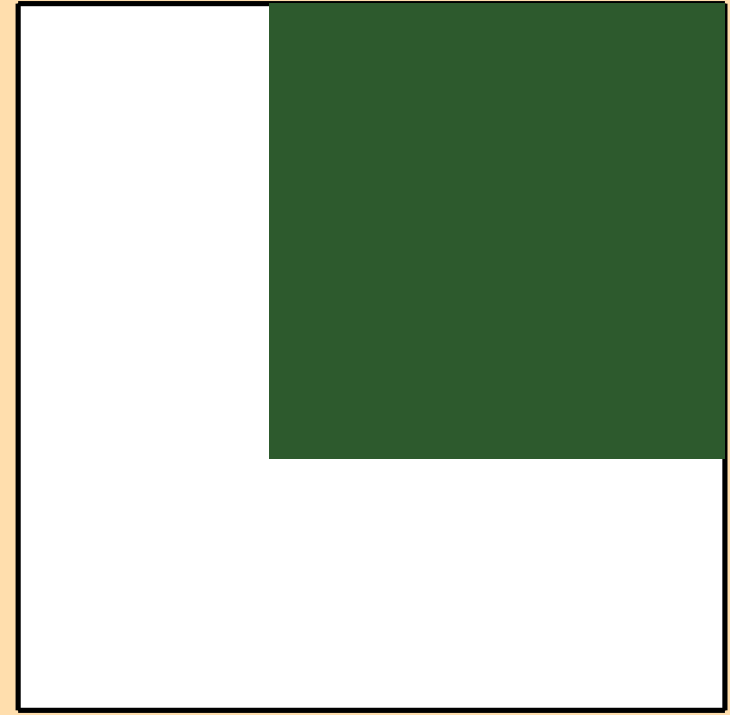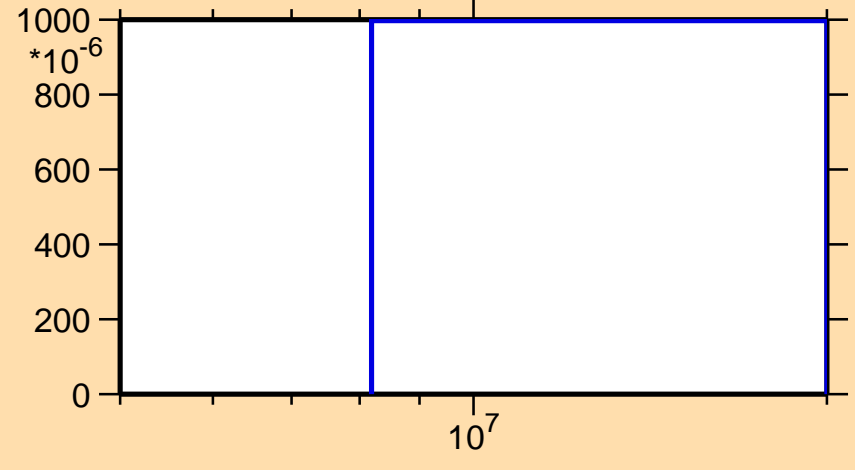

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,np)$

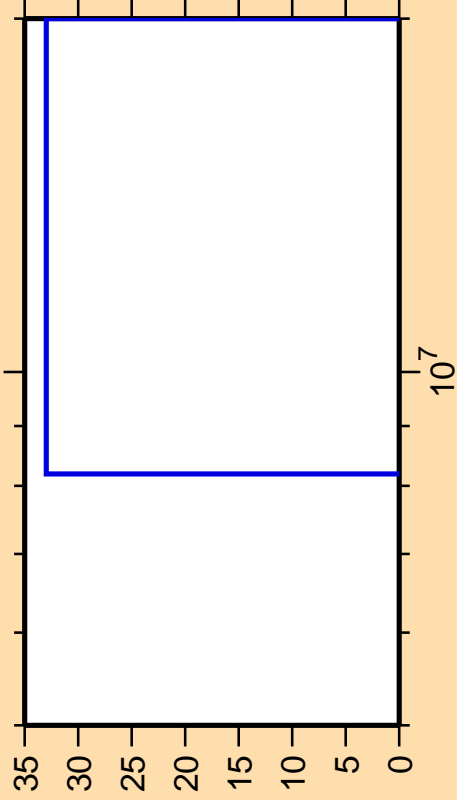

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{55}\text{Fe}(n,np)$

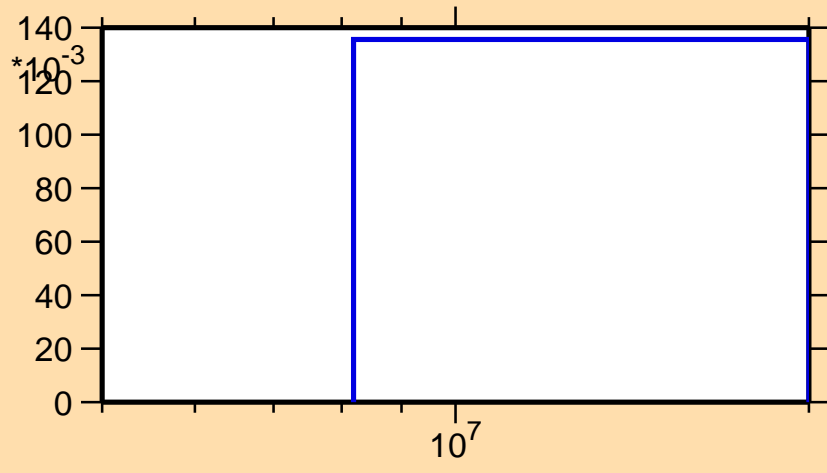

140
120
100
80
60
40
20
0

10^7



Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{nd})$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{55}\text{Fe}(n,\text{nd})$

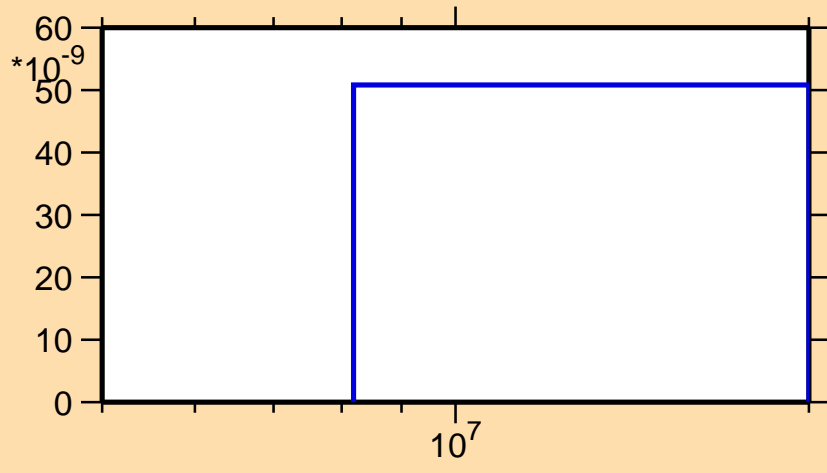


Warning: some uncertainty data were suppressed.

Warning: some uncertainty data were suppressed.

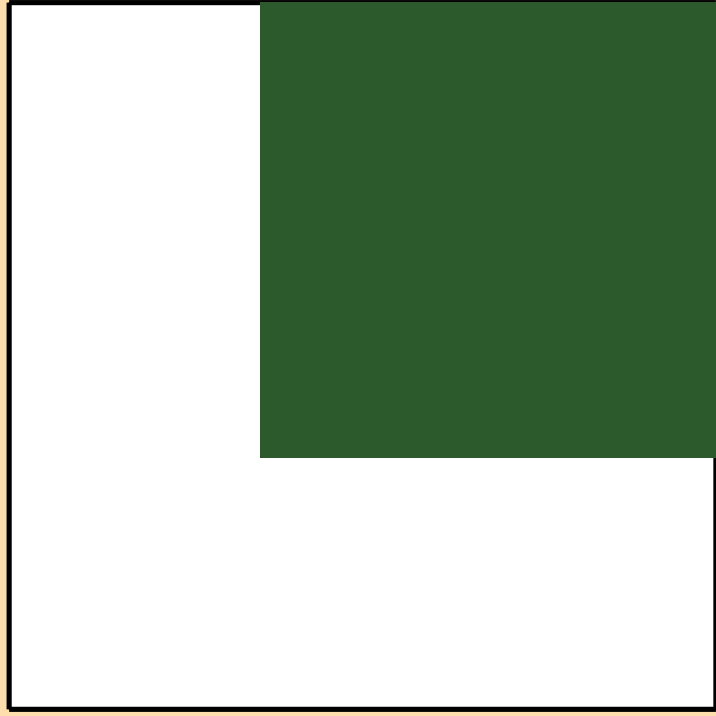

Correlation Matrix

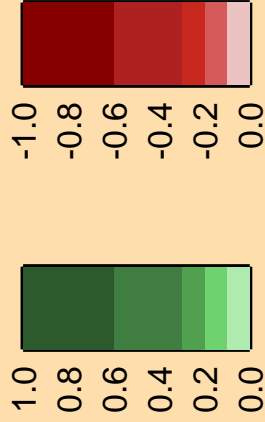

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,2np)$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{55}\text{Fe}(n,2np)$

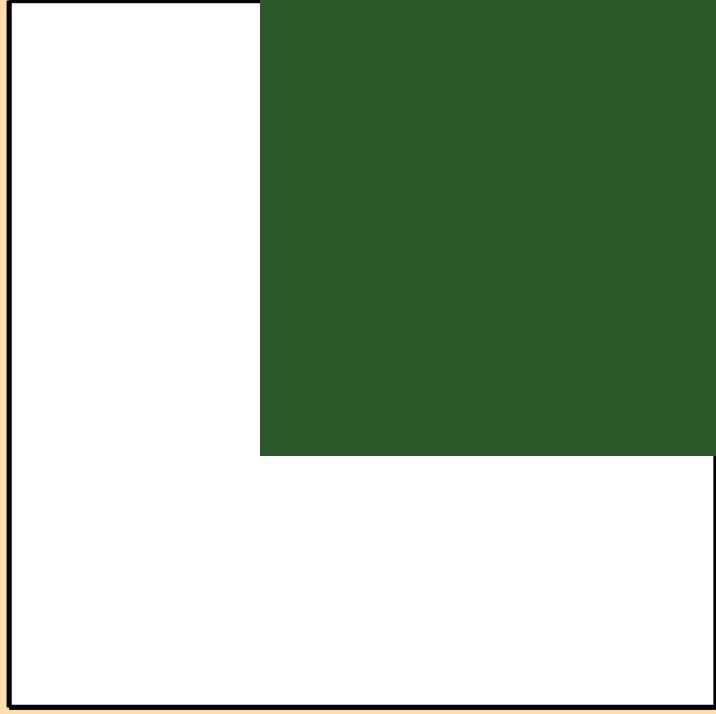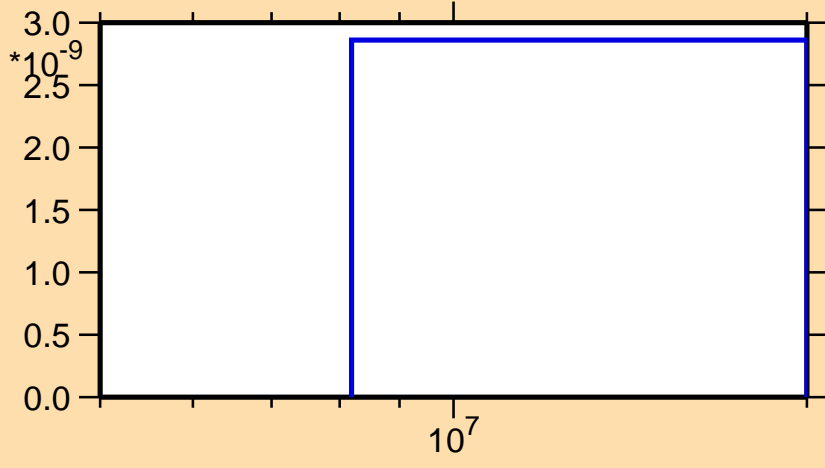



Correlation Matrix



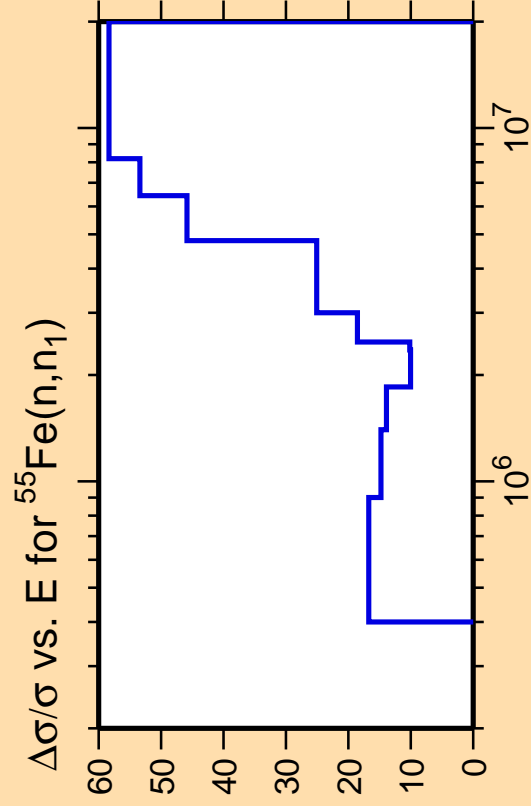


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

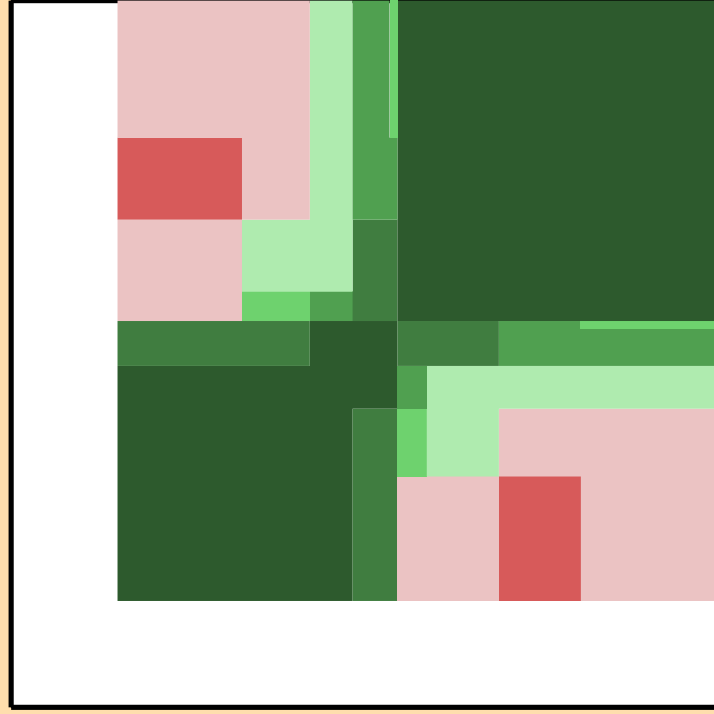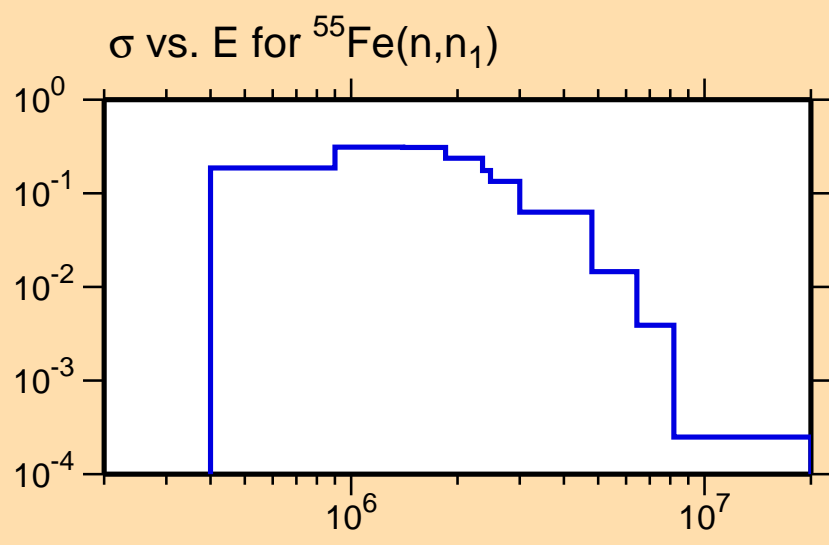



Correlation Matrix



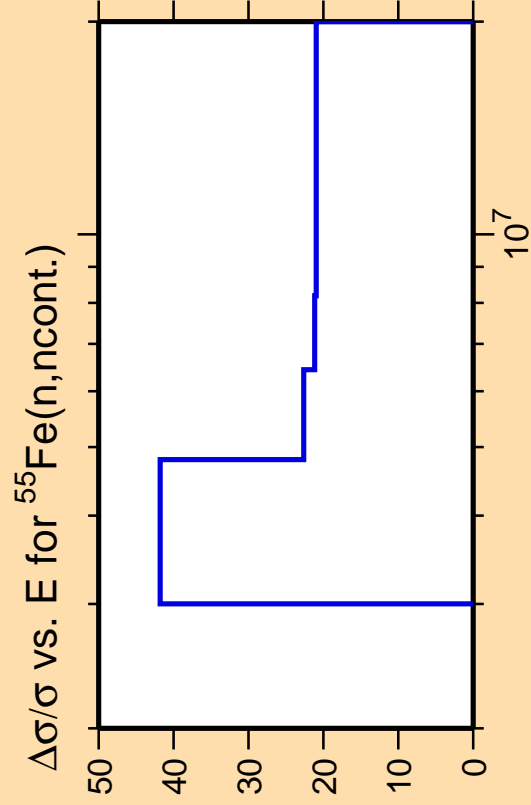


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

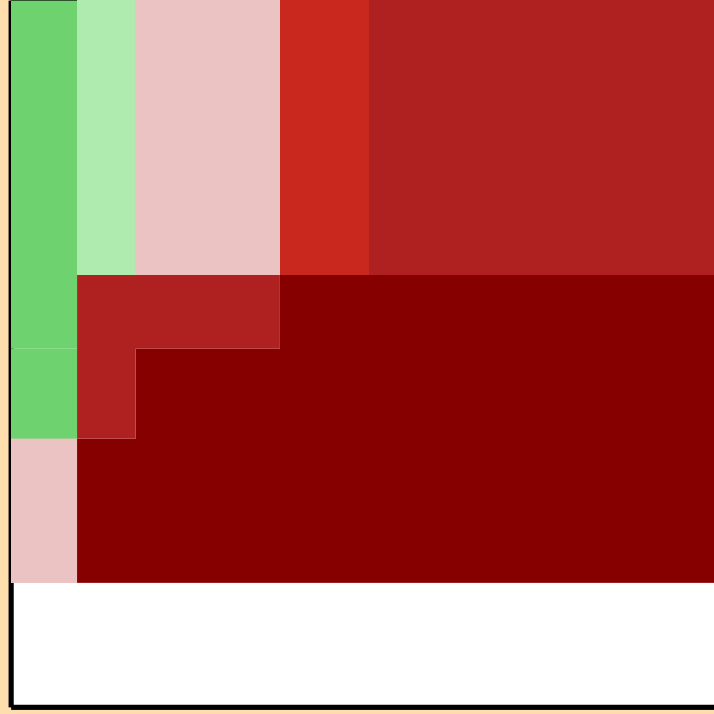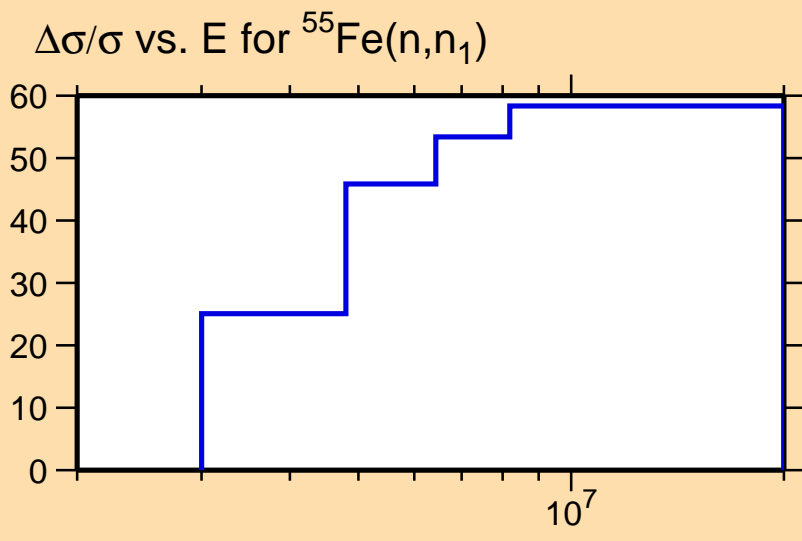

Correlation Matrix





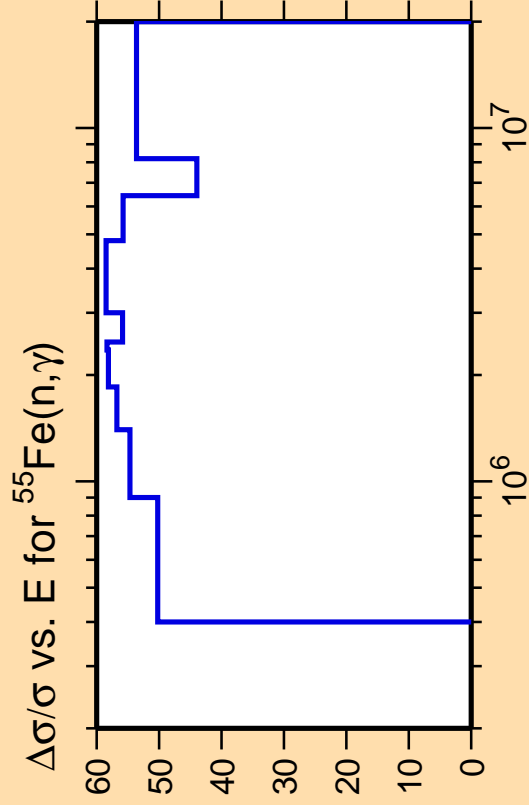

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,n_1)$

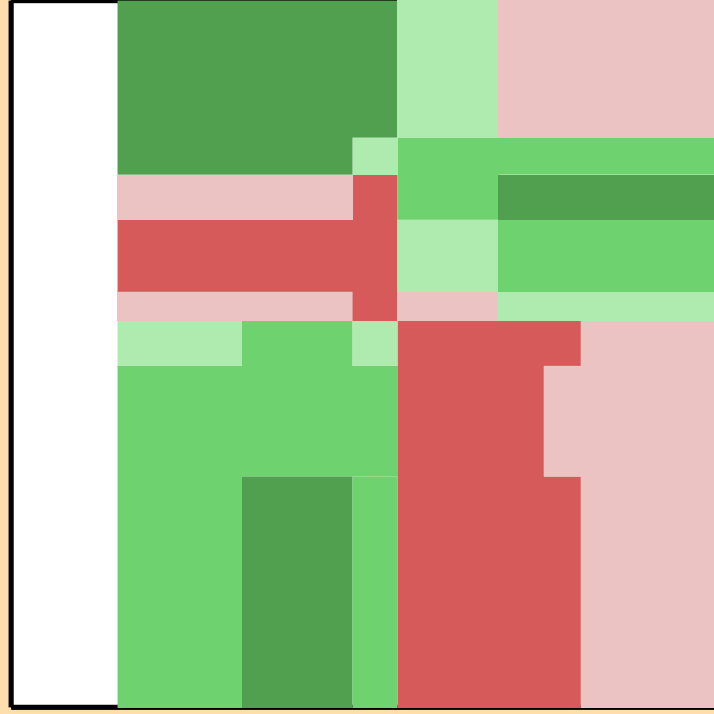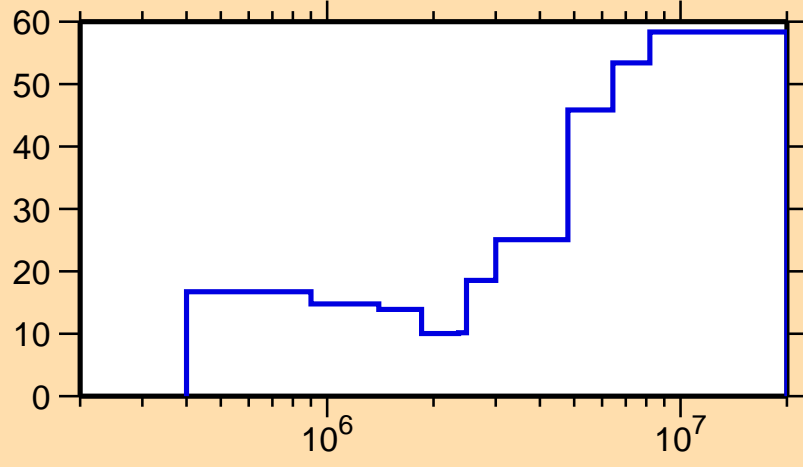

Correlation Matrix




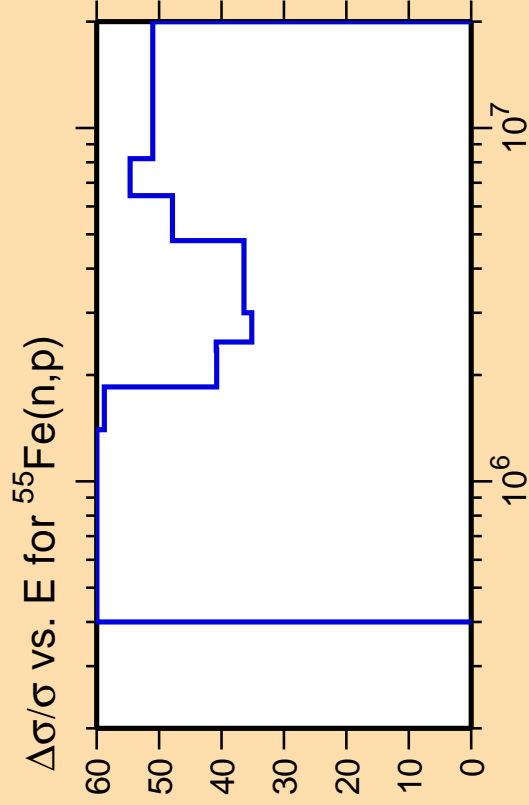


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,n_1)$

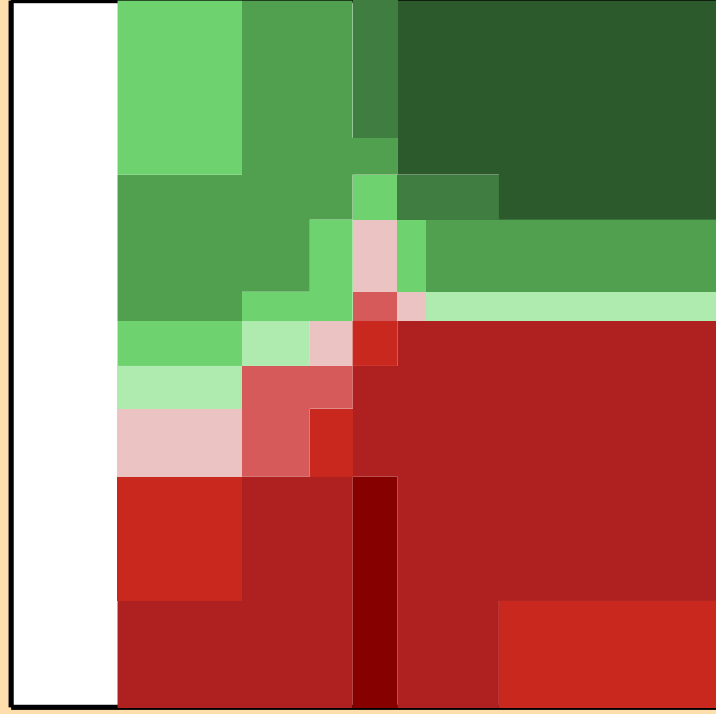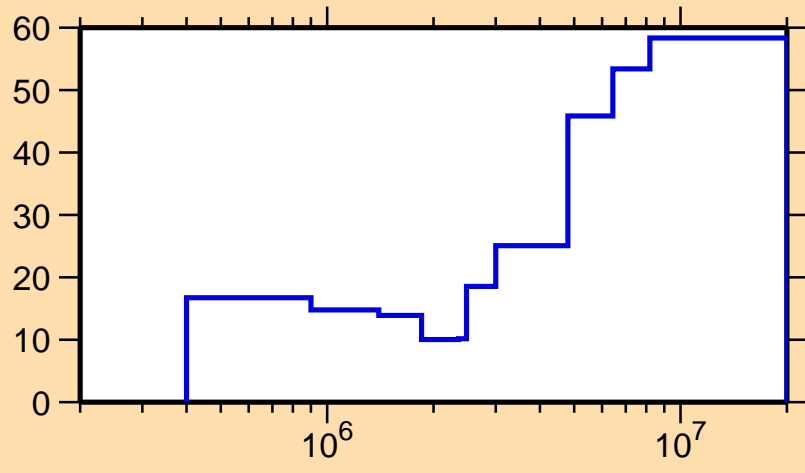

Correlation Matrix




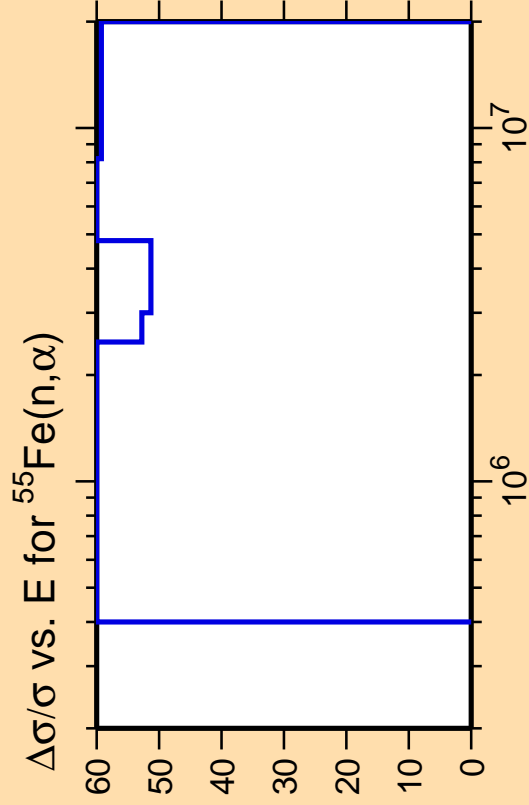


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,n_1)$

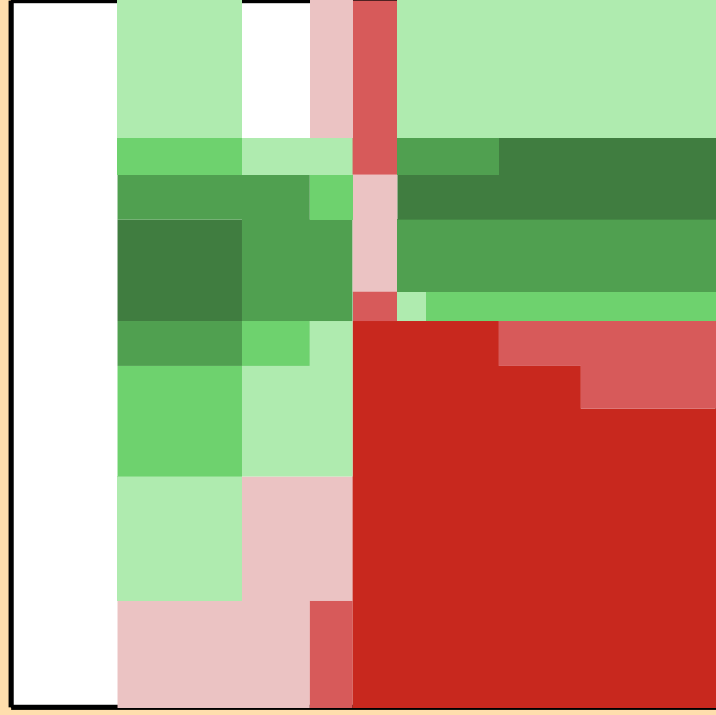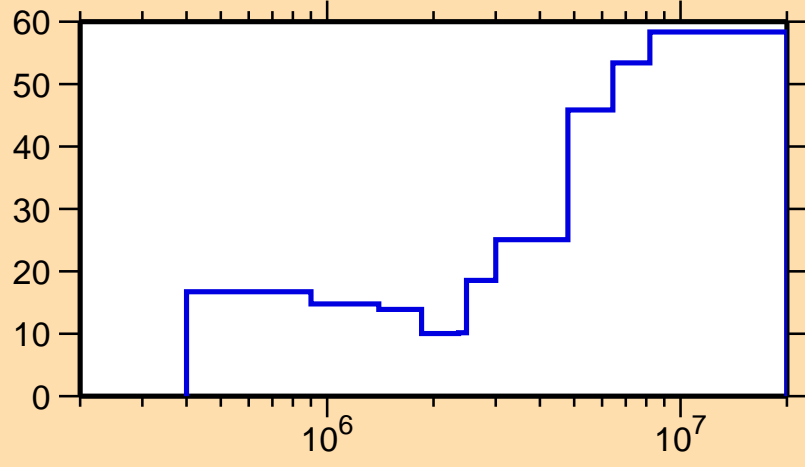



Correlation Matrix



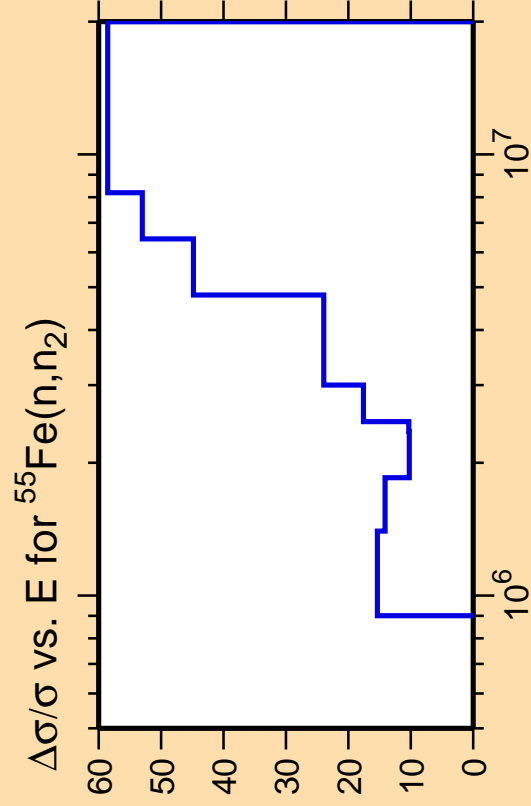


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

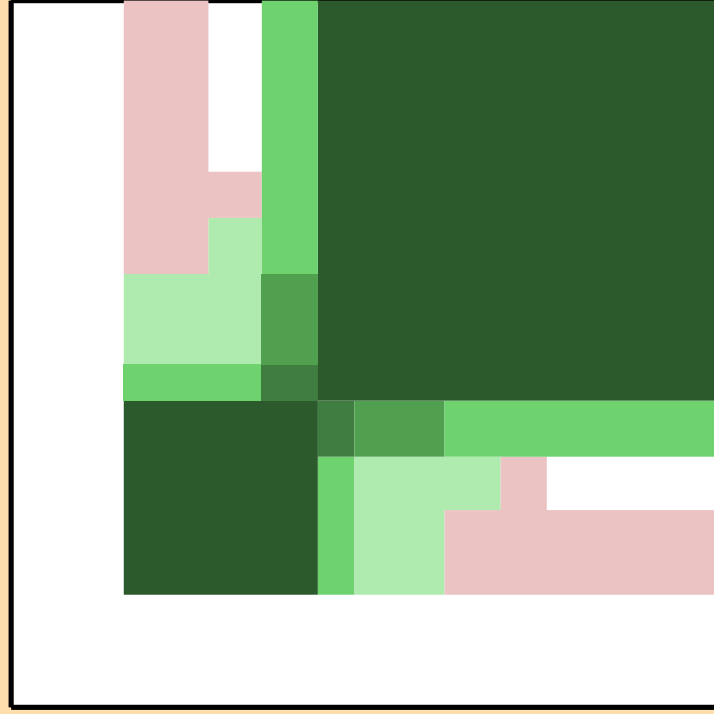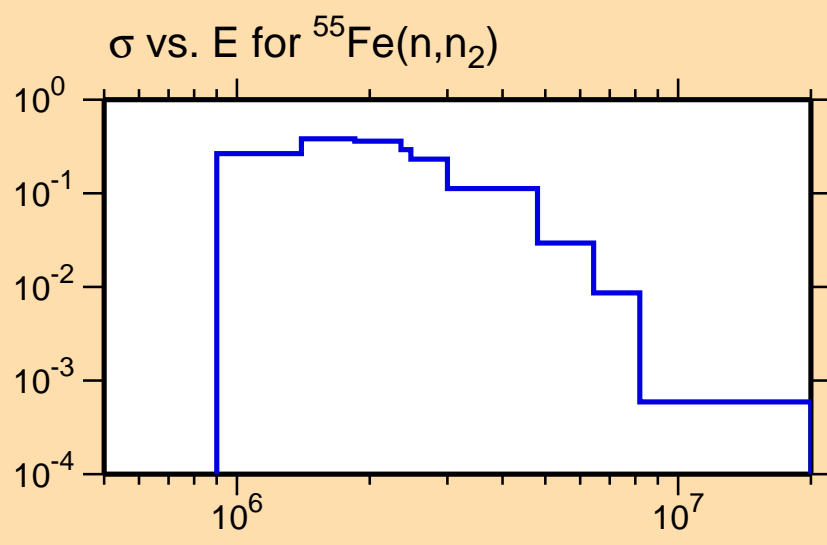



Correlation Matrix



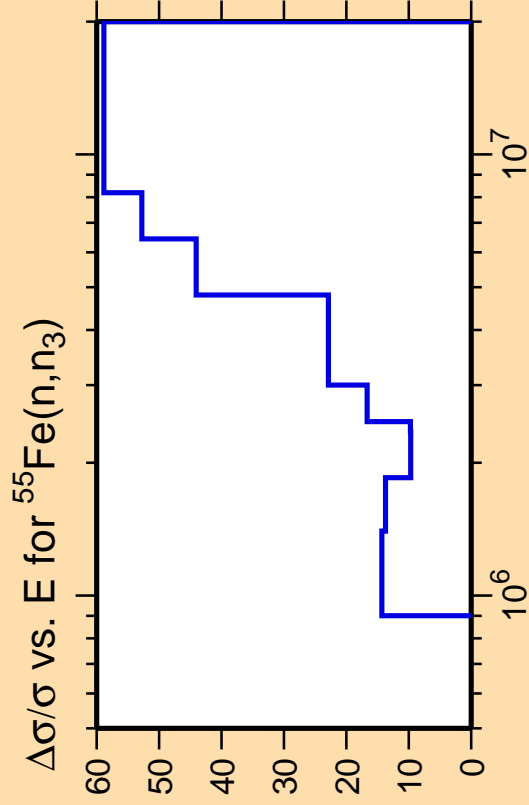


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

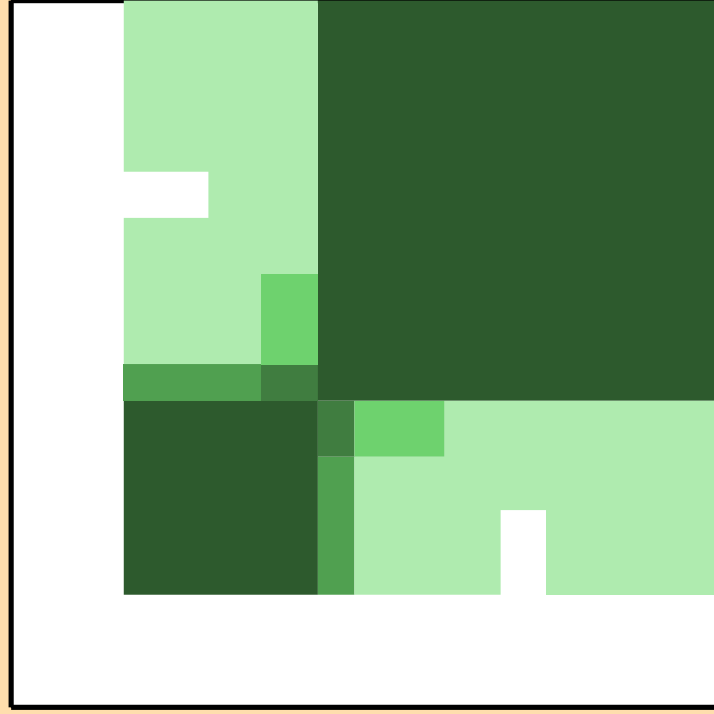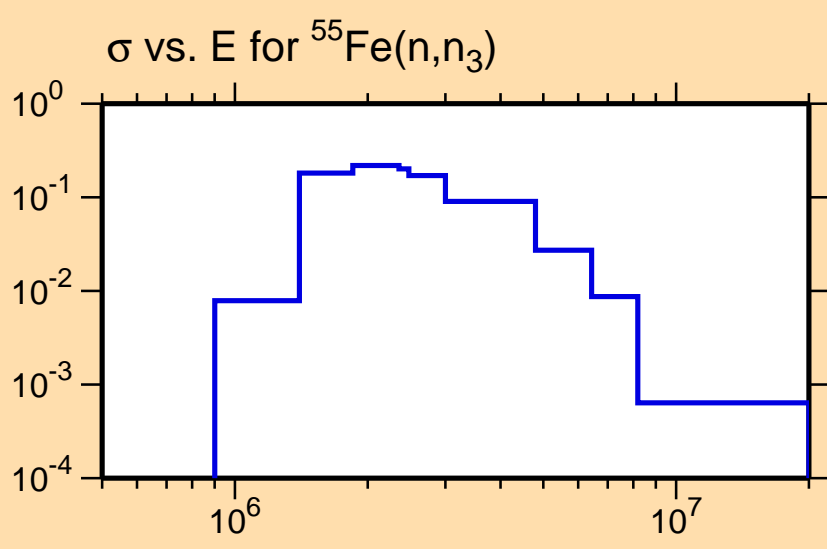



Correlation Matrix



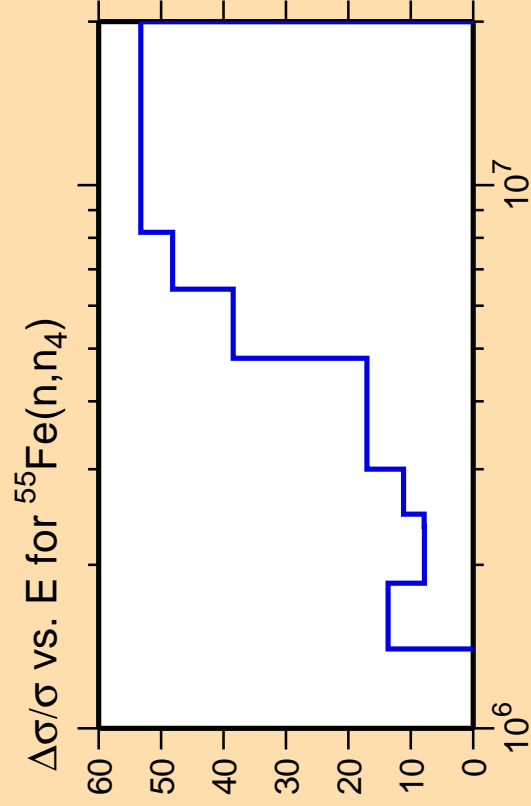

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

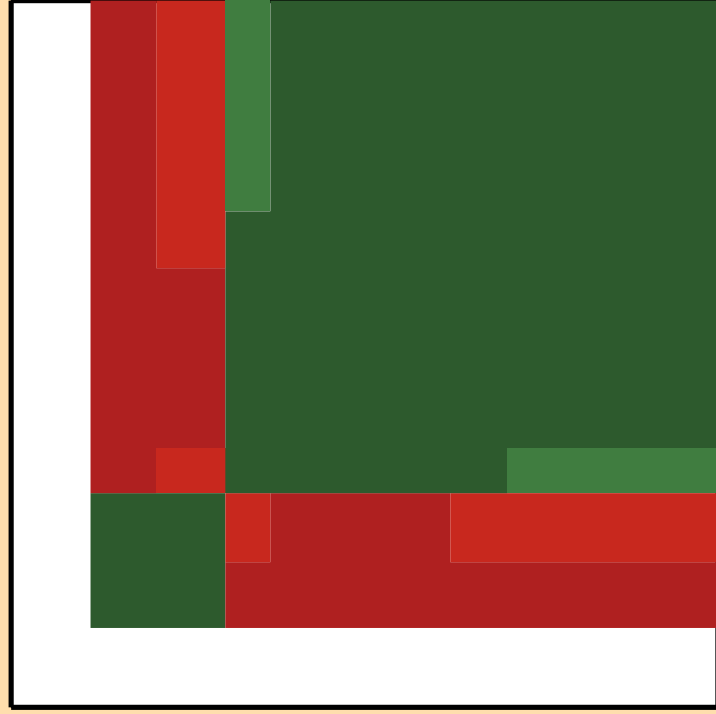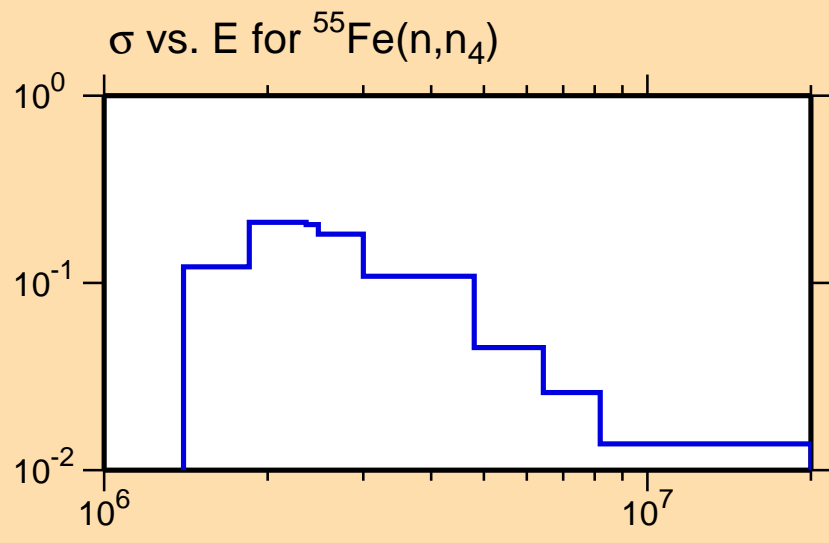

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,n\text{cont.})$

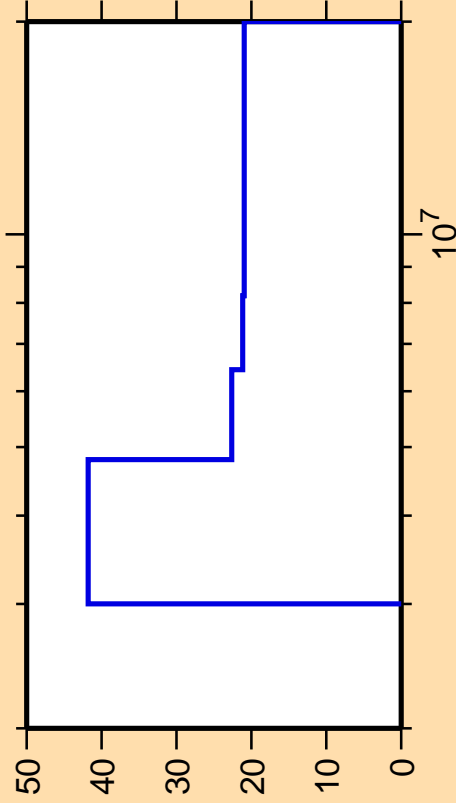

Ordinate scales are % relative standard deviation and barns.




Abscissa scales are energy (eV).





σ vs. E for $^{55}\text{Fe}(n,n\text{cont.})$

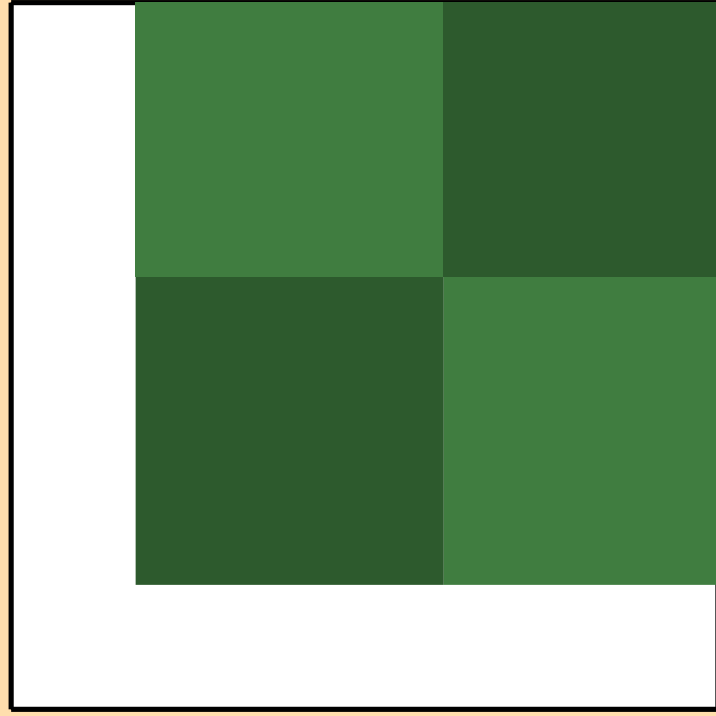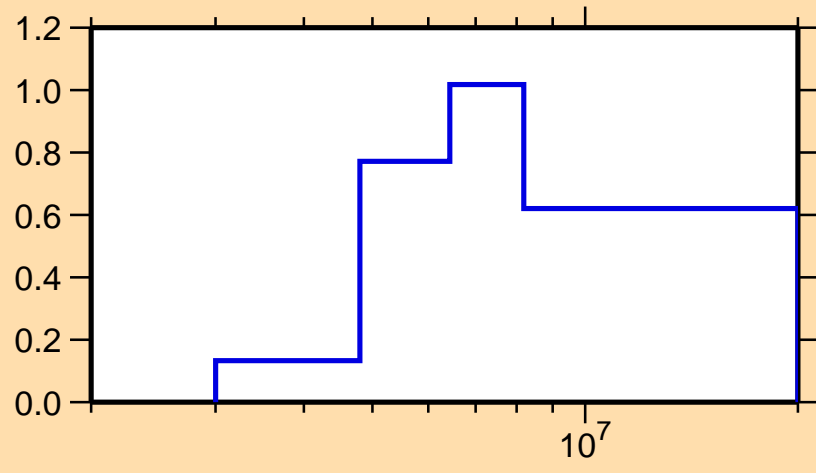


Correlation Matrix



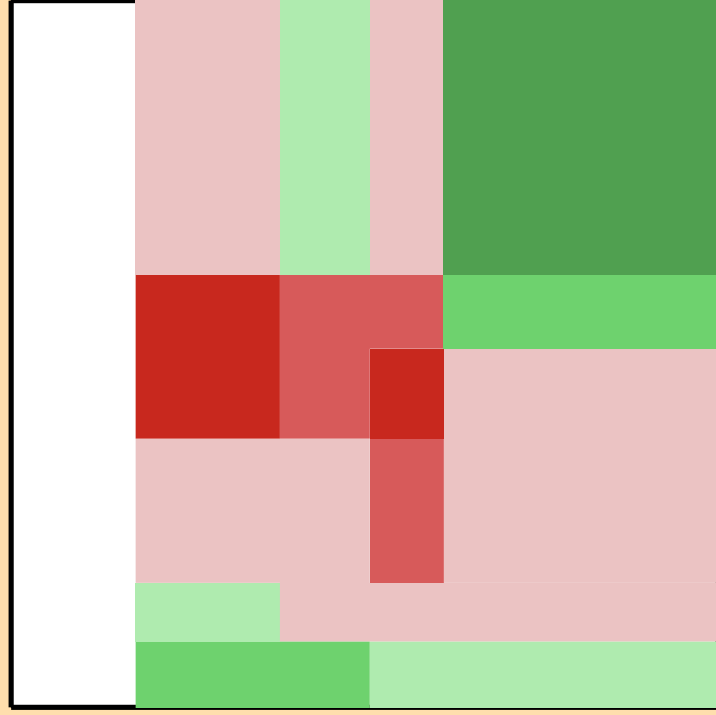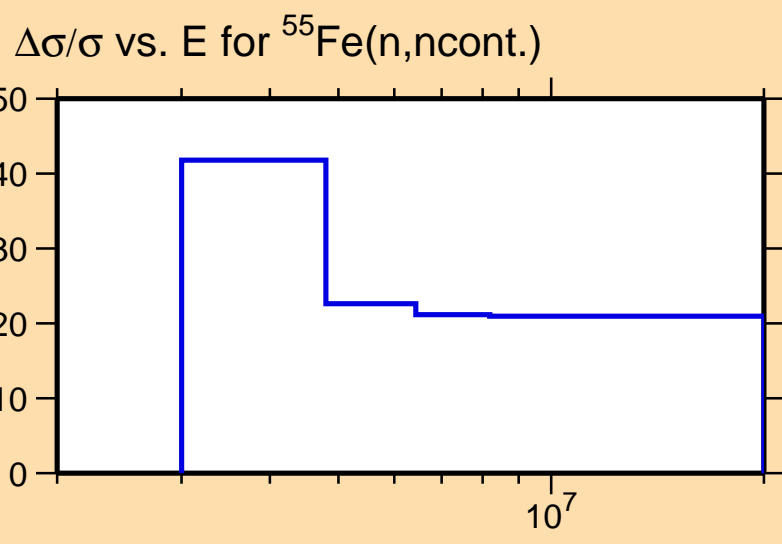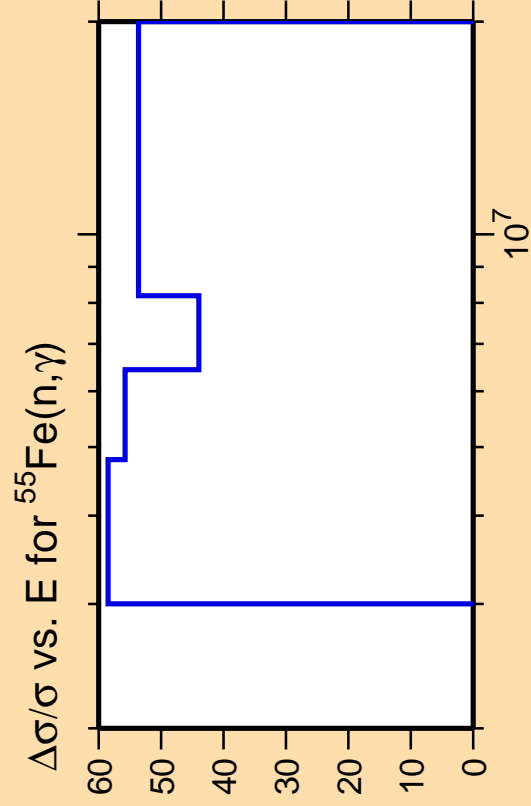

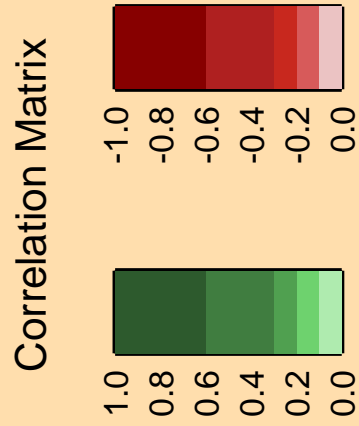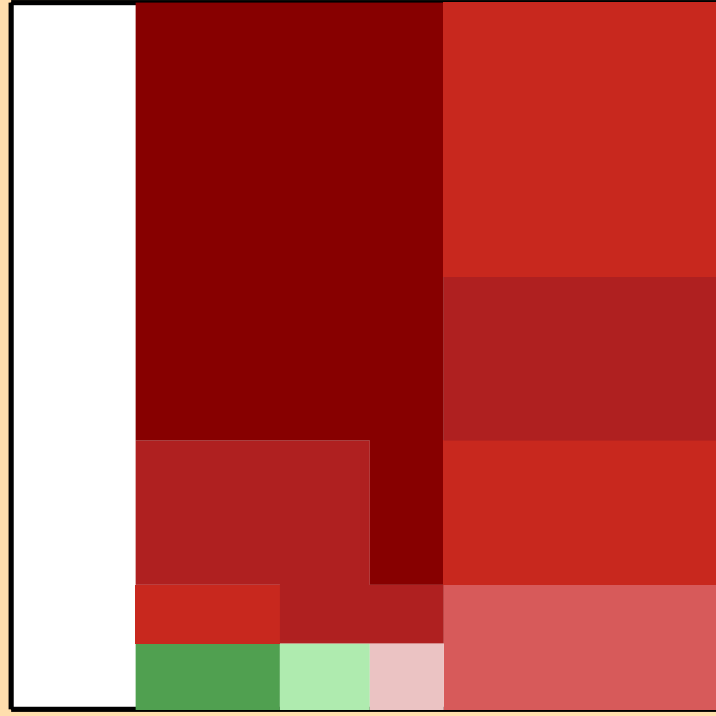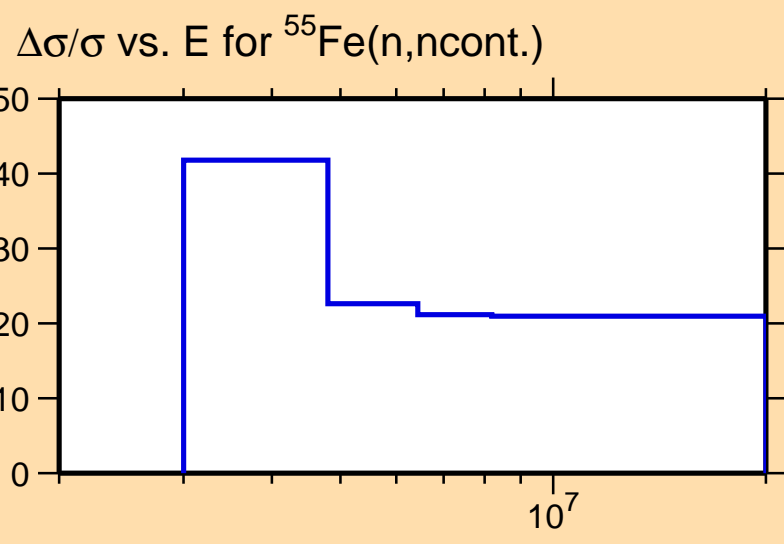
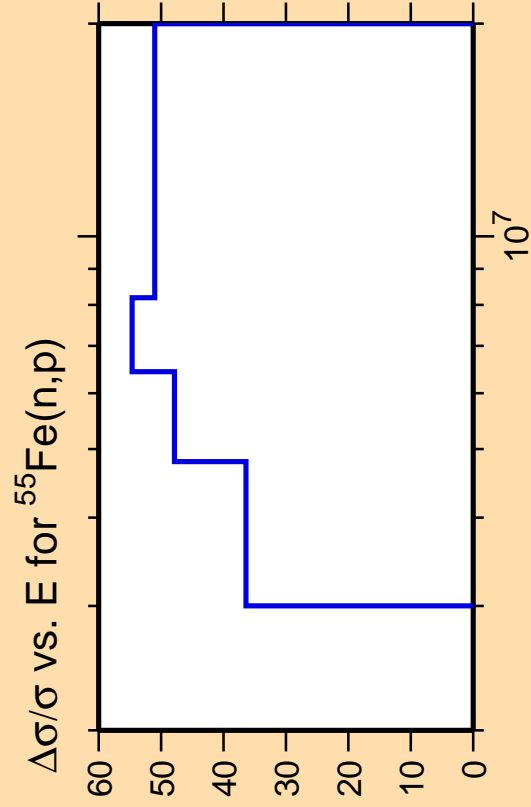


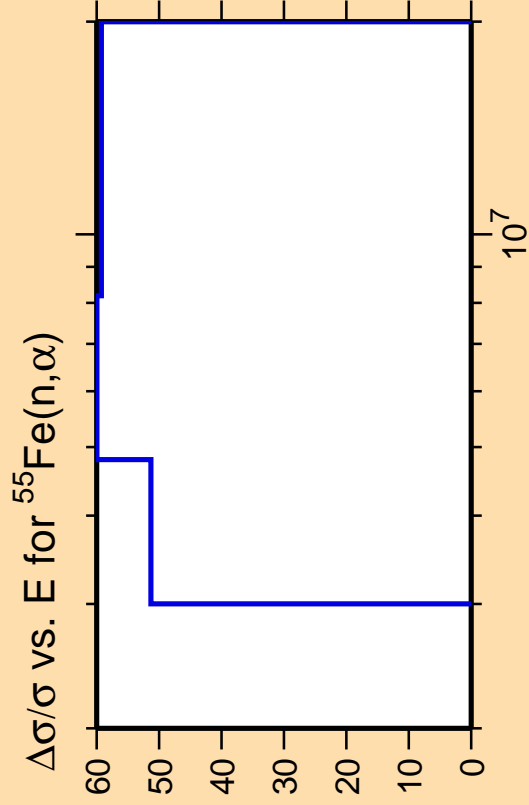

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

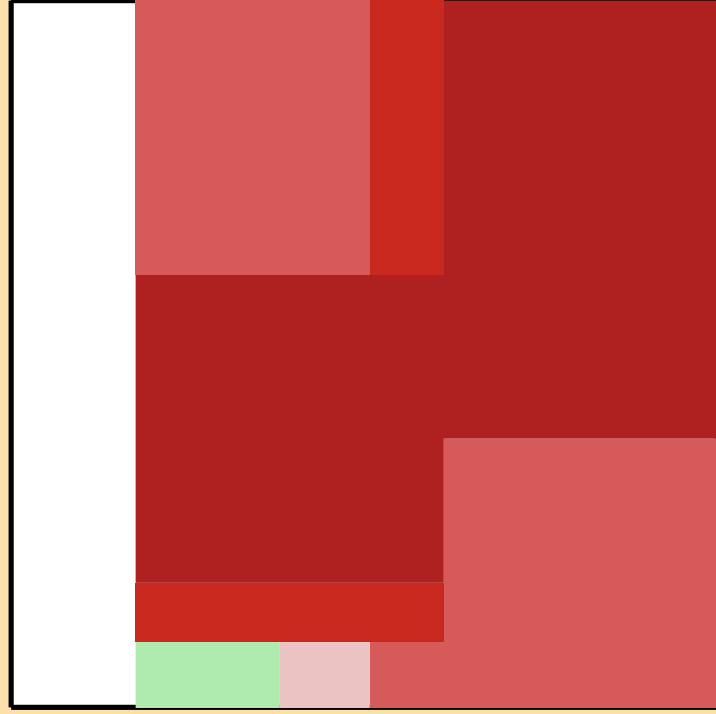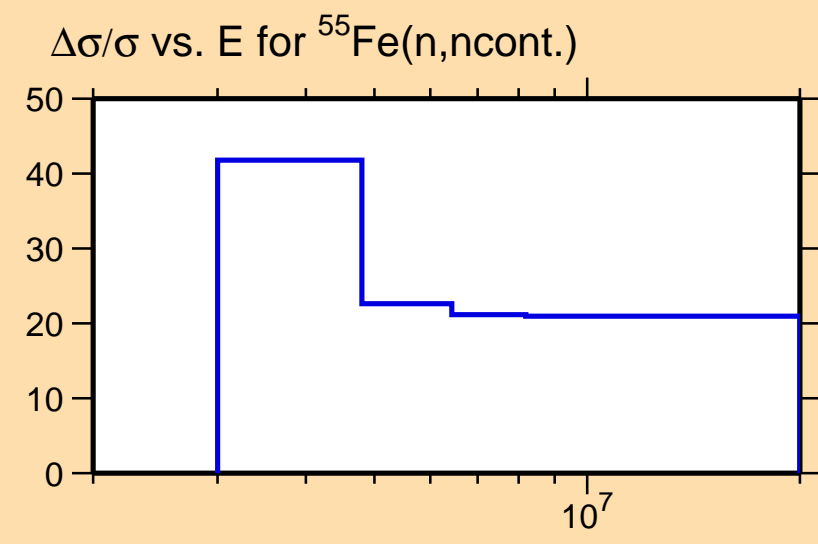

Correlation Matrix





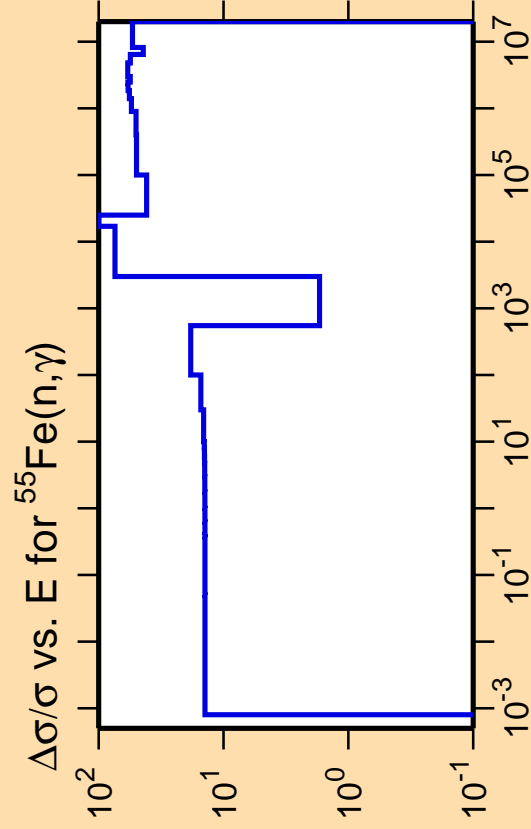

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

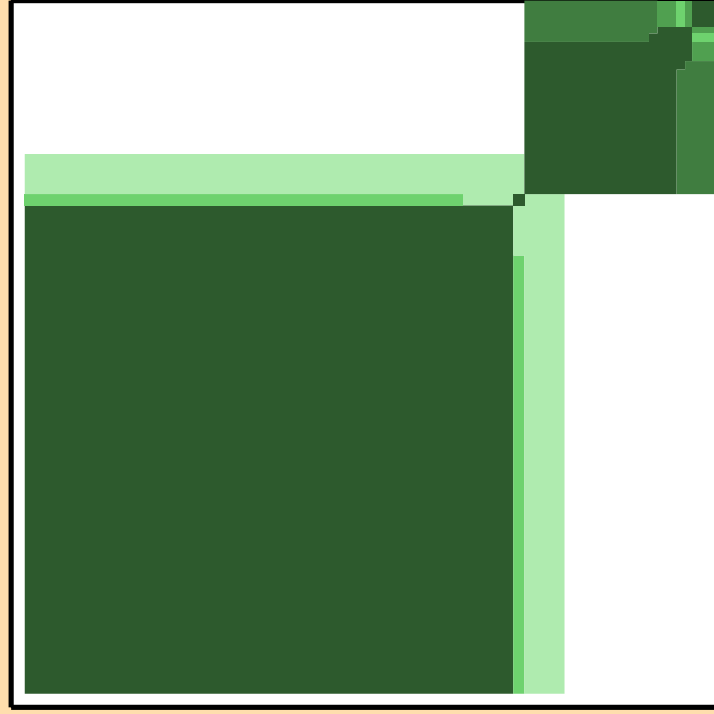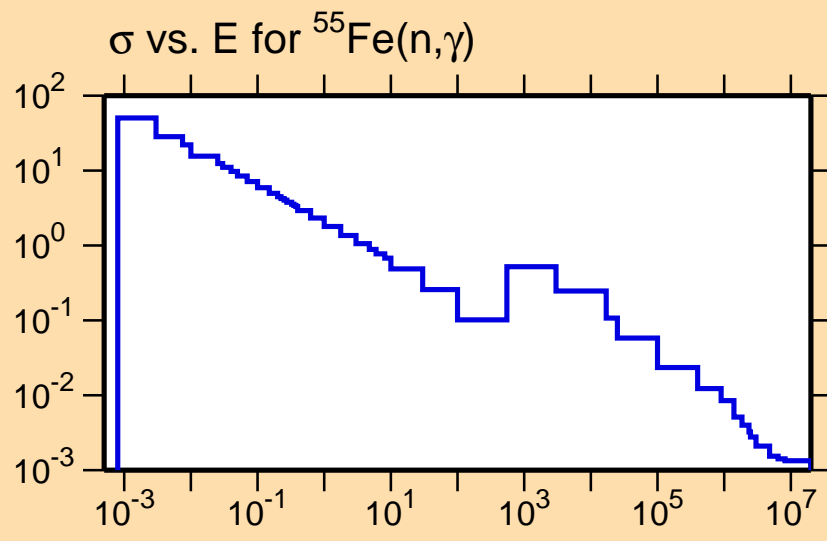

Correlation Matrix





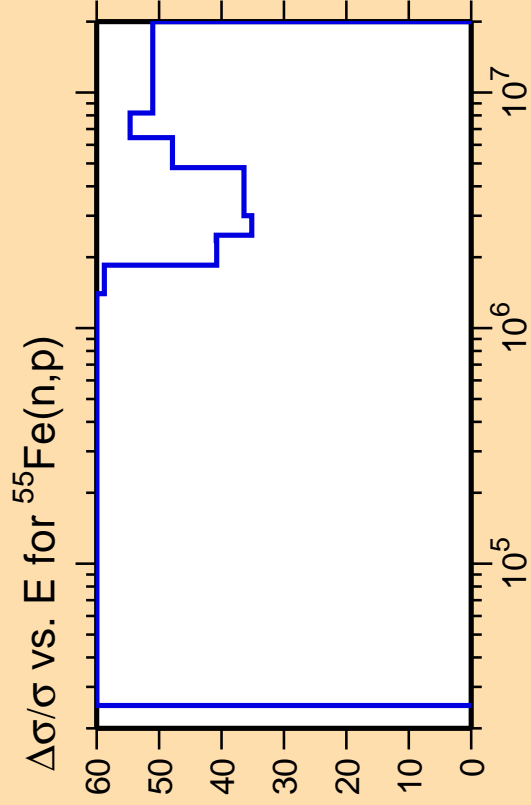

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

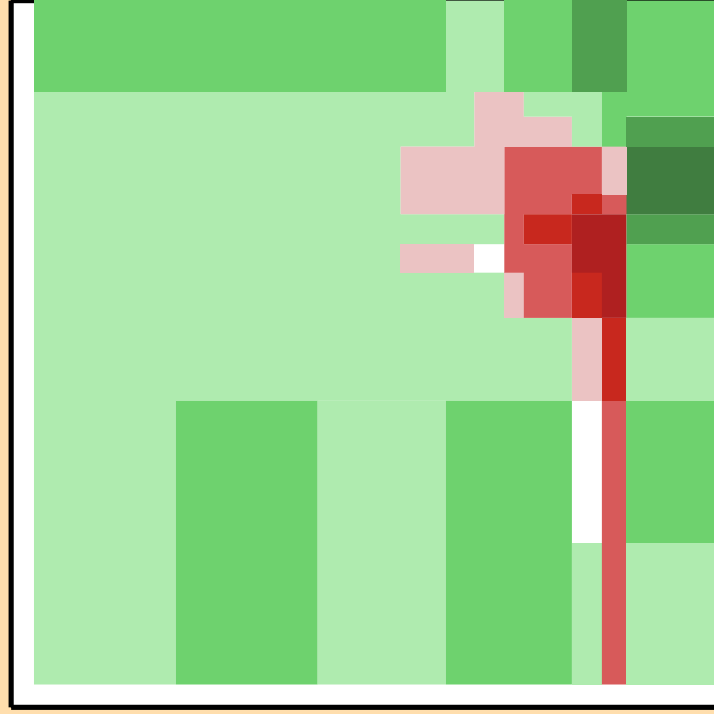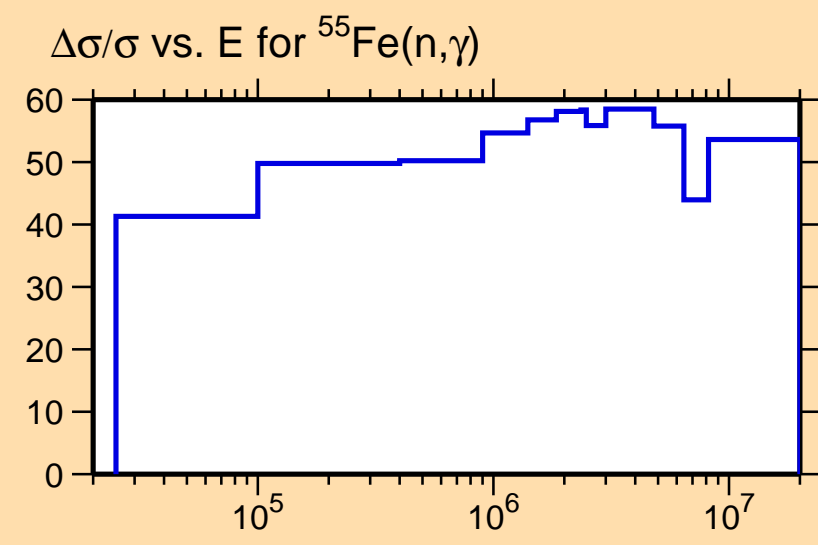

Correlation Matrix





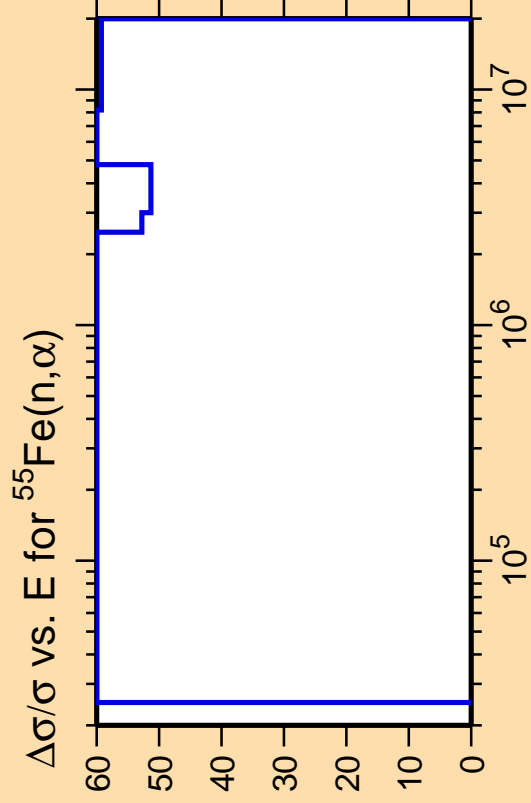

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

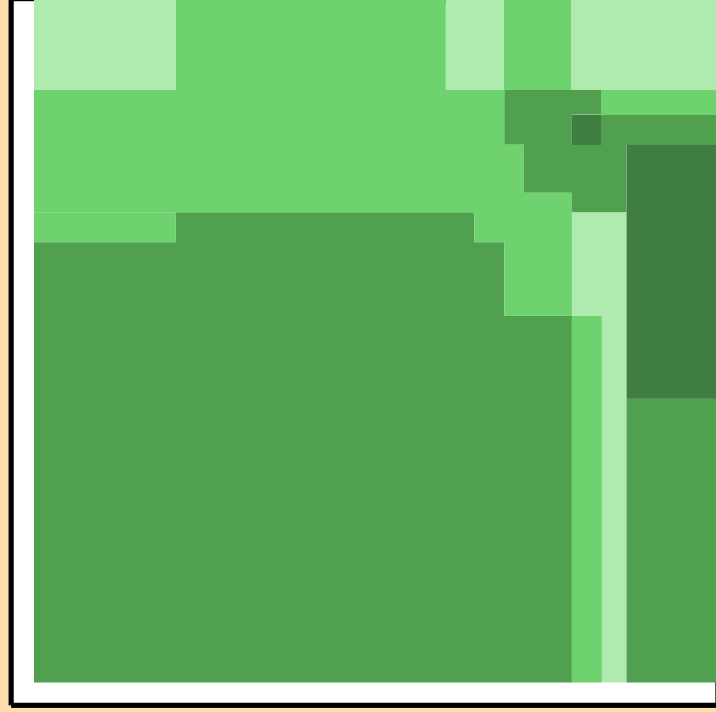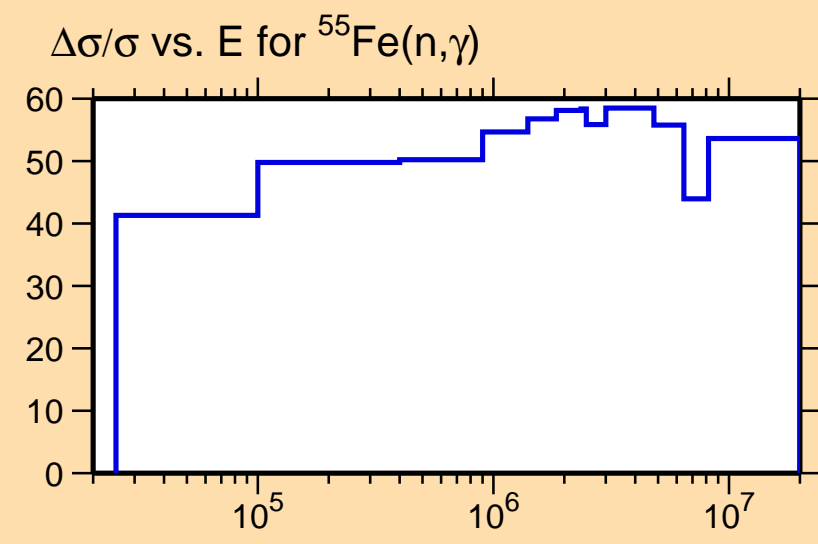

Correlation Matrix





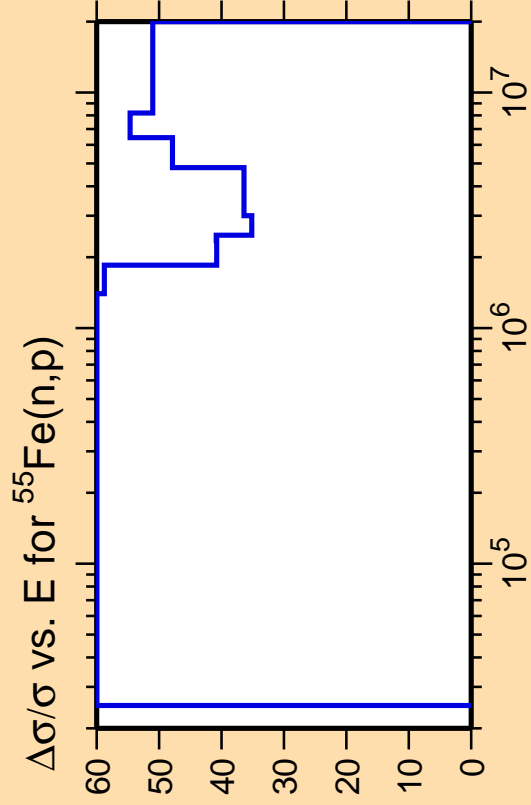

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

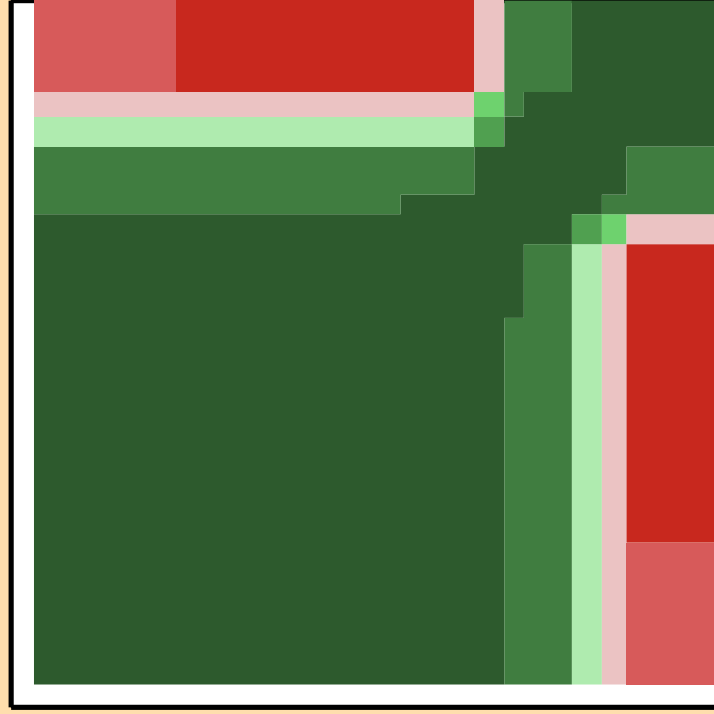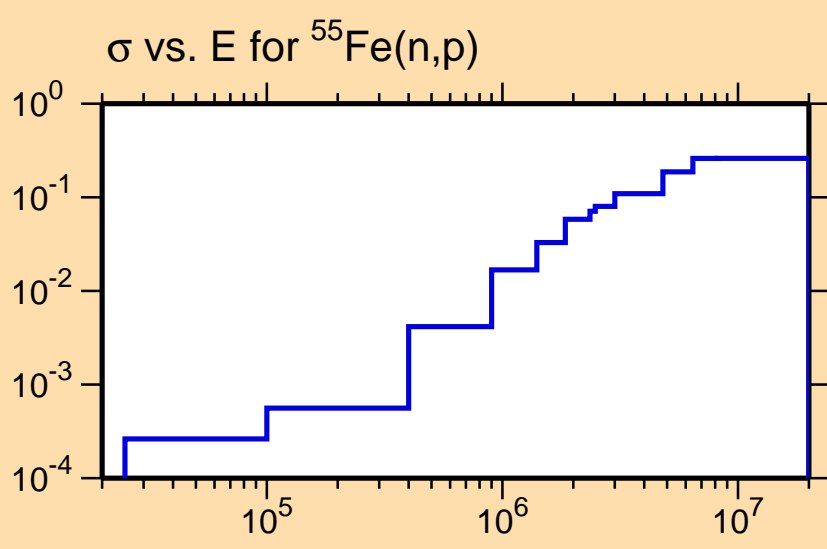

Correlation Matrix





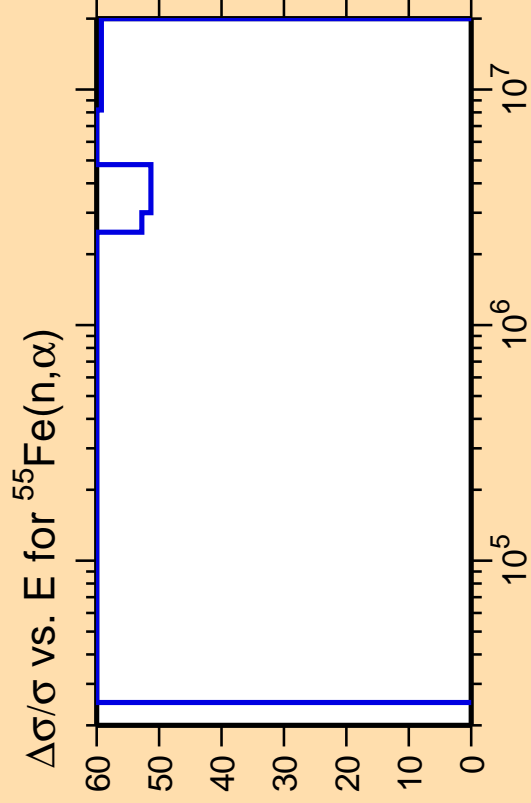

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

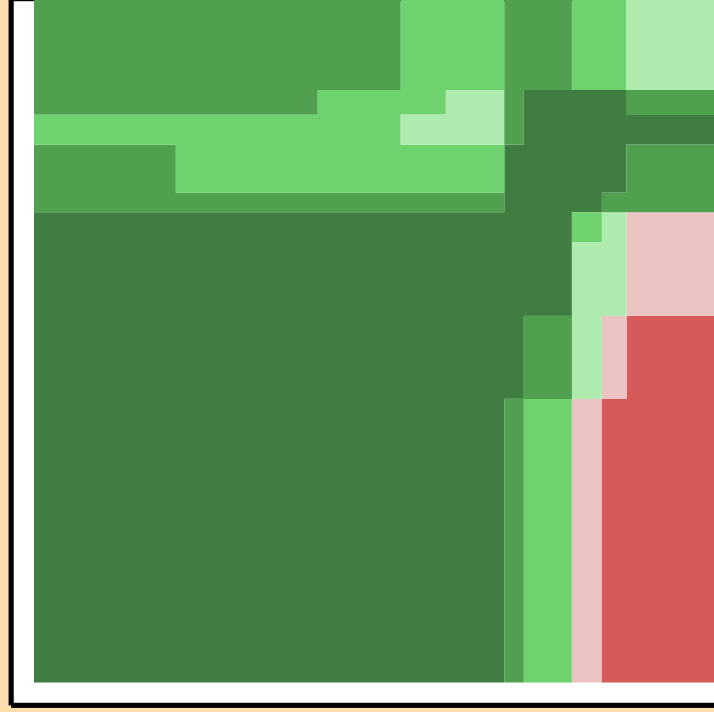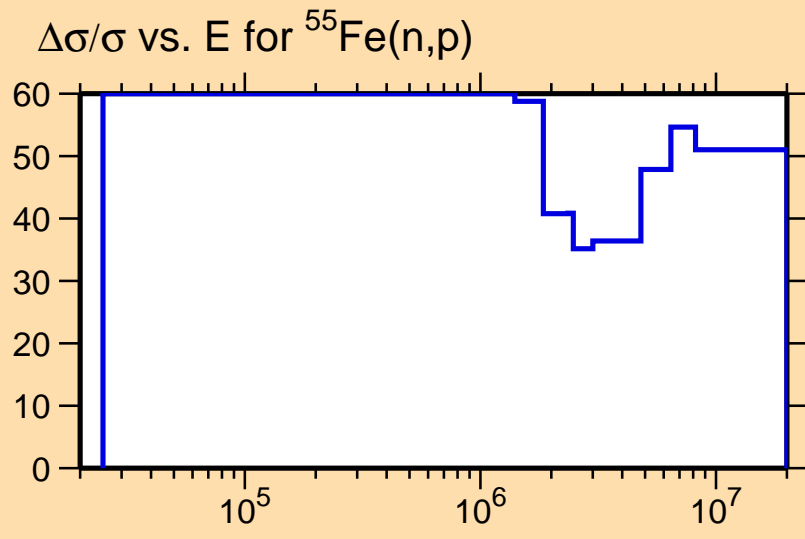

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,d)$

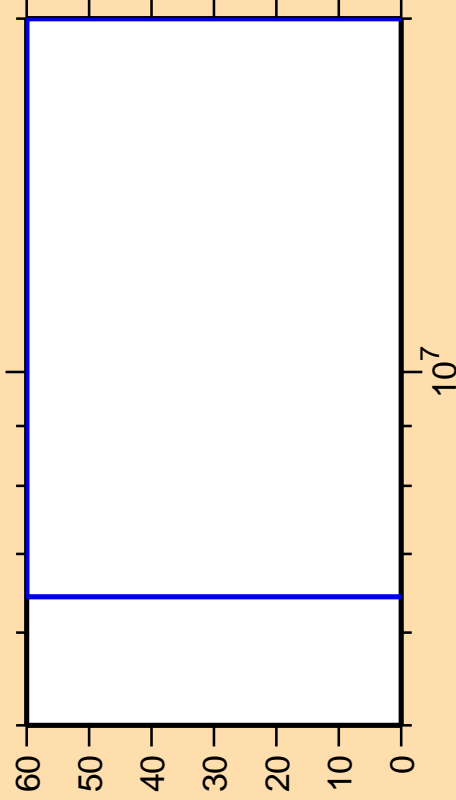

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

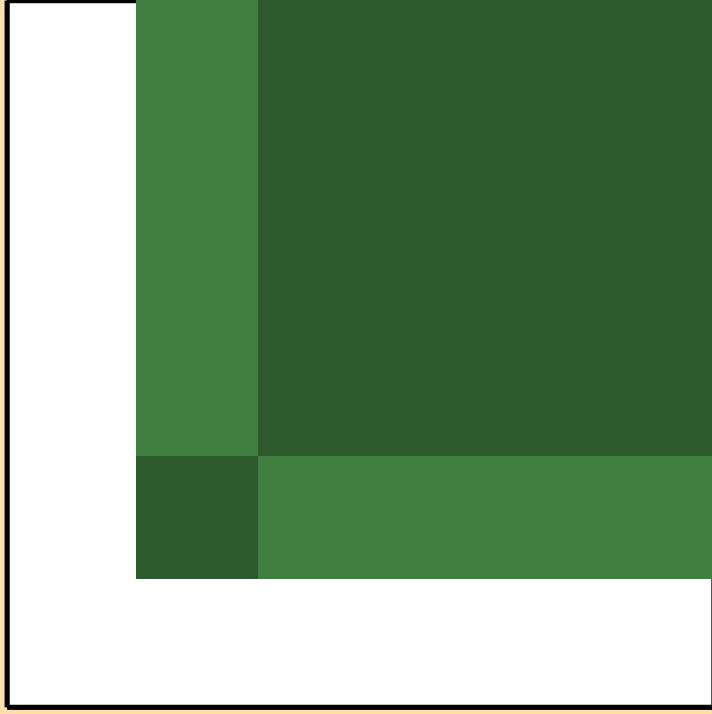

Correlation Matrix



σ vs. E for $^{55}\text{Fe}(n,d)$

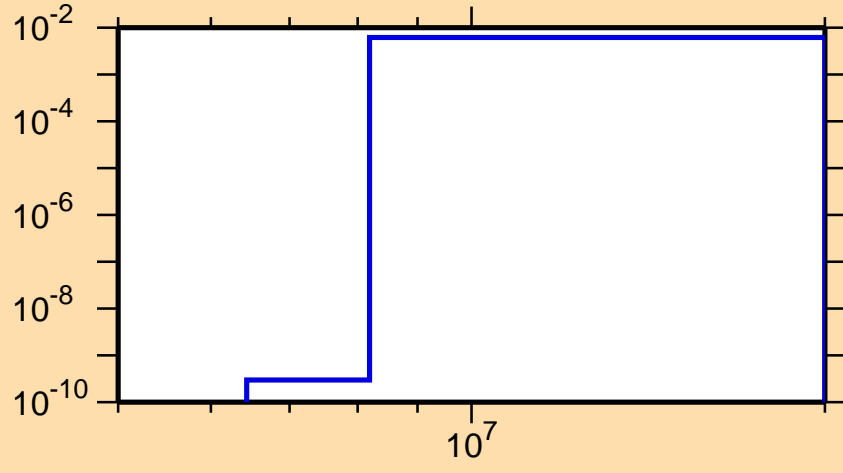

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,t)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{55}\text{Fe}(n,t)$

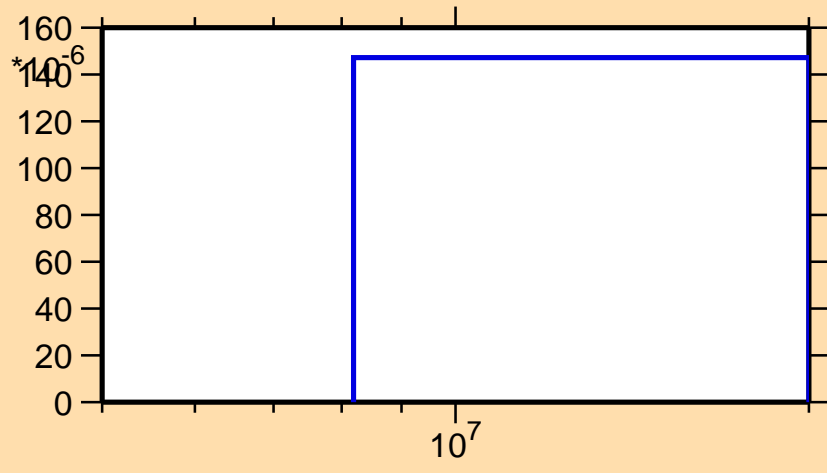

$\times 10^{-6}$


10^7



Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{He}3)$

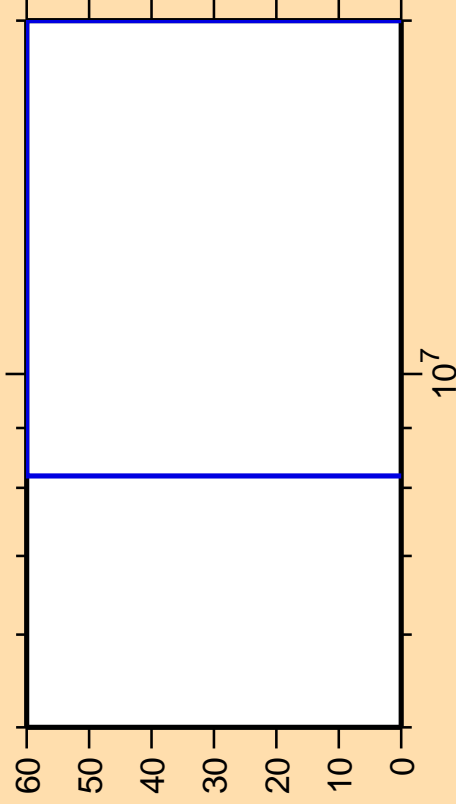


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{55}\text{Fe}(n,\text{He}3)$

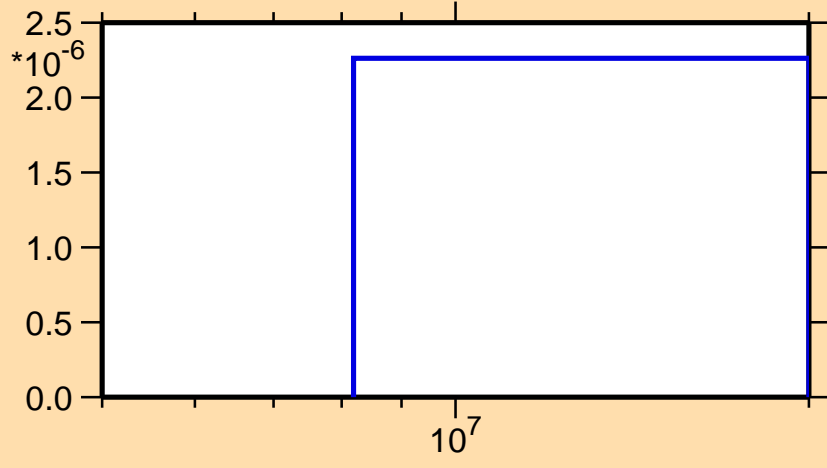

Correlation Matrix





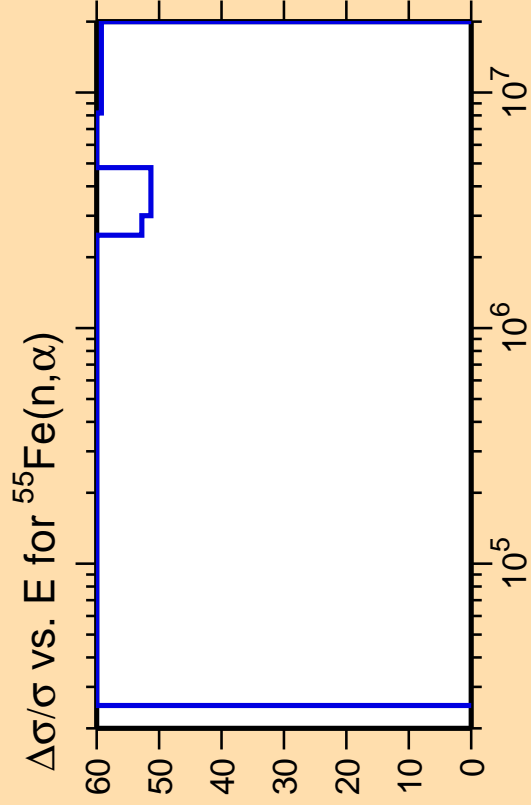

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

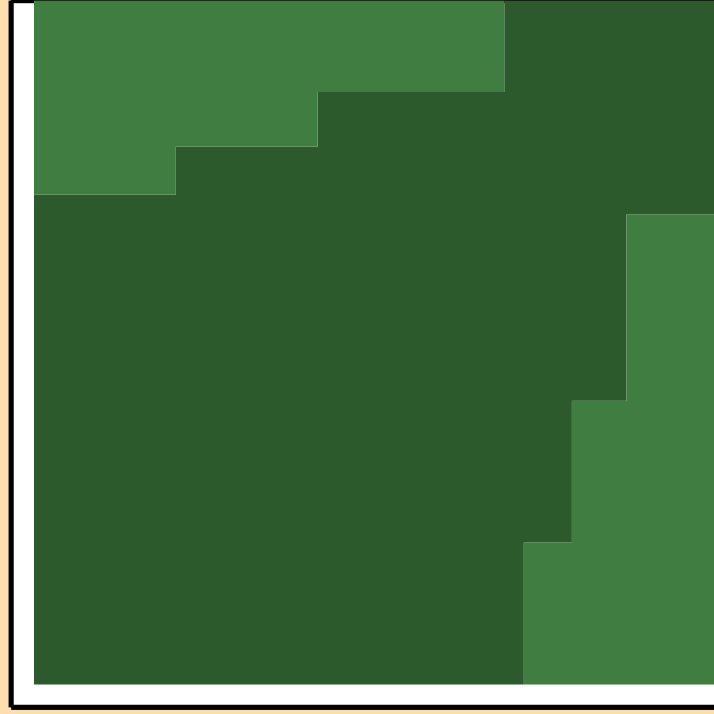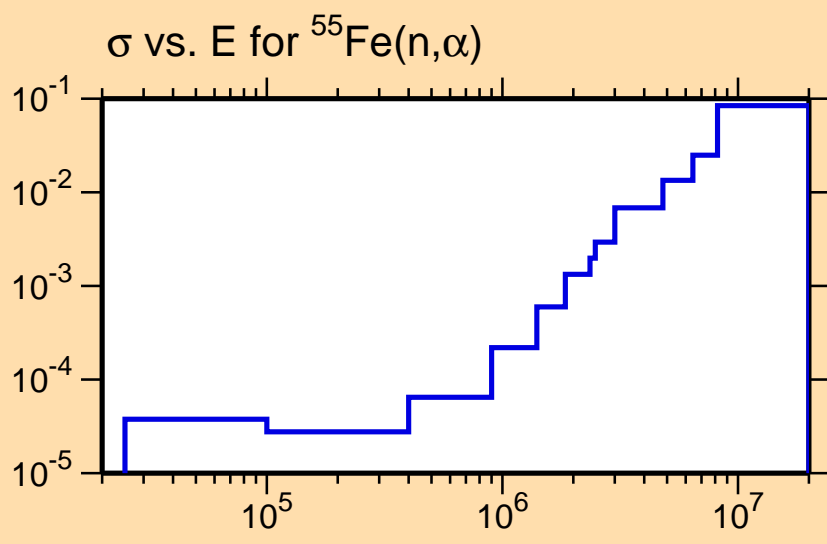

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,p\alpha)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{55}\text{Fe}(n,p\alpha)$

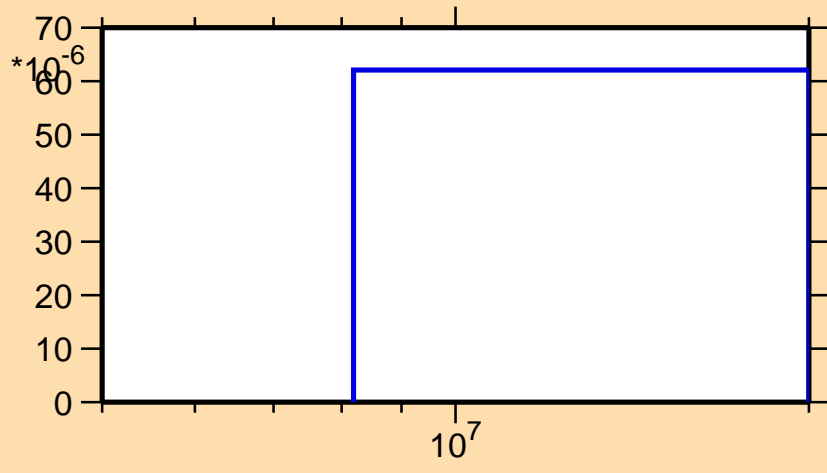


*10⁻⁶

10⁷

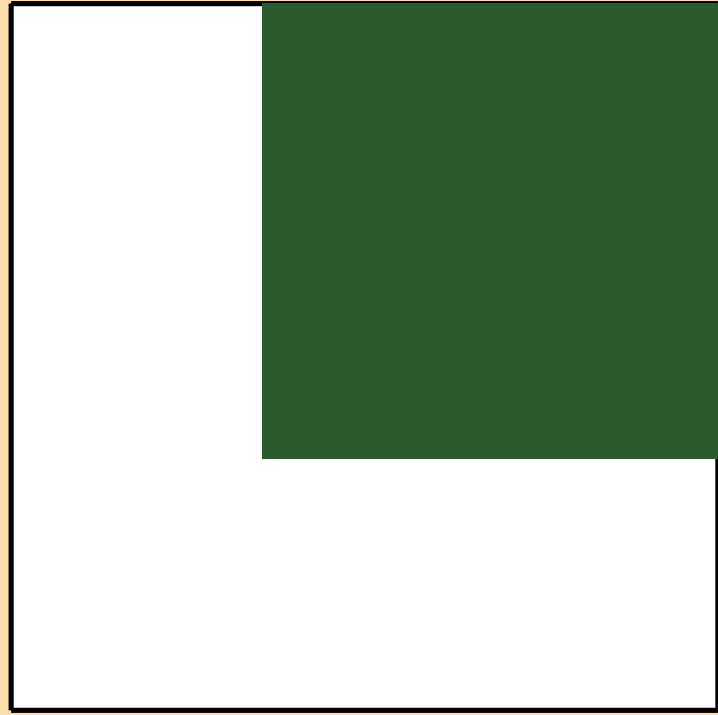

Correlation Matrix

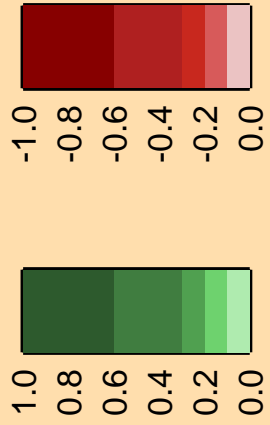

$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{pd})$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{55}\text{Fe}(n,\text{pd})$

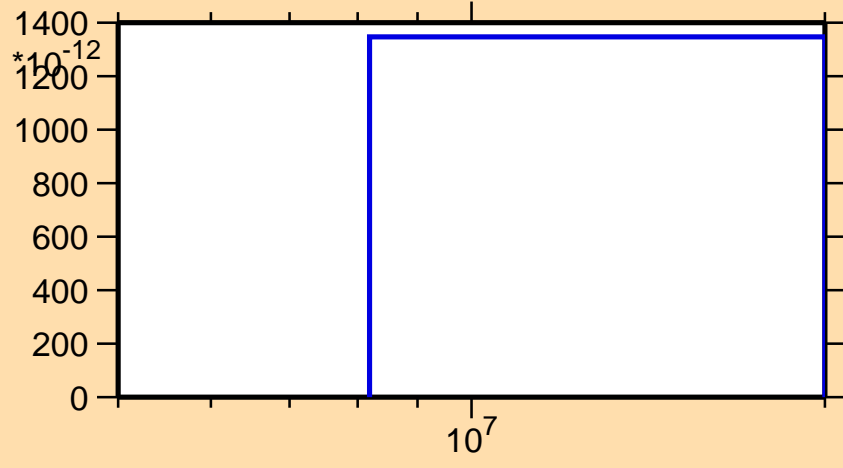

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{55}\text{Fe}(n,\text{pt})$

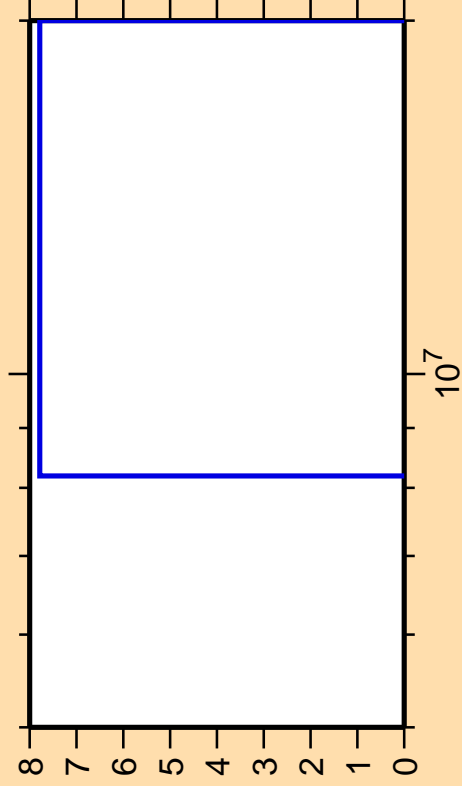

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{55}\text{Fe}(n,\text{pt})$

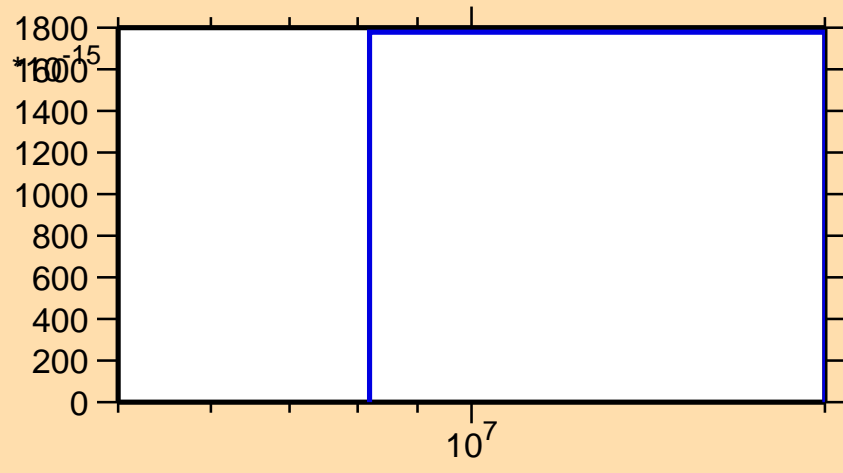

1800
1600
1400
1200
1000
800
600
400
200
0

10^7



Correlation Matrix

