



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).





Correlation Matrix

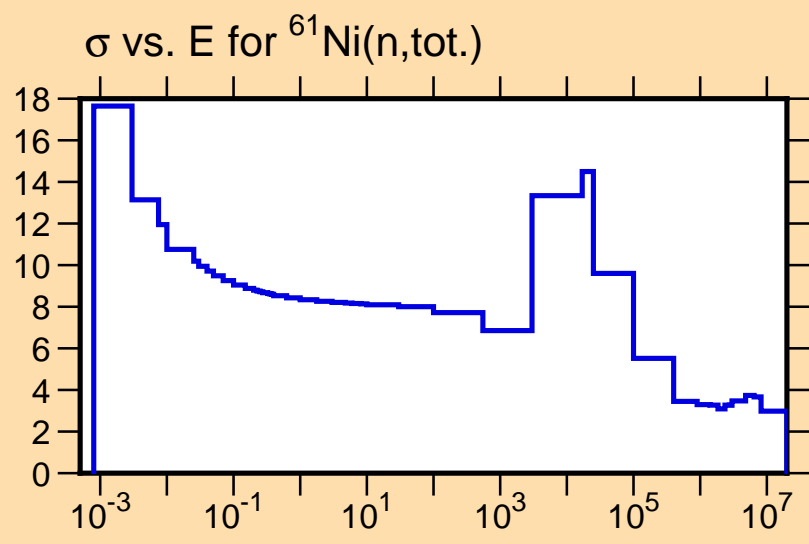

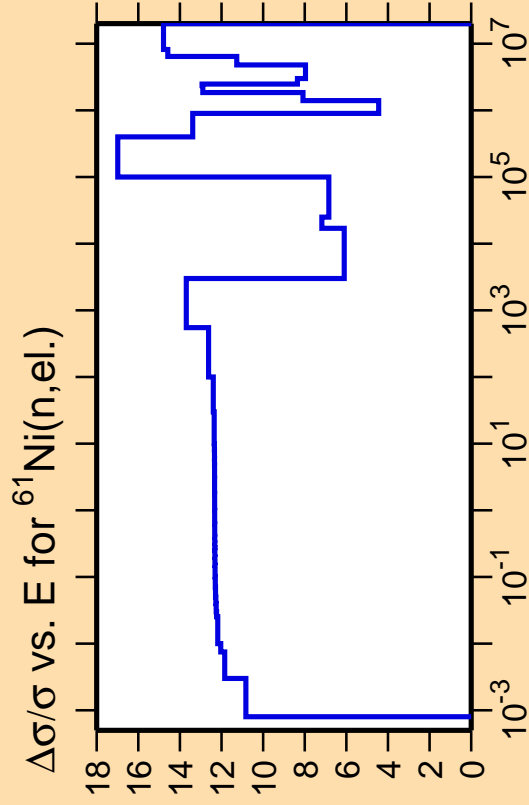

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

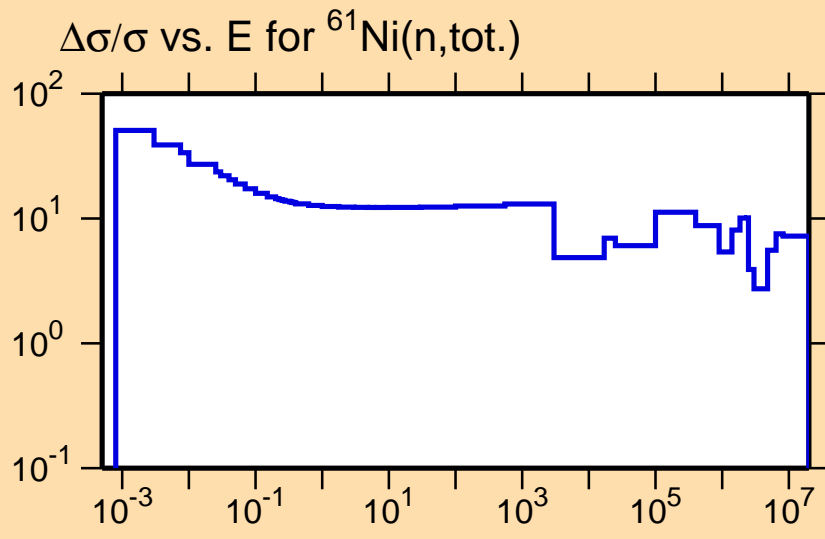

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

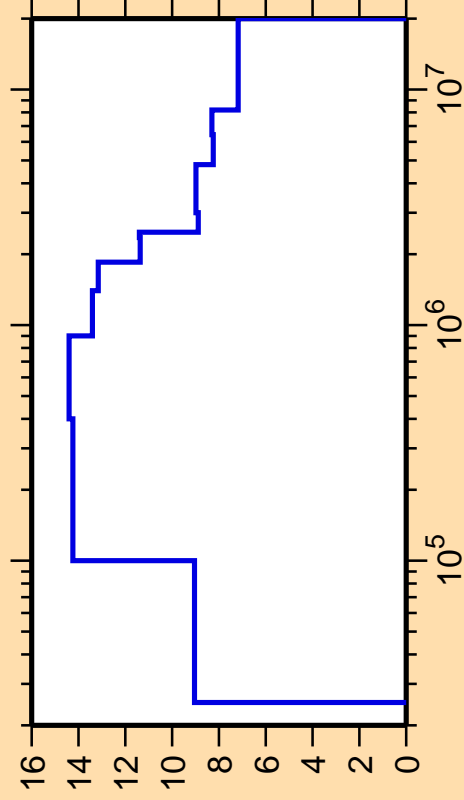

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{tot.})$

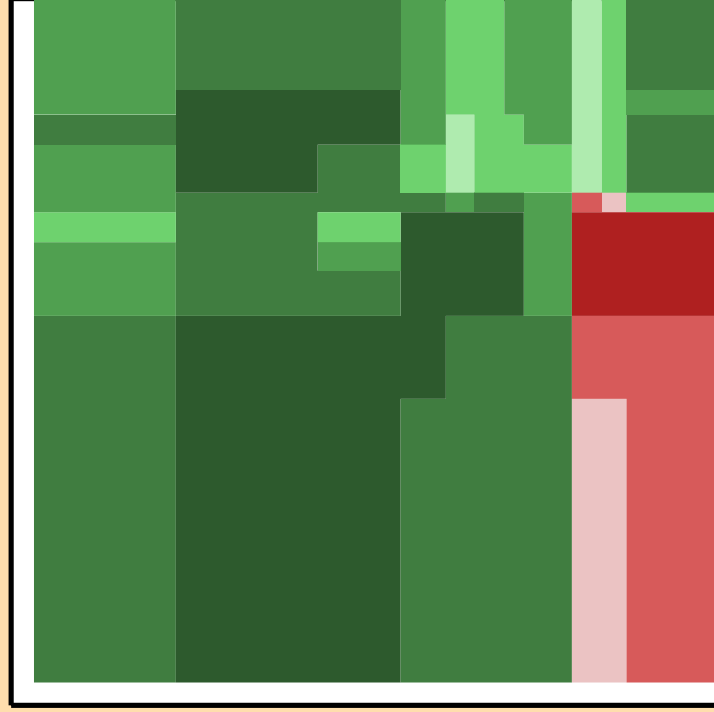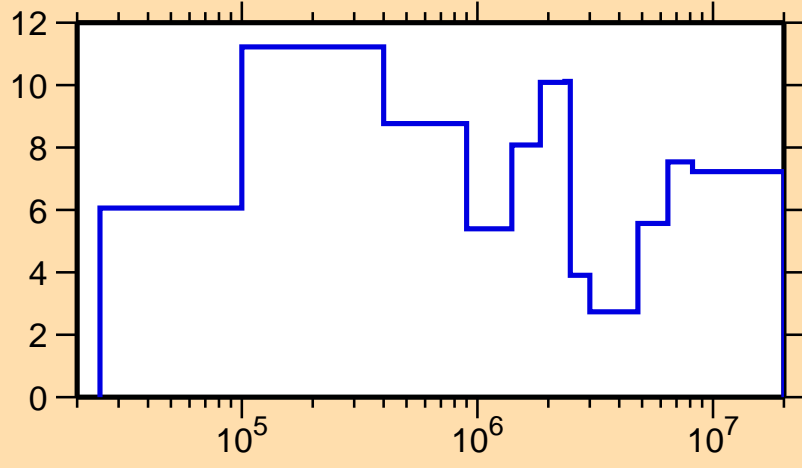

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

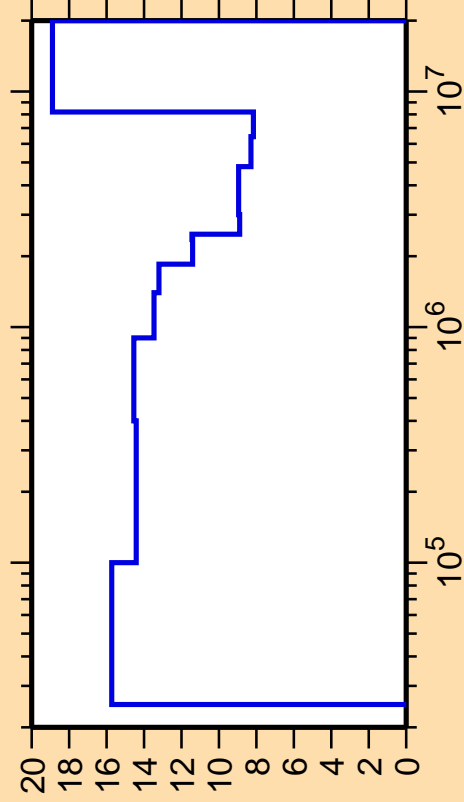

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{tot.})$

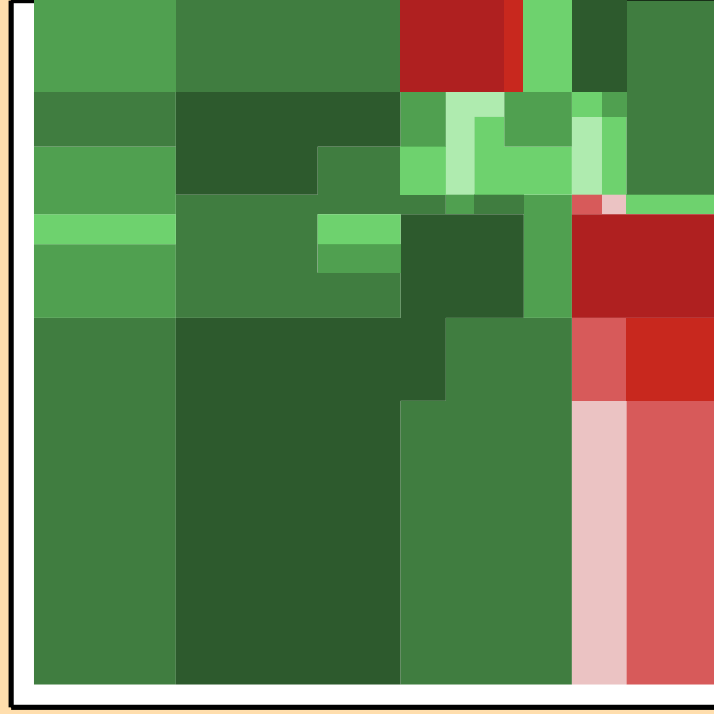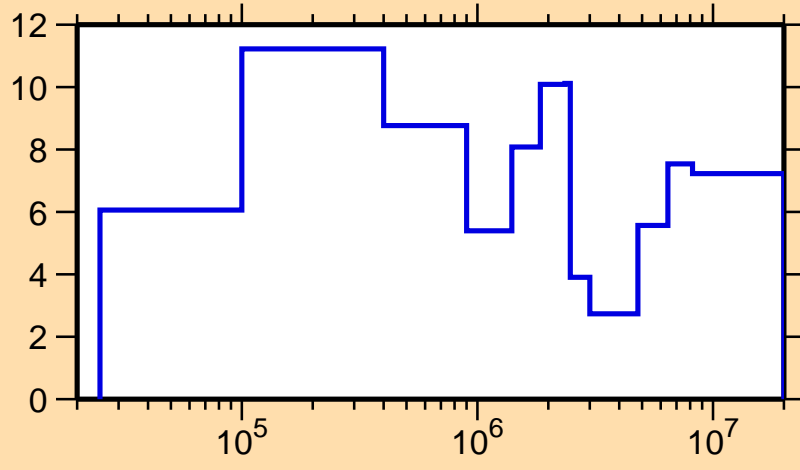

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

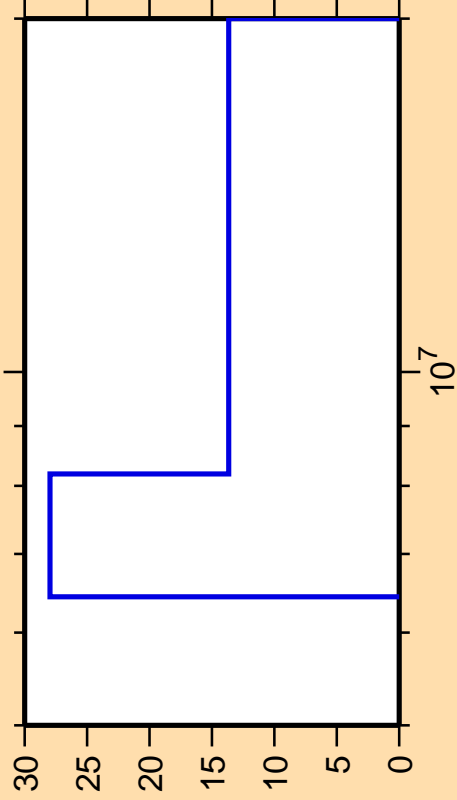


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{tot.})$

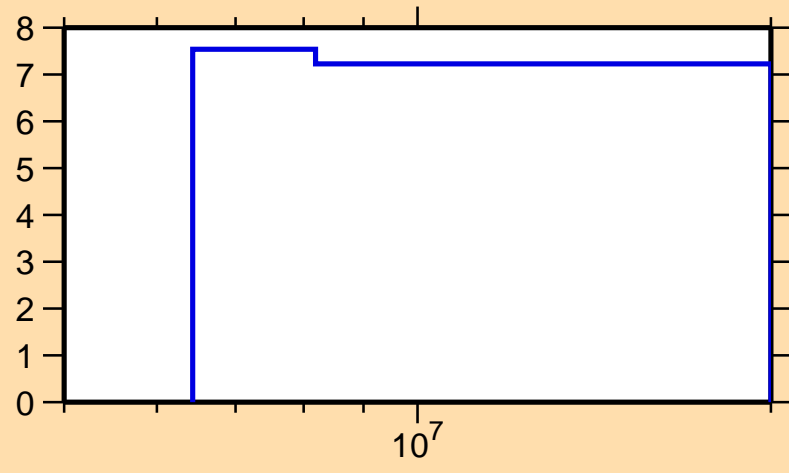

Correlation Matrix


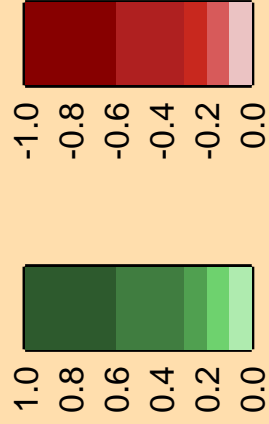


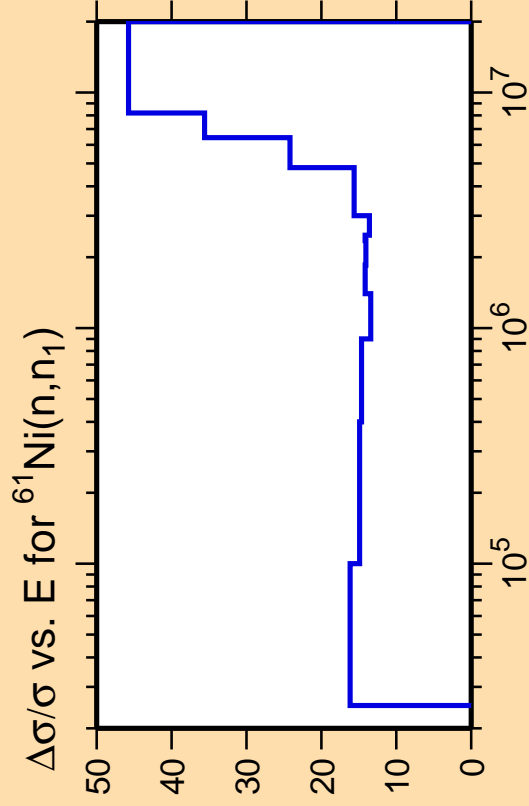

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{tot.})$

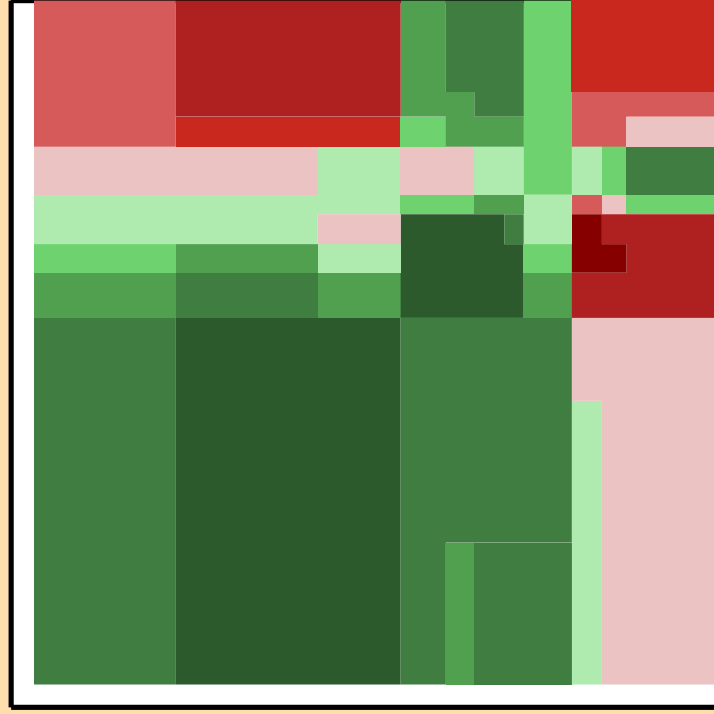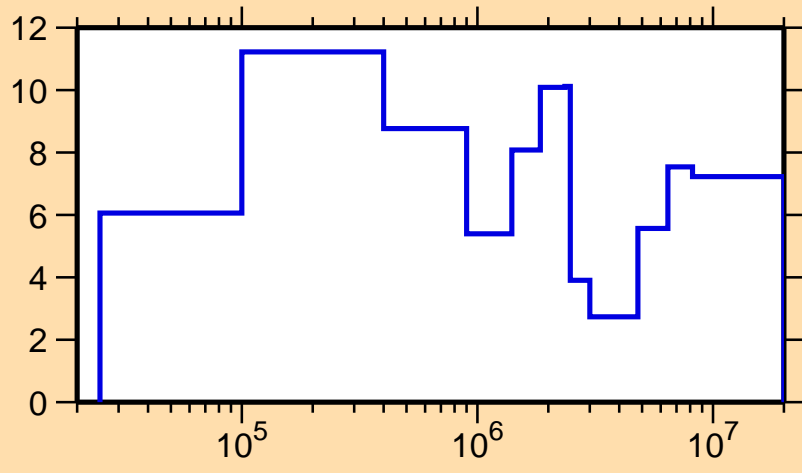

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

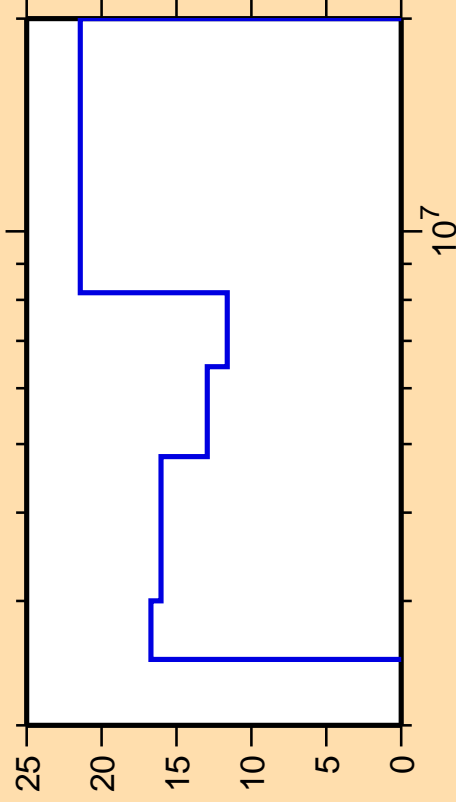

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{tot.})$

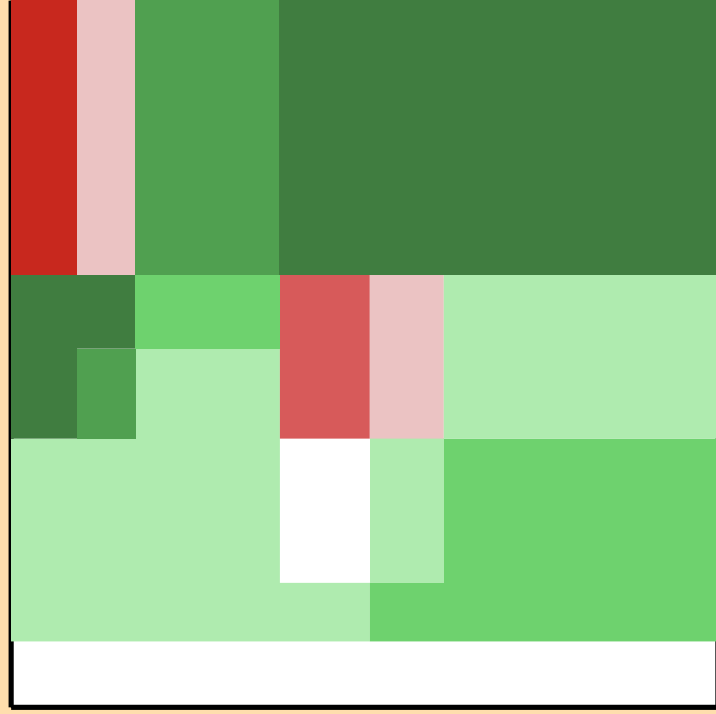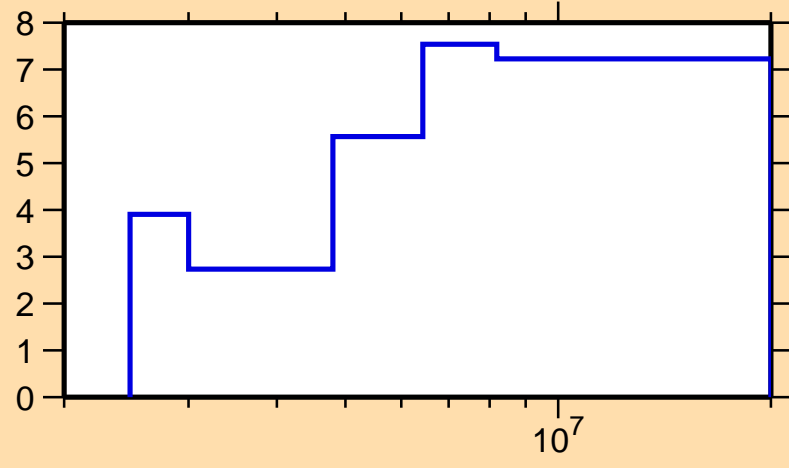

Correlation Matrix




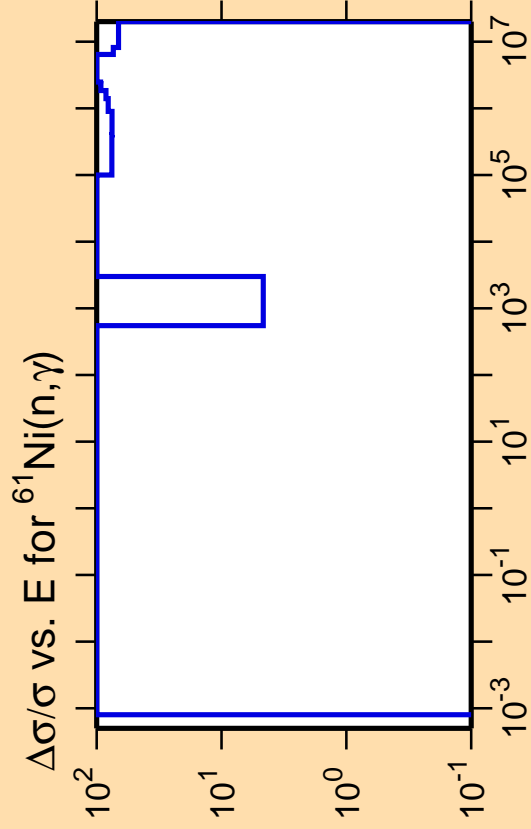


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{tot.})$

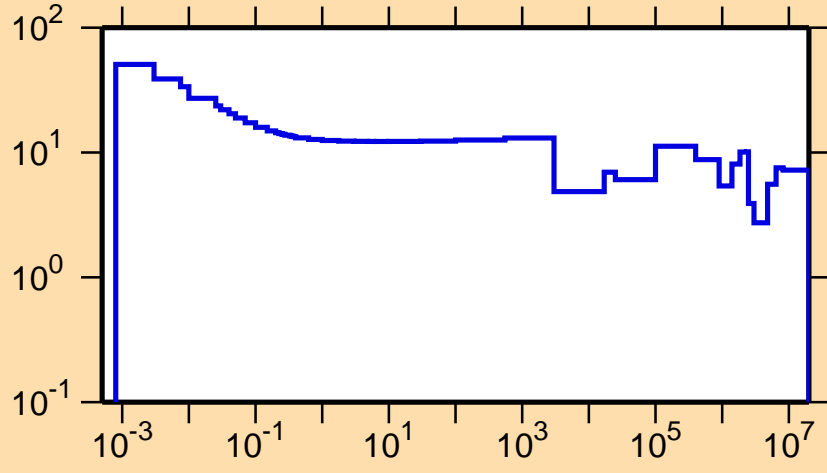

Correlation Matrix





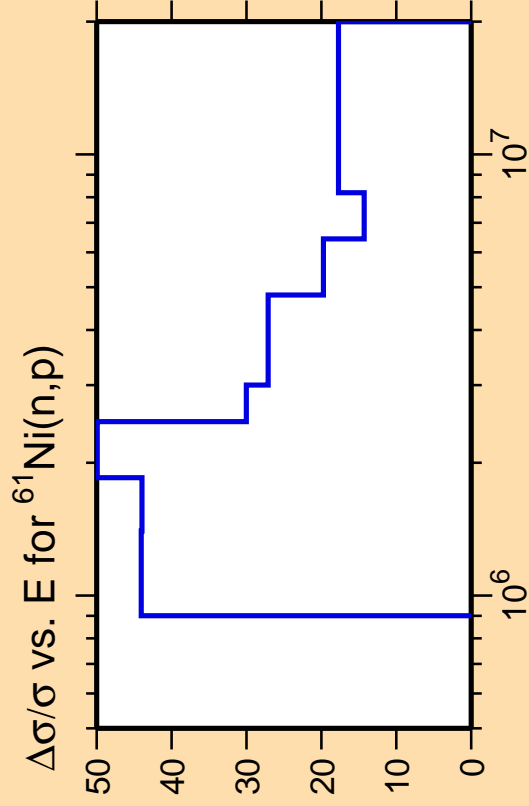

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{tot.})$

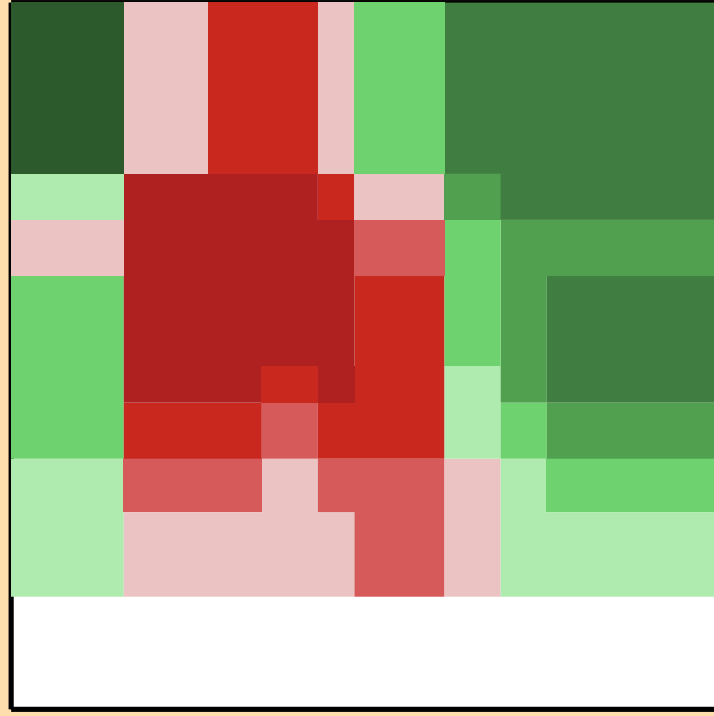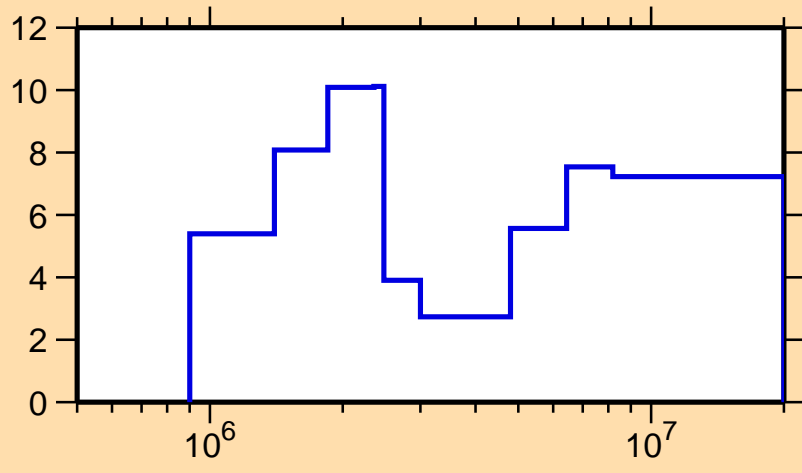

Correlation Matrix




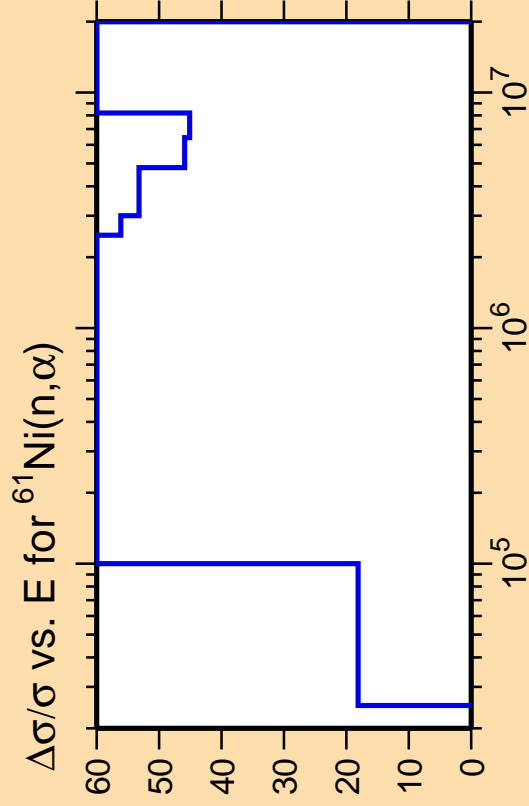


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n, \text{tot.})$

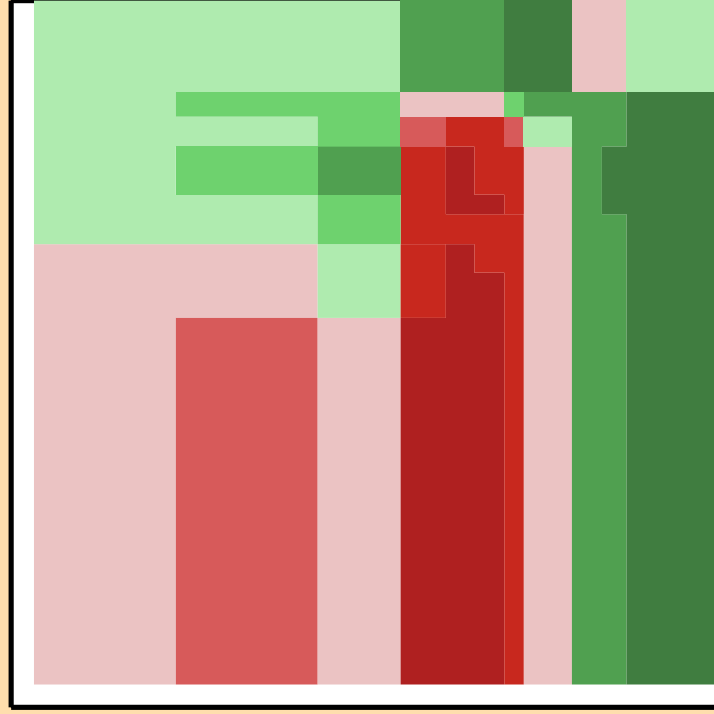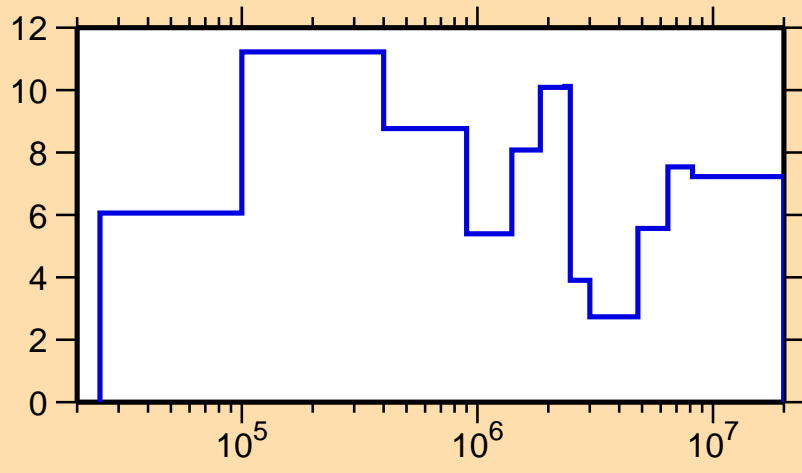

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

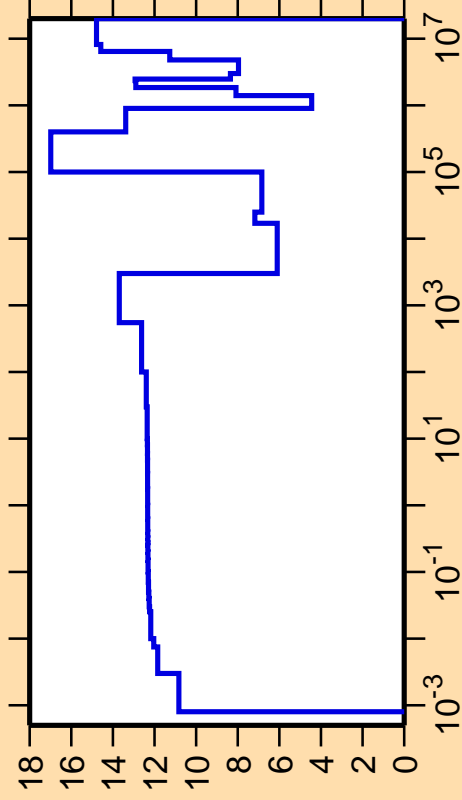

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{61}\text{Ni}(n,\text{el.})$

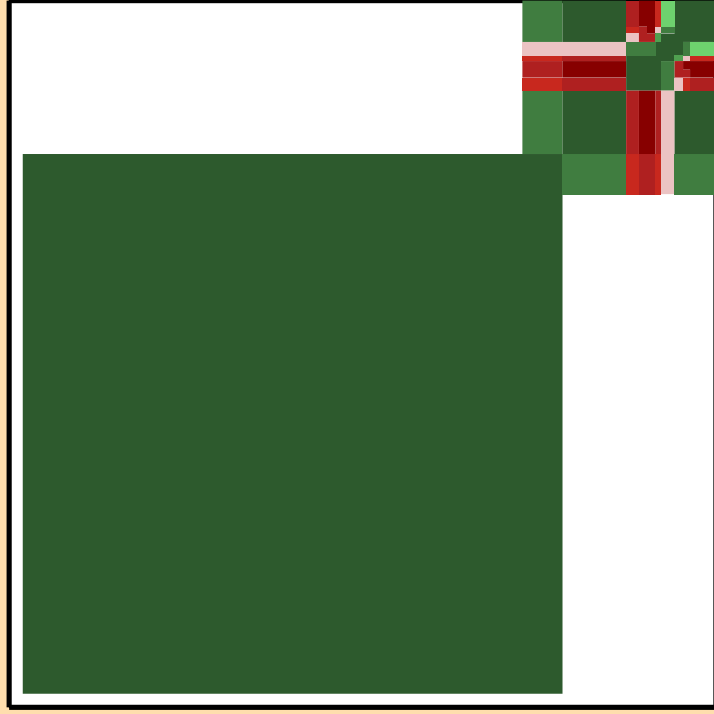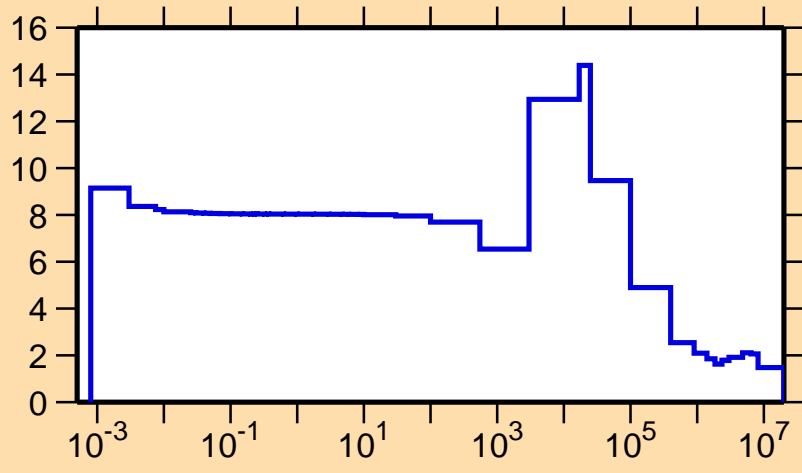

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

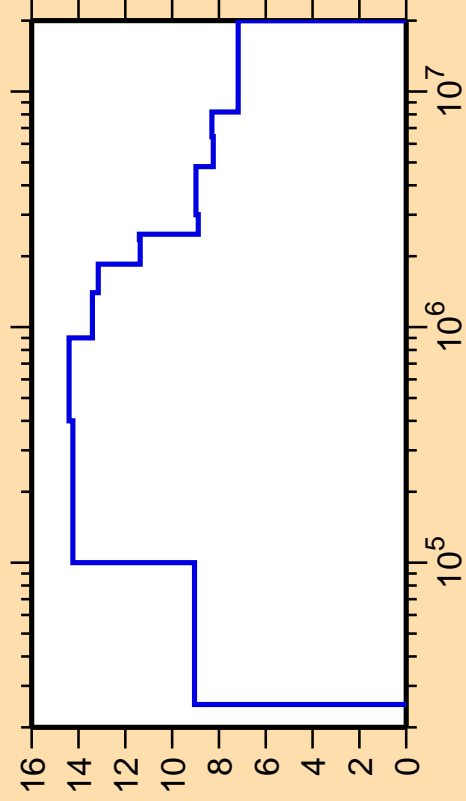

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

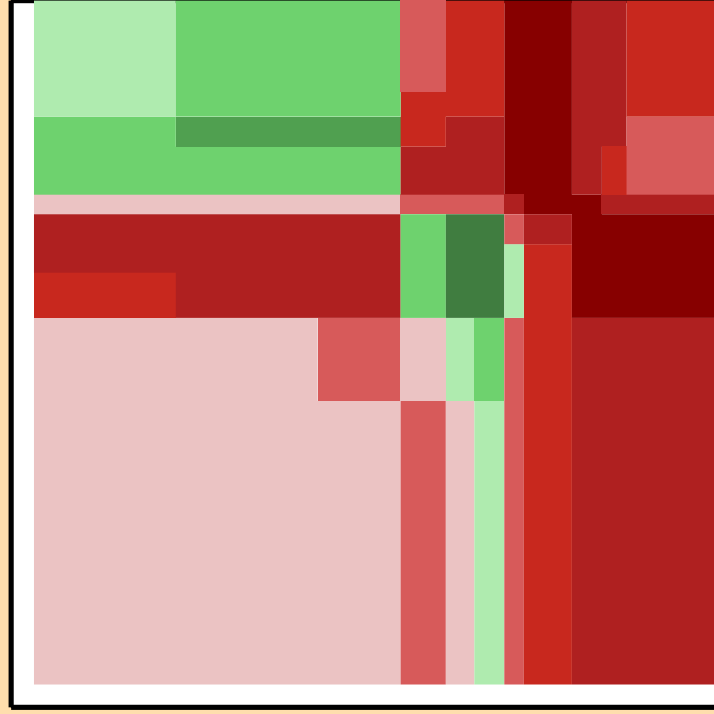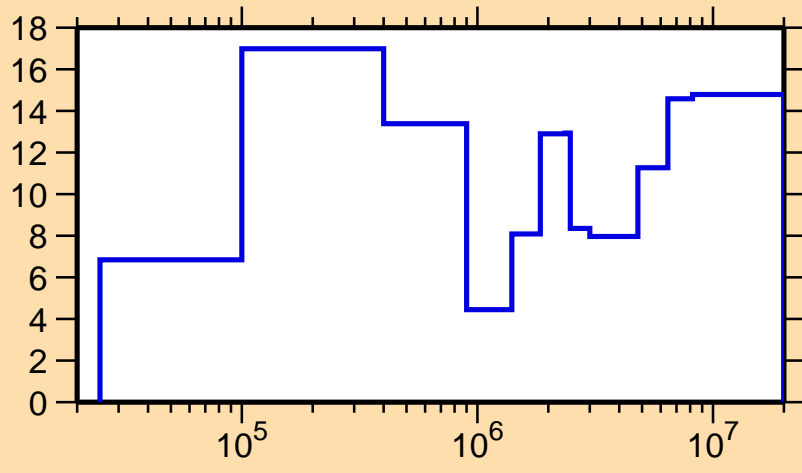

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

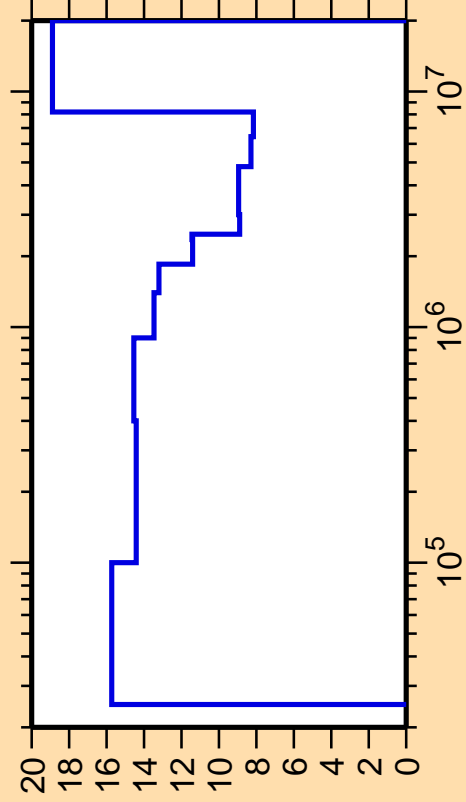

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

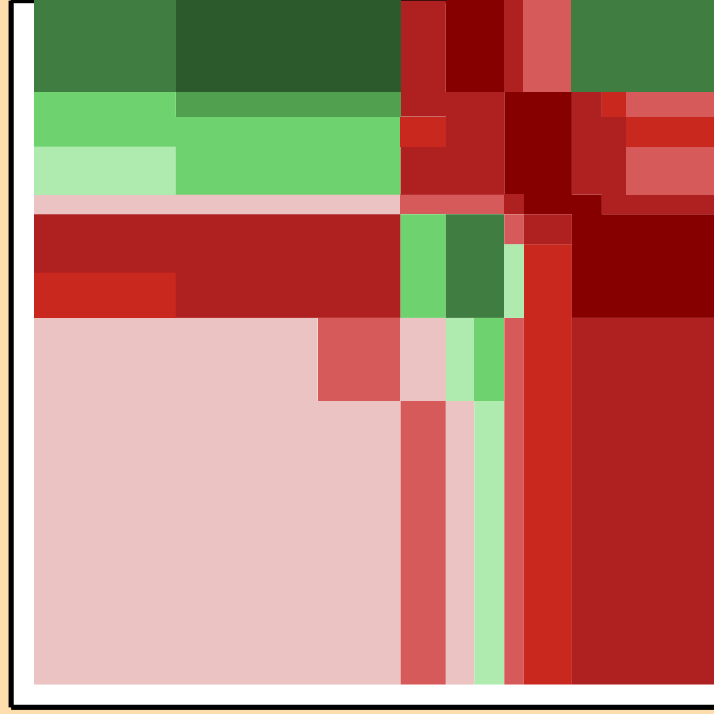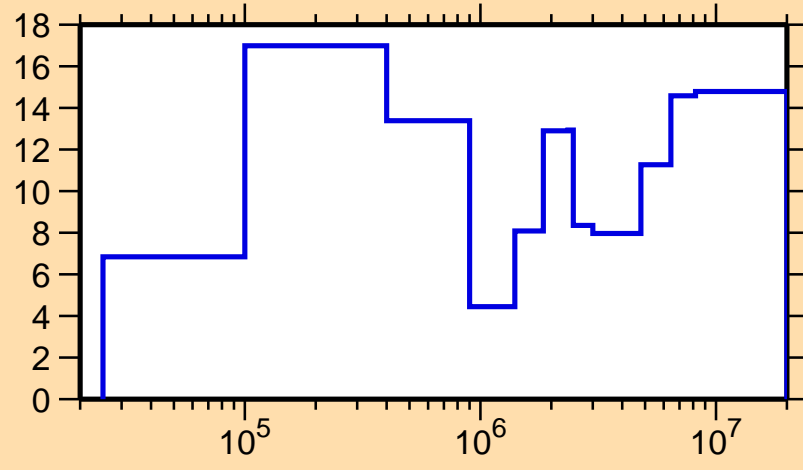

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

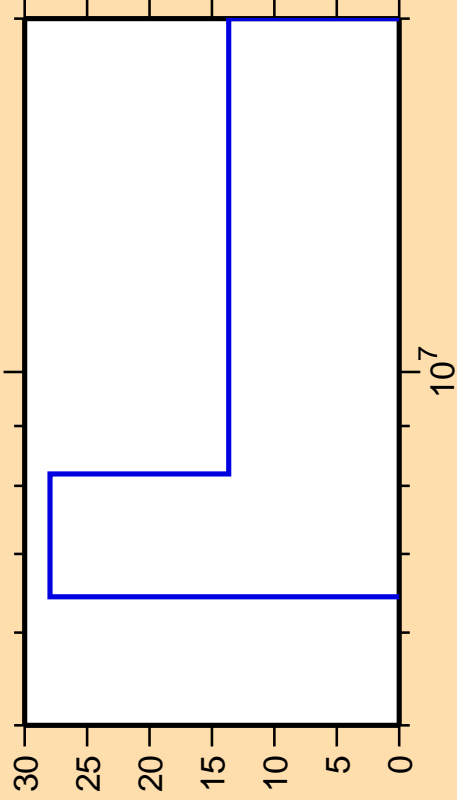

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

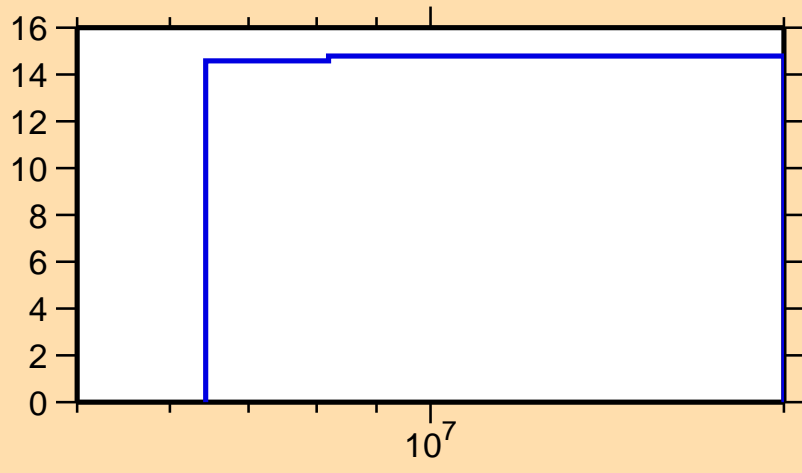

Correlation Matrix





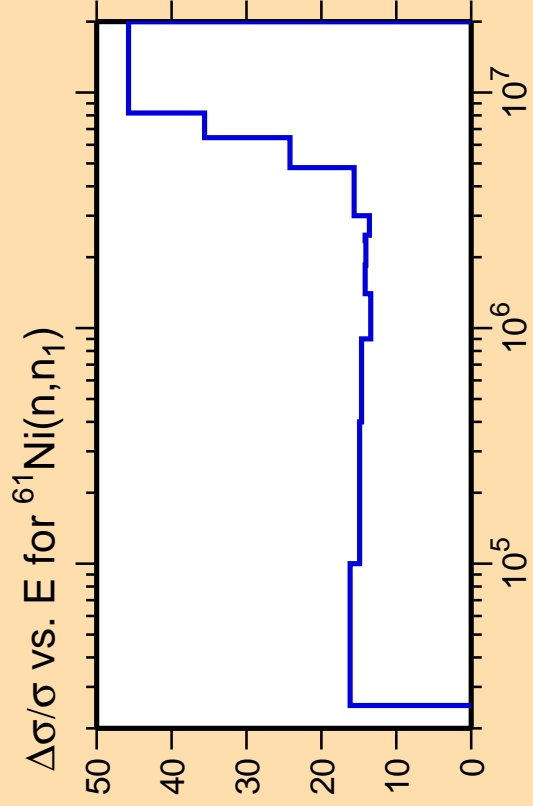

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

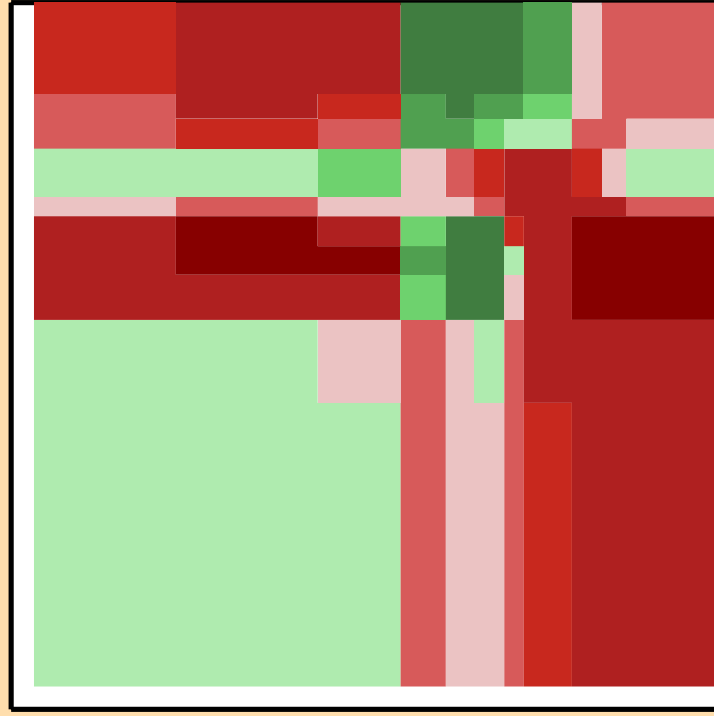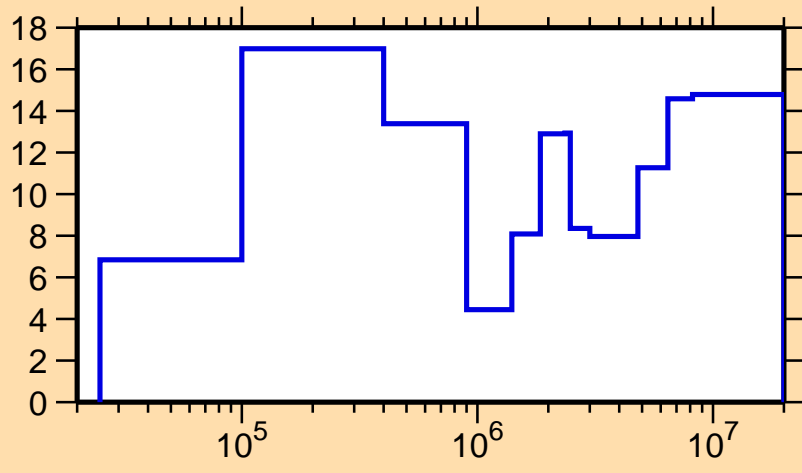

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

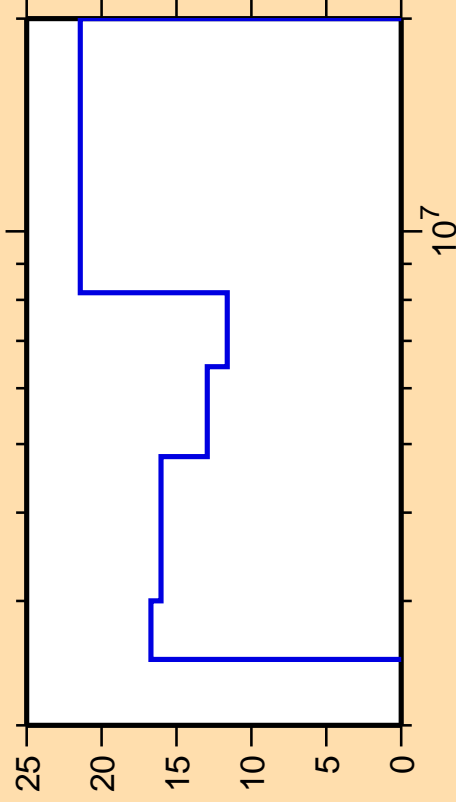

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

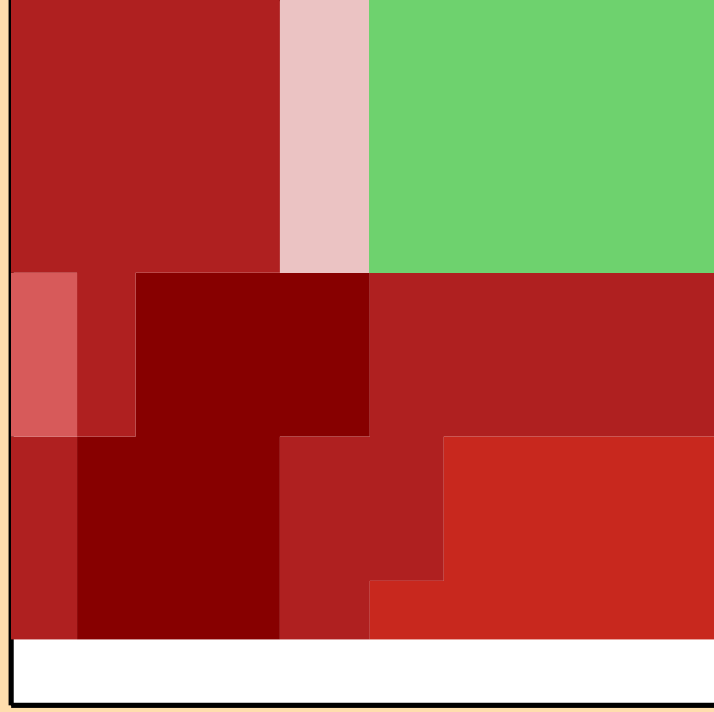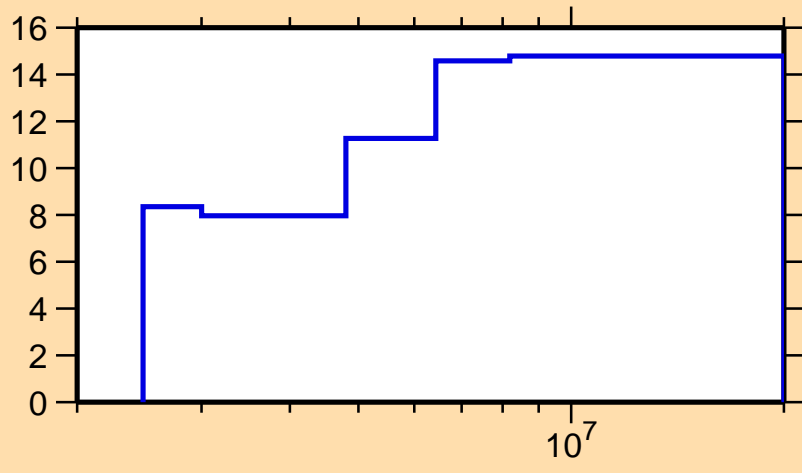

Correlation Matrix




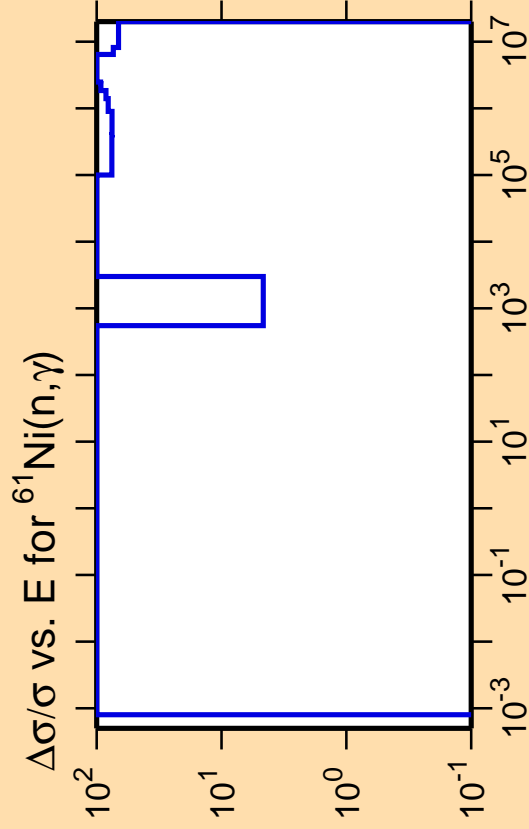


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

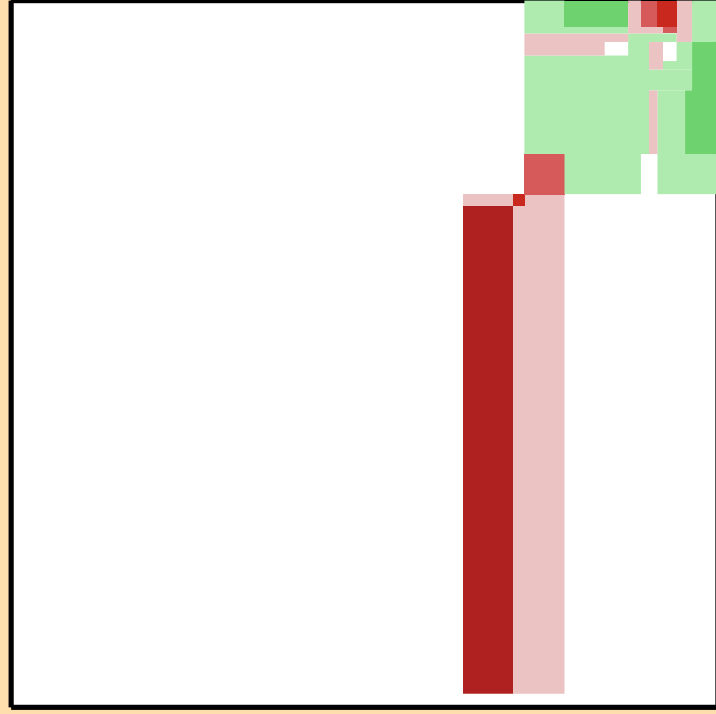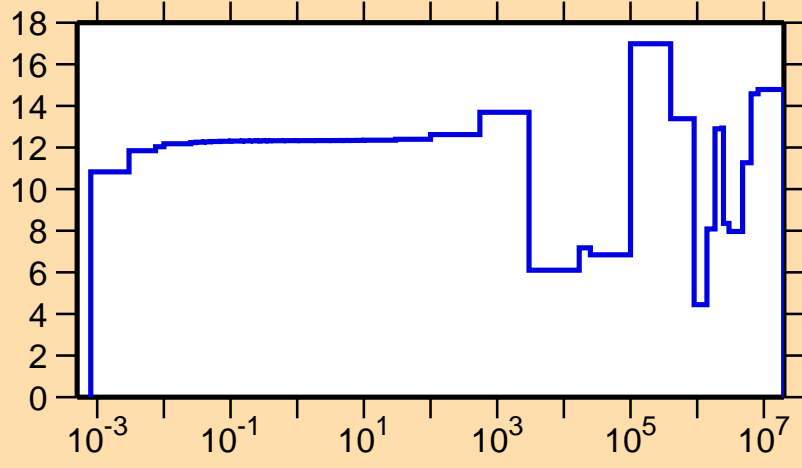

Correlation Matrix





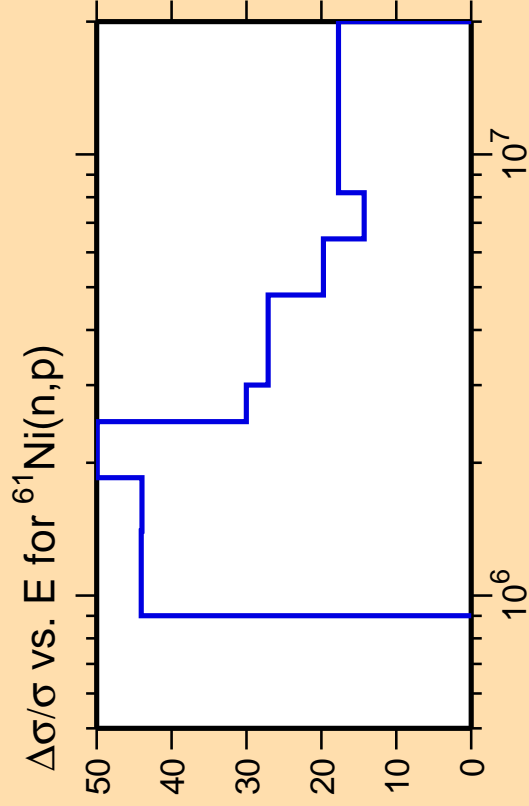

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{el.})$

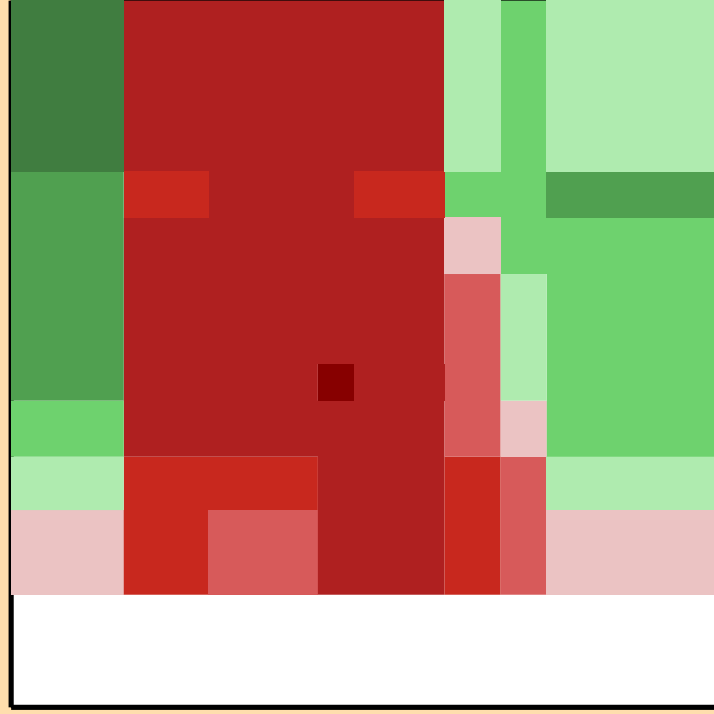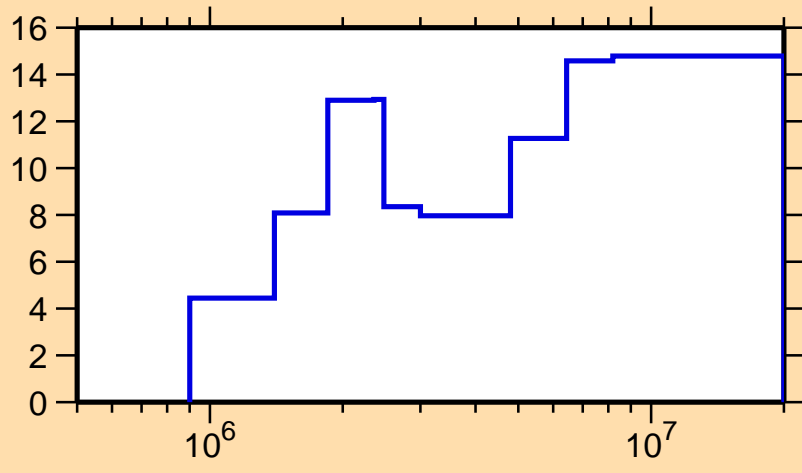

Correlation Matrix




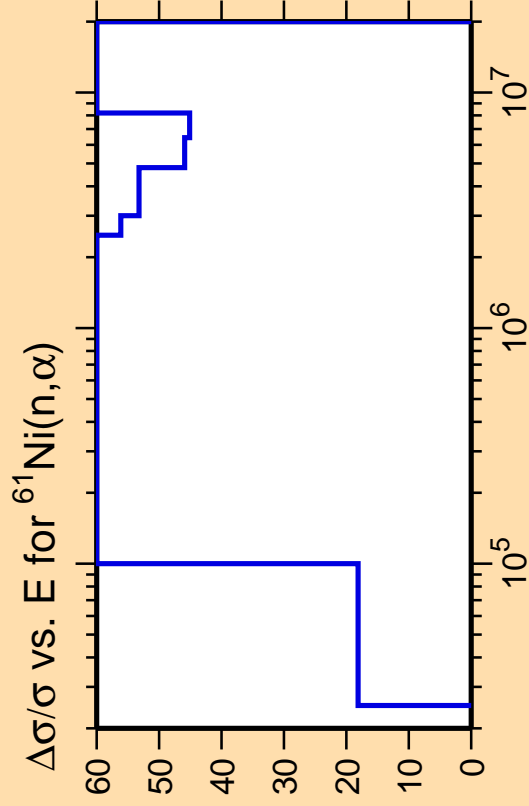


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n, \text{el.})$

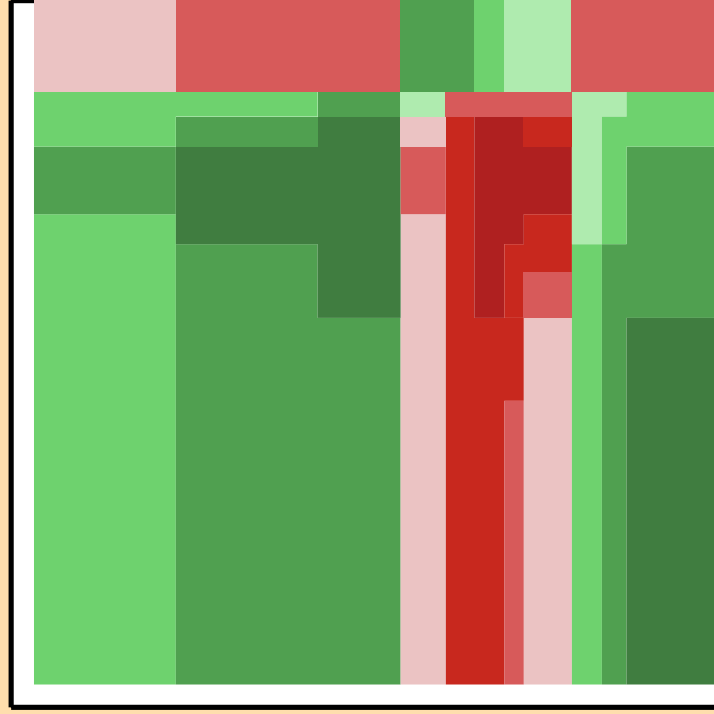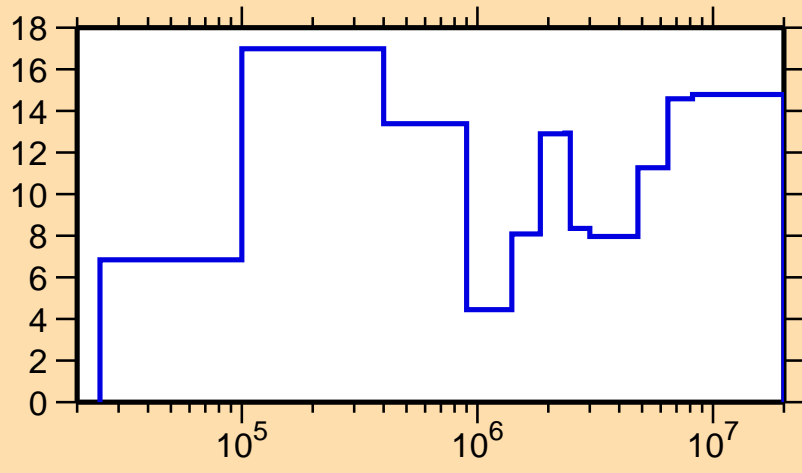

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

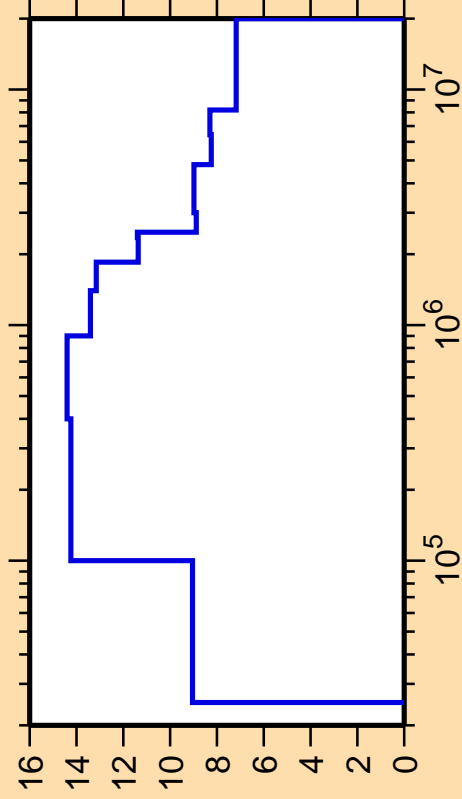

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

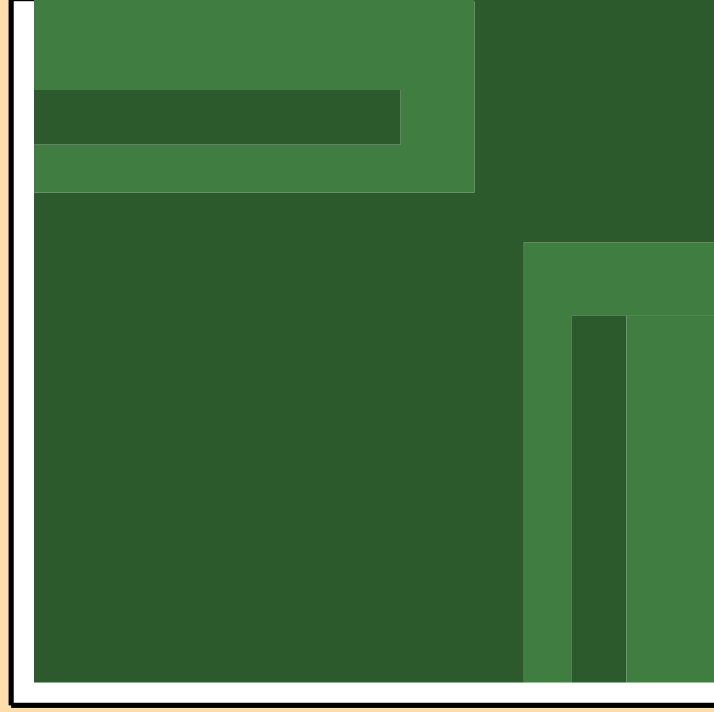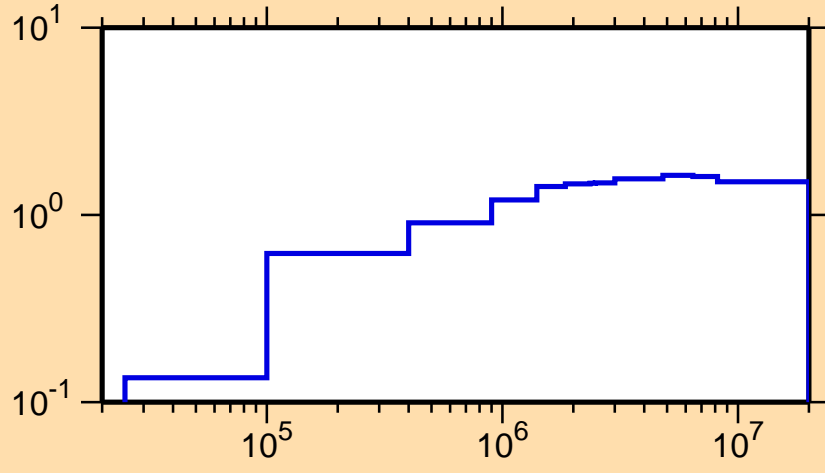

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

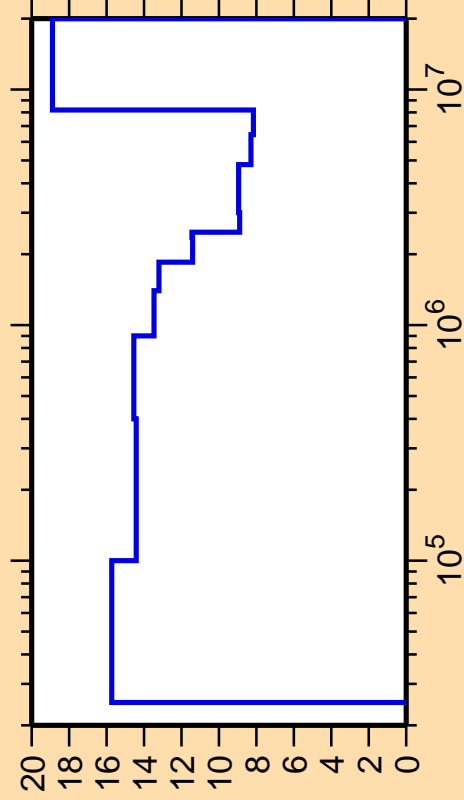

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

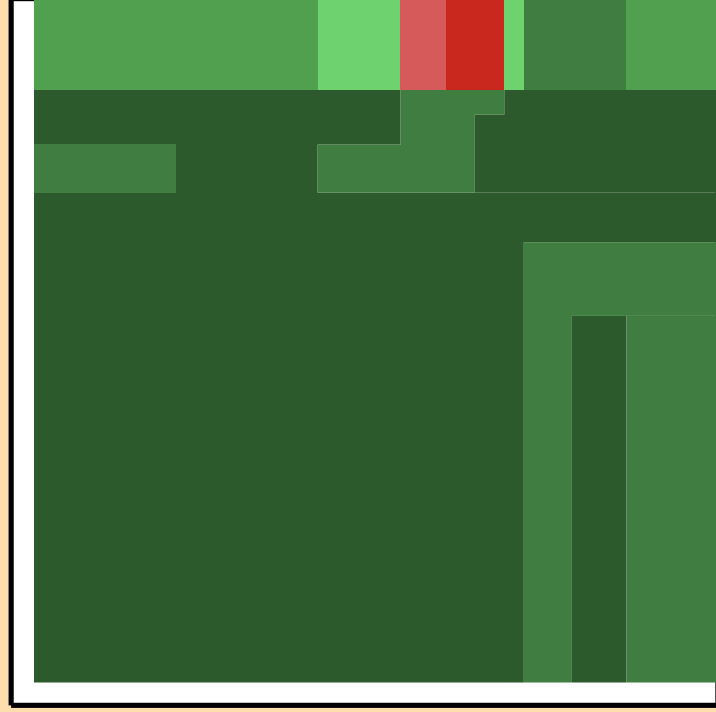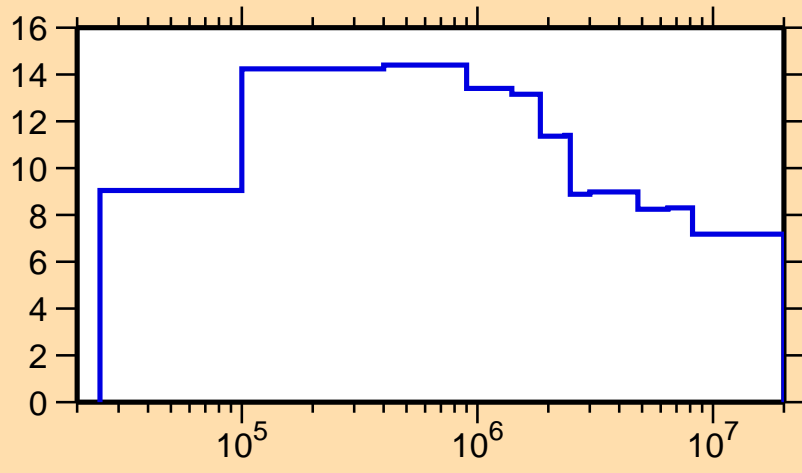

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

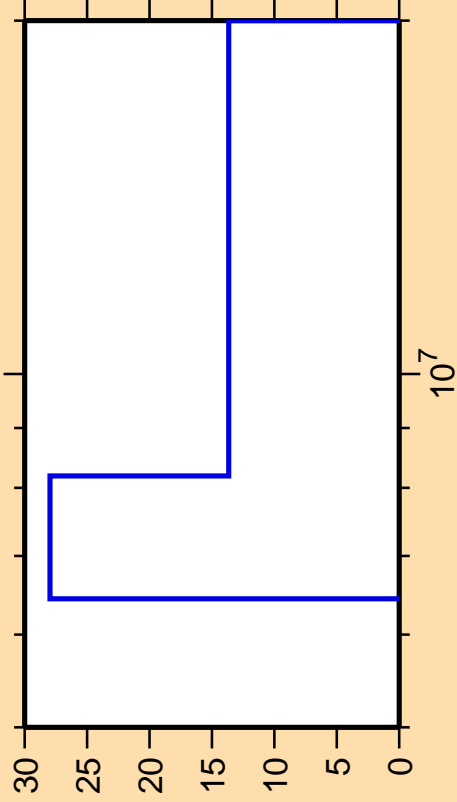

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

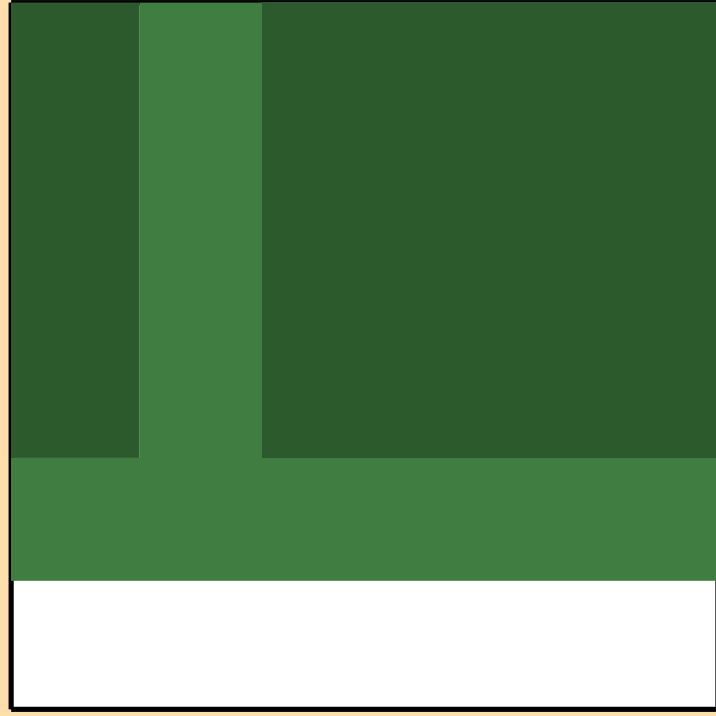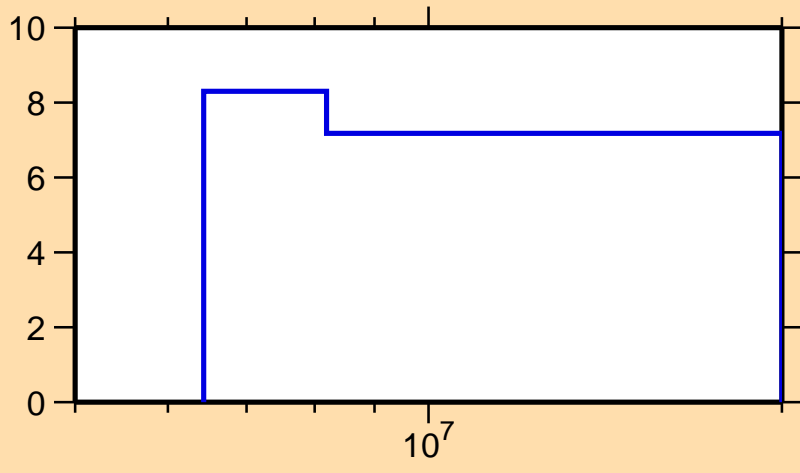

Correlation Matrix





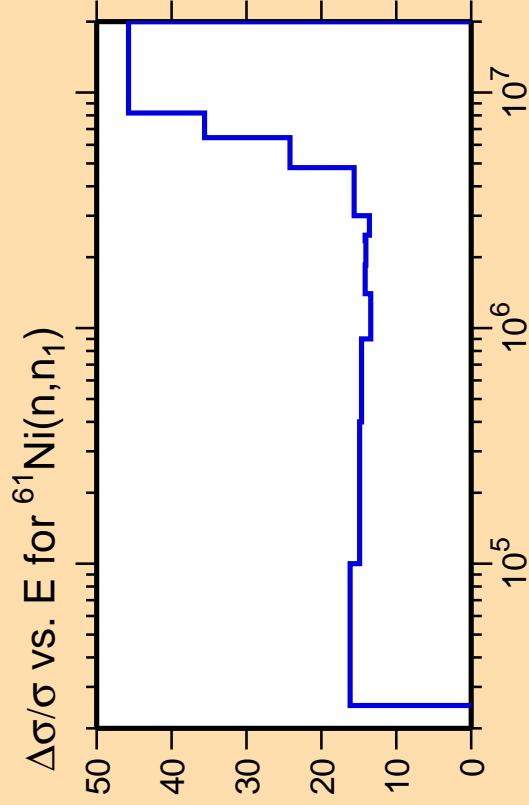

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

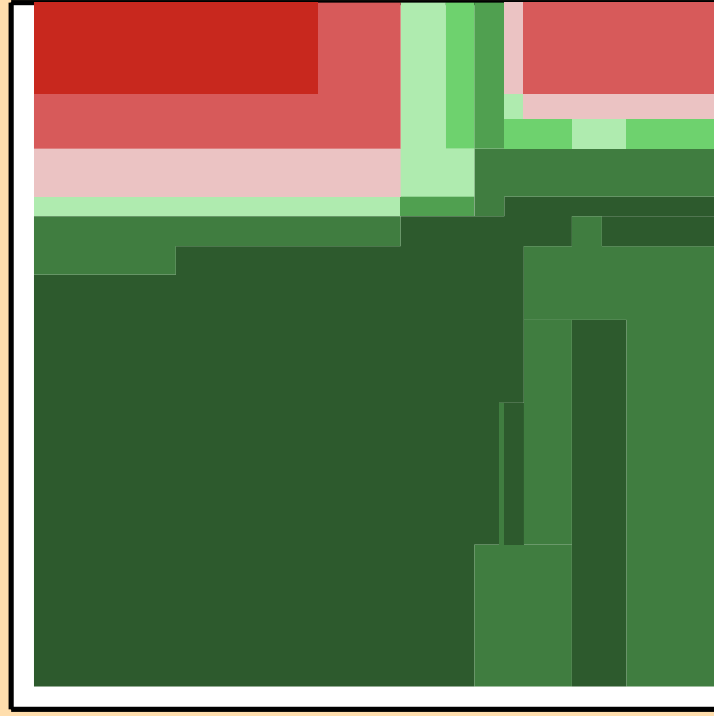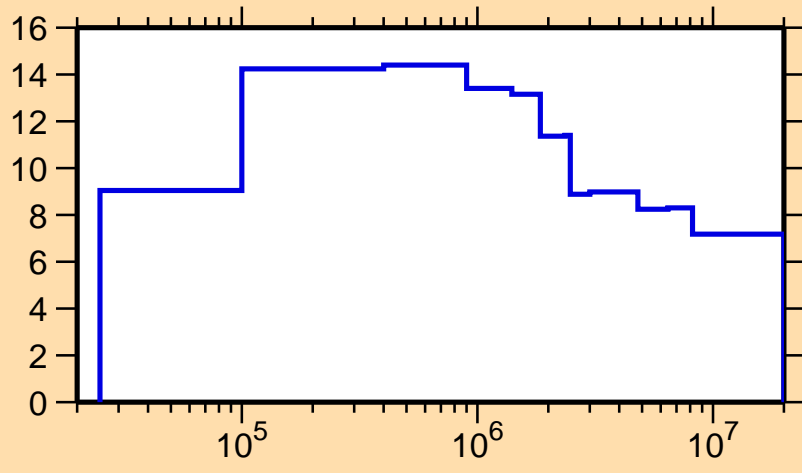

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

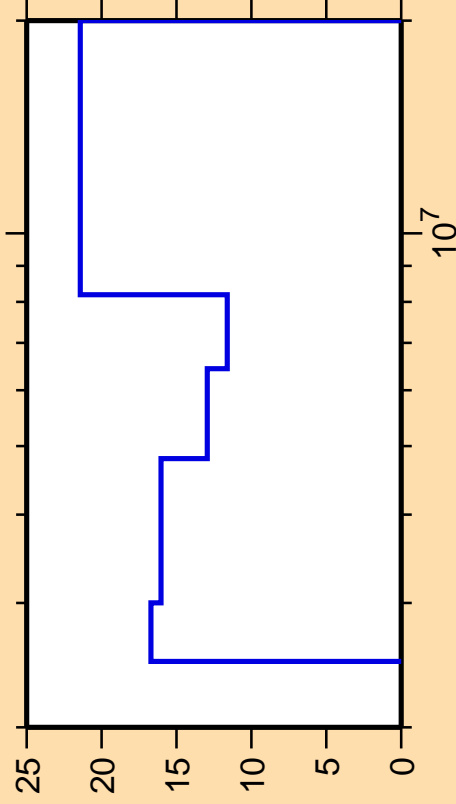

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{onel.})$

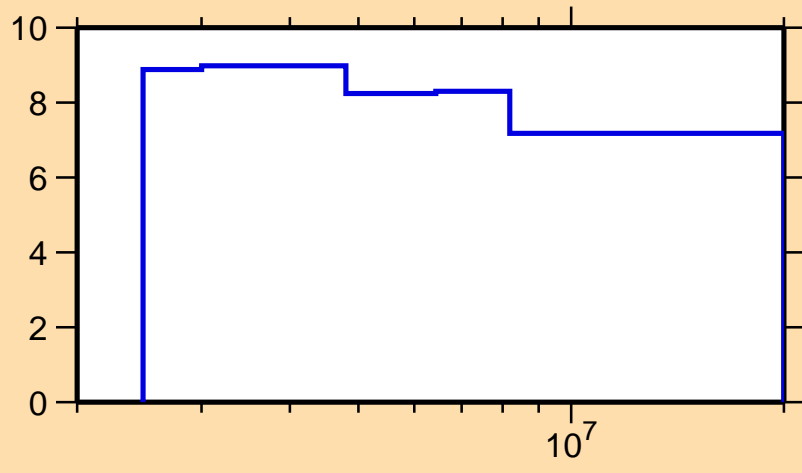

Correlation Matrix




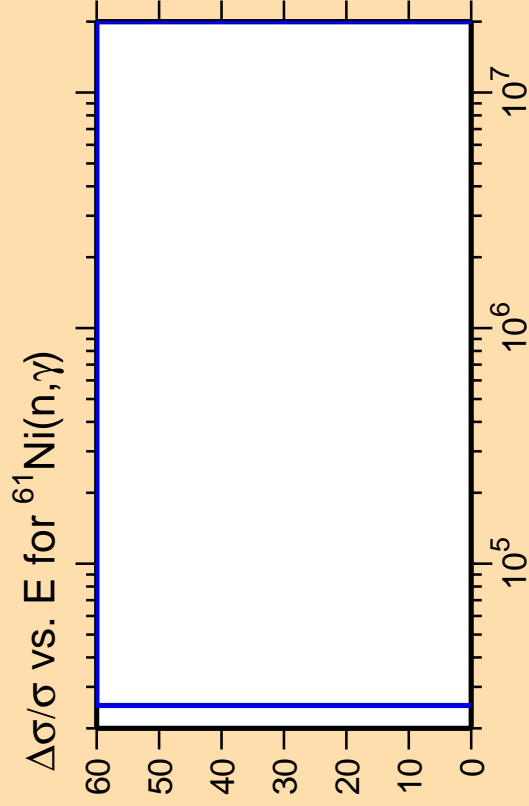


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

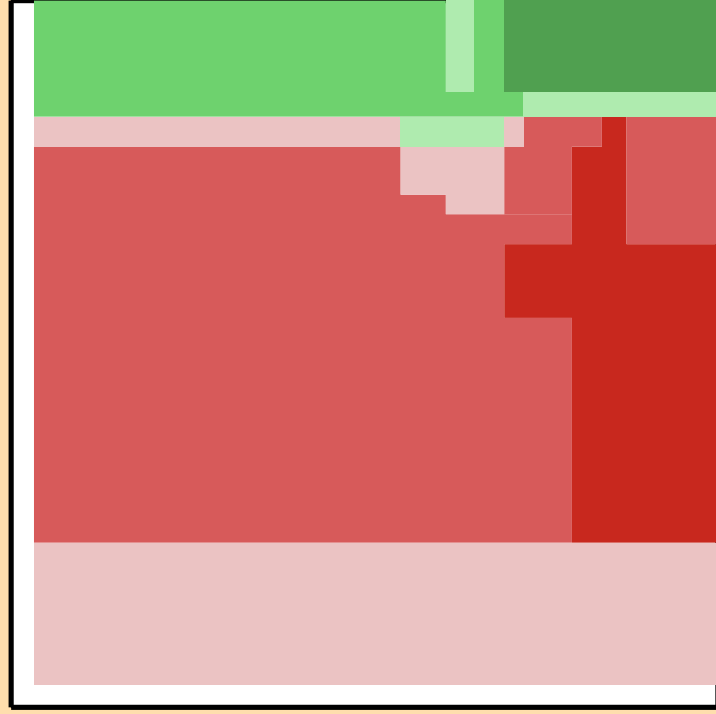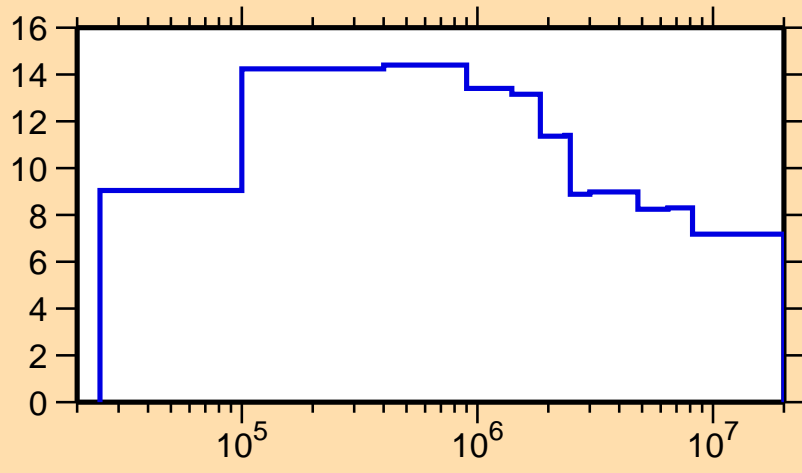

Correlation Matrix





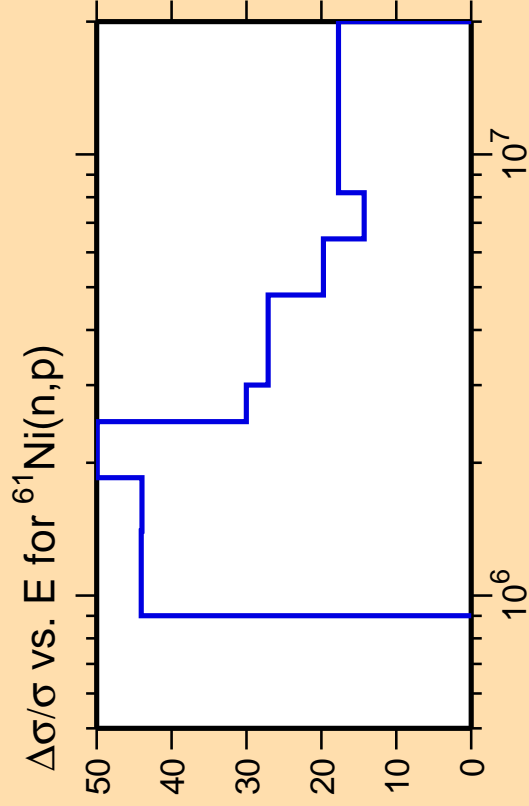

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nonel.})$

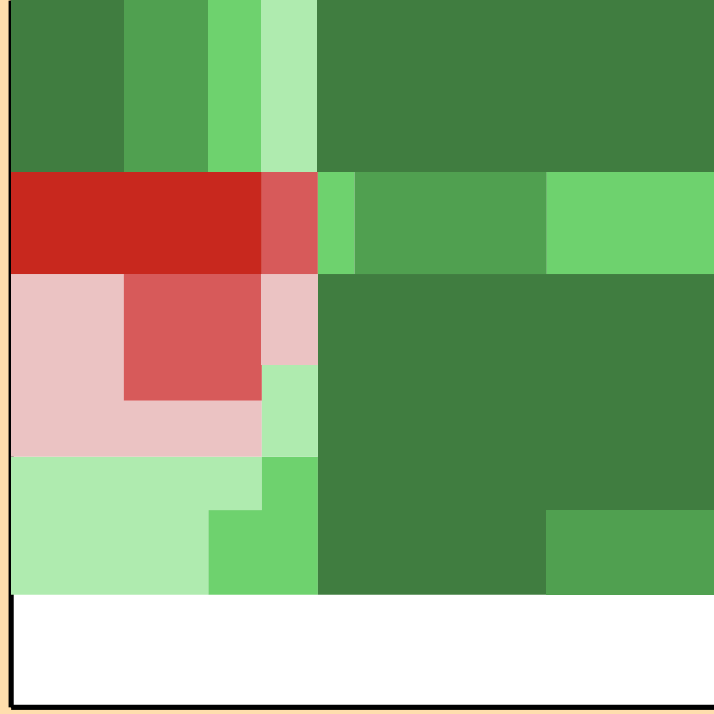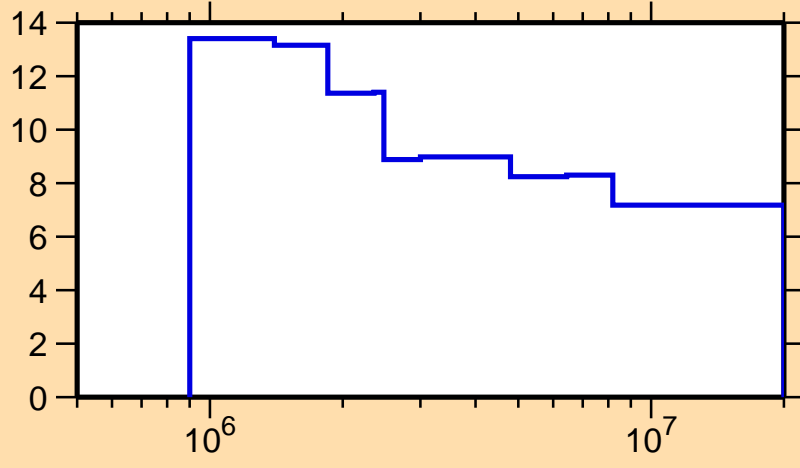

Correlation Matrix




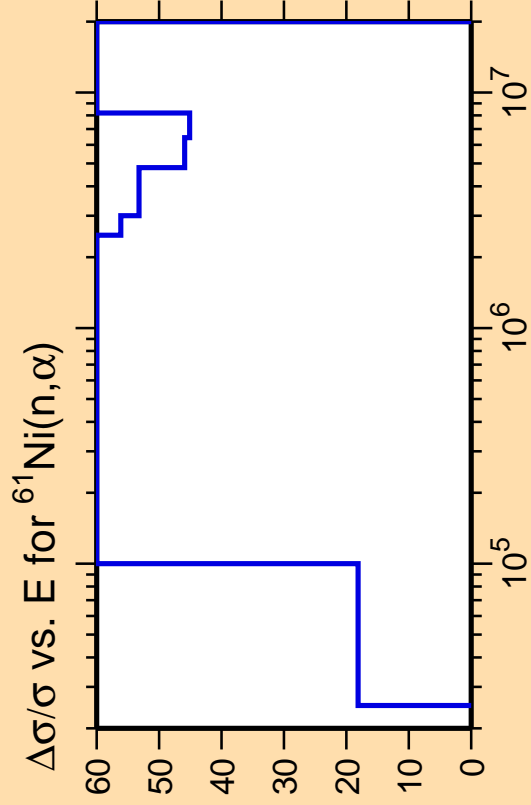


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n, \text{nonel.})$

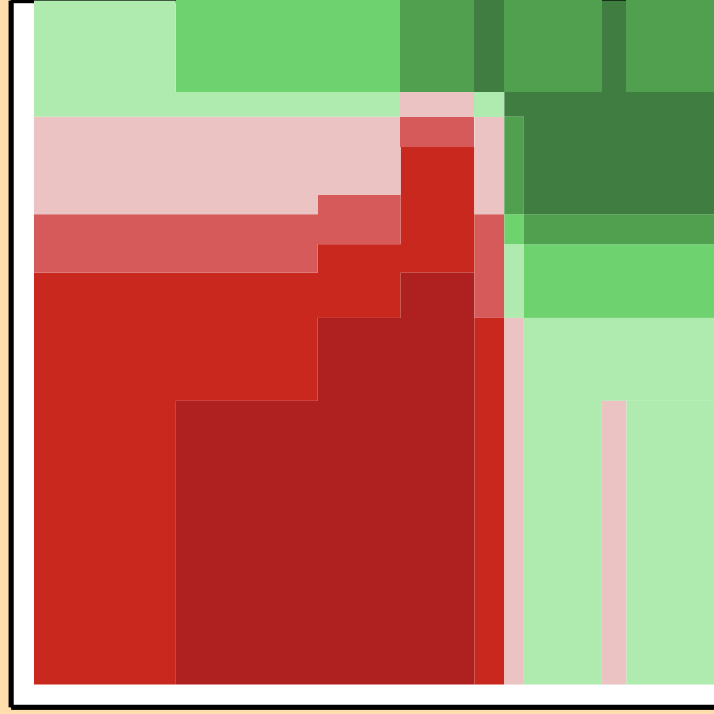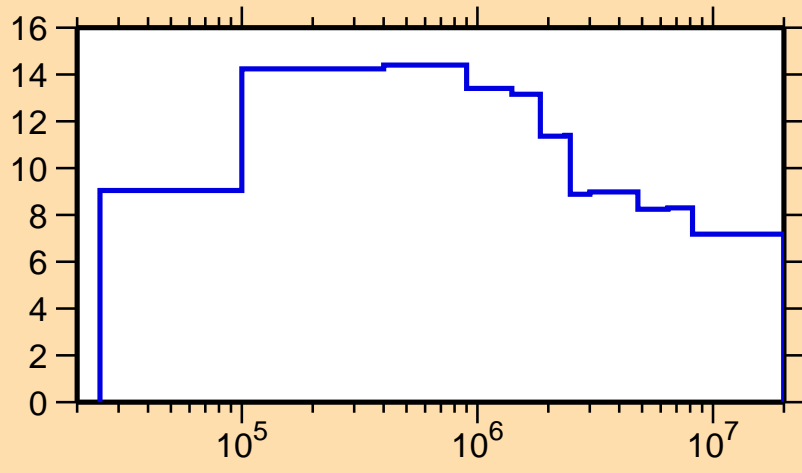

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

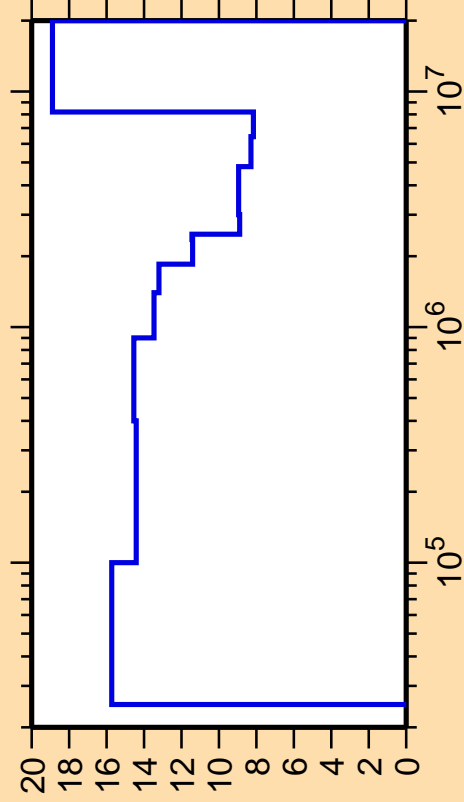

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

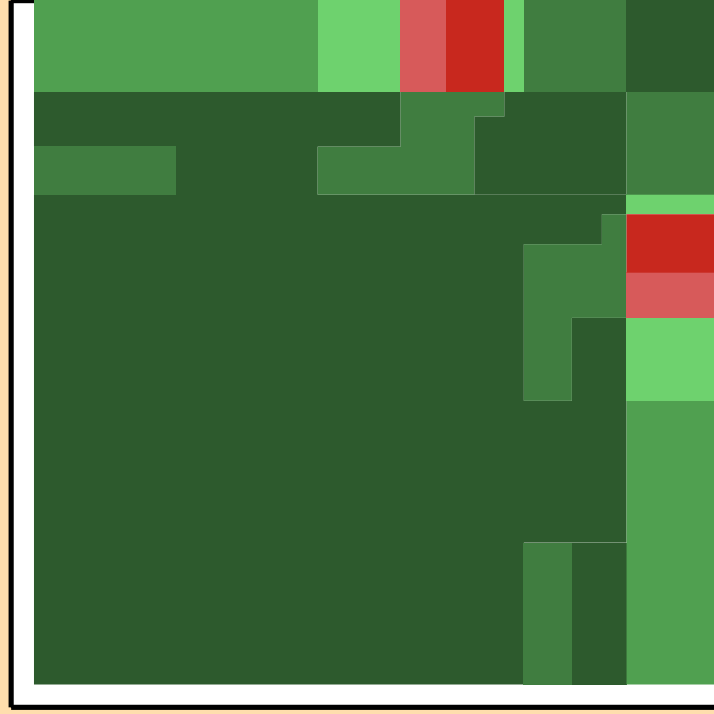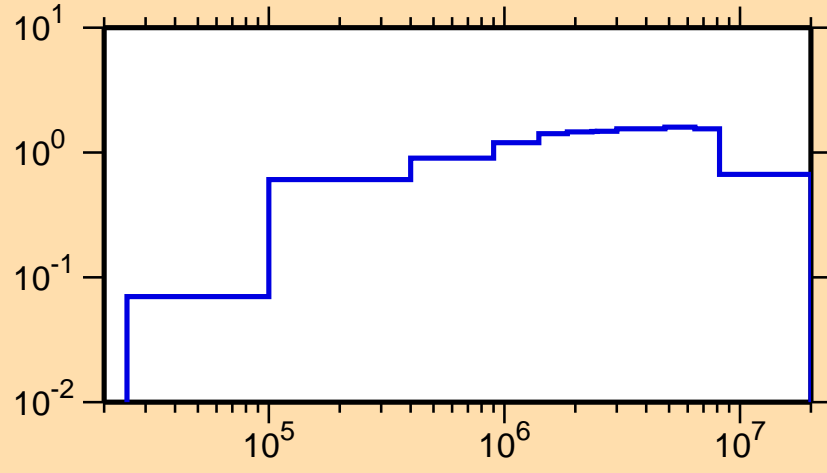

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

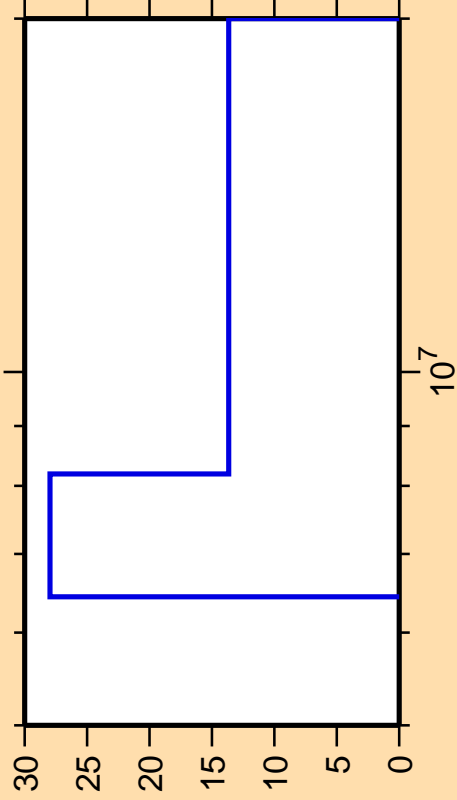

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

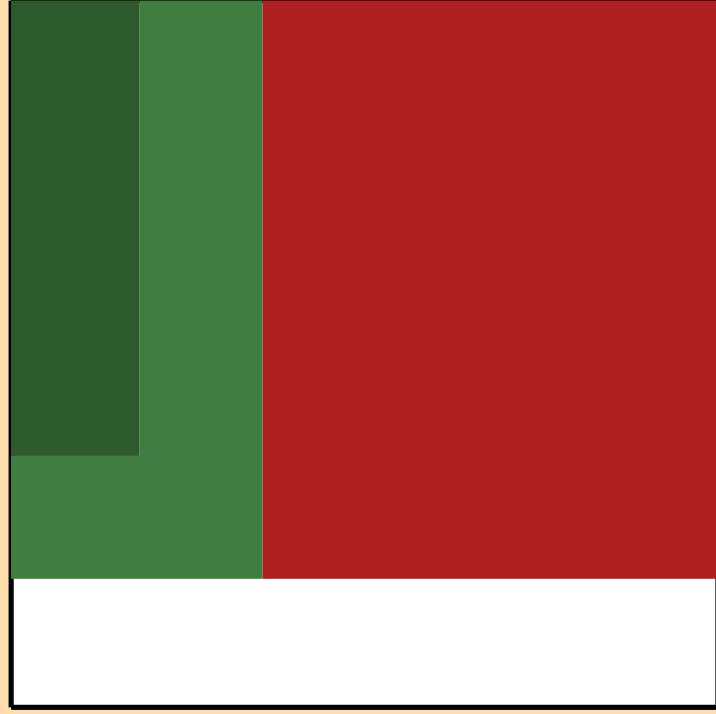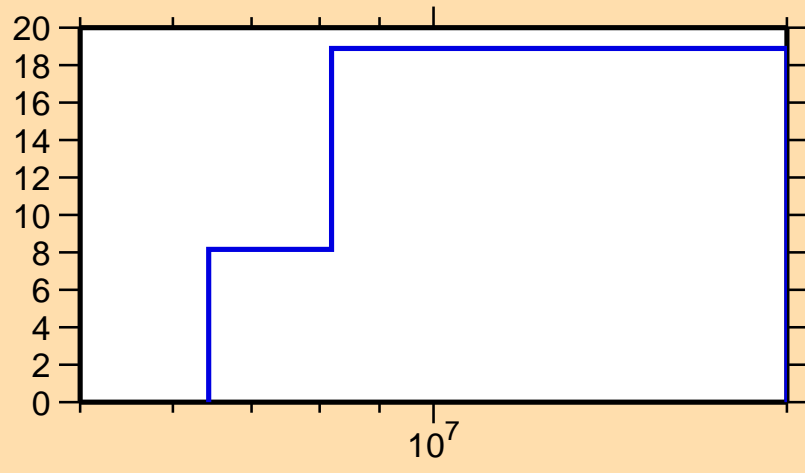

Correlation Matrix





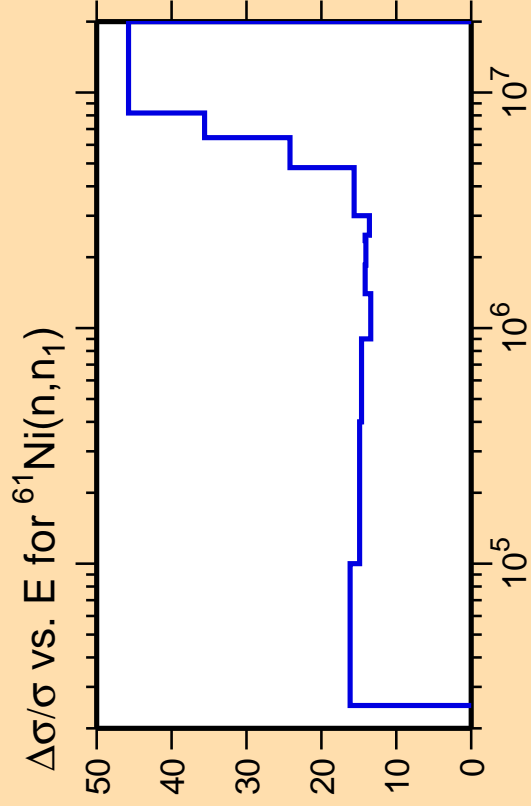

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

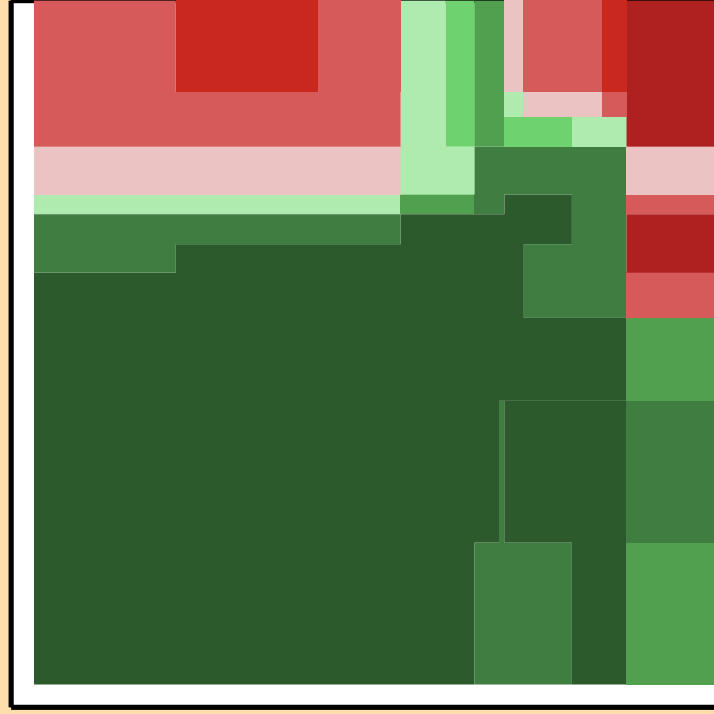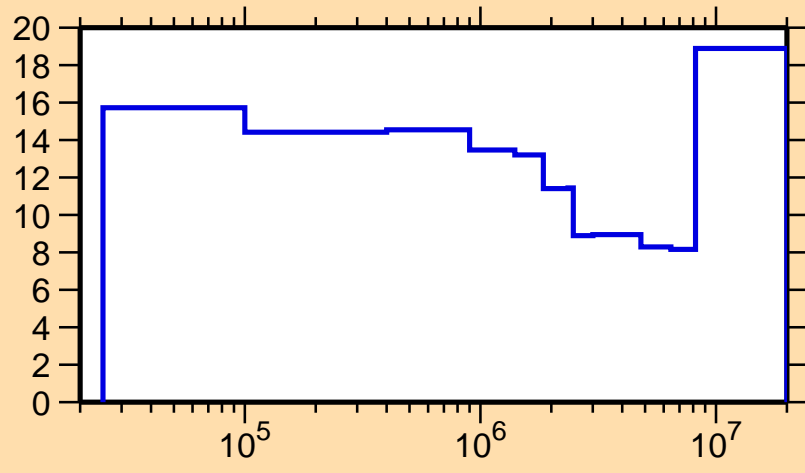

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

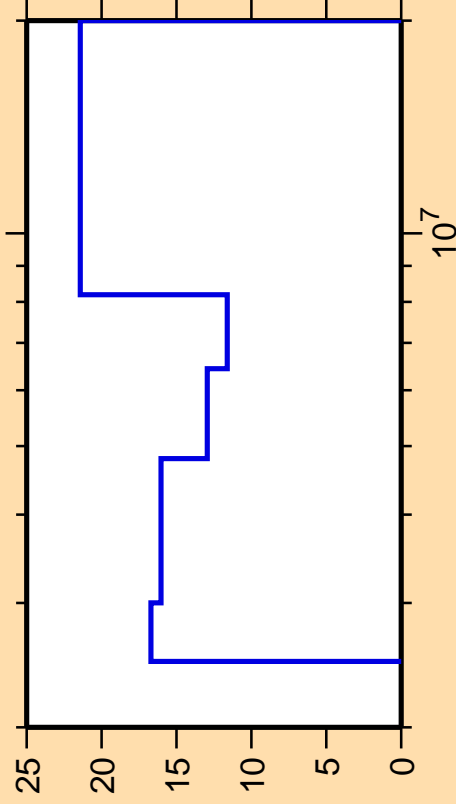

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

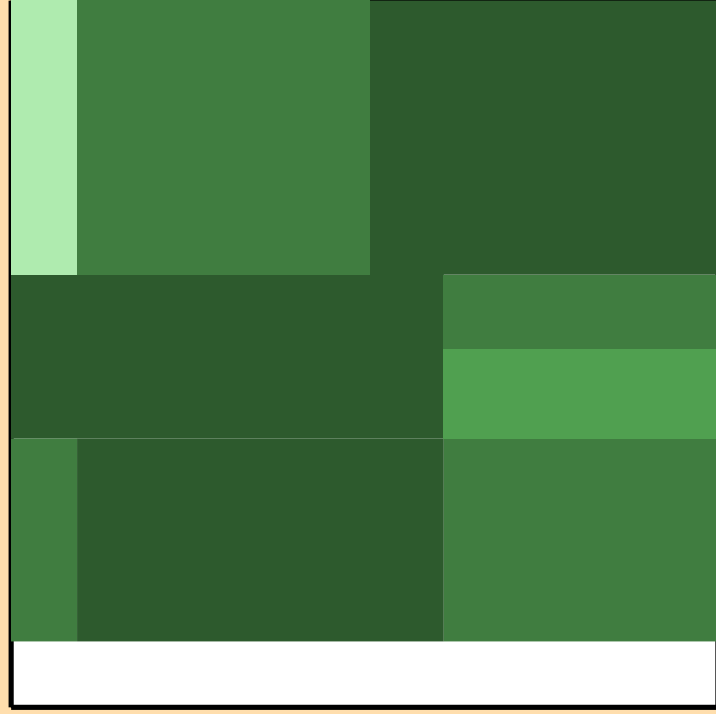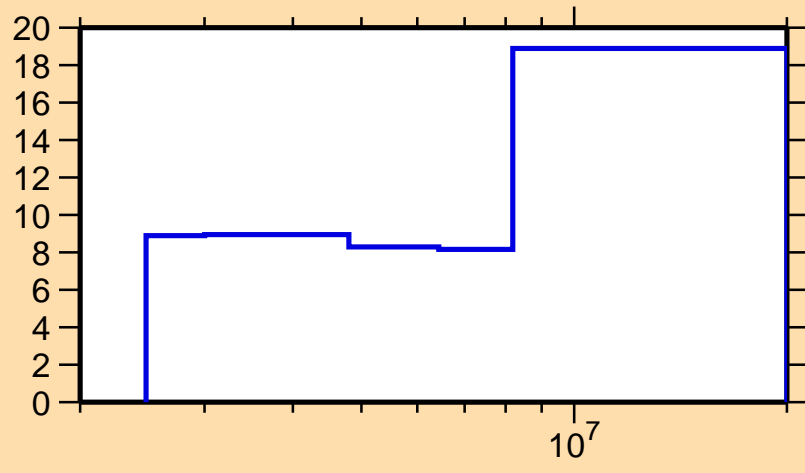

Correlation Matrix



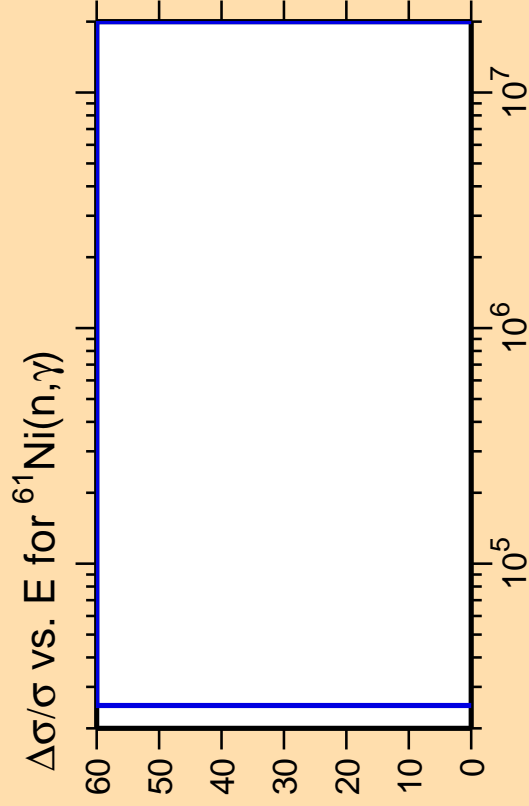


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

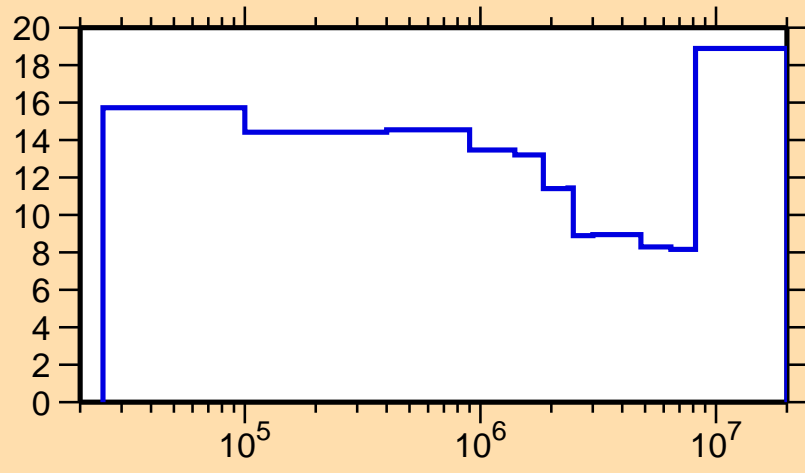


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\gamma)$

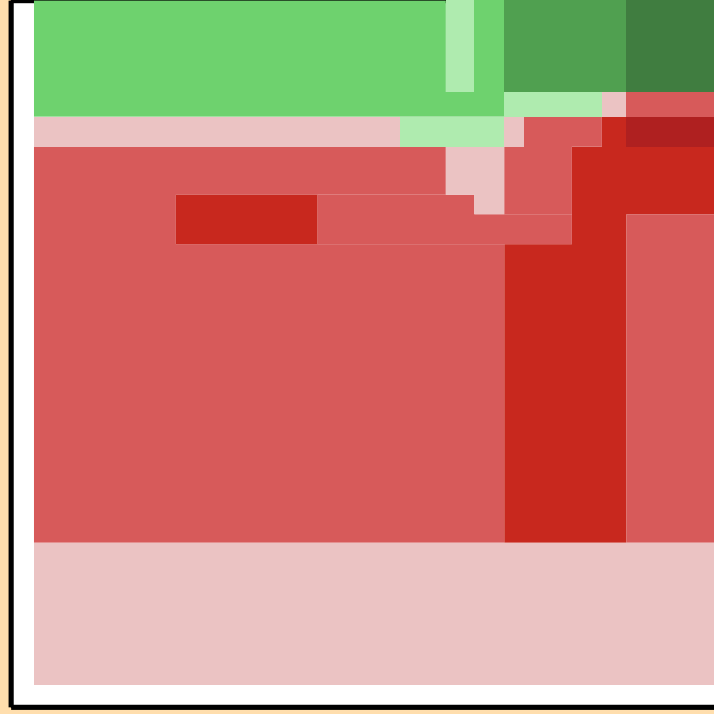

Correlation Matrix





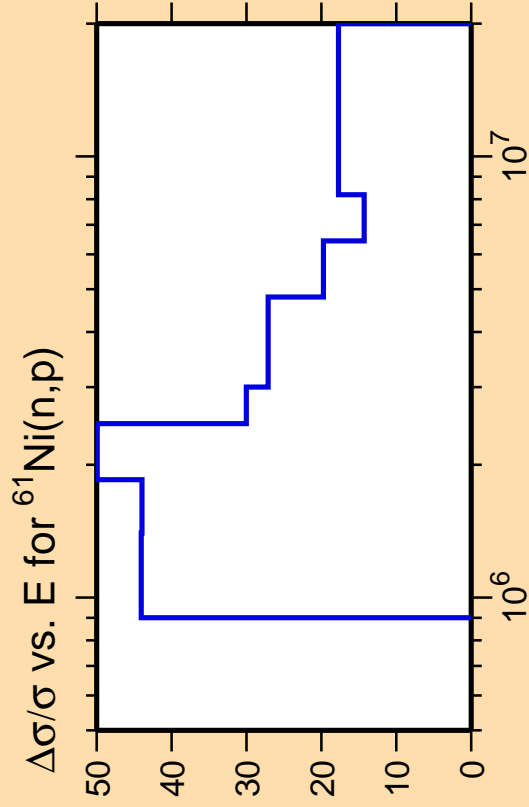

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{inel.})$

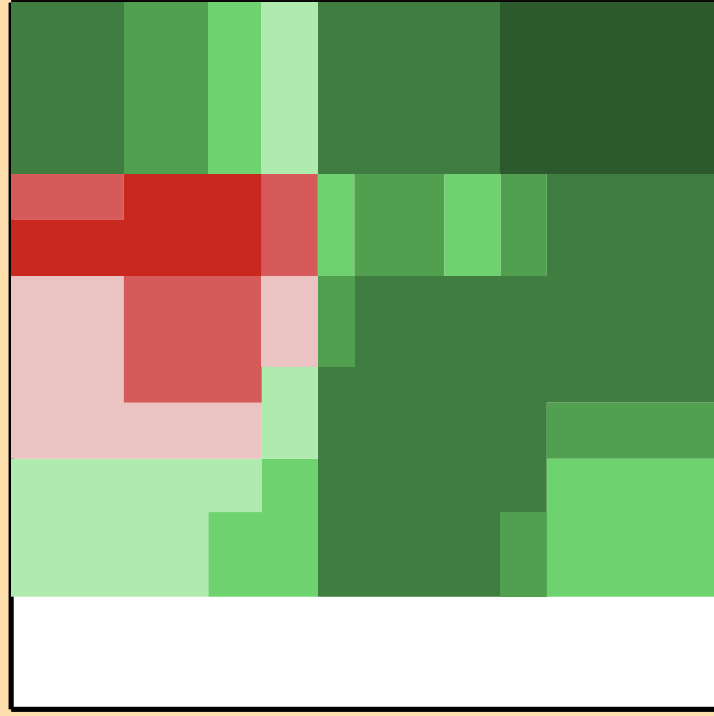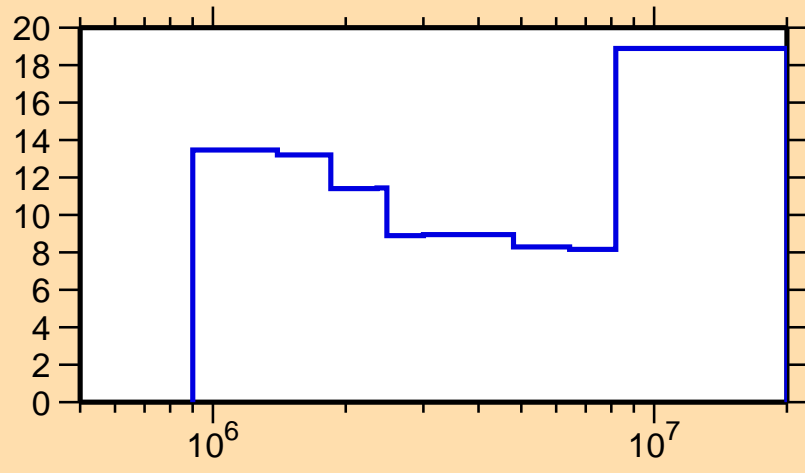

Correlation Matrix




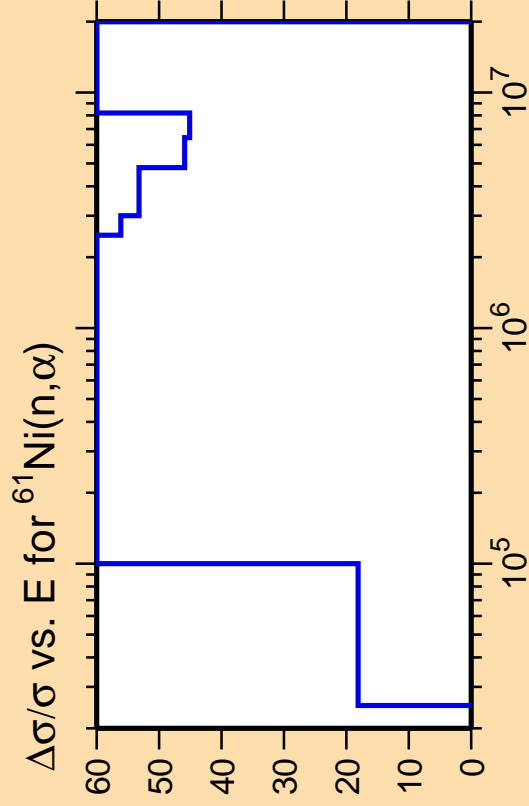


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n, \text{inel.})$

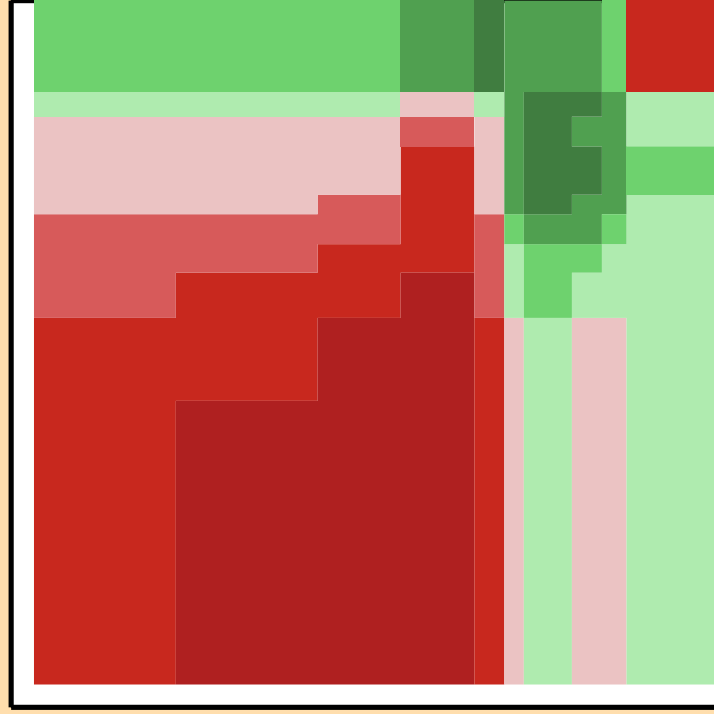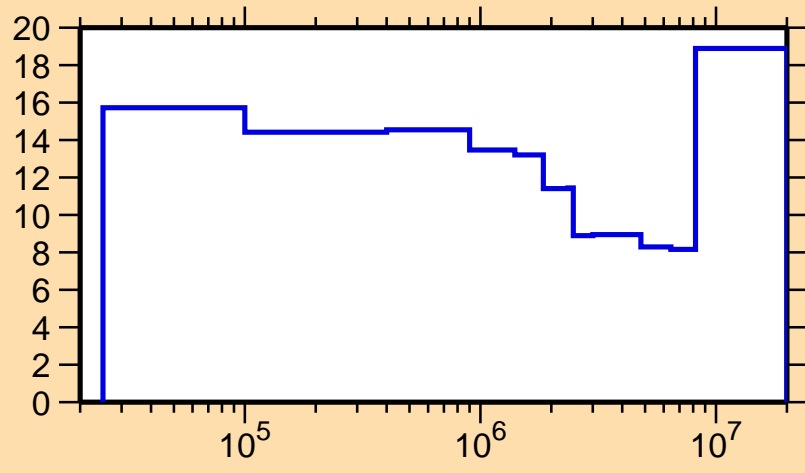

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

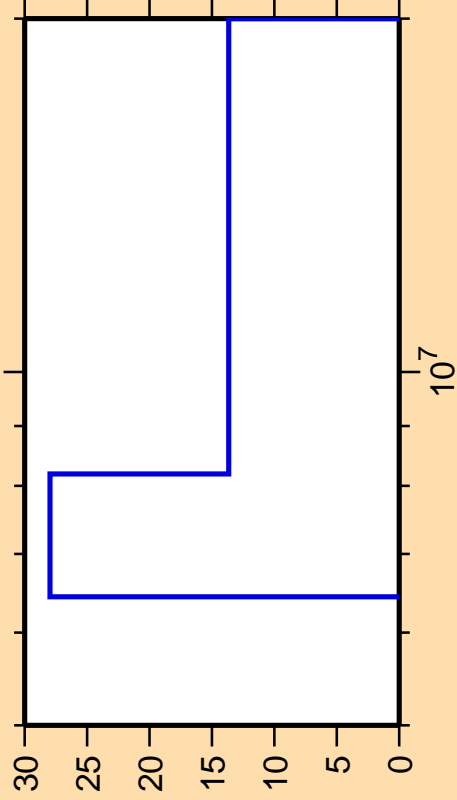

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{61}\text{Ni}(n,2n)$

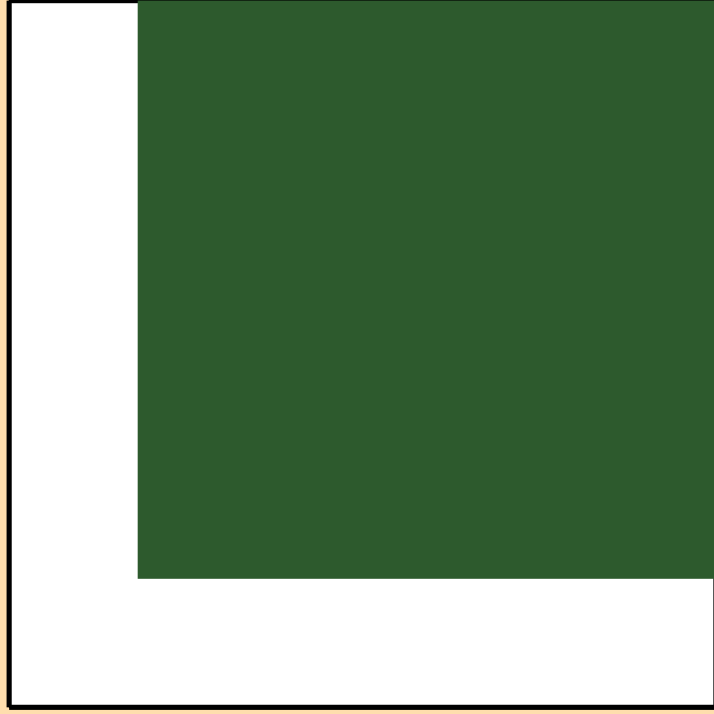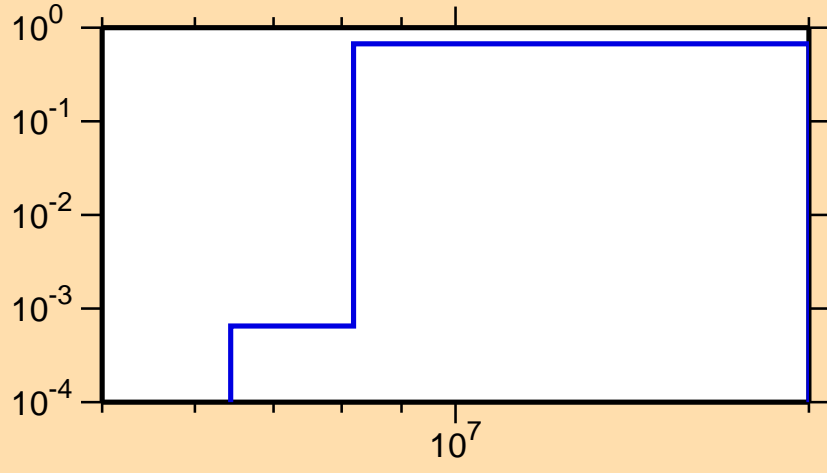

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n_1)$

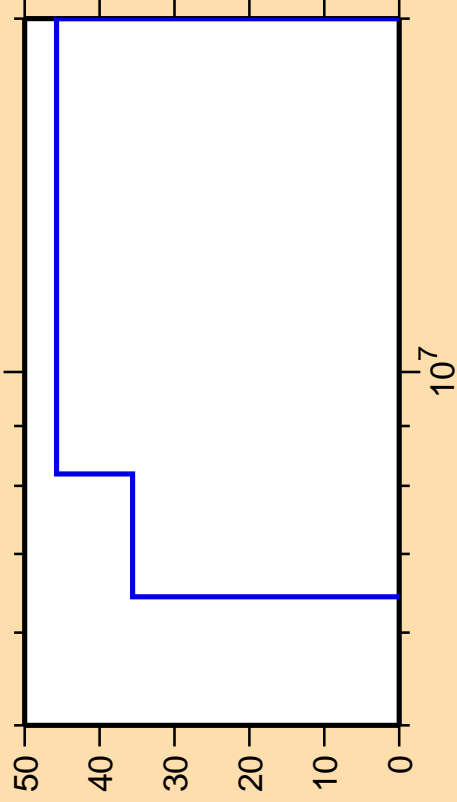

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

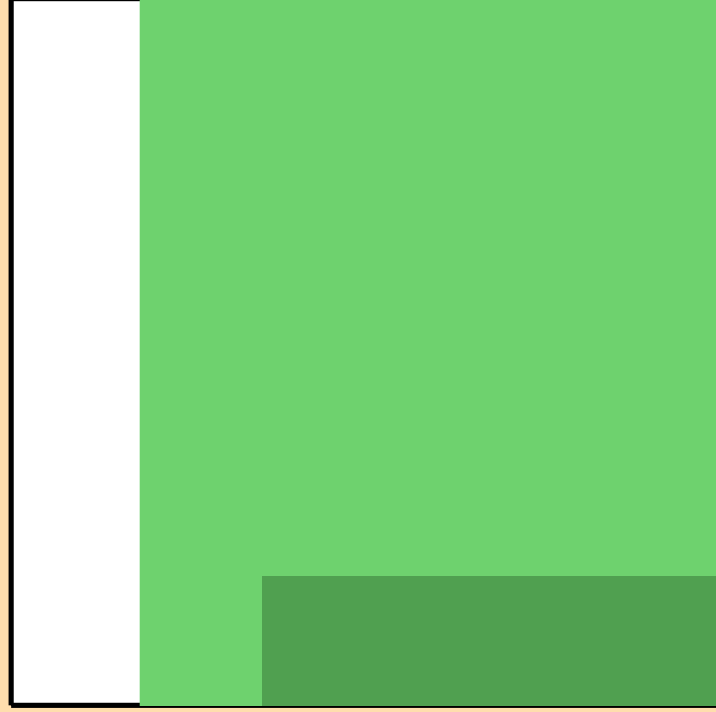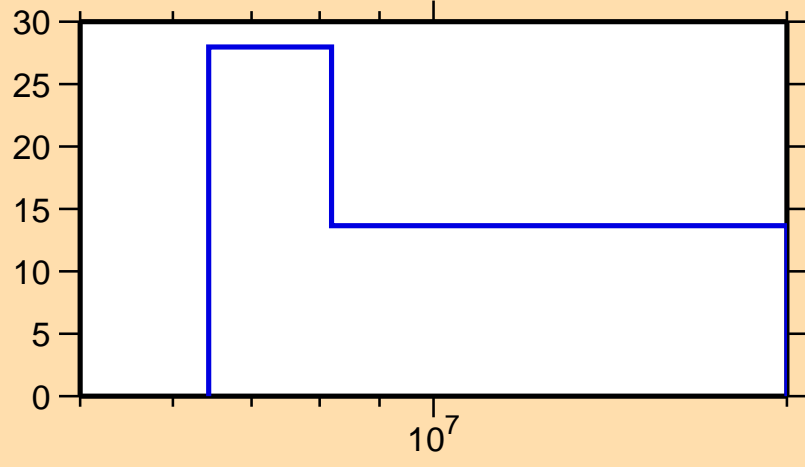

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n_{\text{cont}})$.

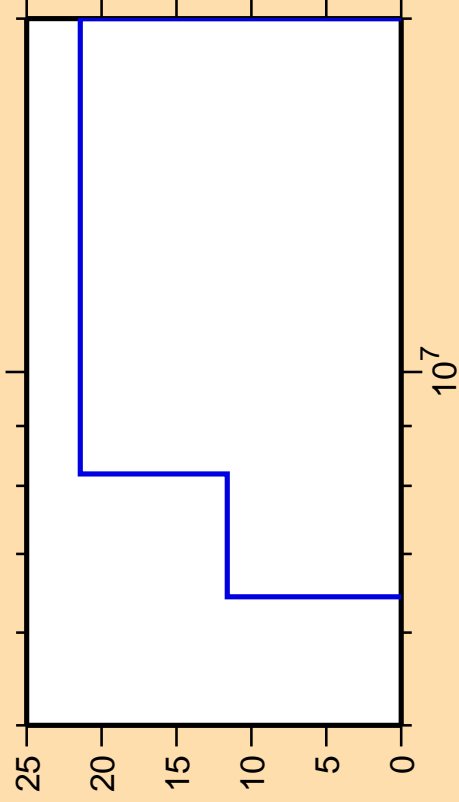

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

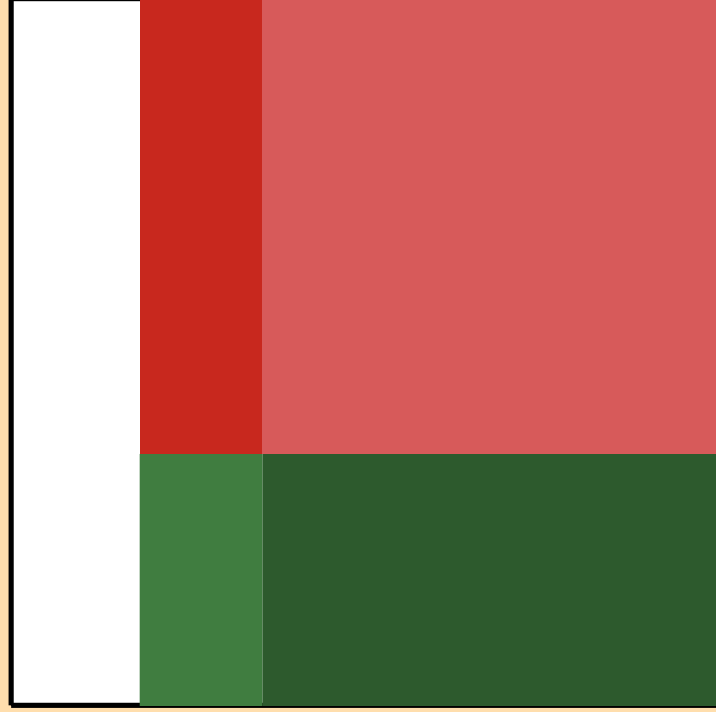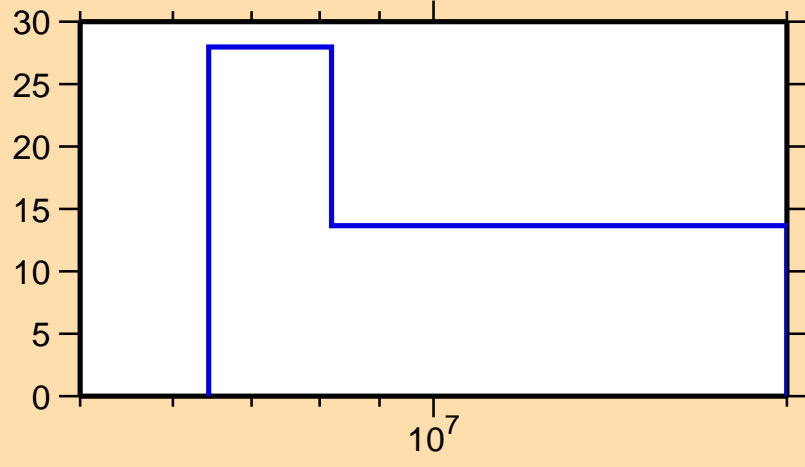

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\gamma)$


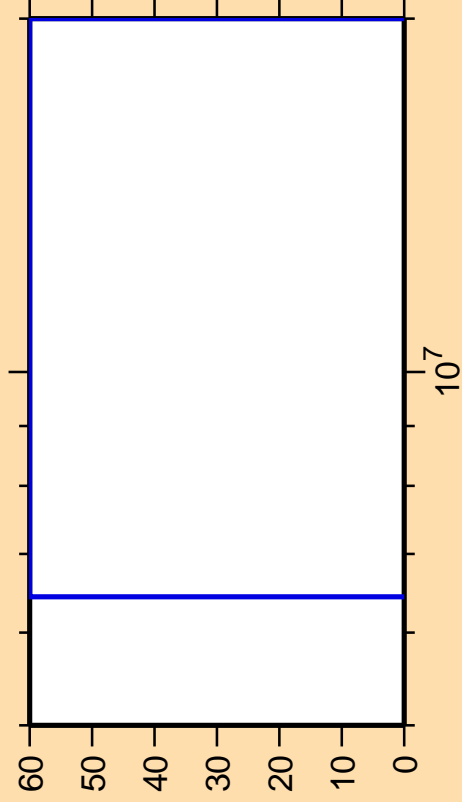


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

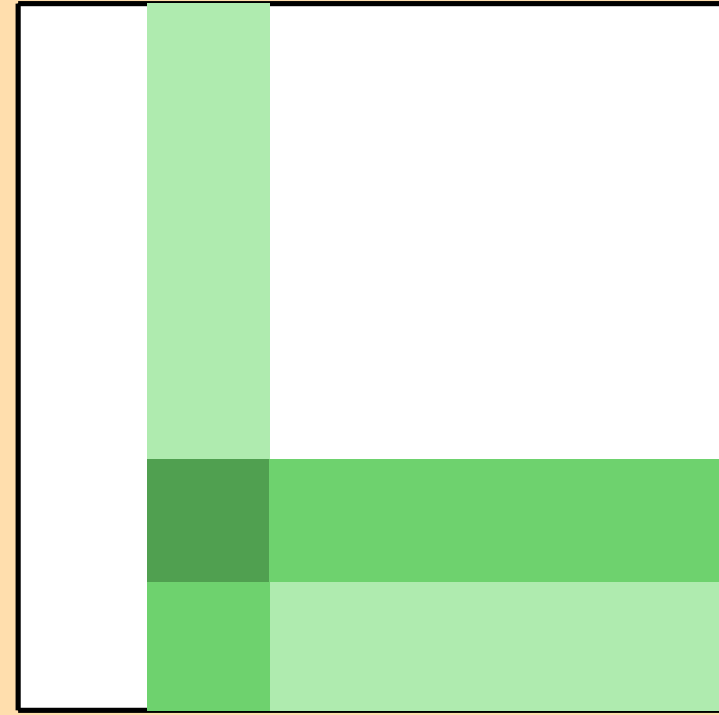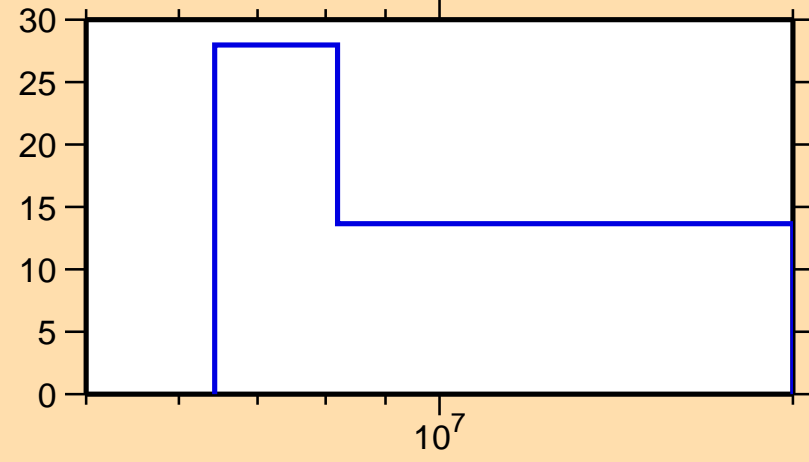

Correlation Matrix

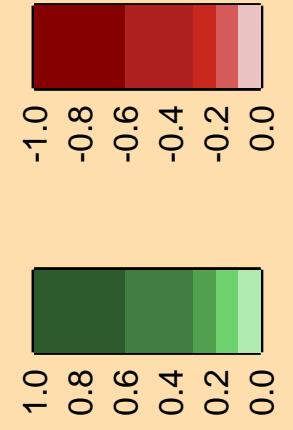



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,p)$

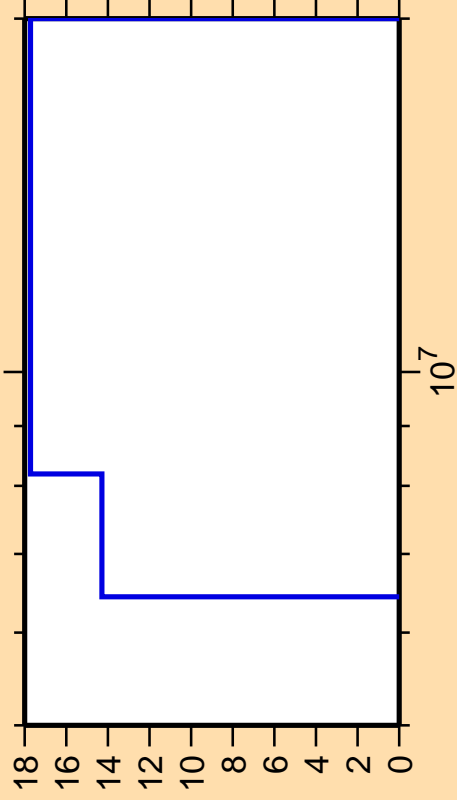

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

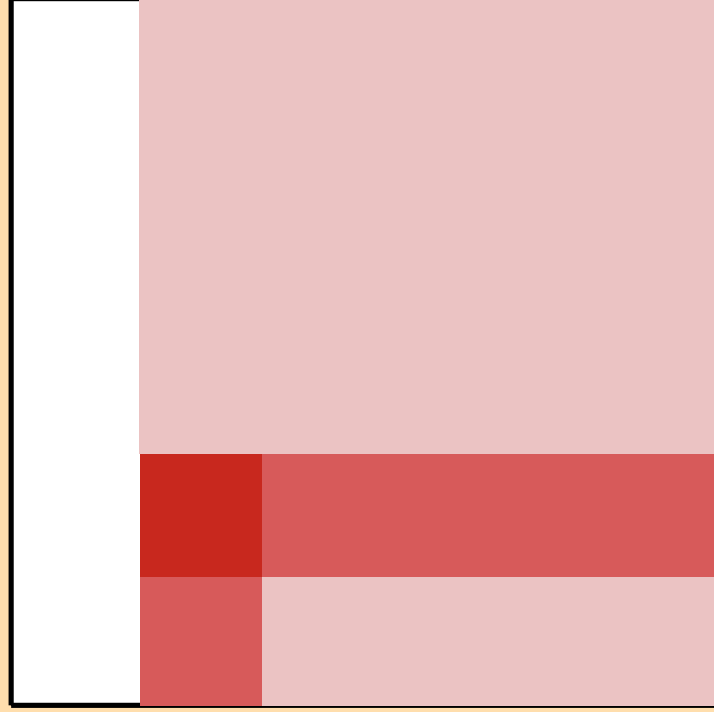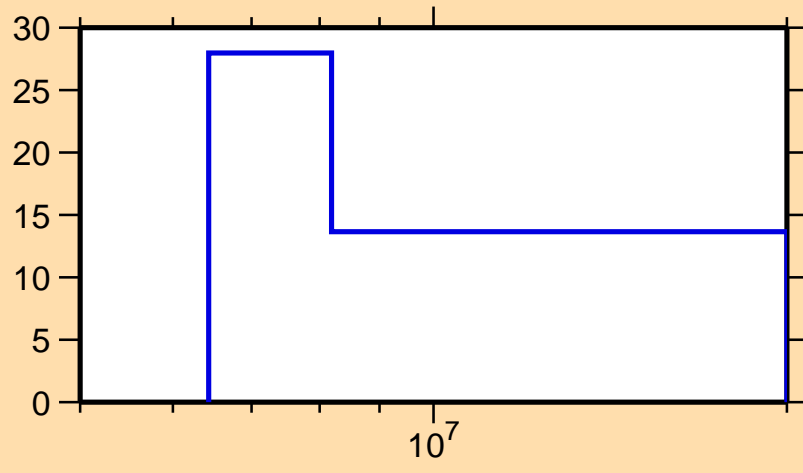

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\alpha)$


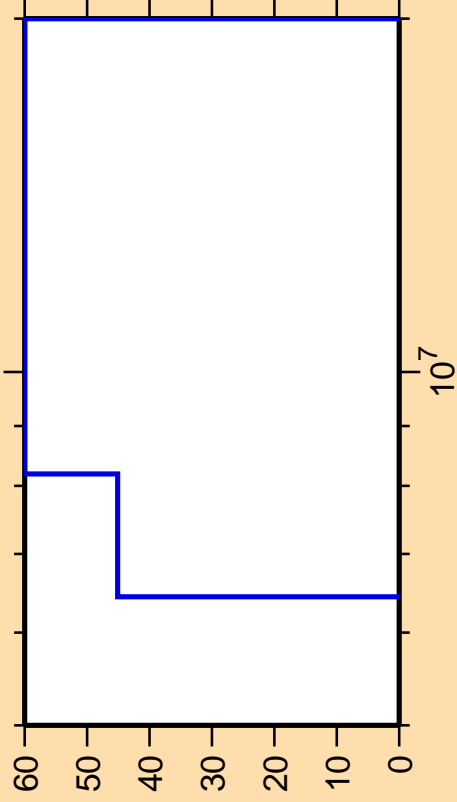


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n)$

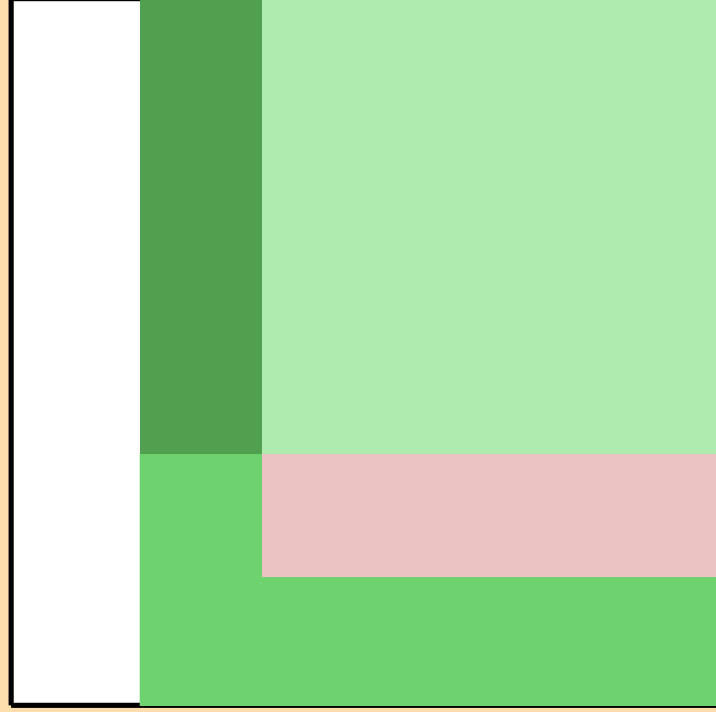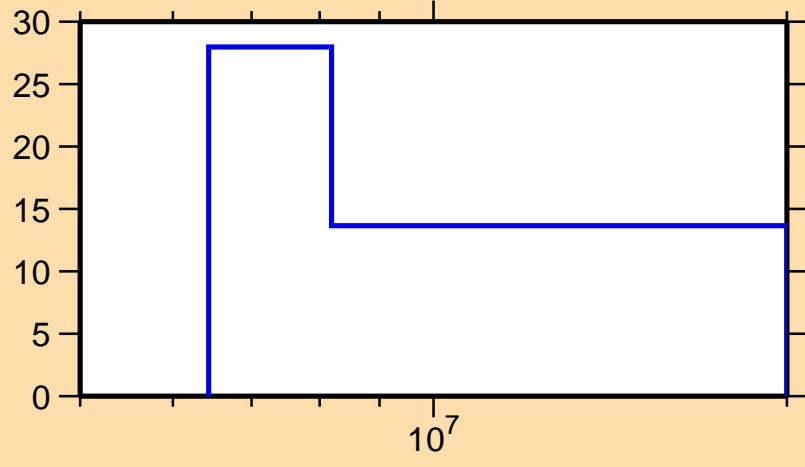

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,3n)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{61}\text{Ni}(n,3n)$

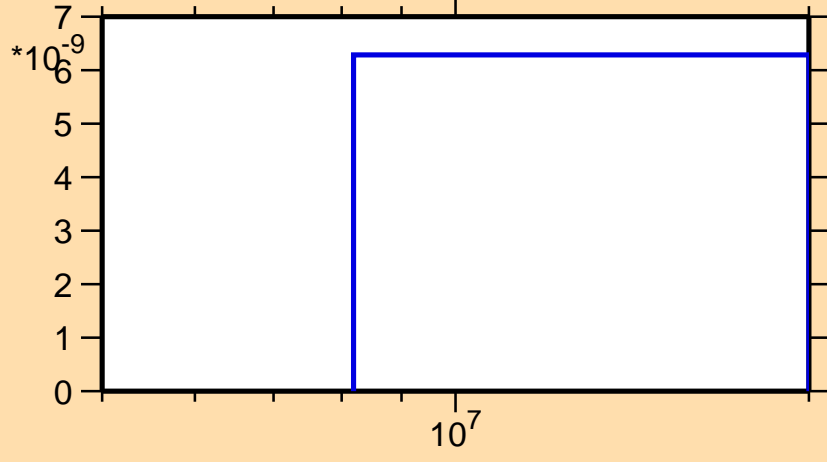

Correlation Matrix




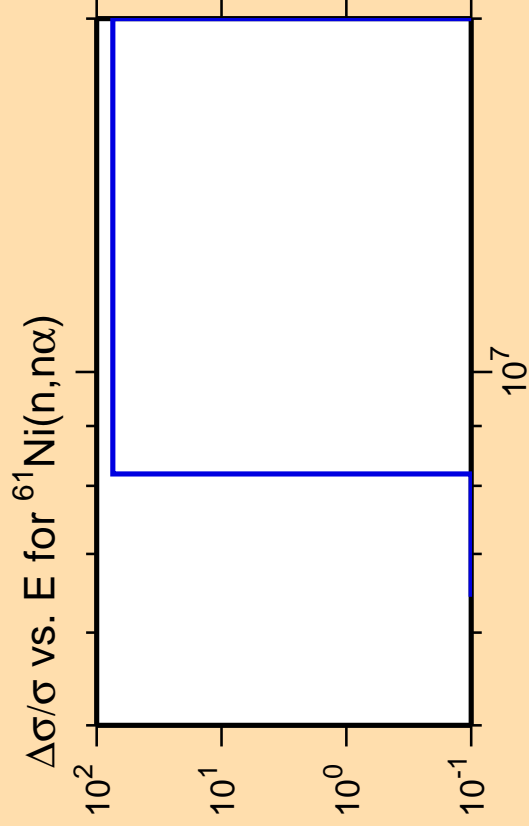


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

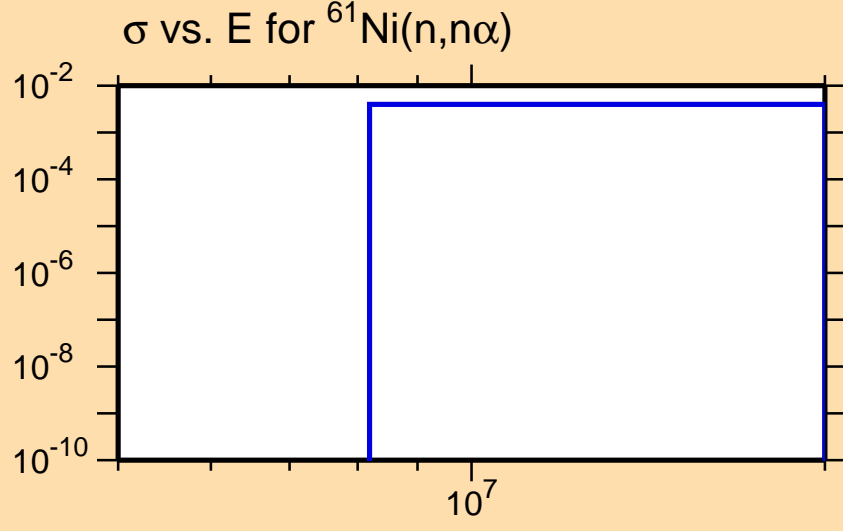

σ vs. E for $^{61}\text{Ni}(n,n\alpha)$

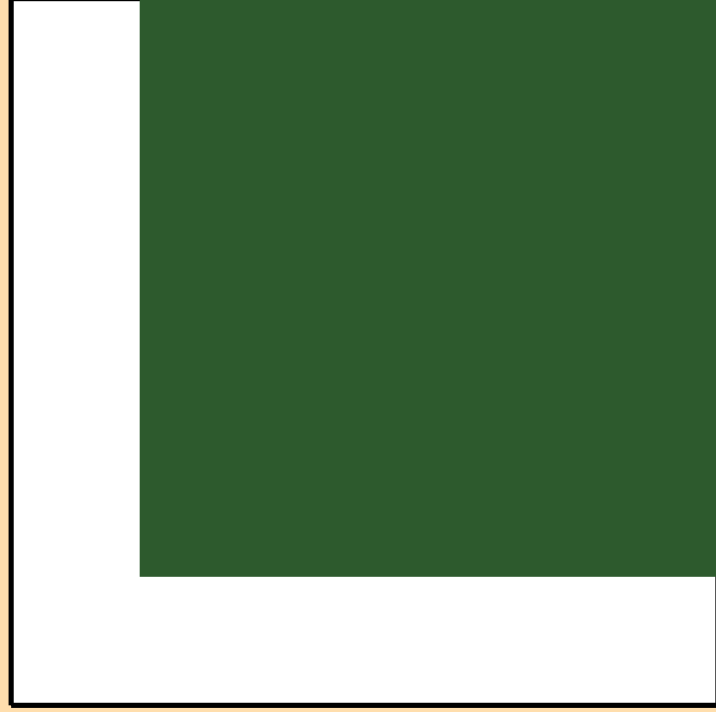

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2n\alpha)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{61}\text{Ni}(n,2n\alpha)$

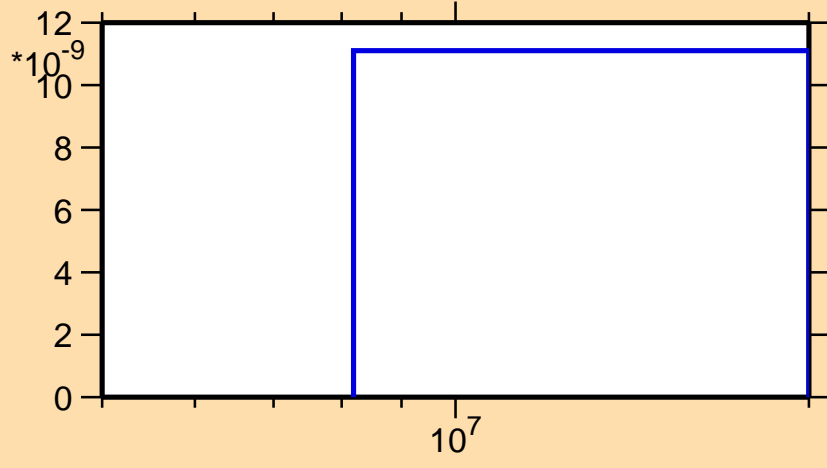


Warning: some uncertainty data were suppressed.



Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,np)$

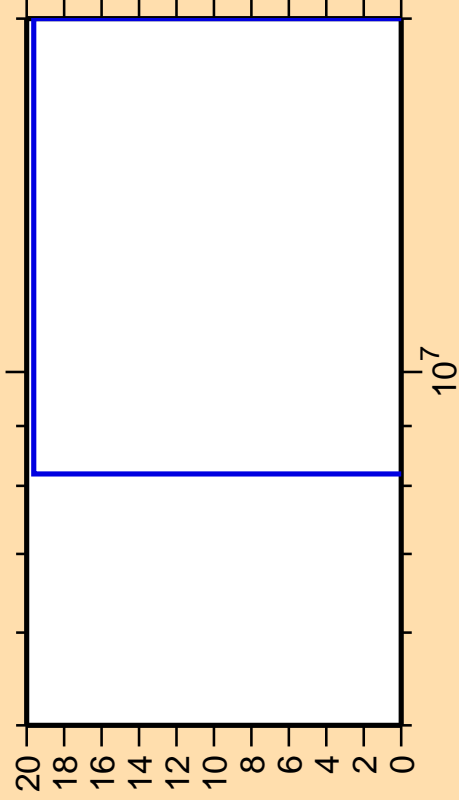

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{61}\text{Ni}(n,np)$

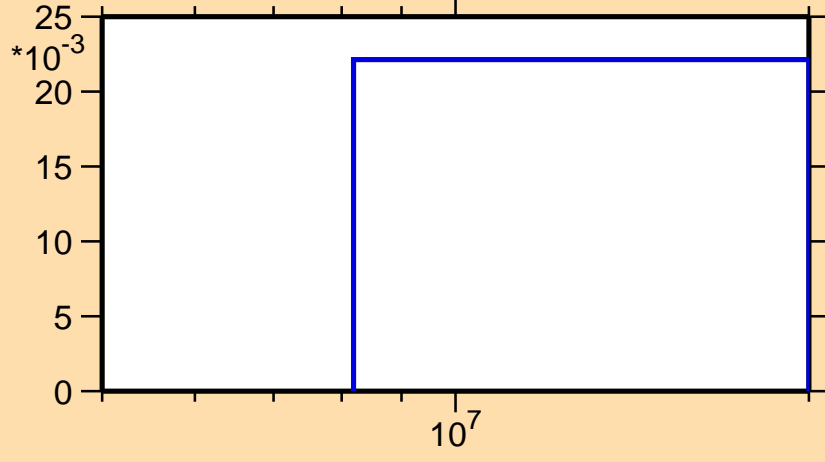

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{nd})$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{61}\text{Ni}(n,\text{nd})$

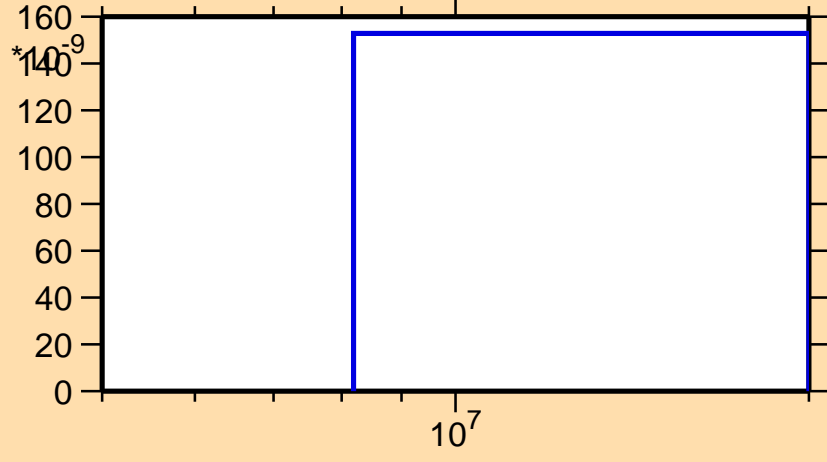

160
140
120
100
80
60
40
20
0

10^7



Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,2np)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{61}\text{Ni}(n,2np)$

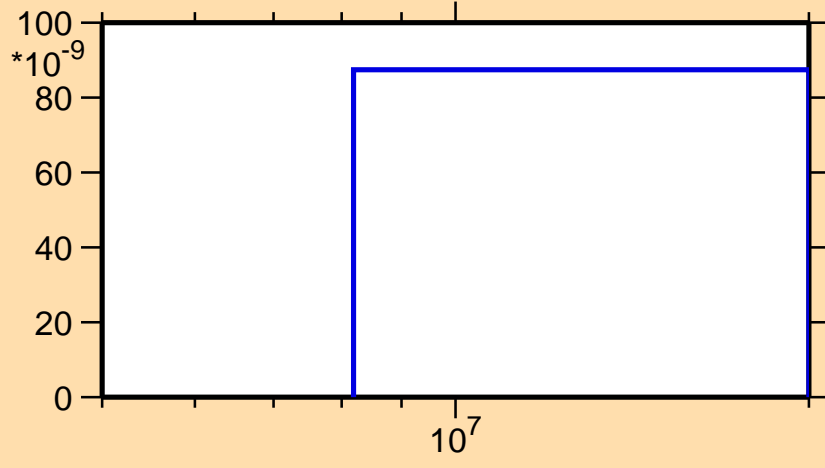



Correlation Matrix



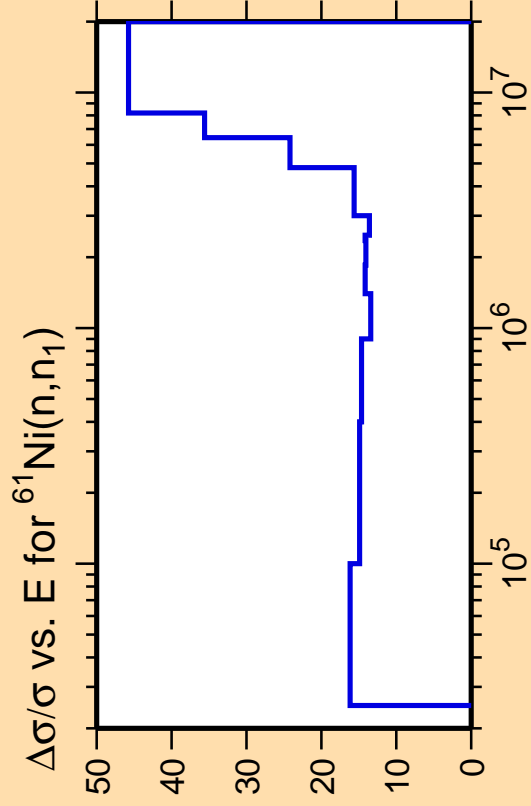

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

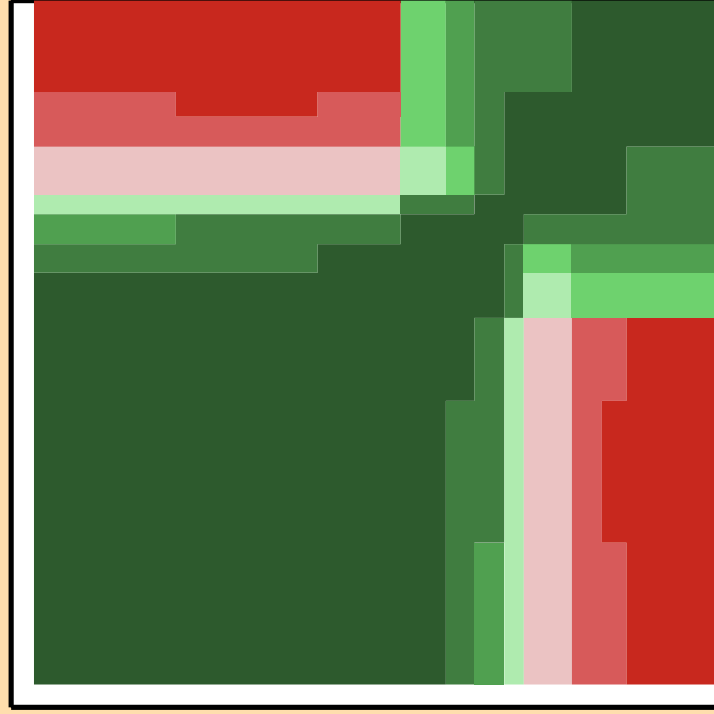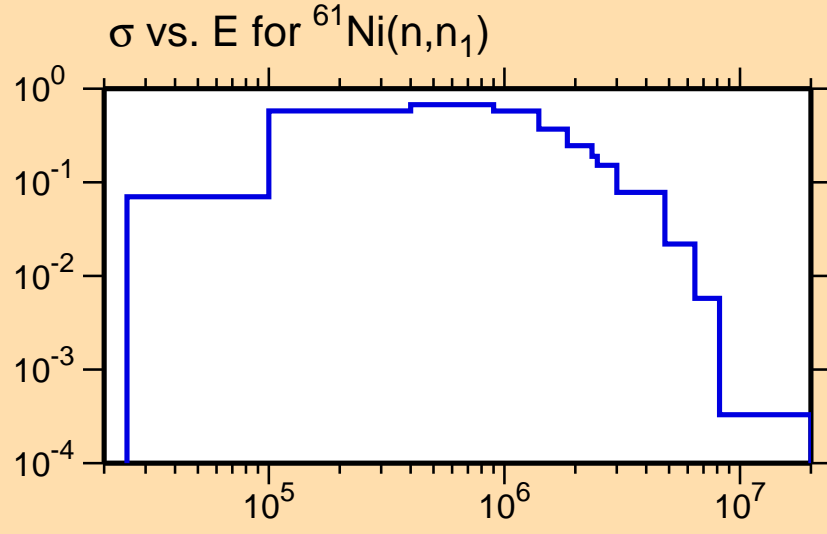

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n_{\text{cont}})$.

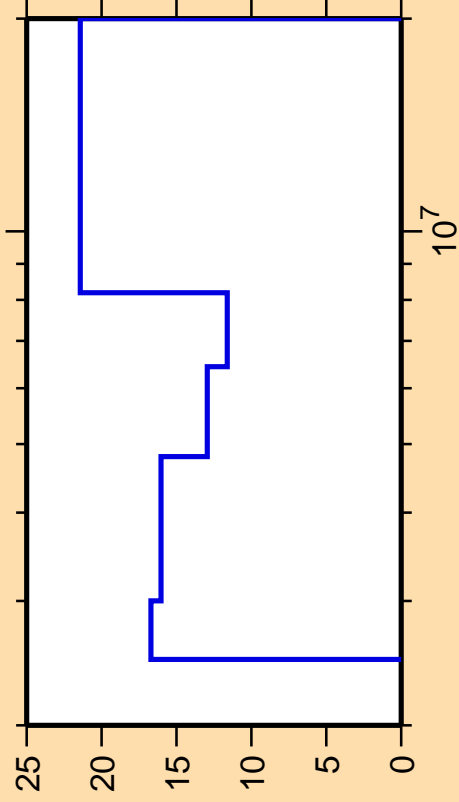

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n_1)$

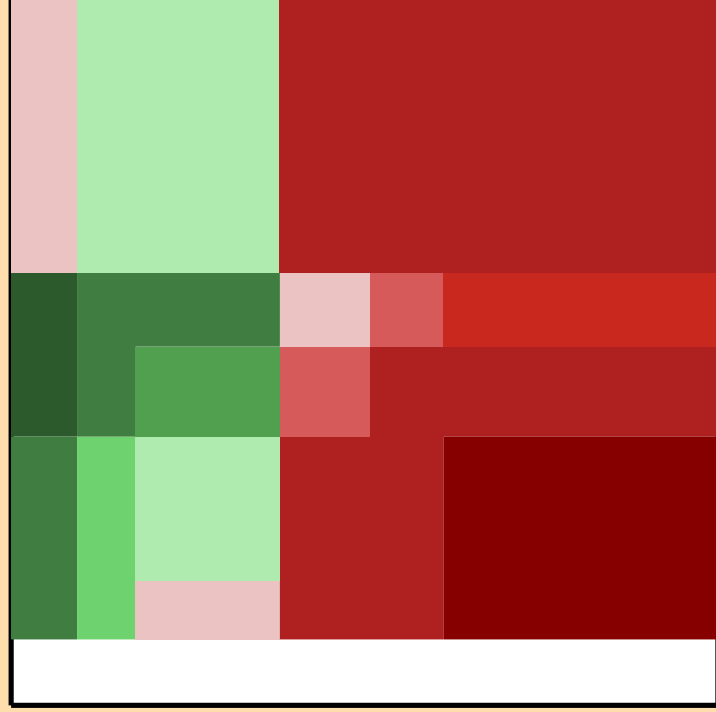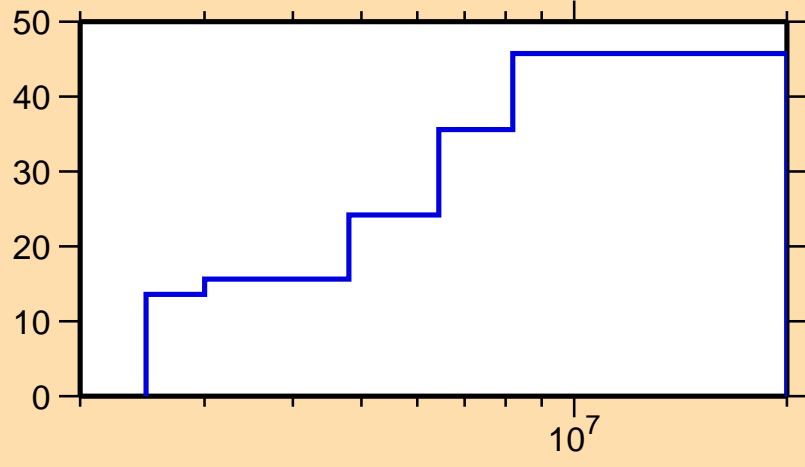

Correlation Matrix




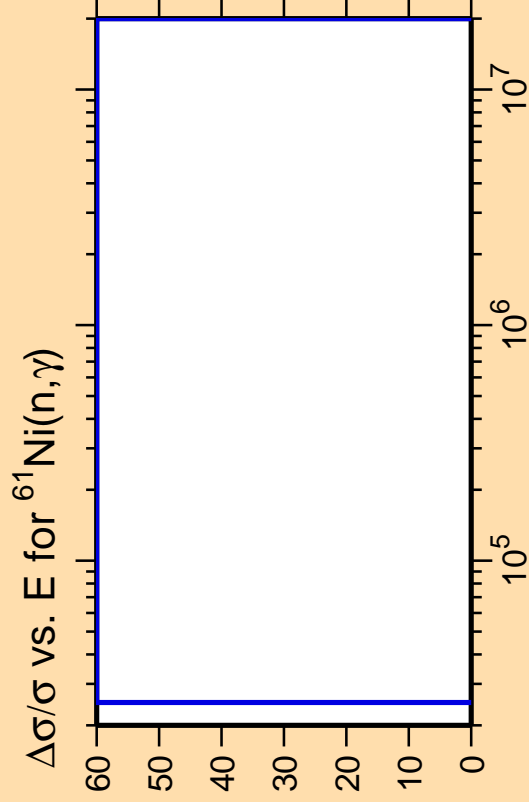

Ordinate scale is %
relative standard deviation.




Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

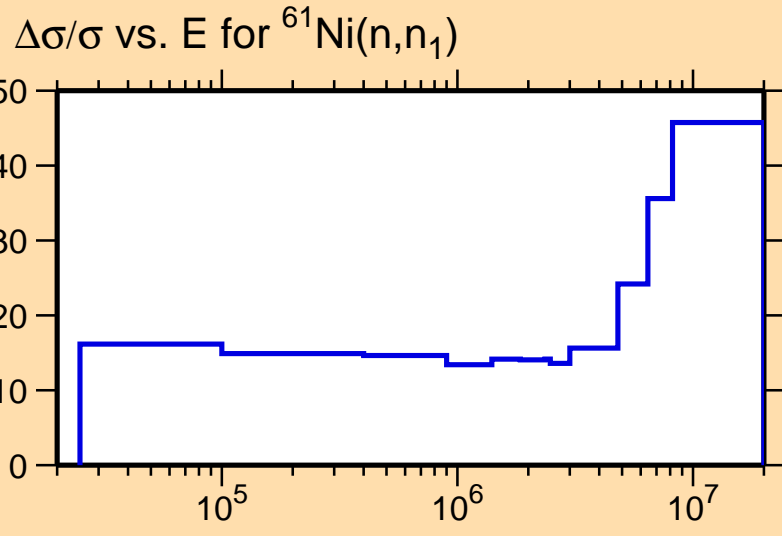



Correlation Matrix



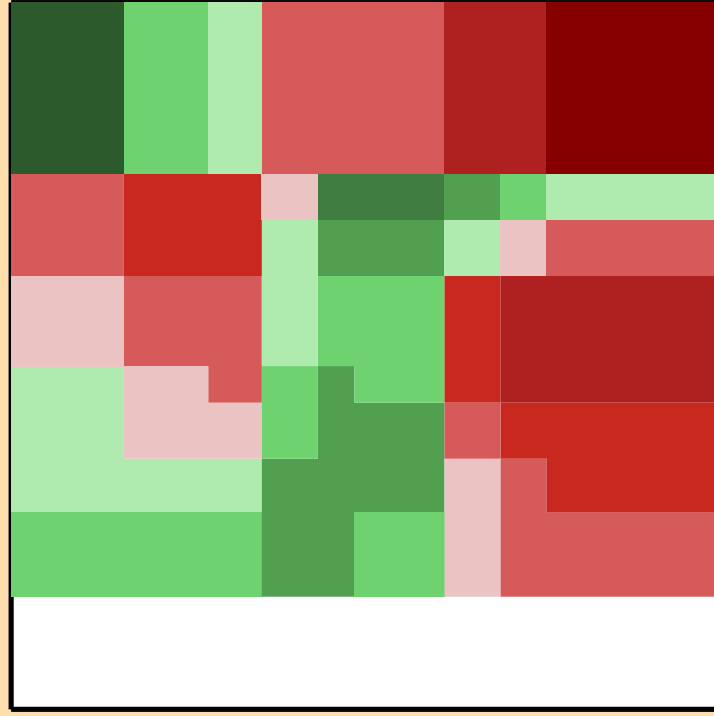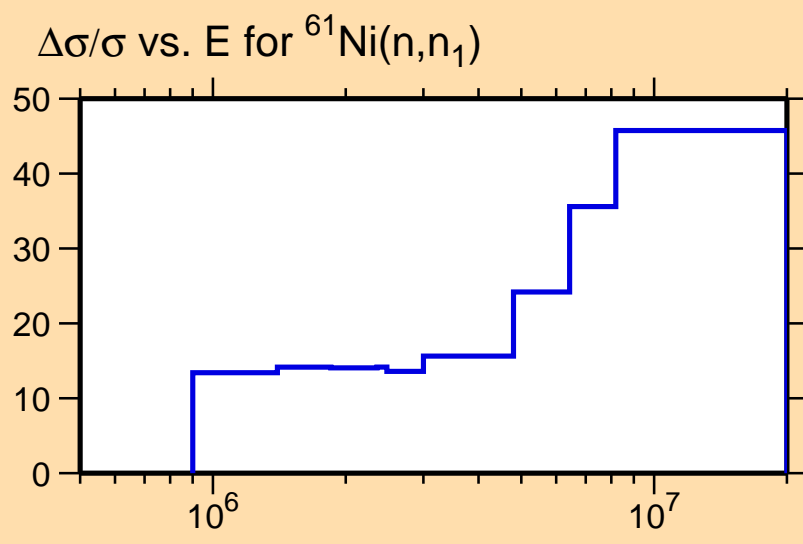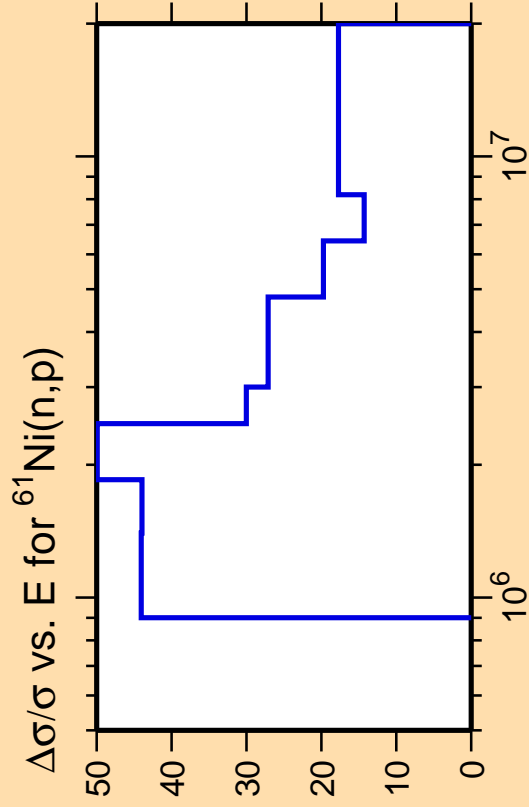

Correlation Matrix

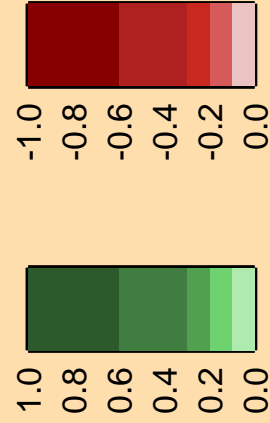


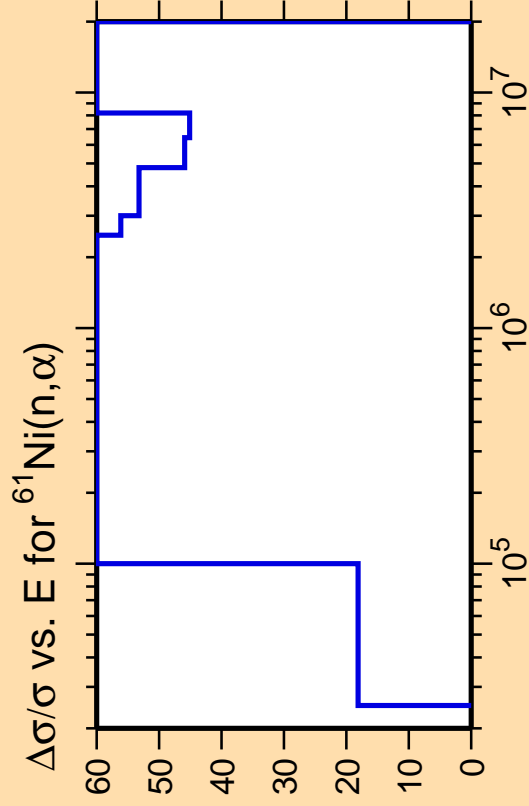


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n_1)$

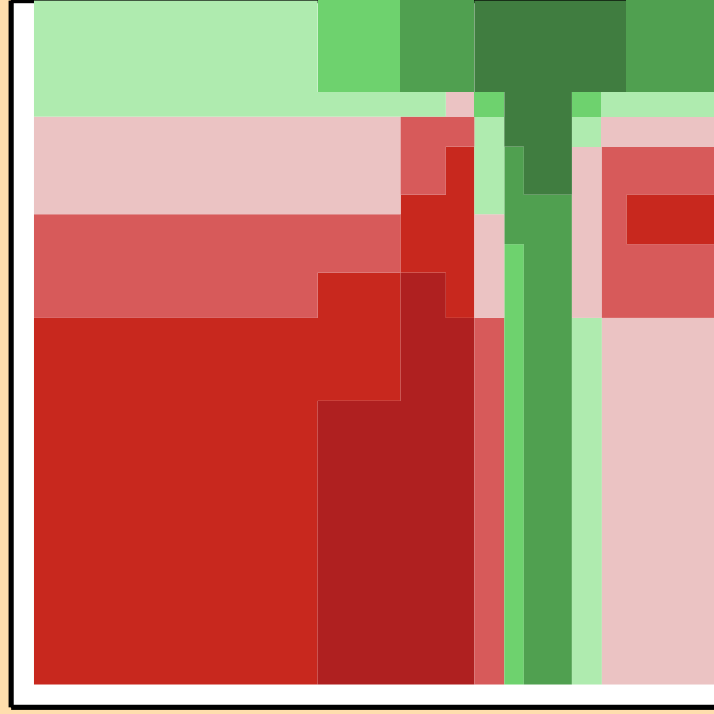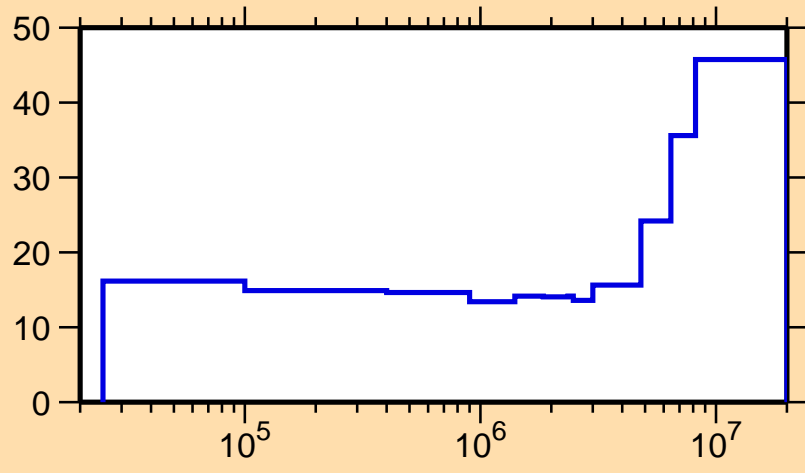

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n_2)$

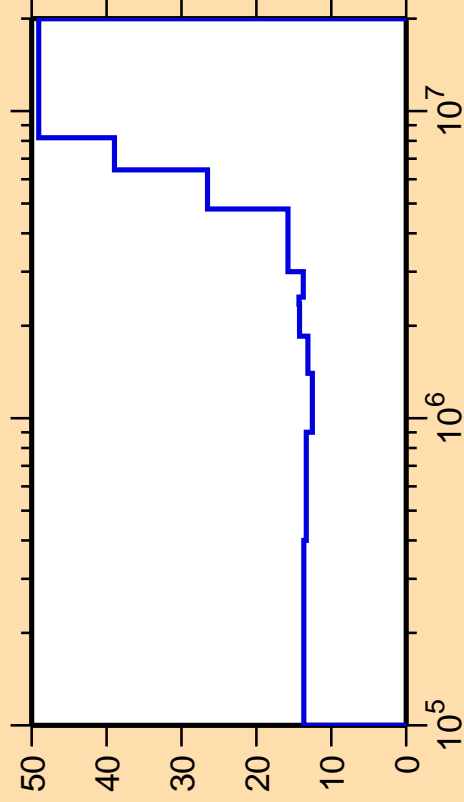

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{61}\text{Ni}(n,n_2)$

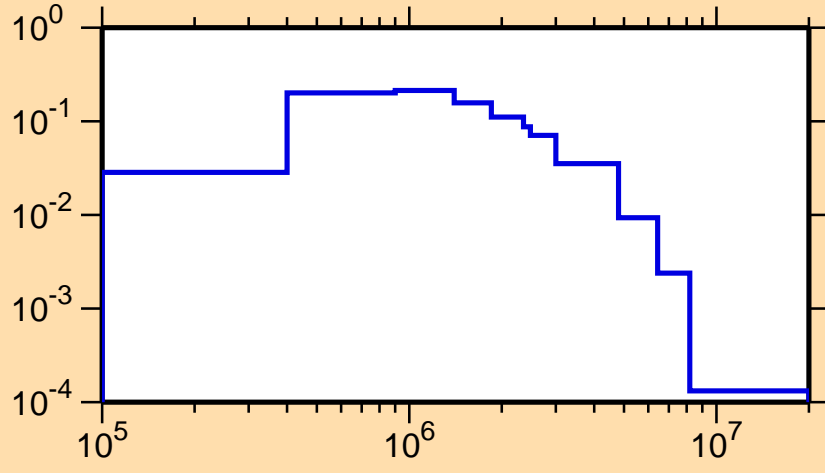

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n_3)$

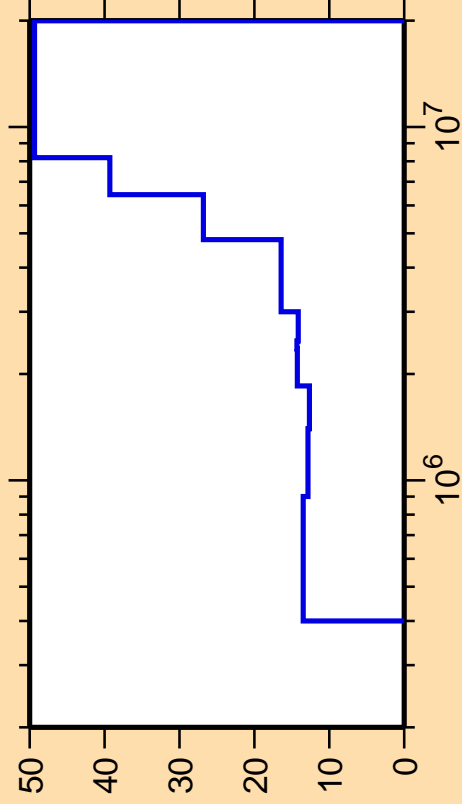

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{61}\text{Ni}(n,n_3)$

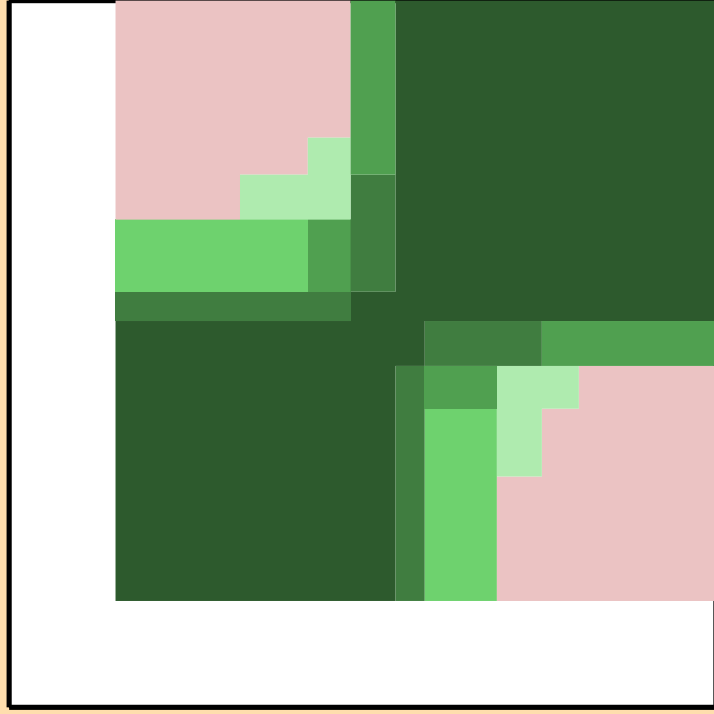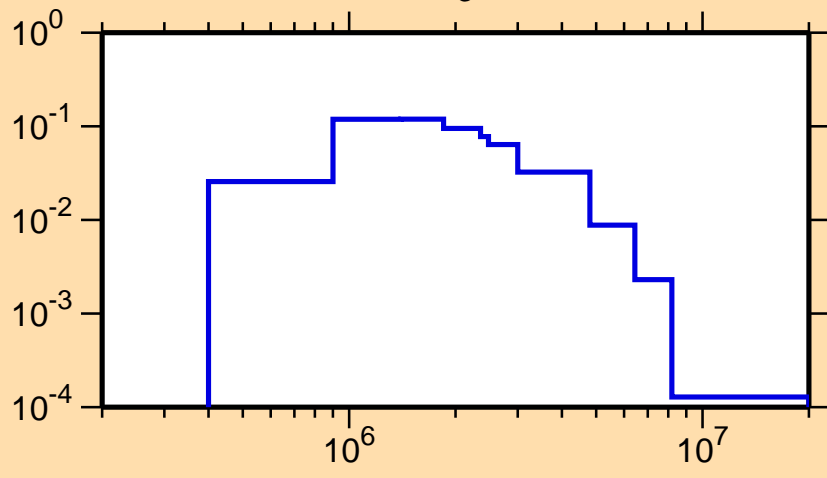



Correlation Matrix



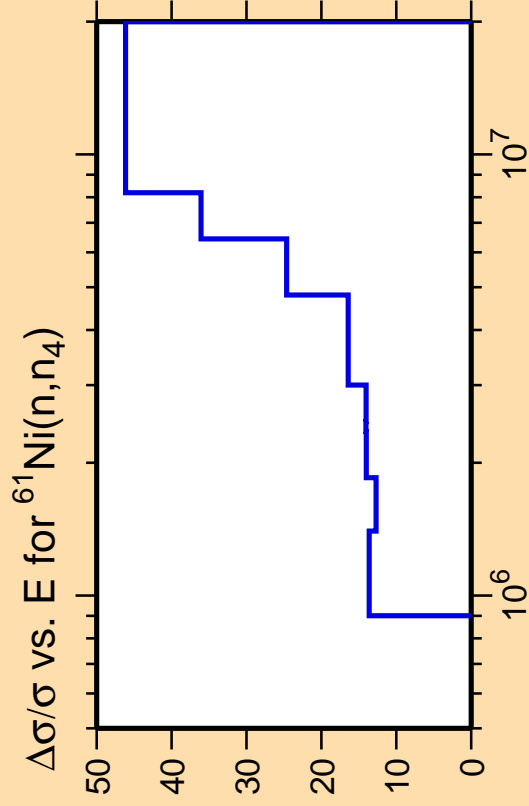

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

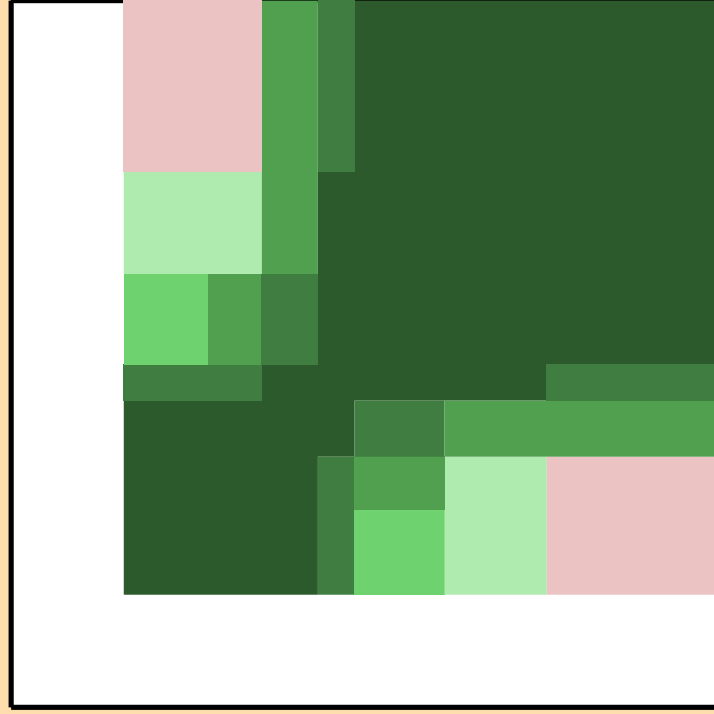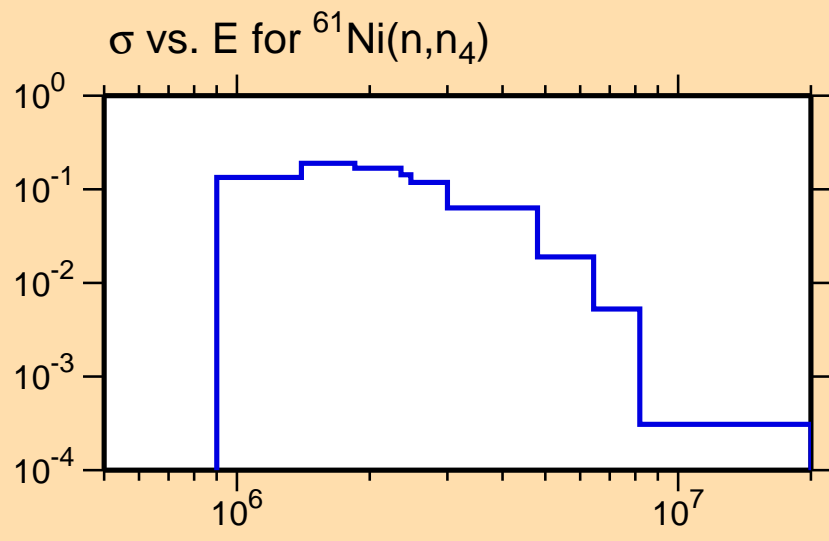

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

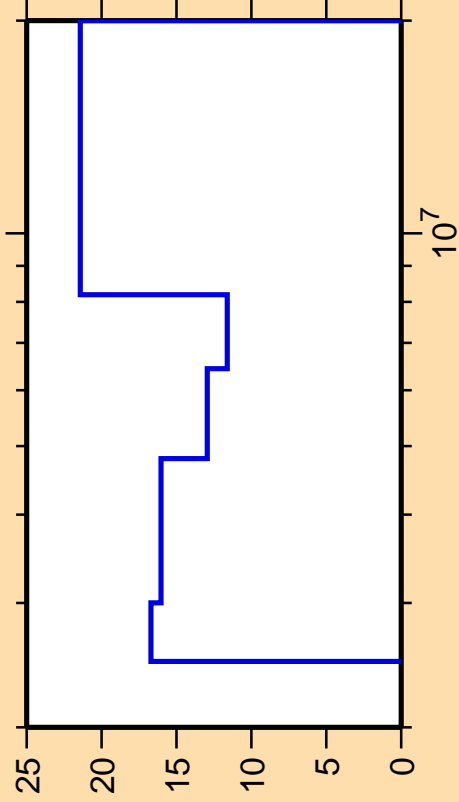

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

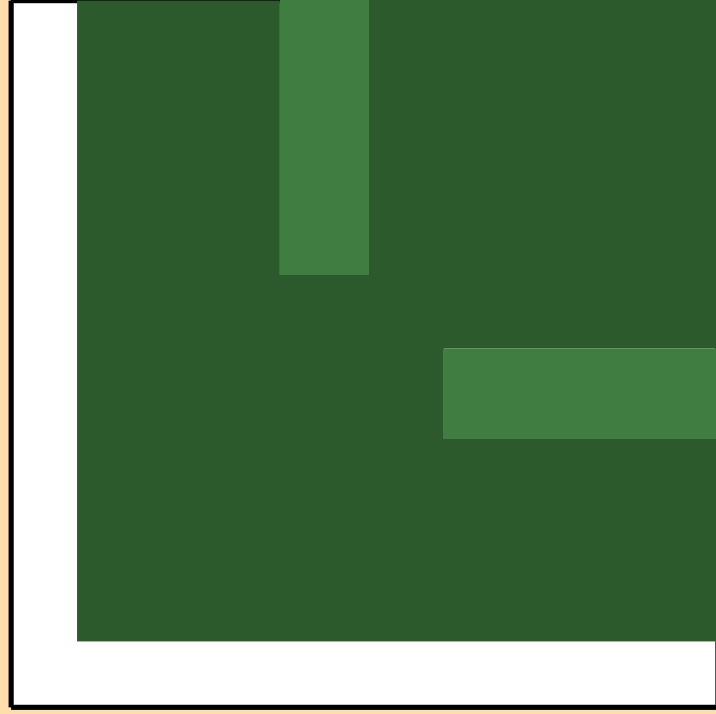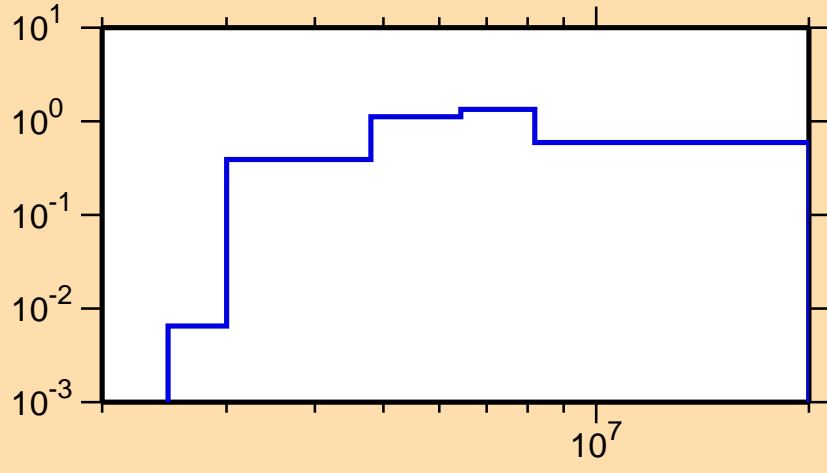

Correlation Matrix





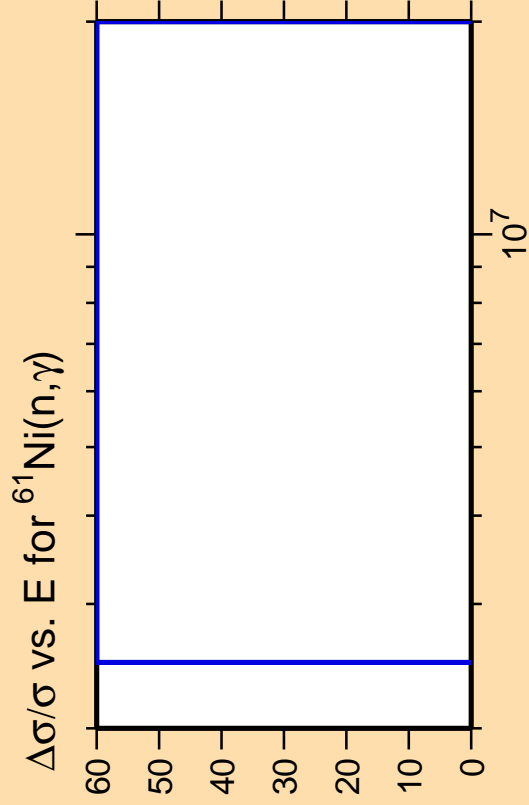

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

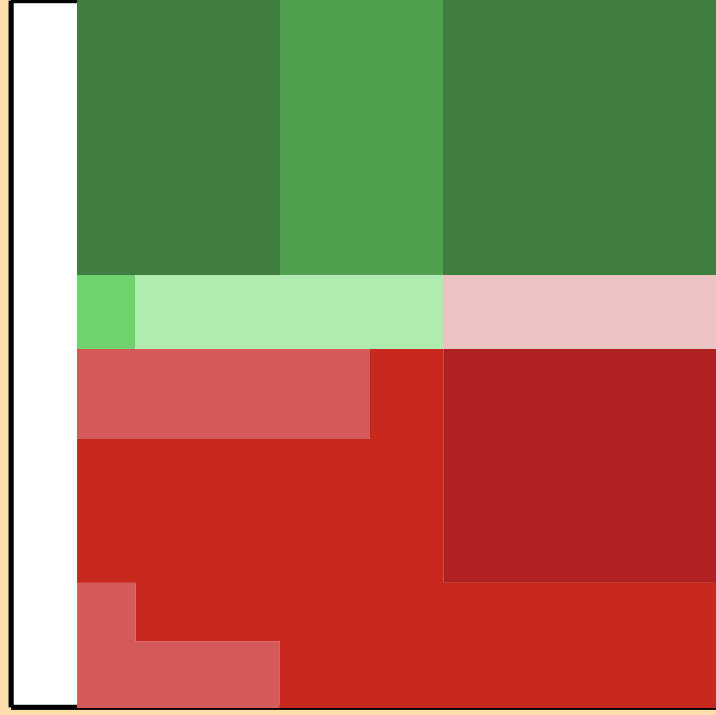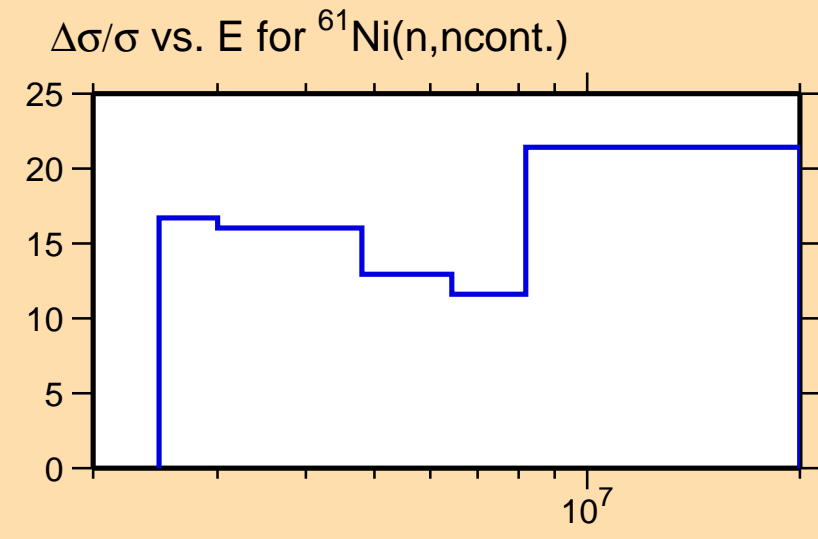

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,p)$

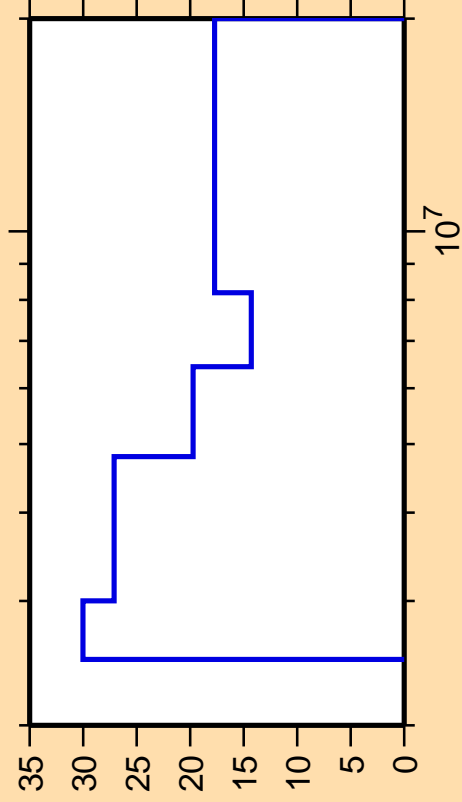

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

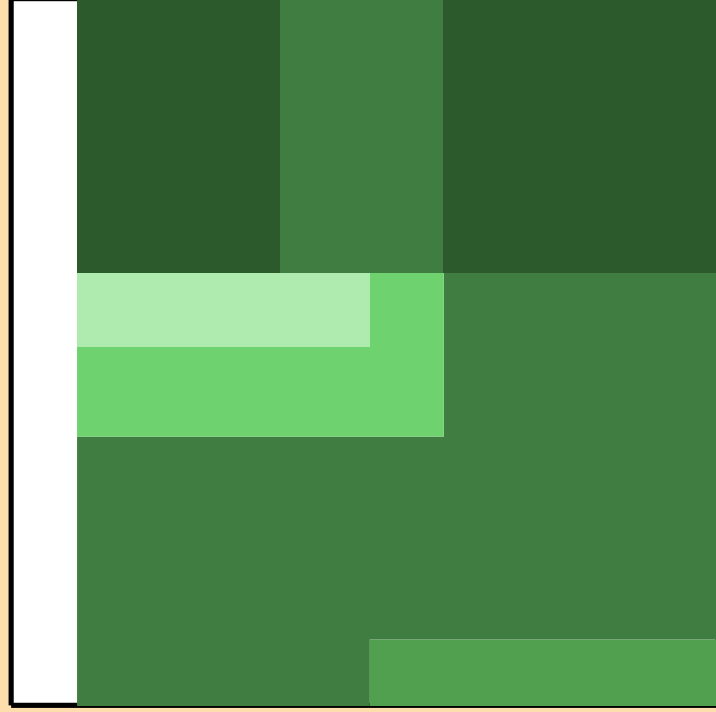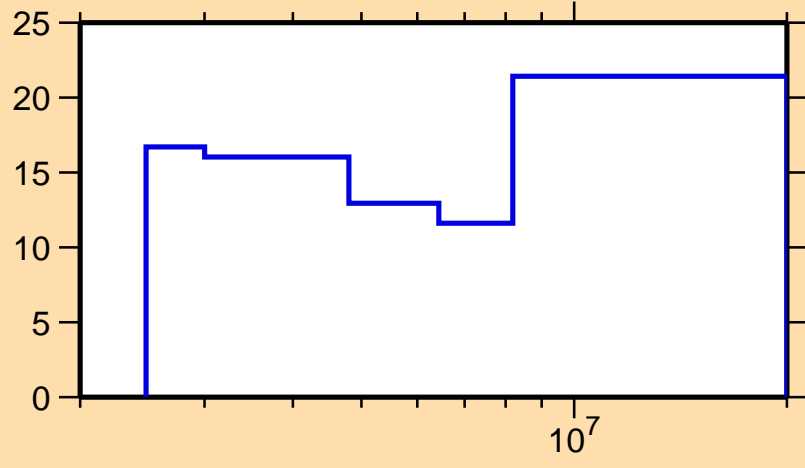

Correlation Matrix



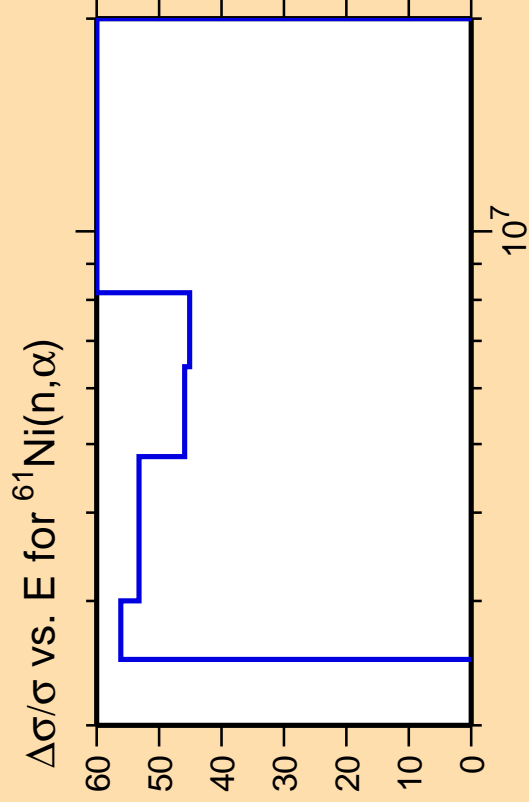


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,n\text{cont.})$

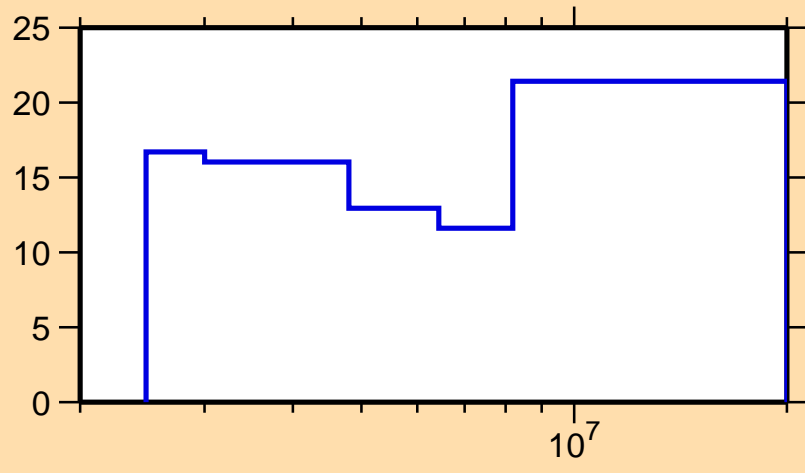


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\alpha)$

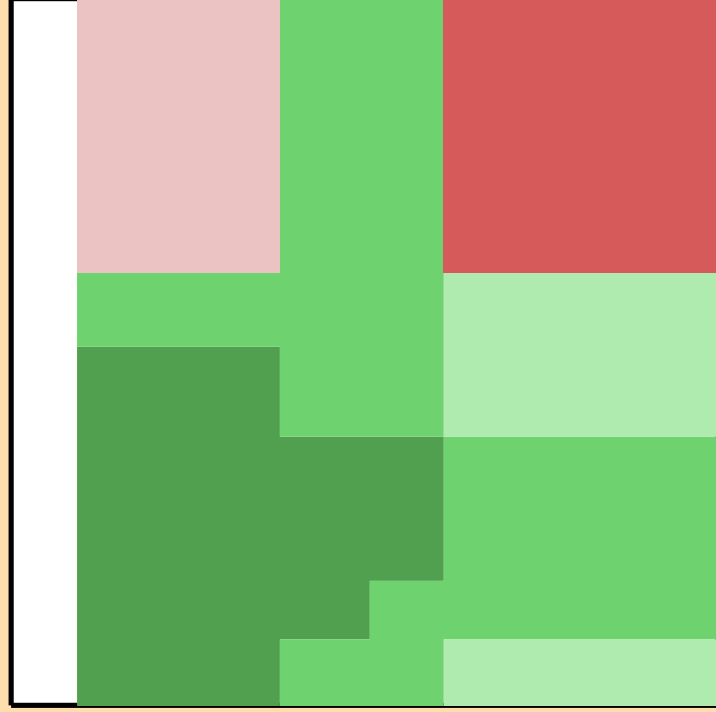

Correlation Matrix





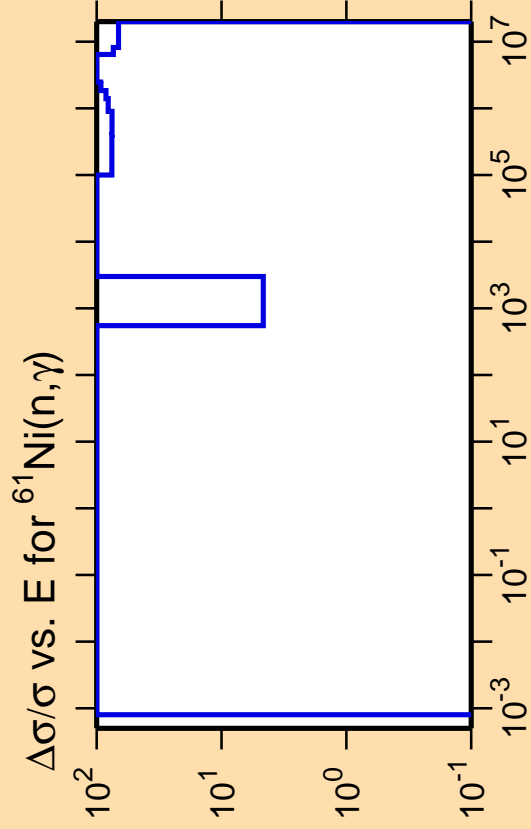

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

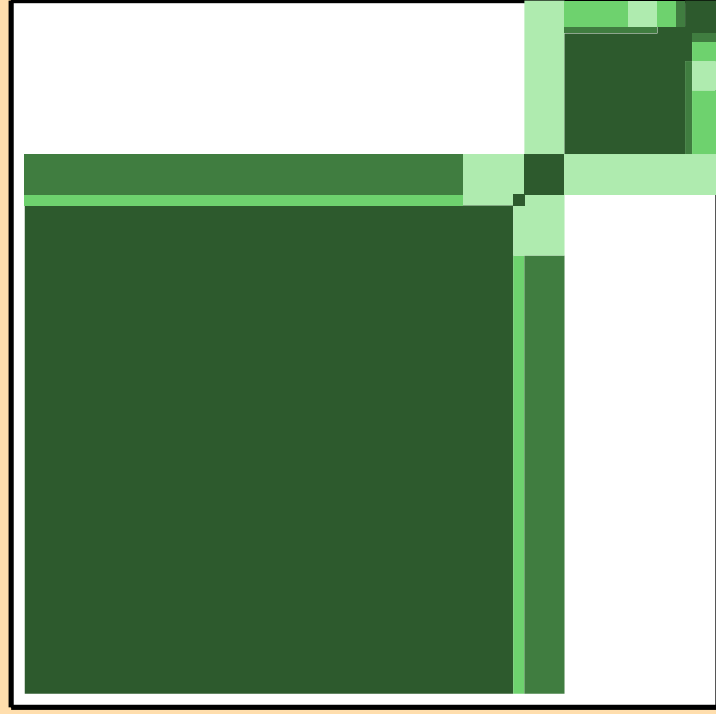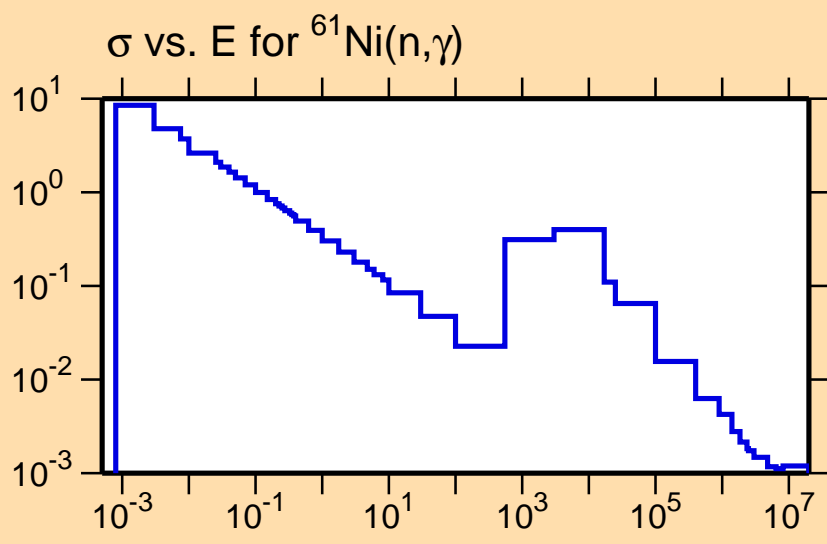

Correlation Matrix





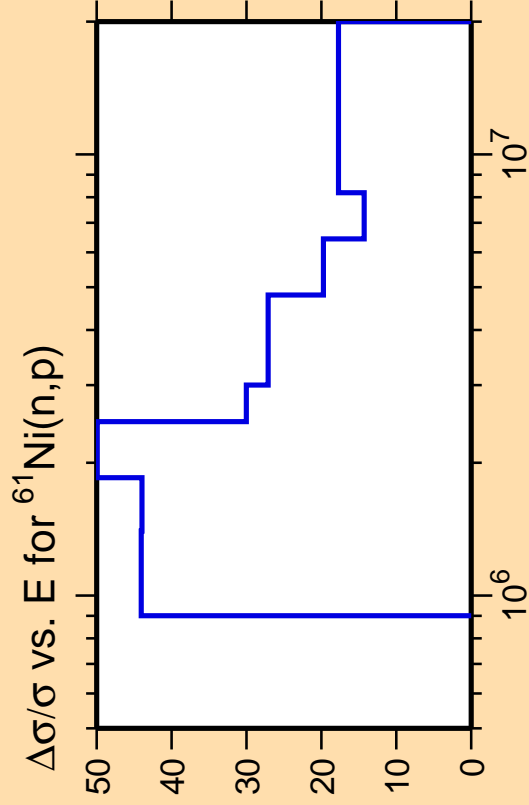

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

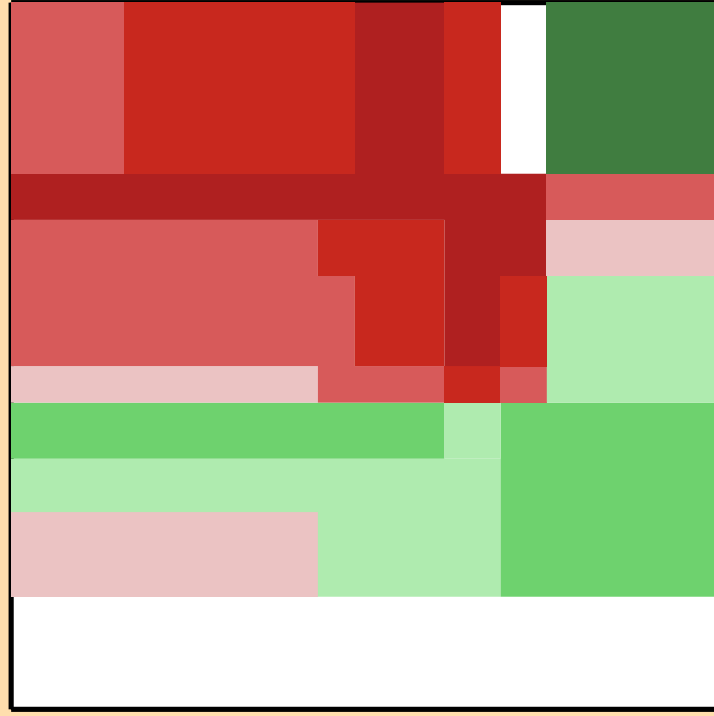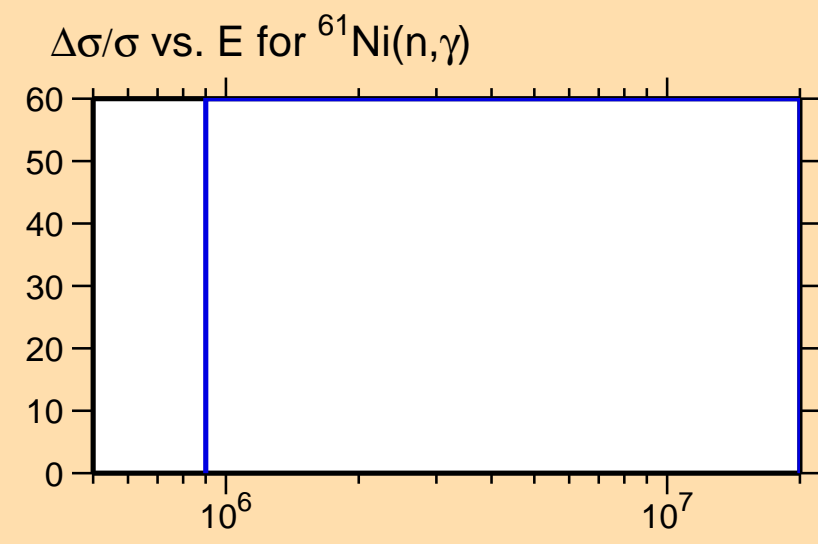

Correlation Matrix





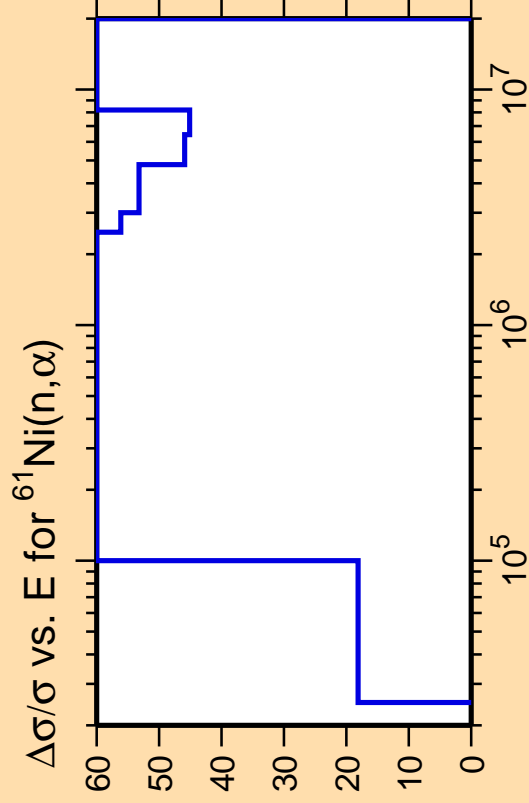


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

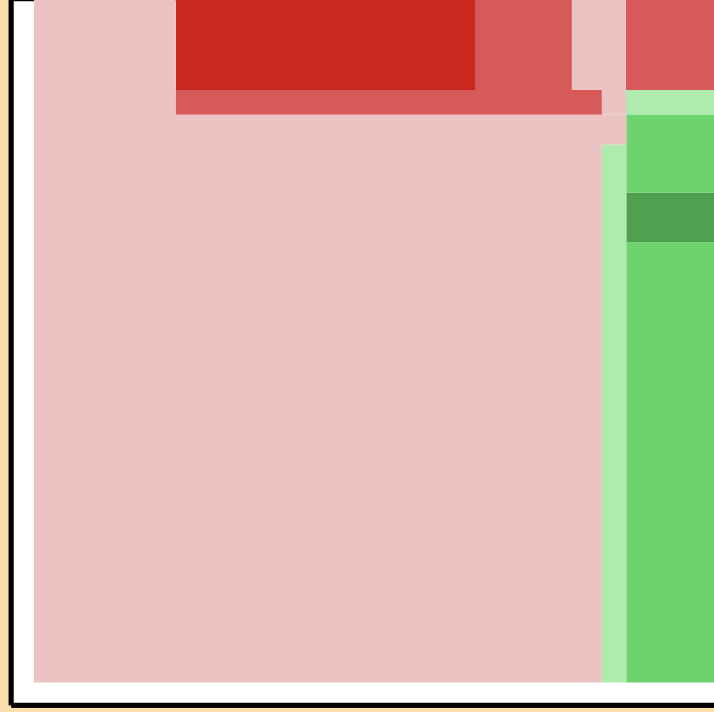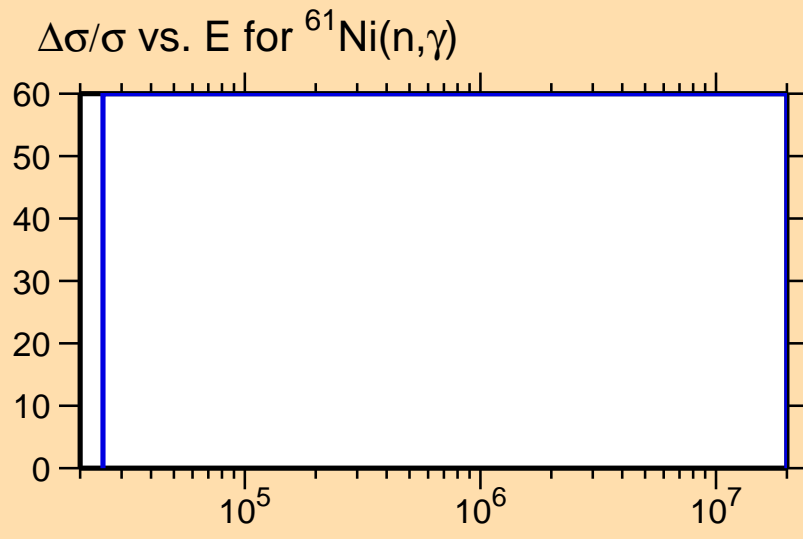



Correlation Matrix

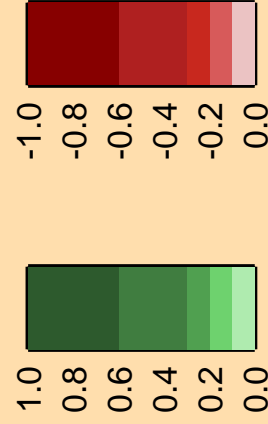

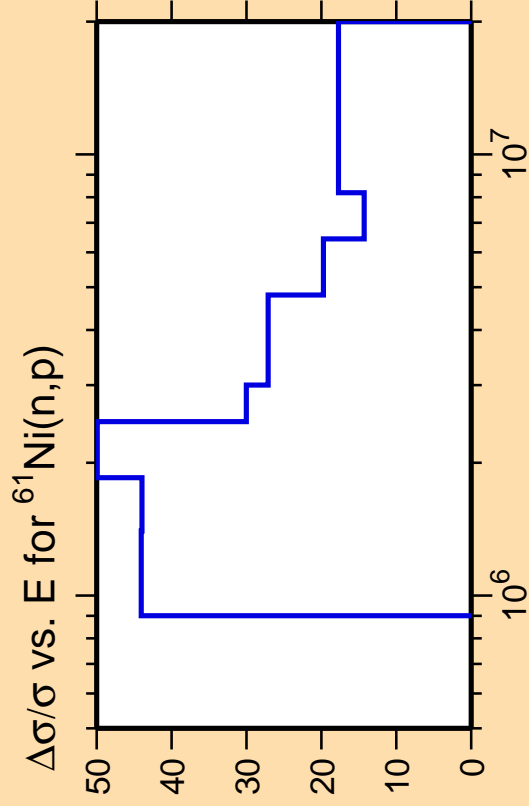


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

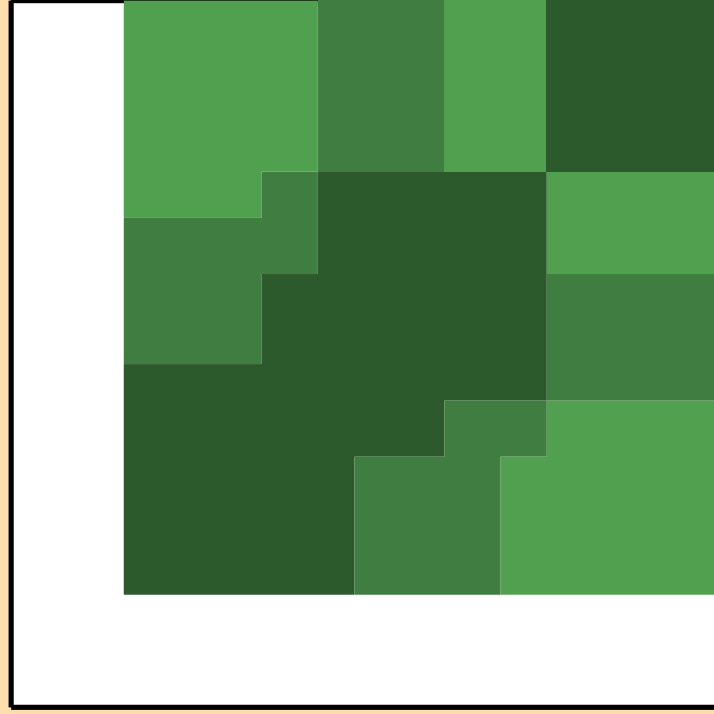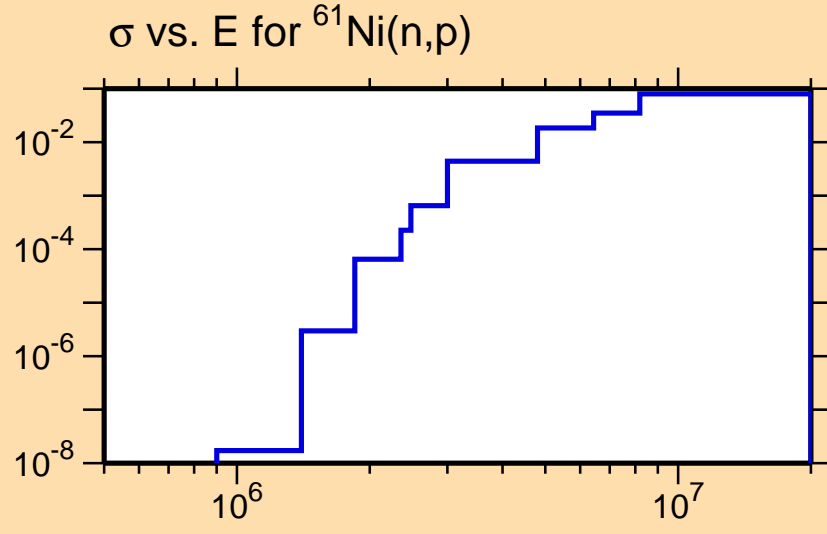

Correlation Matrix




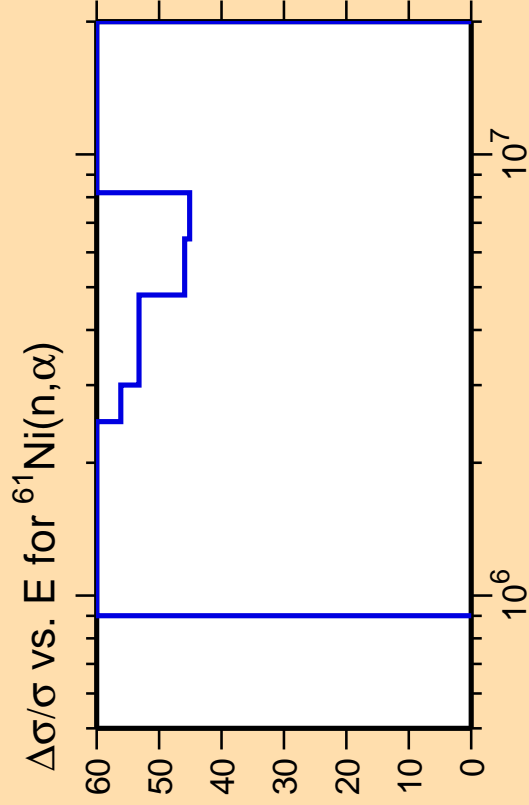


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,p)$

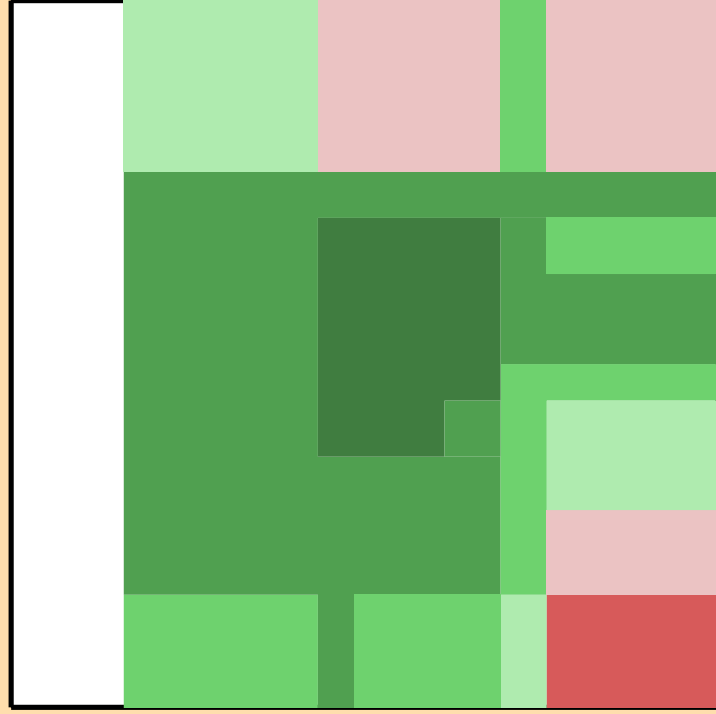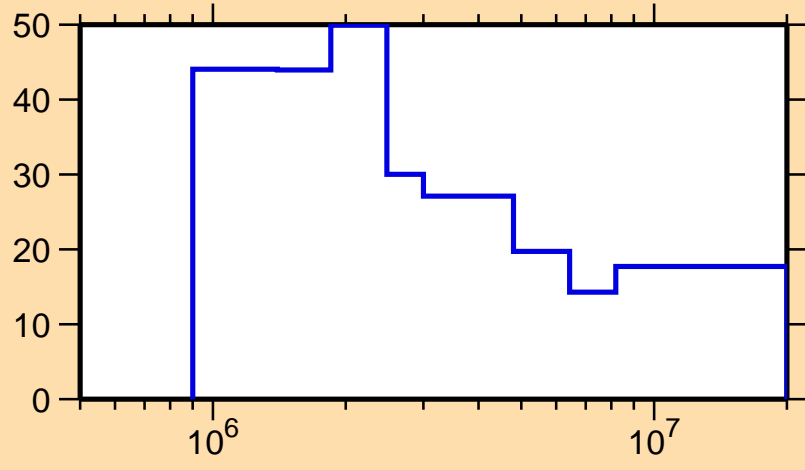

Correlation Matrix




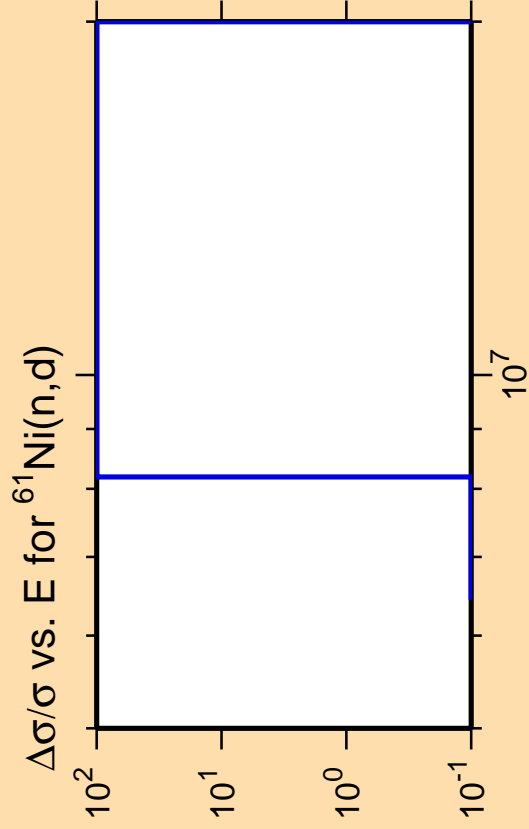


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

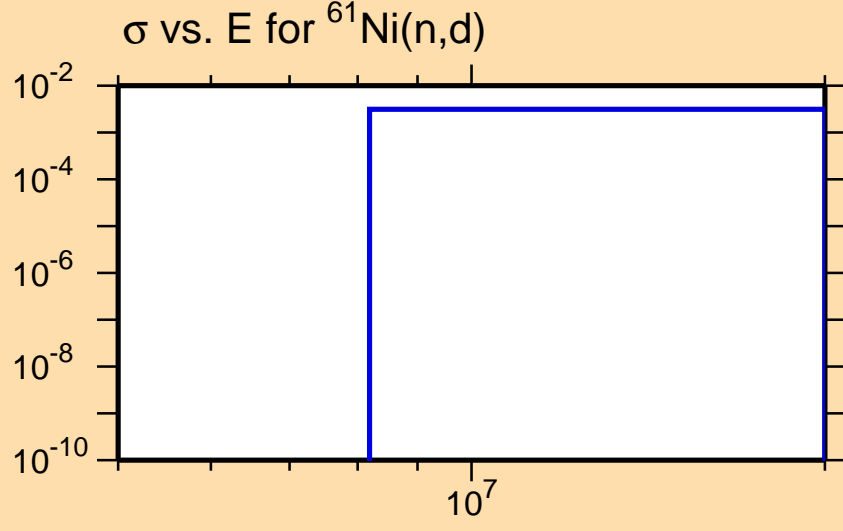

σ vs. E for $^{61}\text{Ni}(n,d)$

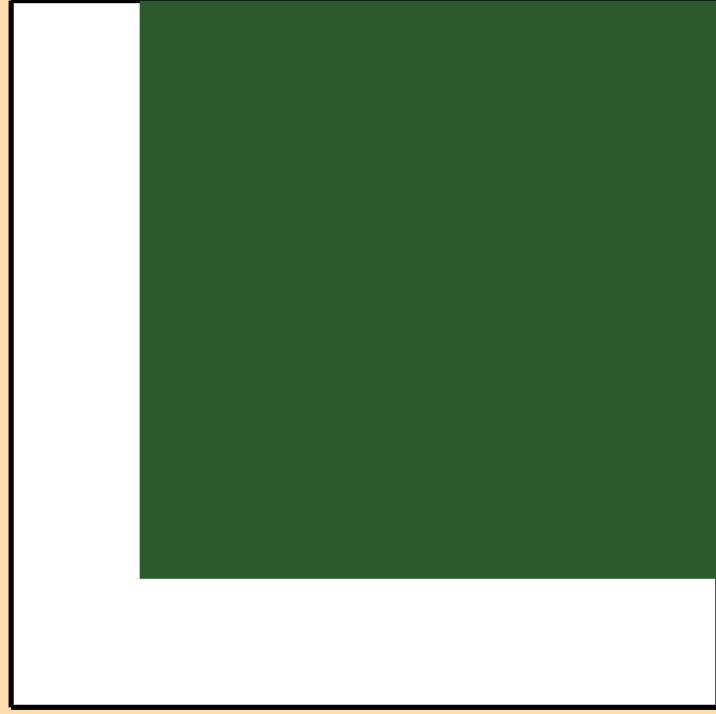

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,t)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{61}\text{Ni}(n,t)$

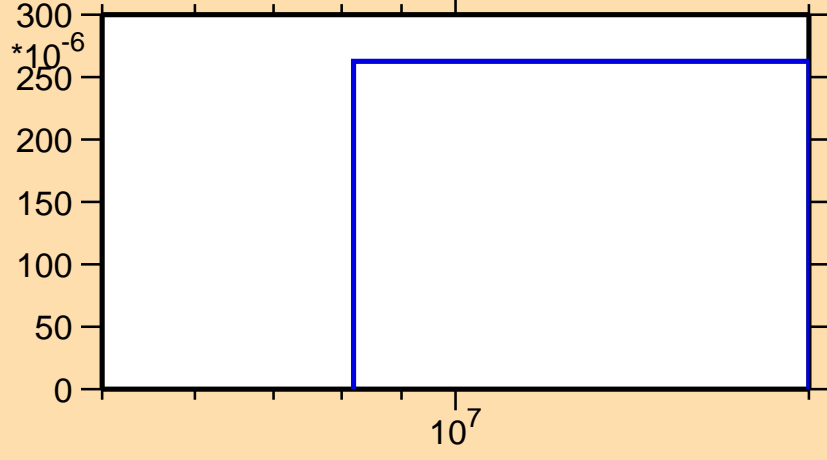

Warning: some uncertainty data were suppressed.

Warning: some uncertainty data were suppressed.



Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{He3})$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{61}\text{Ni}(n,\text{He3})$

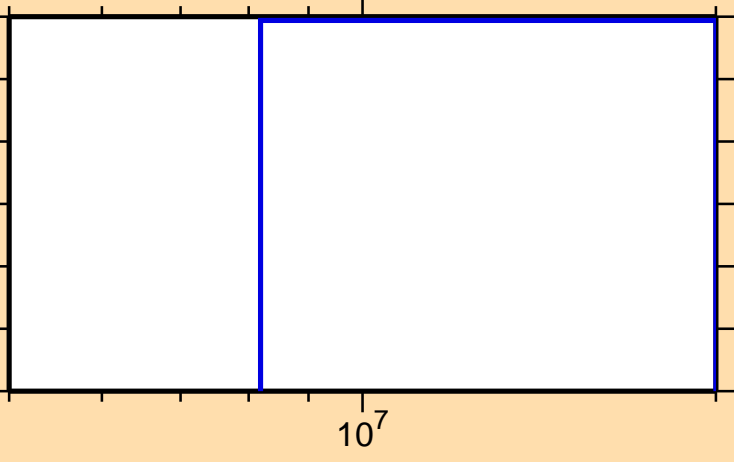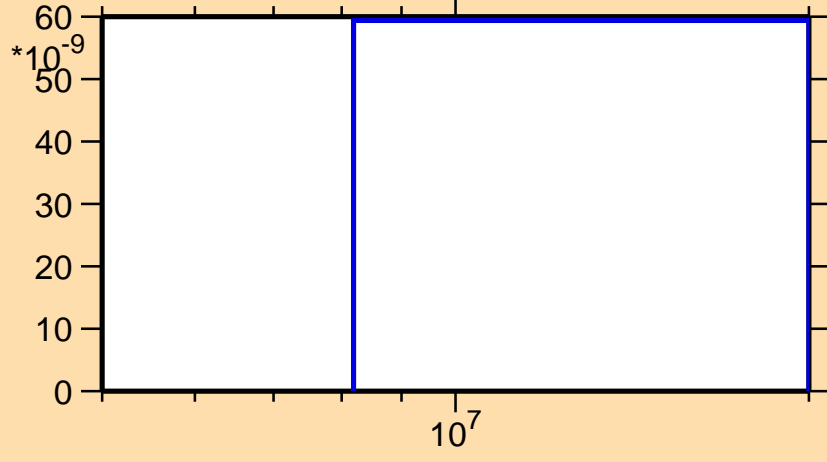

Correlation Matrix





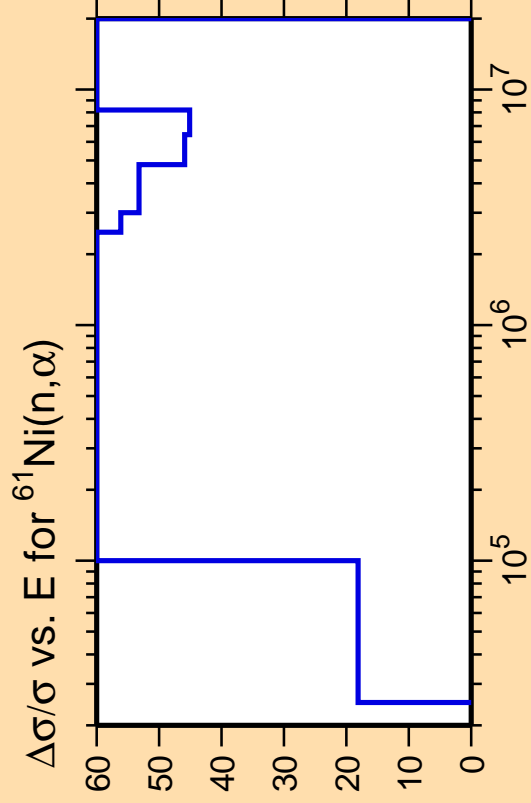

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

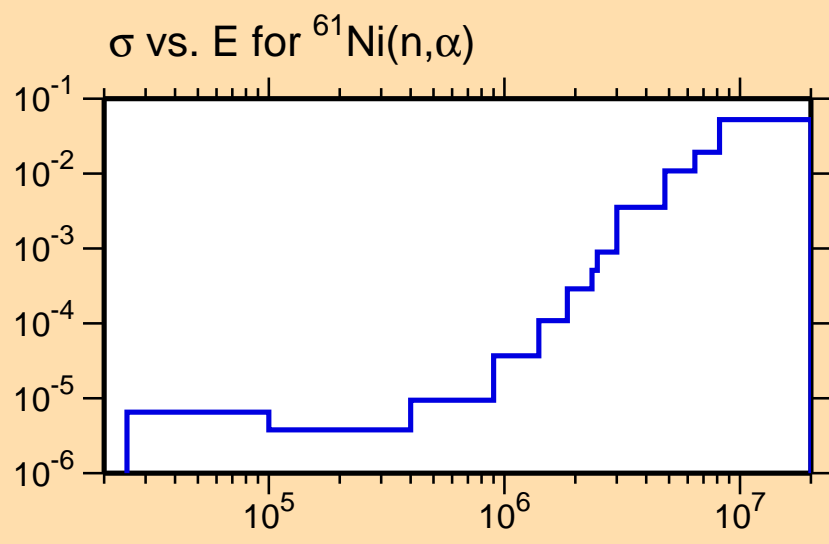

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,p\alpha)$





Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{61}\text{Ni}(n,p\alpha)$

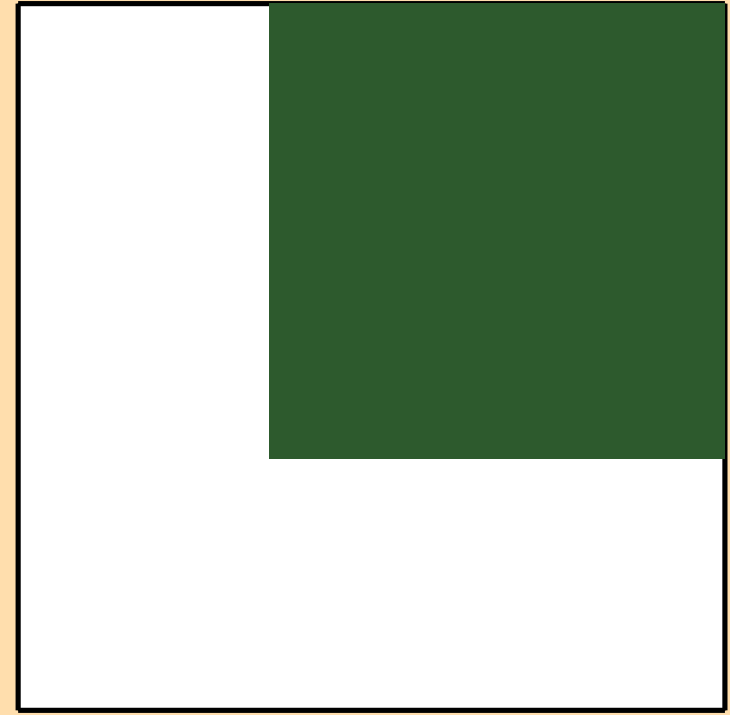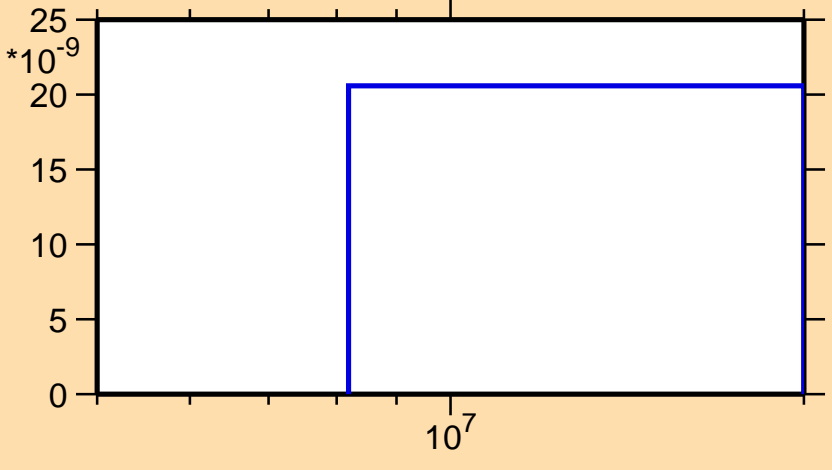

Correlation Matrix

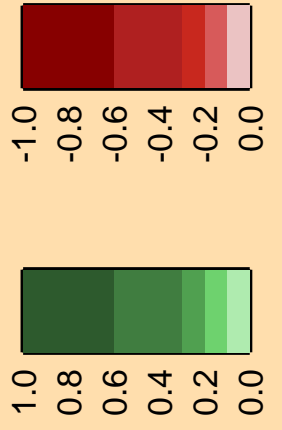


$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{pd})$

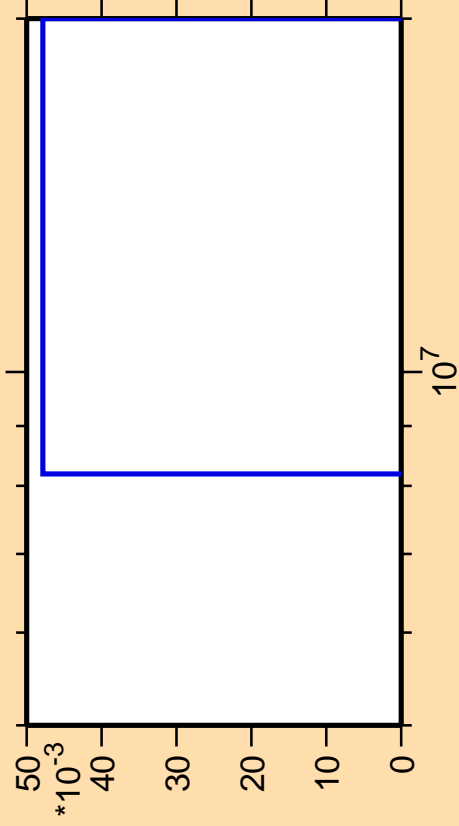


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).



σ vs. E for $^{61}\text{Ni}(n,\text{pd})$

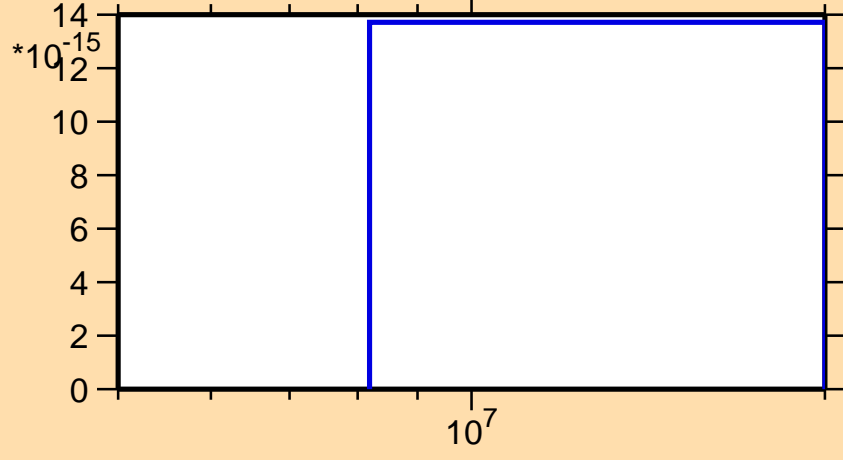

$\Delta\sigma/\sigma$ vs. E for $^{61}\text{Ni}(n,\text{pt})$

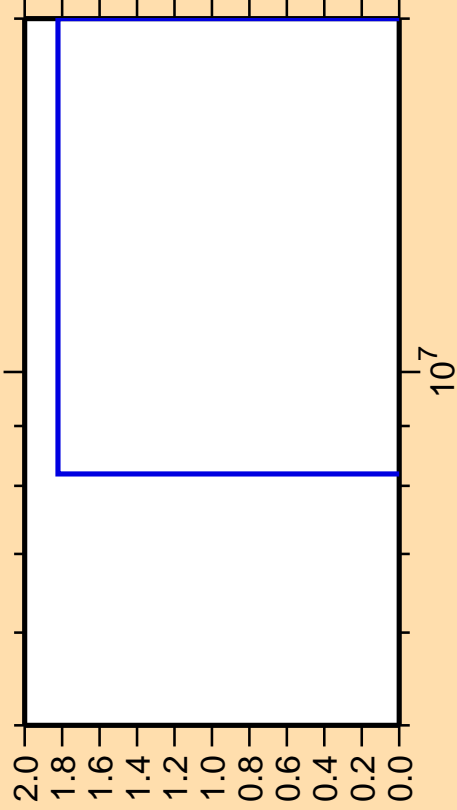

σ vs. E for $^{61}\text{Ni}(n,\text{pt})$

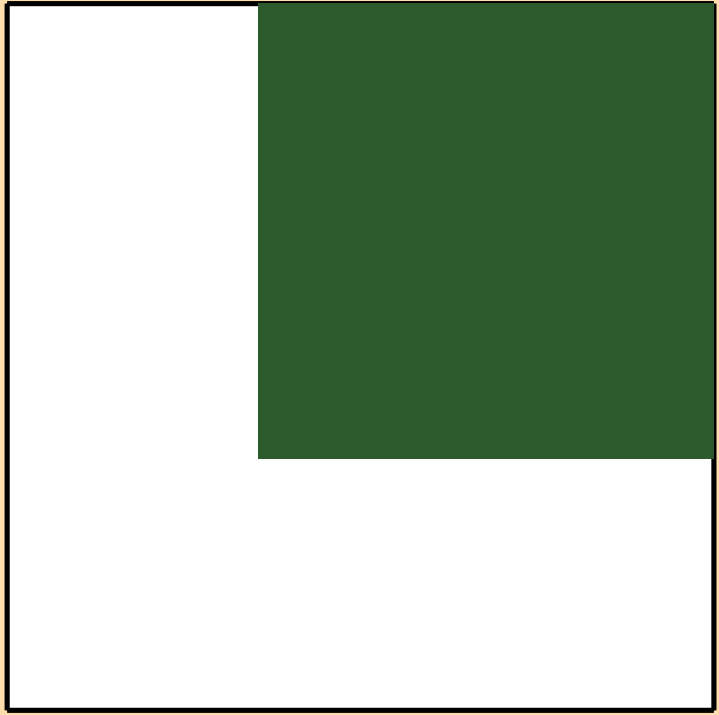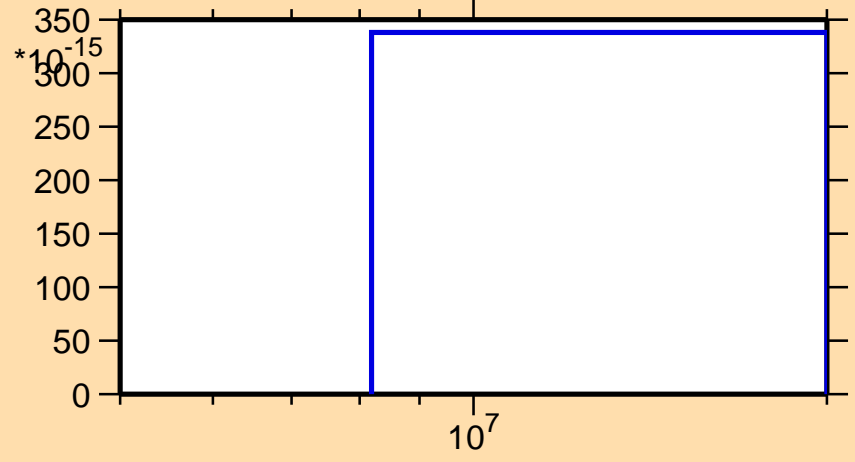

Correlation Matrix

