
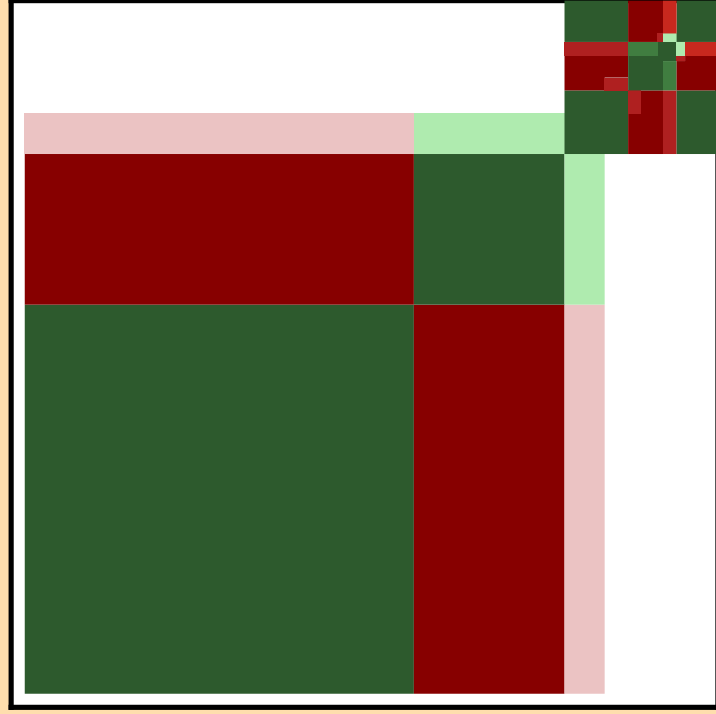


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

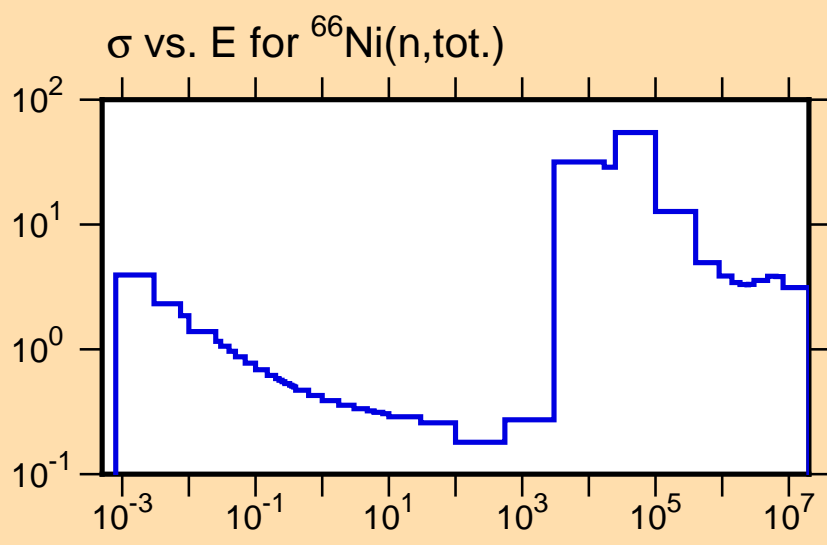

Correlation Matrix





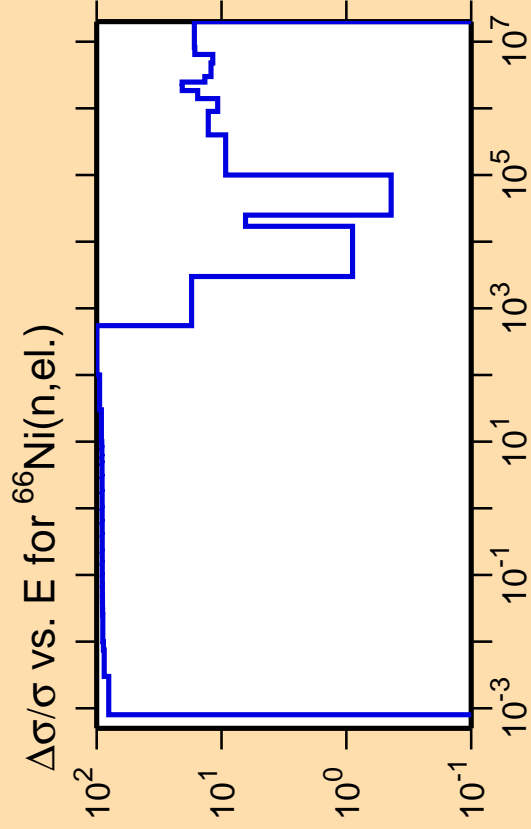

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

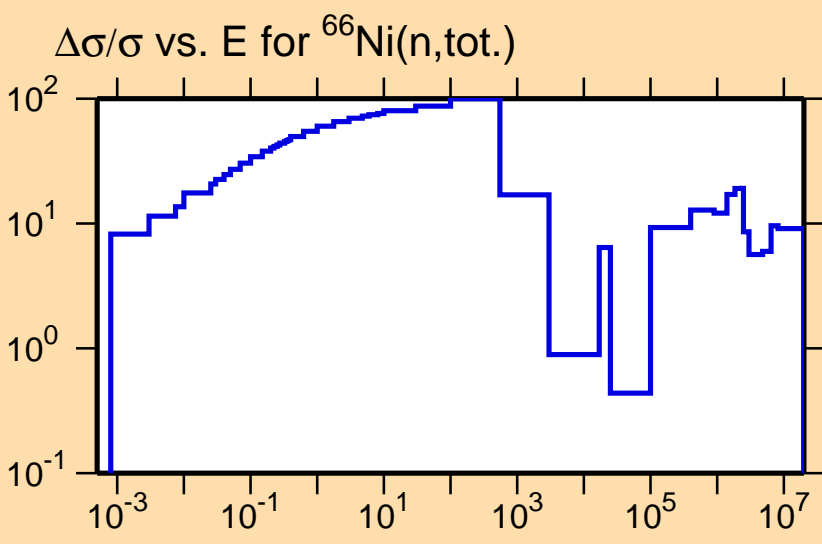

Correlation Matrix





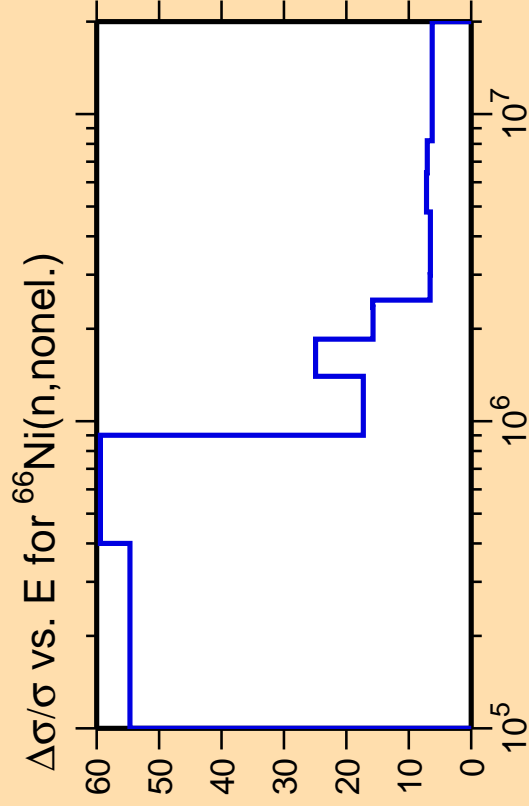

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

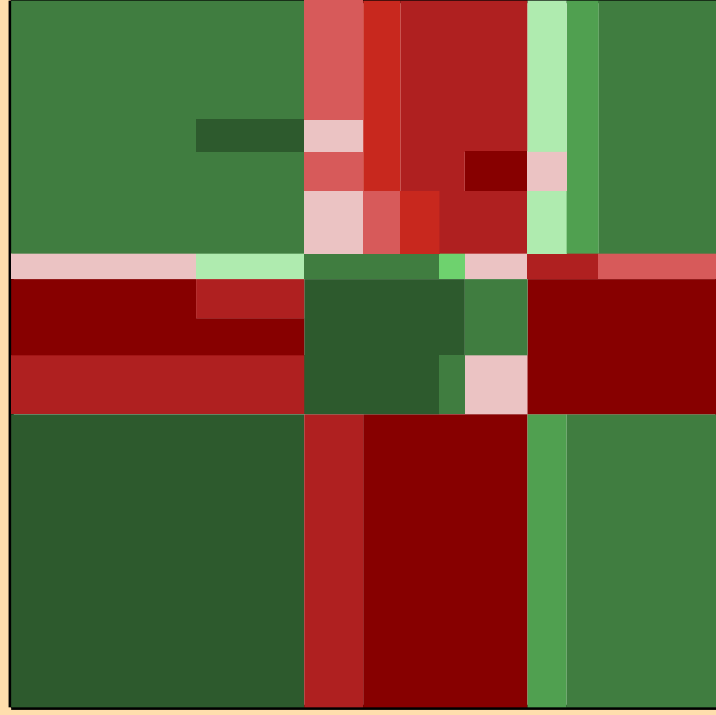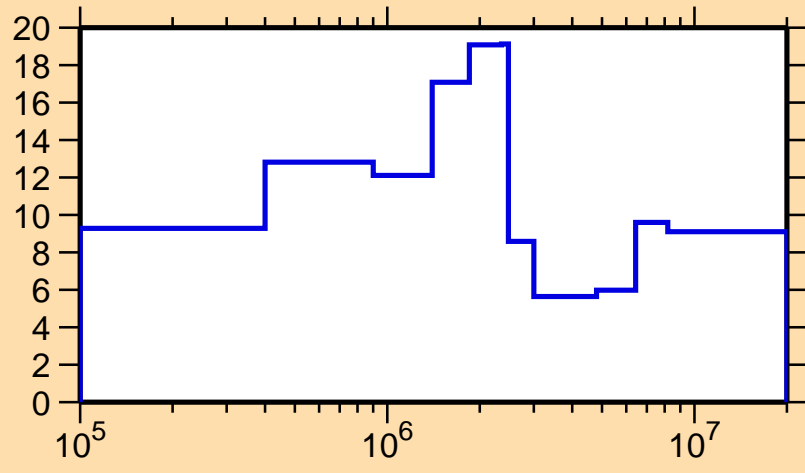

Correlation Matrix





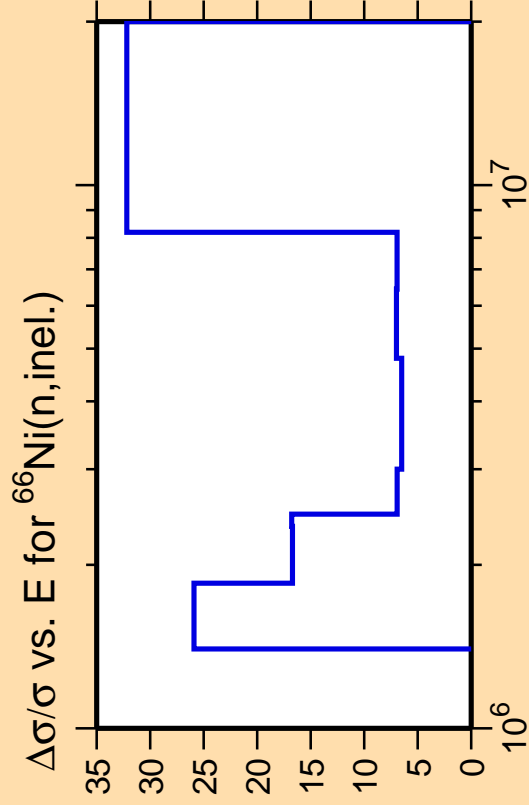

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

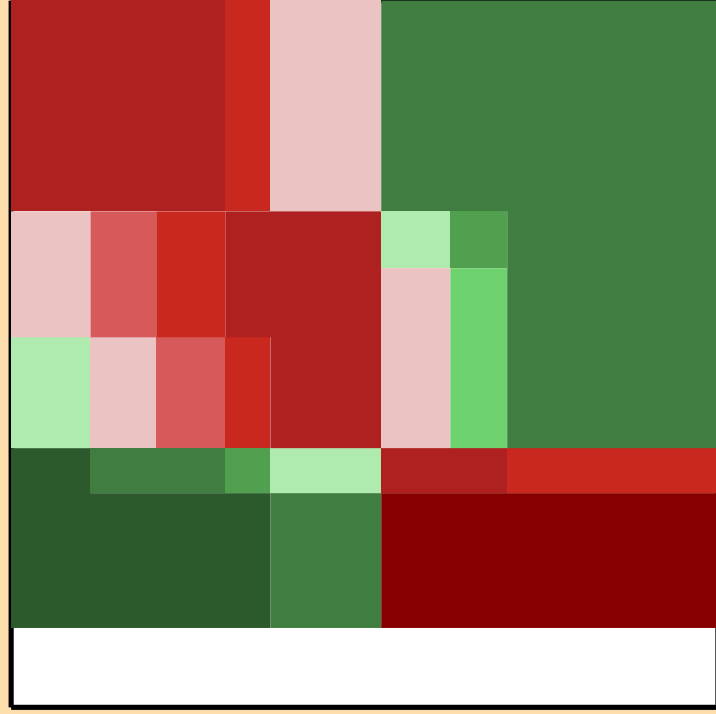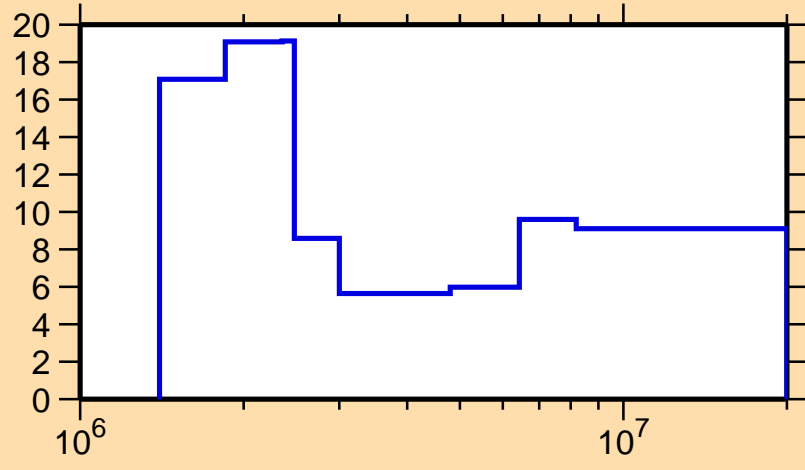

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

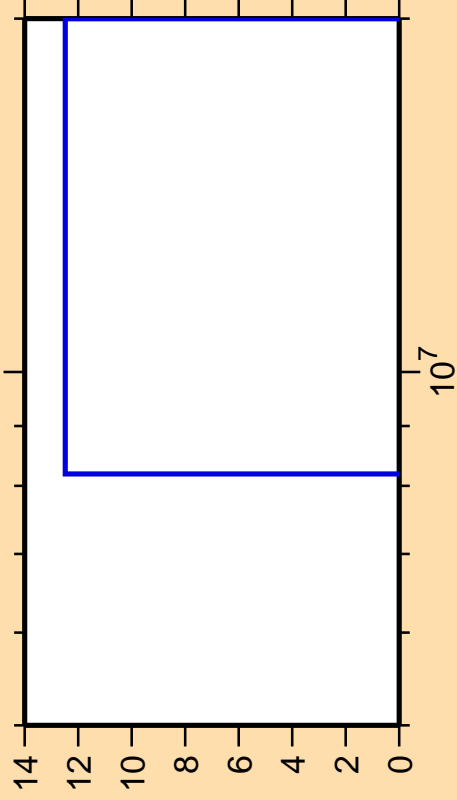

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

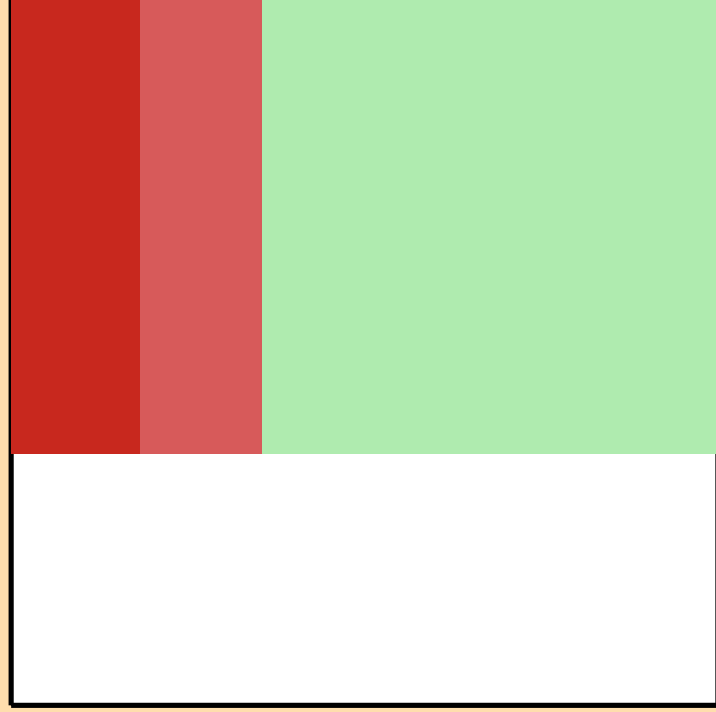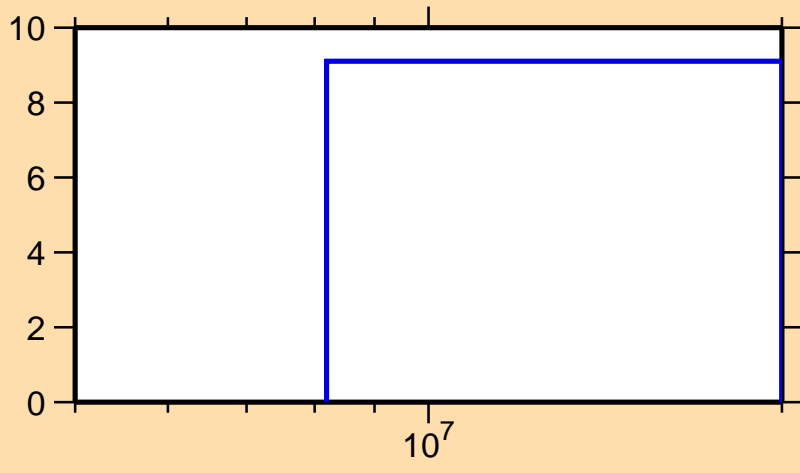

Correlation Matrix





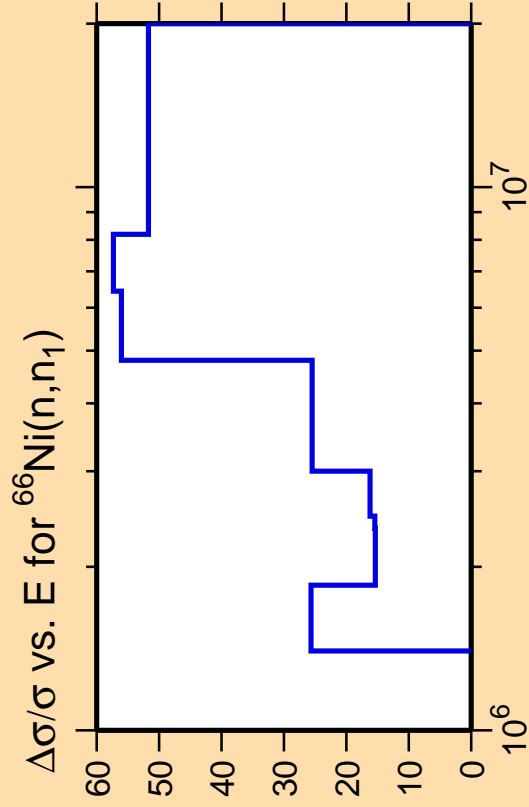

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

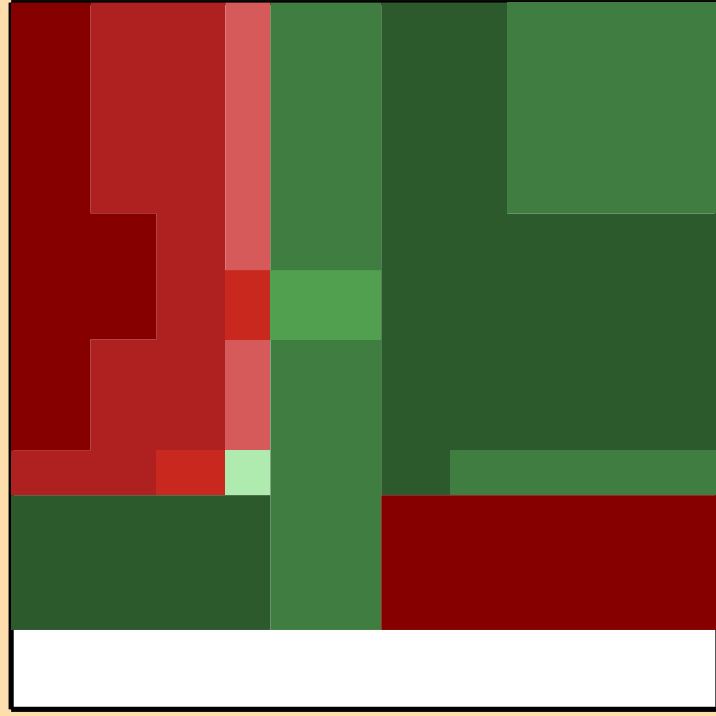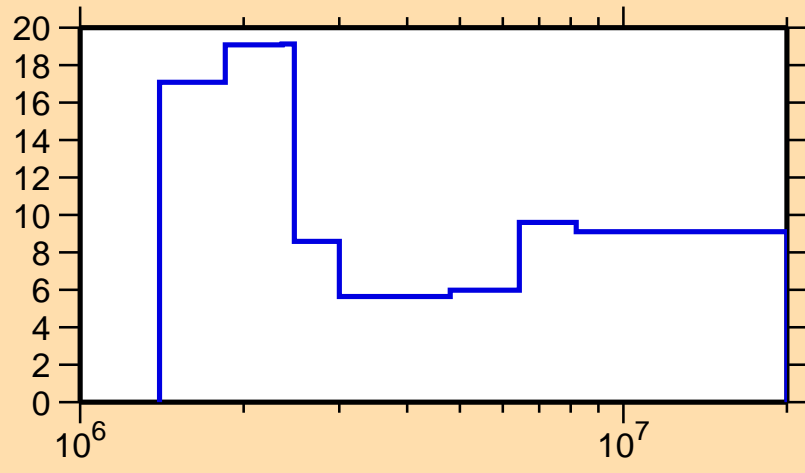

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

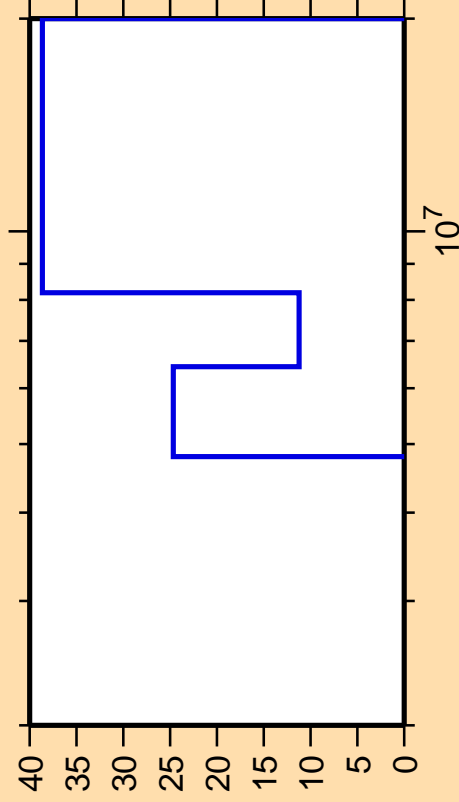

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

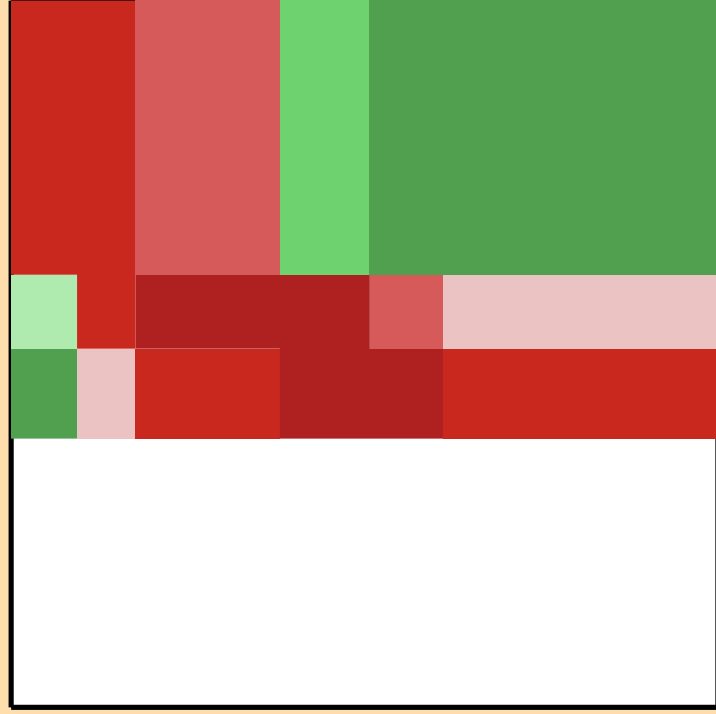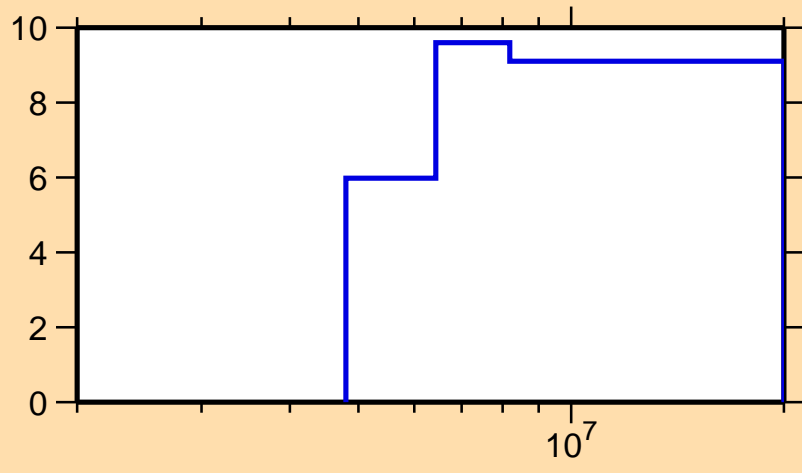

Correlation Matrix




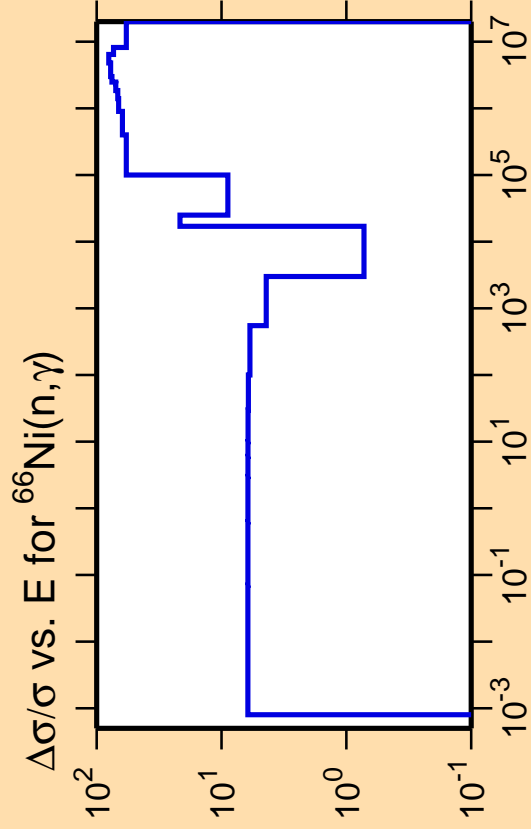


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

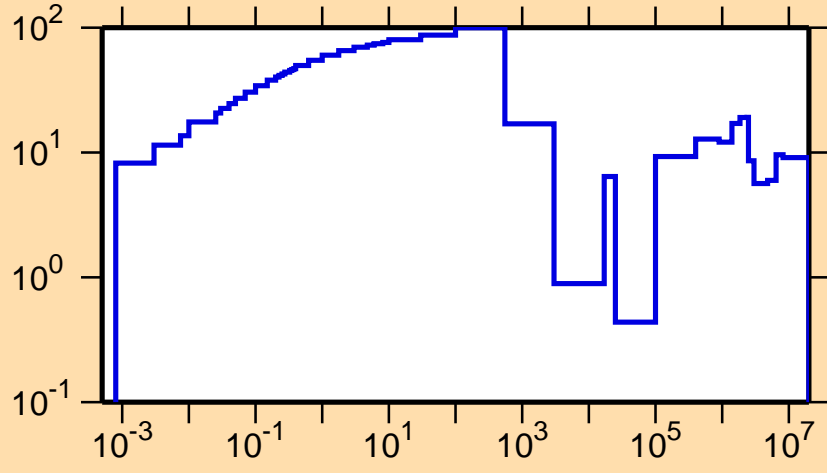

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$


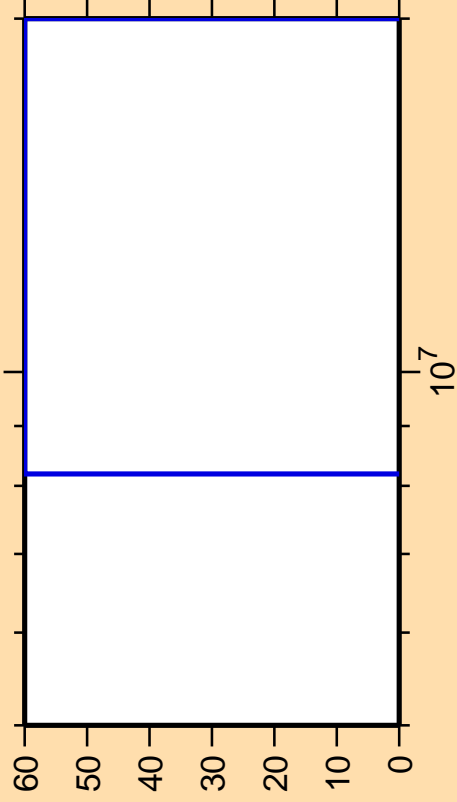


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

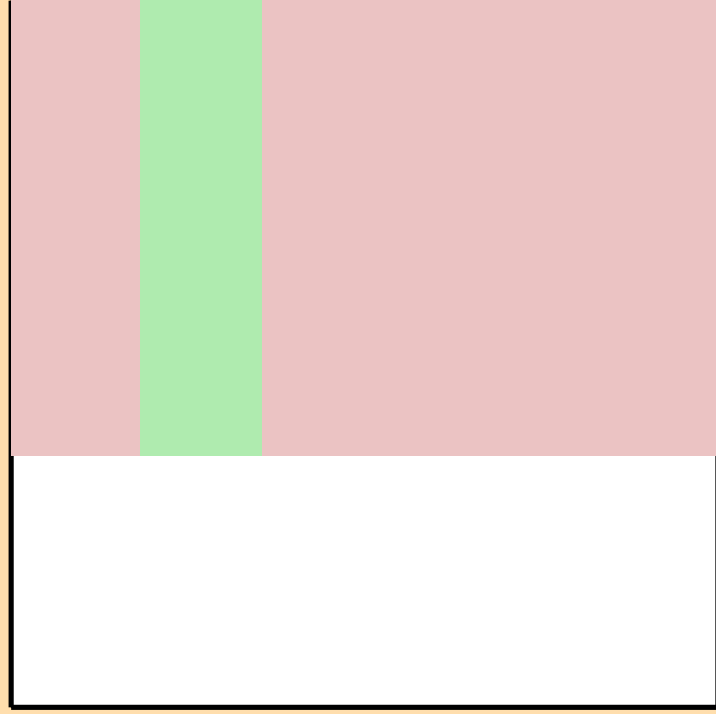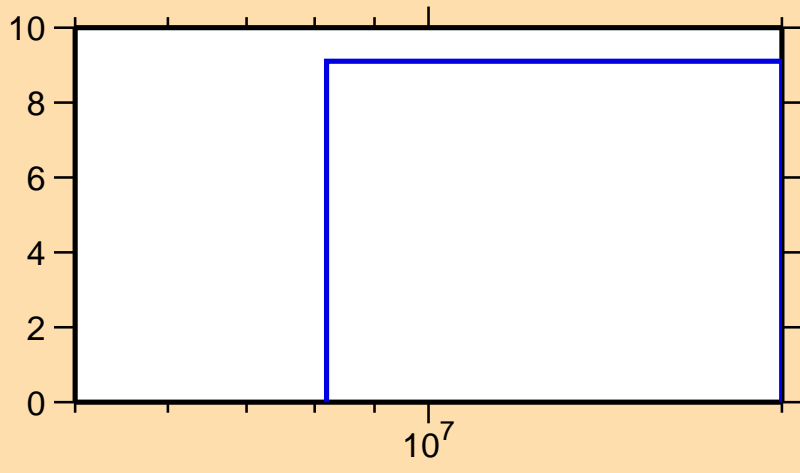

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


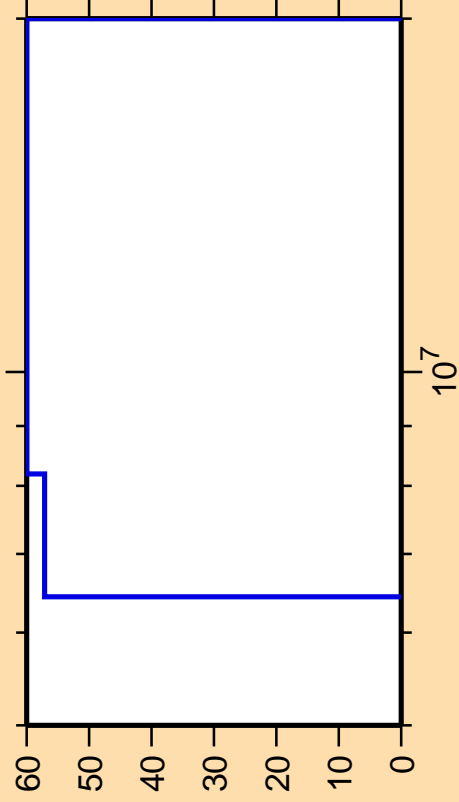


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{tot.})$

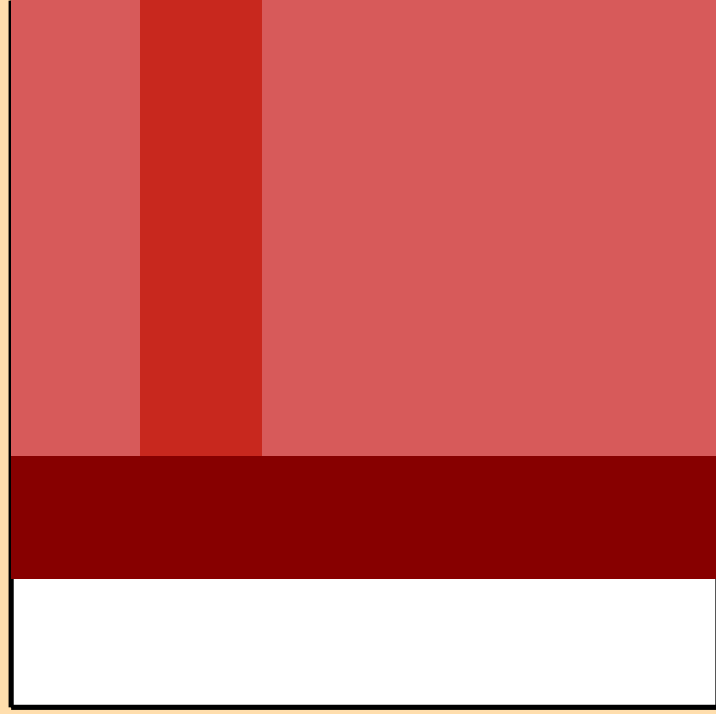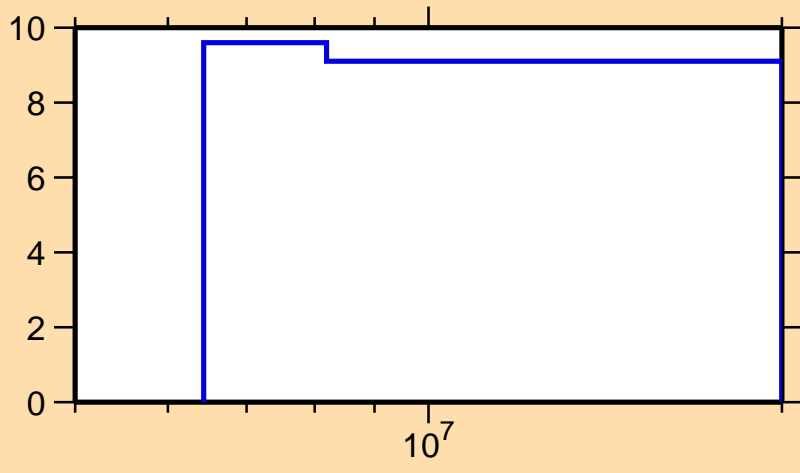

Correlation Matrix




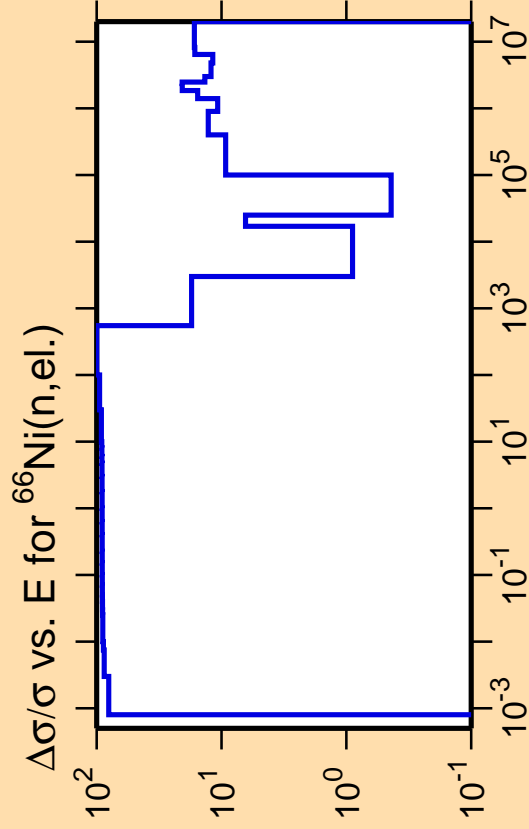


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{66}\text{Ni}(n,\text{el.})$

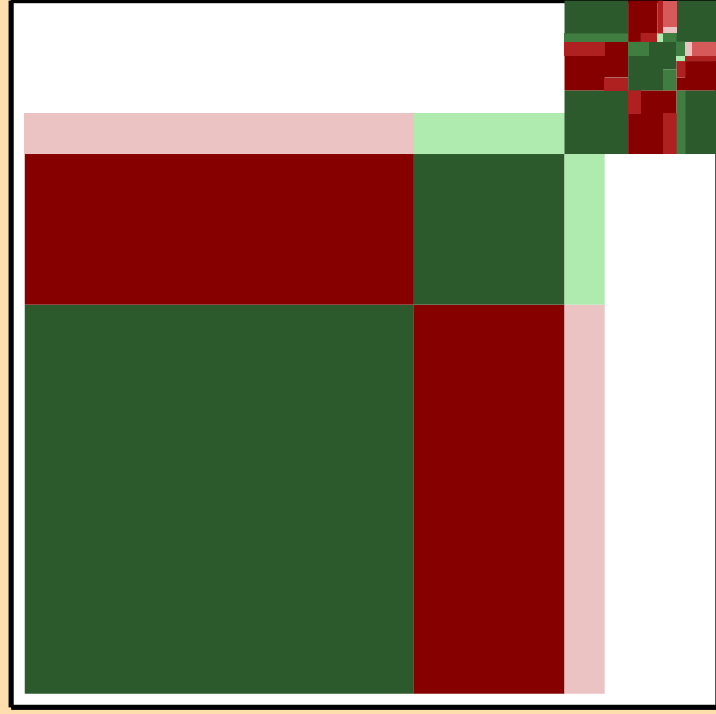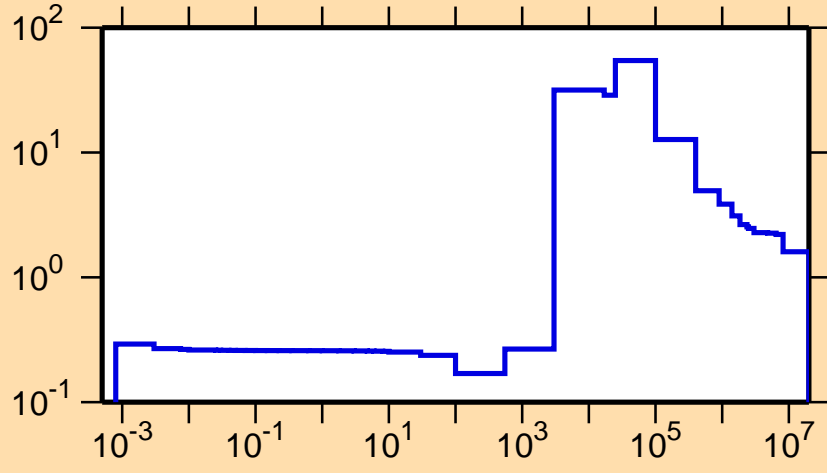

Correlation Matrix




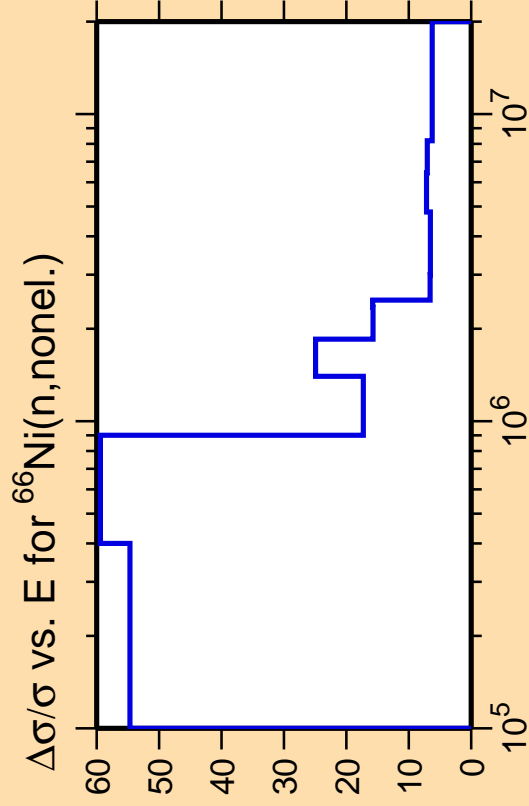

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{el.})$

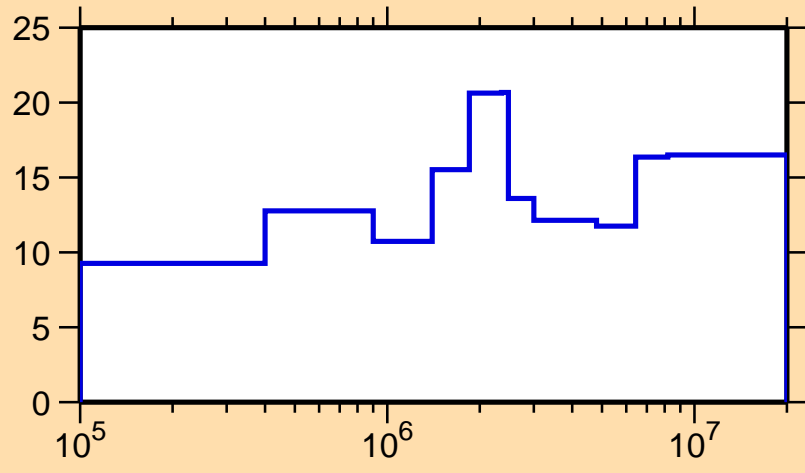

Correlation Matrix





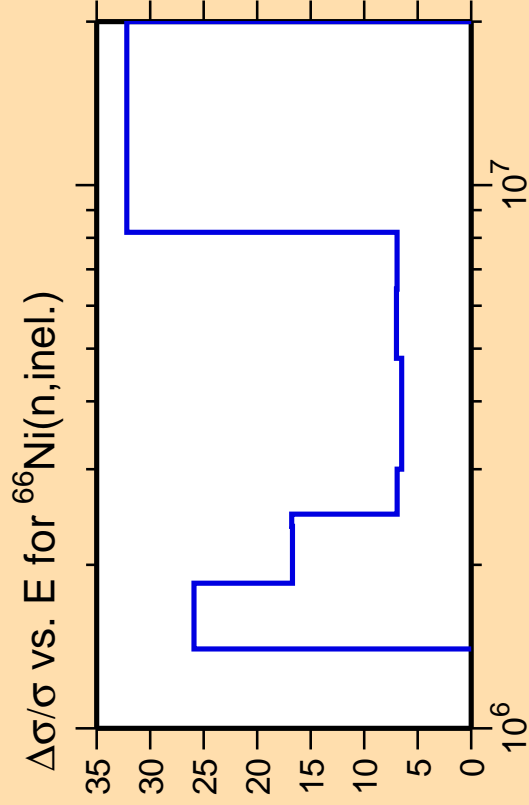

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{el.})$

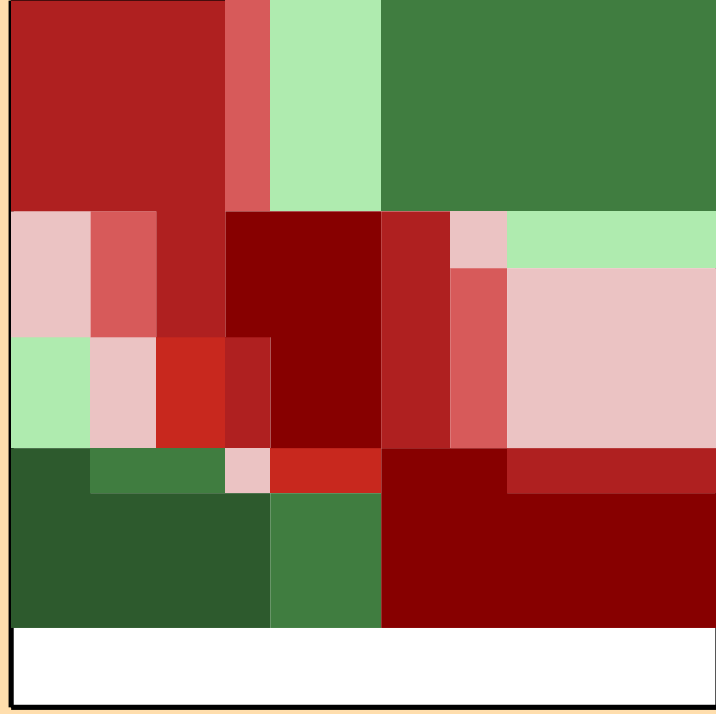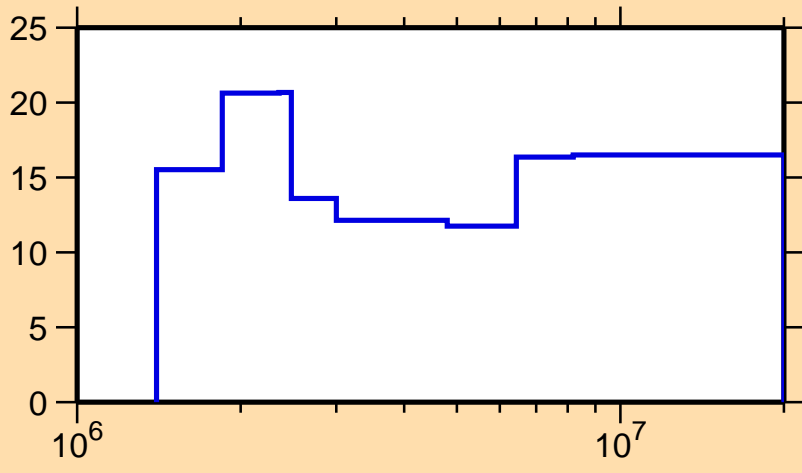

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

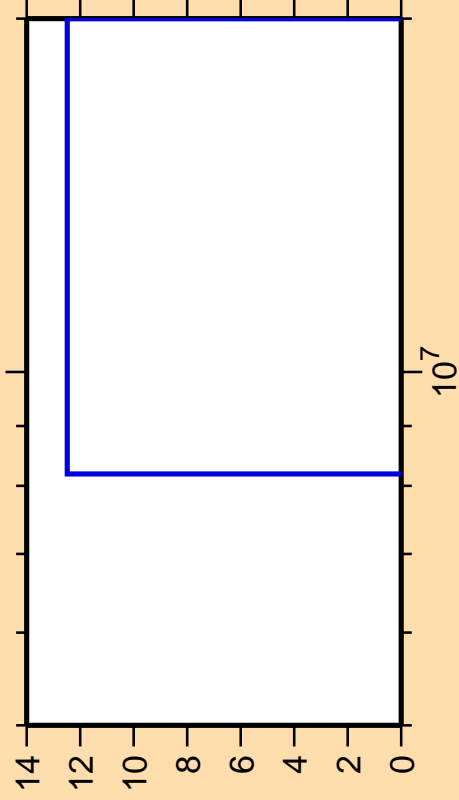

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{el.})$

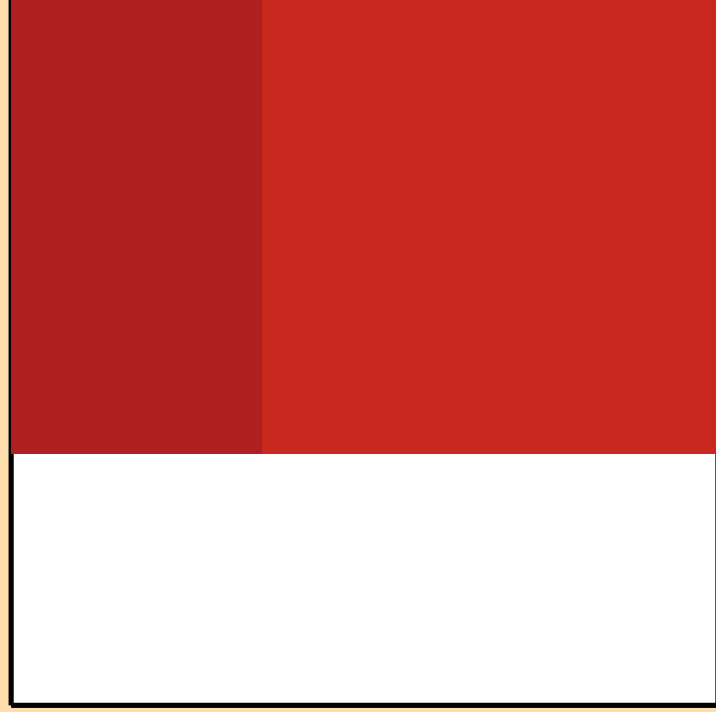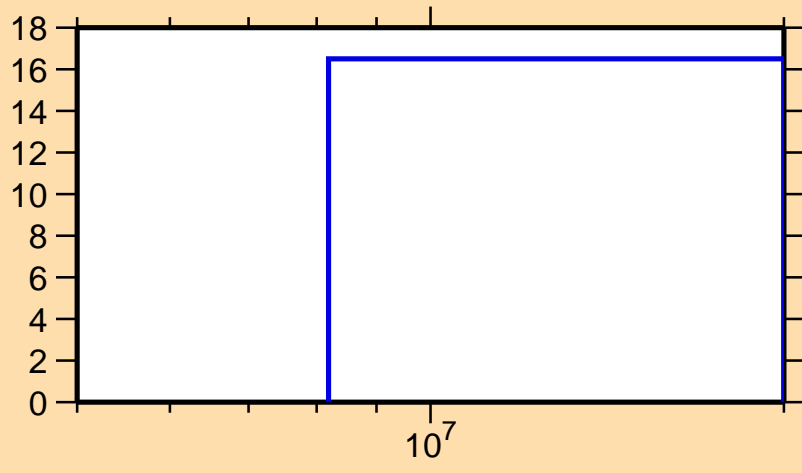



Correlation Matrix



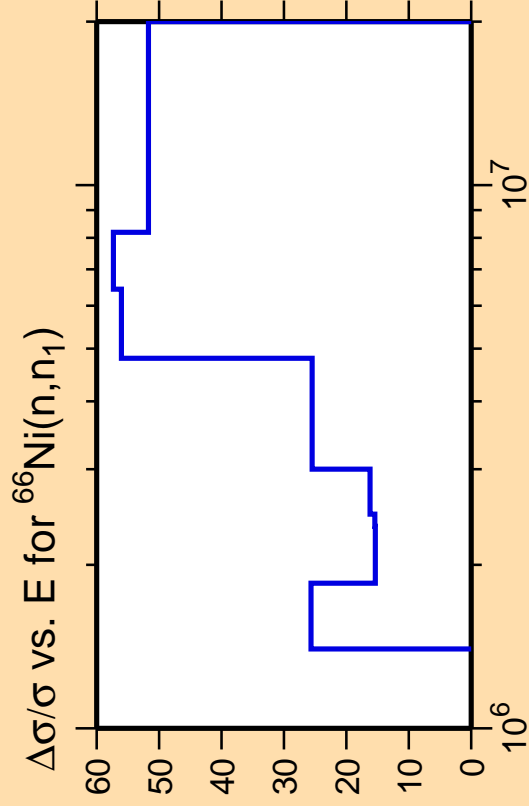

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

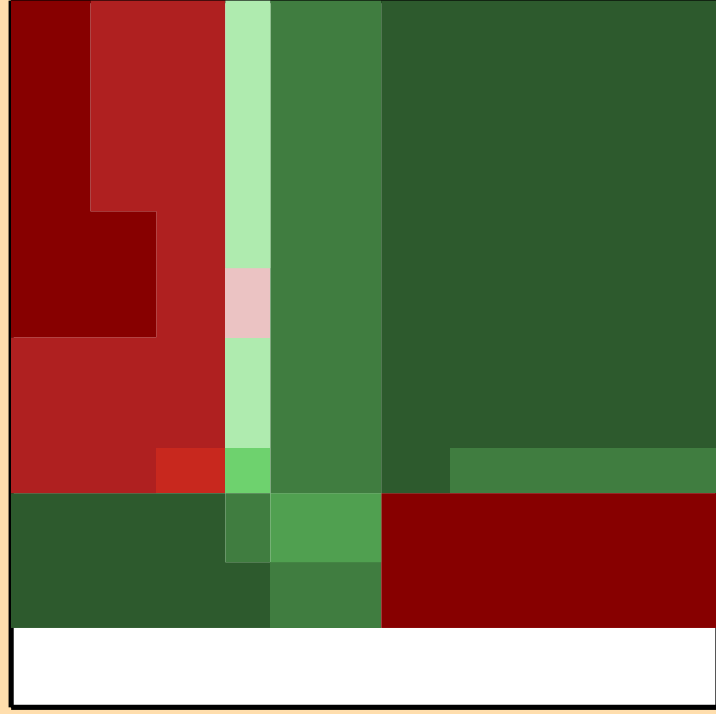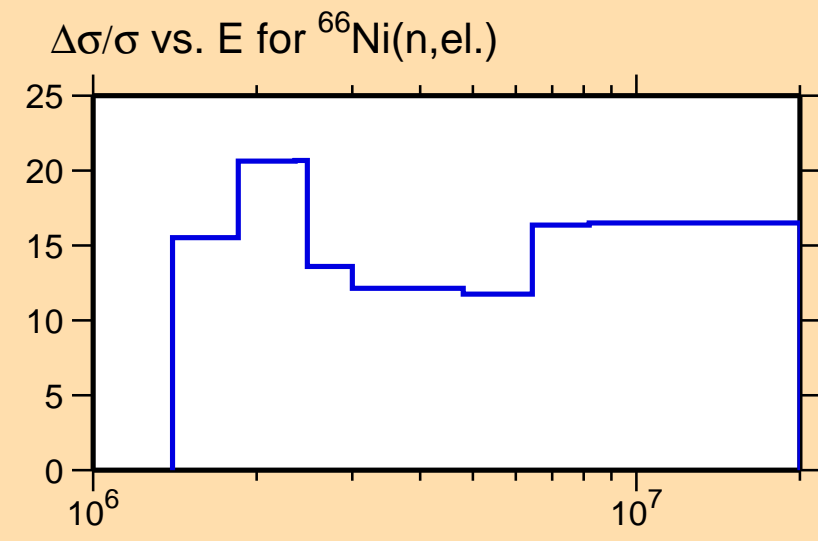

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

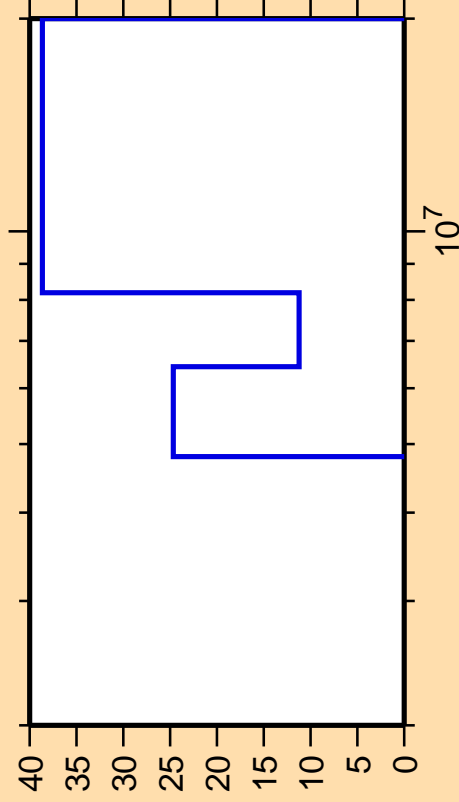

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{el.})$

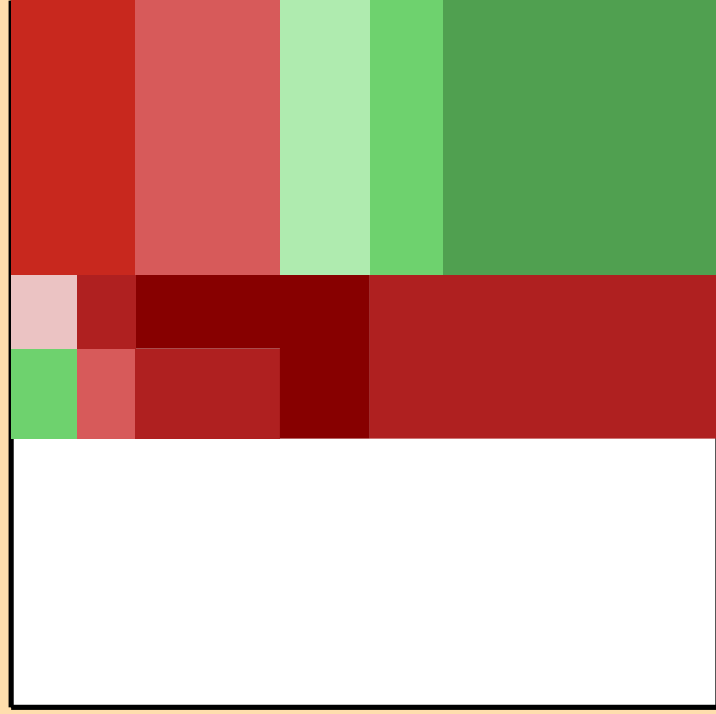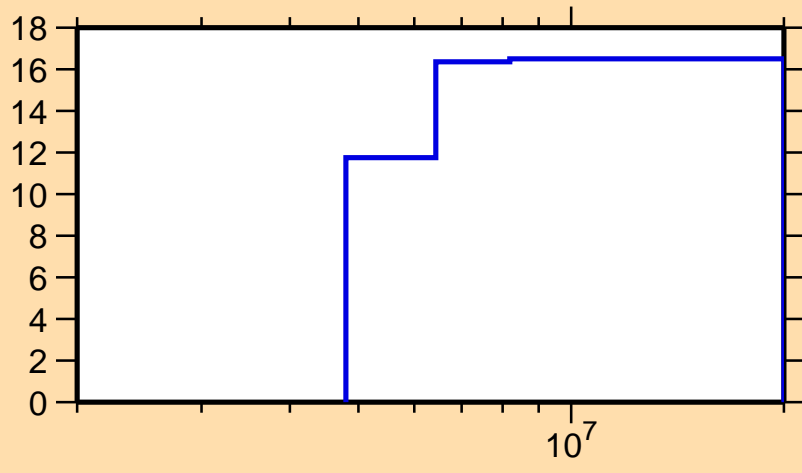

Correlation Matrix




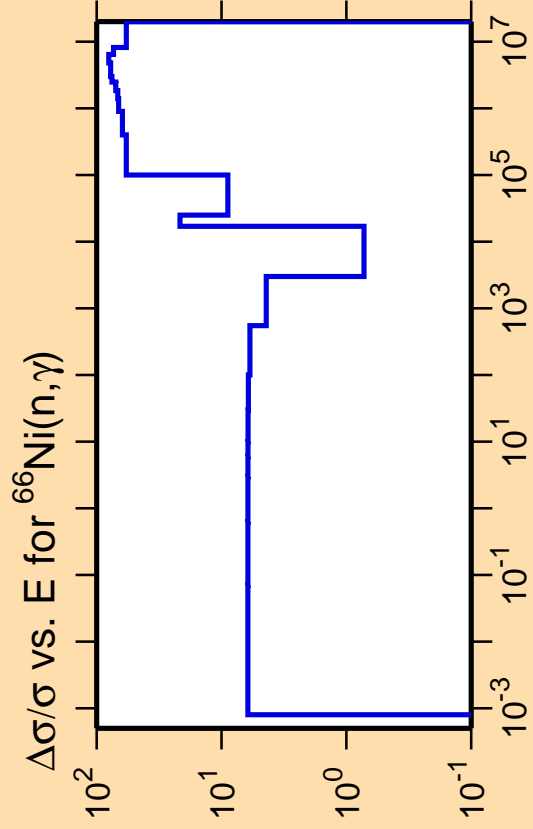


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{el.})$

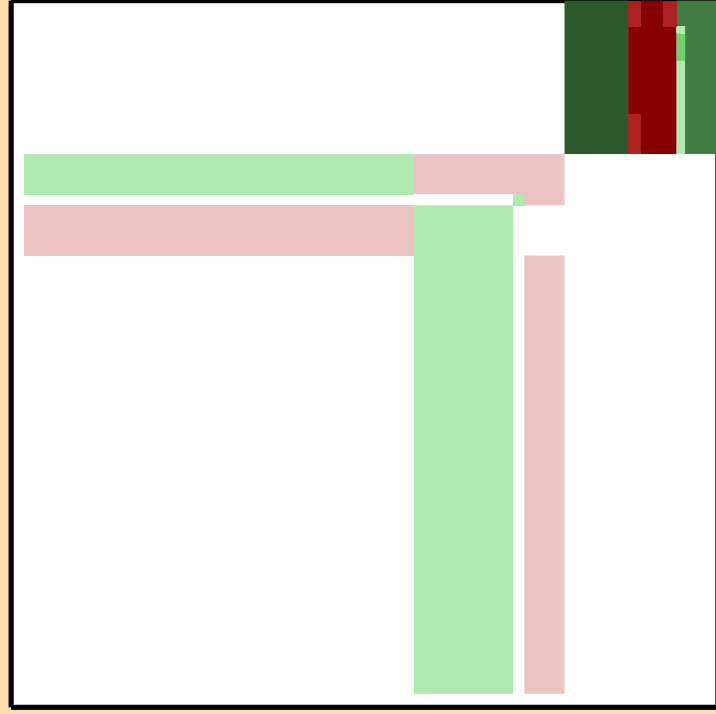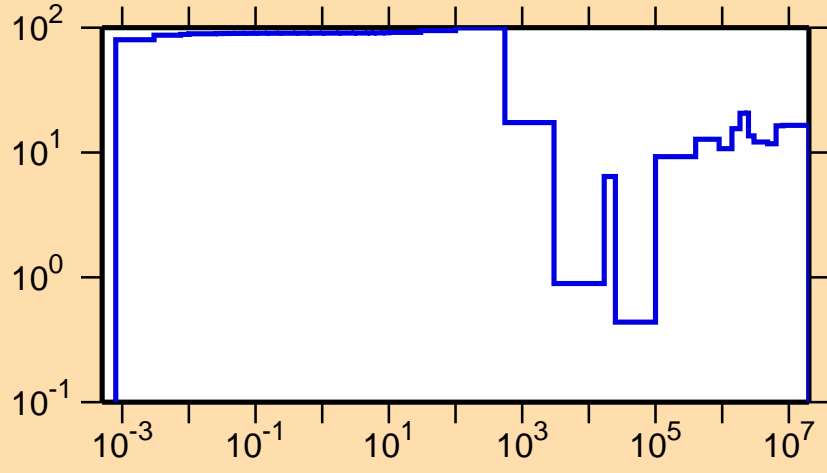

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$


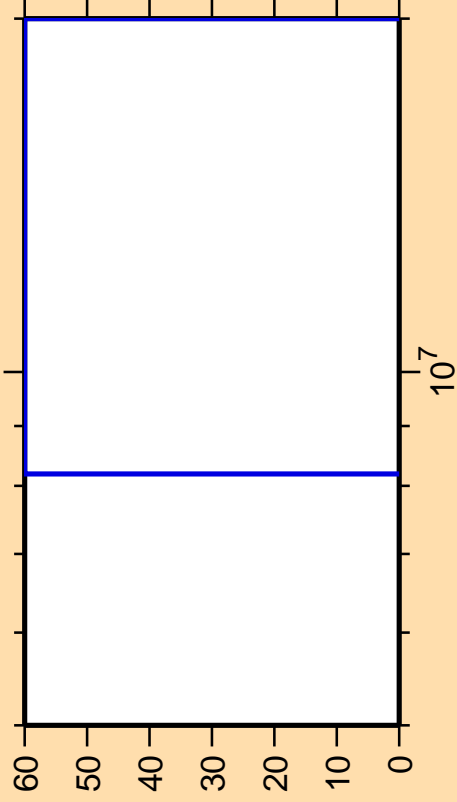


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{el.})$

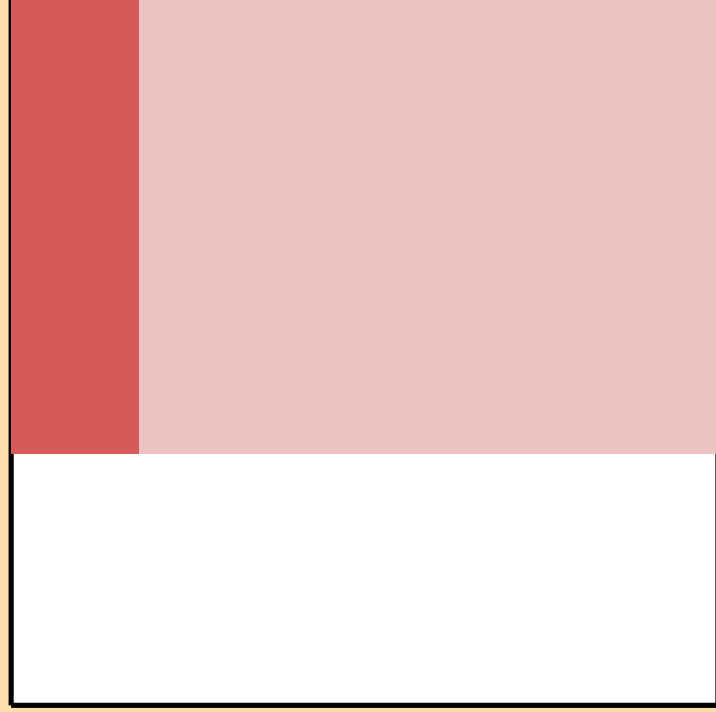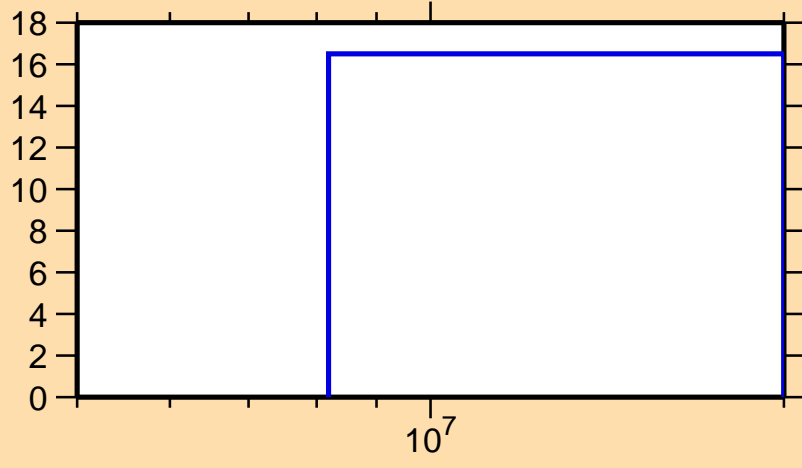

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


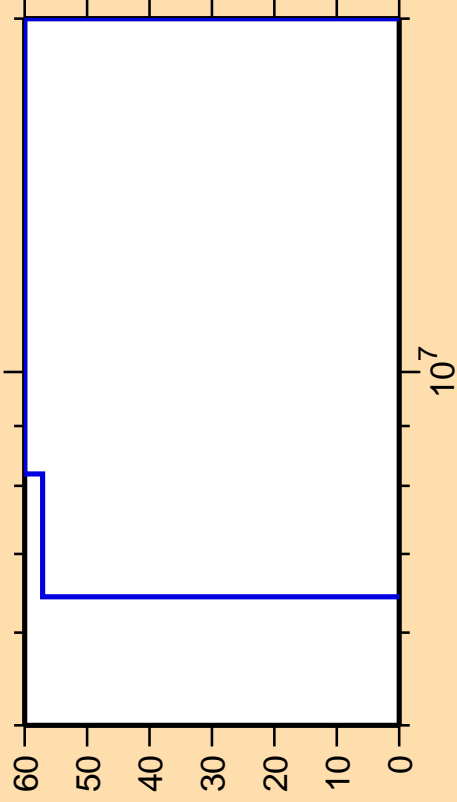


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{el.})$

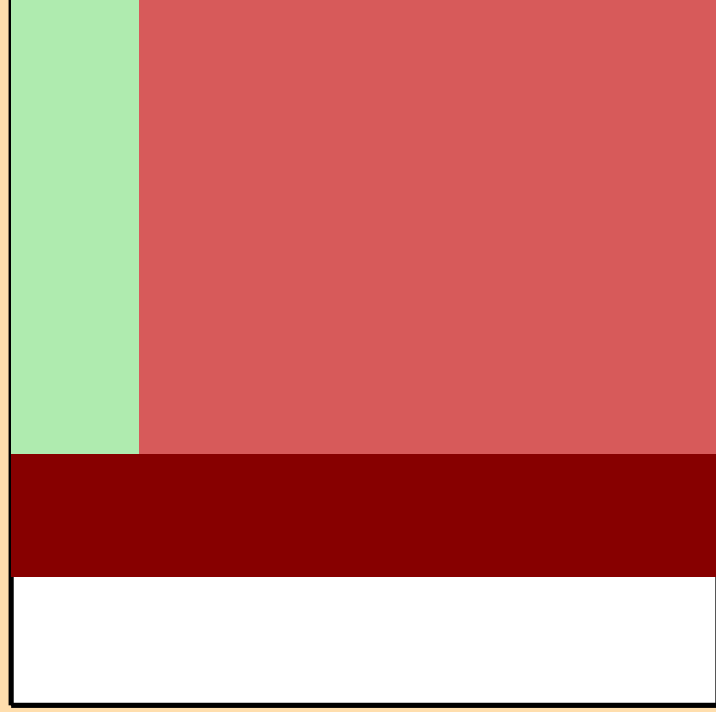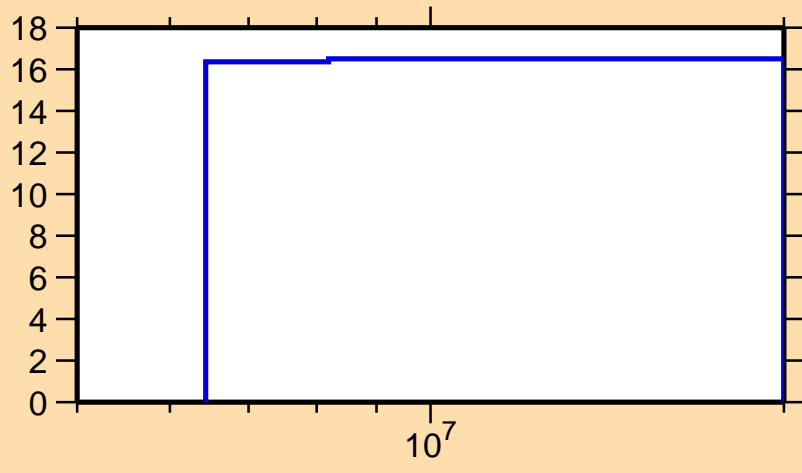



Correlation Matrix



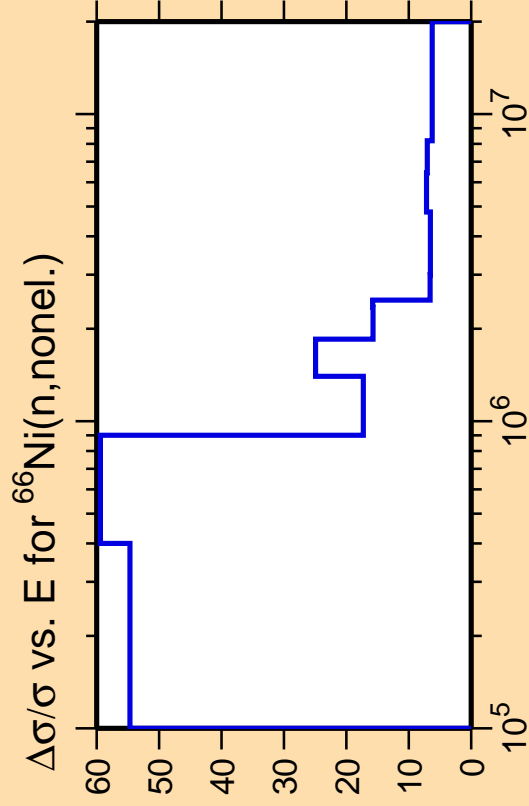


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

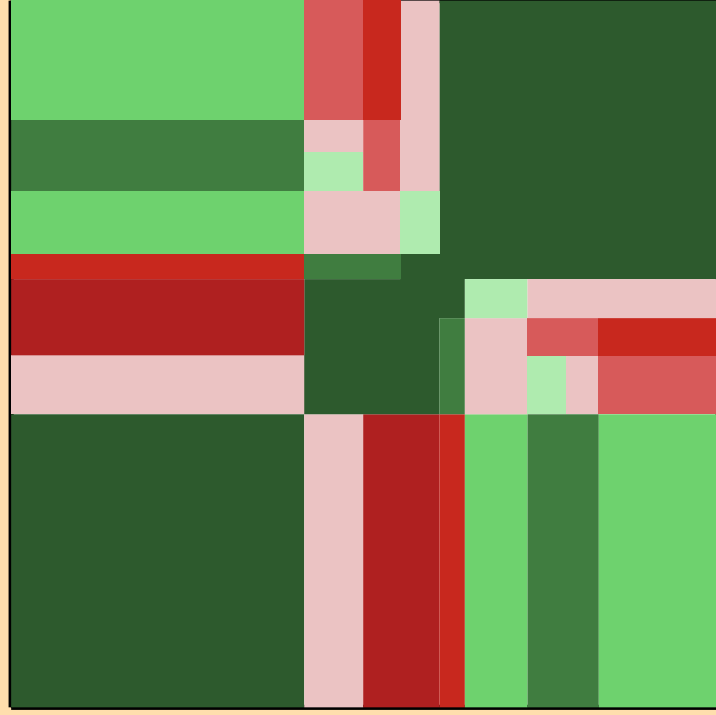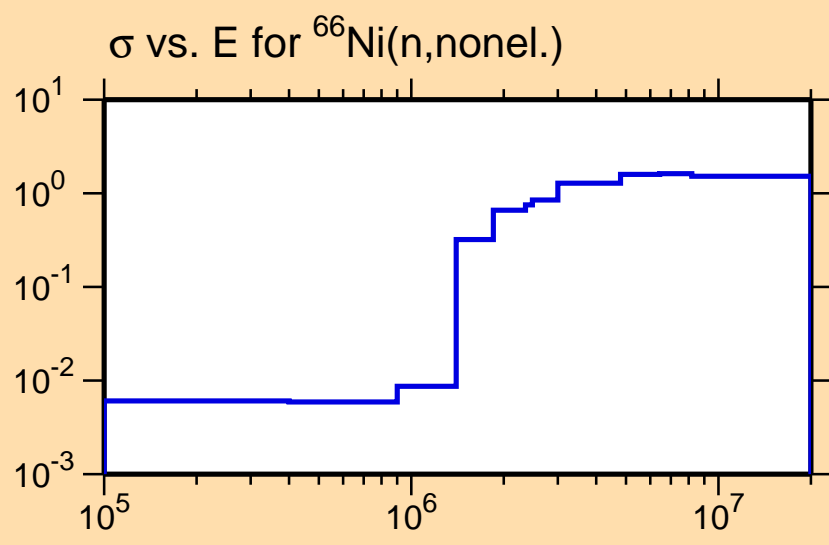

Correlation Matrix





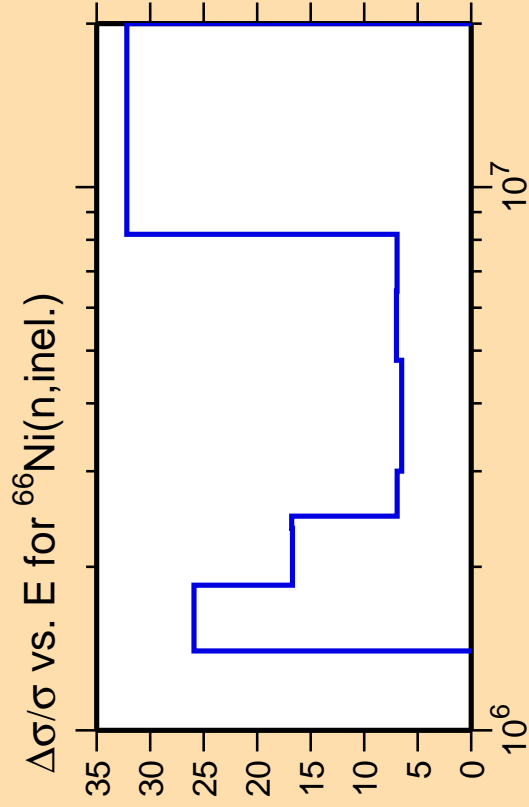

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{nonel.})$

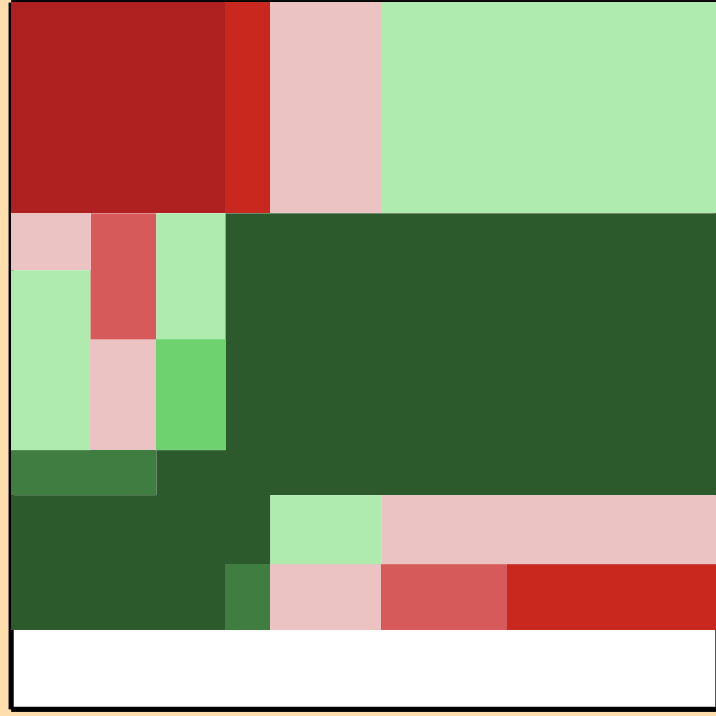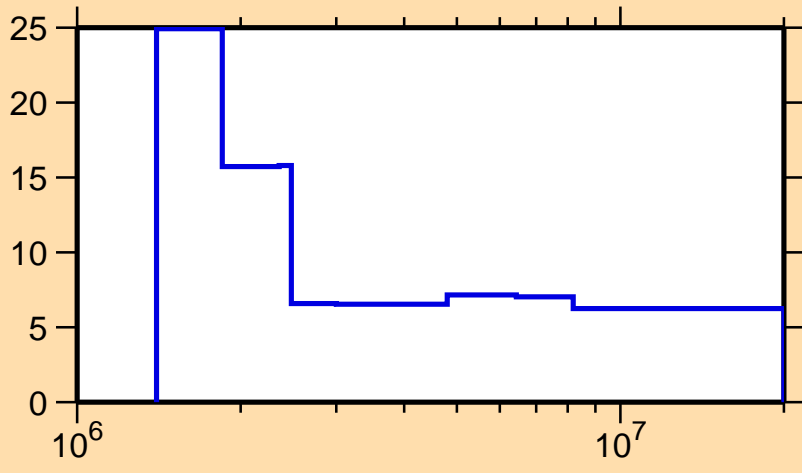



Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

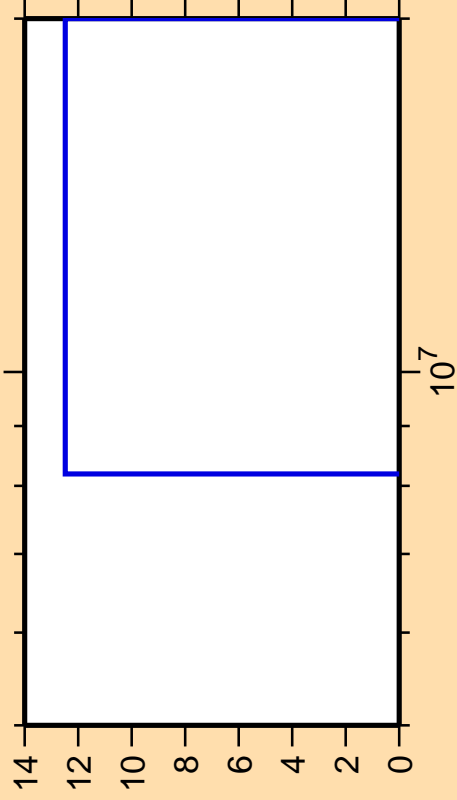


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{nonel.})$

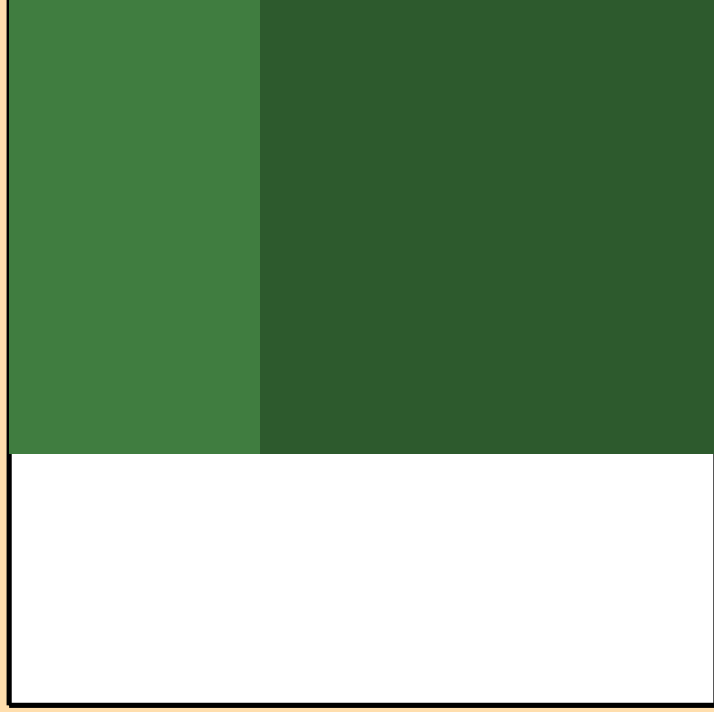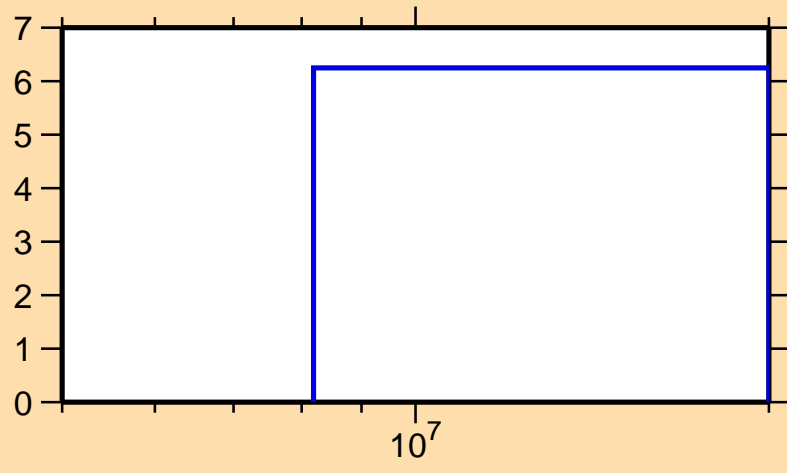

Correlation Matrix


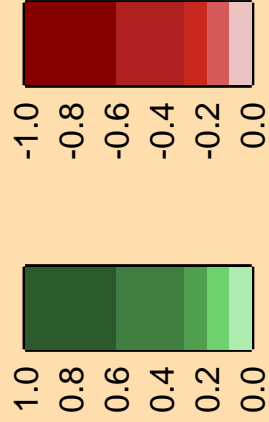


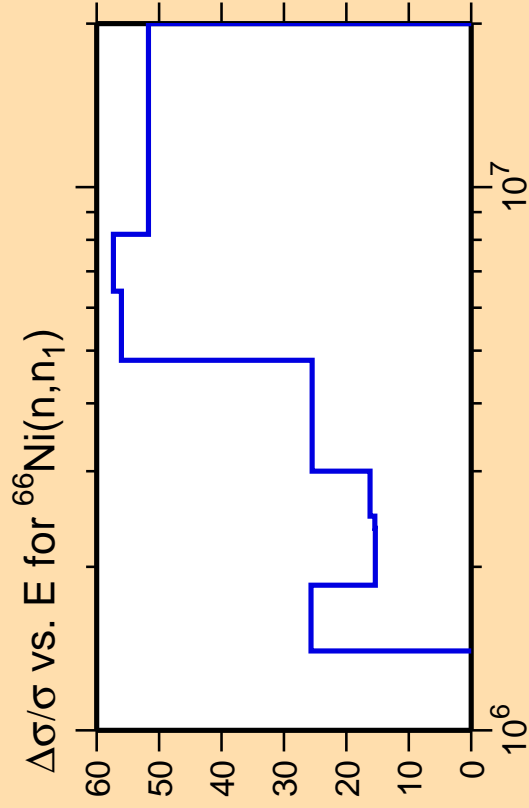

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{nonel.})$

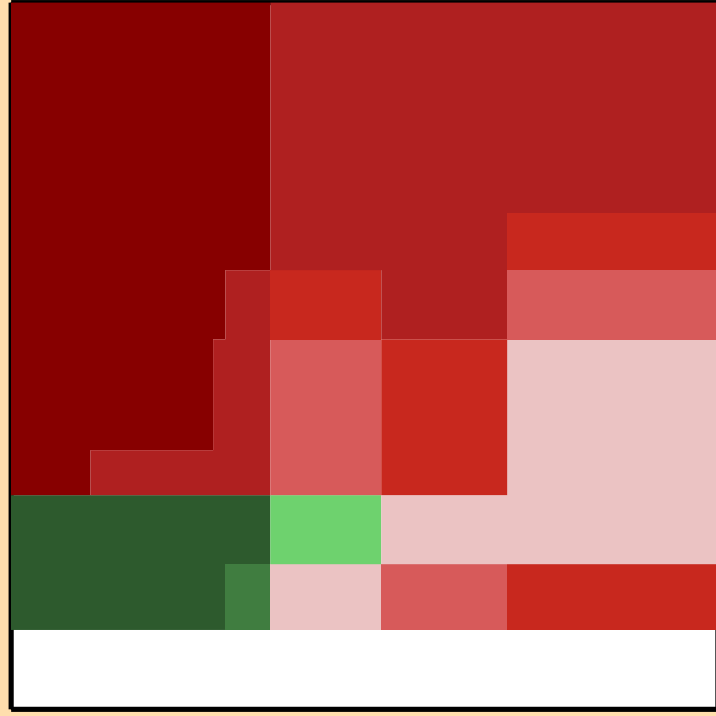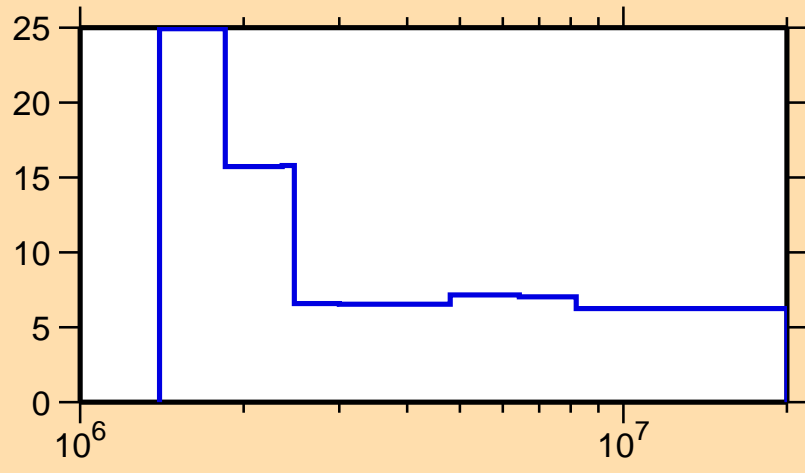

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

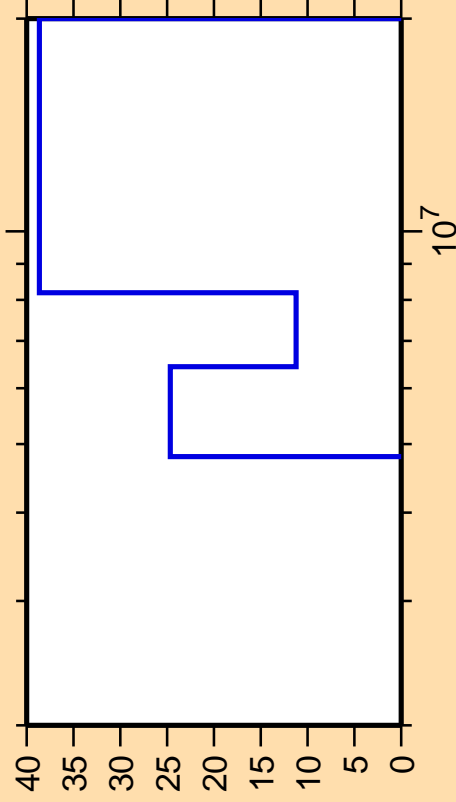

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{onel.})$

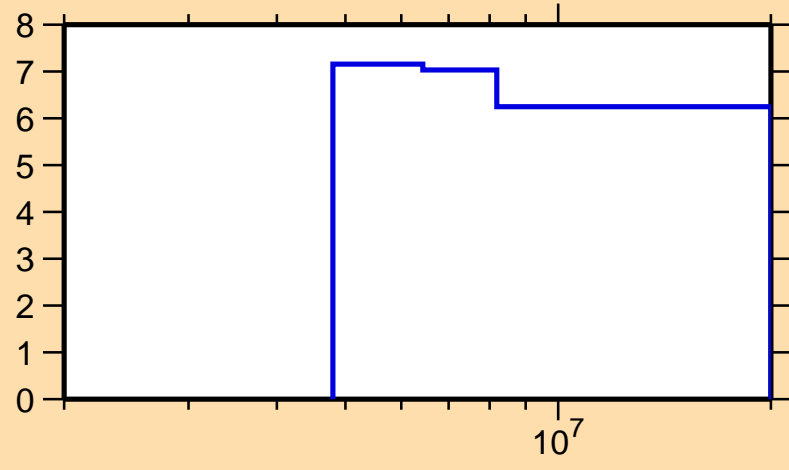

Correlation Matrix




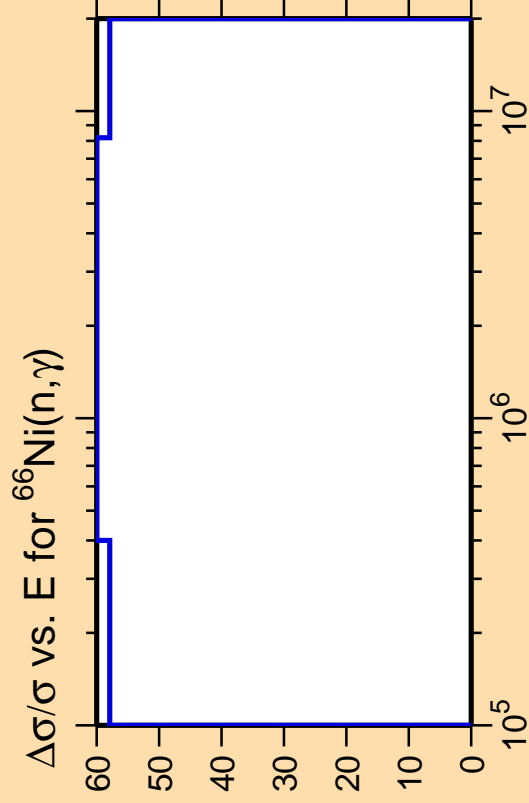


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{nonel.})$

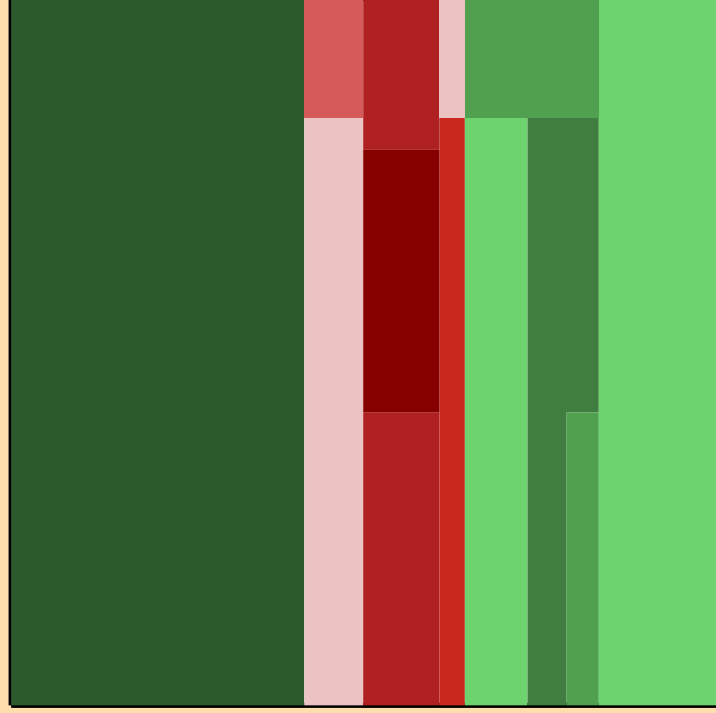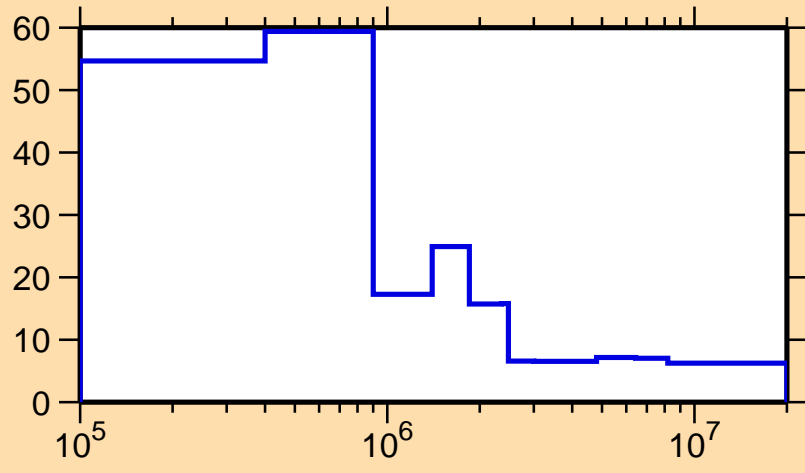

Correlation Matrix




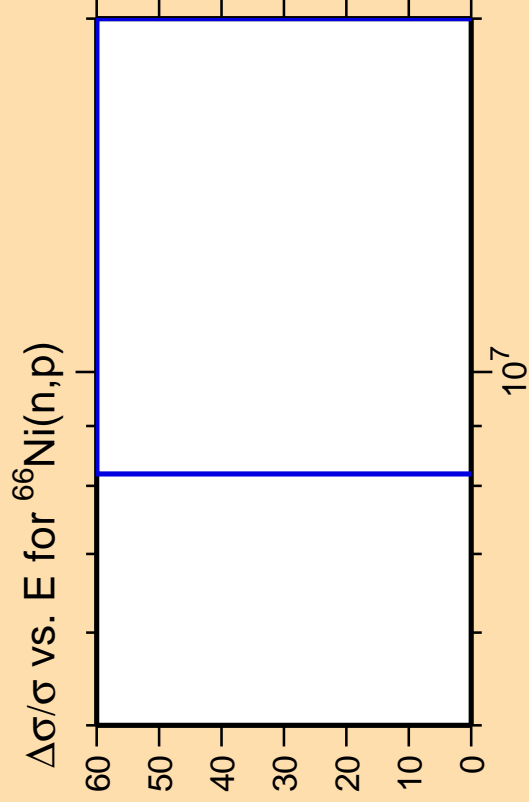


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{nonel.})$

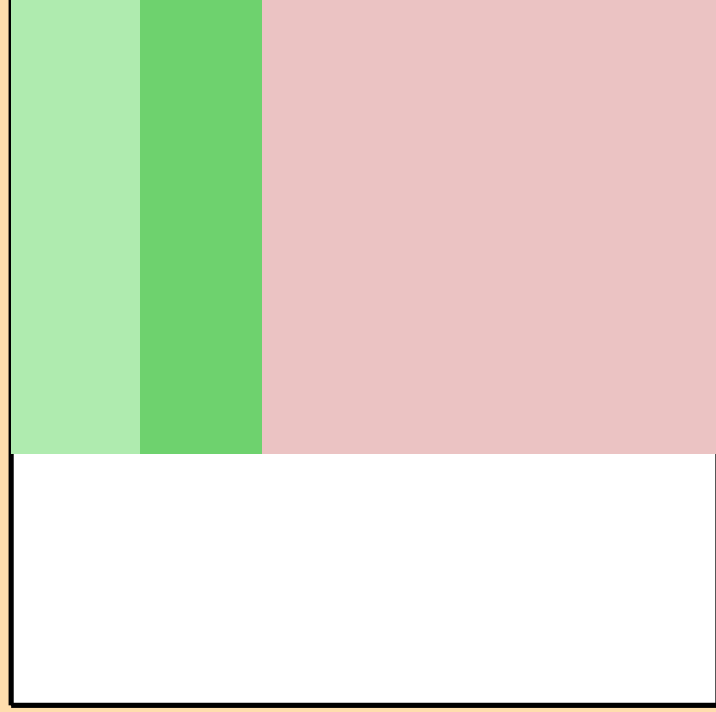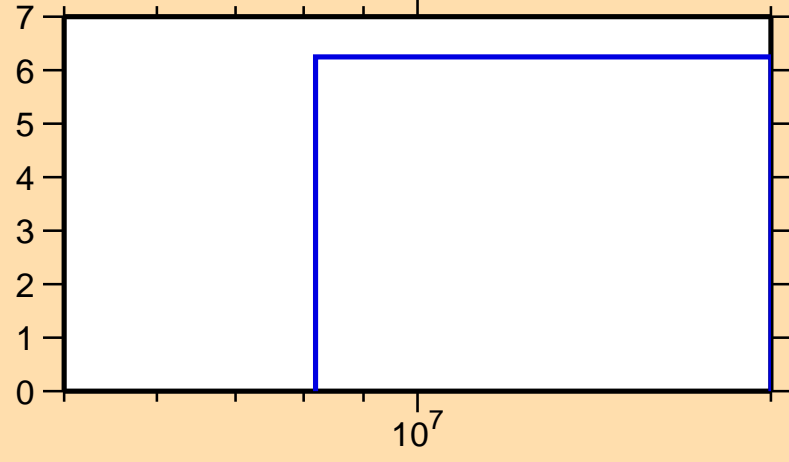

Correlation Matrix




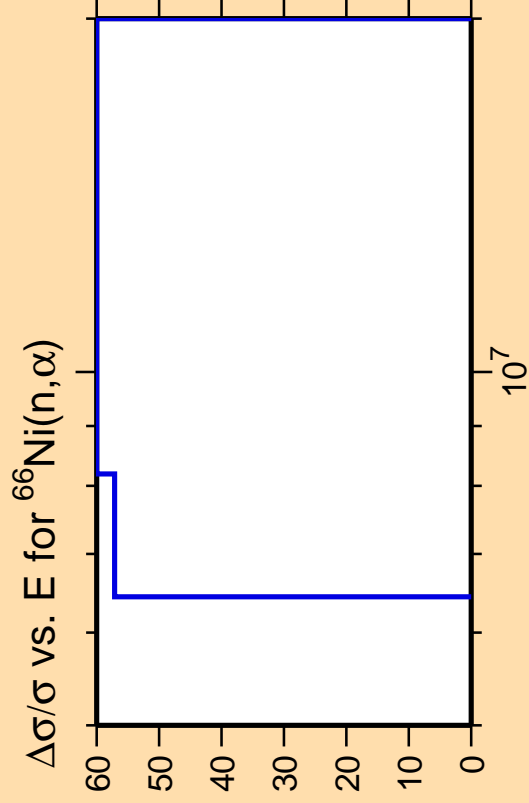


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{nonel.})$

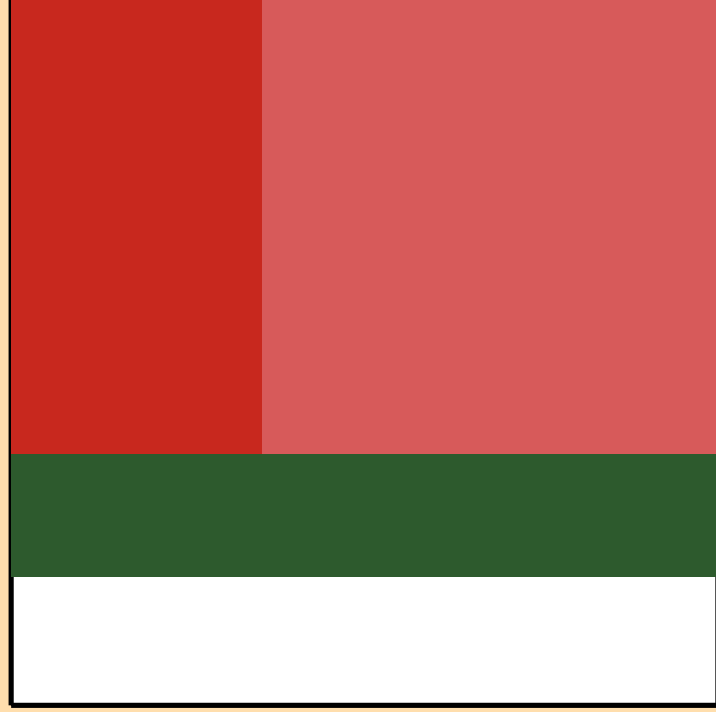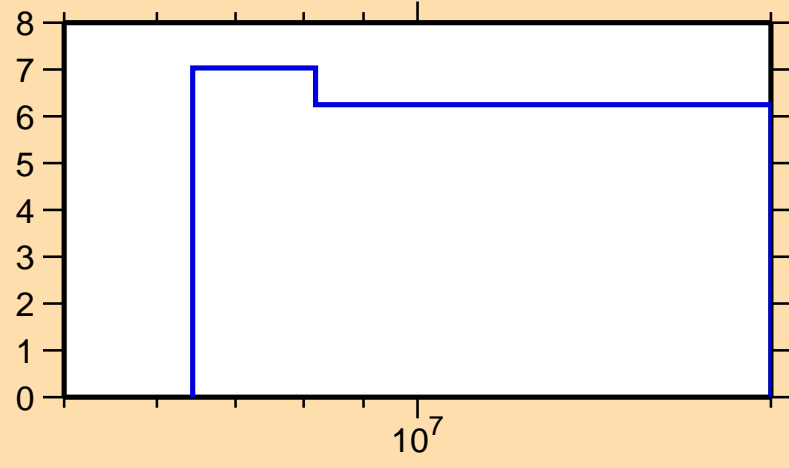



Correlation Matrix



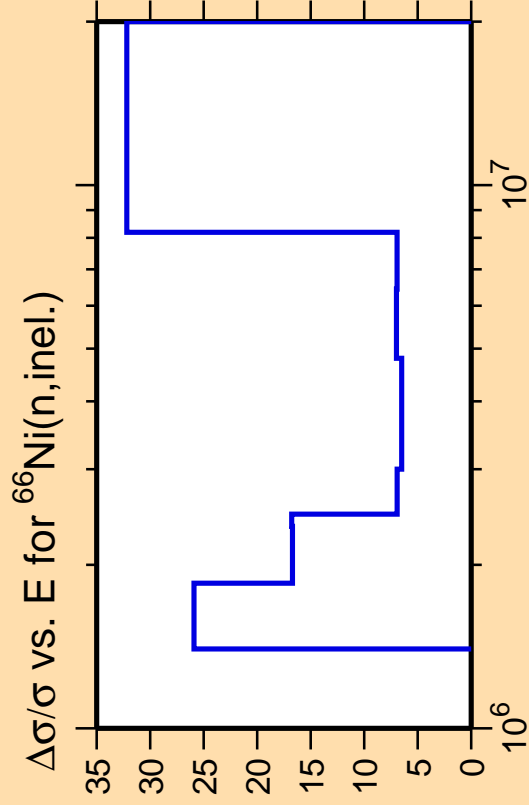

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

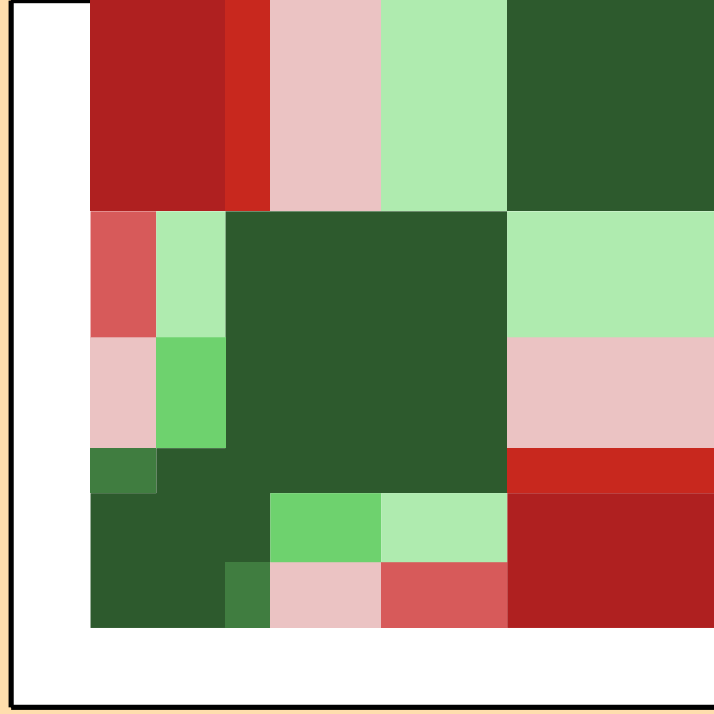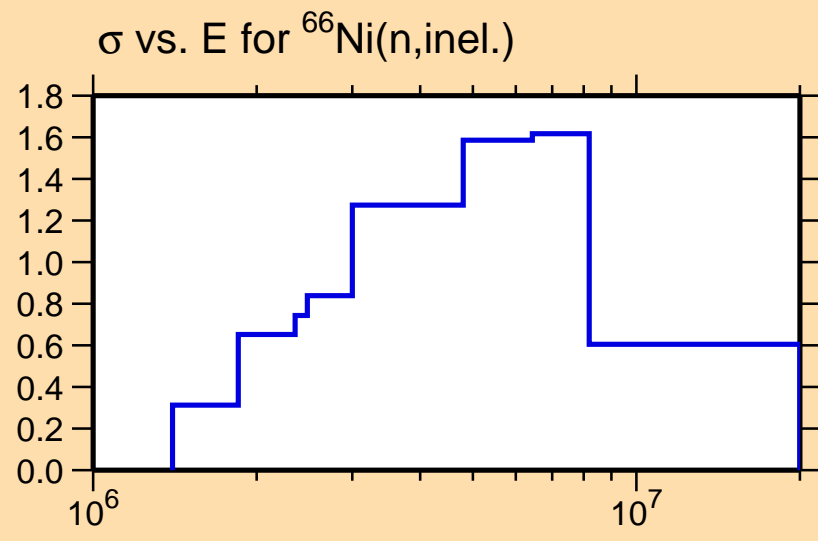

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

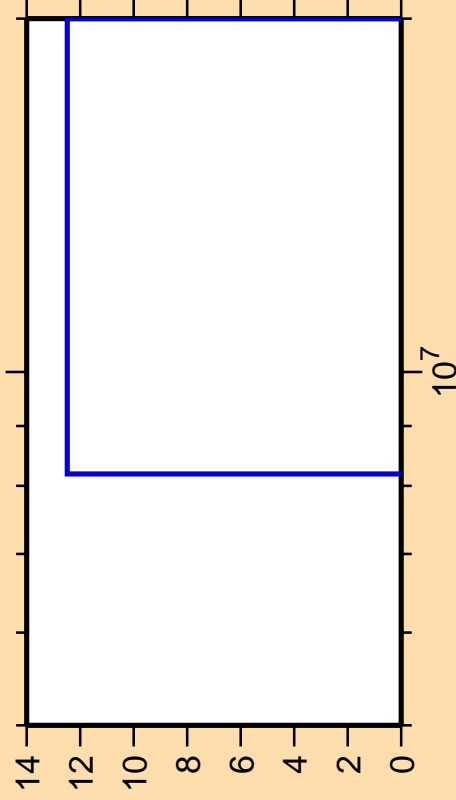

Ordinate scale is %
relative standard deviation.





Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{inel.})$

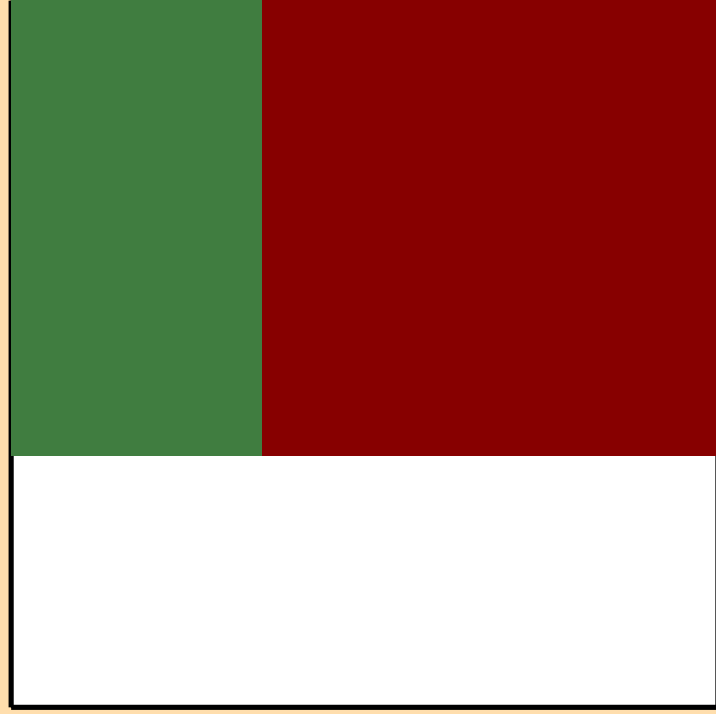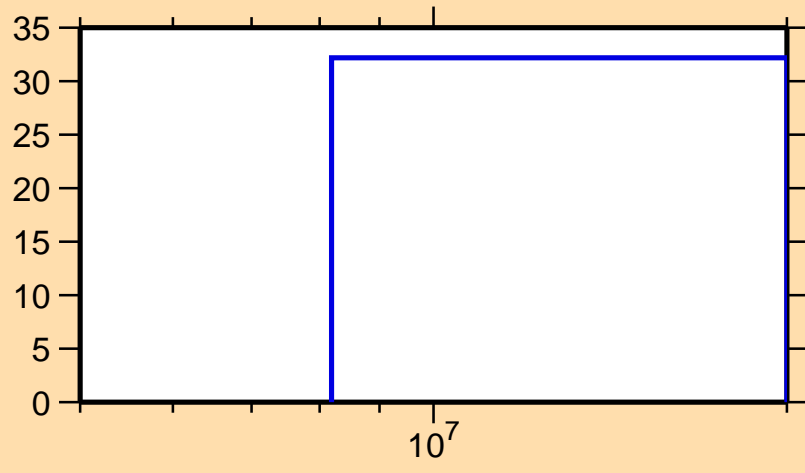


Correlation Matrix



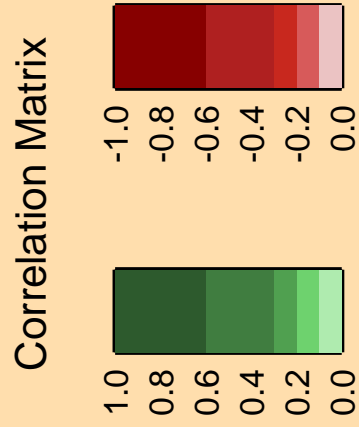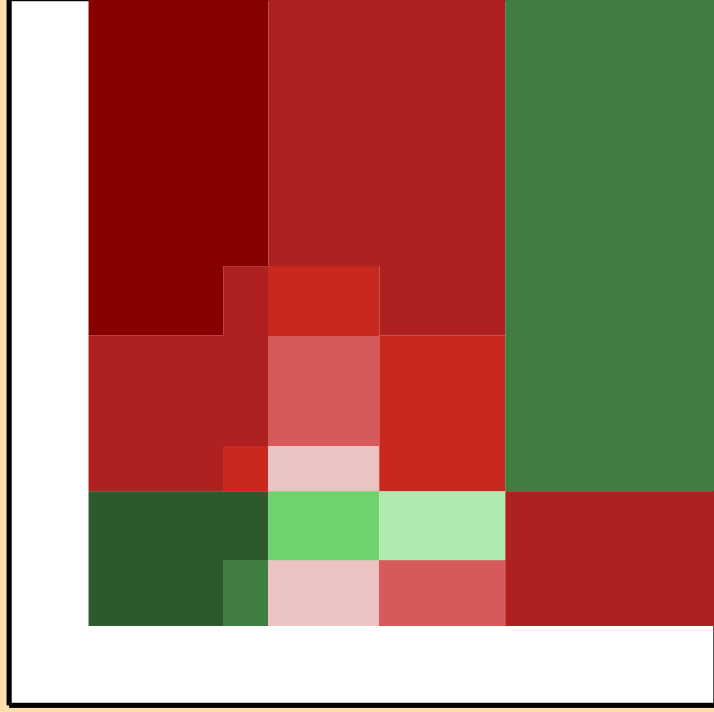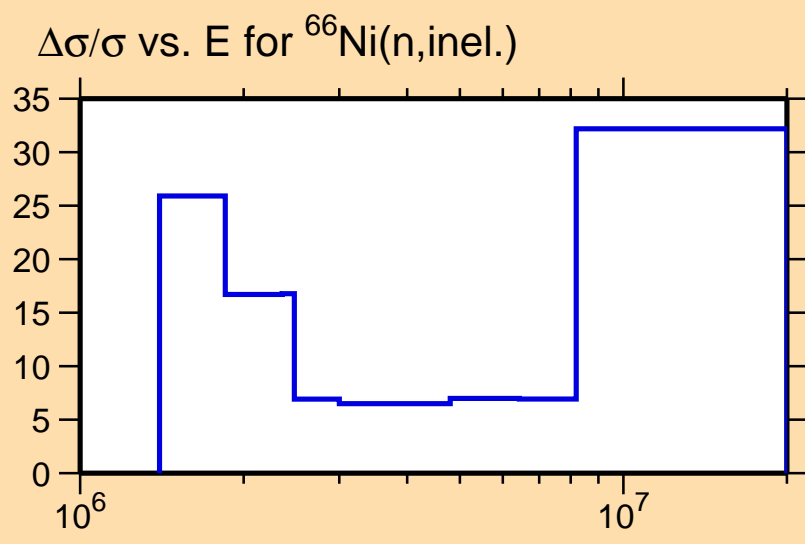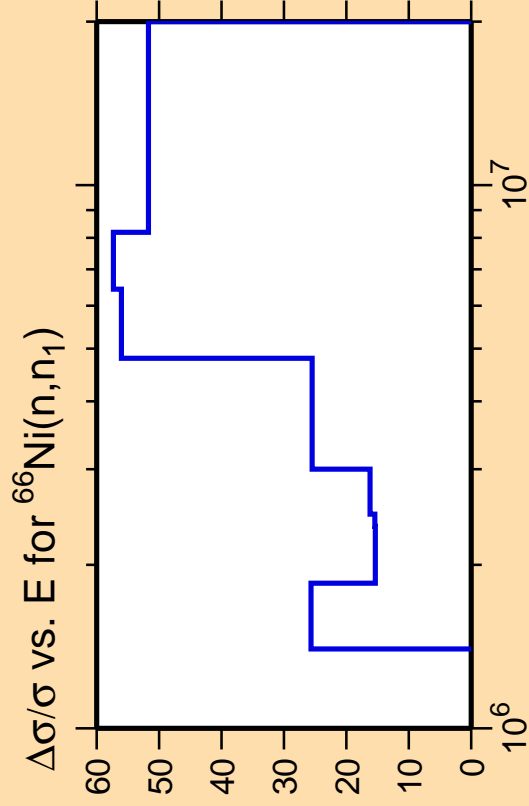



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

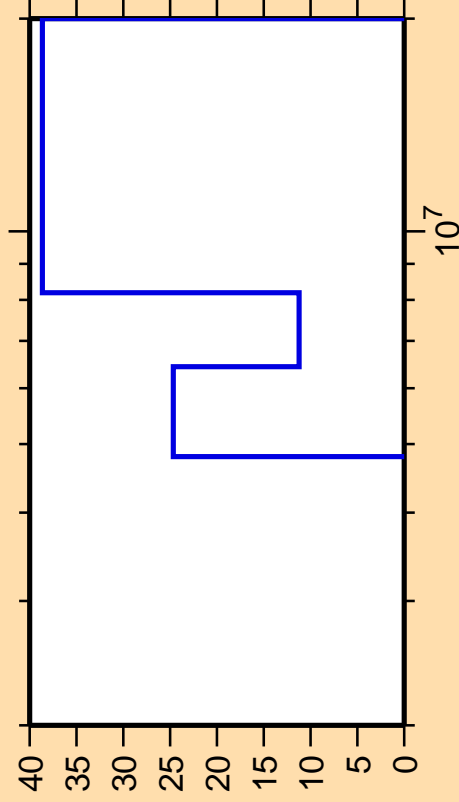

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{inel.})$

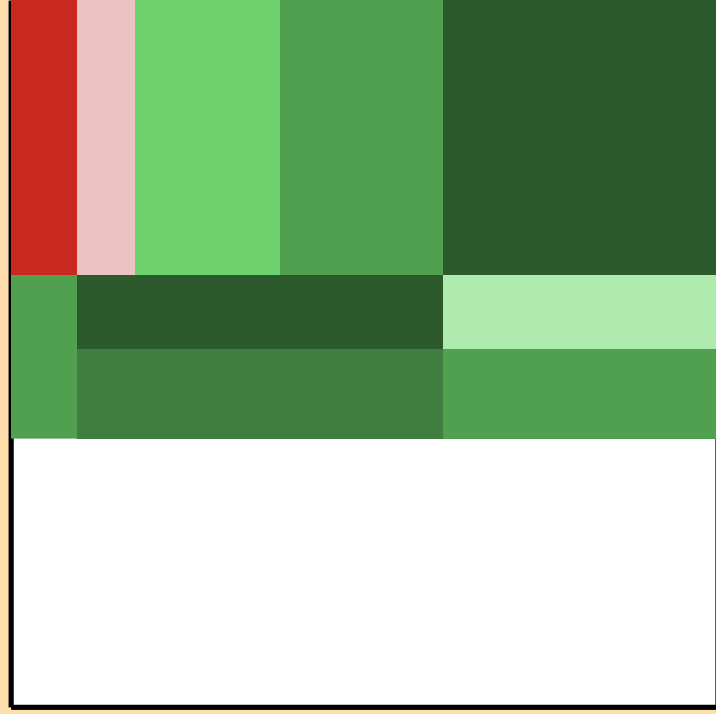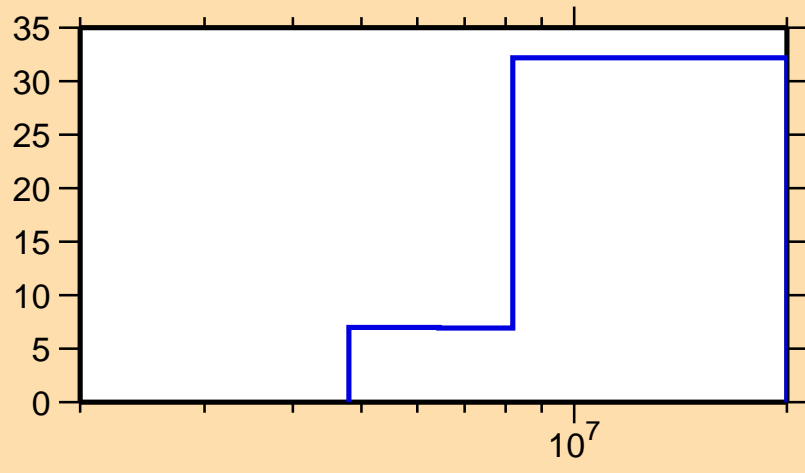

Correlation Matrix




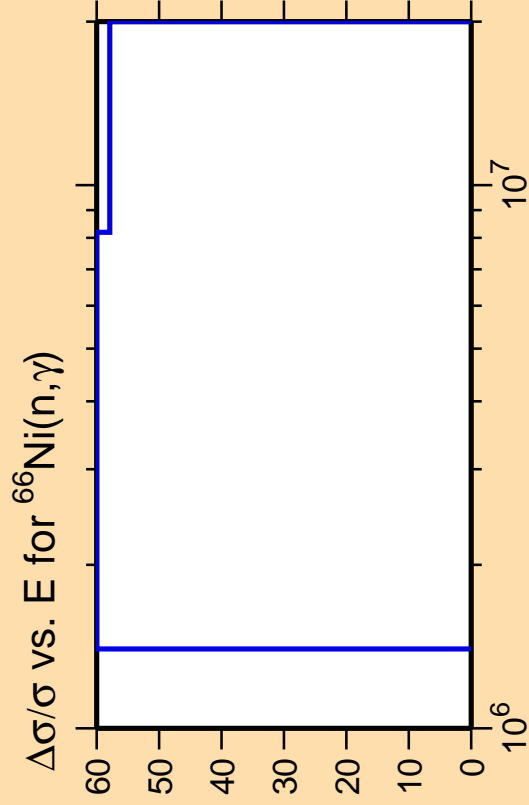


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{inel.})$

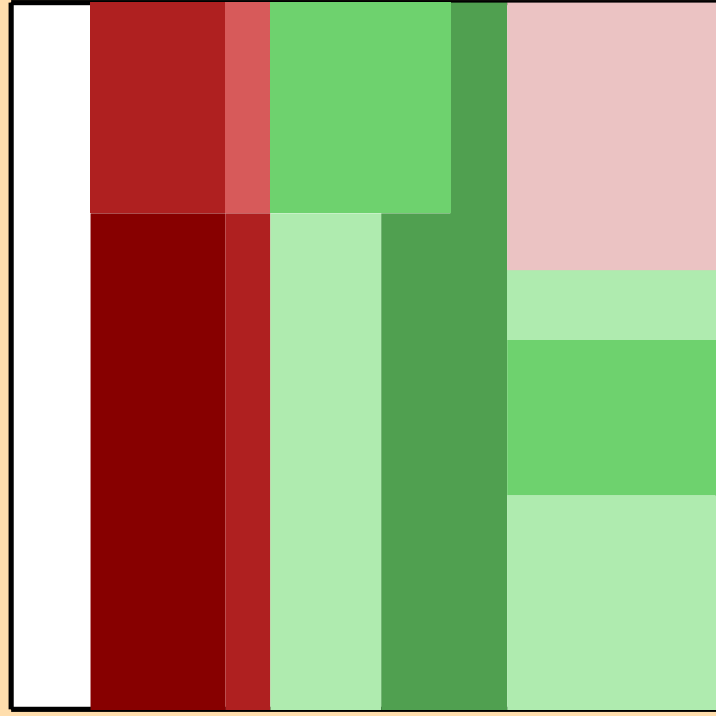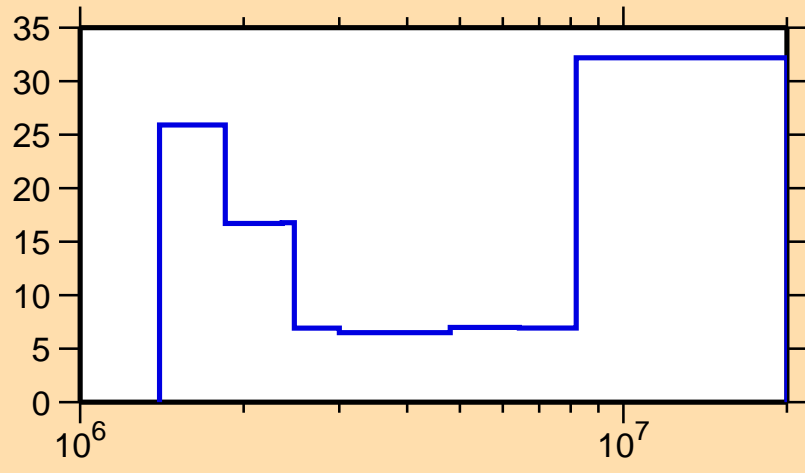

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$


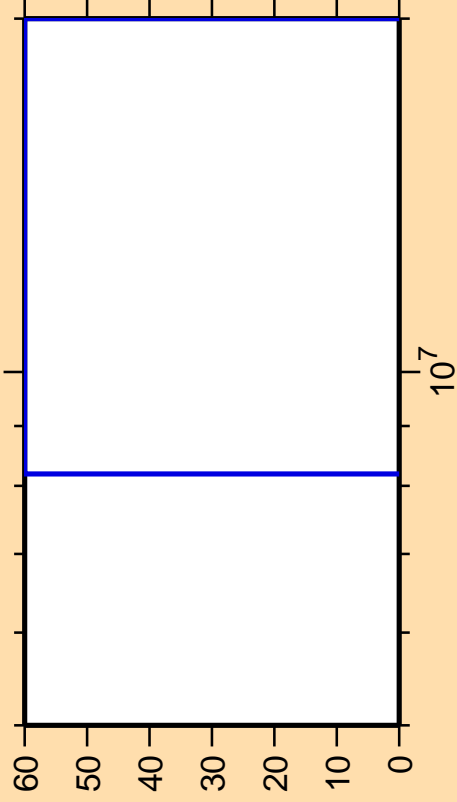


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{inel.})$

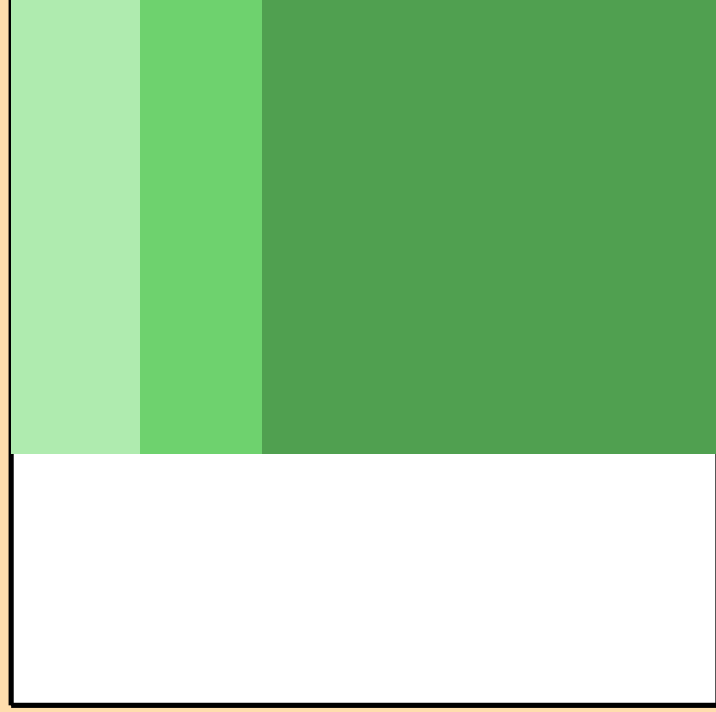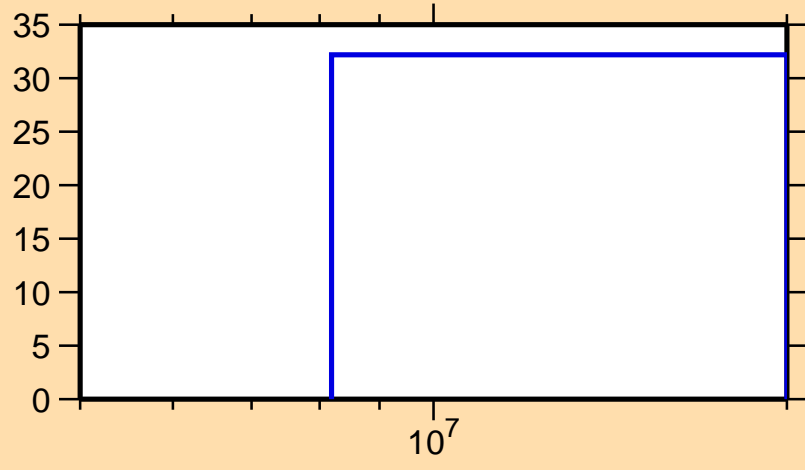

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


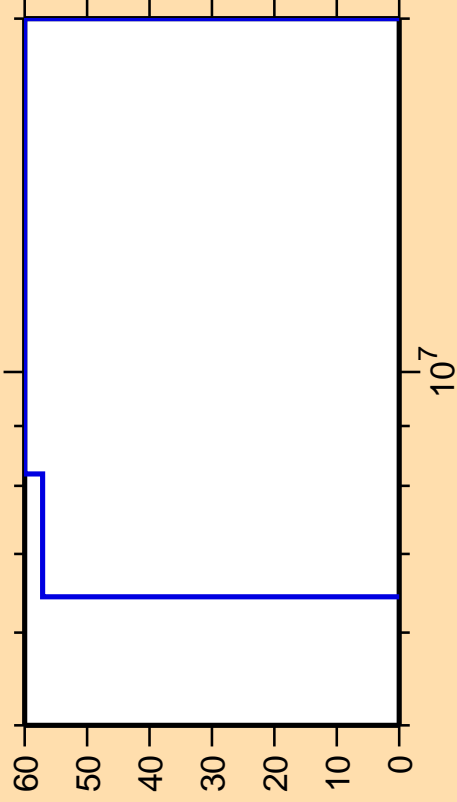


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\text{inel.})$

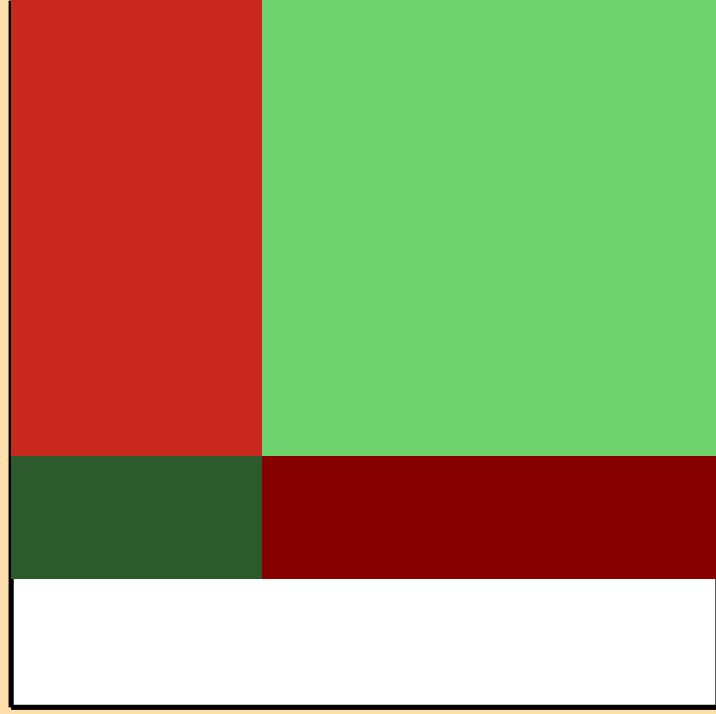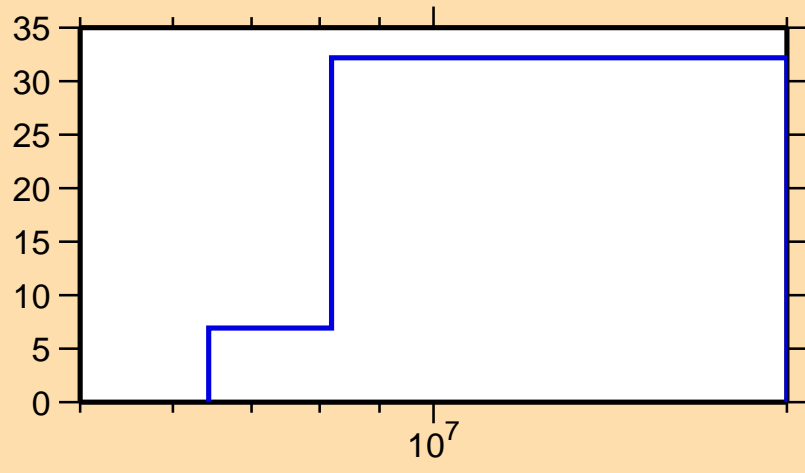

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

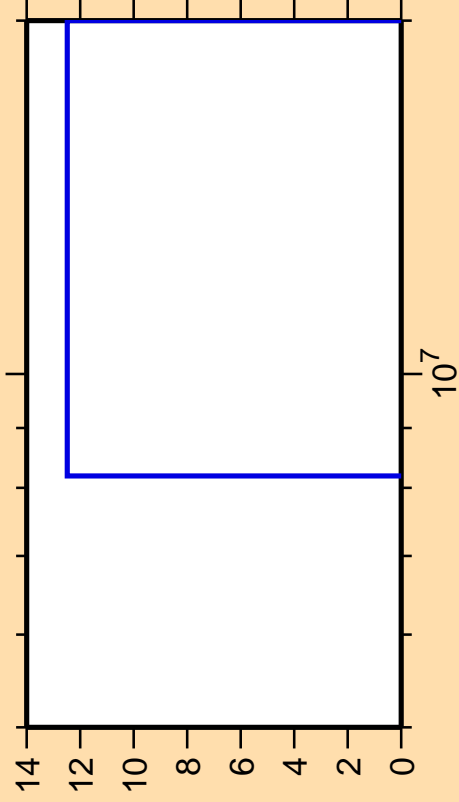

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{66}\text{Ni}(n,2n)$

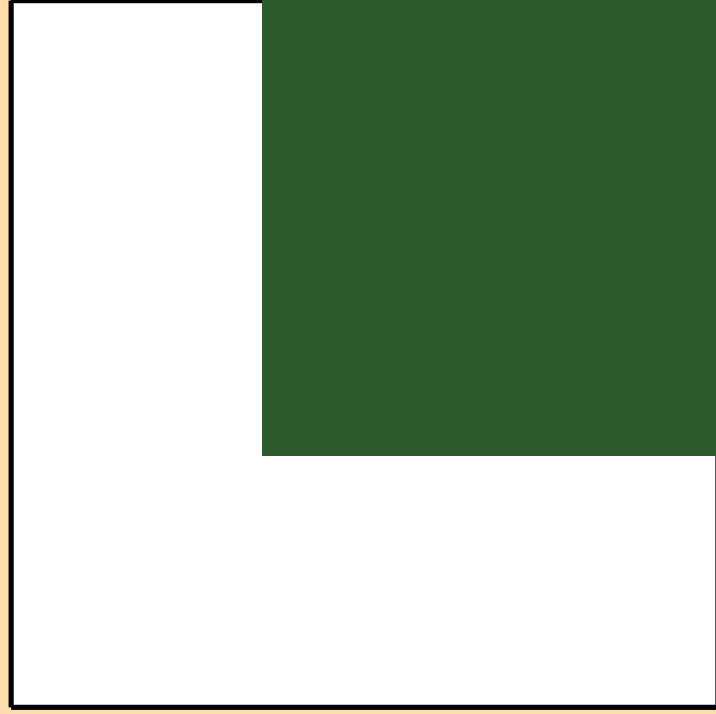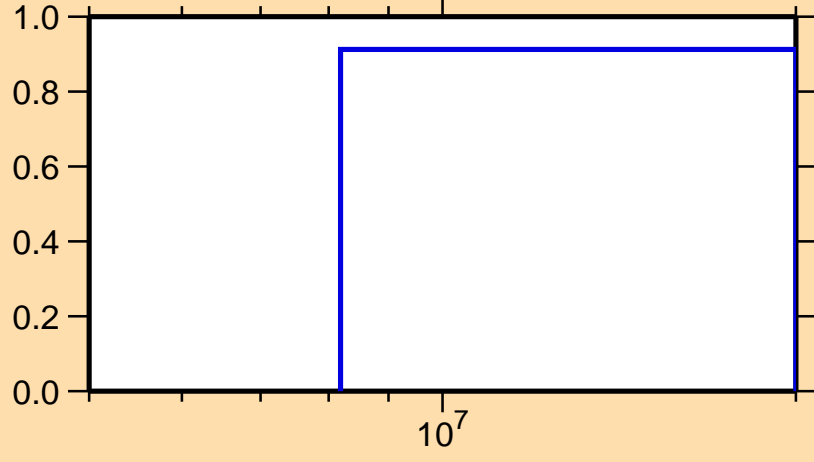

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n_1)$

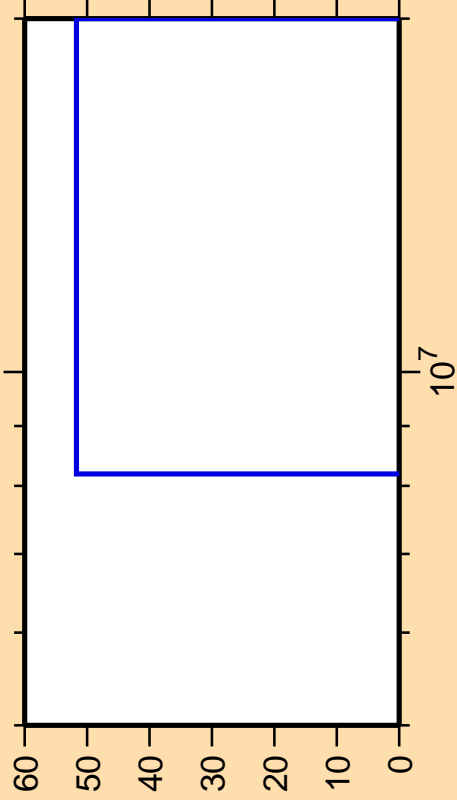

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

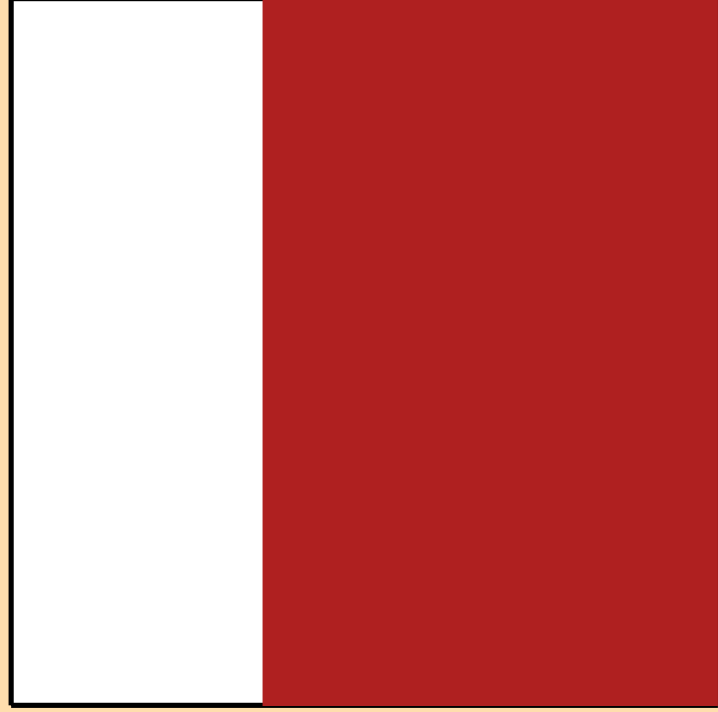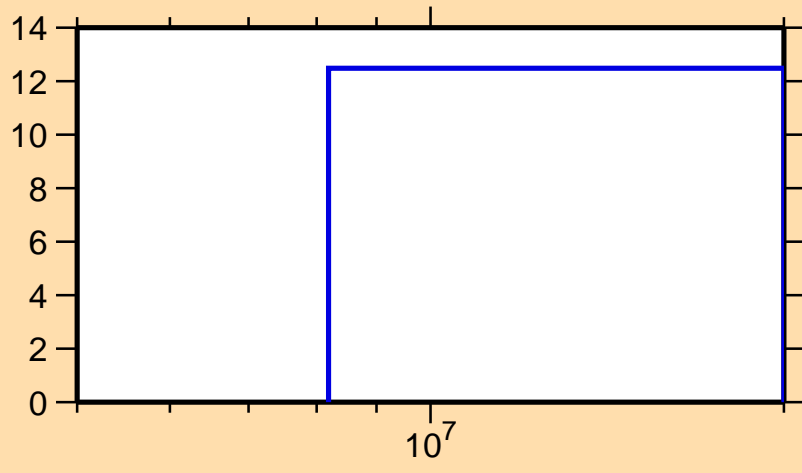

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

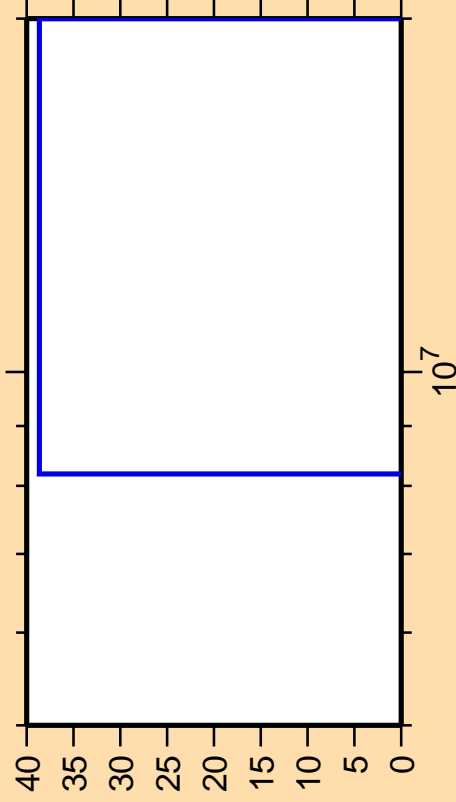

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

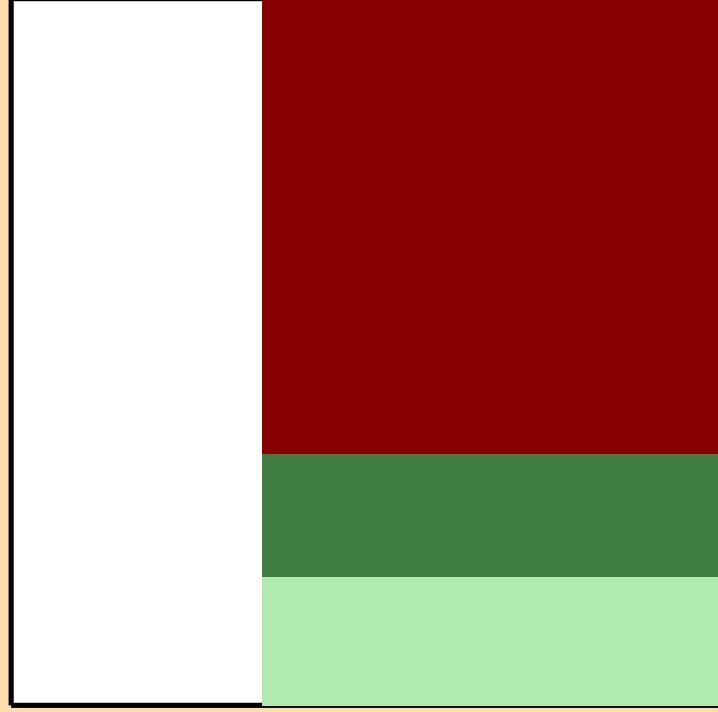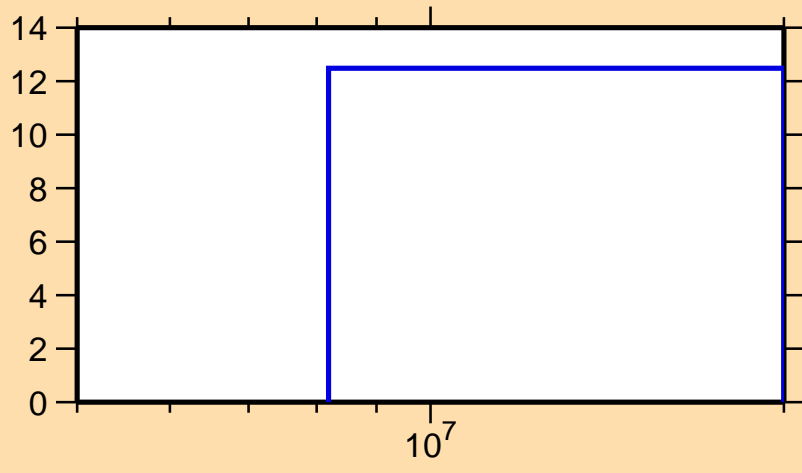

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\gamma)$

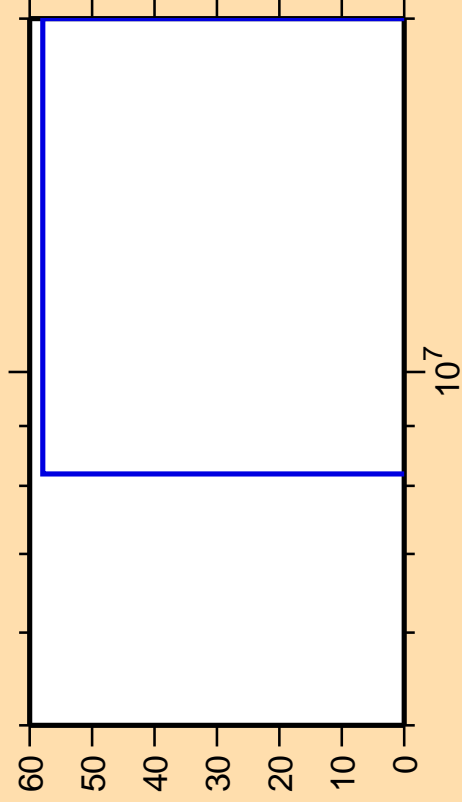


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

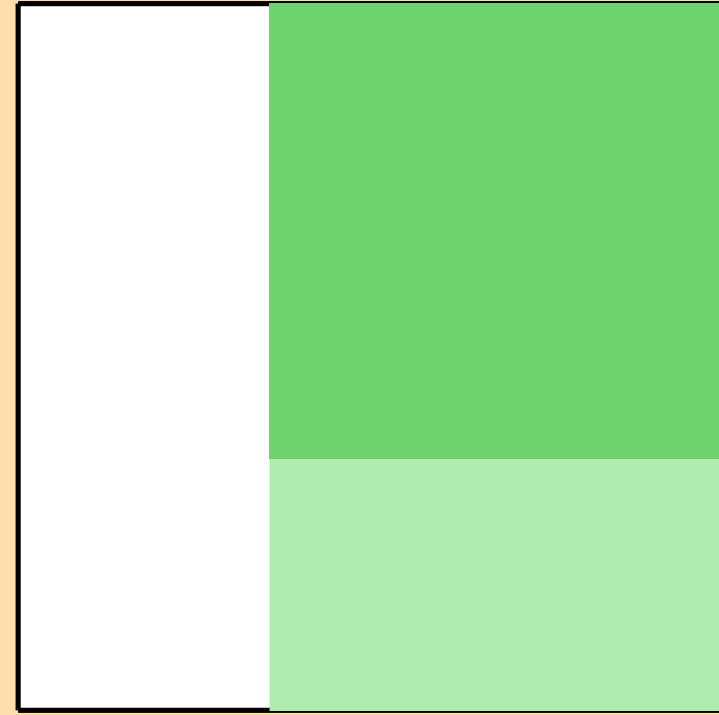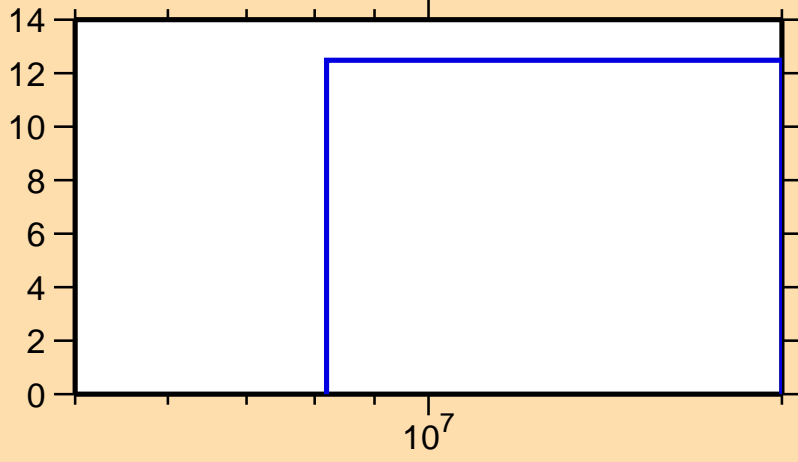

Correlation Matrix

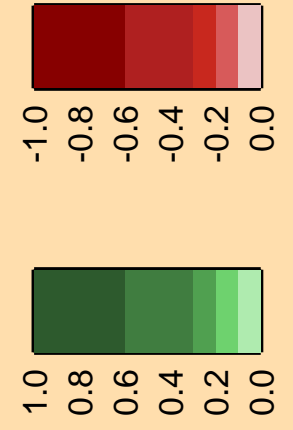

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$


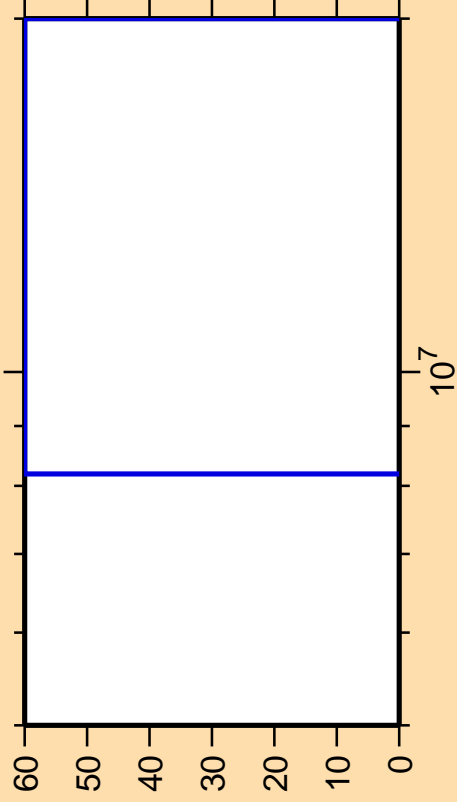


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

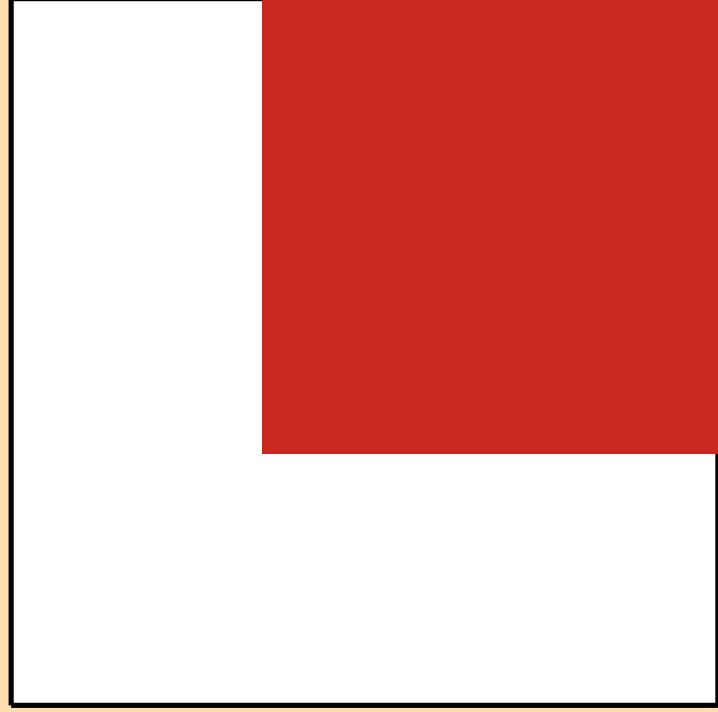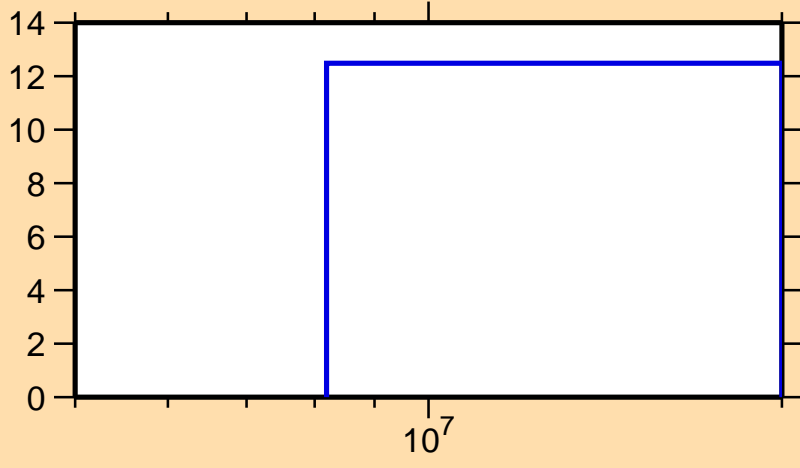

Correlation Matrix

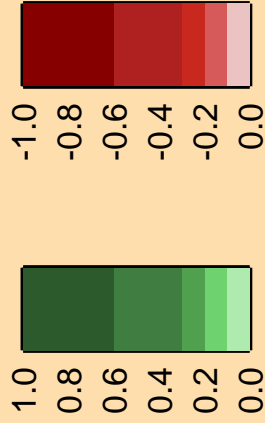

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$





Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,2n)$

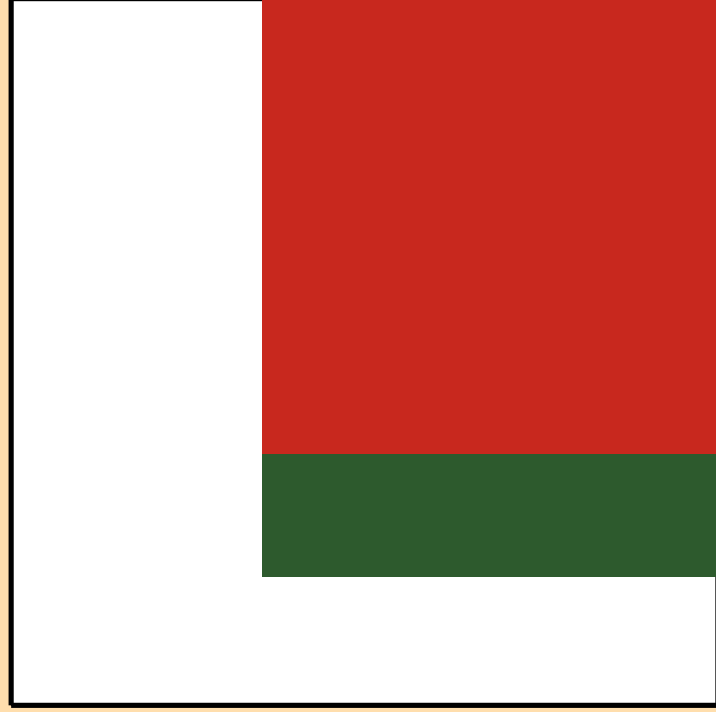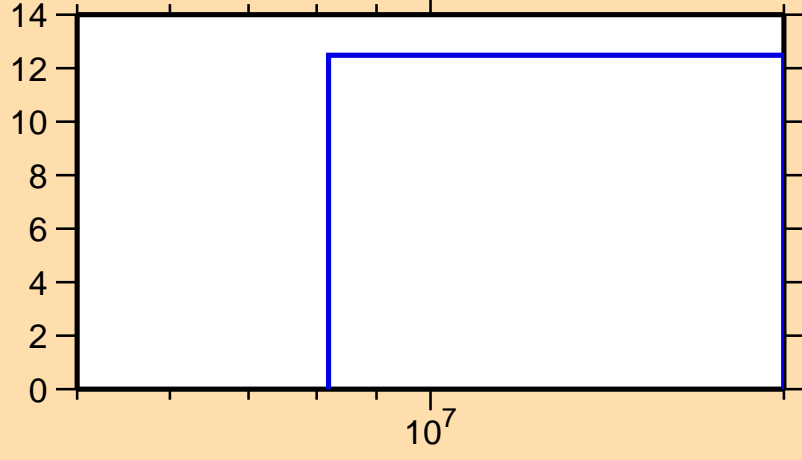



Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,3n)$

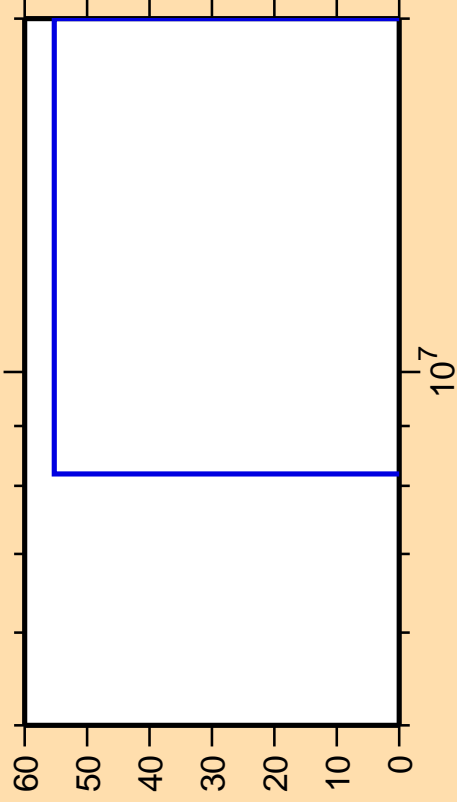


σ vs. E for $^{66}\text{Ni}(n,3n)$

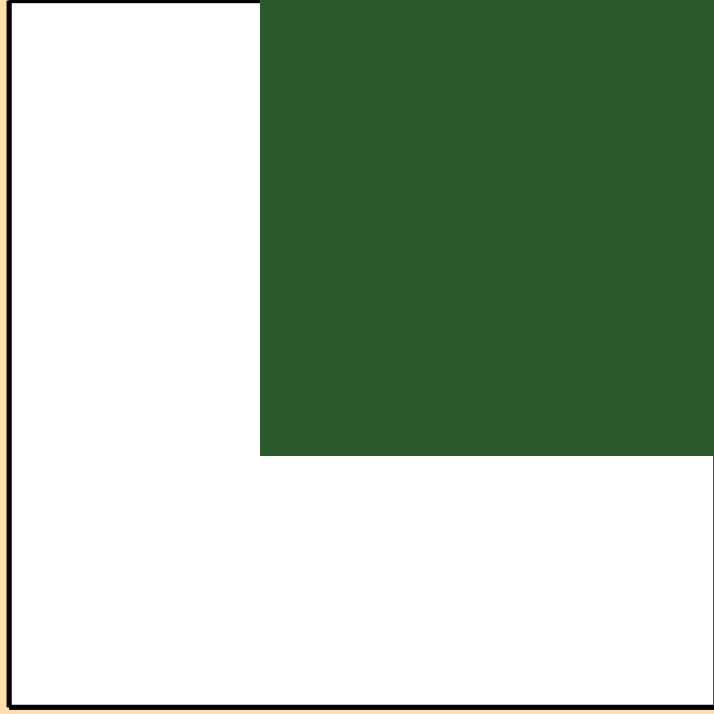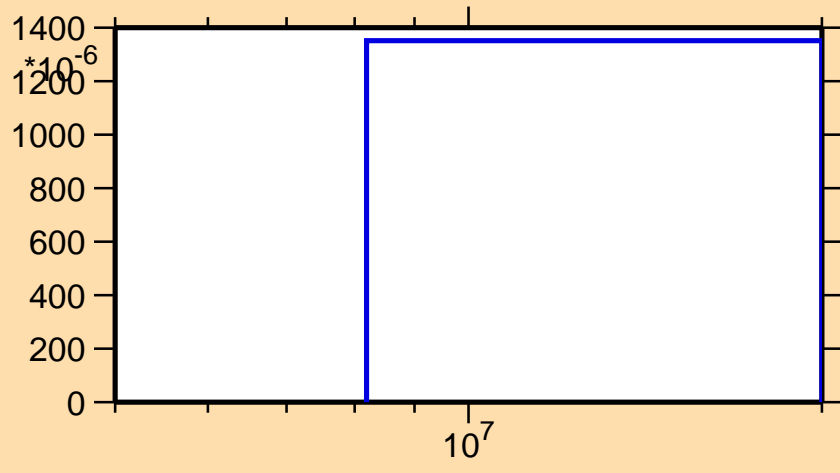

Correlation Matrix

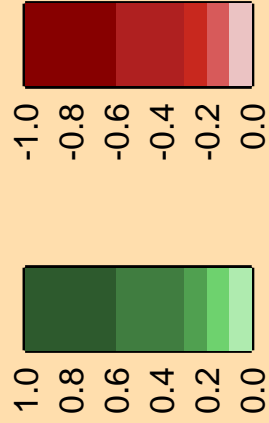

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\alpha)$


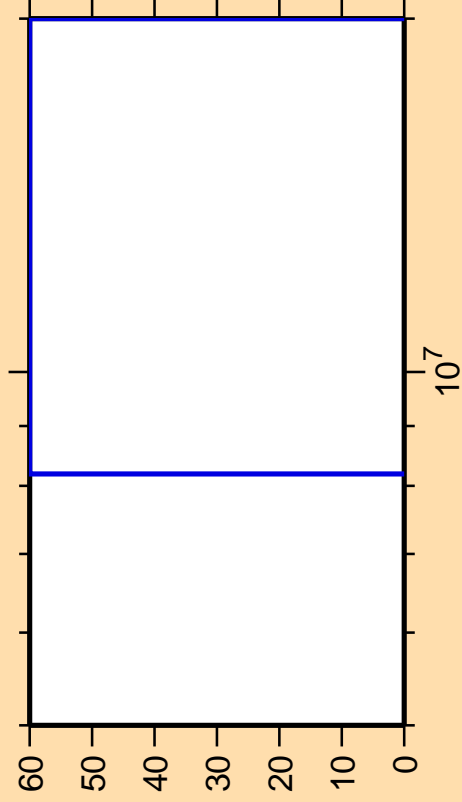


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{66}\text{Ni}(n,n\alpha)$

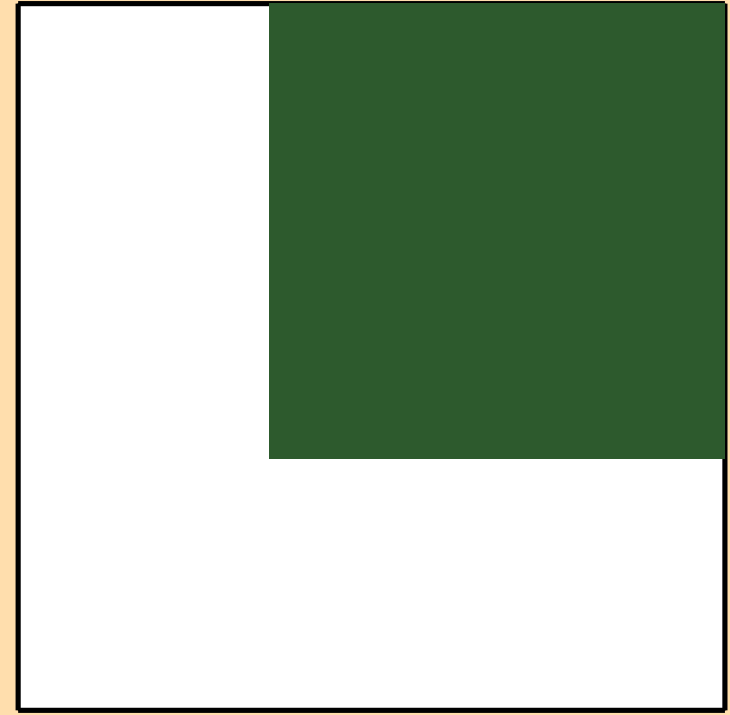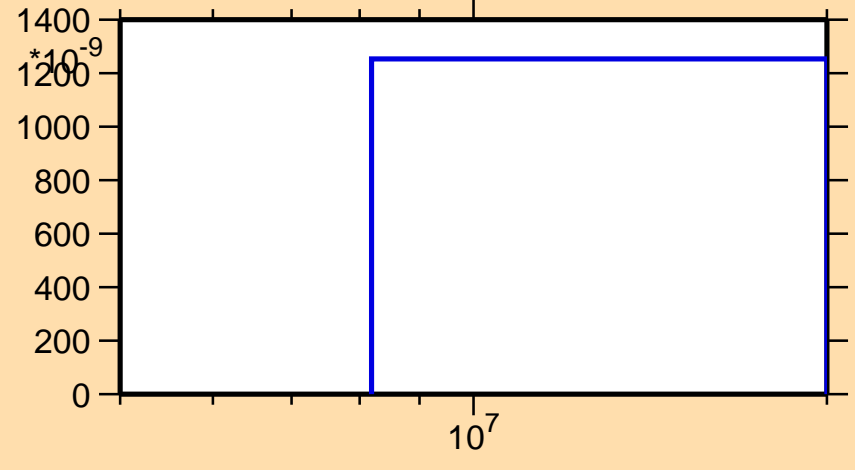

Correlation Matrix

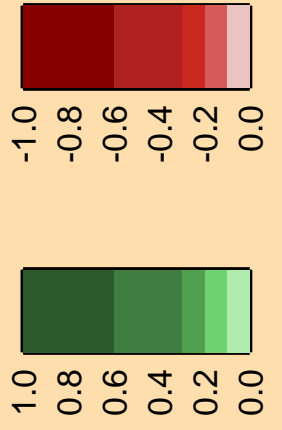



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,np)$

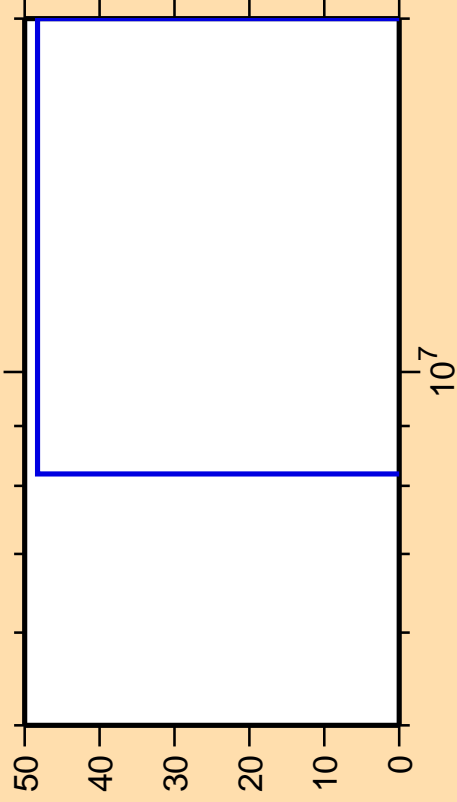

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{66}\text{Ni}(n,np)$

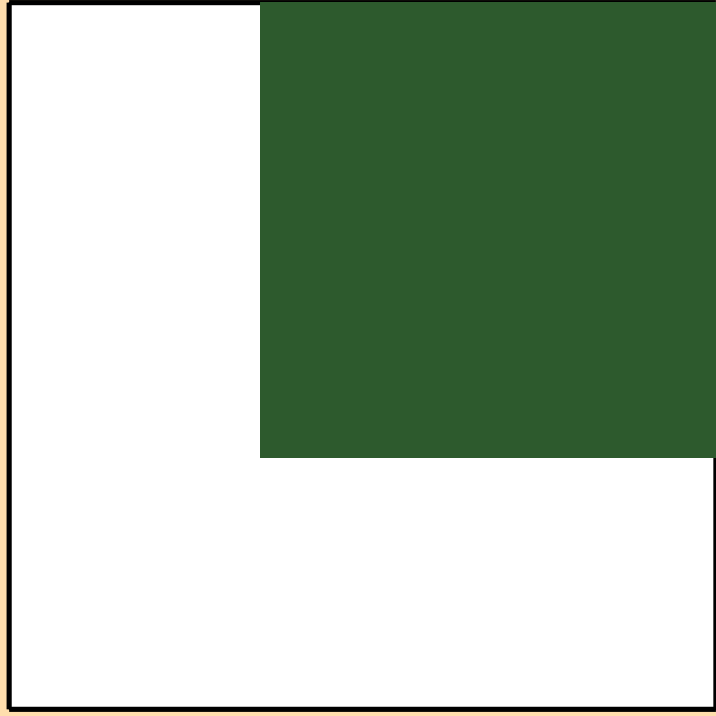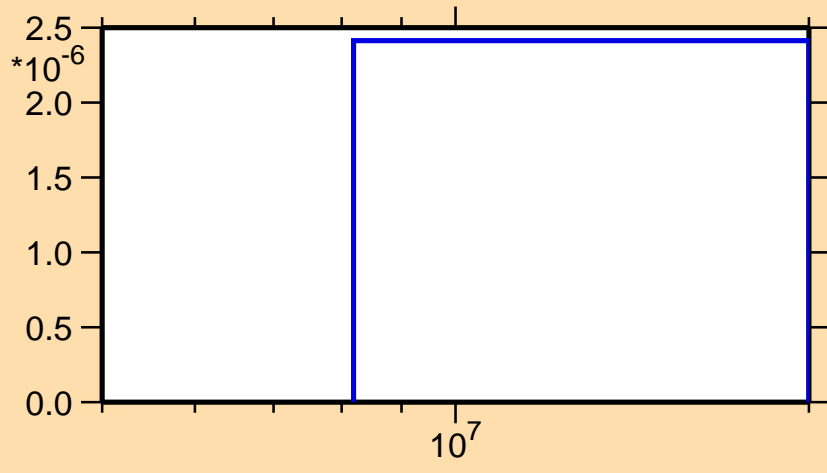



Correlation Matrix



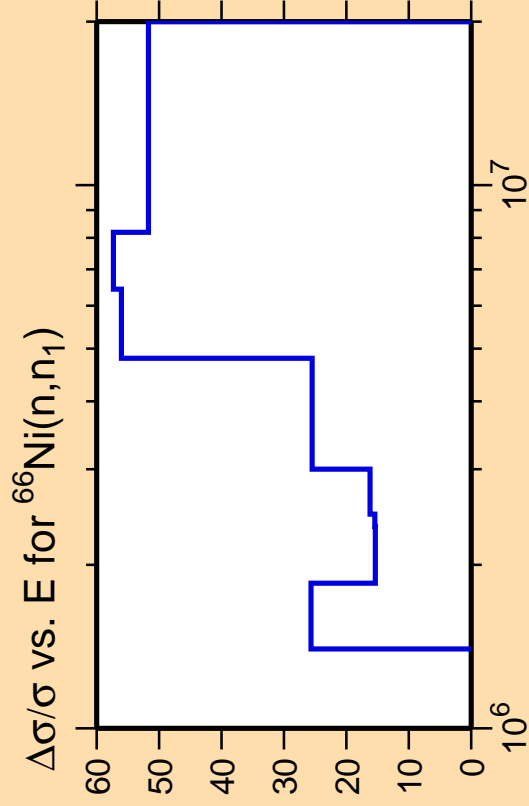

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

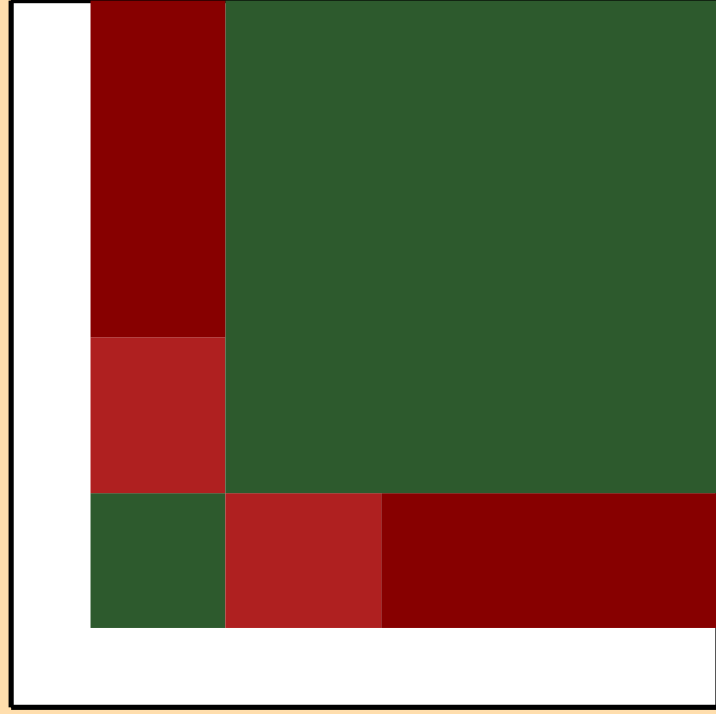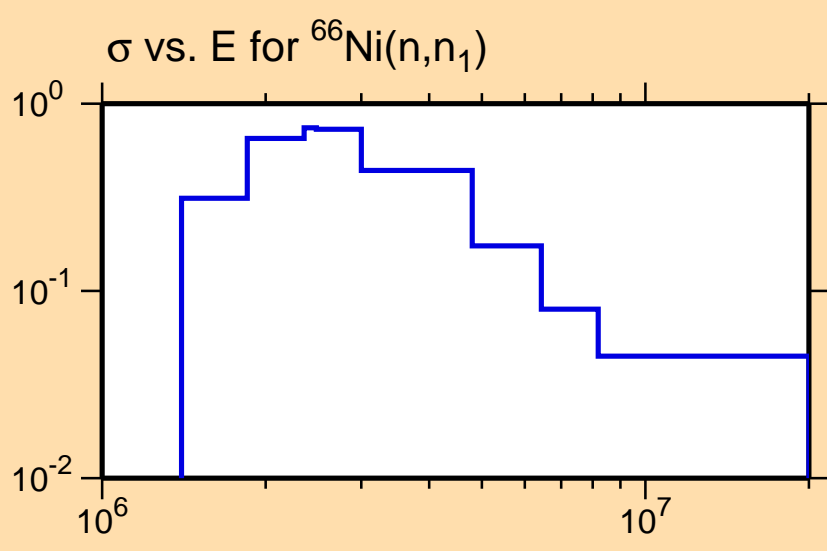

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n_{\text{cont}})$.

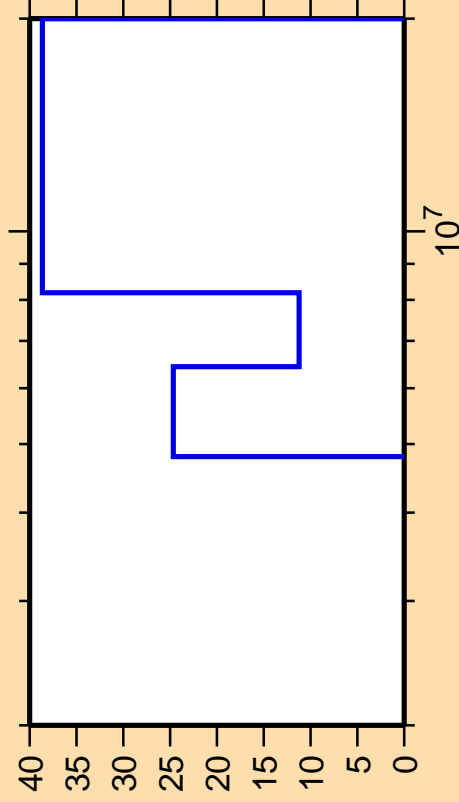

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n, n_1)$

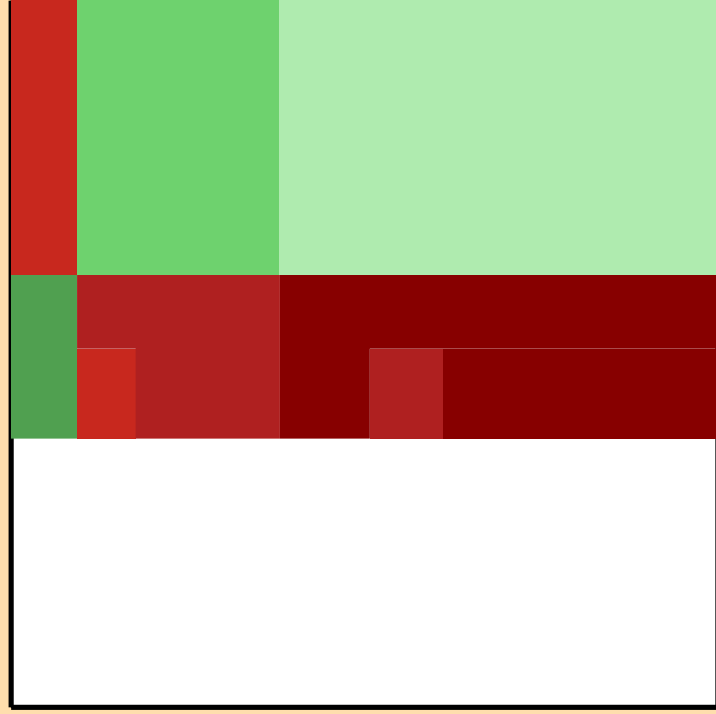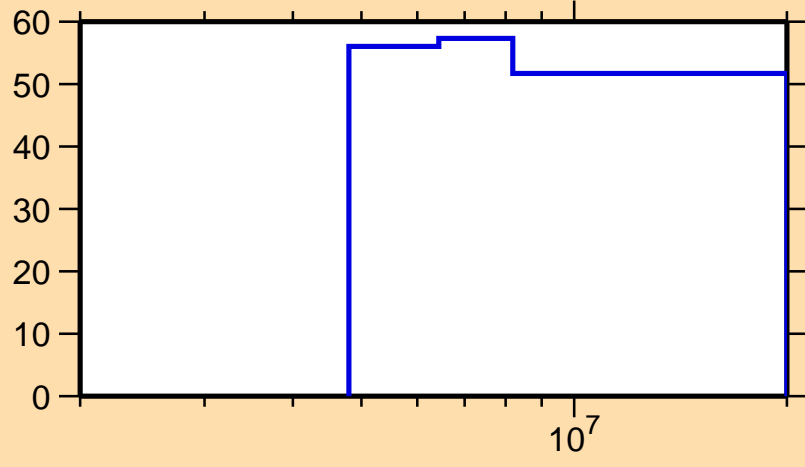

Correlation Matrix





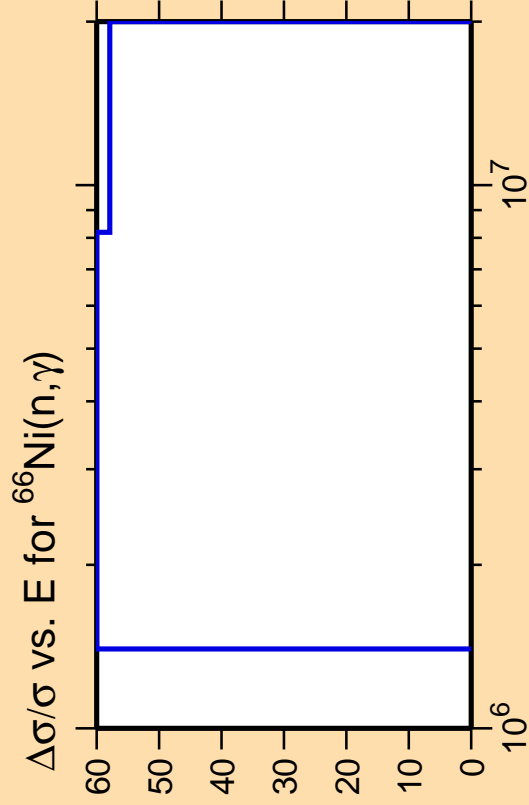

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

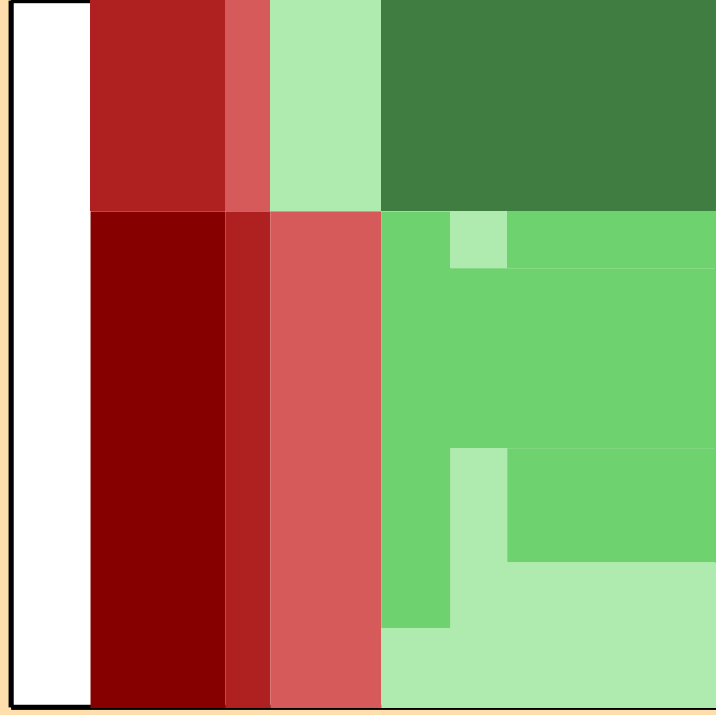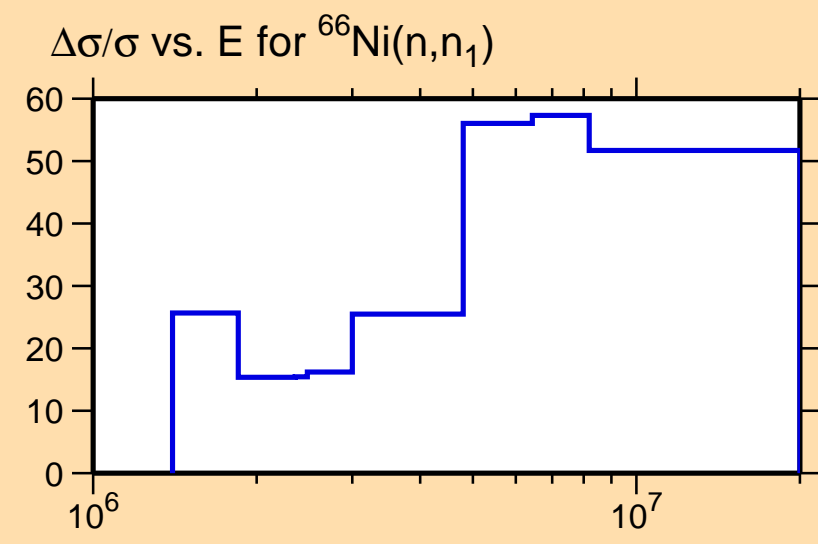

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$


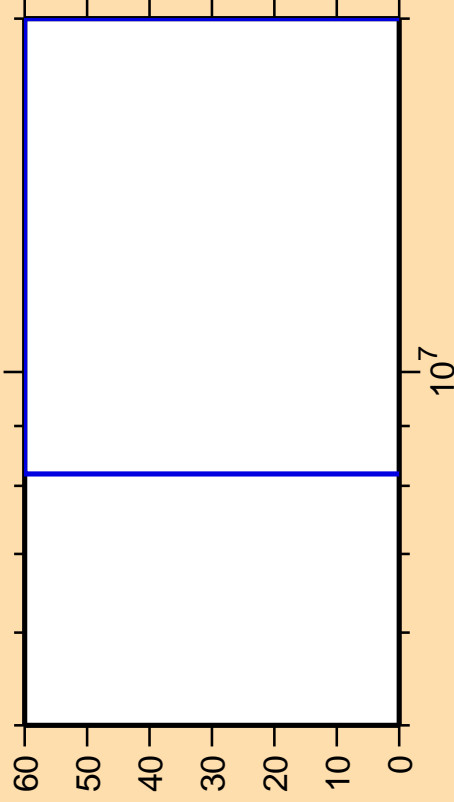


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n_1)$

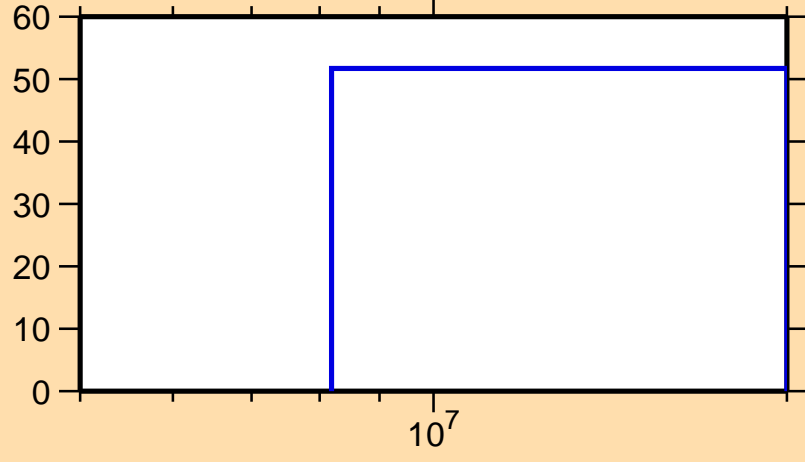

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


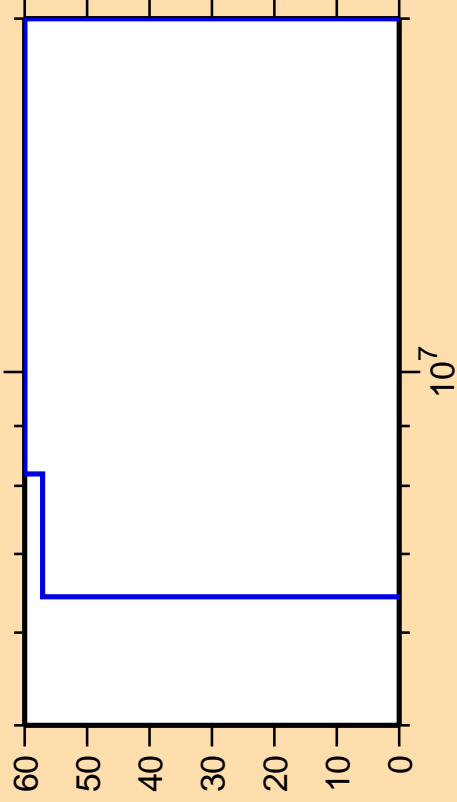


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n_1)$

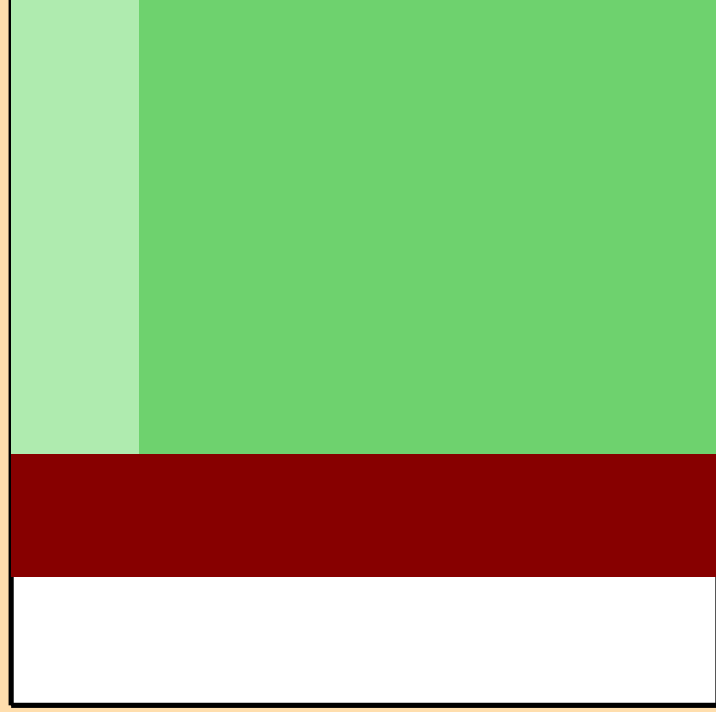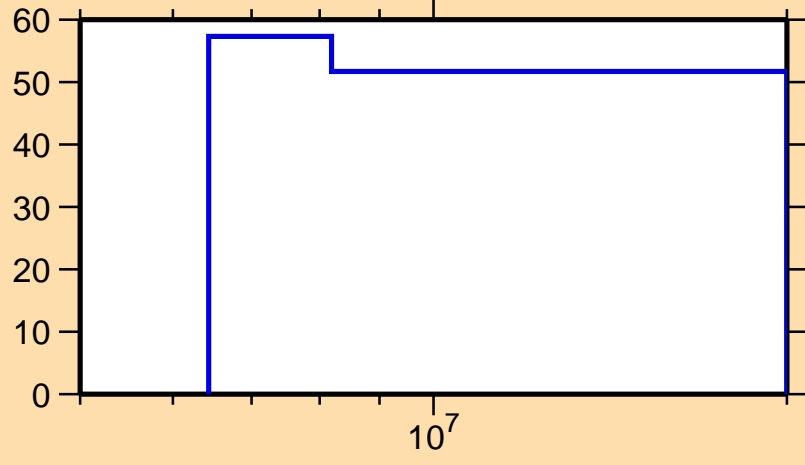

Correlation Matrix





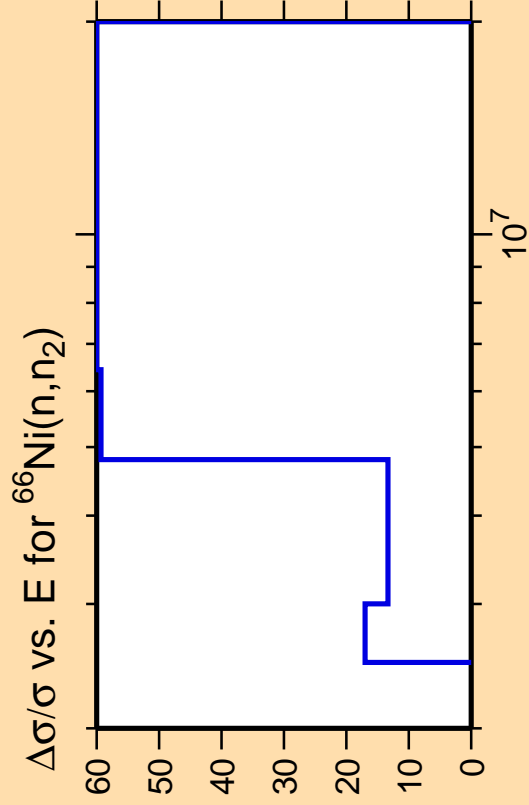

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

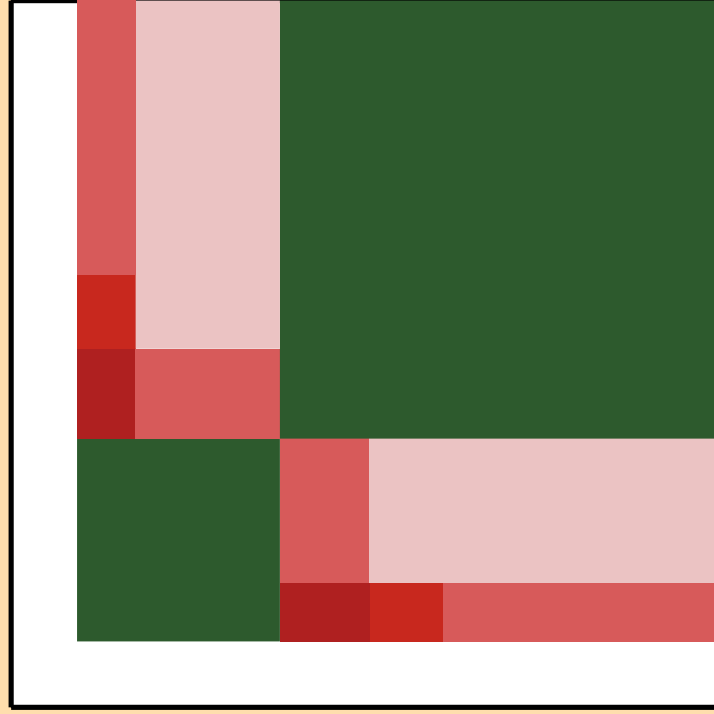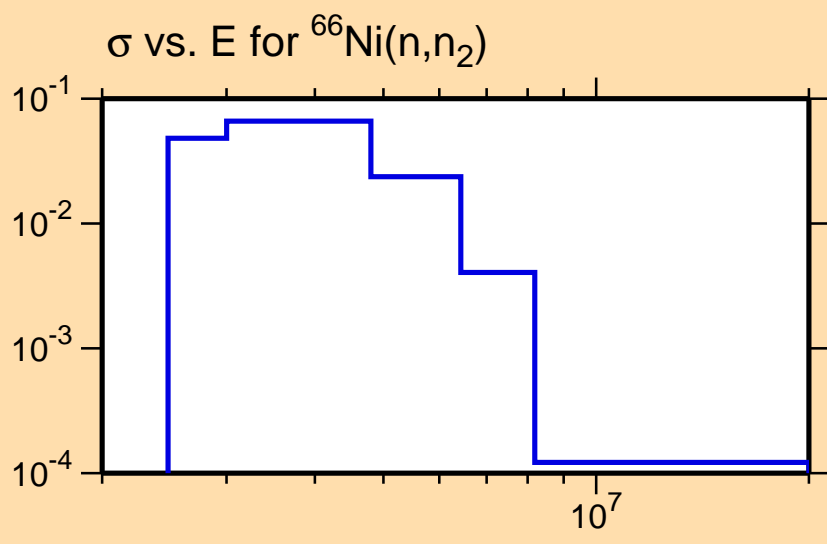

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n_3)$


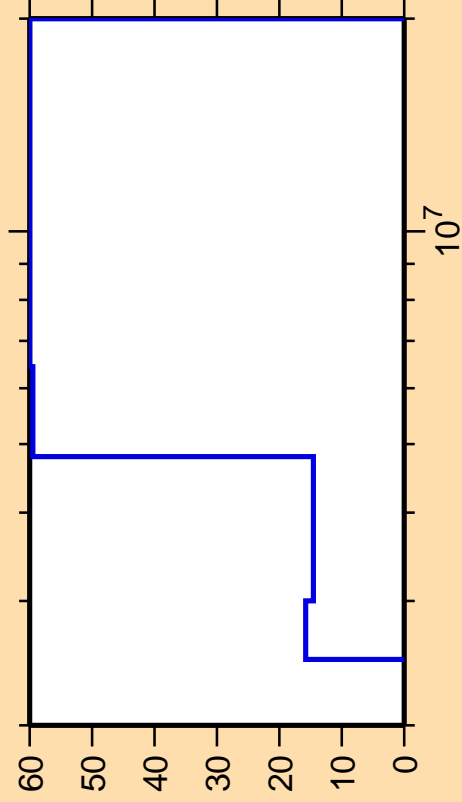


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{66}\text{Ni}(n,n_3)$

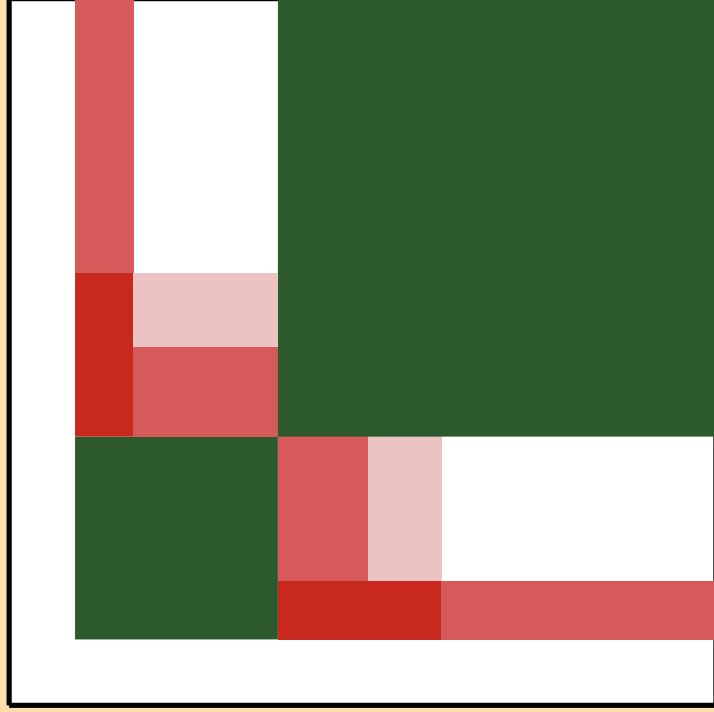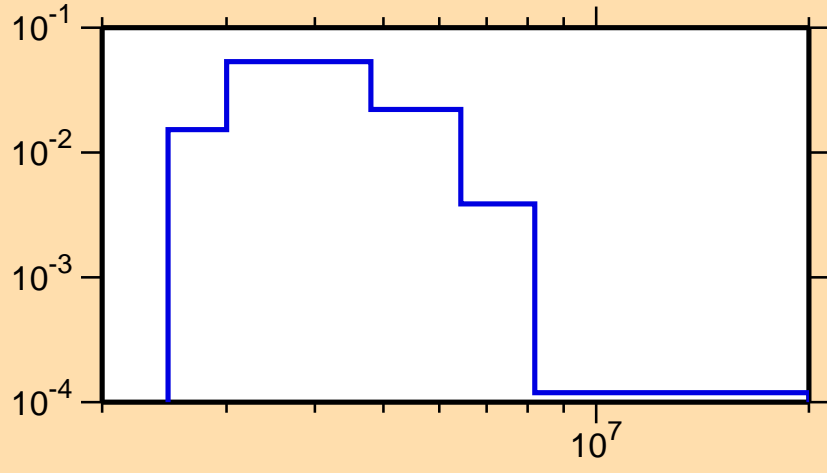

Correlation Matrix

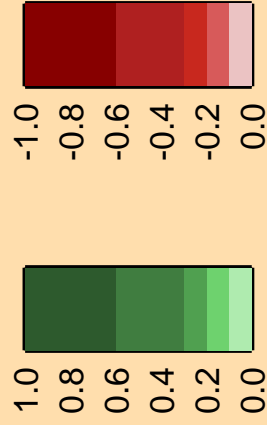


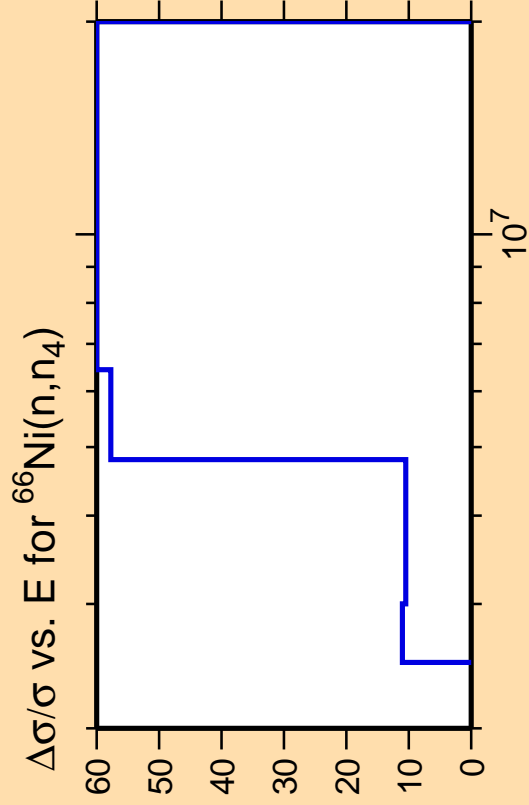


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

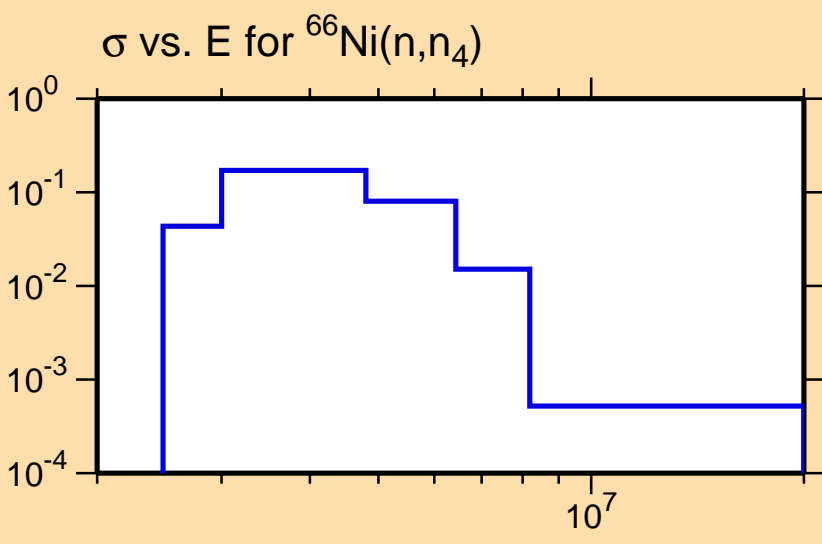


σ vs. E for $^{66}\text{Ni}(n,n_4)$

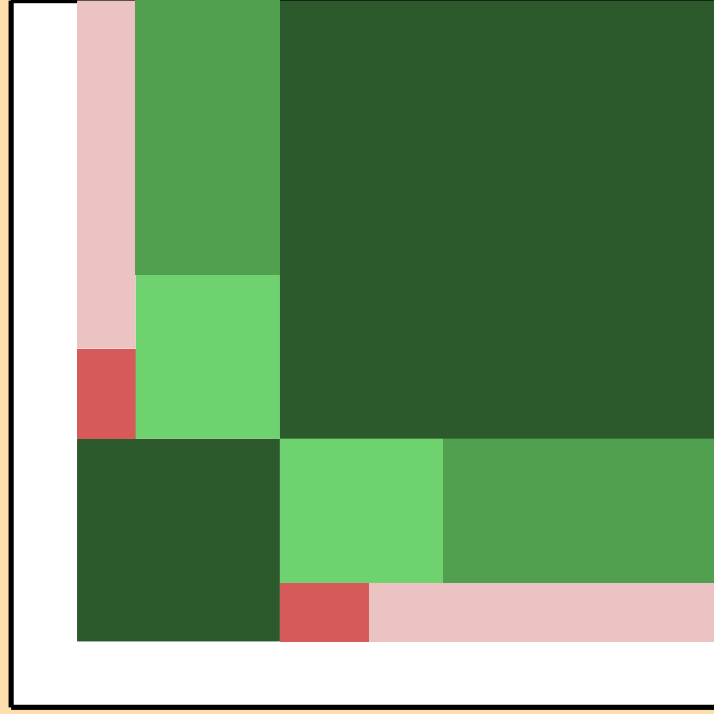

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

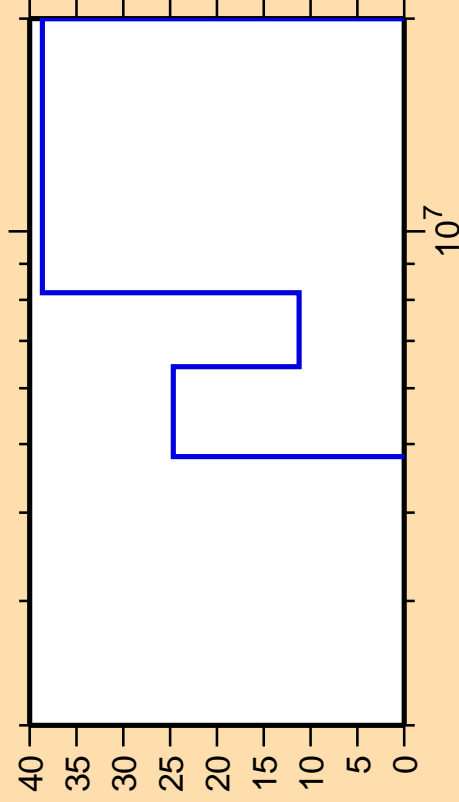

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

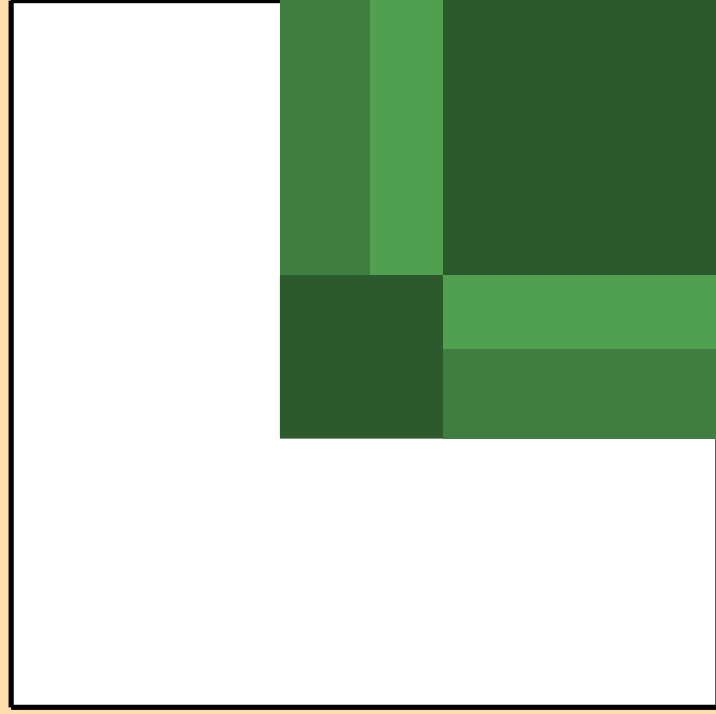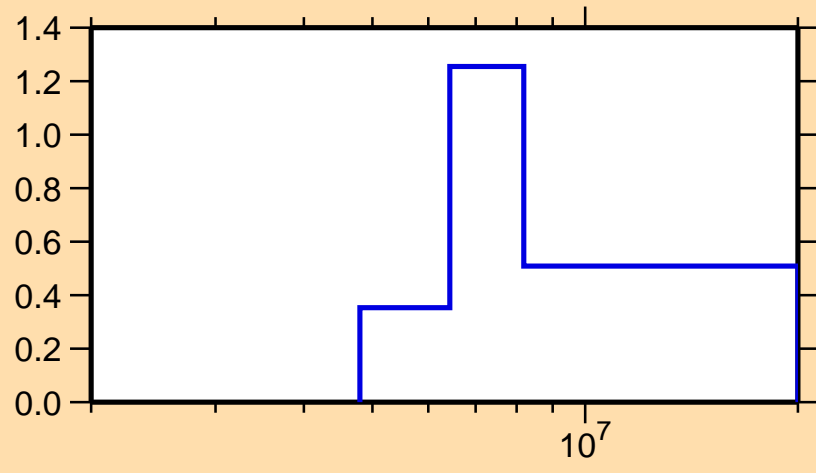

Correlation Matrix




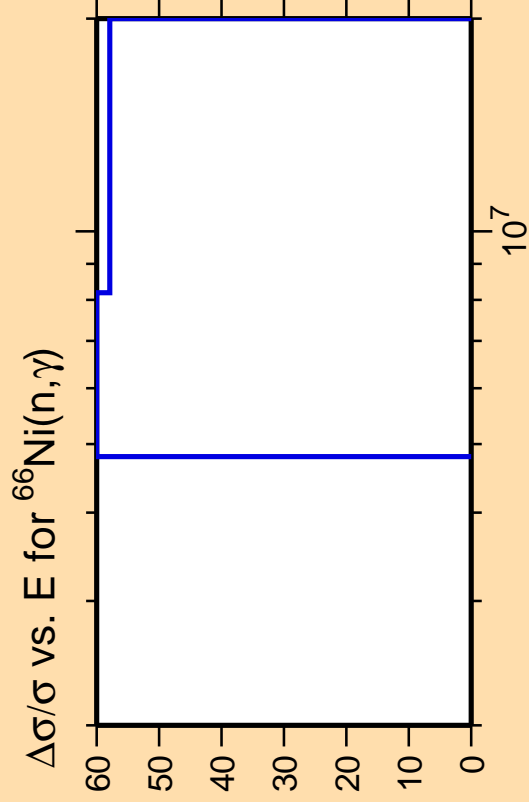


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

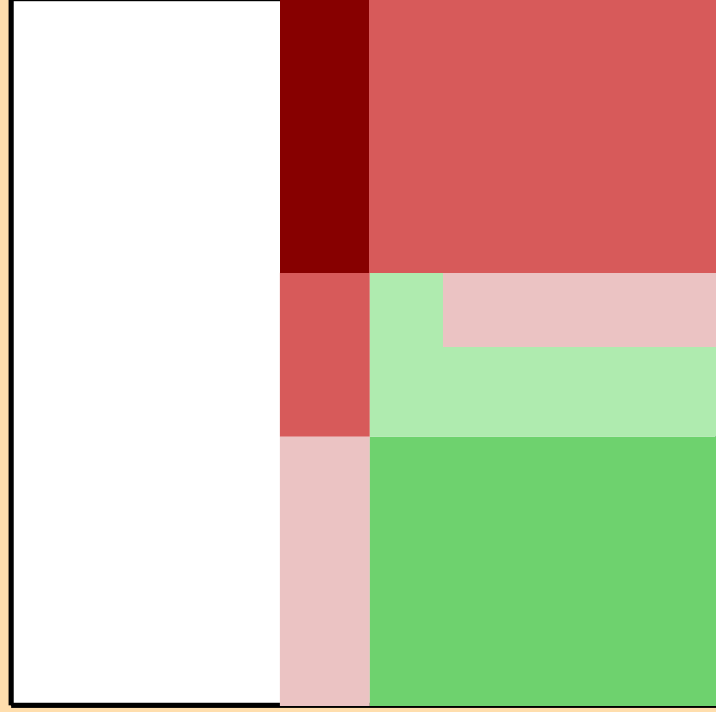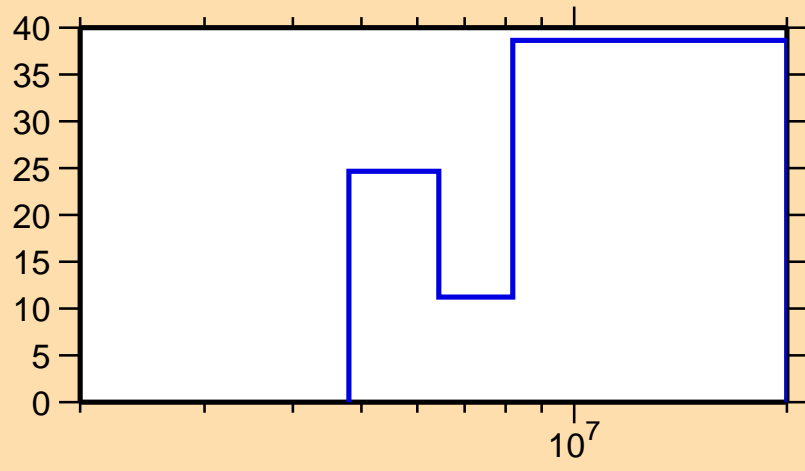

Correlation Matrix





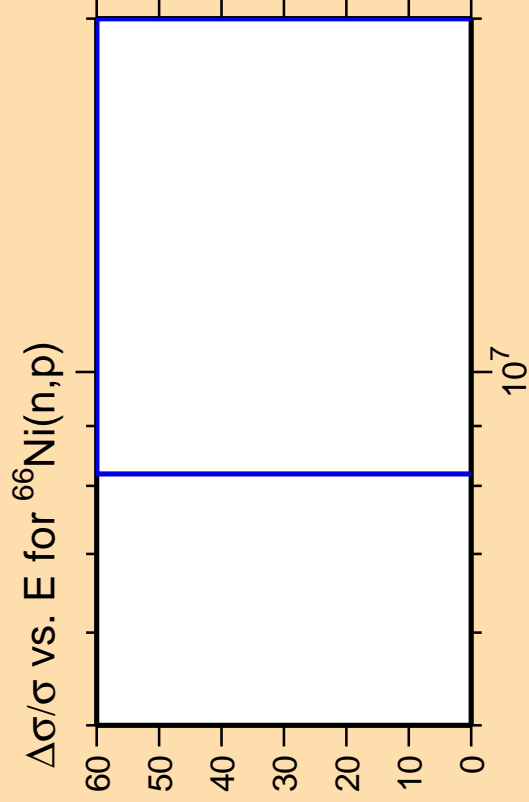

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

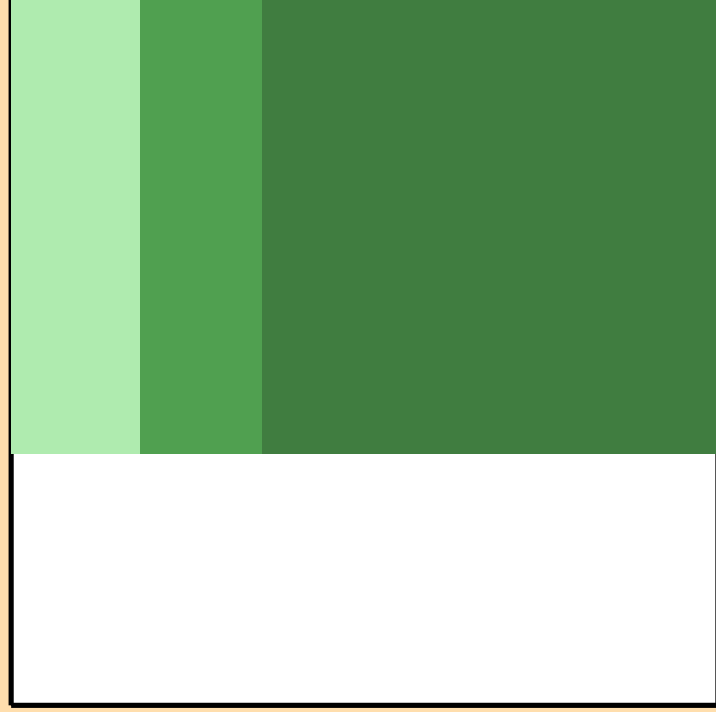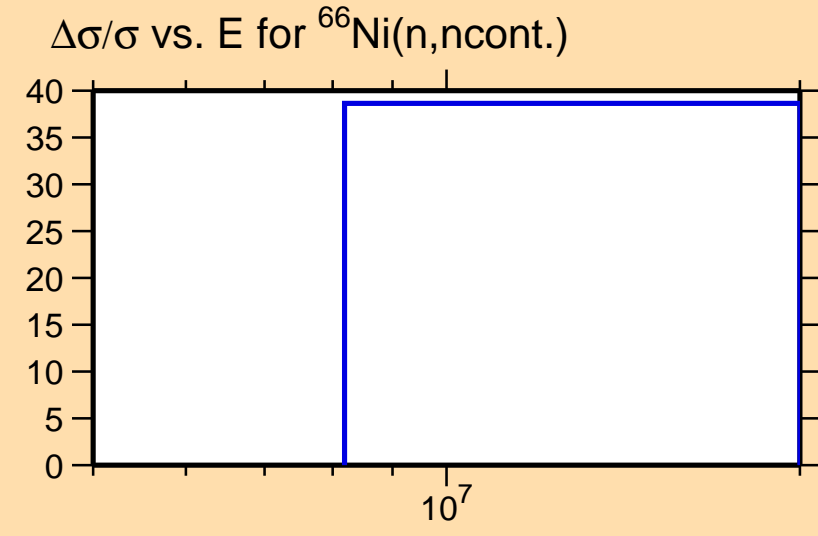

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


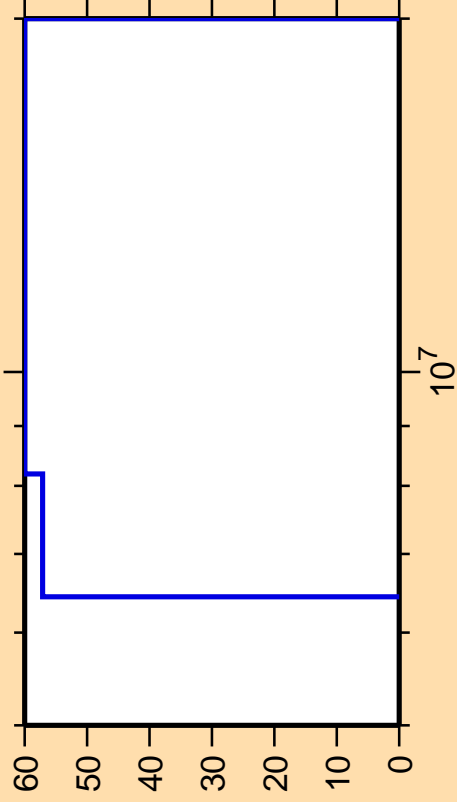


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,n\text{cont.})$

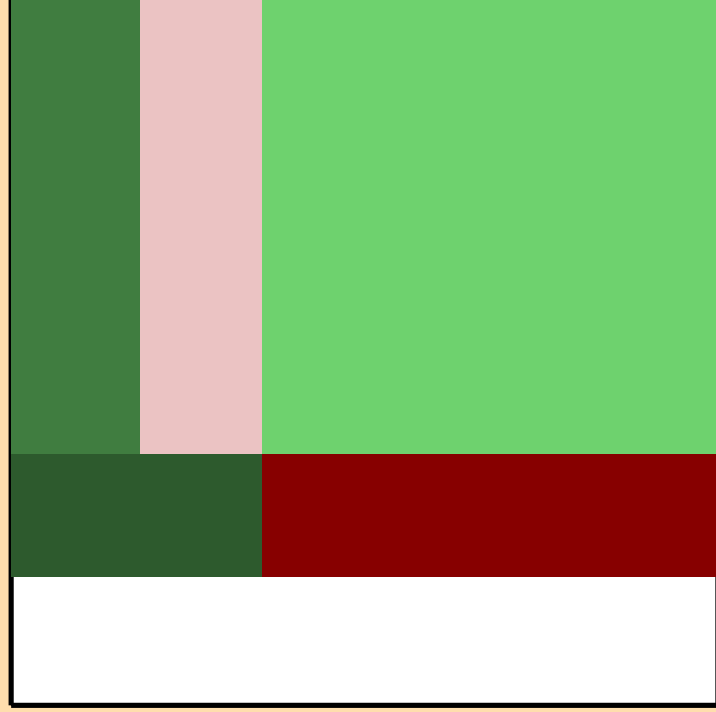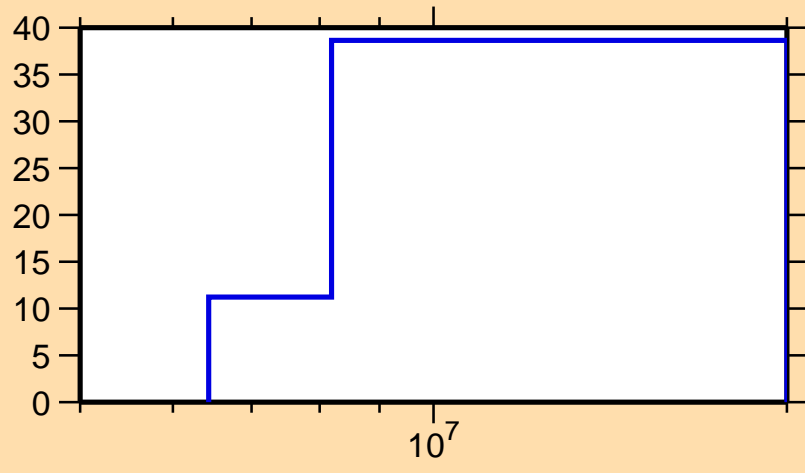



Correlation Matrix



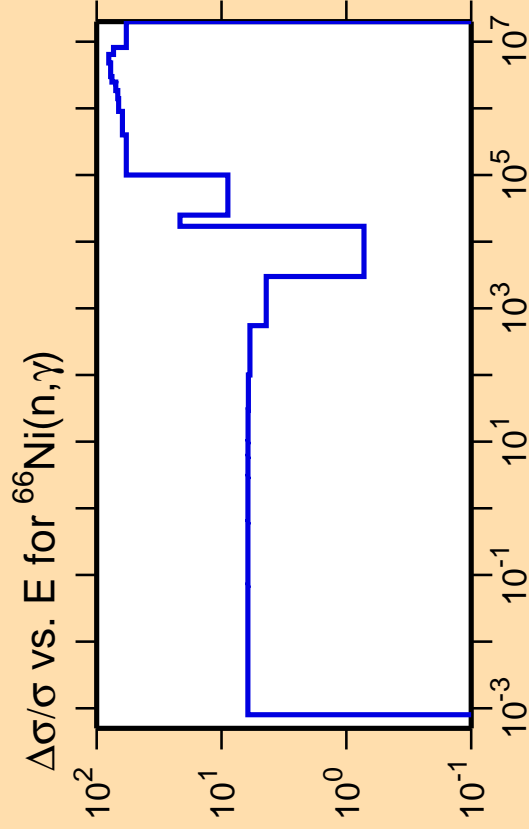

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

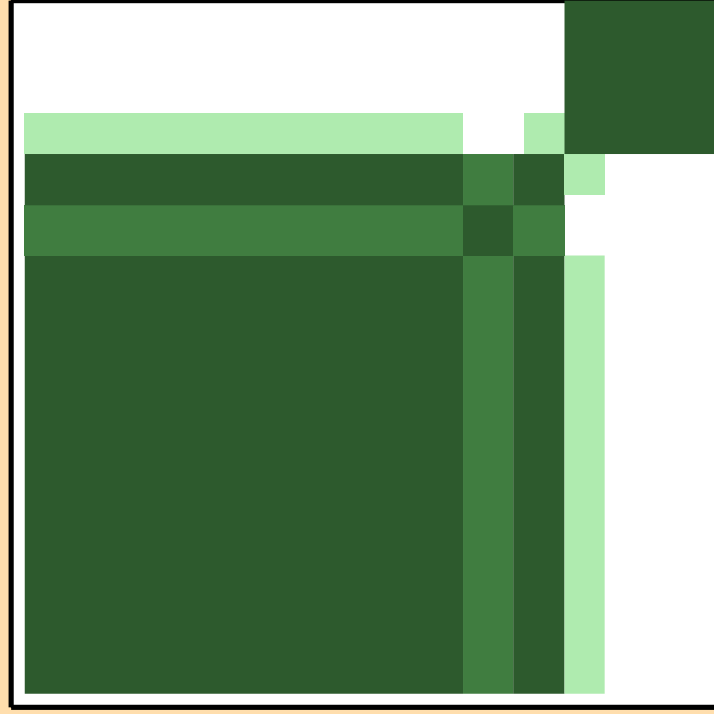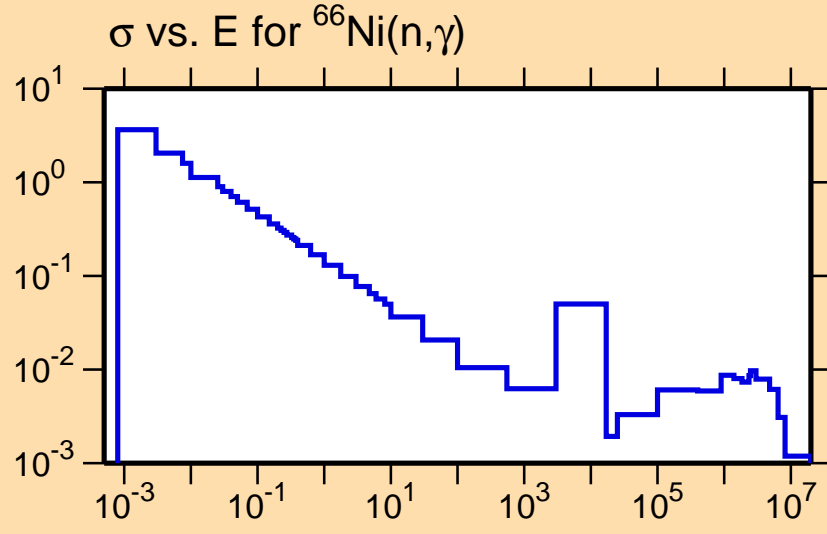

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$


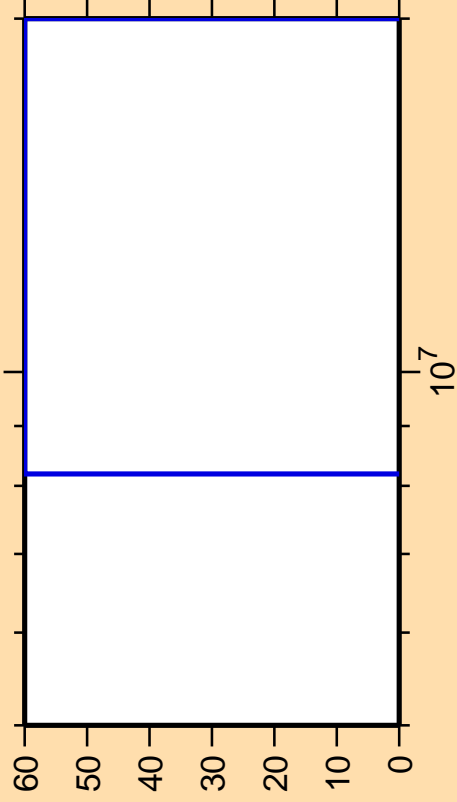


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\gamma)$

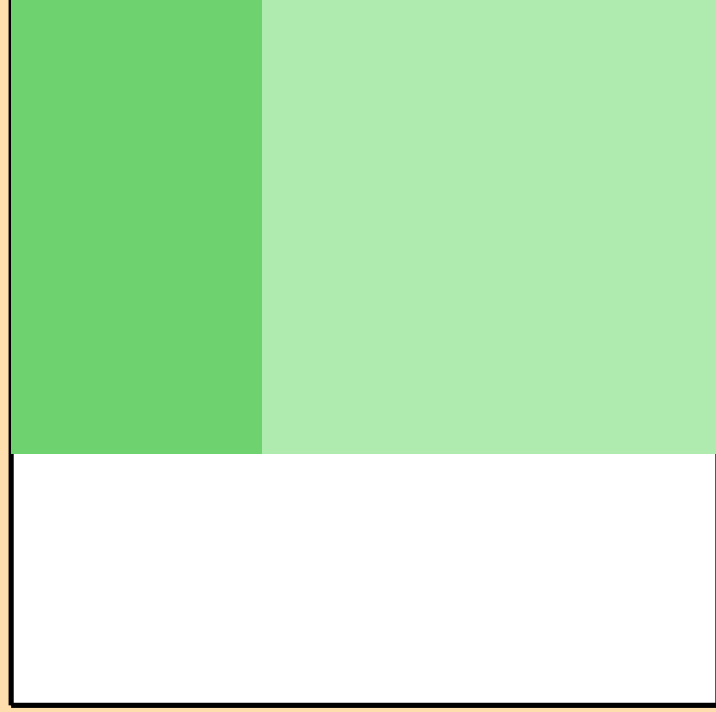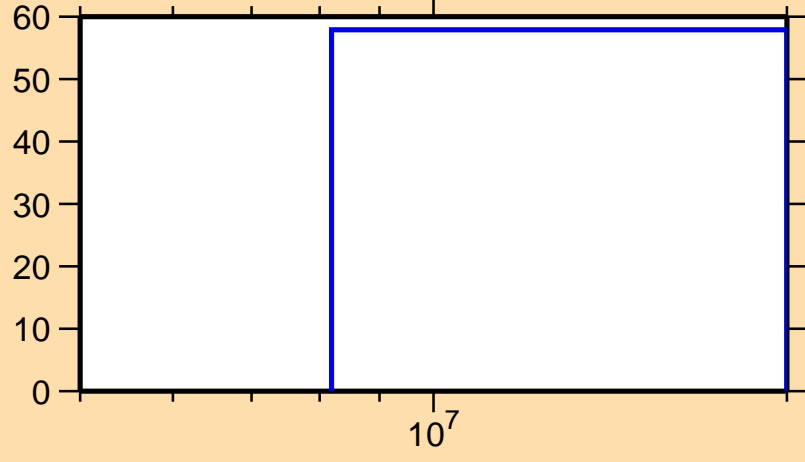

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


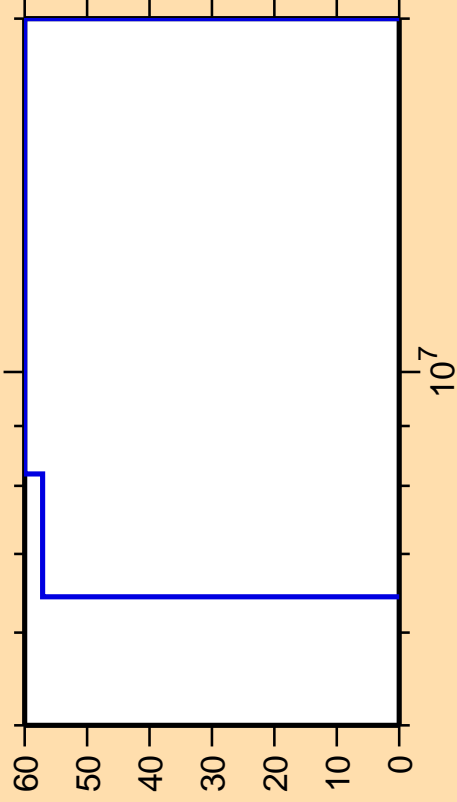


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\gamma)$

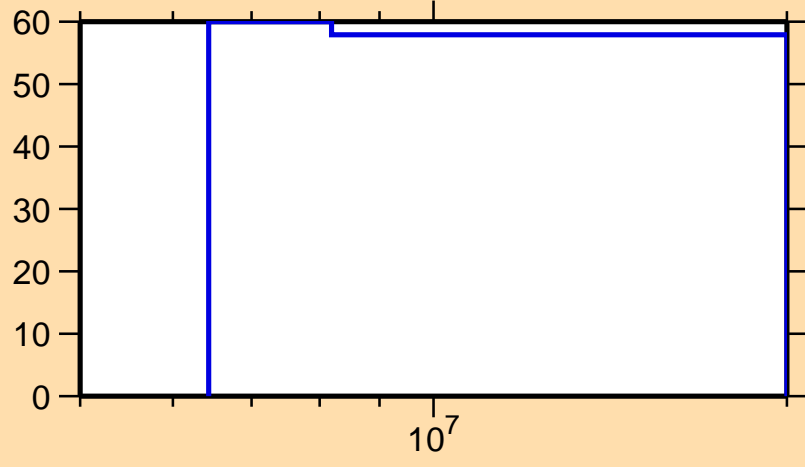

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$

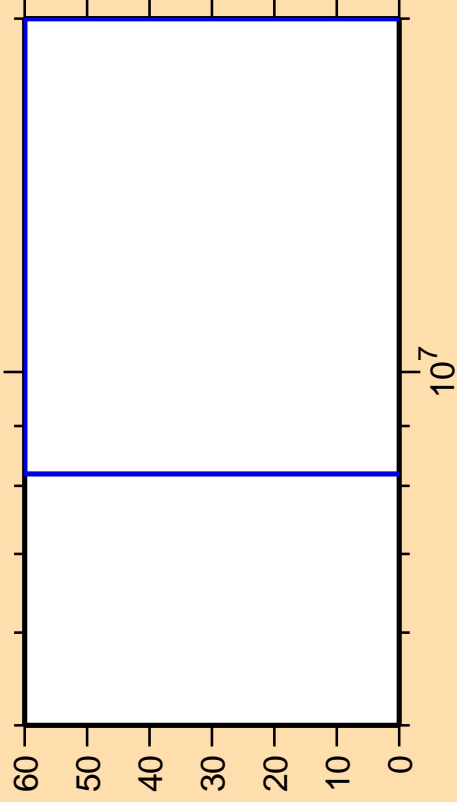


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{66}\text{Ni}(n,p)$

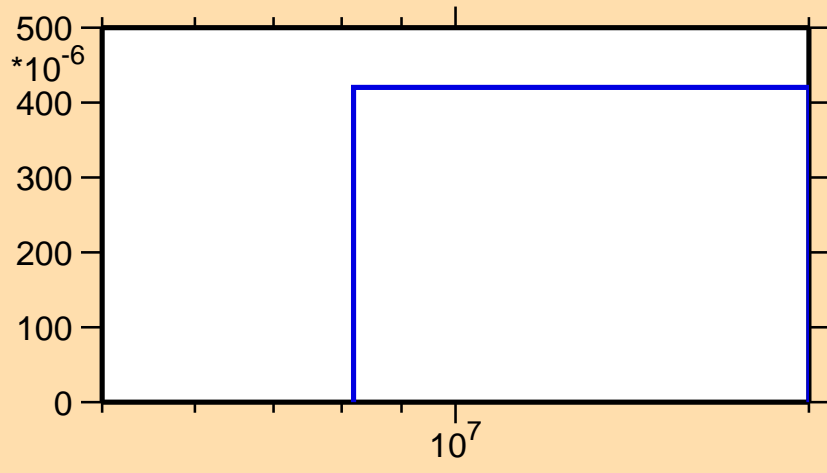


500
* 10^{-6}
400
300
200
100
0


10^7

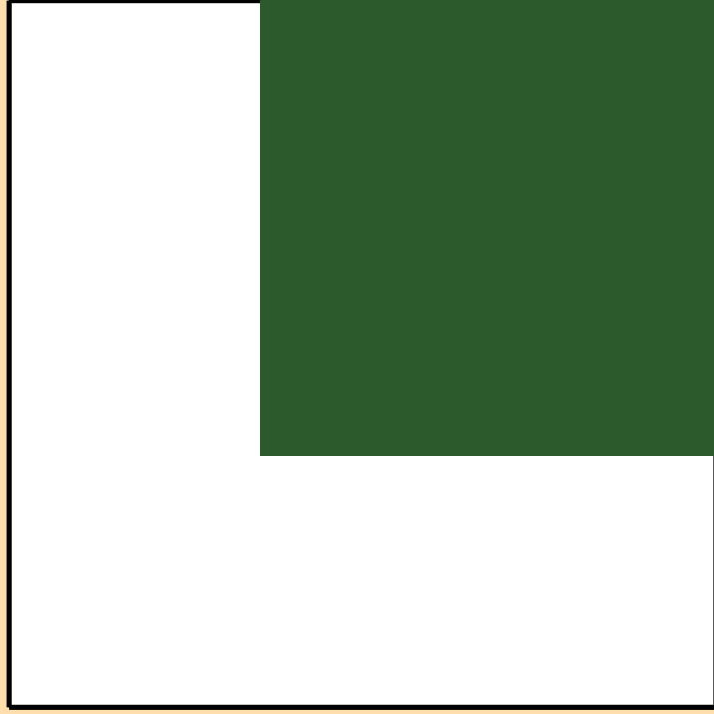

Correlation Matrix

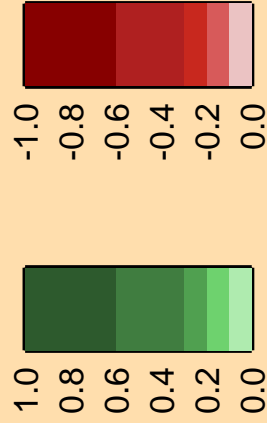

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


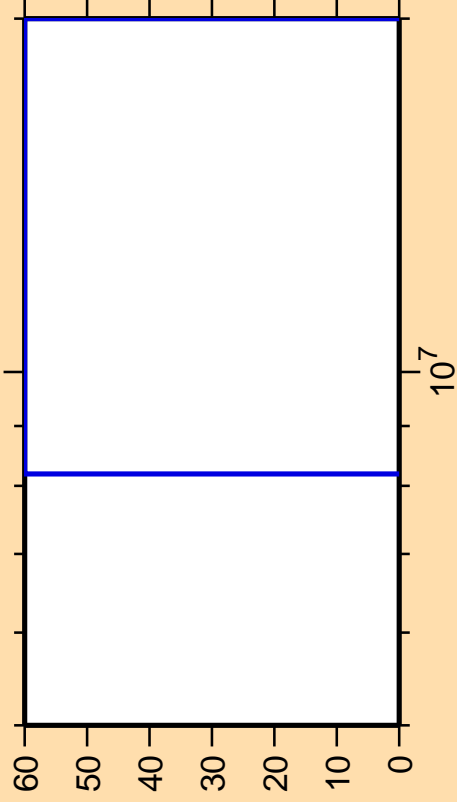


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,p)$

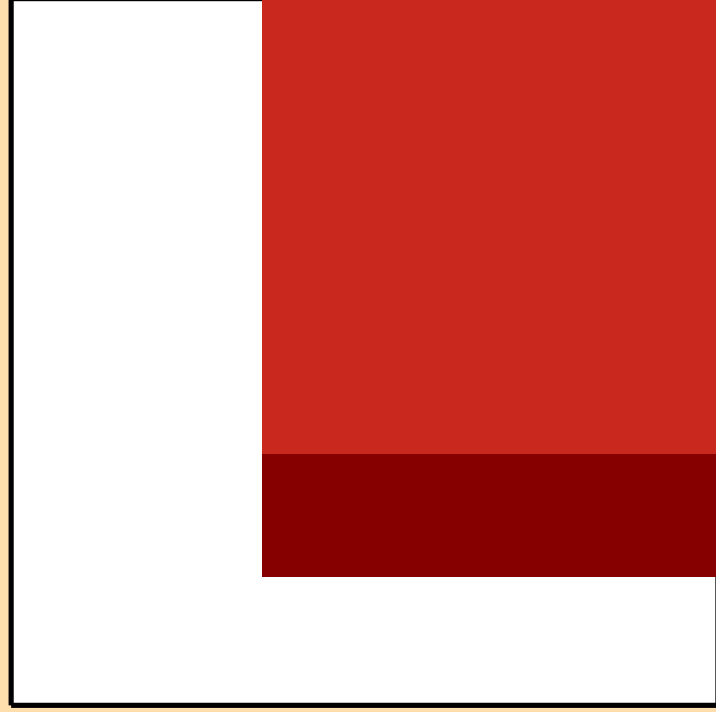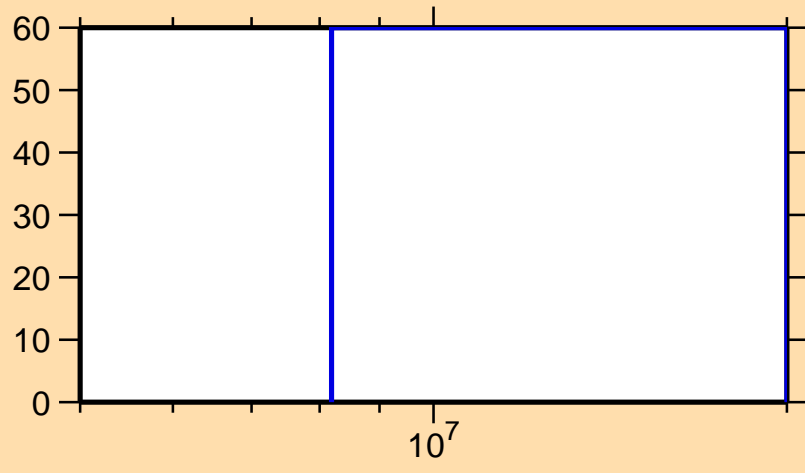

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,d)$

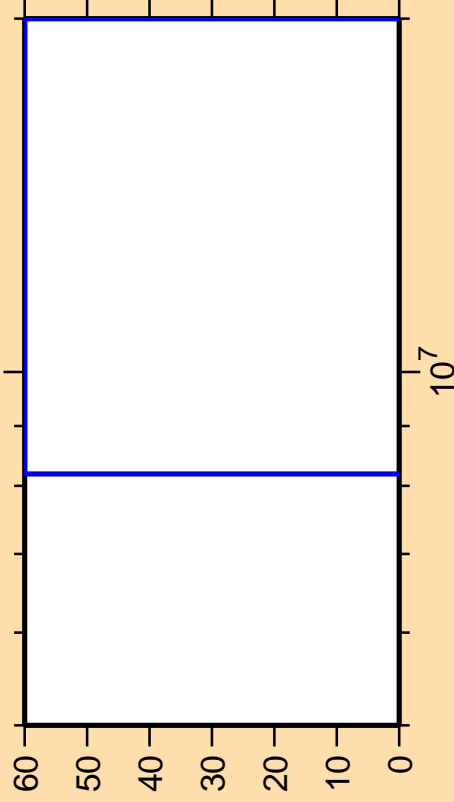


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{66}\text{Ni}(n,d)$

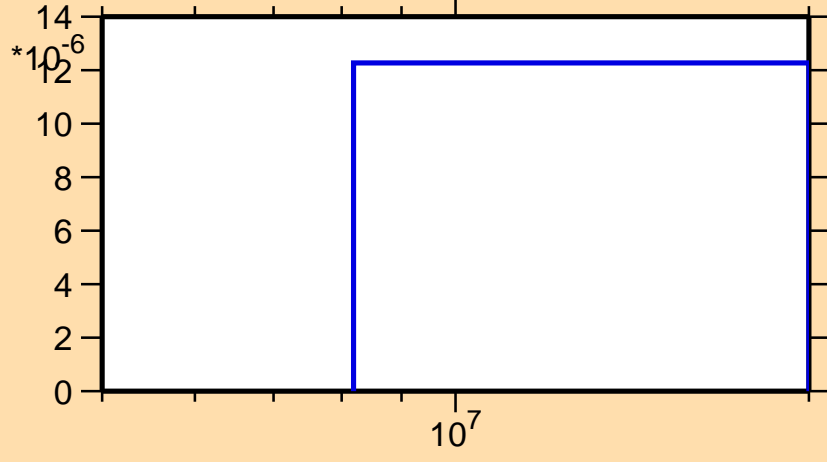

14
12
10
8
6
4
2
0

10^7

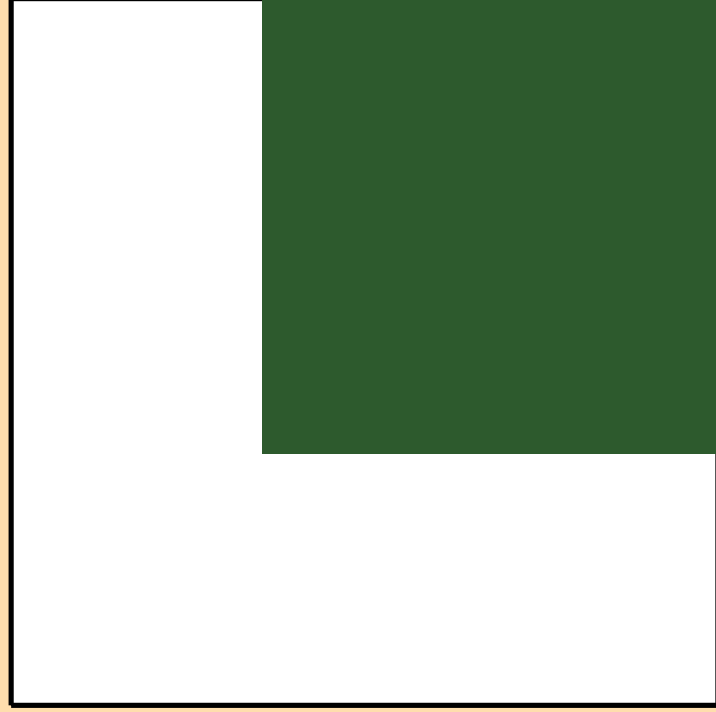


Correlation Matrix



1.0
0.8
0.6
0.4
0.2
0.0

-1.0
-0.8
-0.6
-0.4
-0.2
0.0

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,t)$


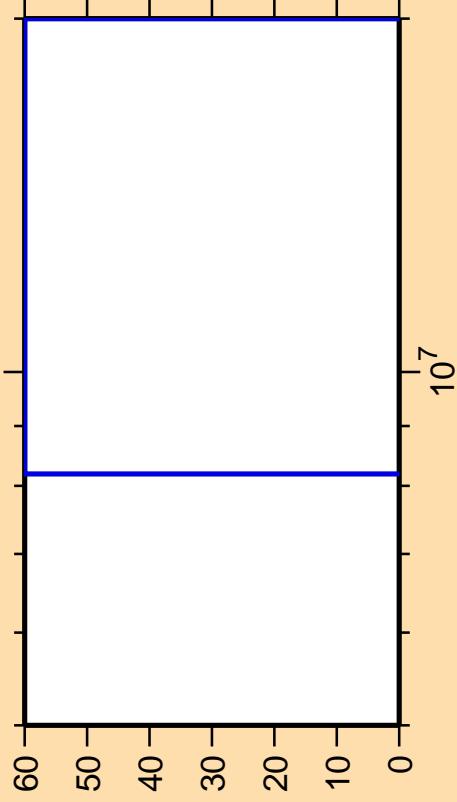


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{66}\text{Ni}(n,t)$

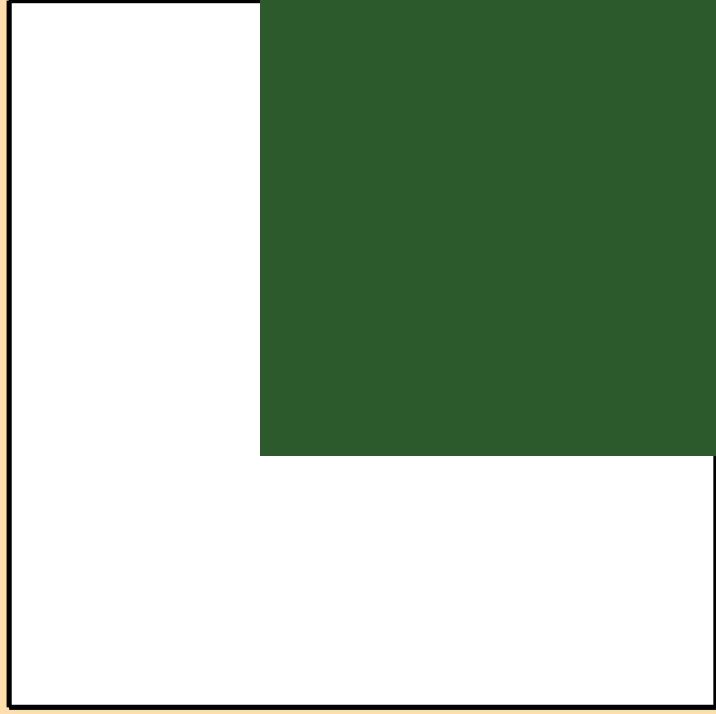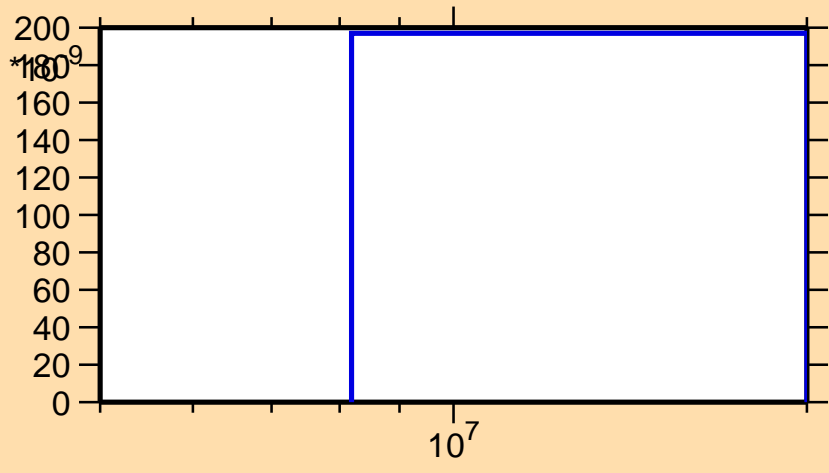

Correlation Matrix

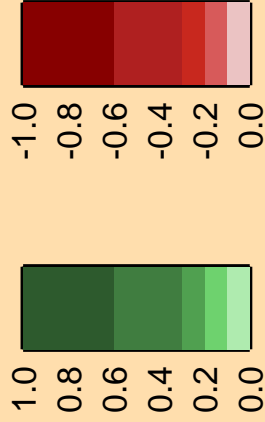

$\Delta\sigma/\sigma$ vs. E for $^{66}\text{Ni}(n,\alpha)$


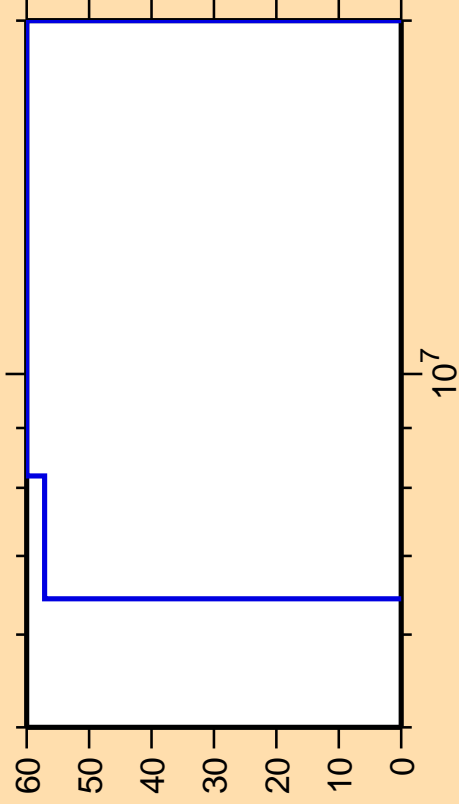


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{66}\text{Ni}(n,\alpha)$

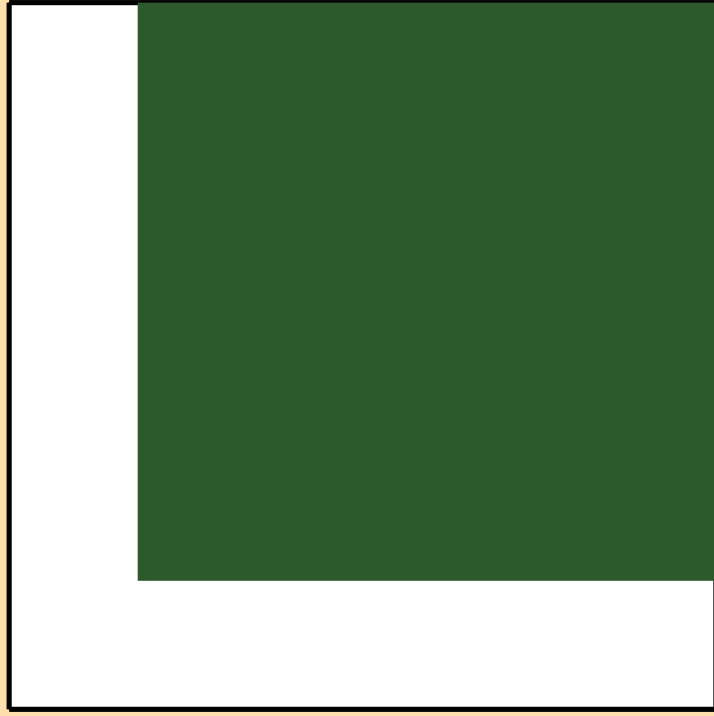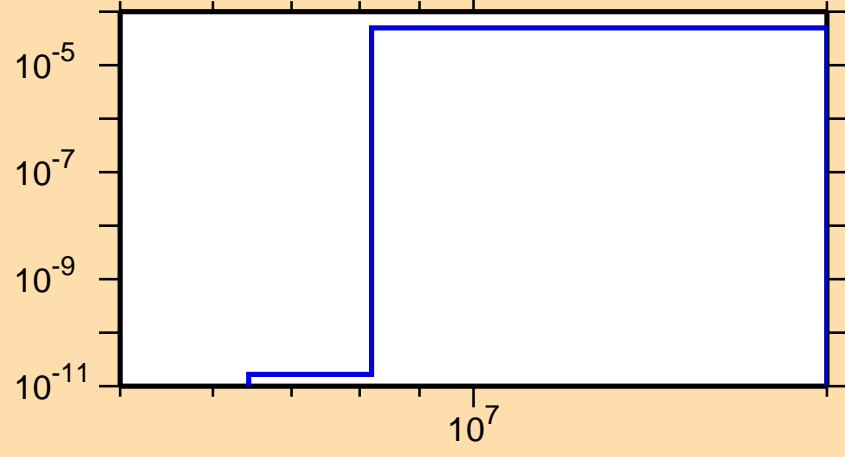

Correlation Matrix

