




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{tot.})$

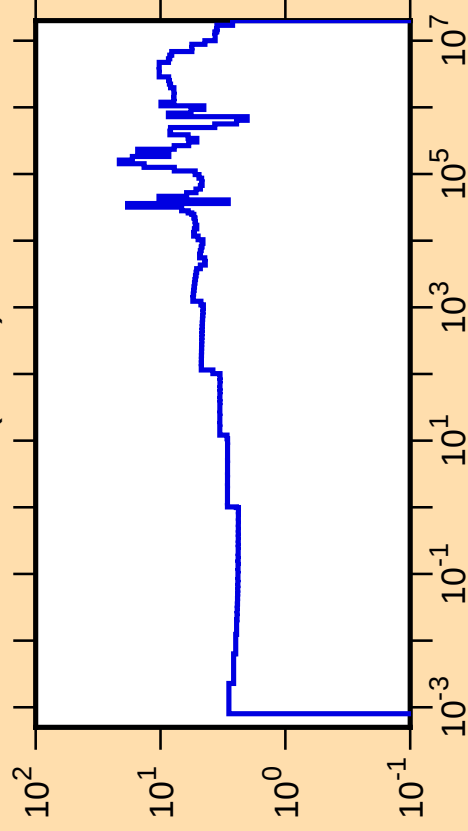

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Si}(n,\text{tot.})$

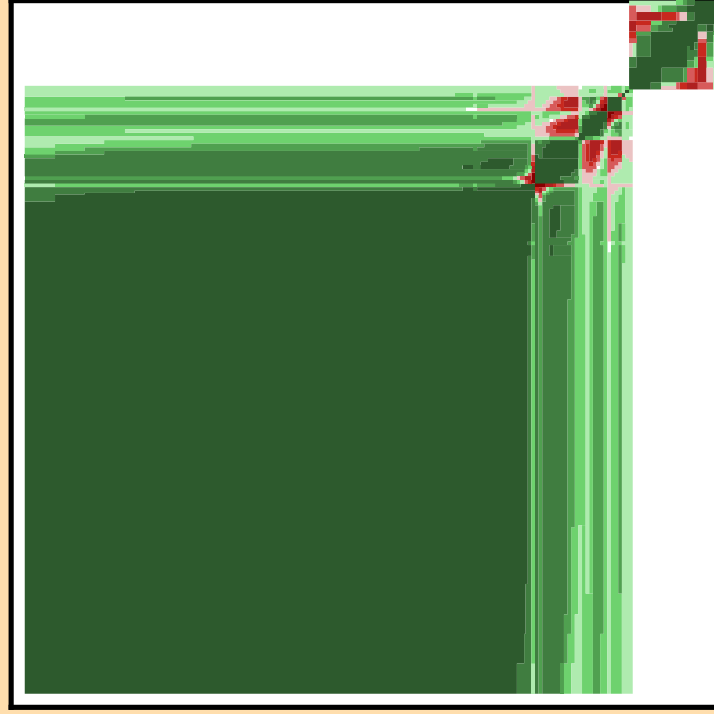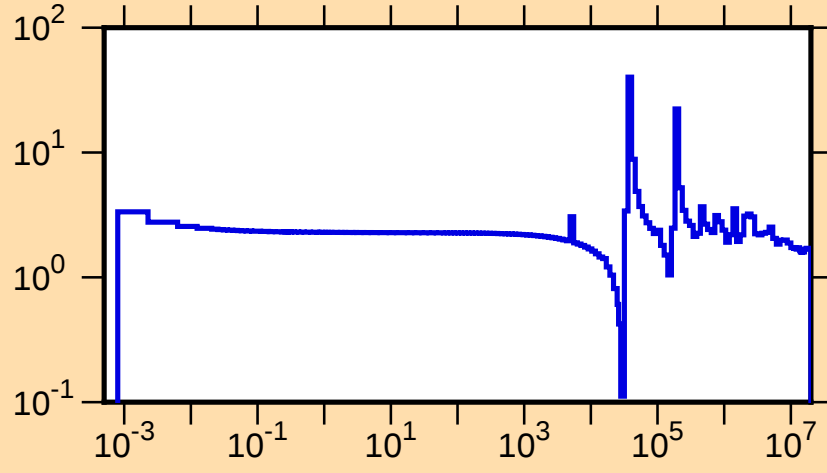


Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{el.})$

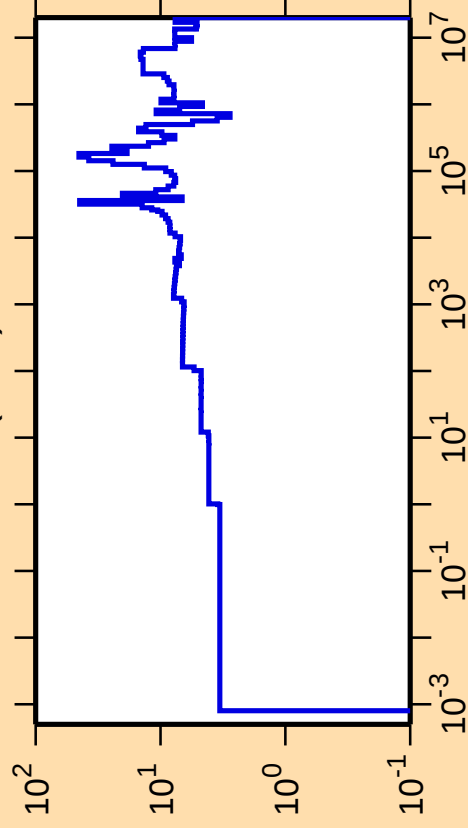


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{tot.})$

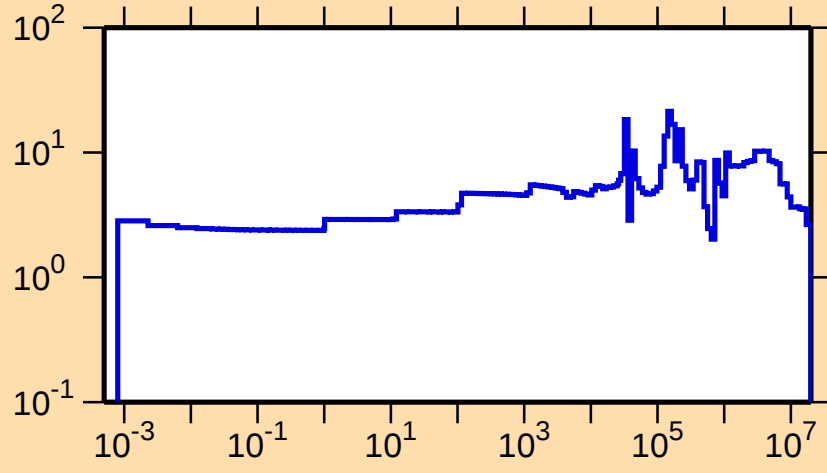


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).



Correlation Matrix




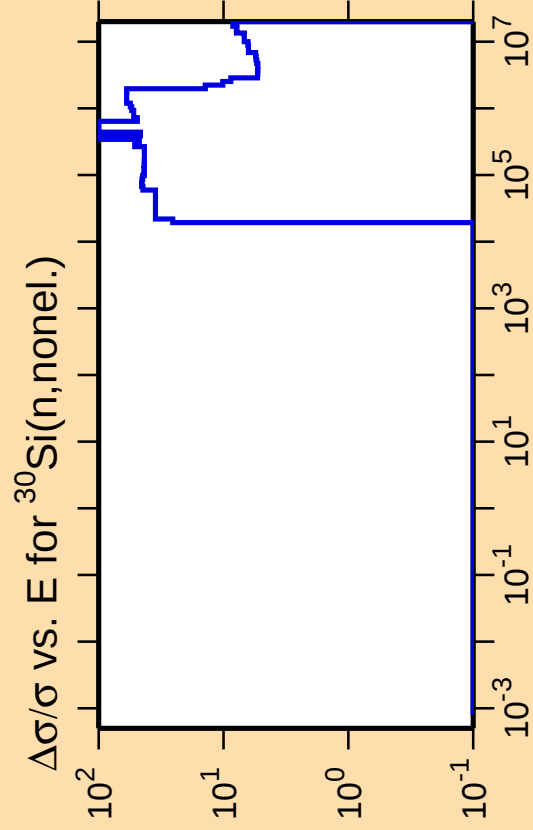


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

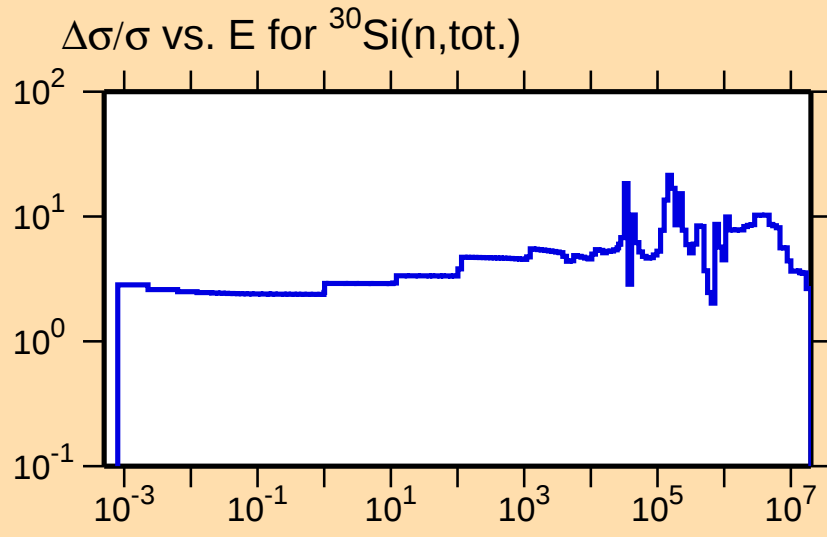



Correlation Matrix

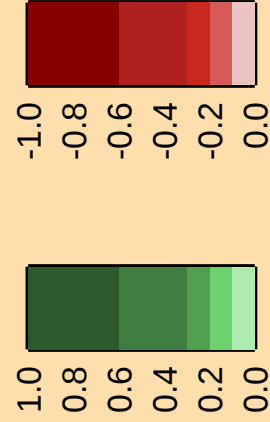

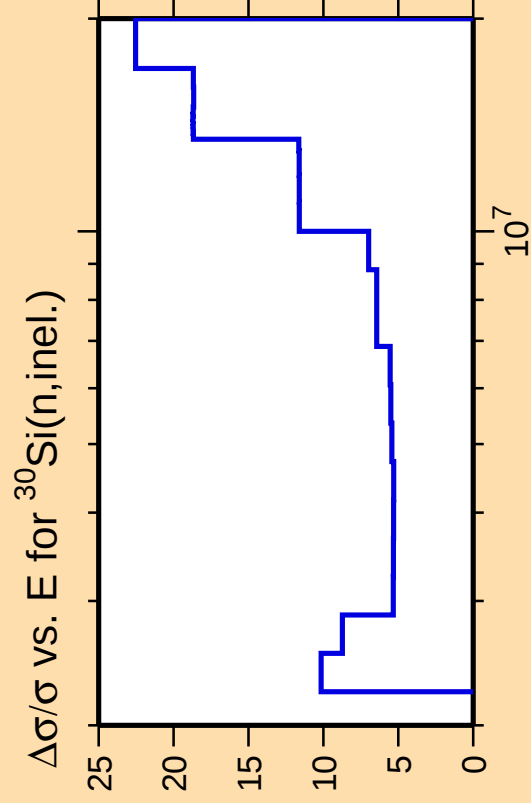

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

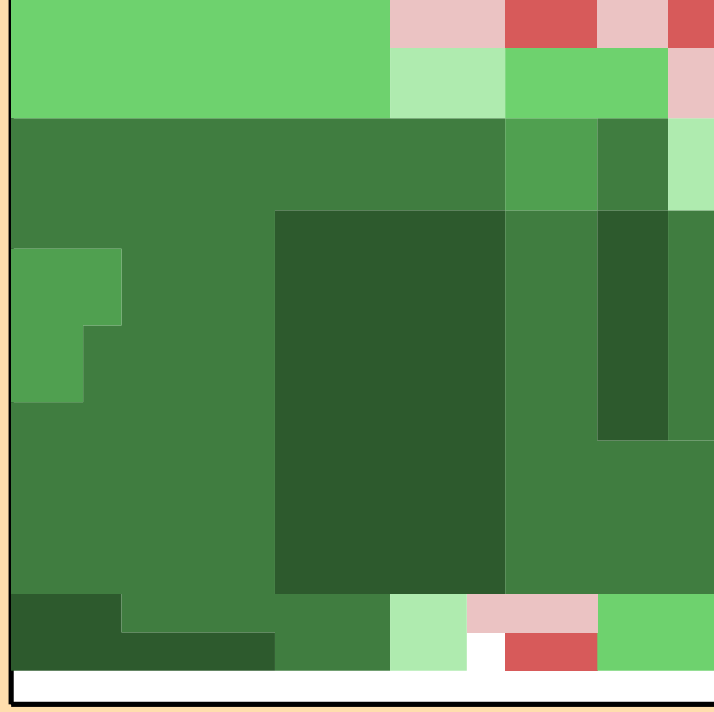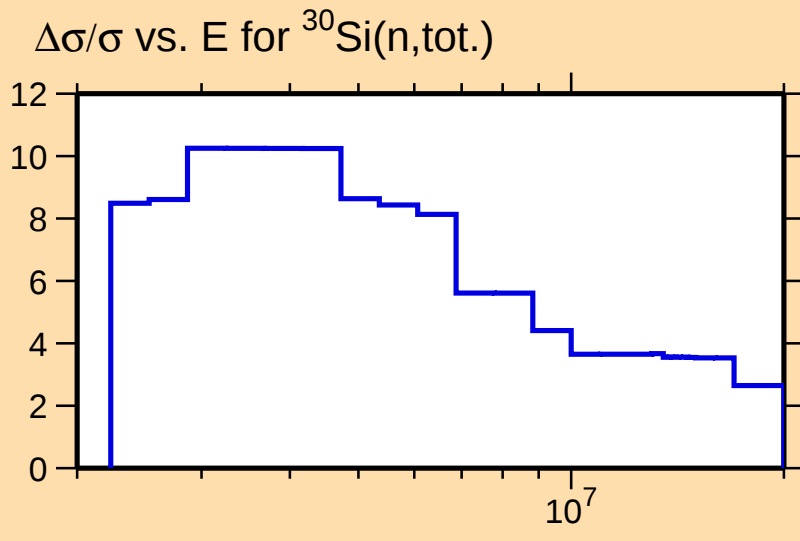

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$


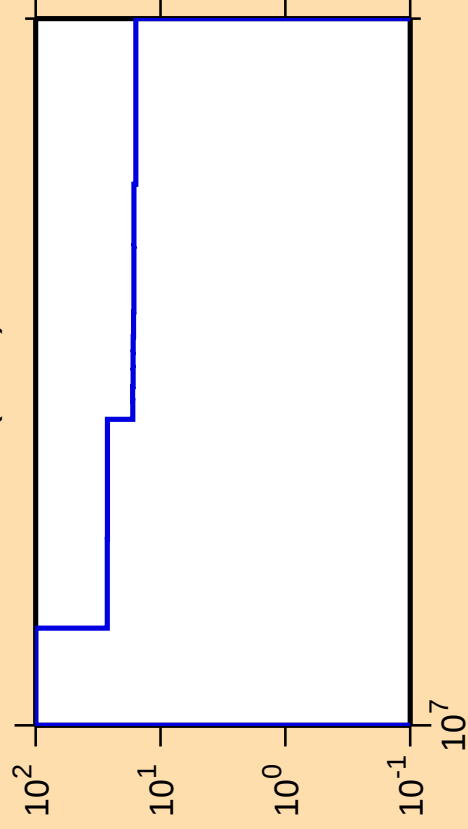


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{tot.})$

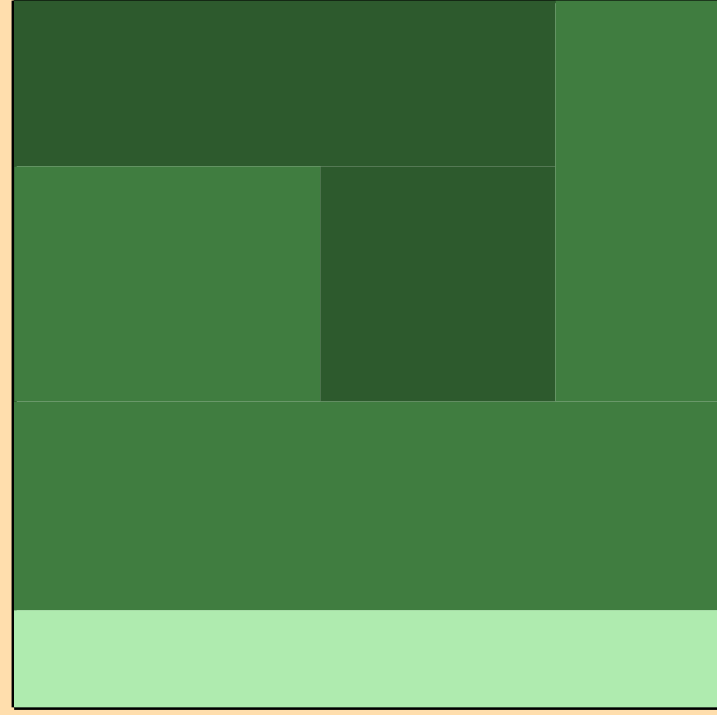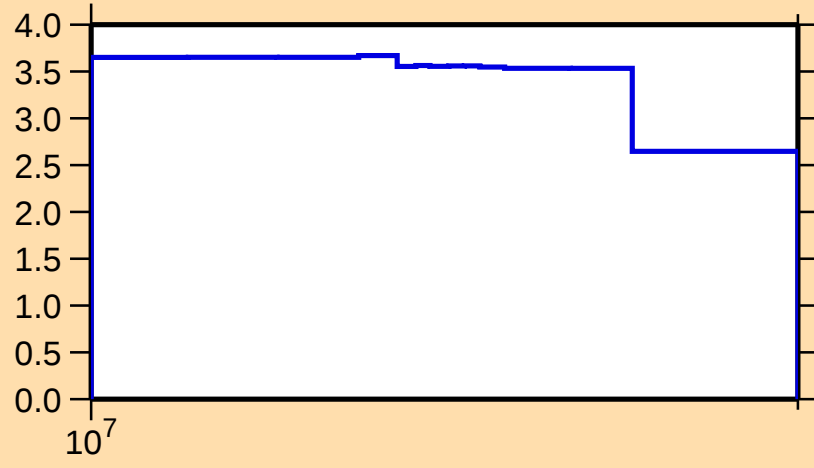



Correlation Matrix



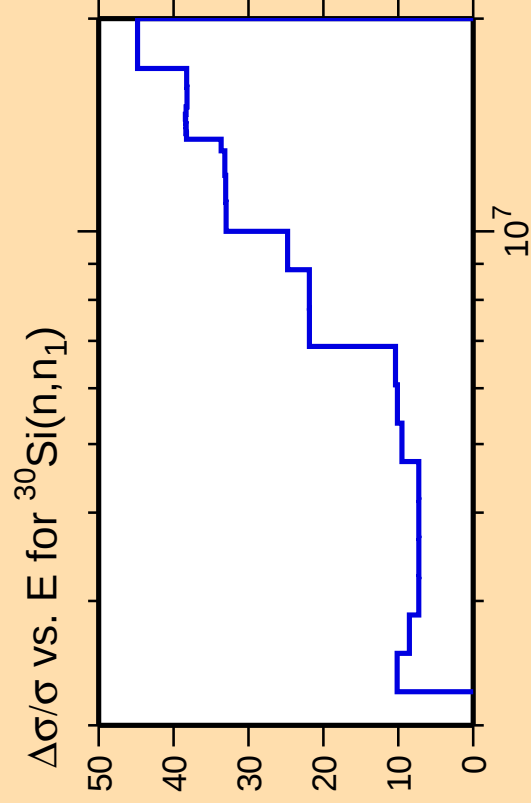

Ordinate scale is %
relative standard deviation.


Abcissa scales are energy (eV).

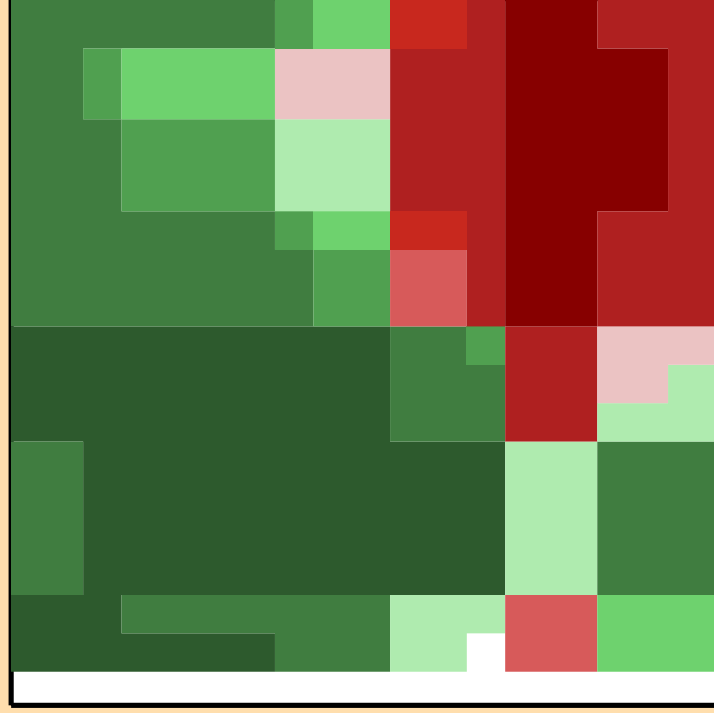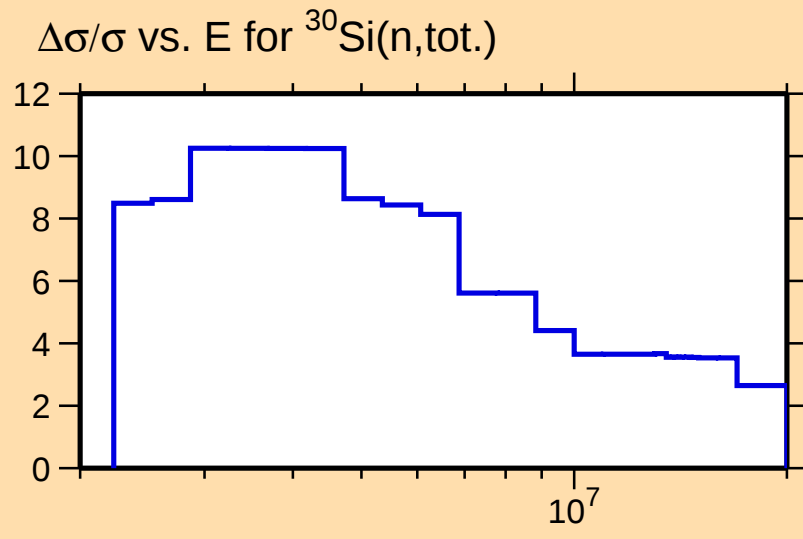

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n\text{cont.})$

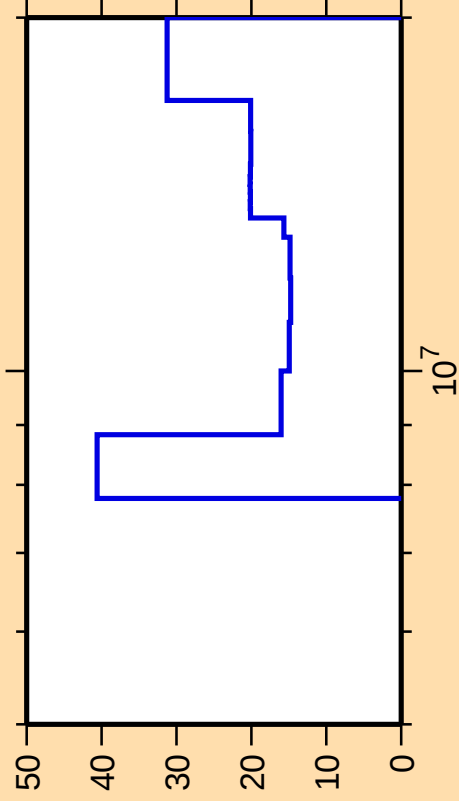

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{tot.})$

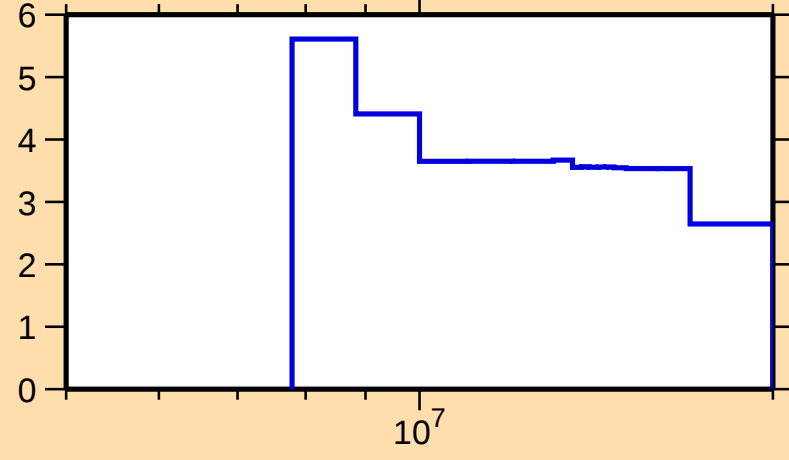

Correlation Matrix




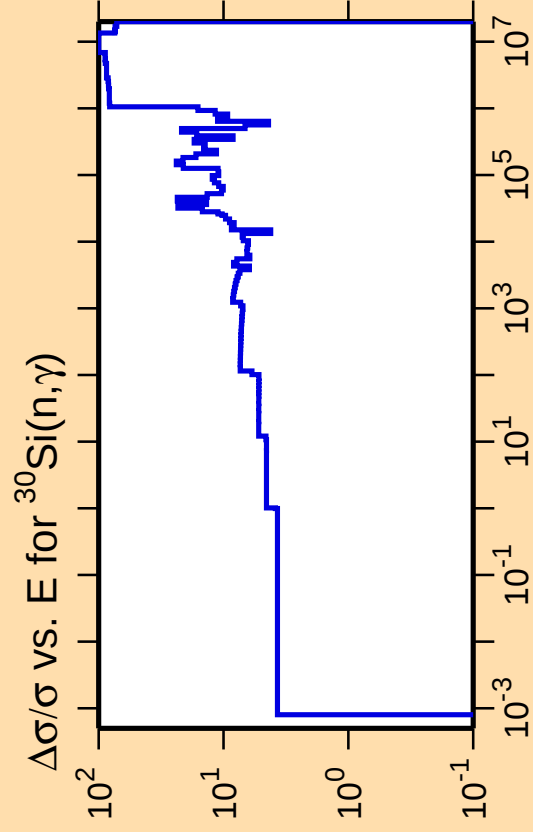


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{tot.})$

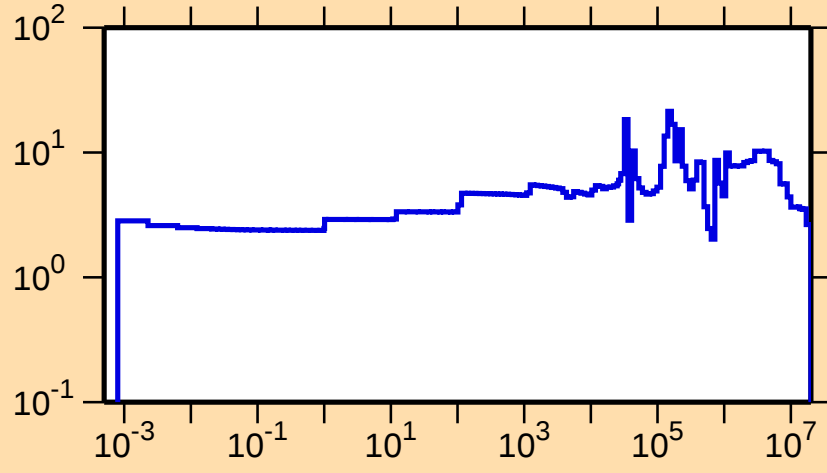

Correlation Matrix




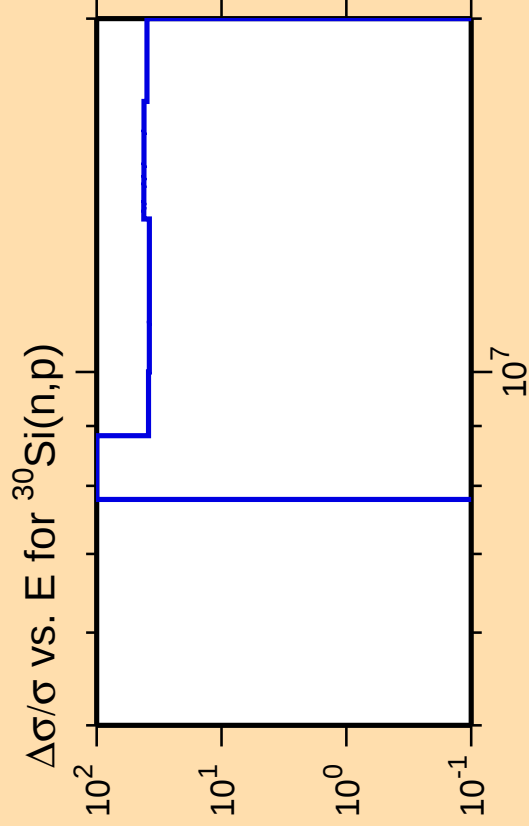


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{tot.})$

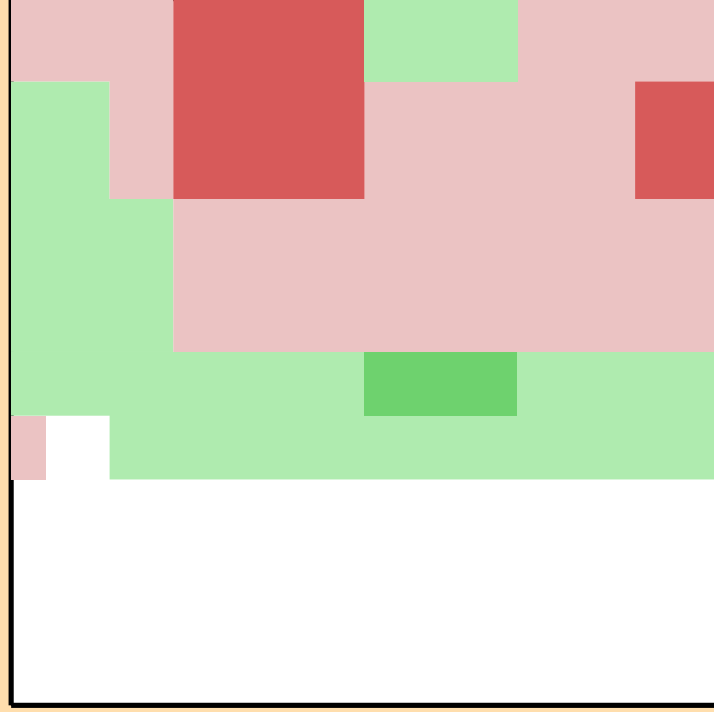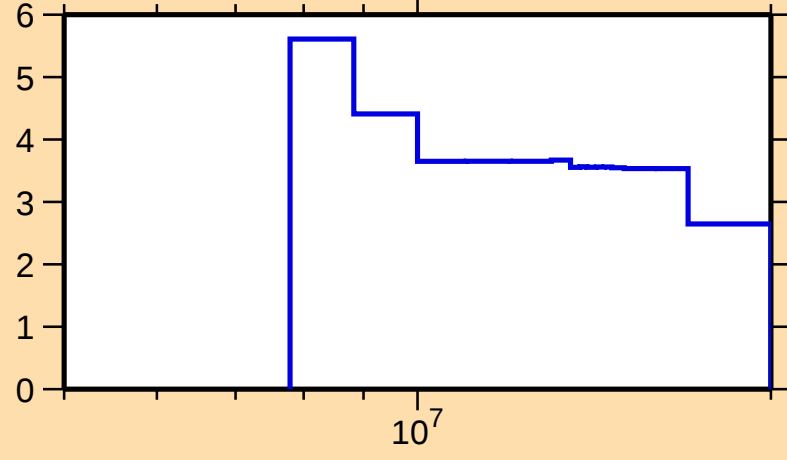

Correlation Matrix




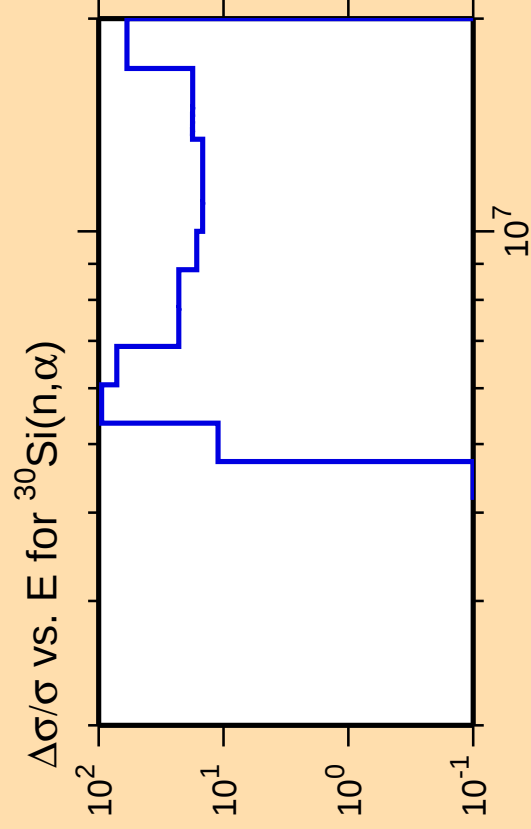

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

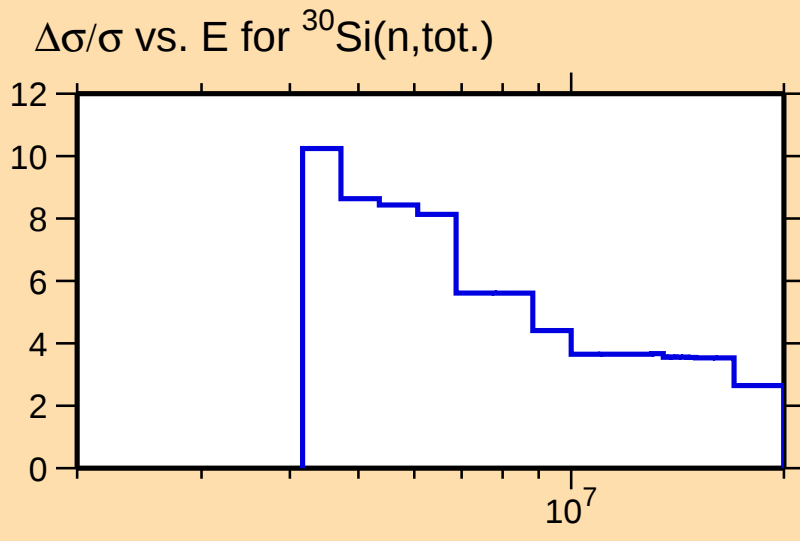

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{el.})$

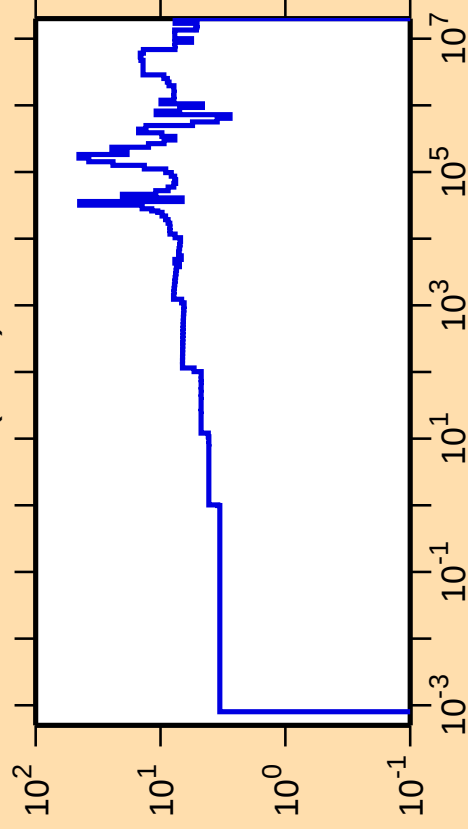

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Si}(n,\text{el.})$

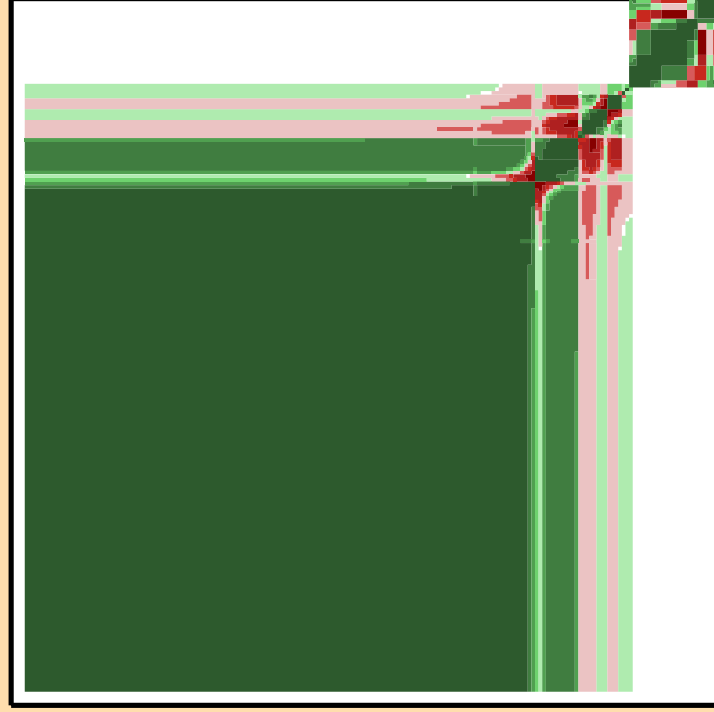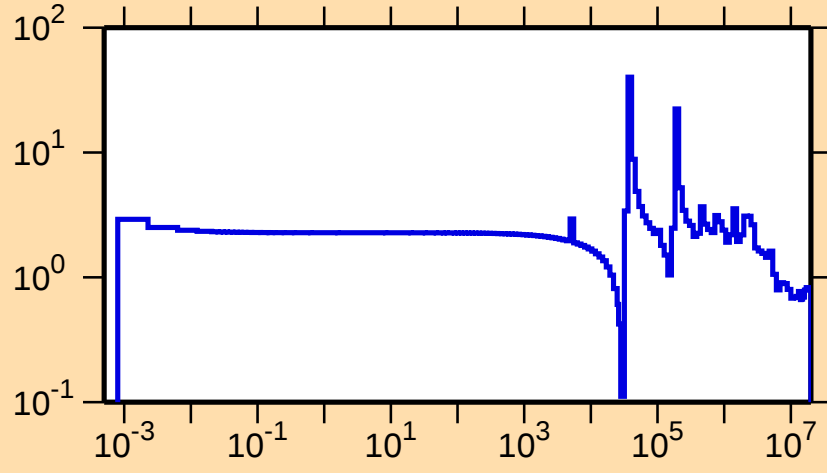


Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{nonel.})$

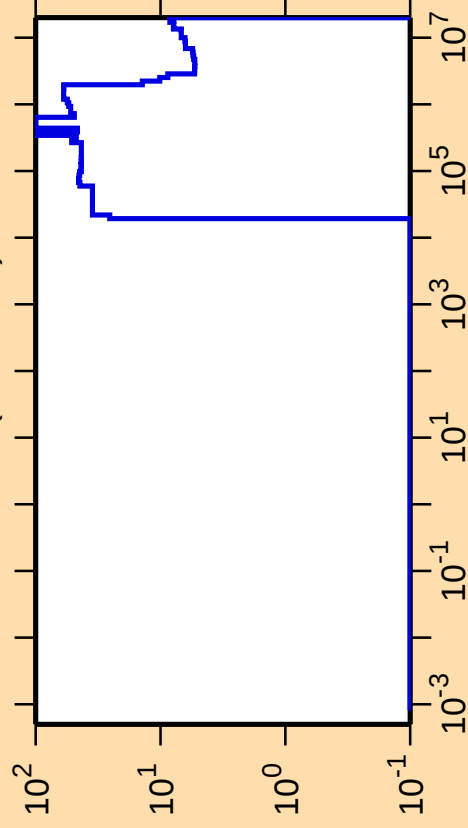


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{el.})$

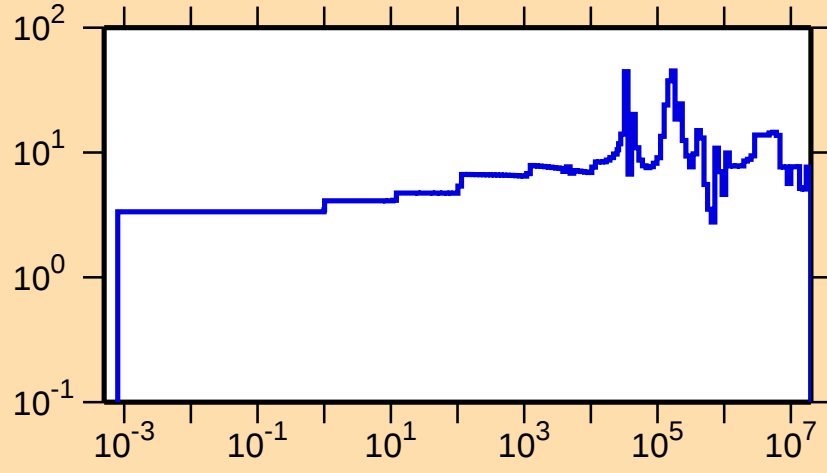


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.





Correlation Matrix

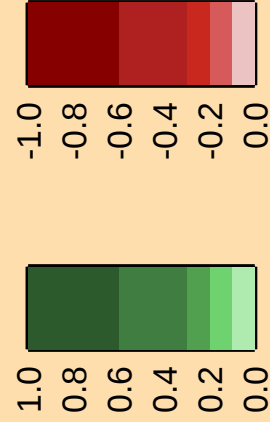

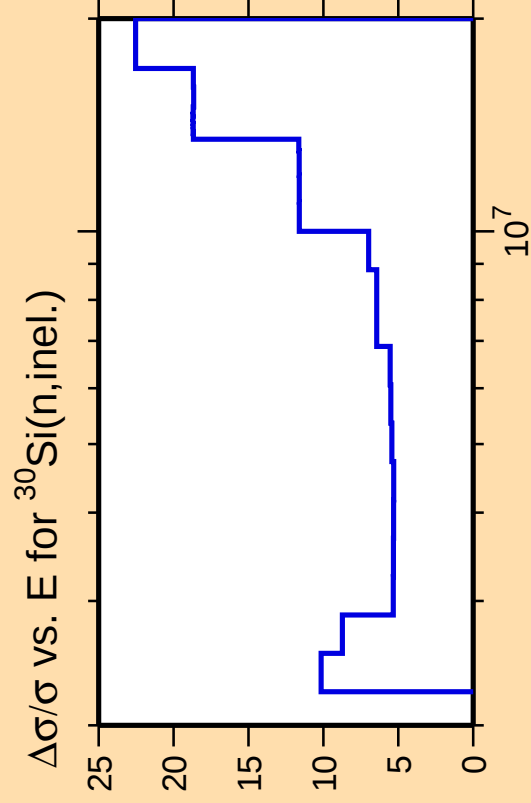

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

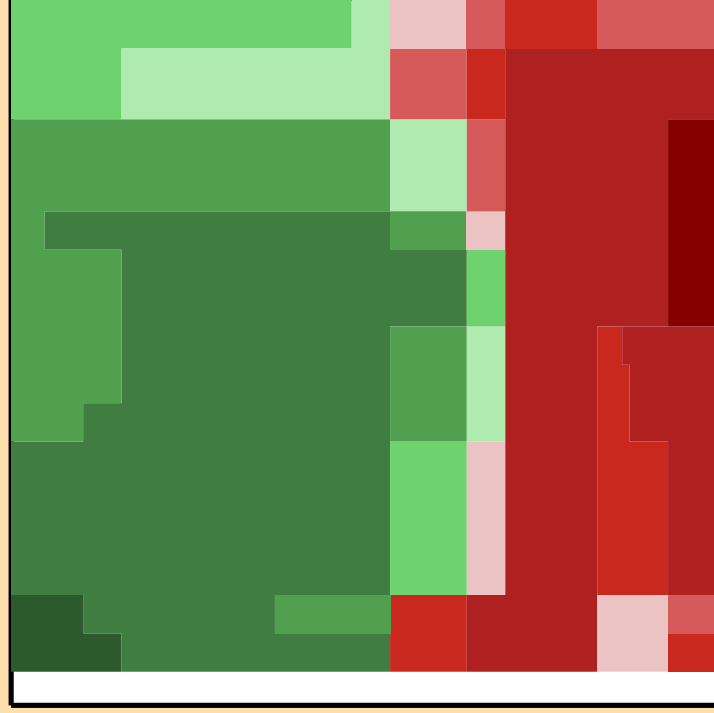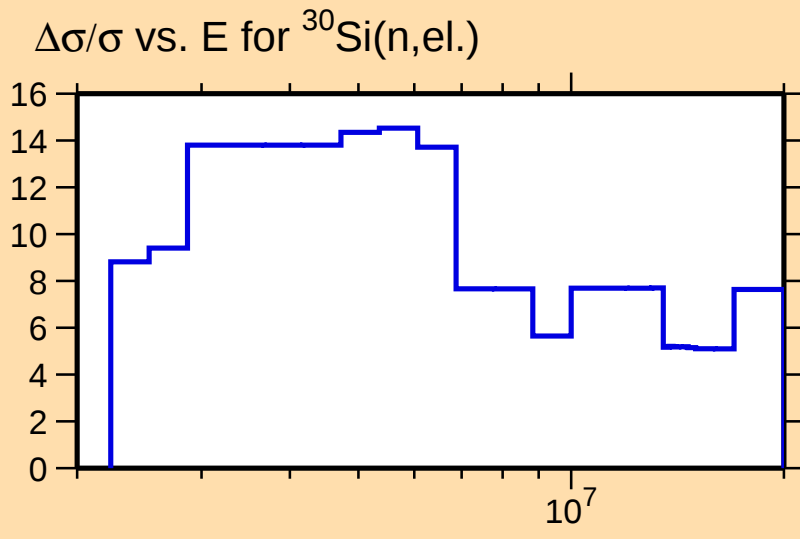

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$


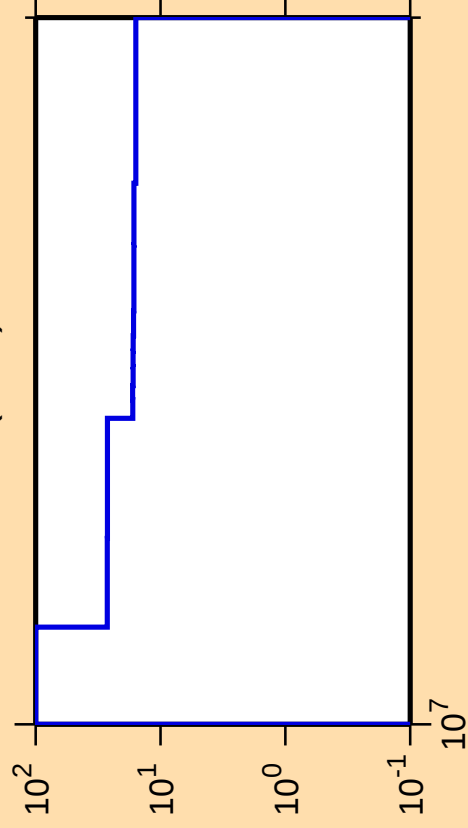


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).




Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{el.})$

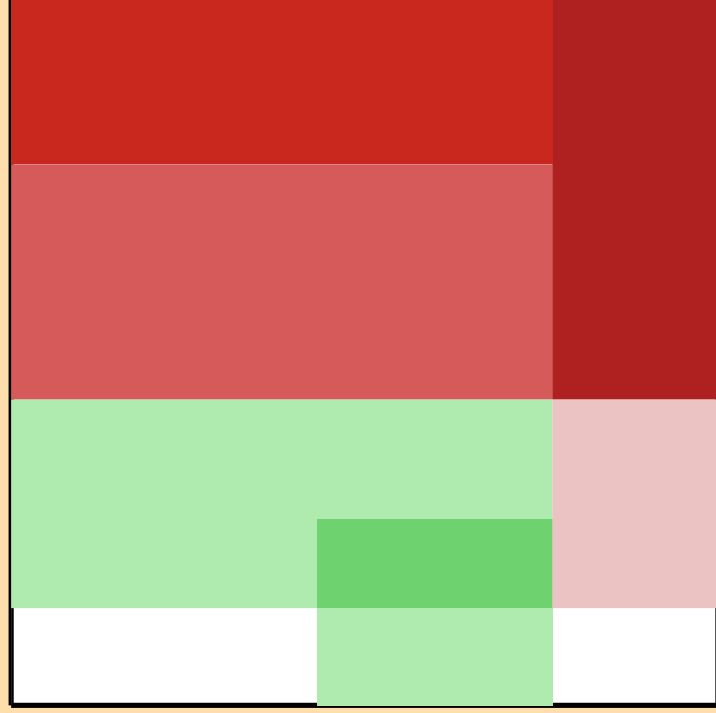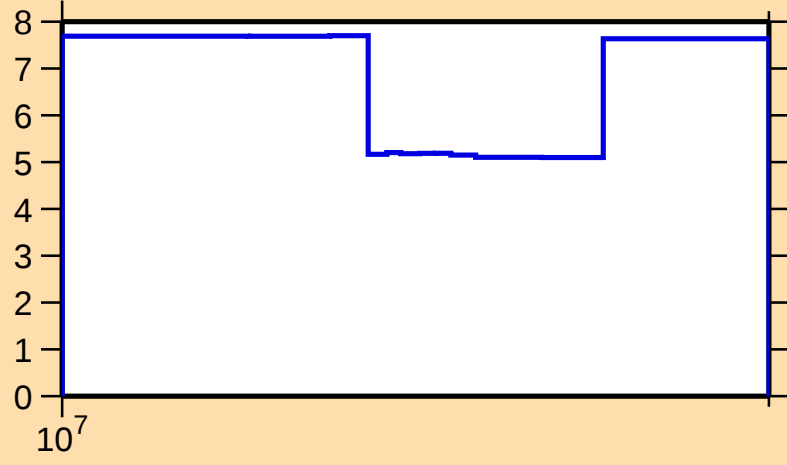


Correlation Matrix




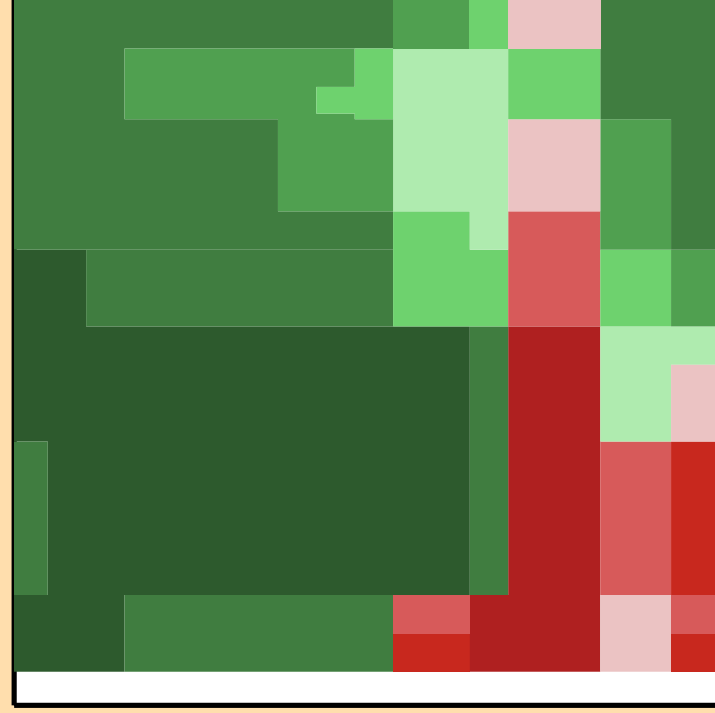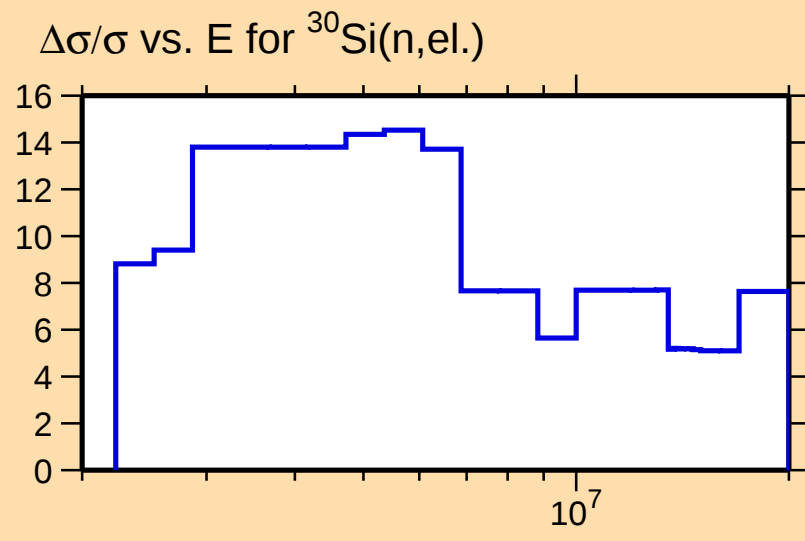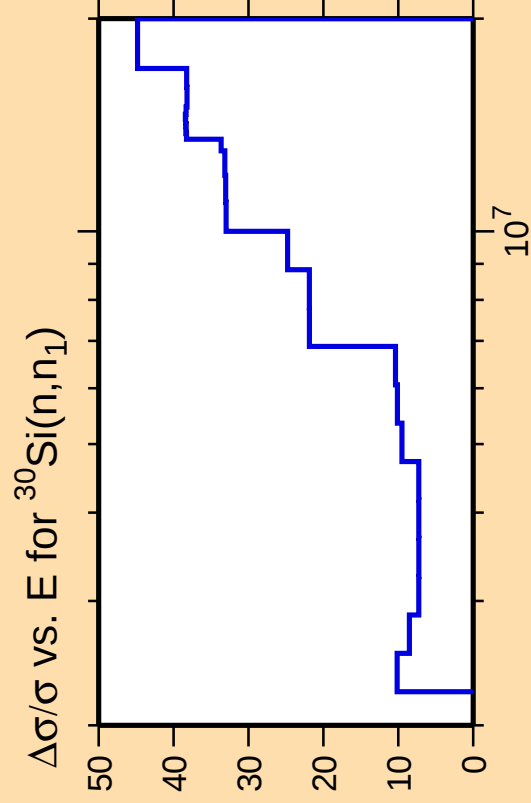

Correlation Matrix

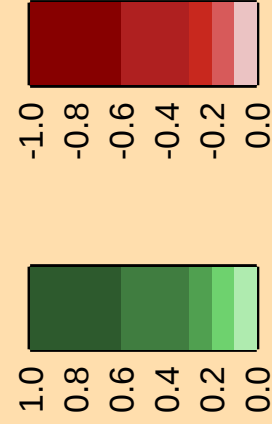



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n\text{cont.})$

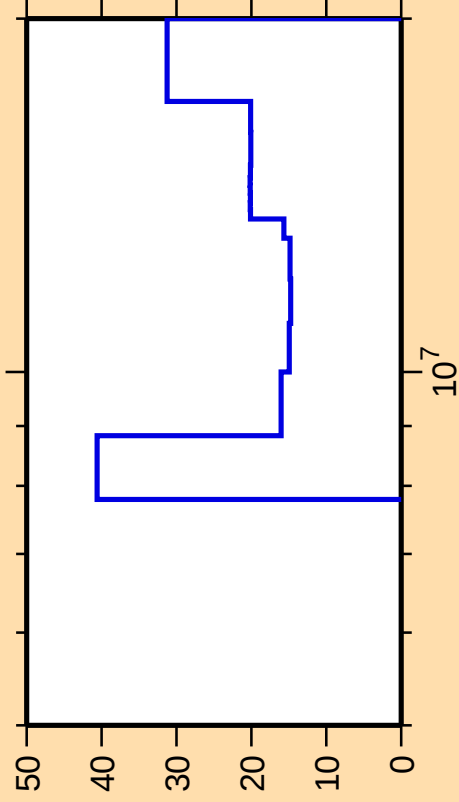

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{el.})$

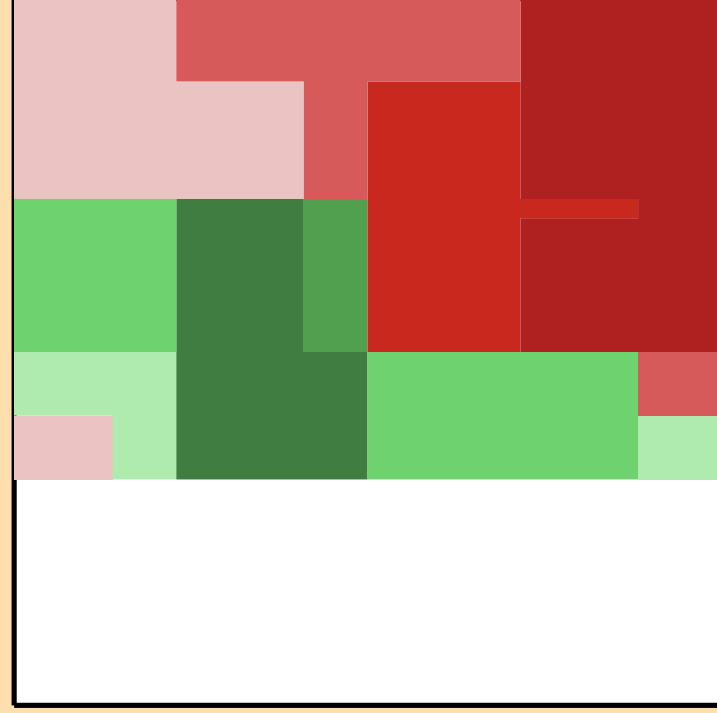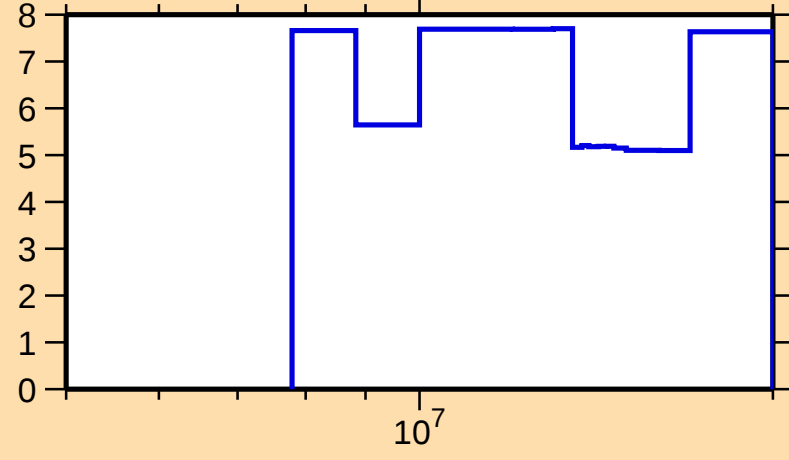

Correlation Matrix




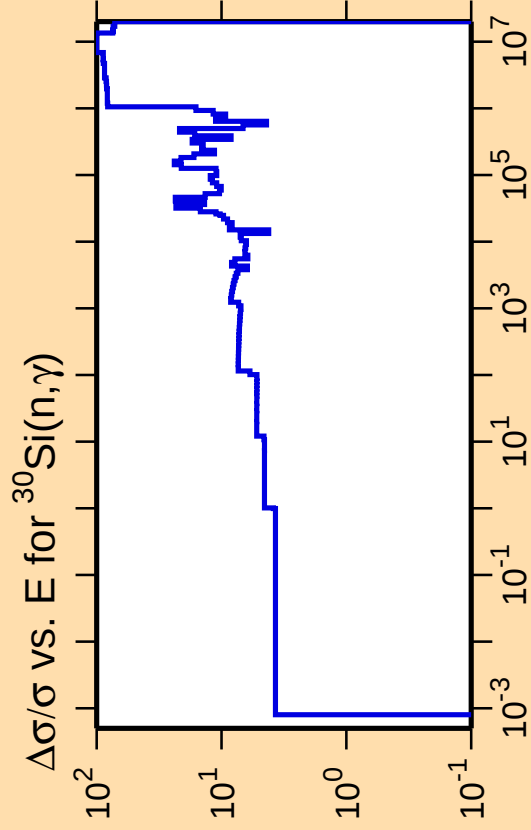


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{el.})$

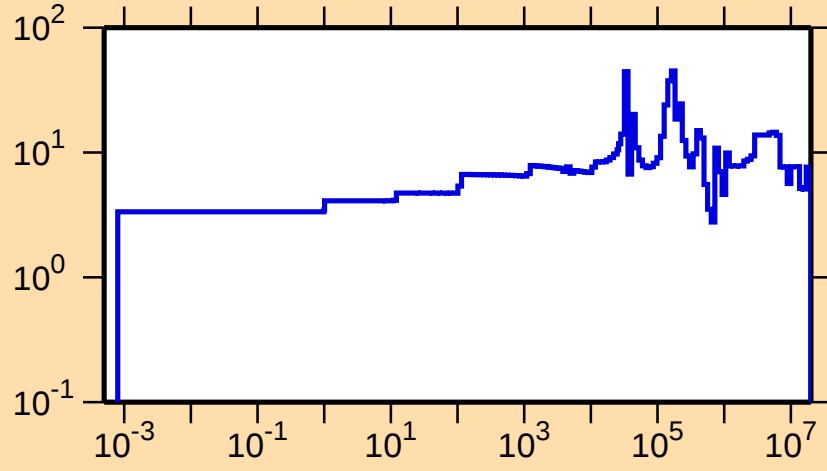

Correlation Matrix




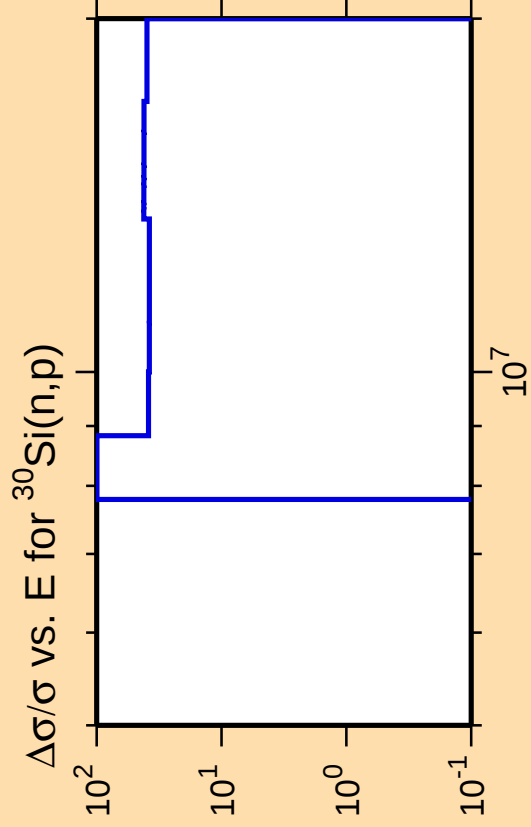



Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{el.})$

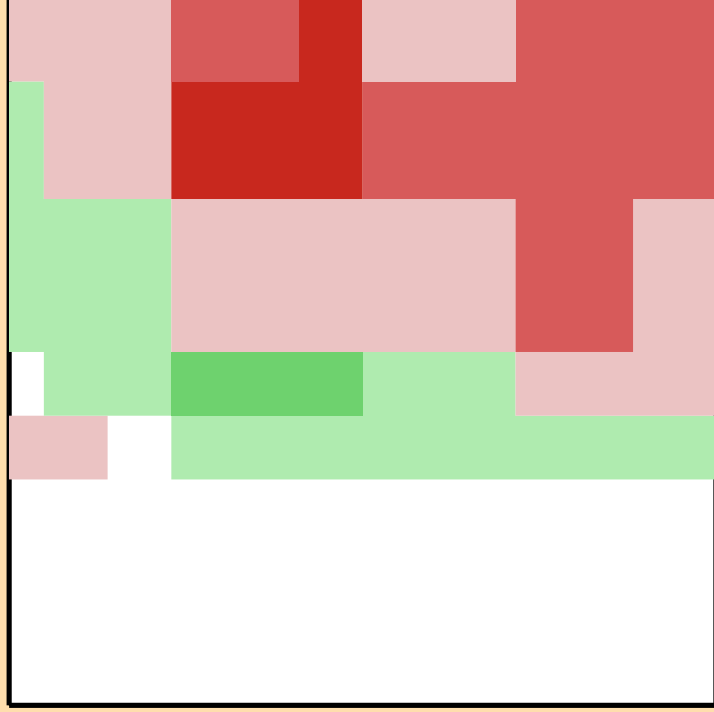
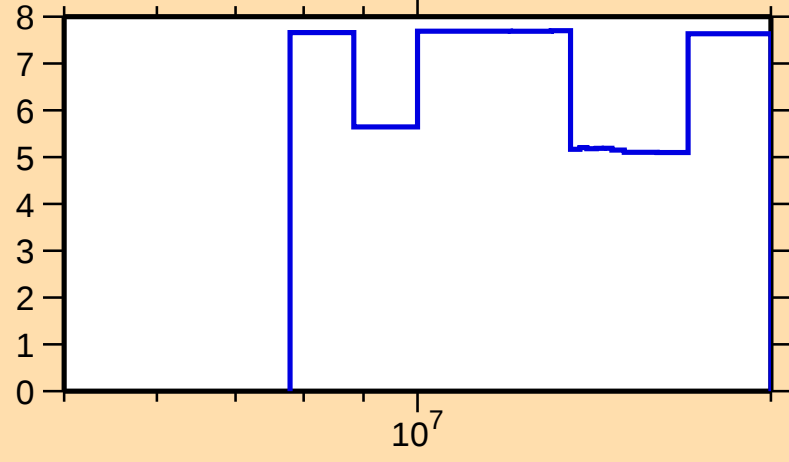


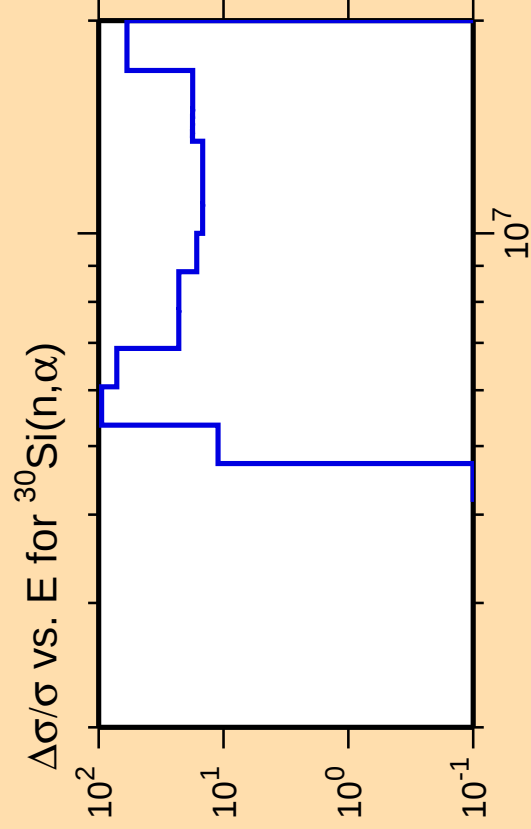

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

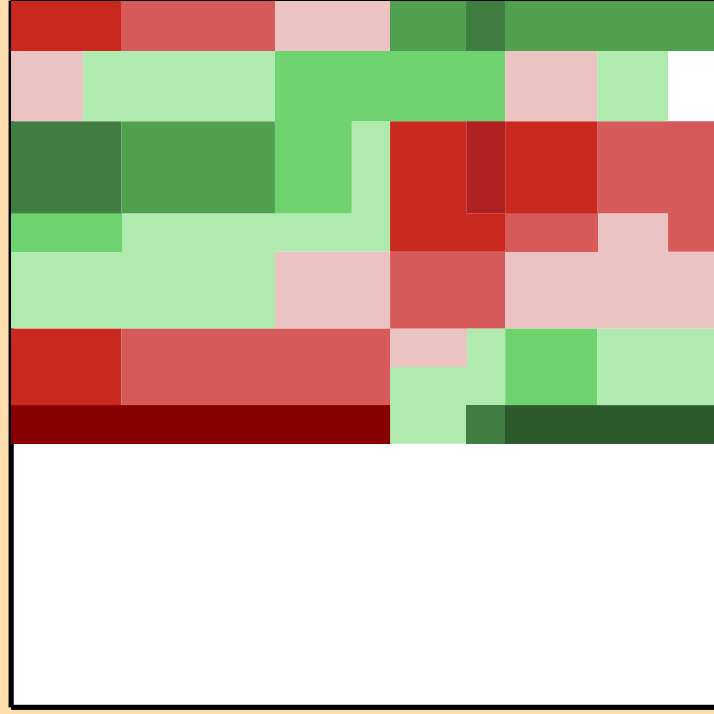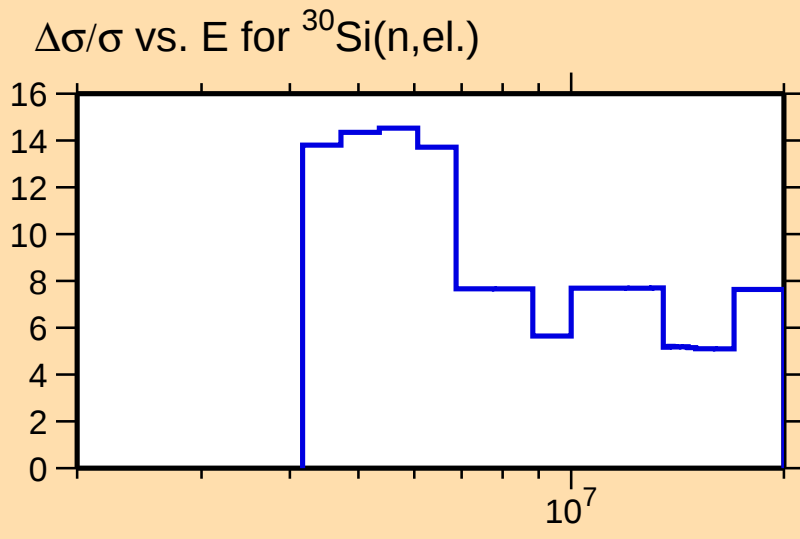

Correlation Matrix





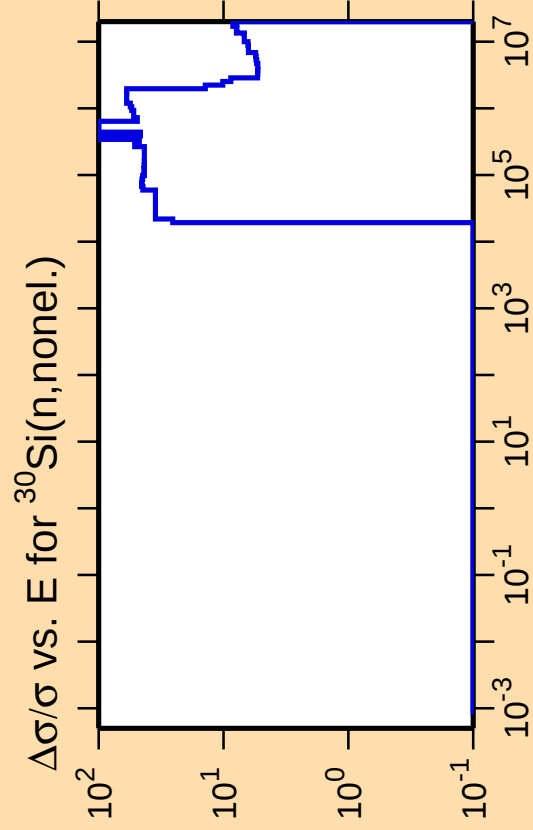

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

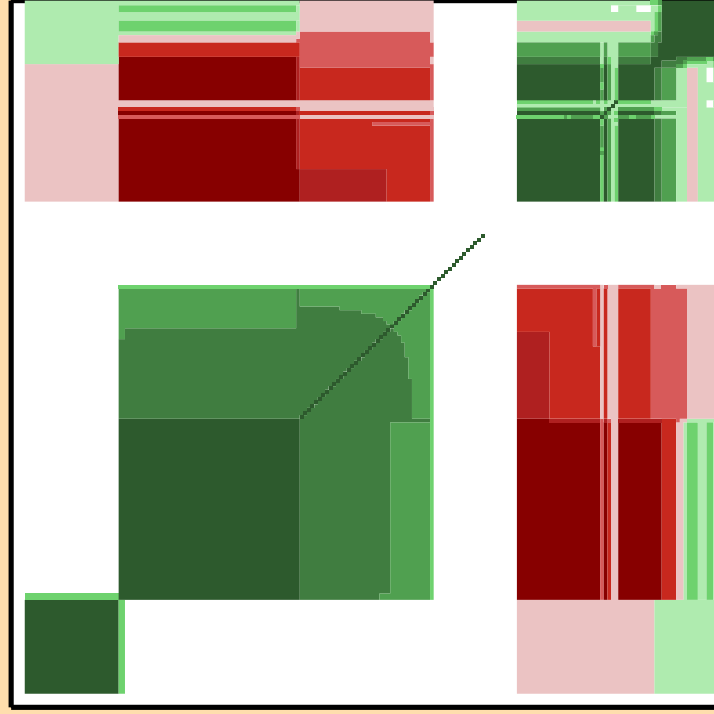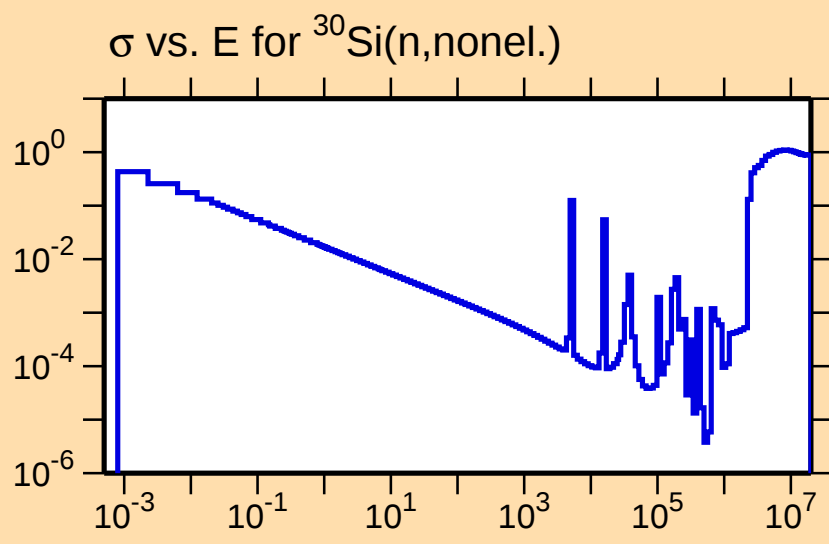

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{inel.})$

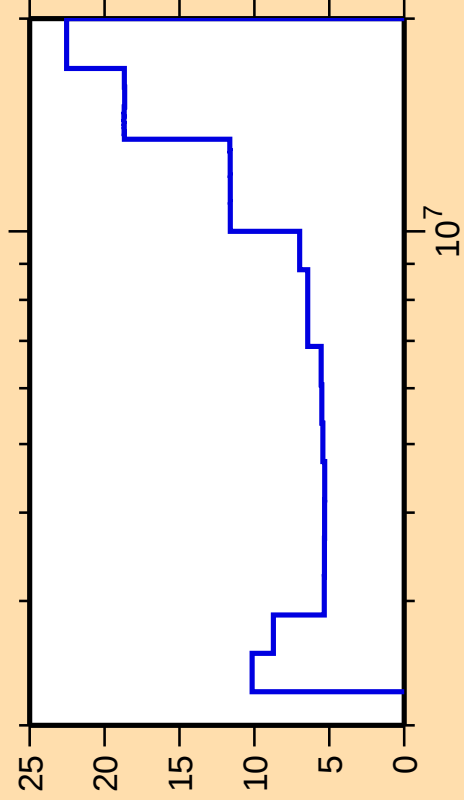


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{nonel.})$

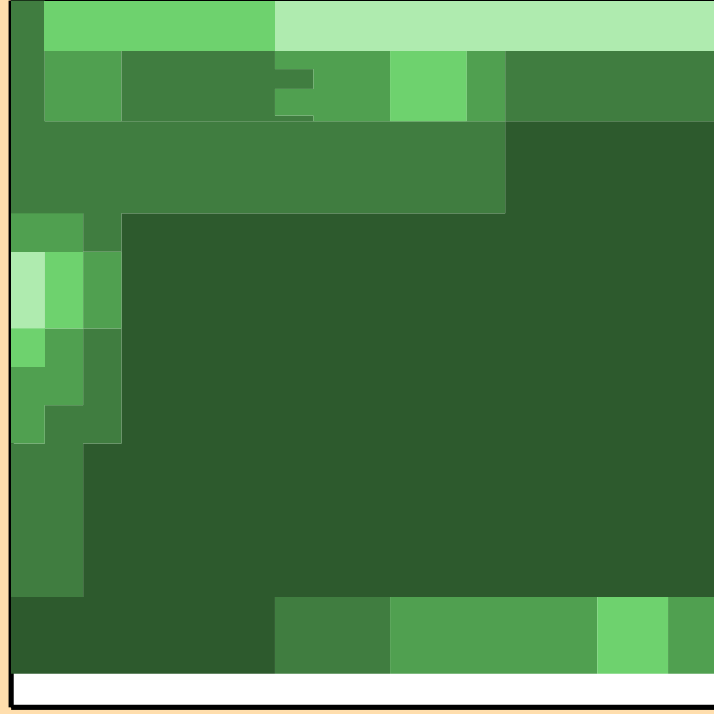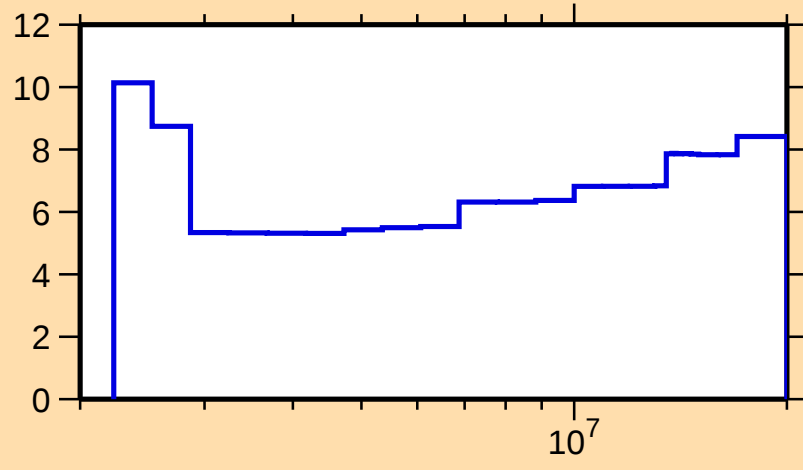

Correlation Matrix

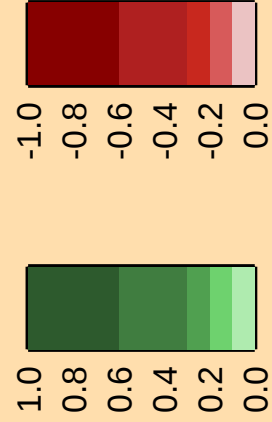

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$


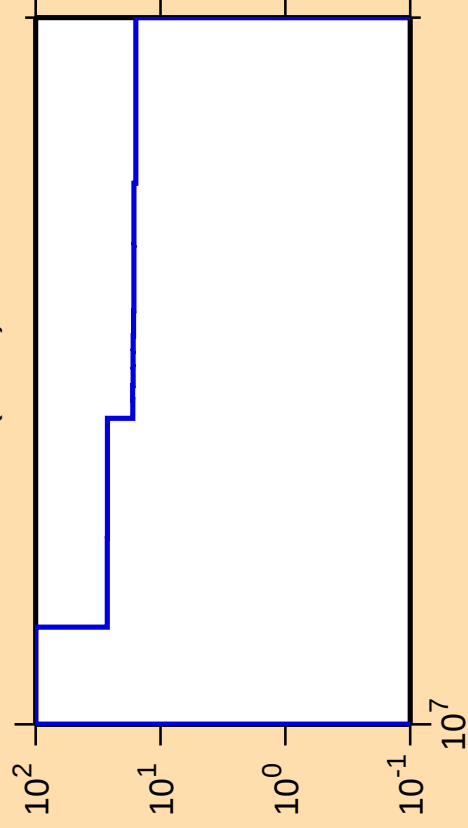


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).




Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{nonel.})$

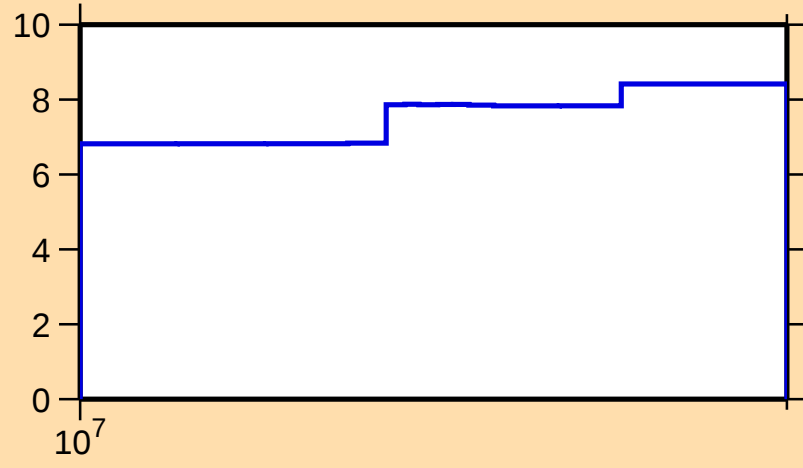


Correlation Matrix




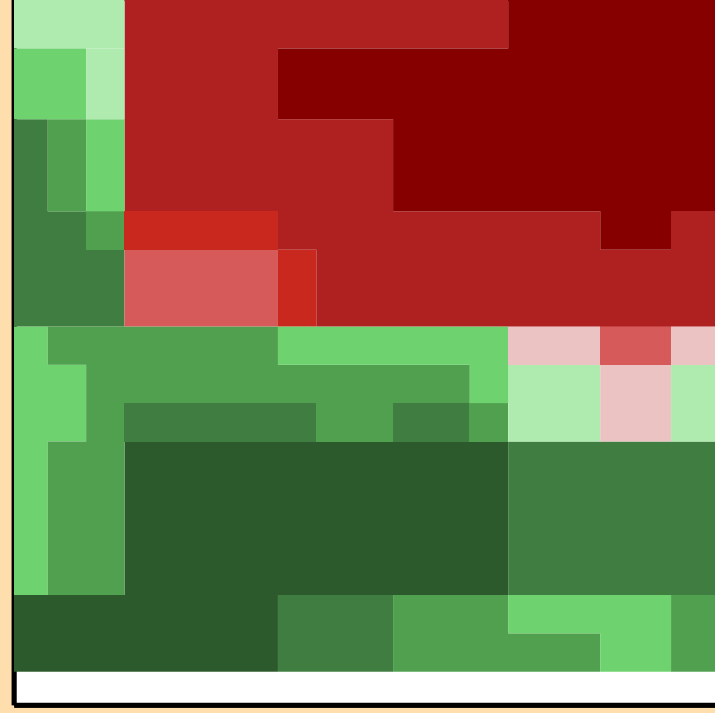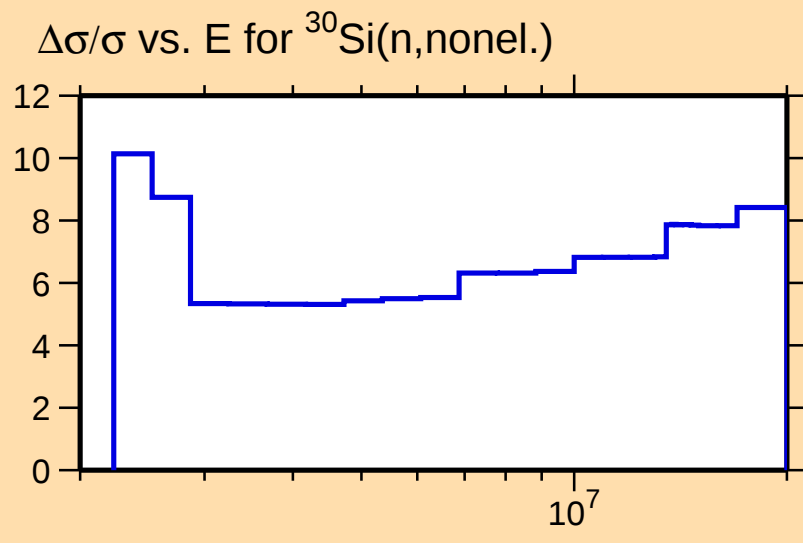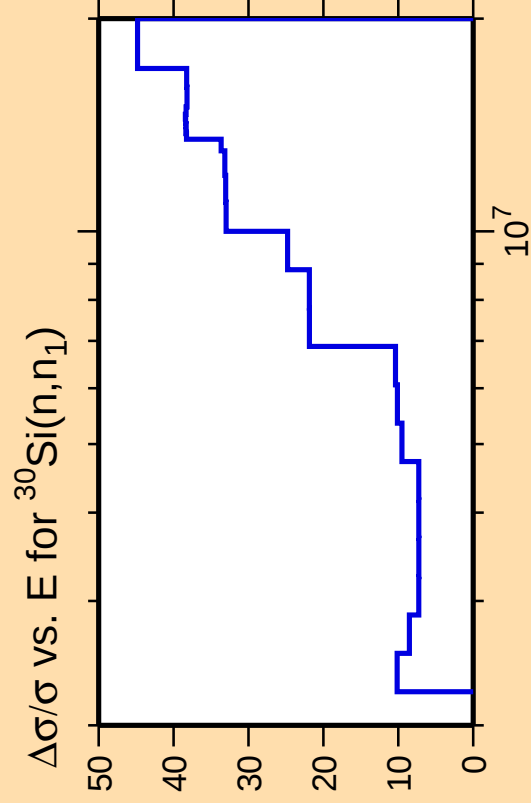

Correlation Matrix

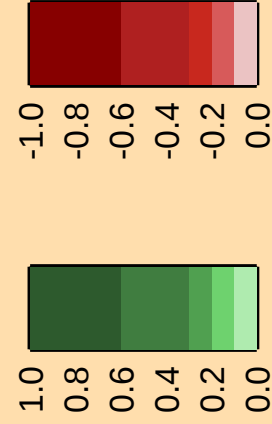


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(\text{n},\text{ncont.})$

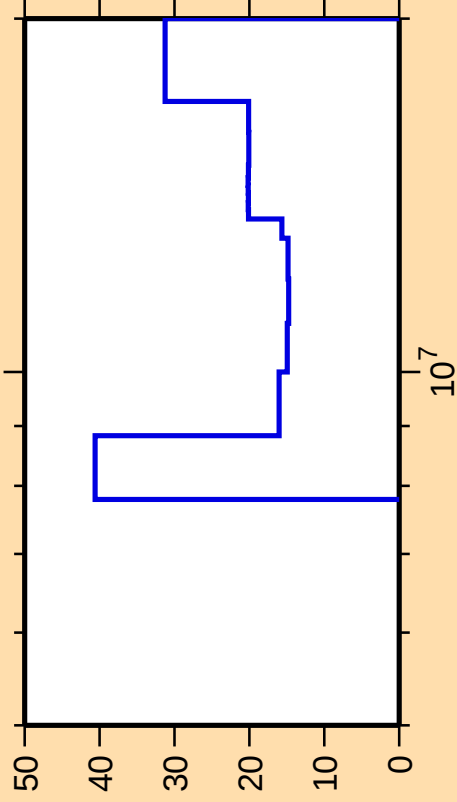

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(\text{n},\text{nonel.})$

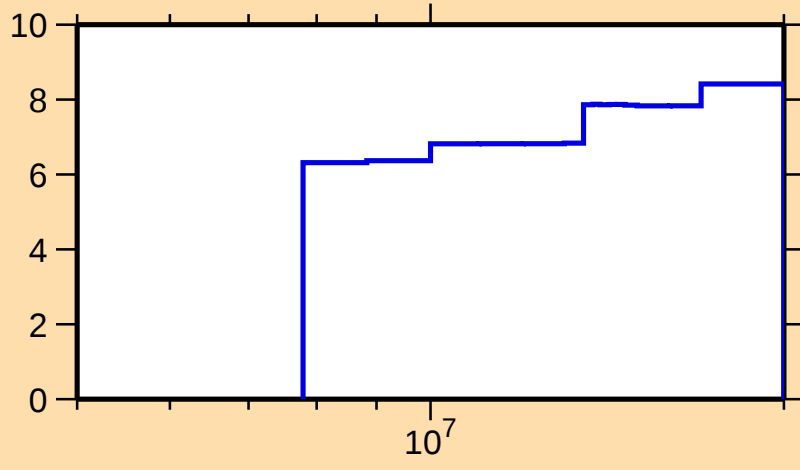

Correlation Matrix





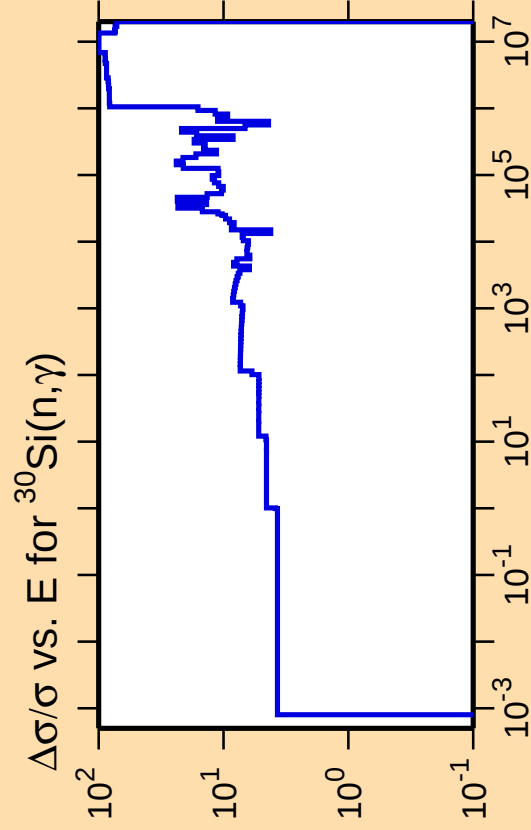

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

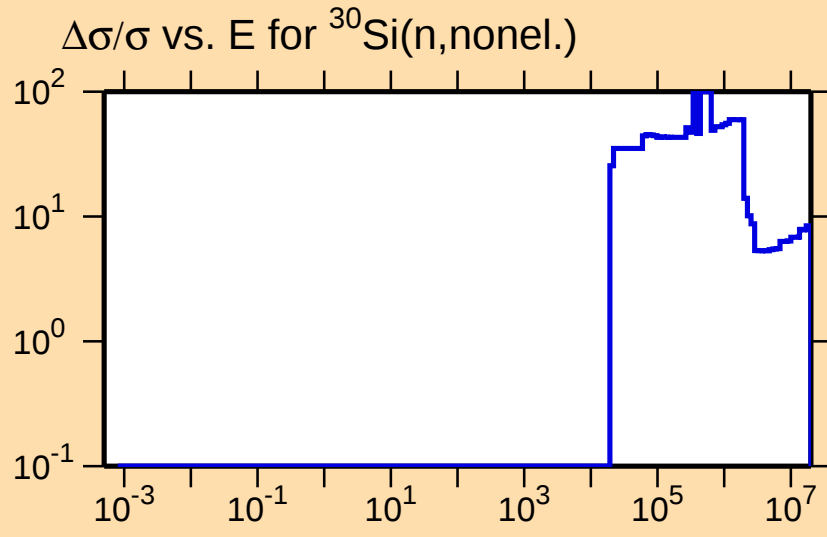

Correlation Matrix





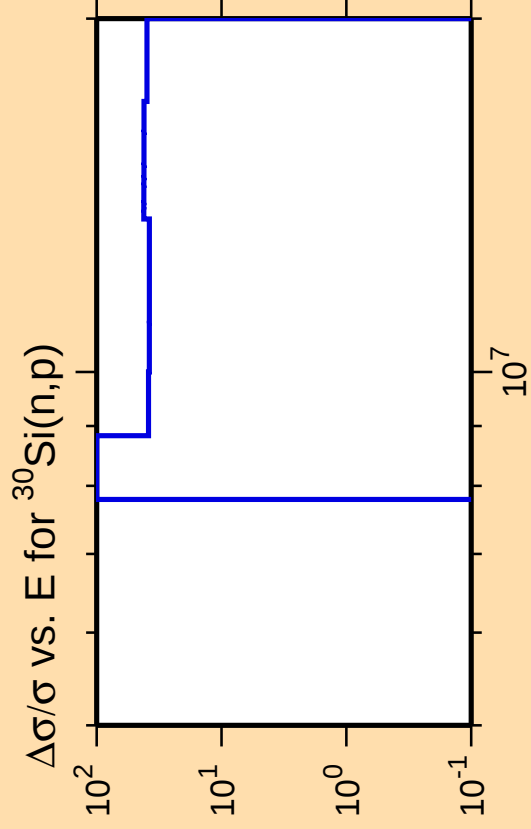


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

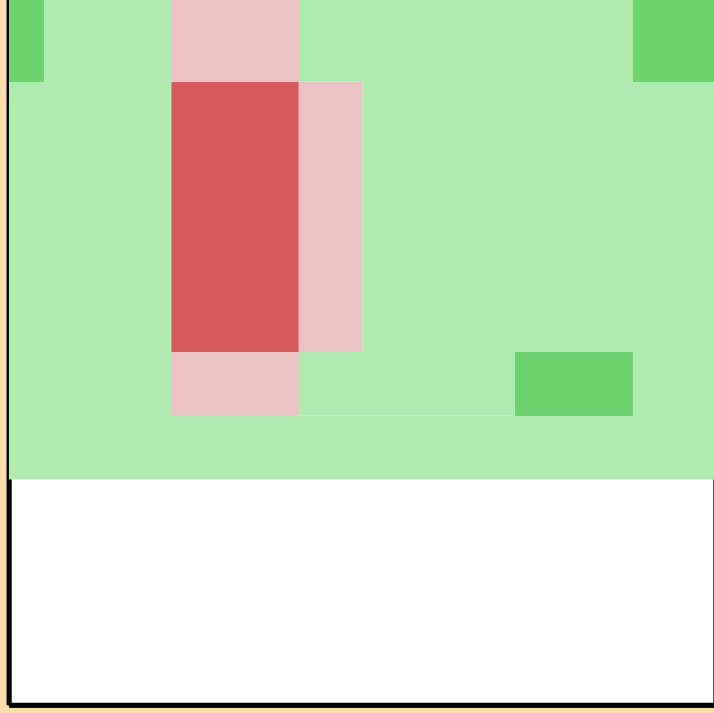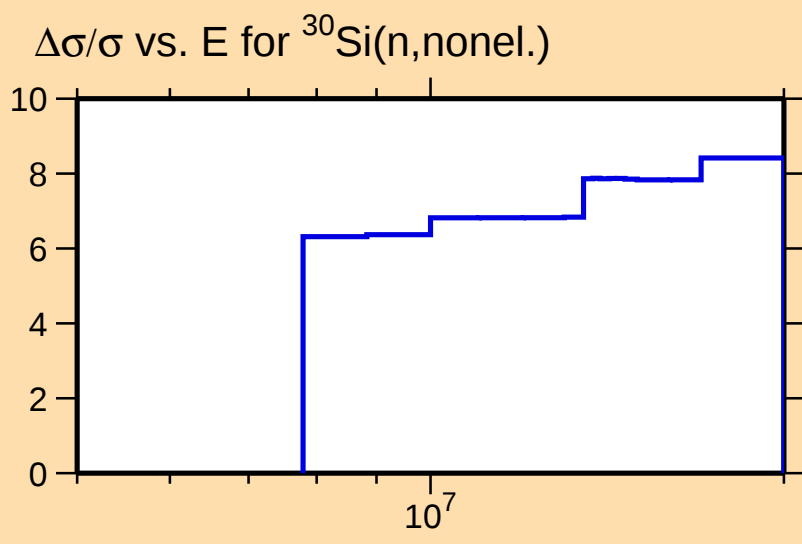

Correlation Matrix

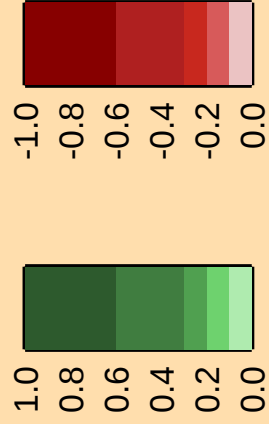


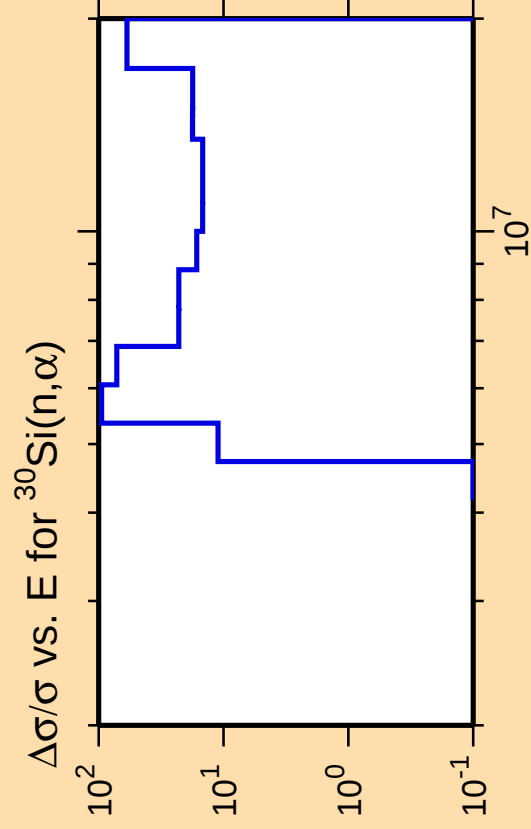


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

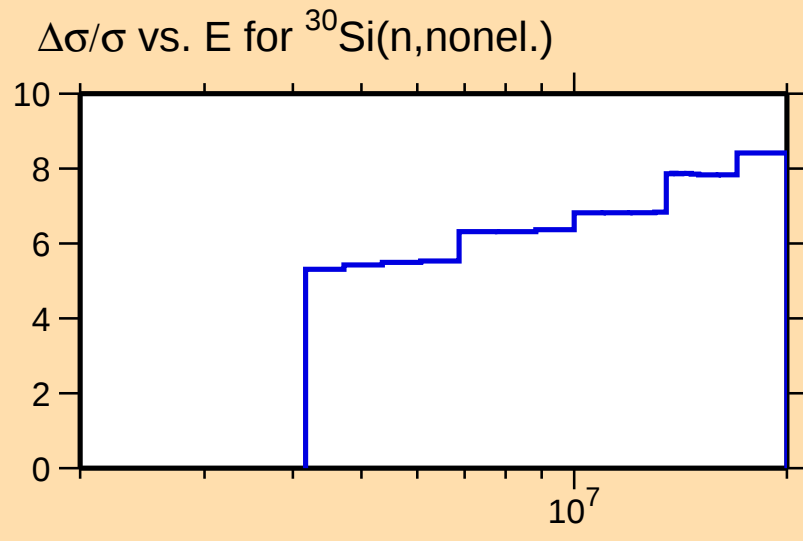



Correlation Matrix

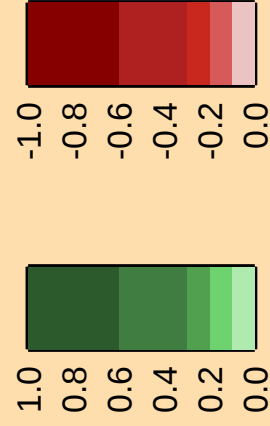

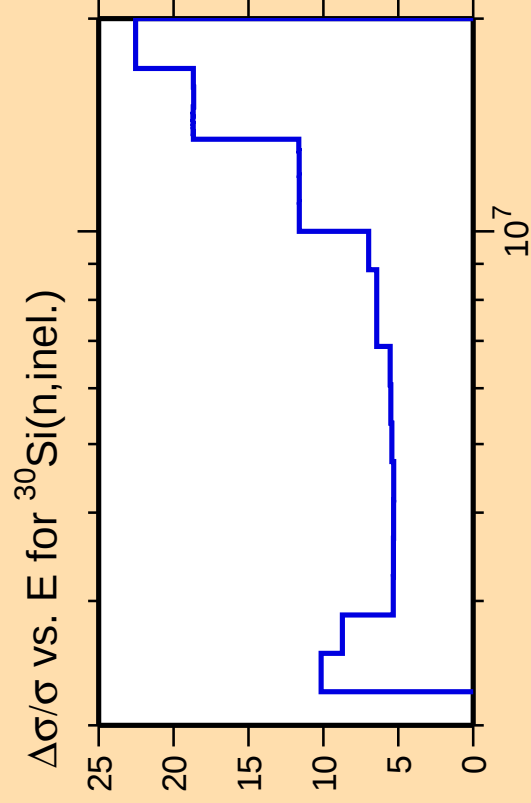

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

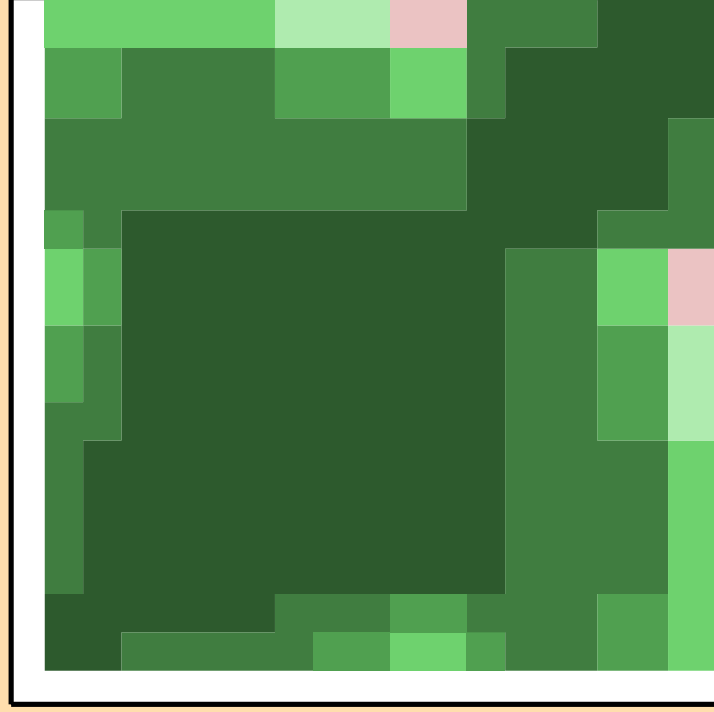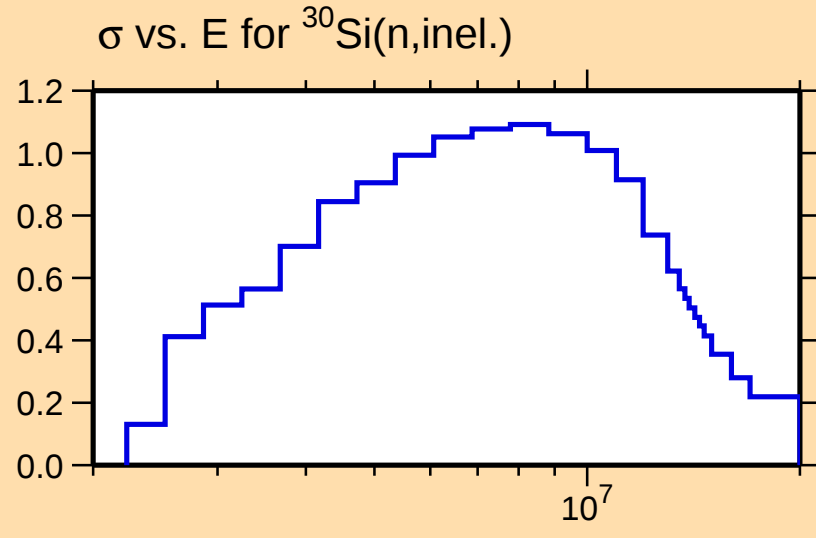

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$


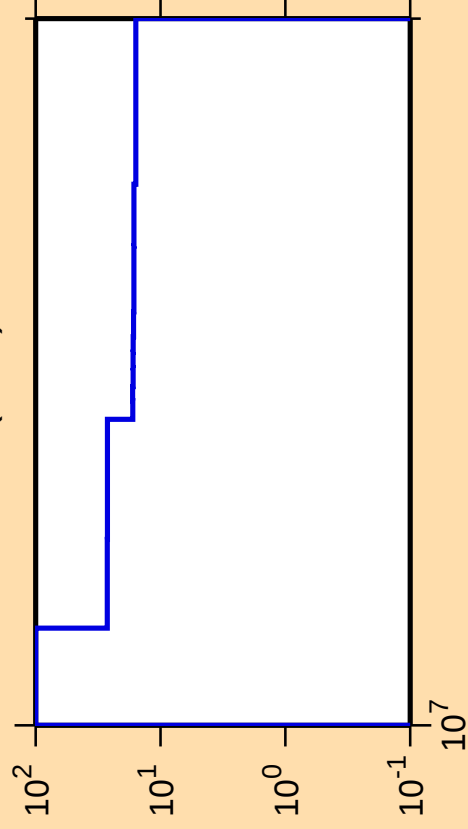


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).




Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{inel.})$

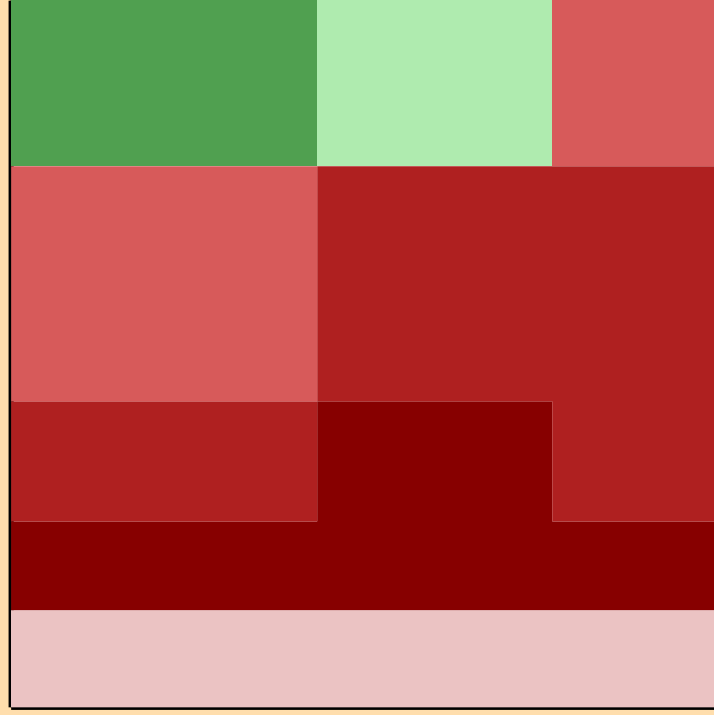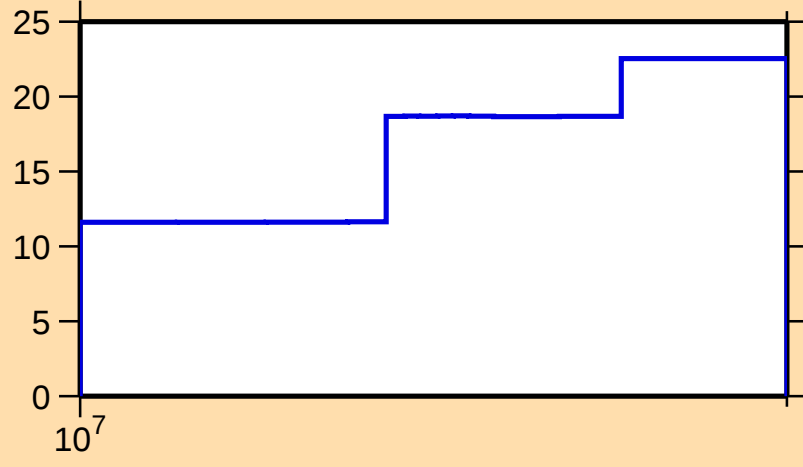


Correlation Matrix




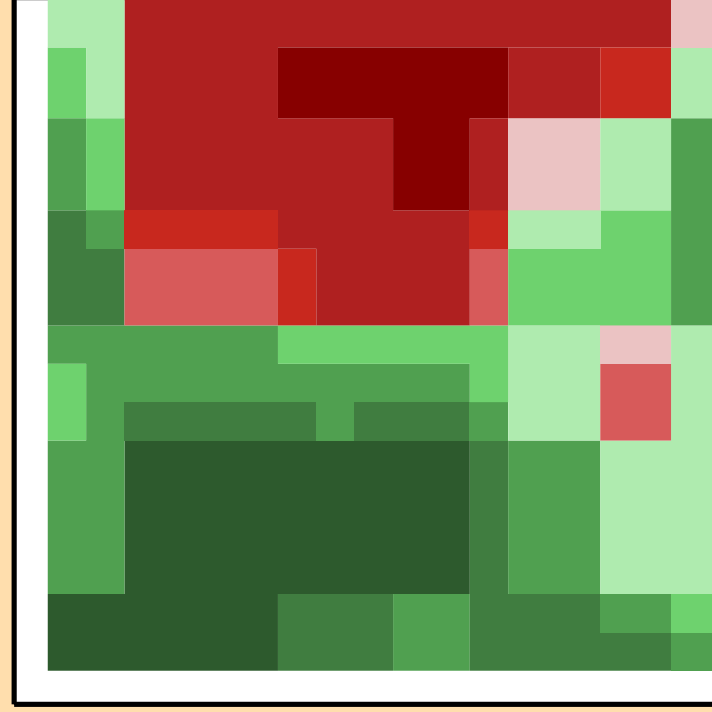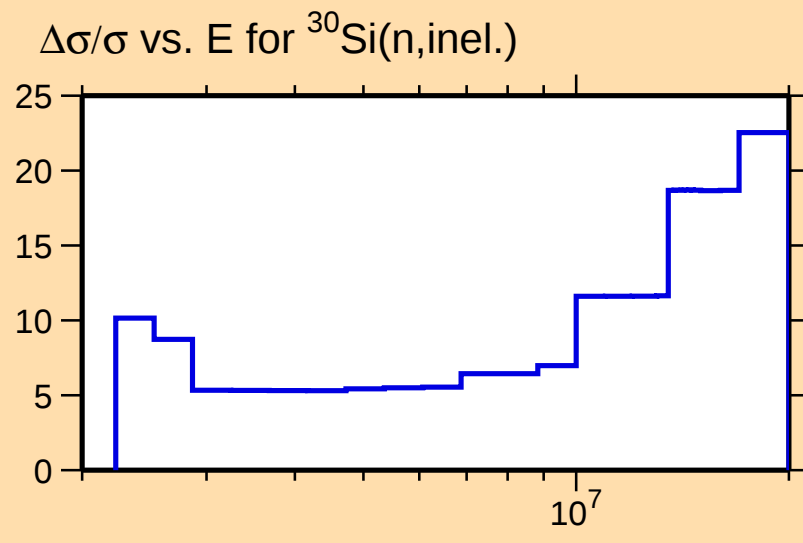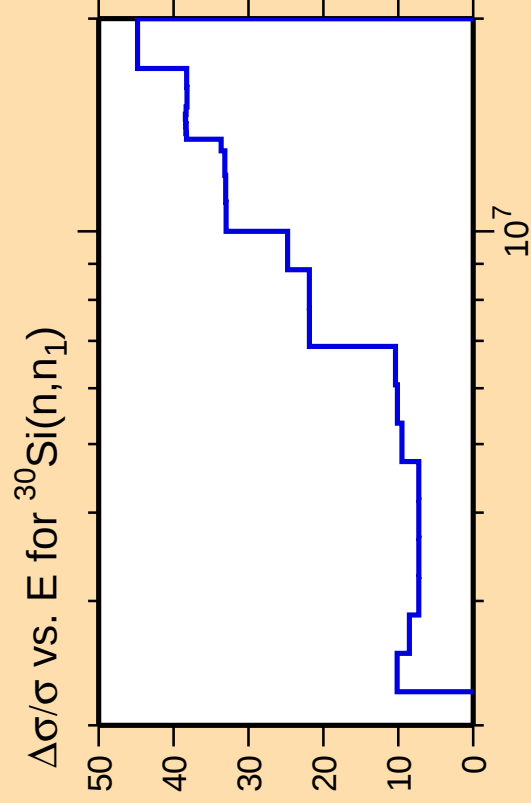

Correlation Matrix

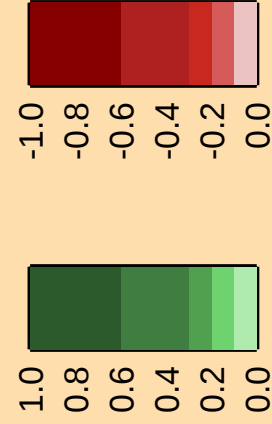



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n\text{cont.})$

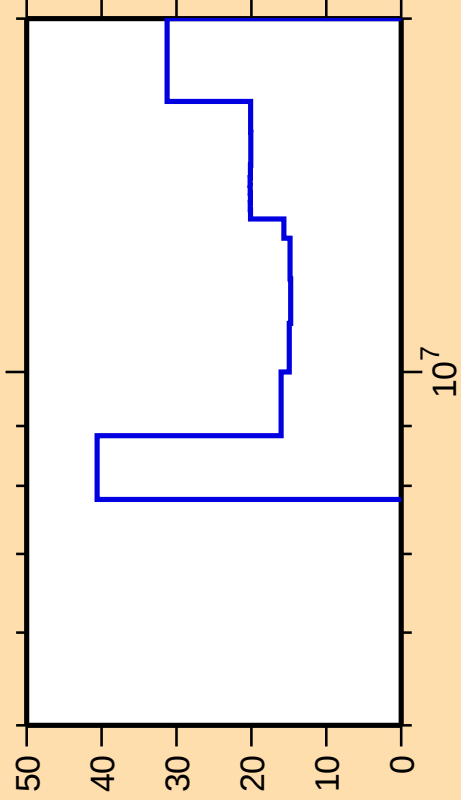


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{inel.})$

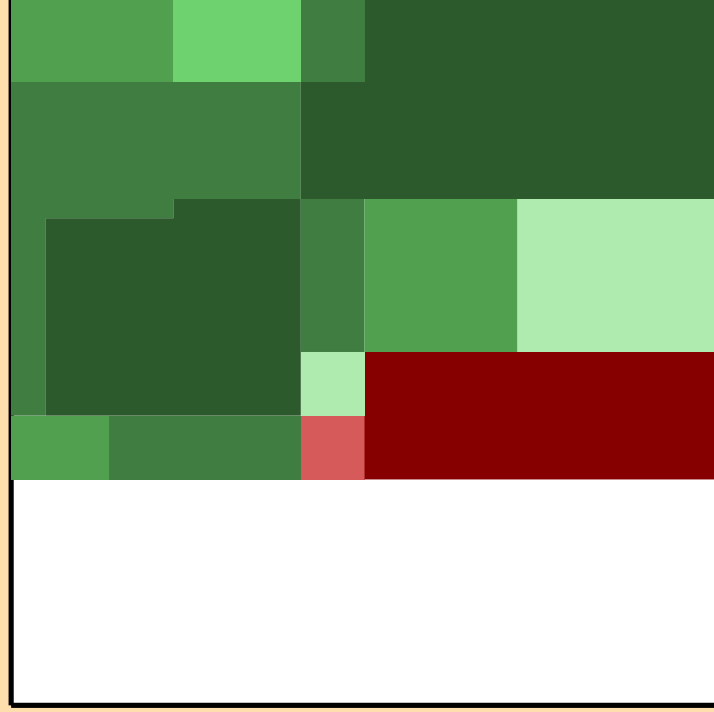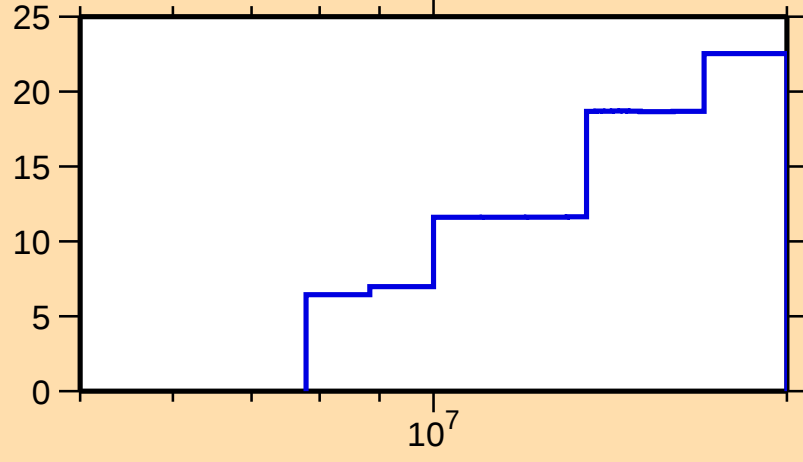

Correlation Matrix

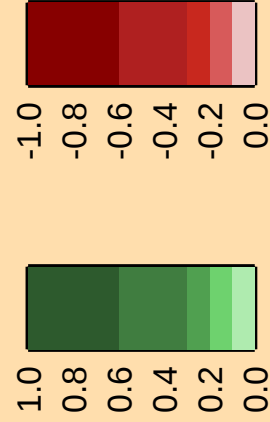


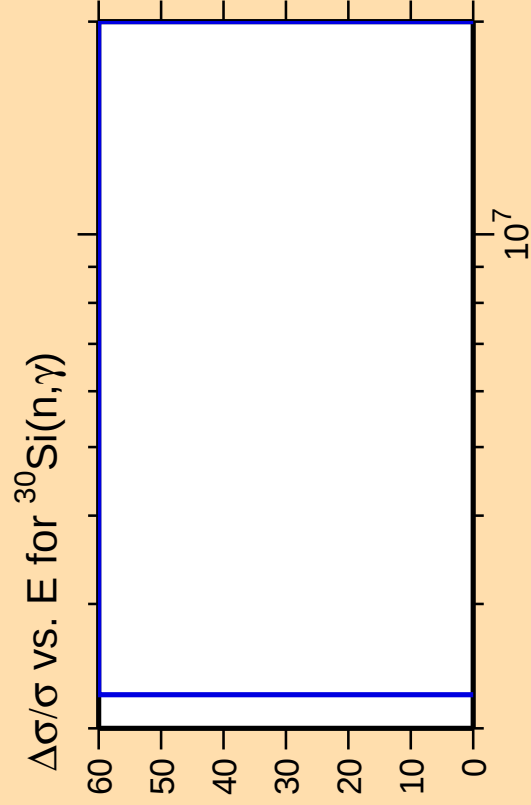

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

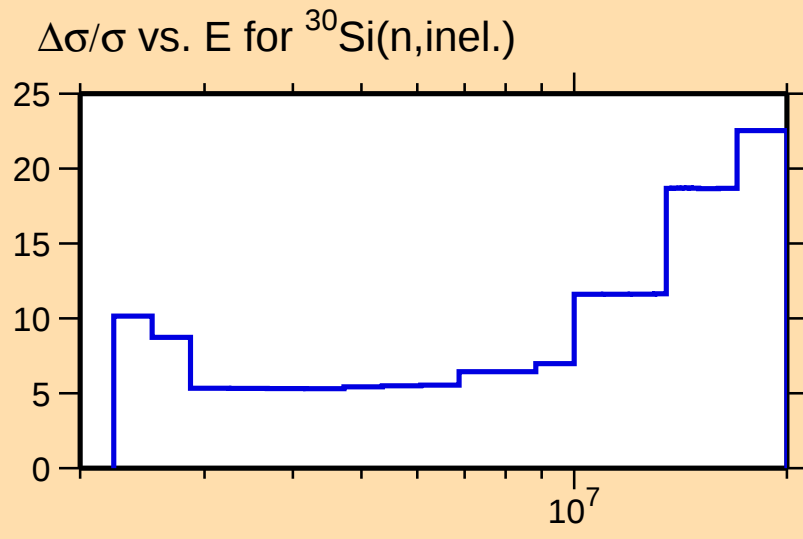

Correlation Matrix







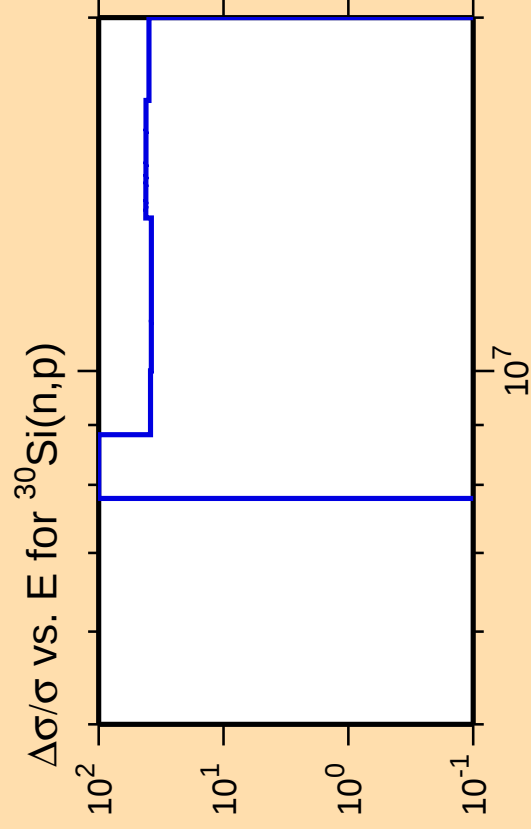


Ordinate scale is %
relative standard deviation.

Abcissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

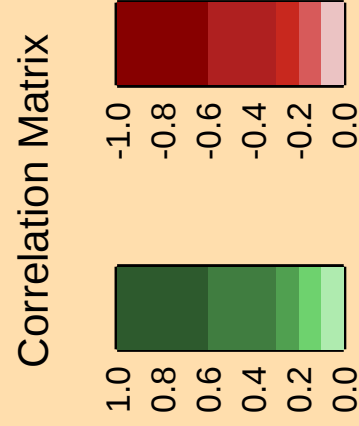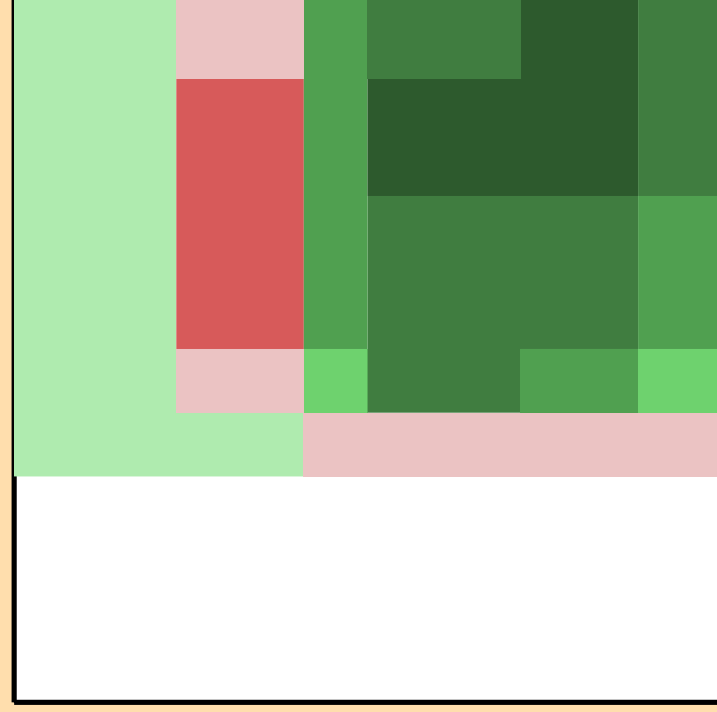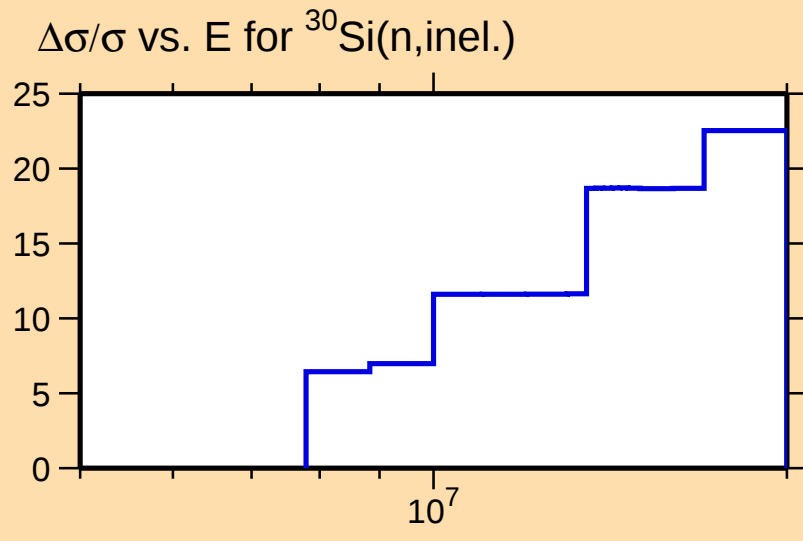

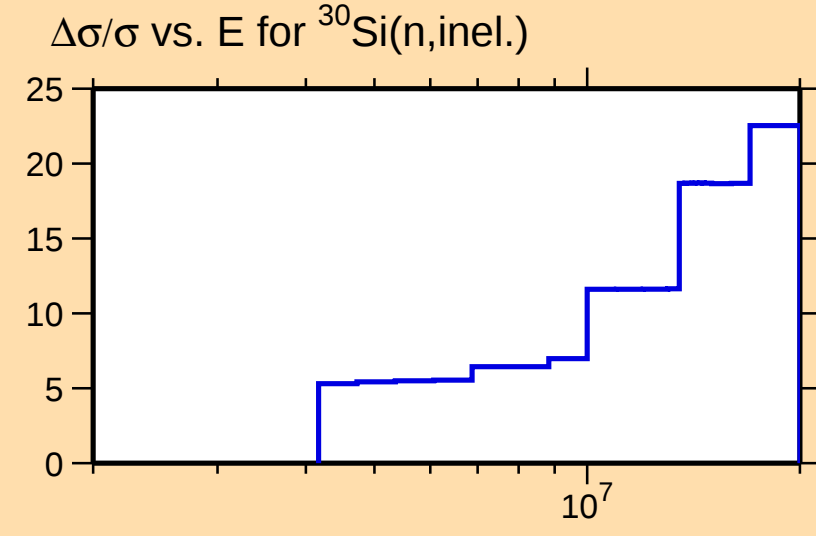
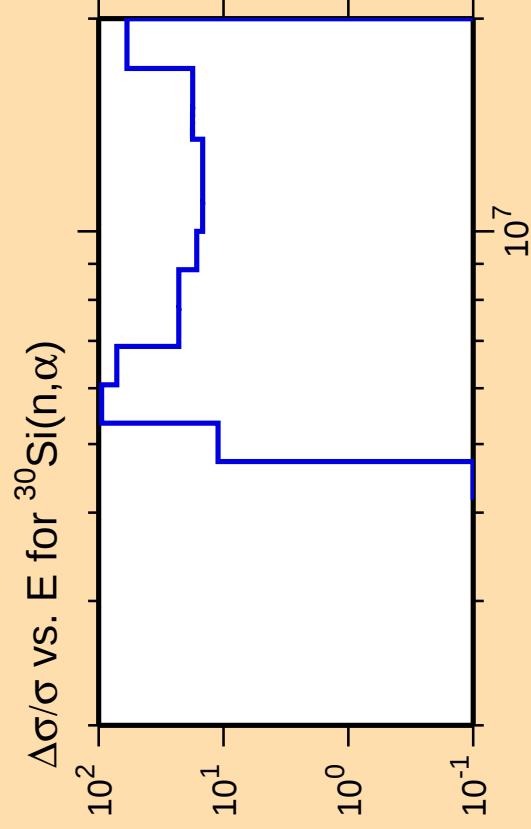


Correlation Matrix




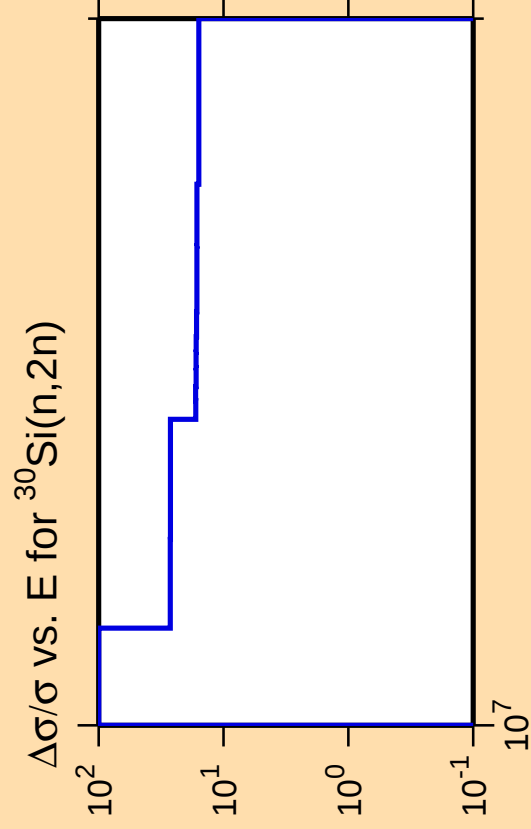


Warning: some uncertainty data were suppressed.

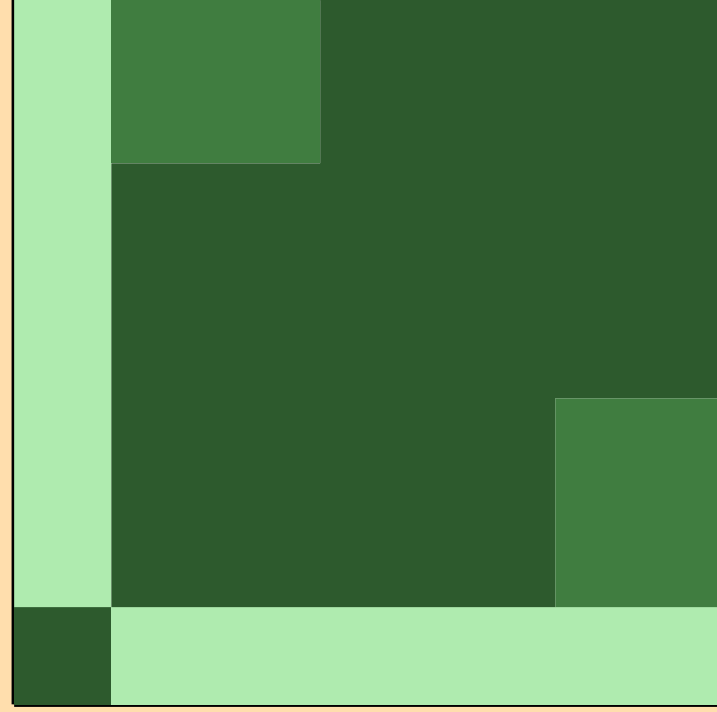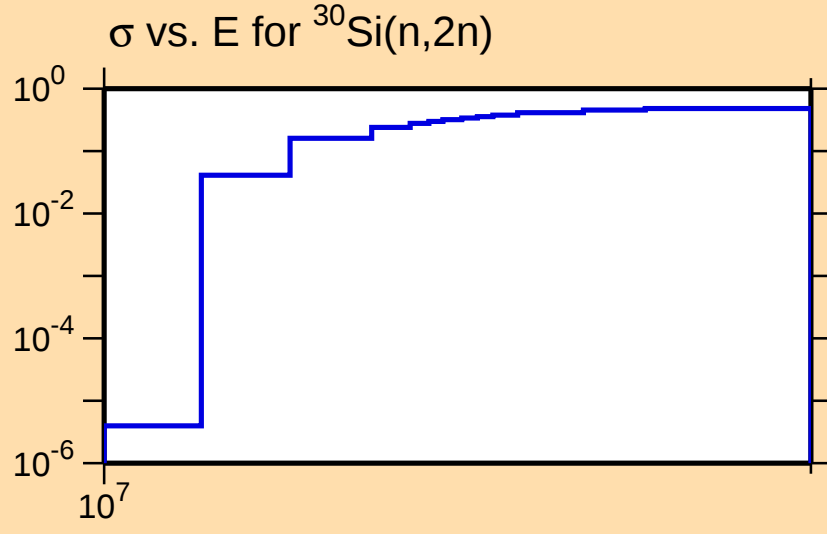

Correlation Matrix

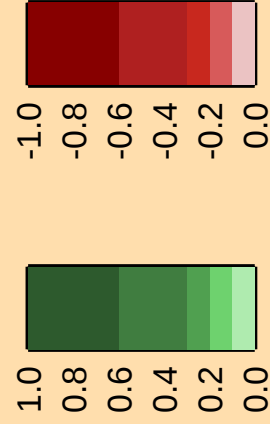

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n_1)$


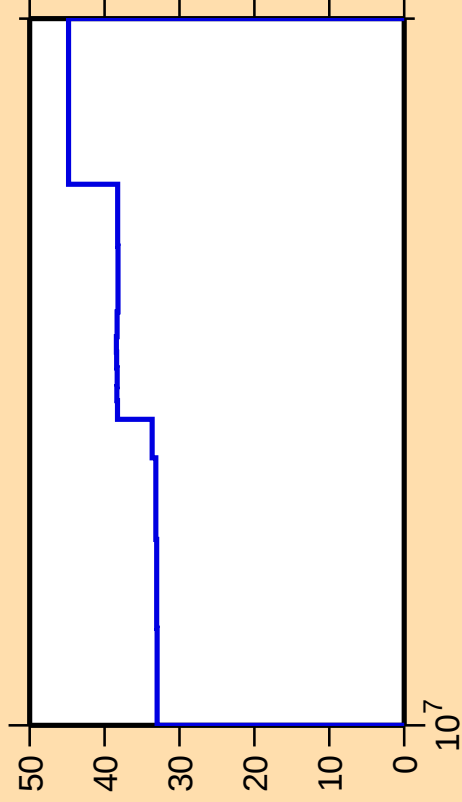


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$

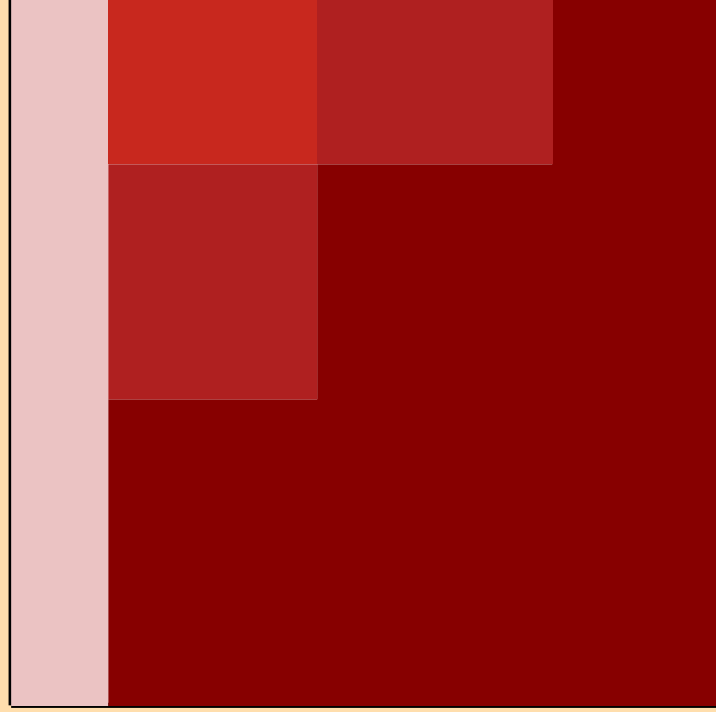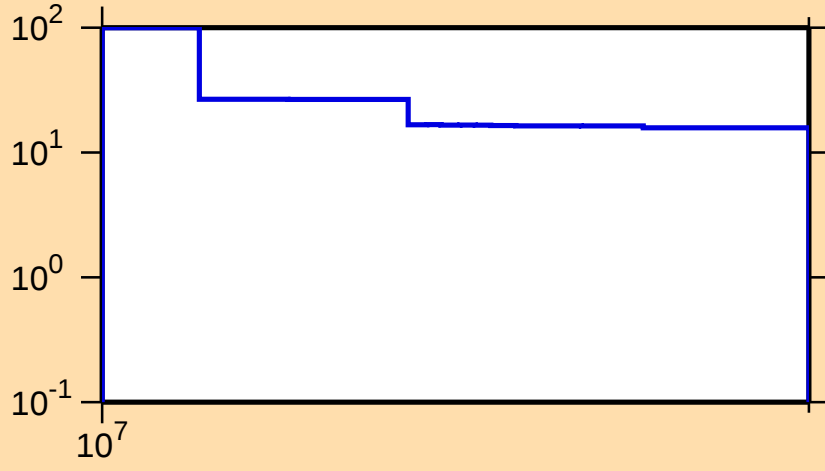

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n\text{cont.})$

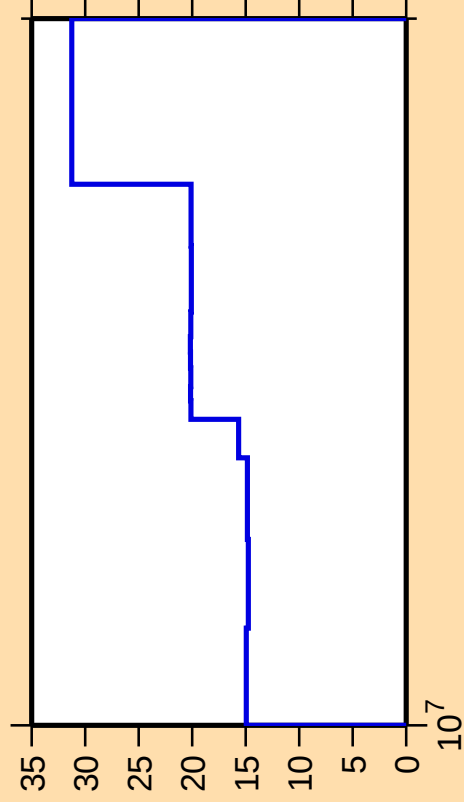


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$

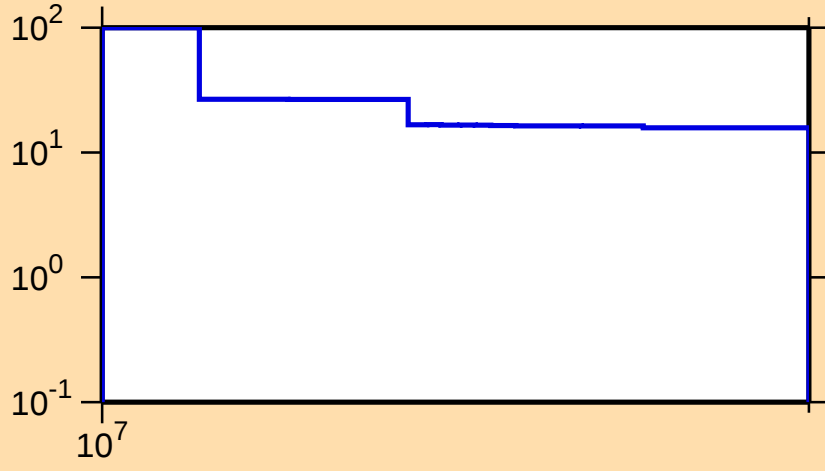

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\gamma)$


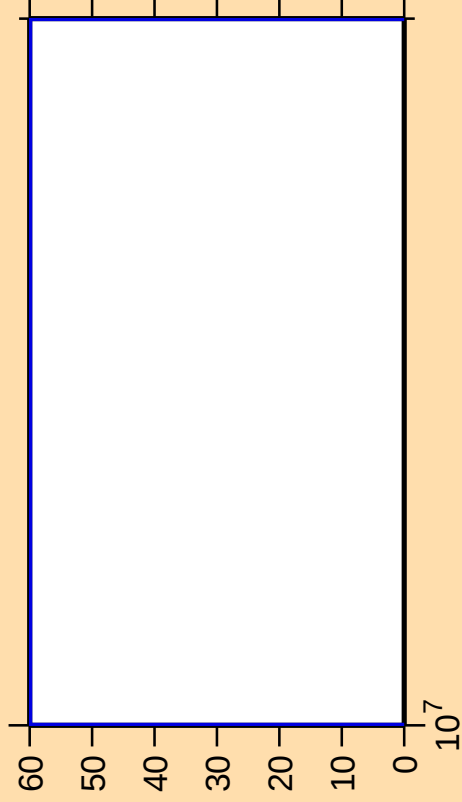


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$

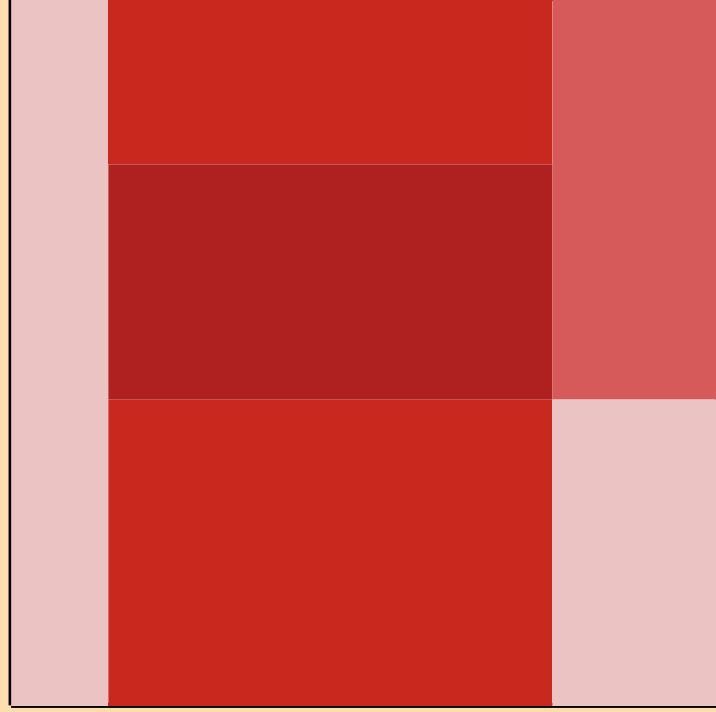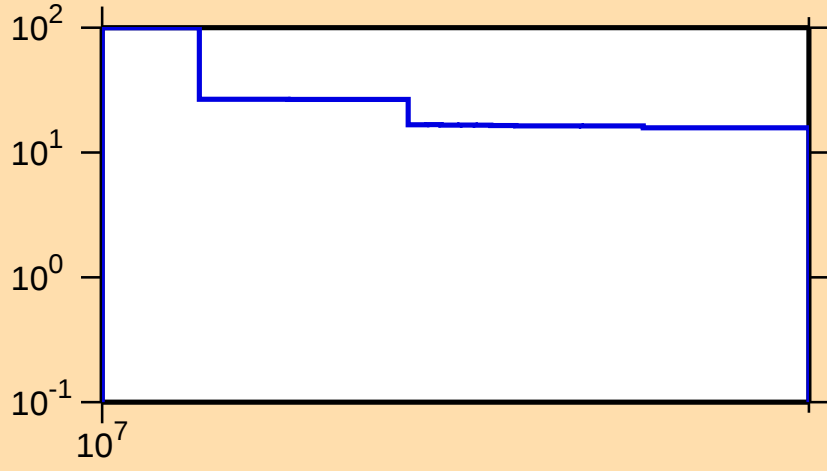

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,p)$


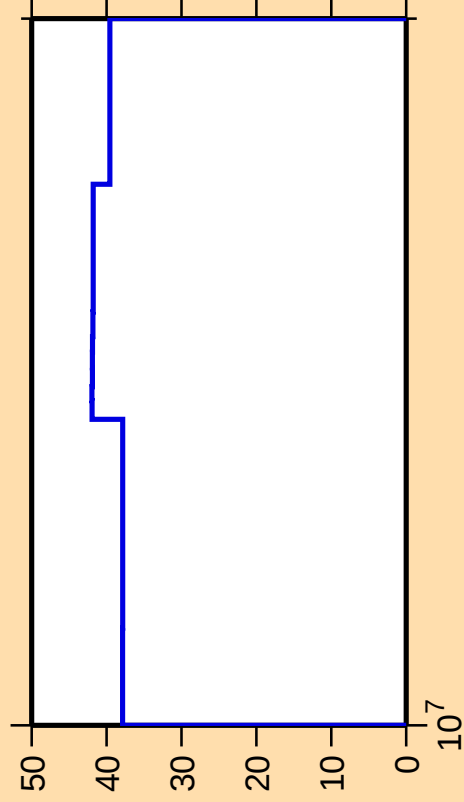


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$

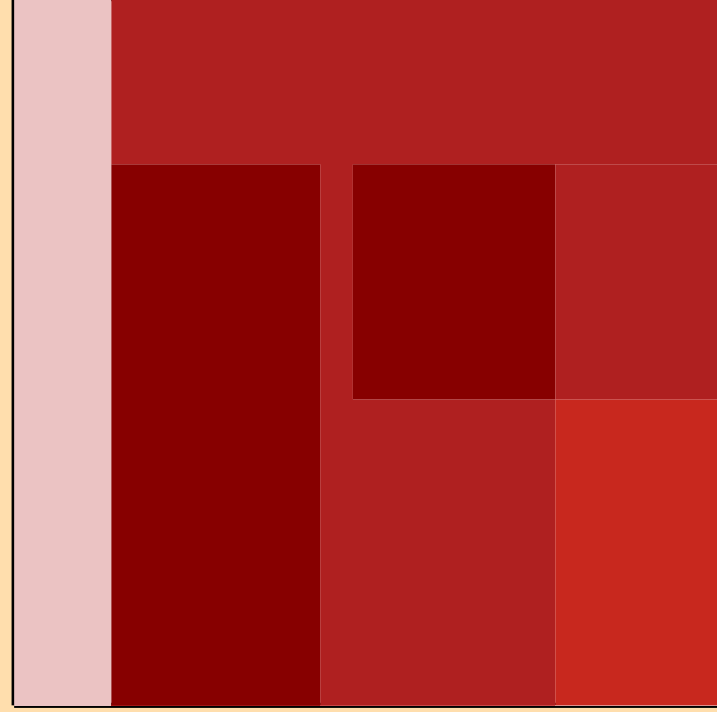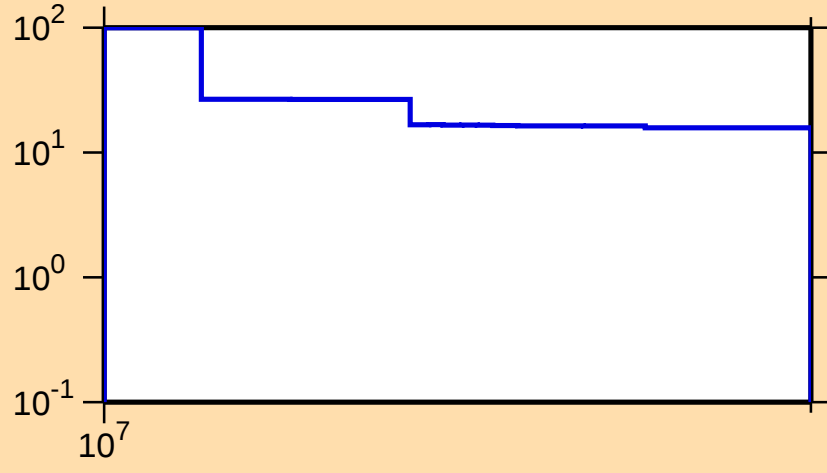

Correlation Matrix

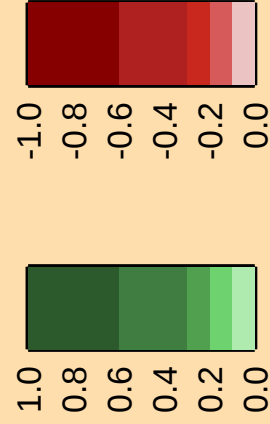

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\alpha)$


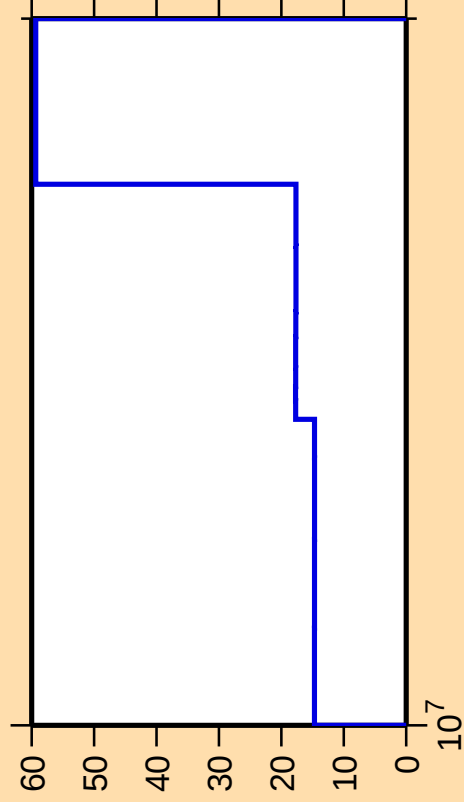


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,2n)$

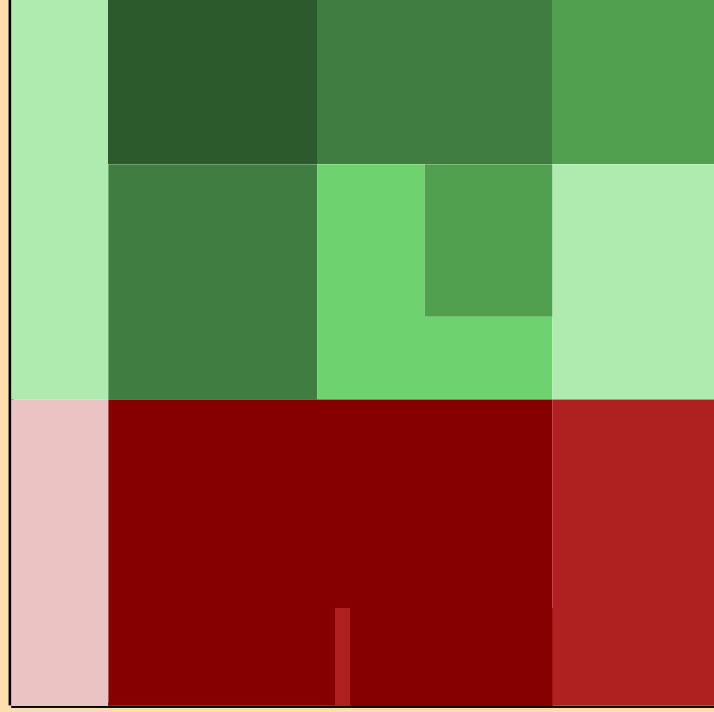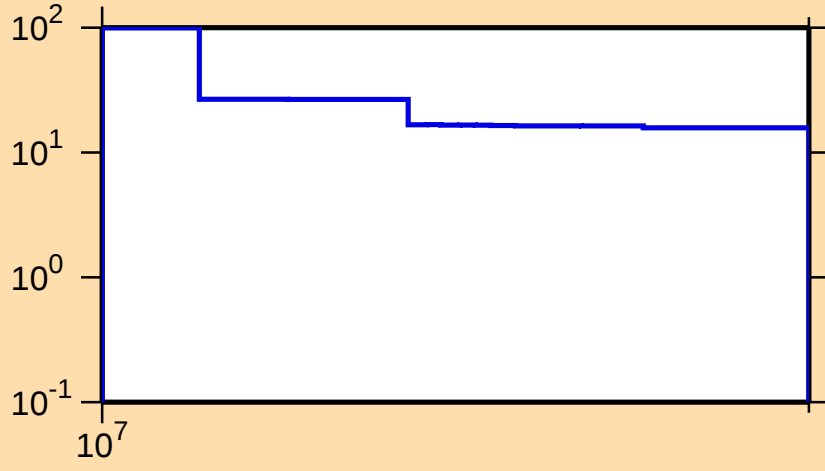

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,3n)$


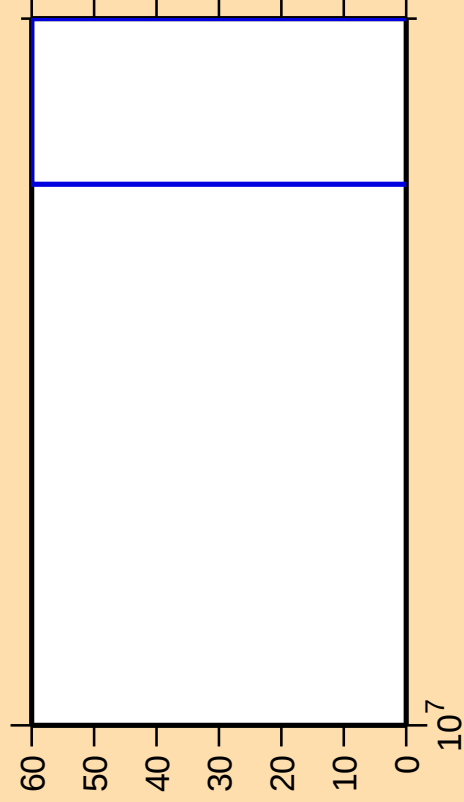


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{30}\text{Si}(n,3n)$

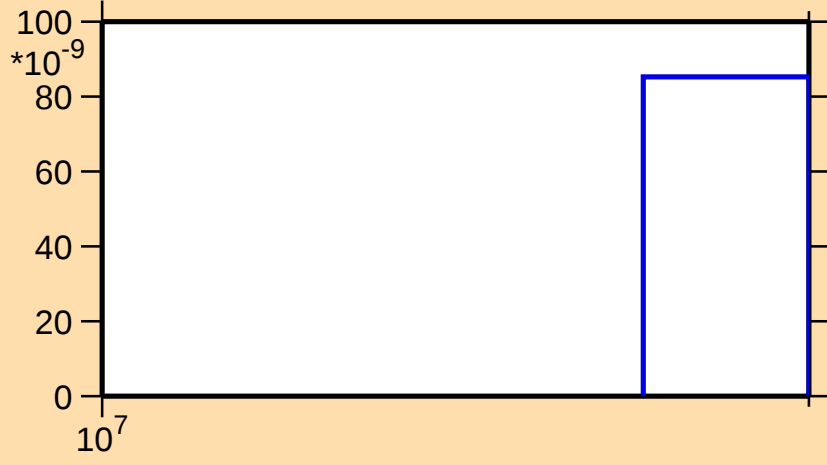

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n\alpha)$

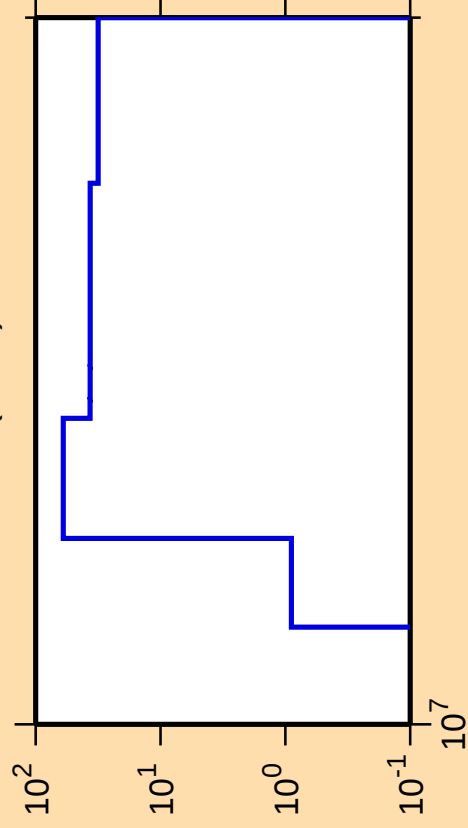

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Si}(n,n\alpha)$

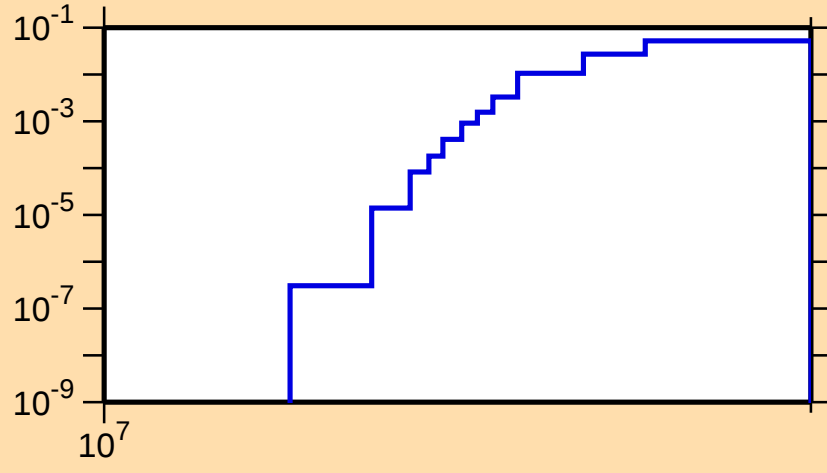

Correlation Matrix





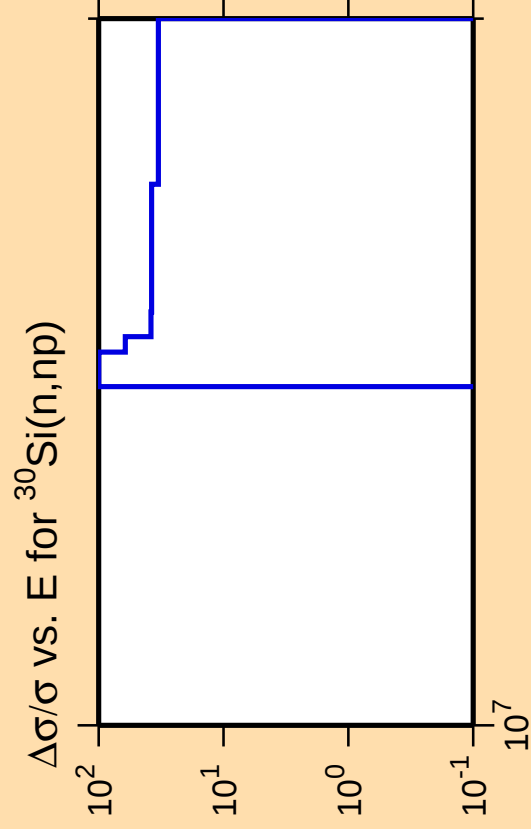

Ordinate scales are % relative standard deviation and barns.




Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

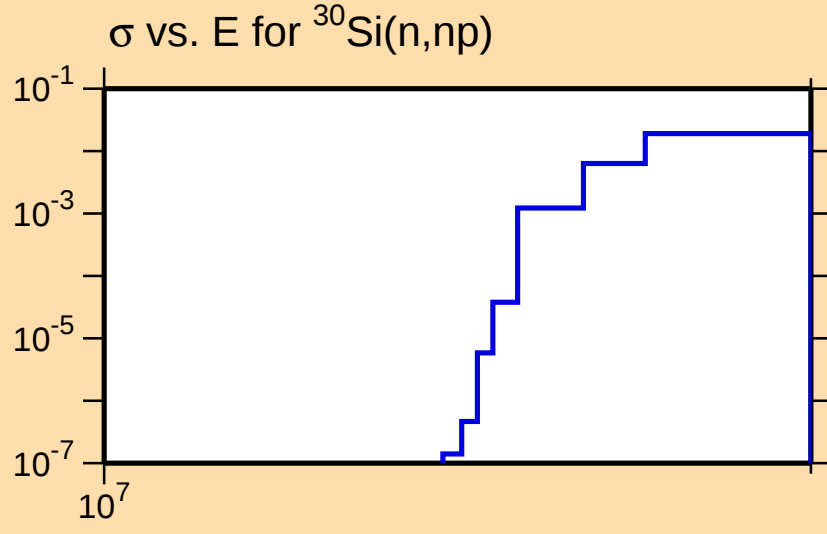

Correlation Matrix




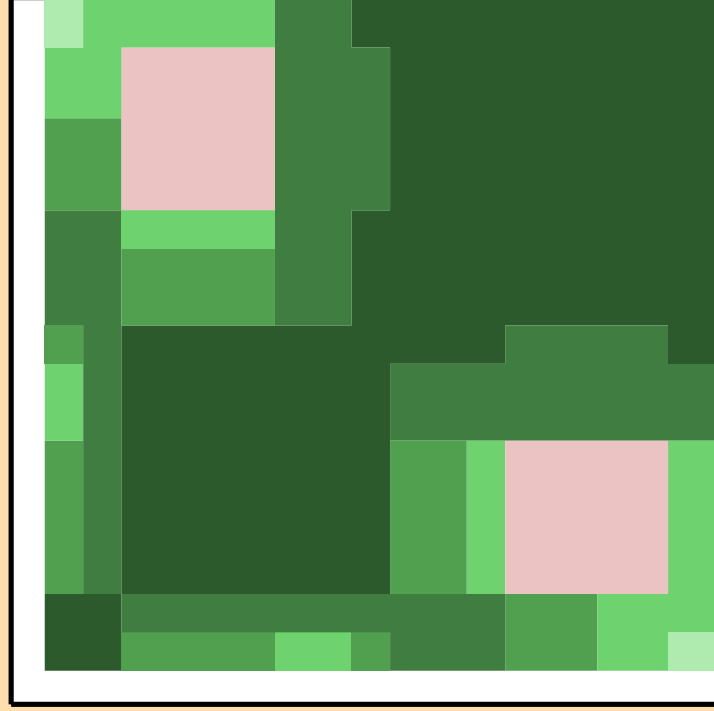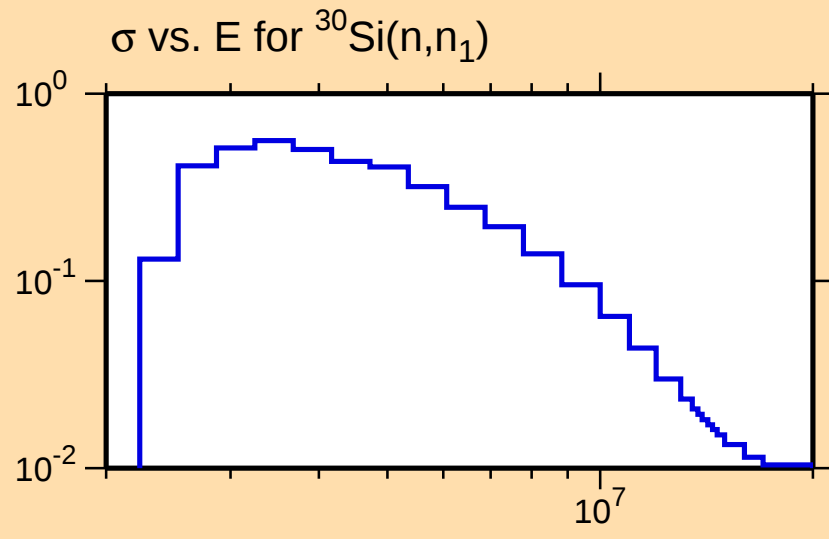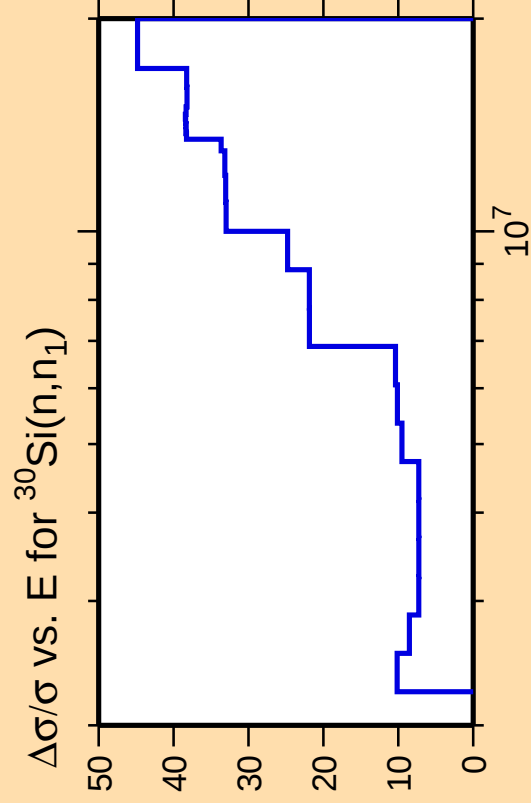

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n_{\text{cont}})$.

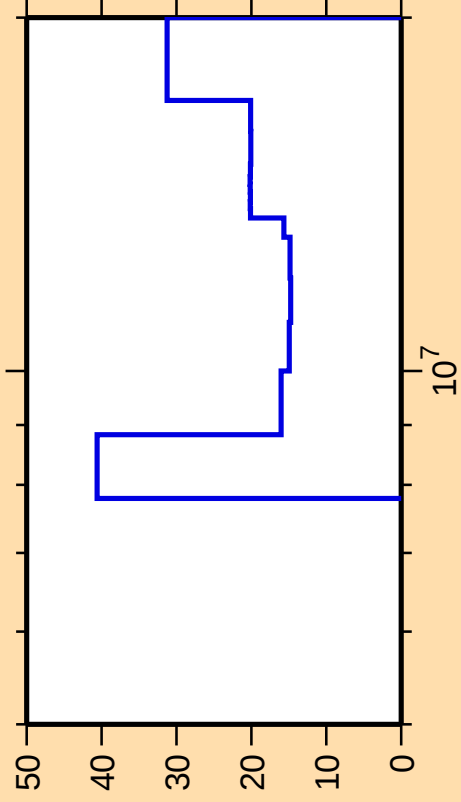

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n_1)$

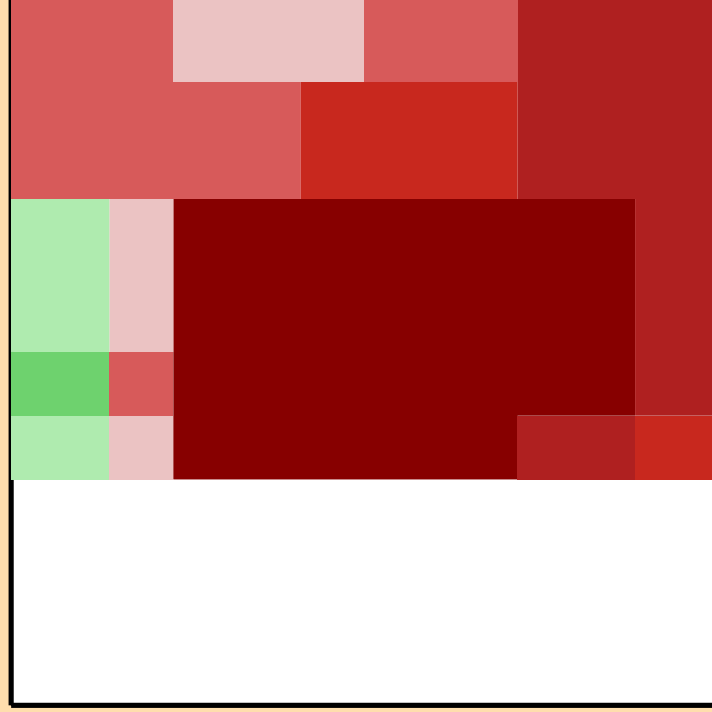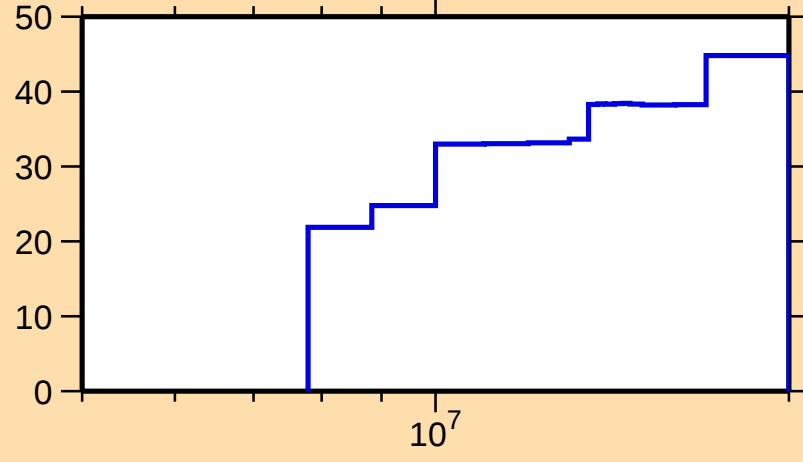

Correlation Matrix




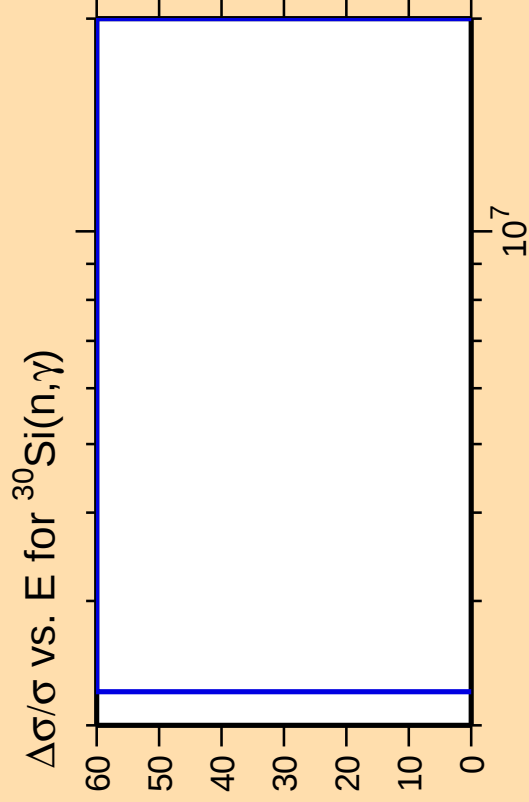


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n_1)$

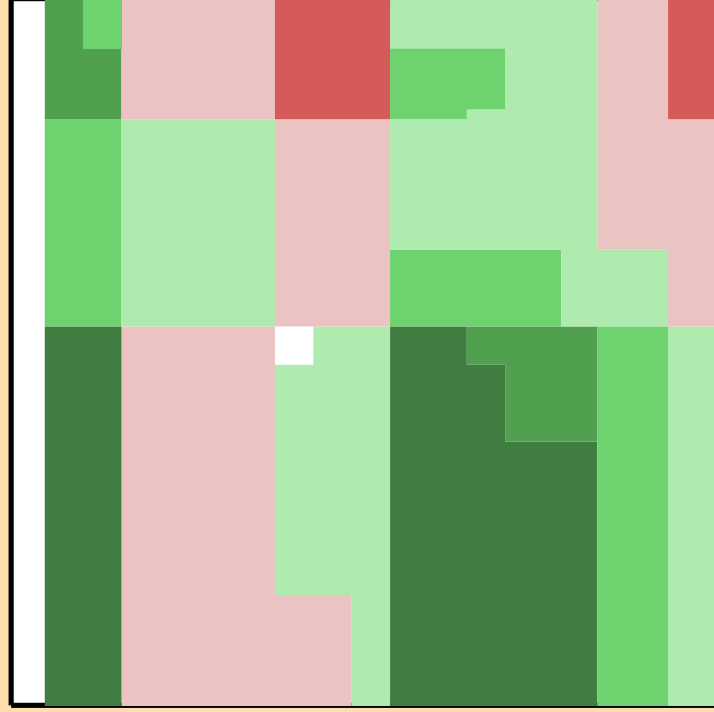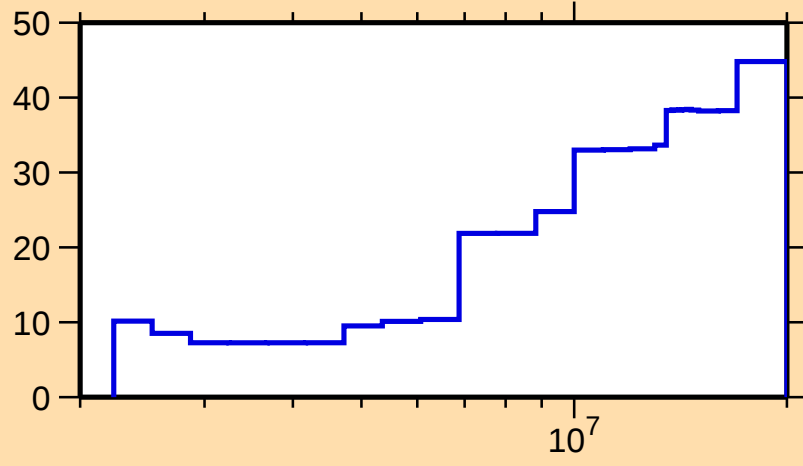

Correlation Matrix





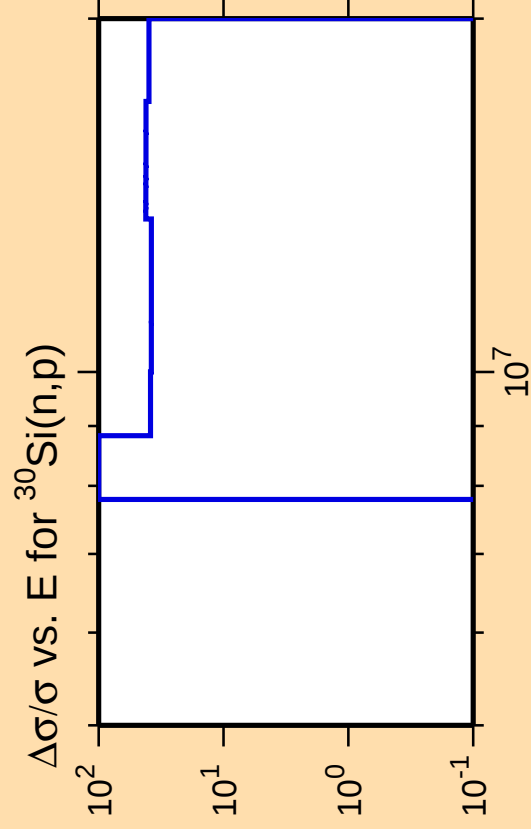

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

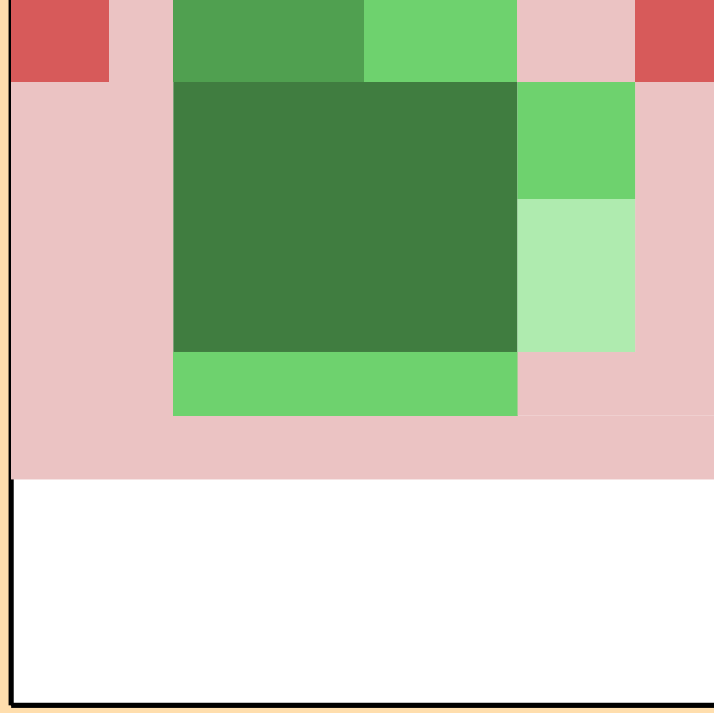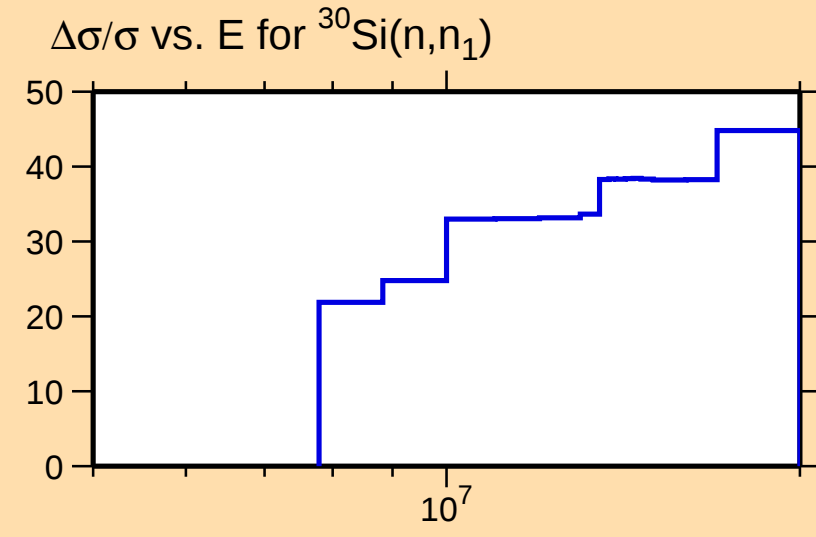

Correlation Matrix




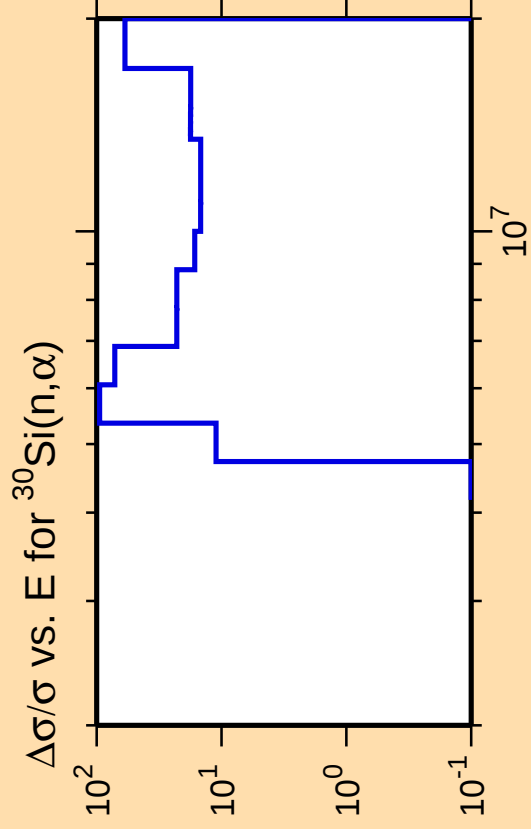


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).




Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n_1)$

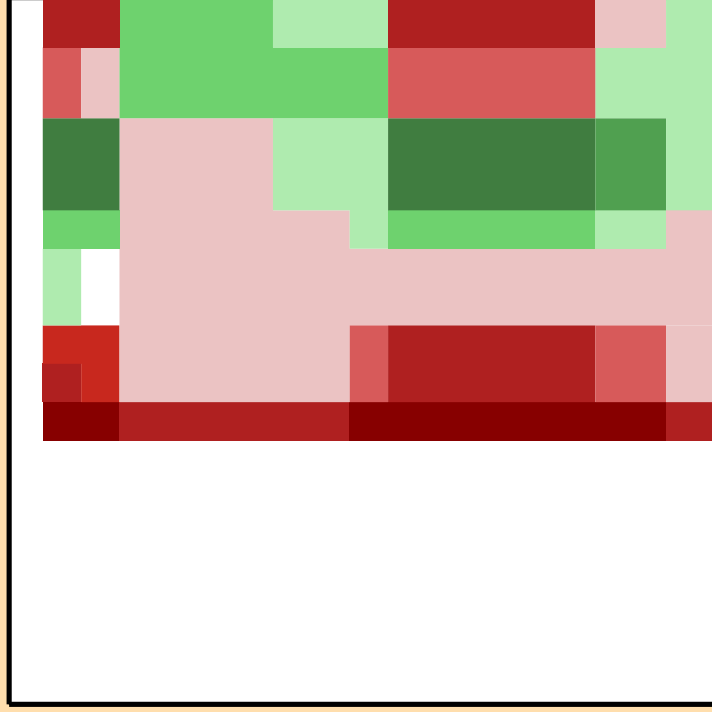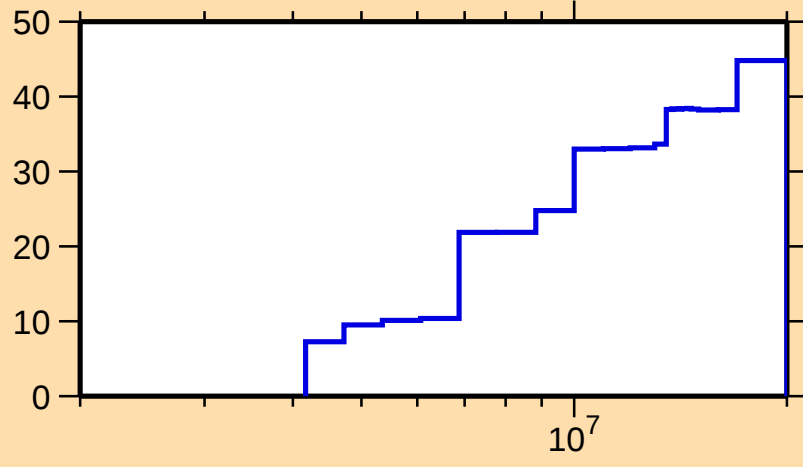


Correlation Matrix

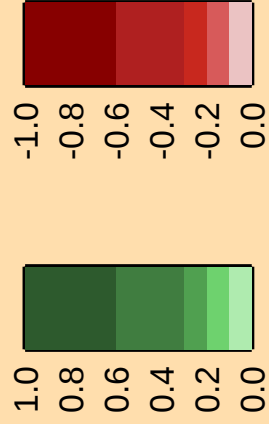

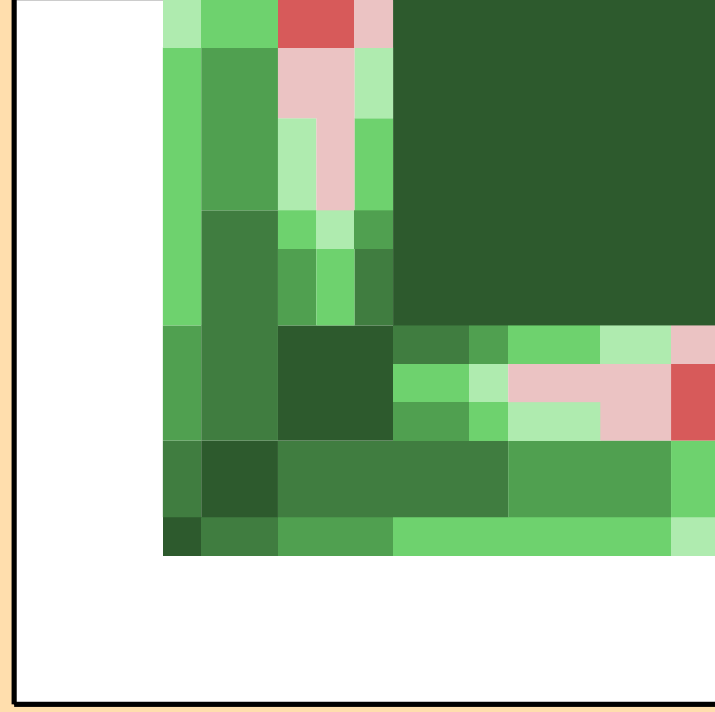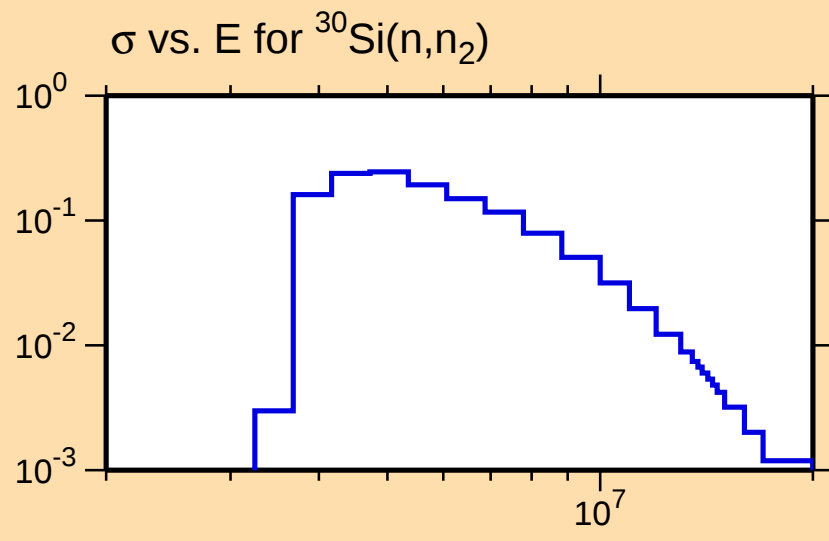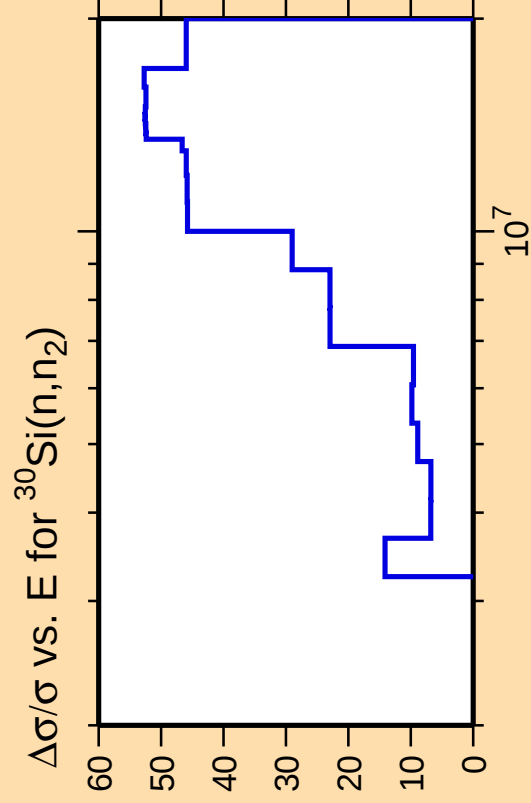



Correlation Matrix



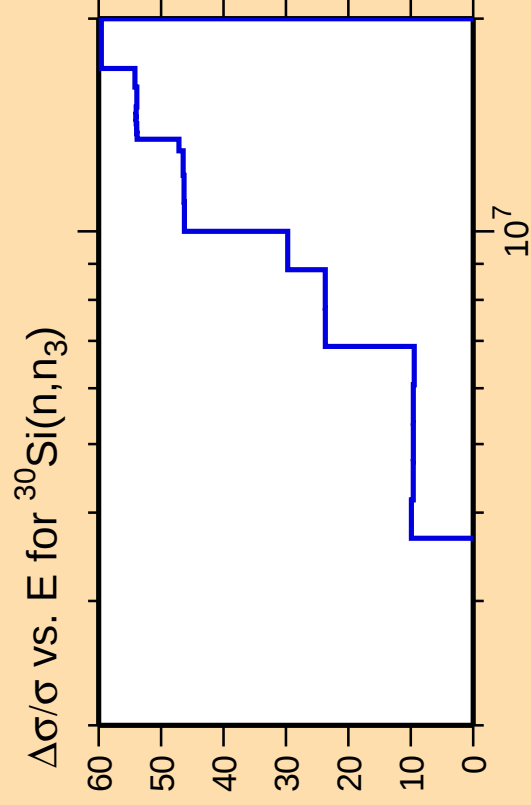


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

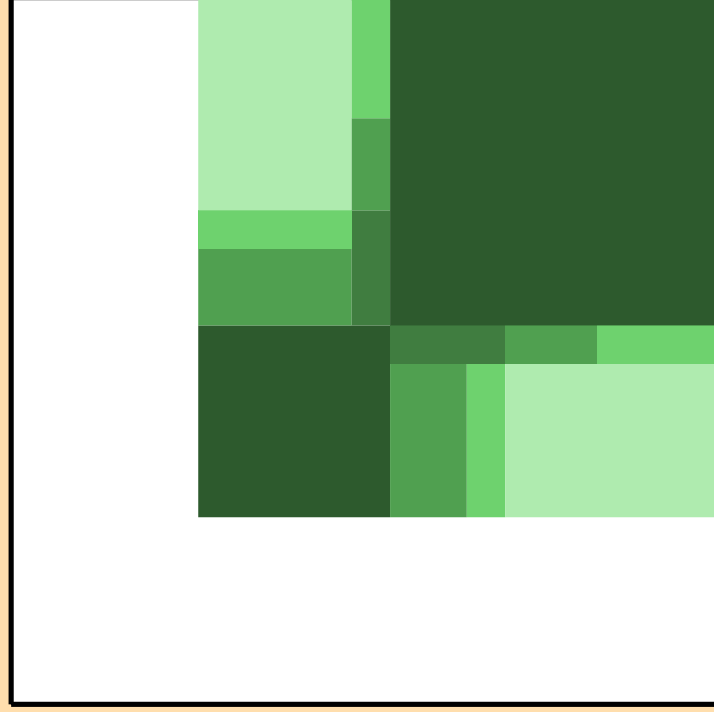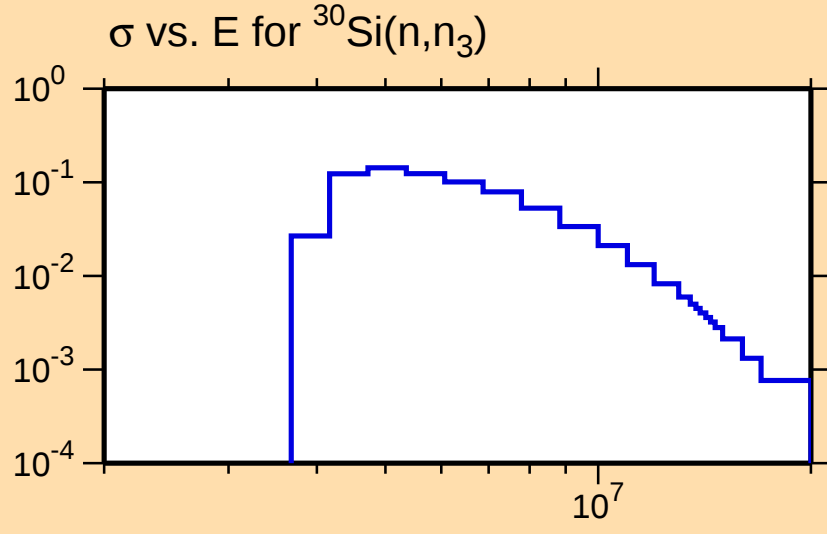



Correlation Matrix



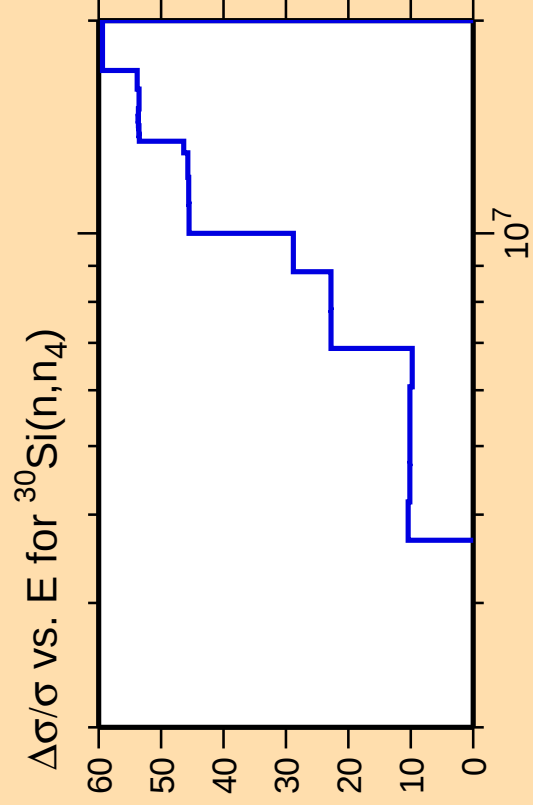

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

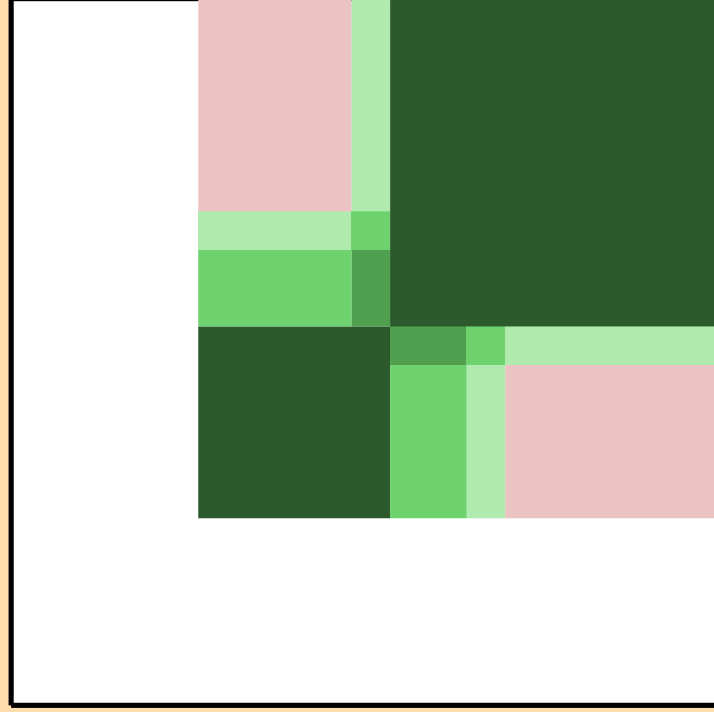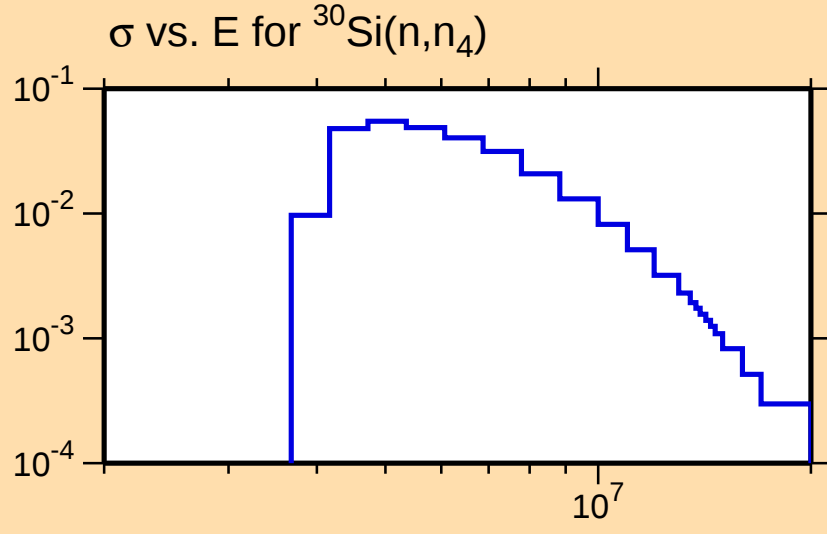

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n\text{cont.})$

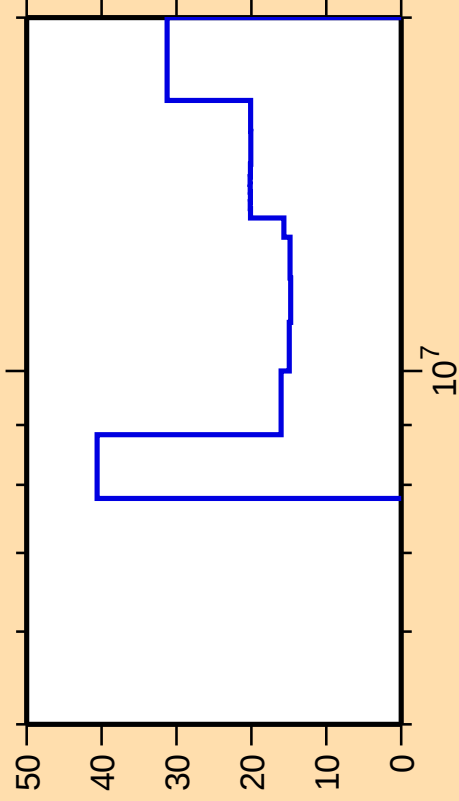

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Si}(n,n\text{cont.})$

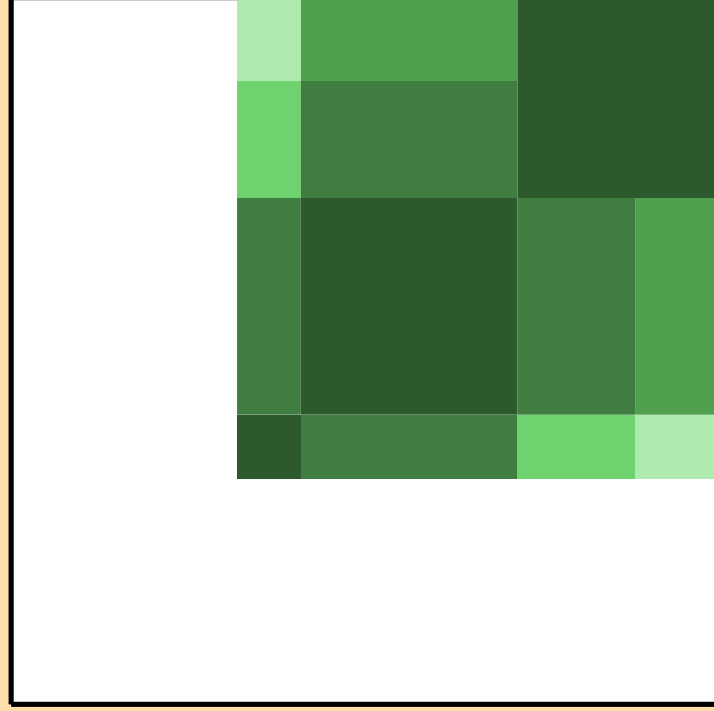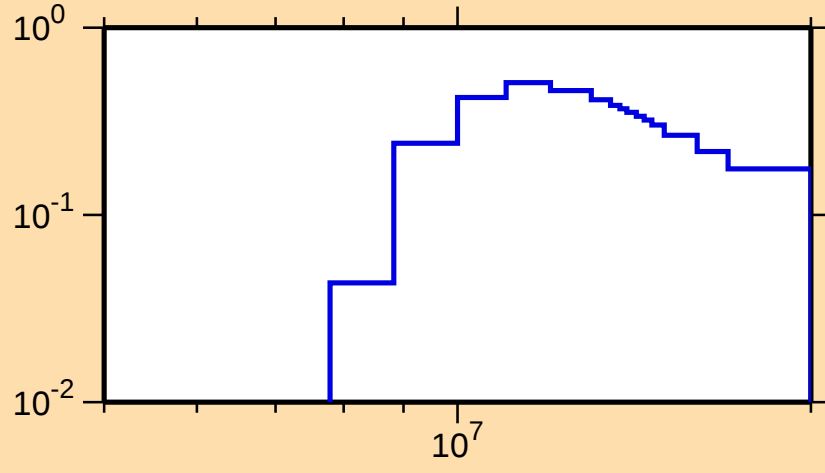

Correlation Matrix





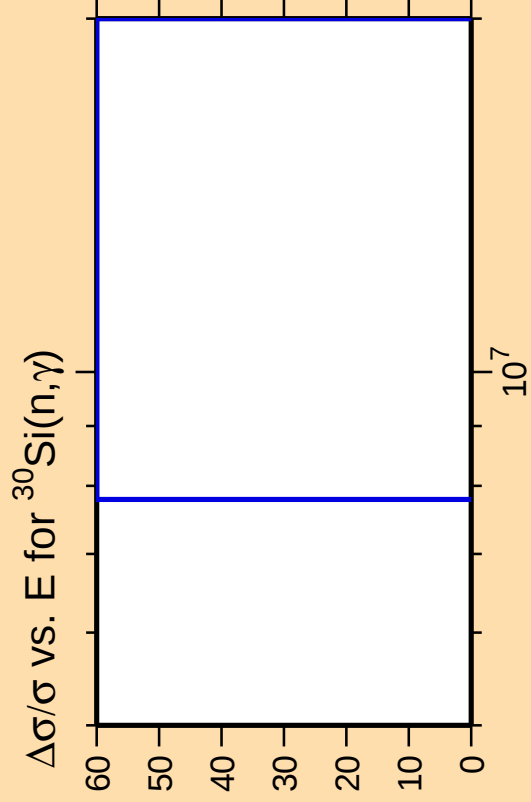


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

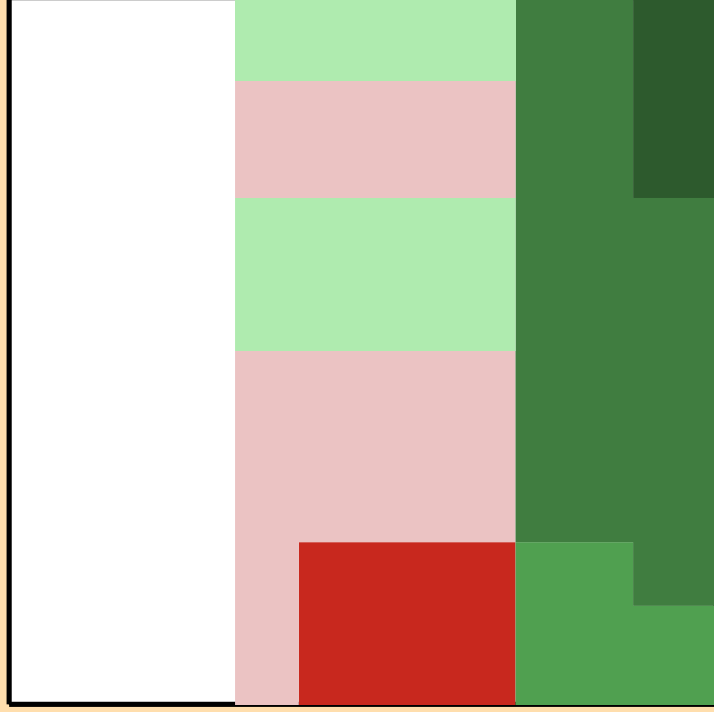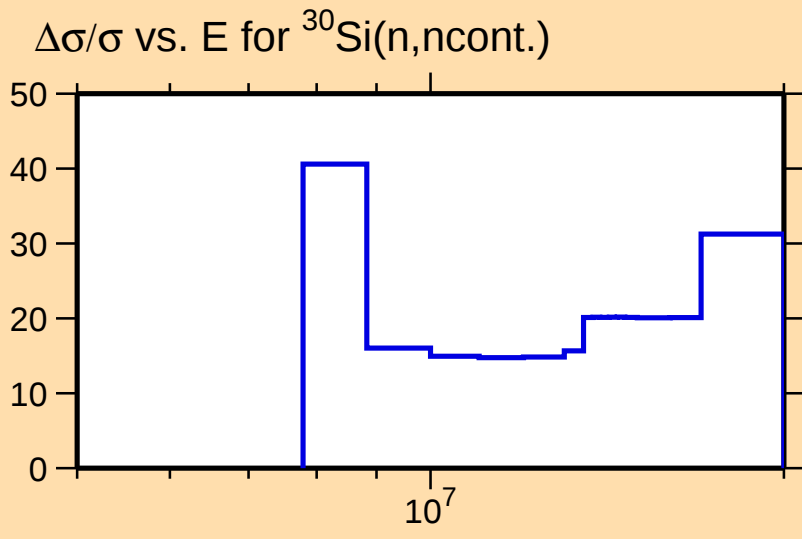

Correlation Matrix


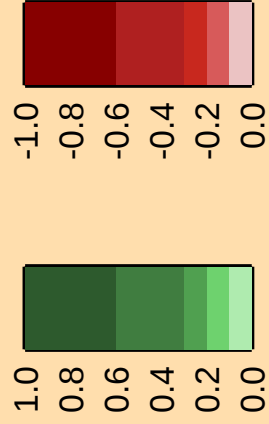


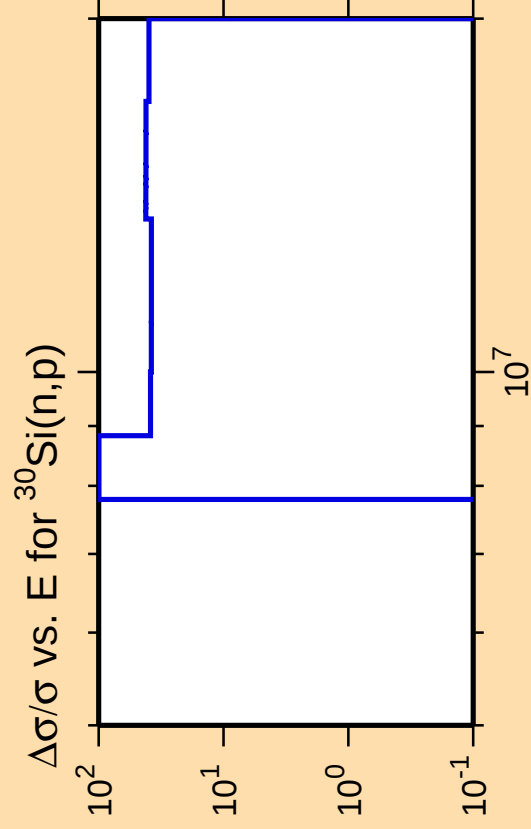

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

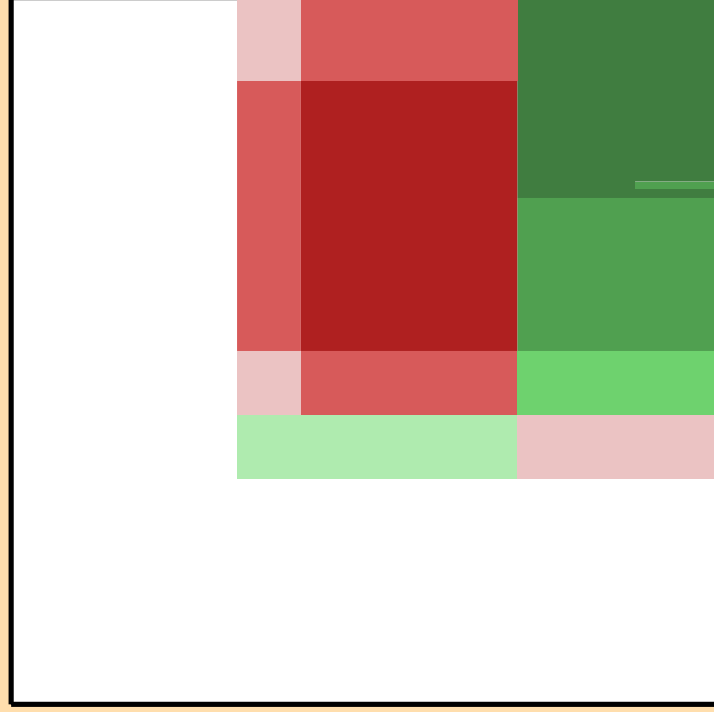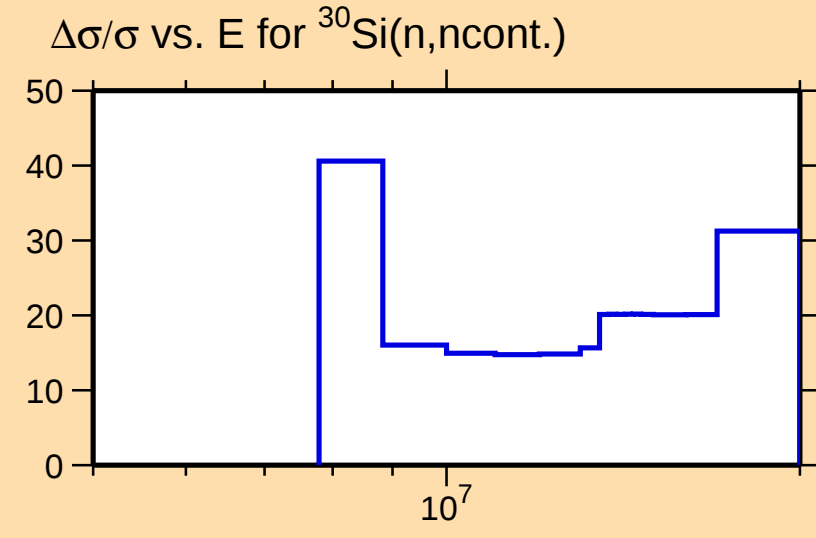

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\alpha)$

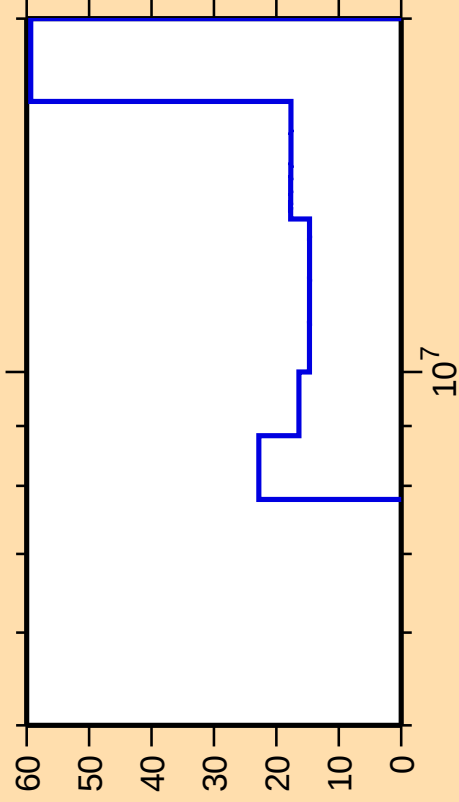

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,n\text{cont.})$

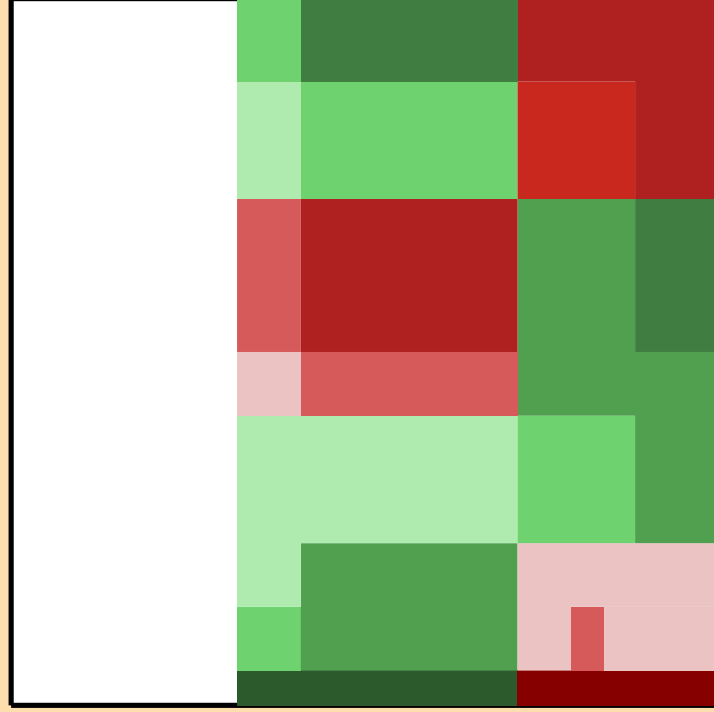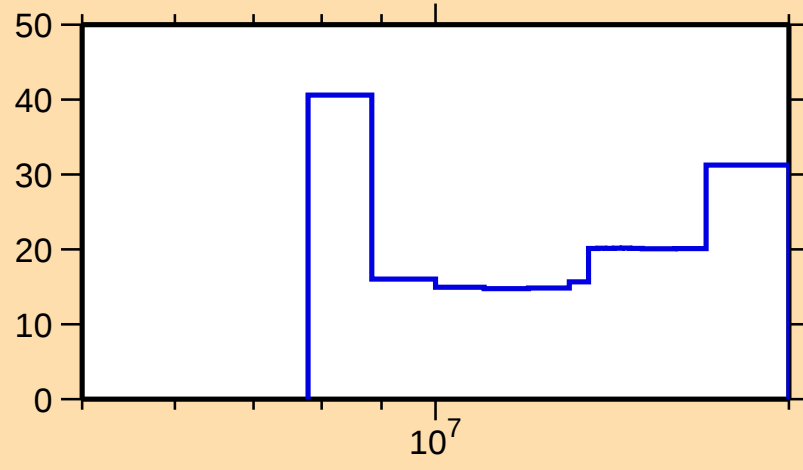

Correlation Matrix





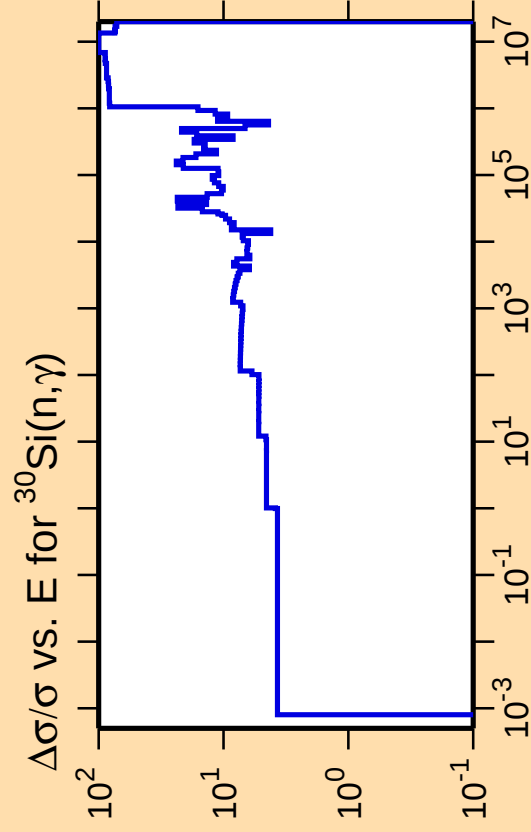

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

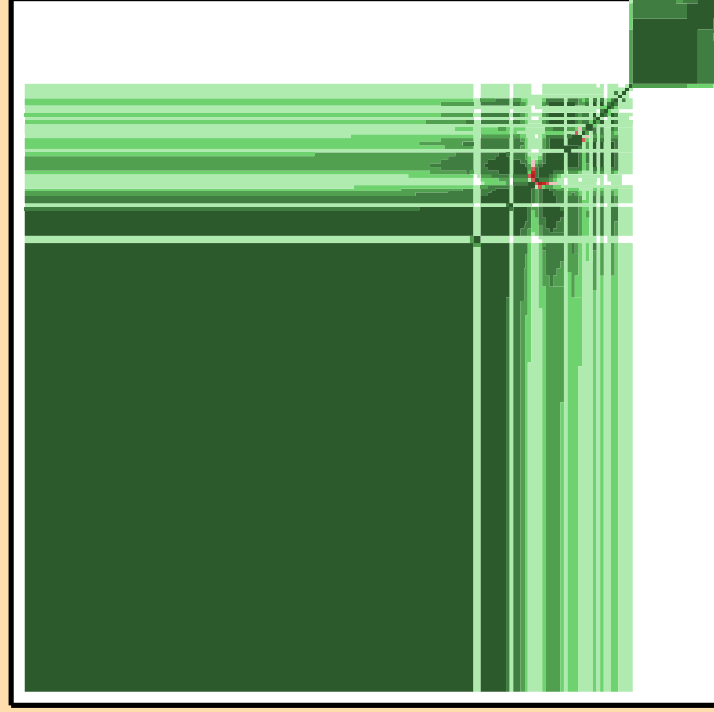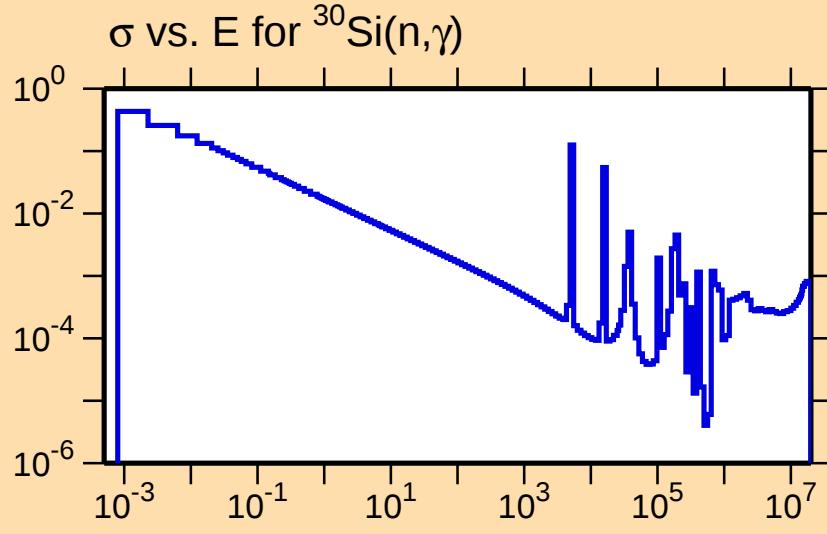

Correlation Matrix





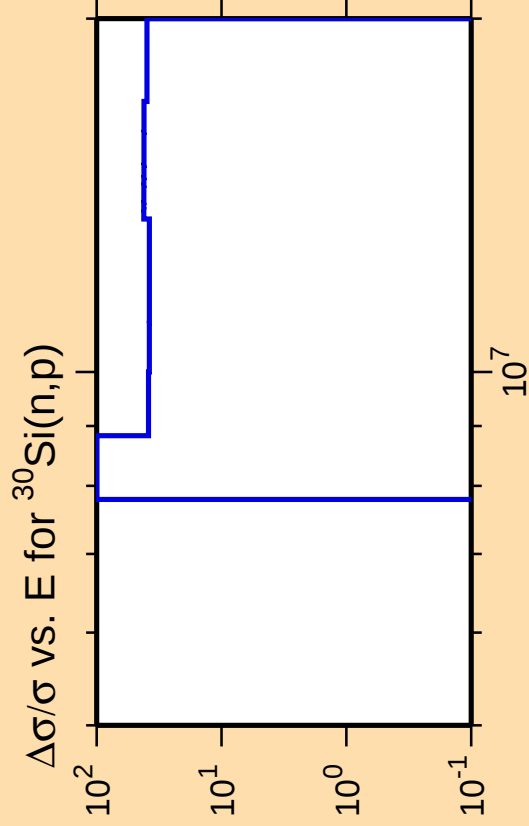


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

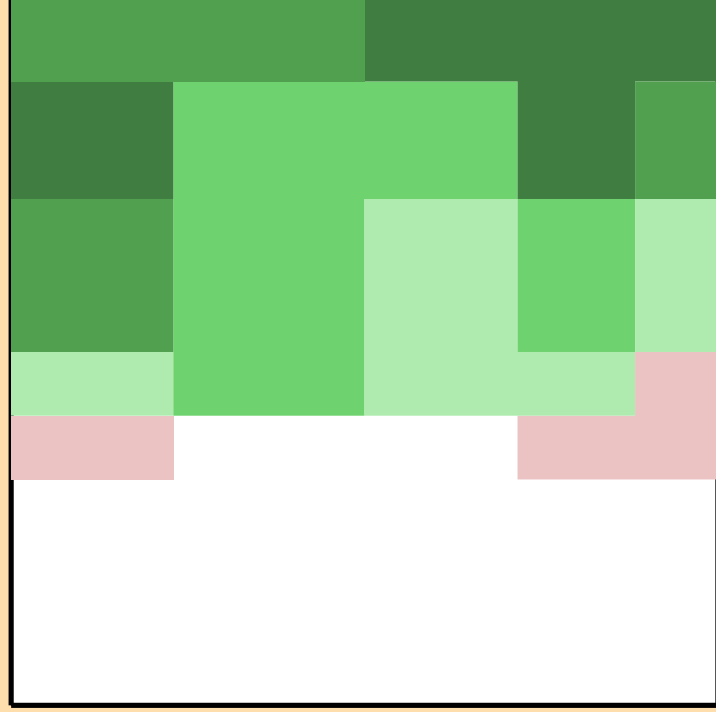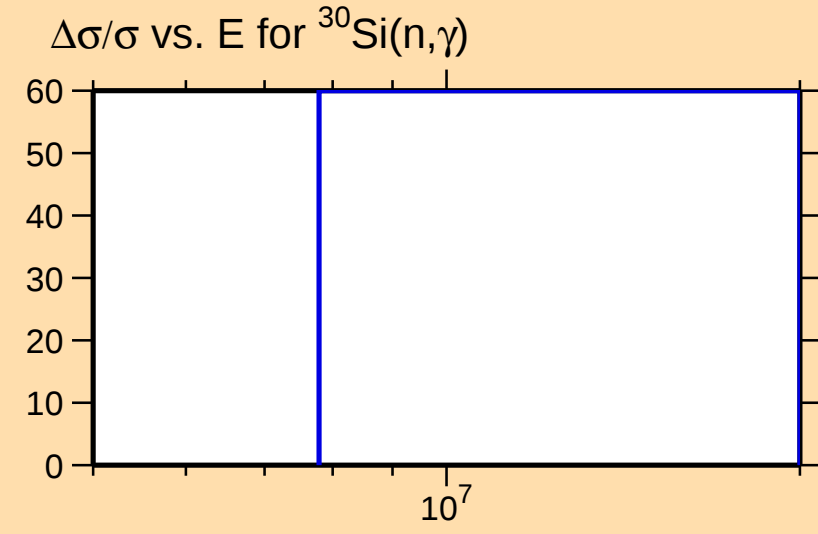


Correlation Matrix

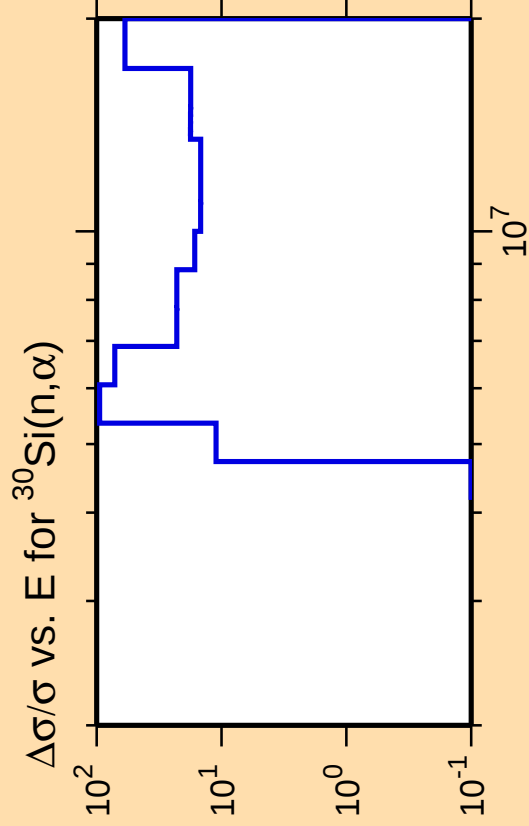


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

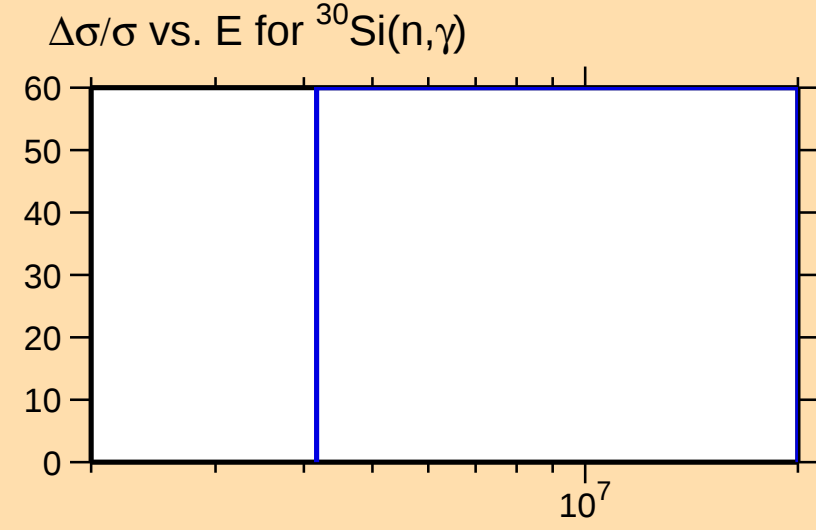

Correlation Matrix


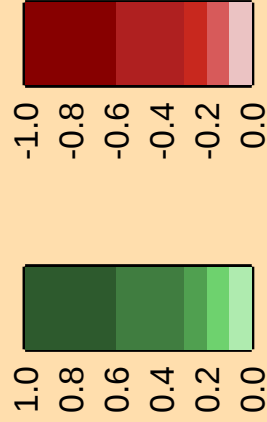


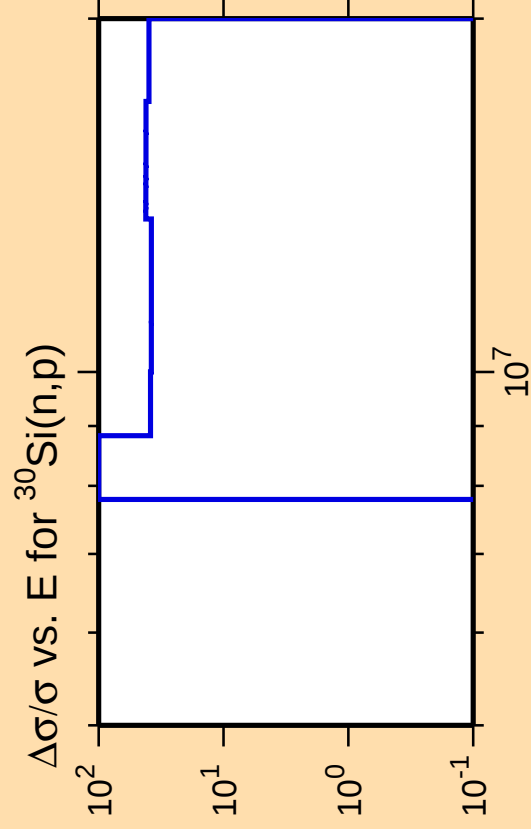

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

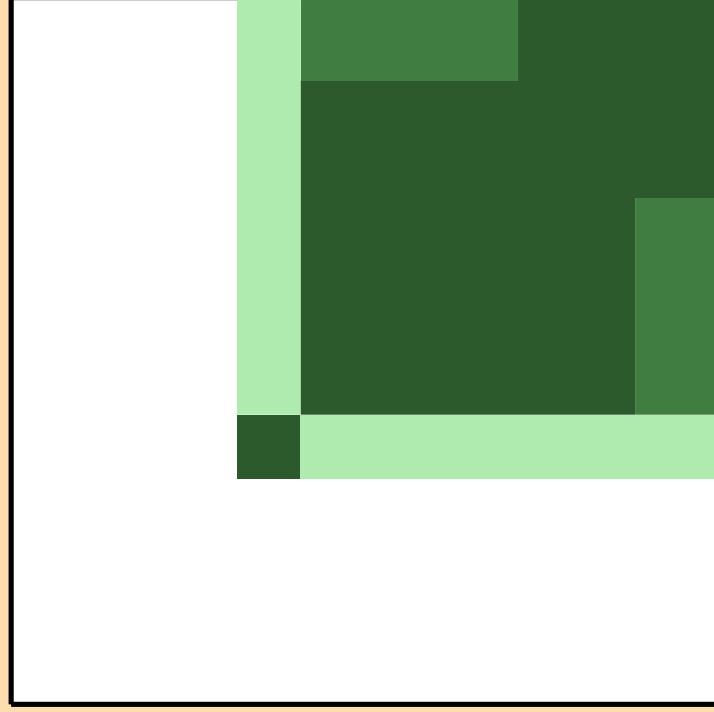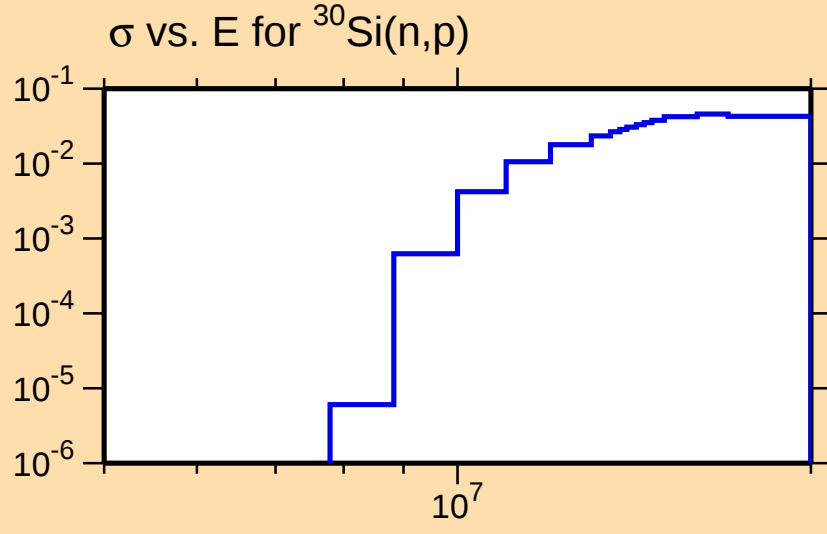

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\alpha)$


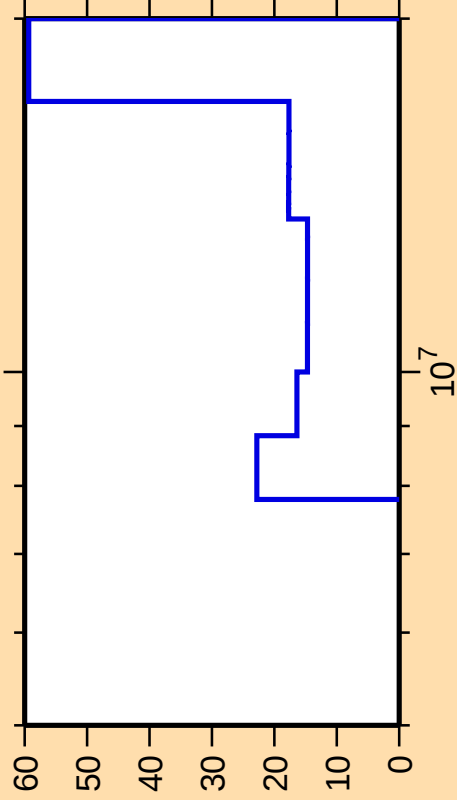


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,p)$

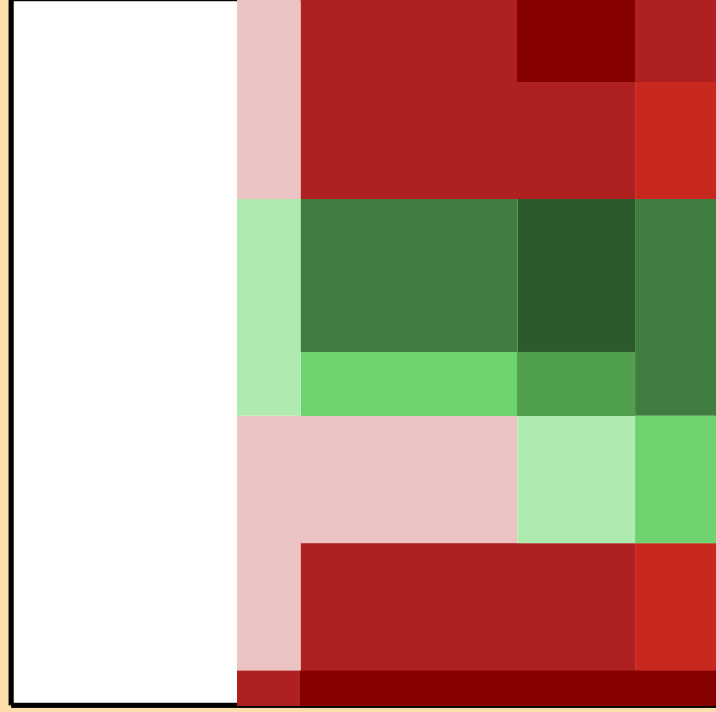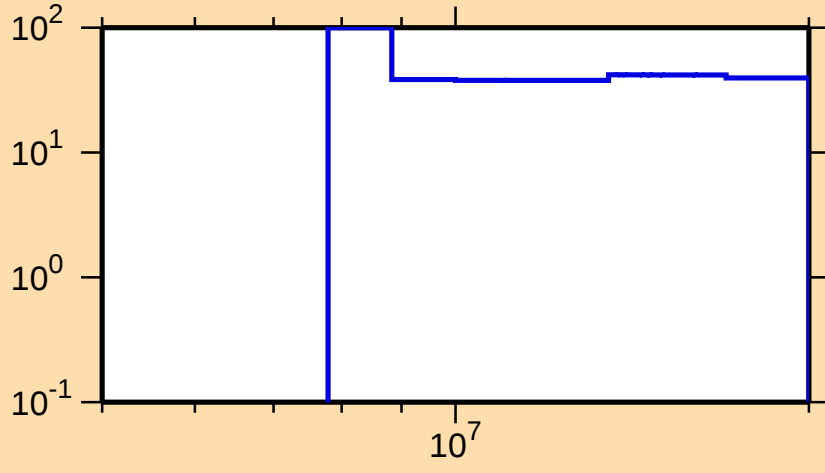

Correlation Matrix





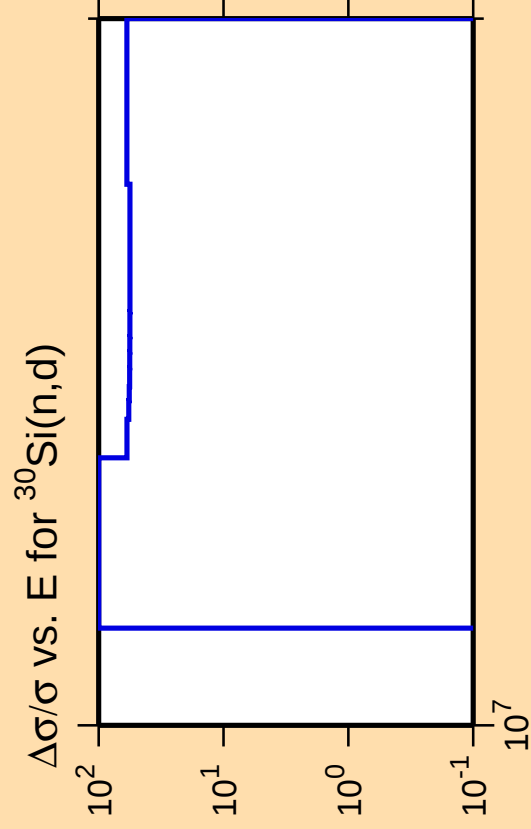

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

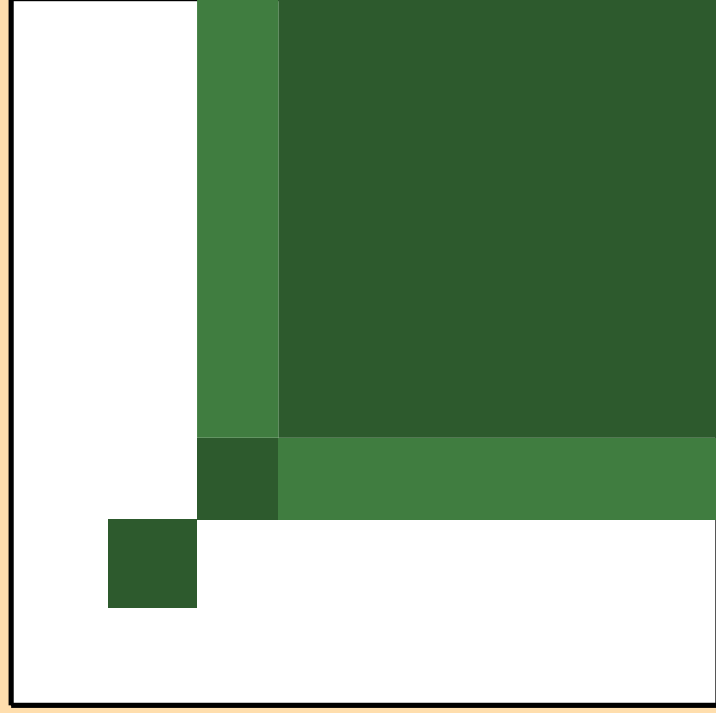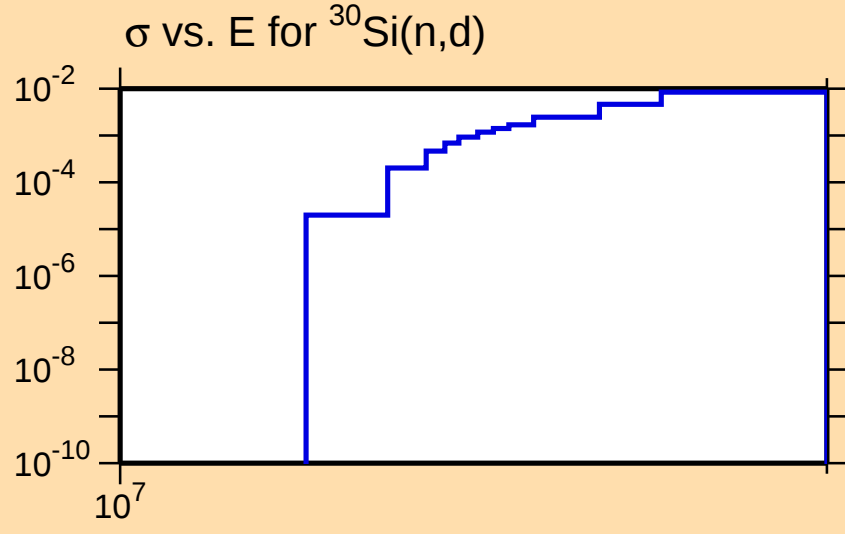

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,t)$


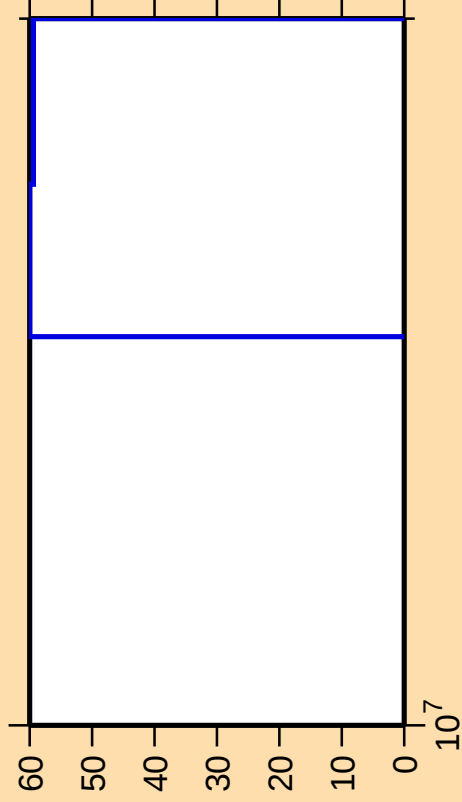


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{30}\text{Si}(n,t)$

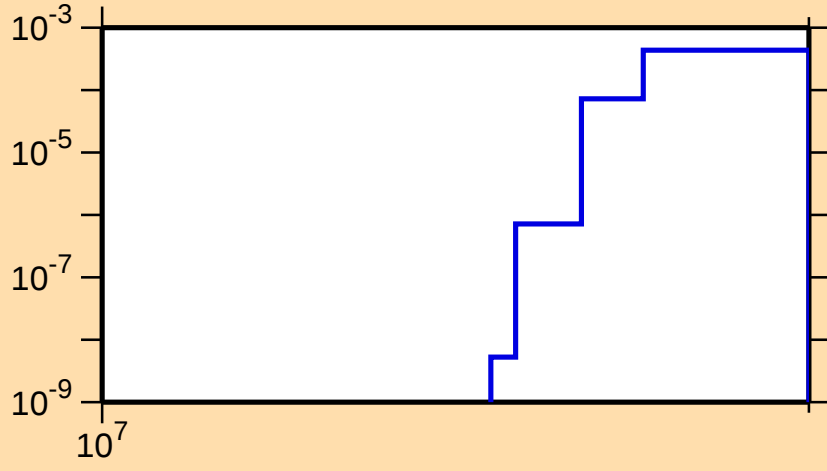

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,\text{He}3)$

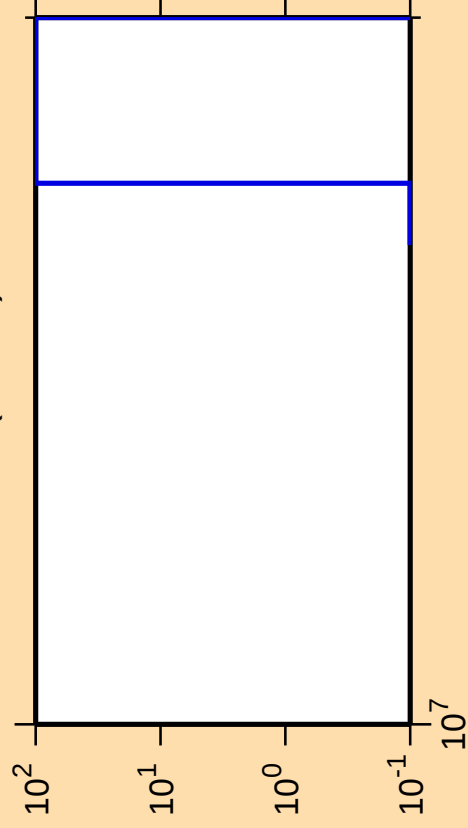


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{30}\text{Si}(n,\text{He}3)$

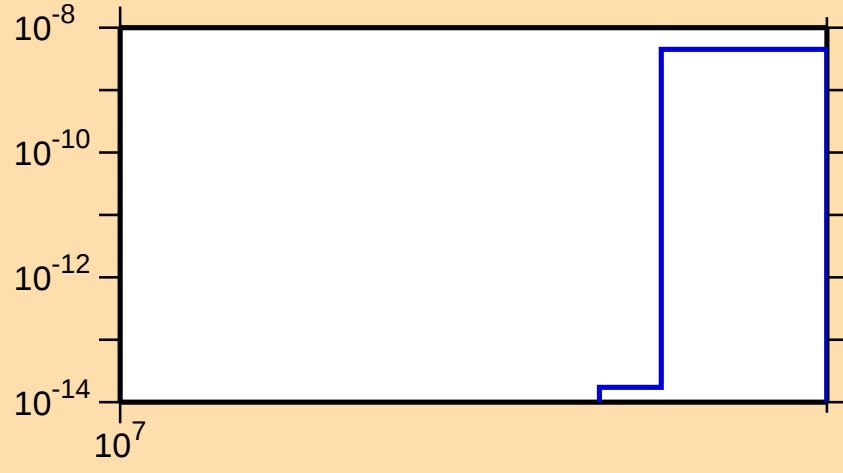


10^7



Correlation Matrix

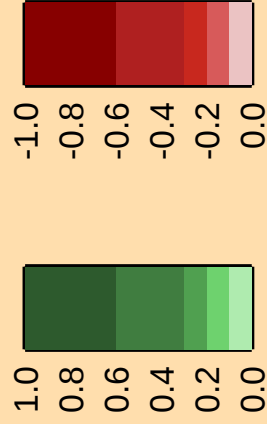


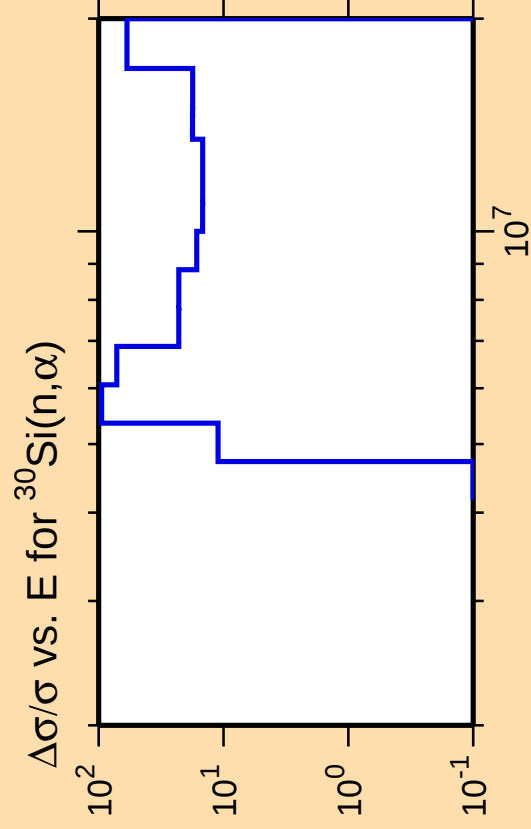

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

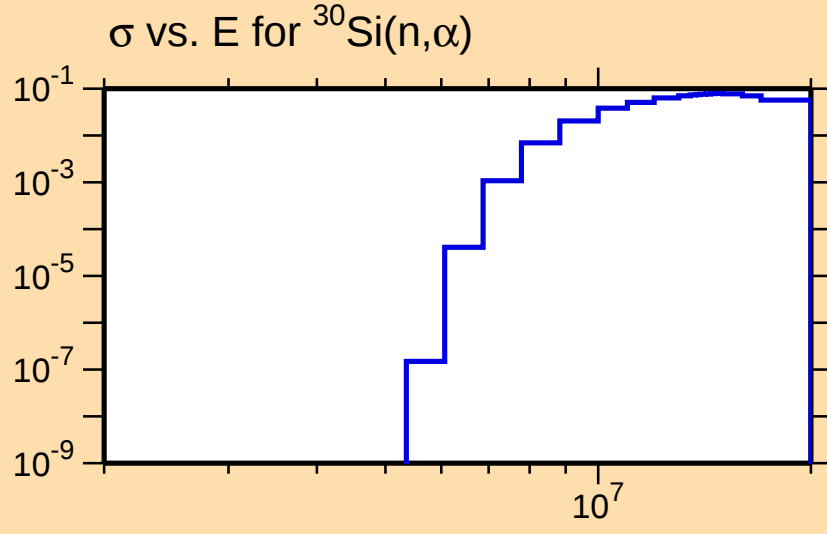

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Si}(n,p\alpha)$

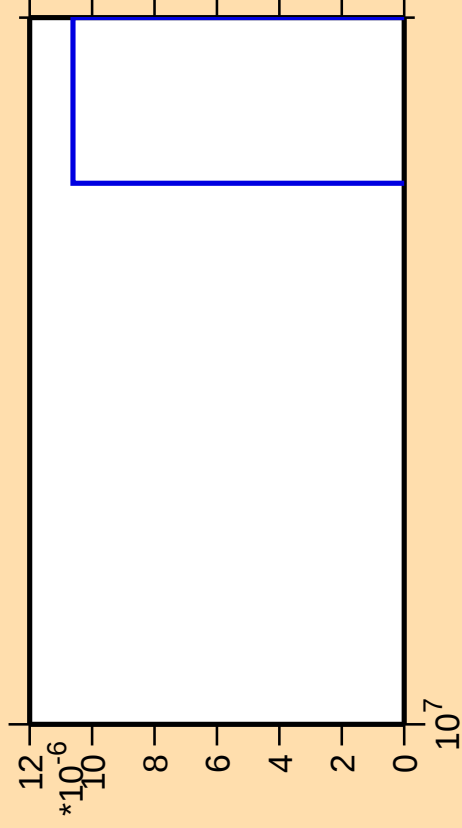

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Si}(n,p\alpha)$



Correlation Matrix

