




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

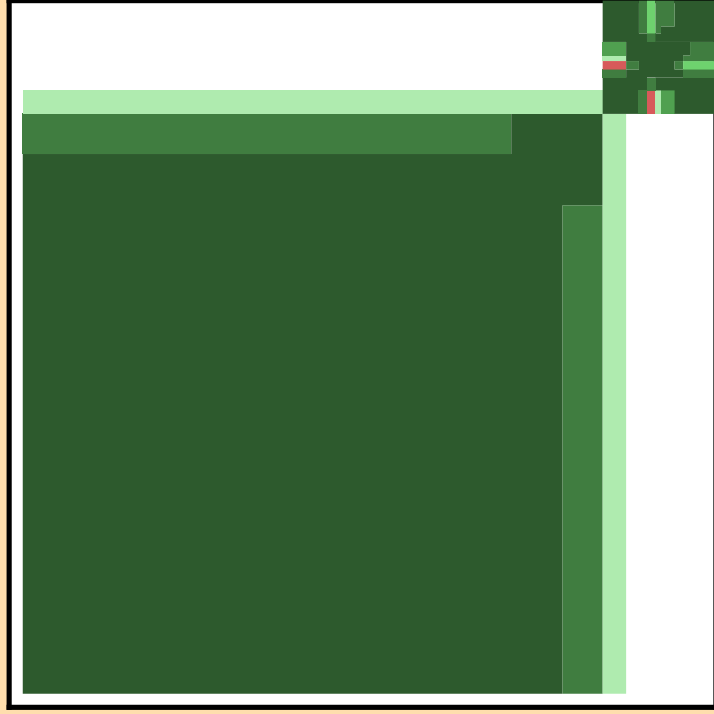

Correlation Matrix


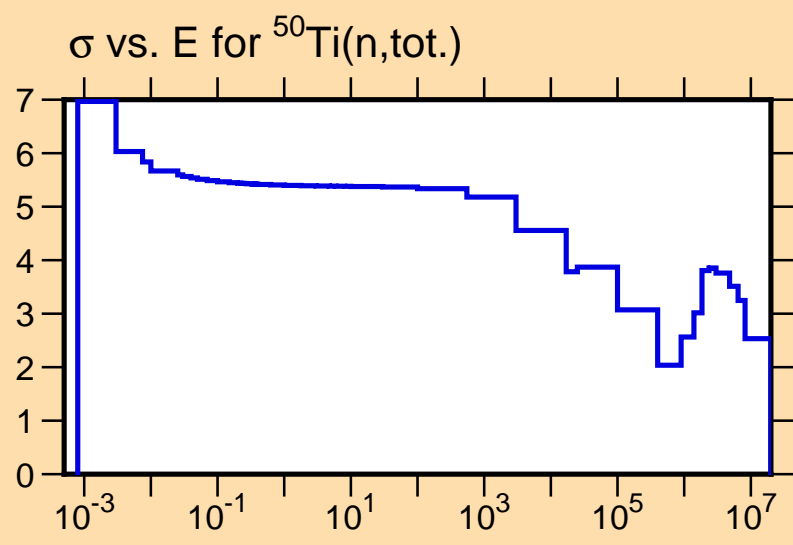


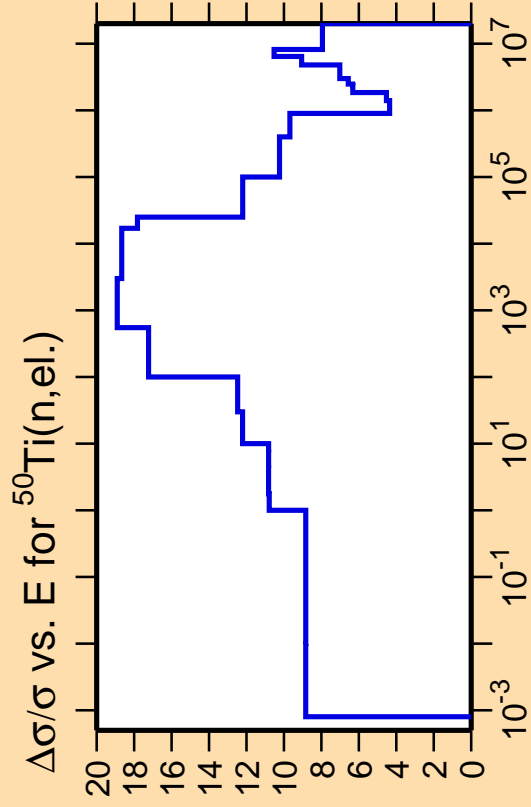

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

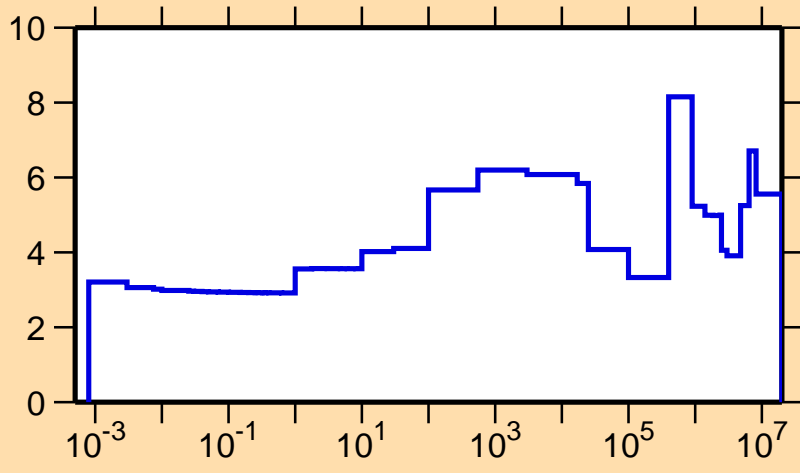

Correlation Matrix




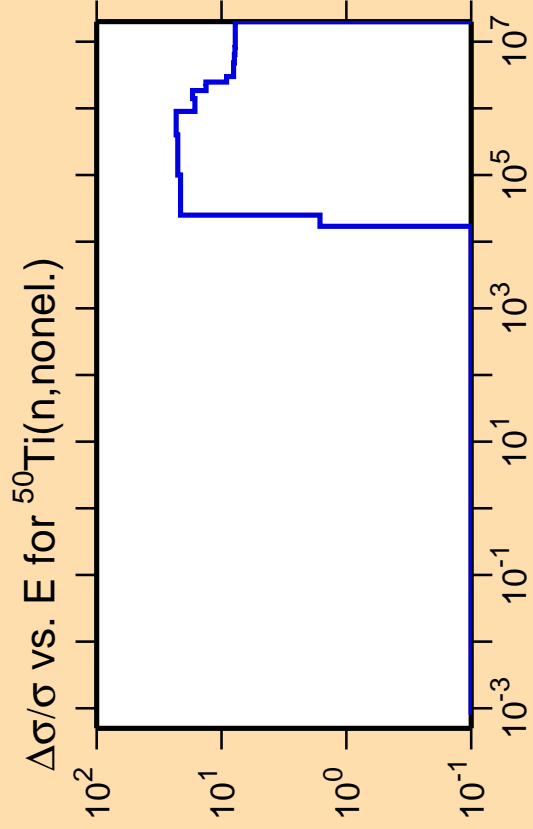


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

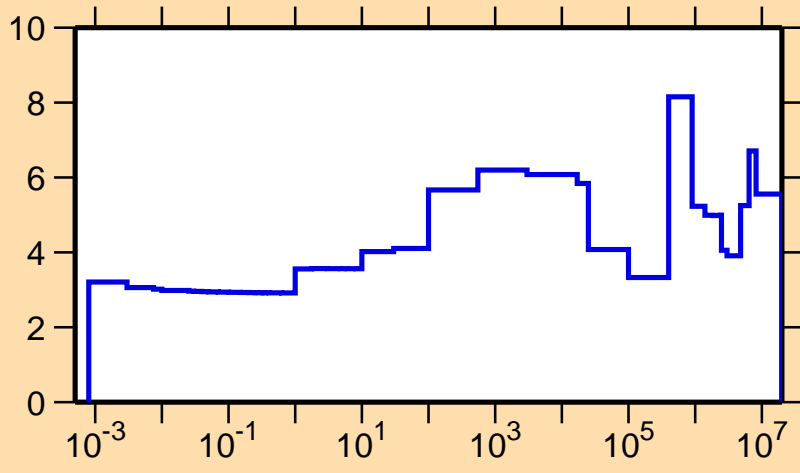

Correlation Matrix




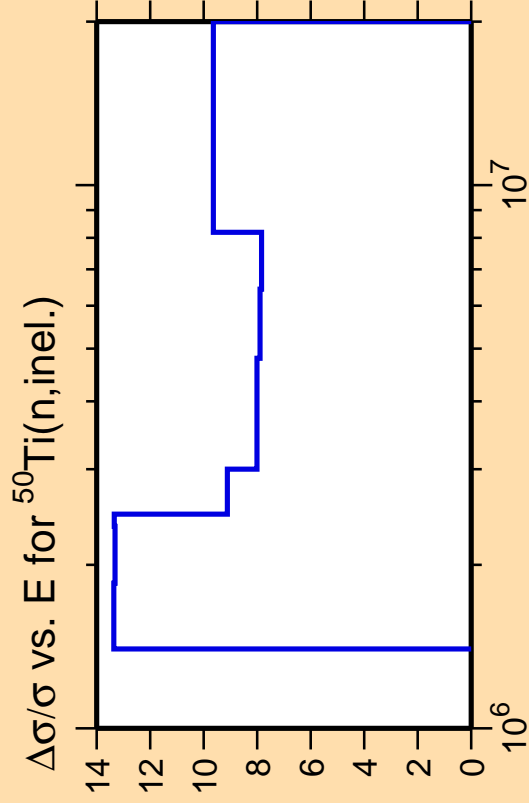

Ordinate scale is %  
relative standard deviation.

Abcissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

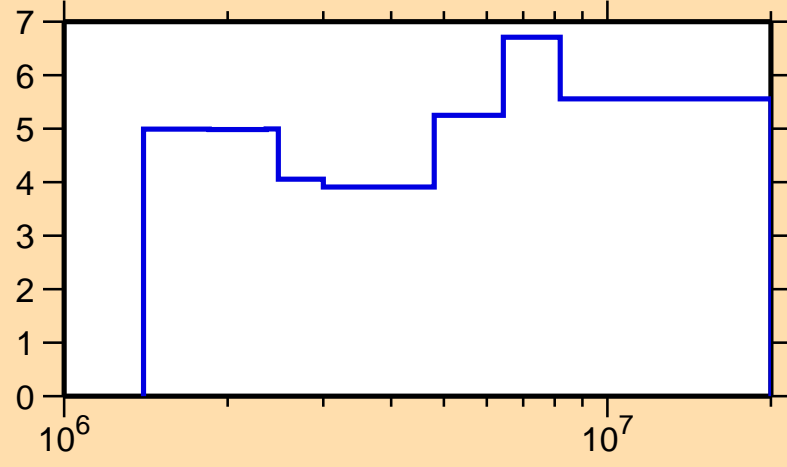



Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

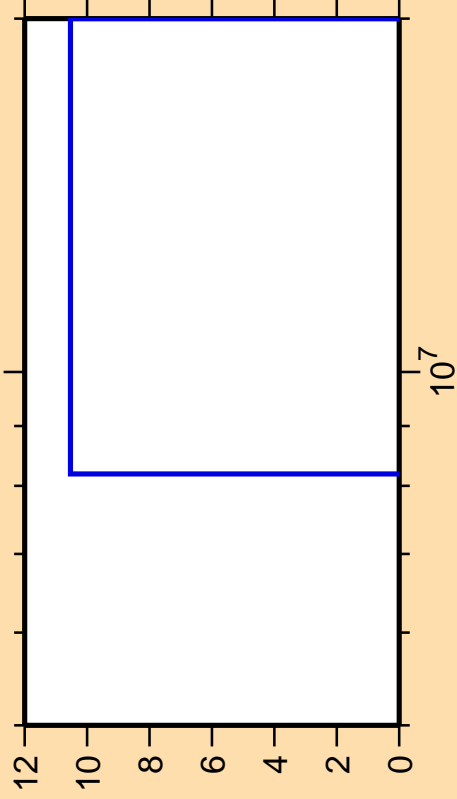


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

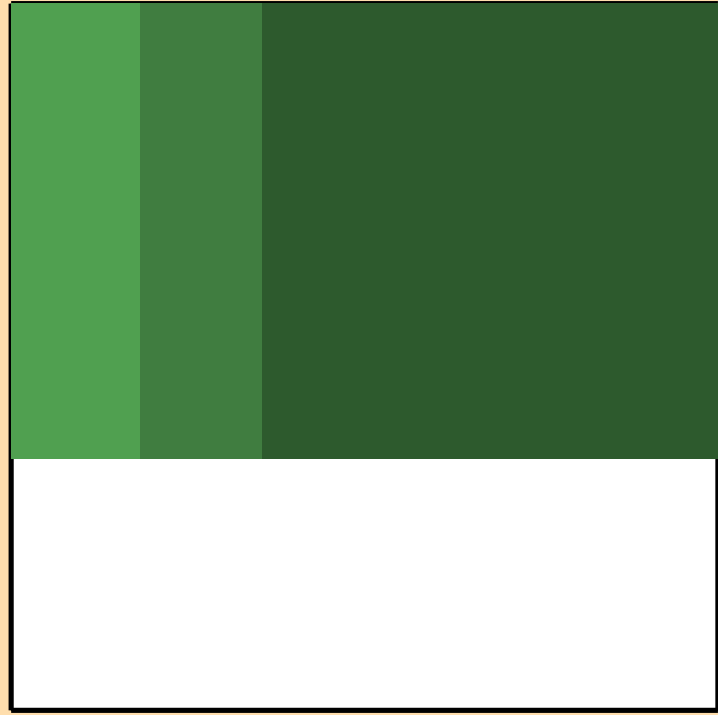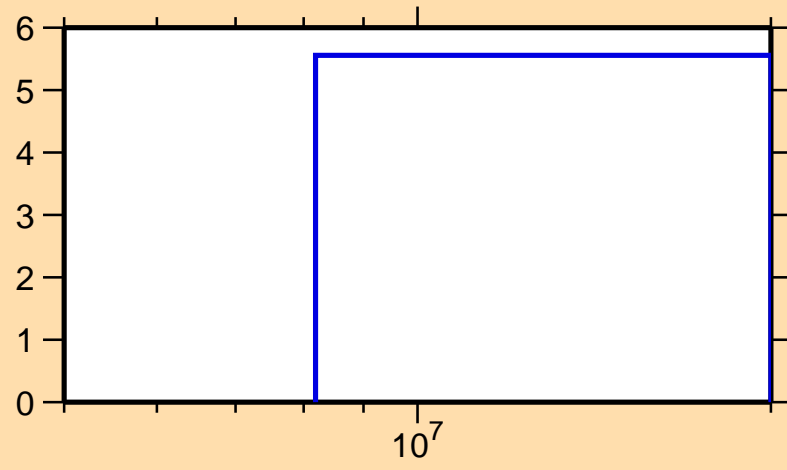

Correlation Matrix


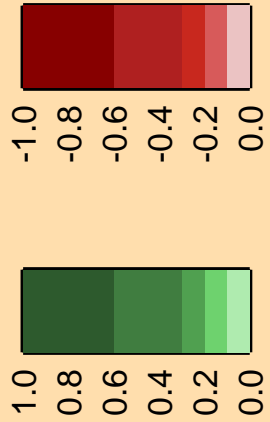


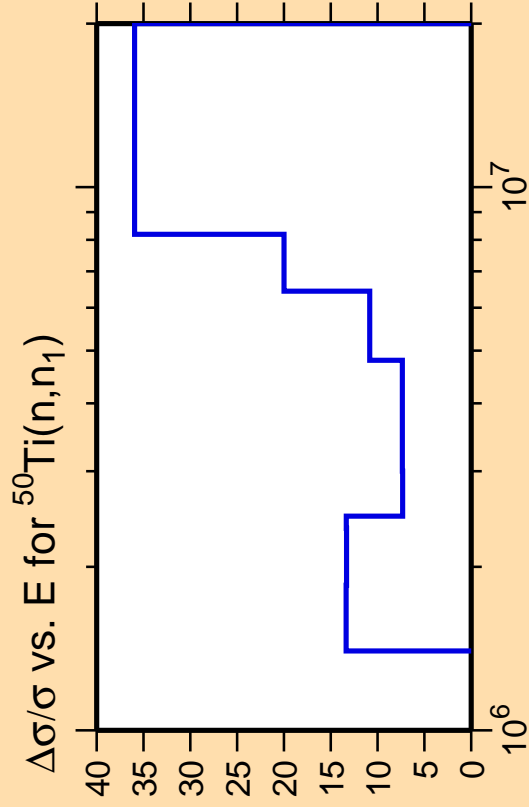

Ordinate scale is %  
relative standard deviation.


Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

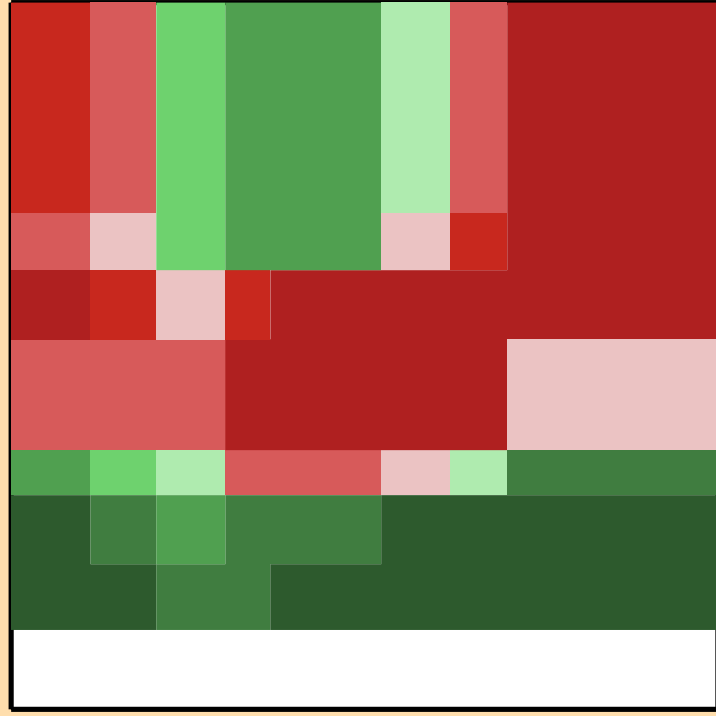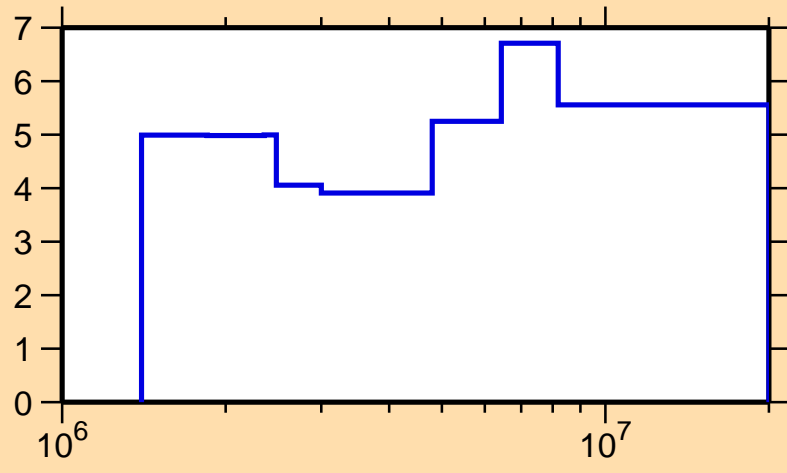

Correlation Matrix





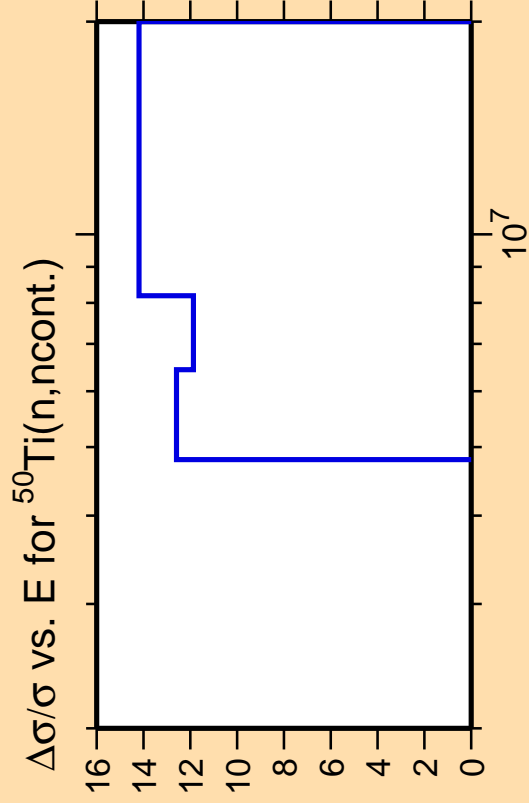

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

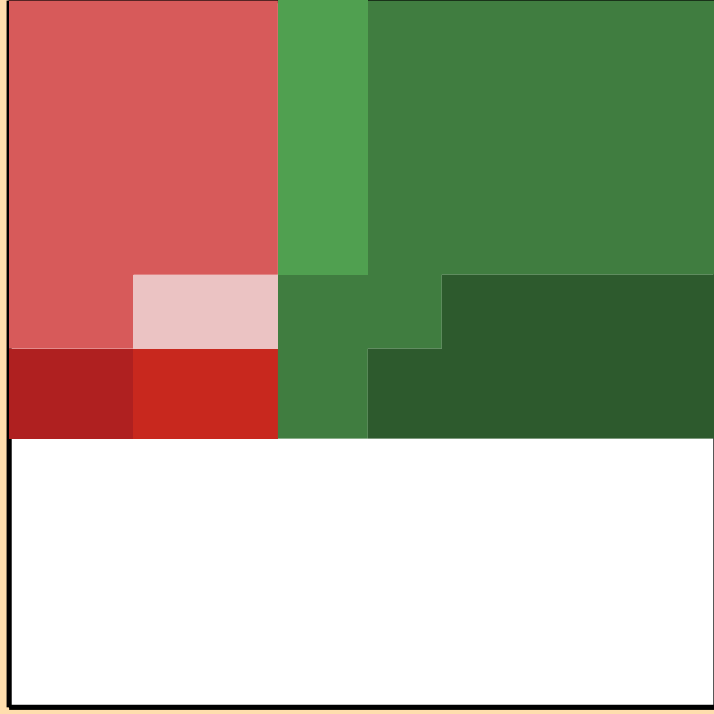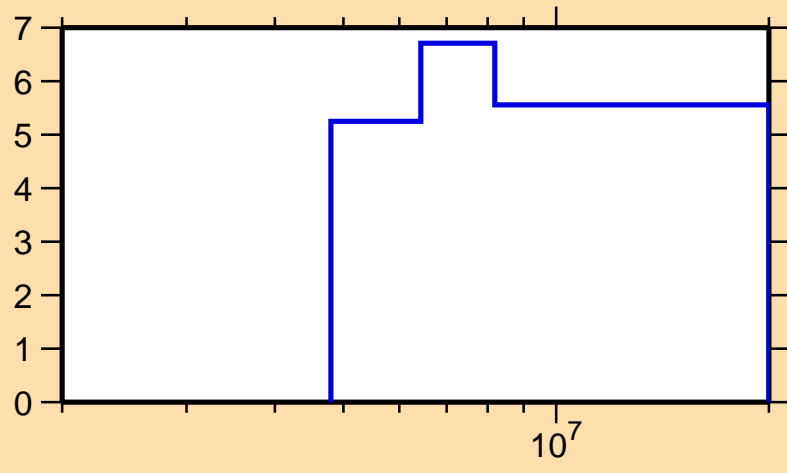

Correlation Matrix




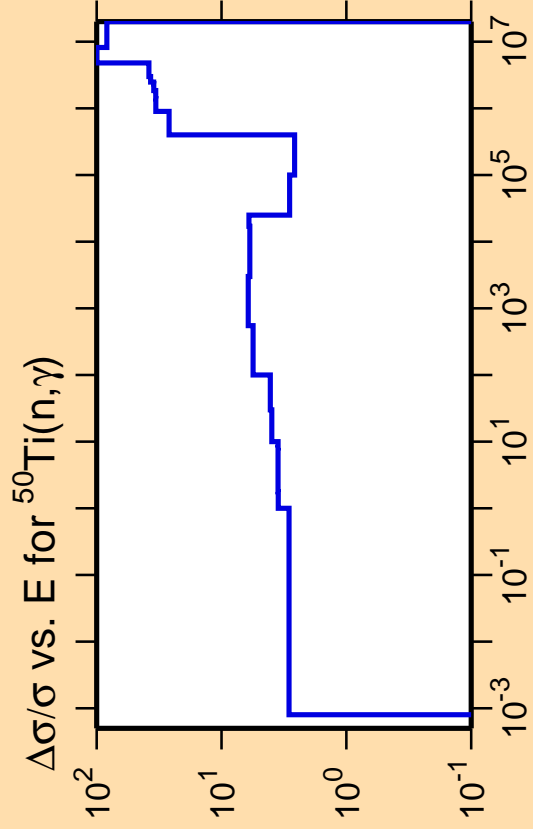


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

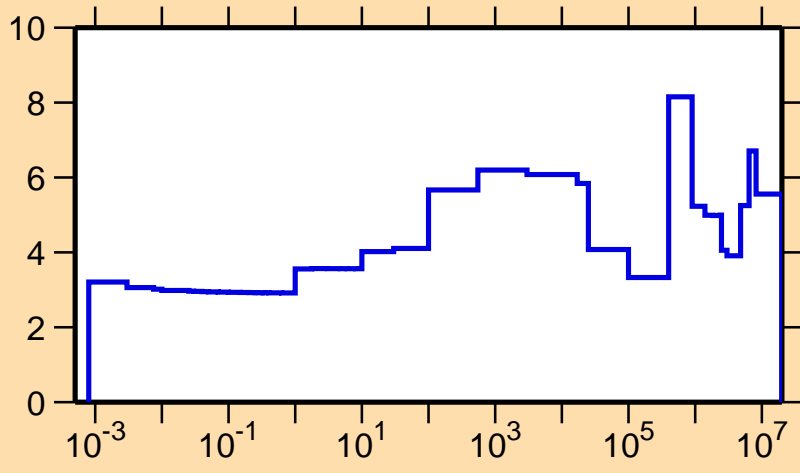

Correlation Matrix






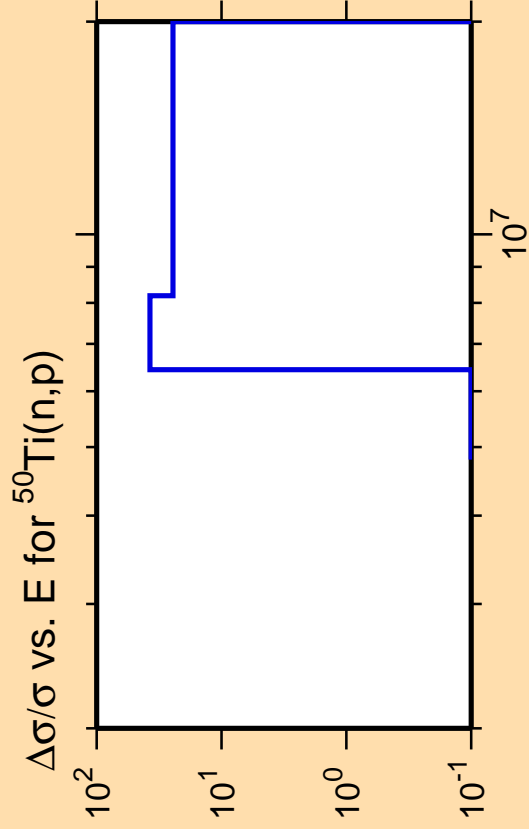


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

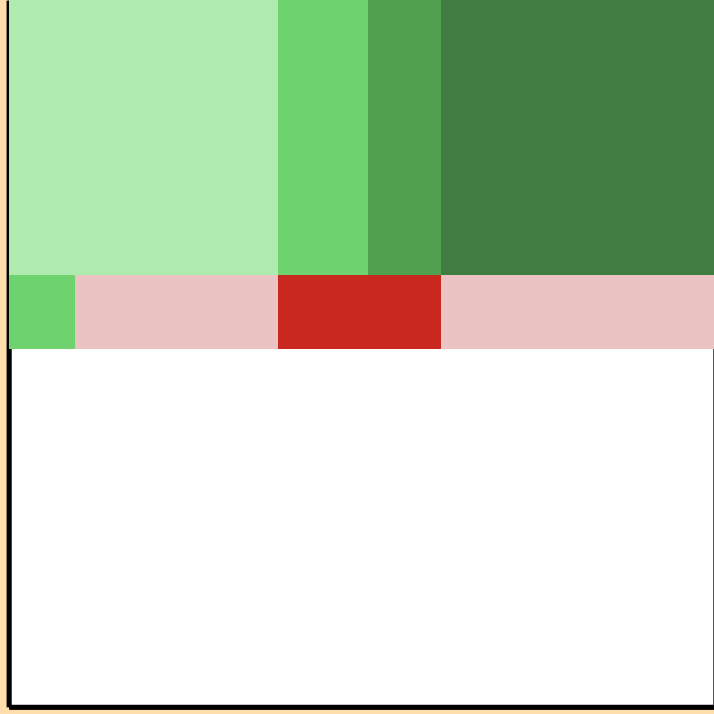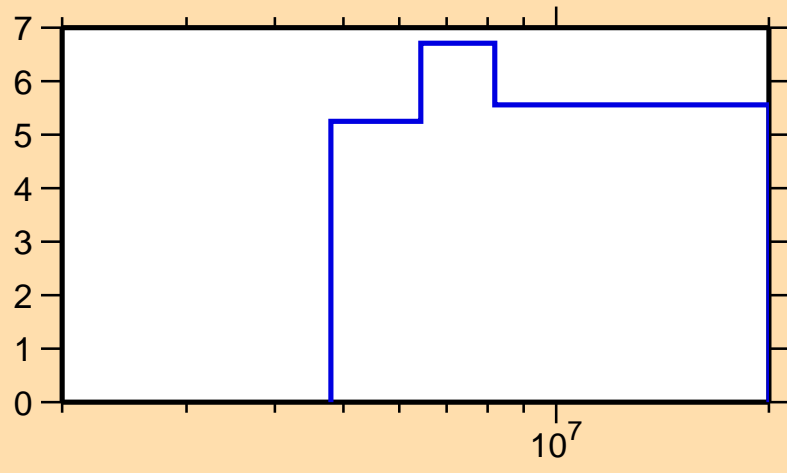

Correlation Matrix




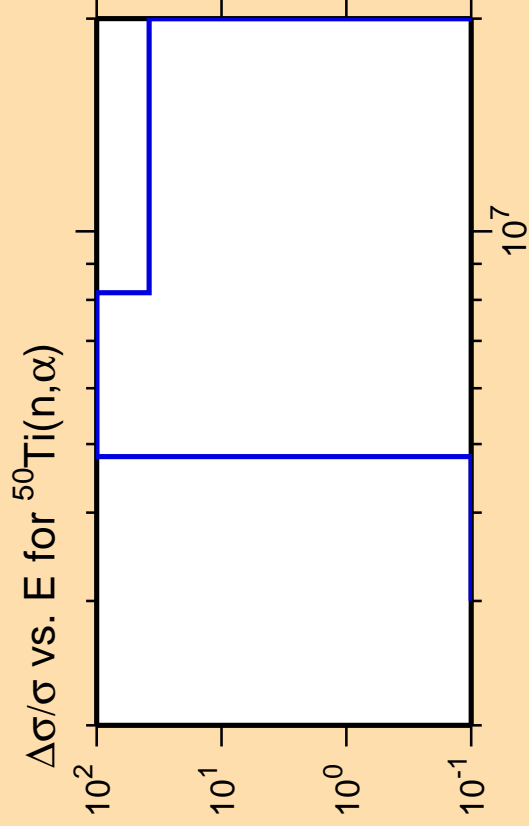


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

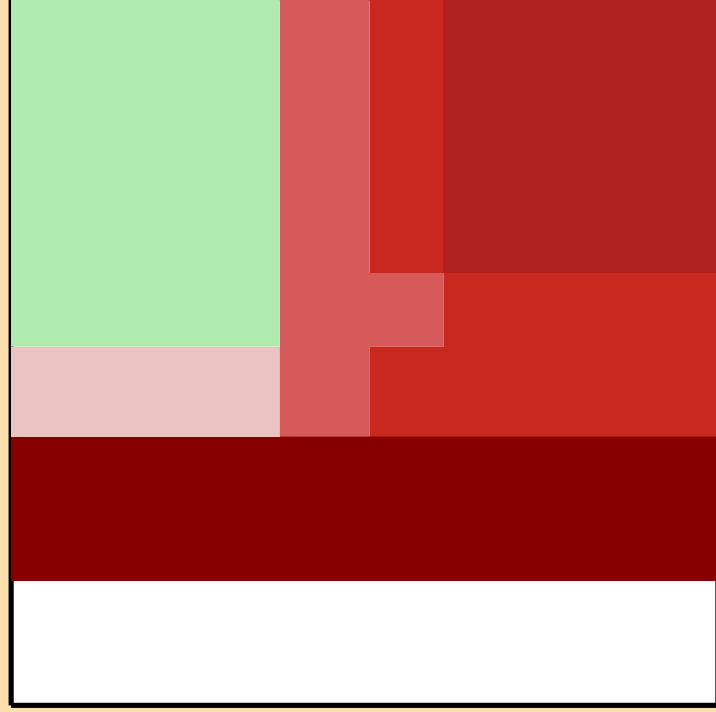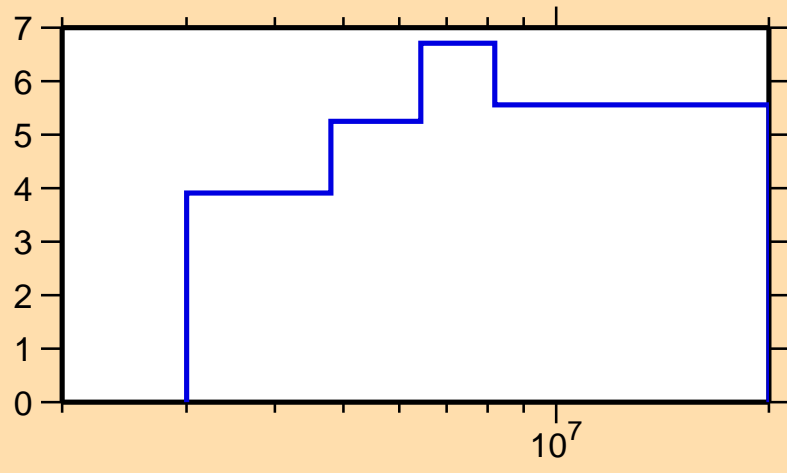

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

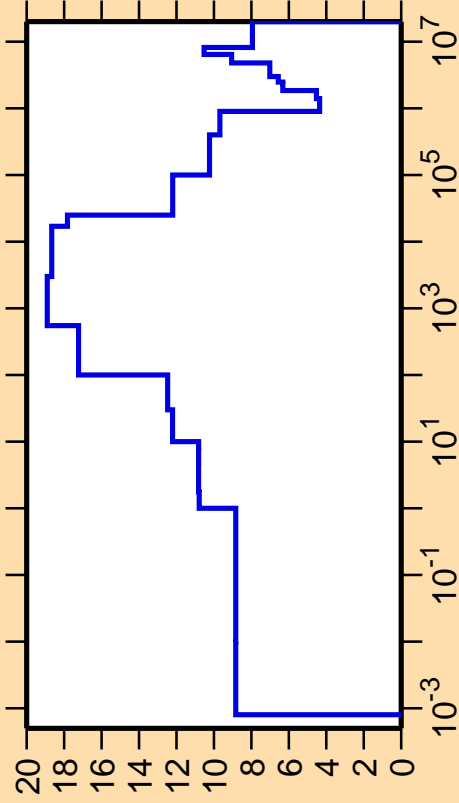

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

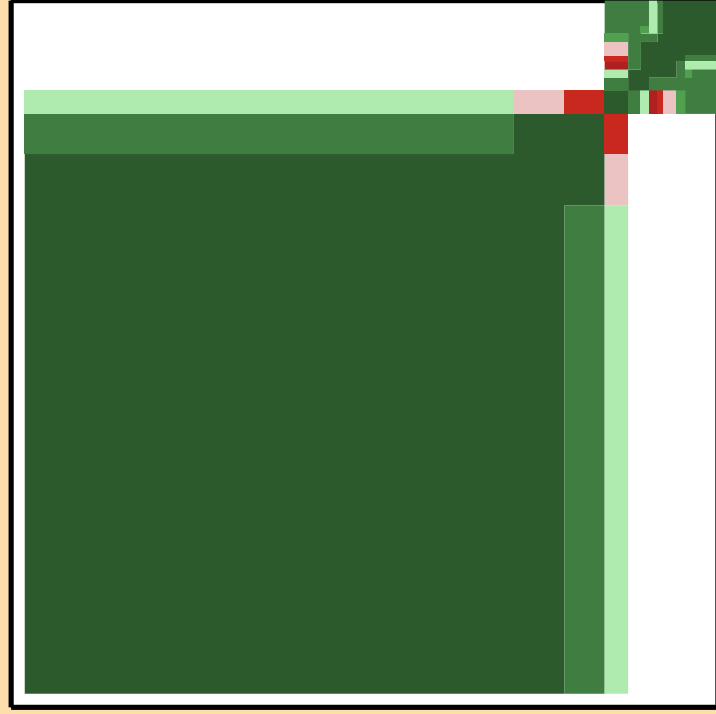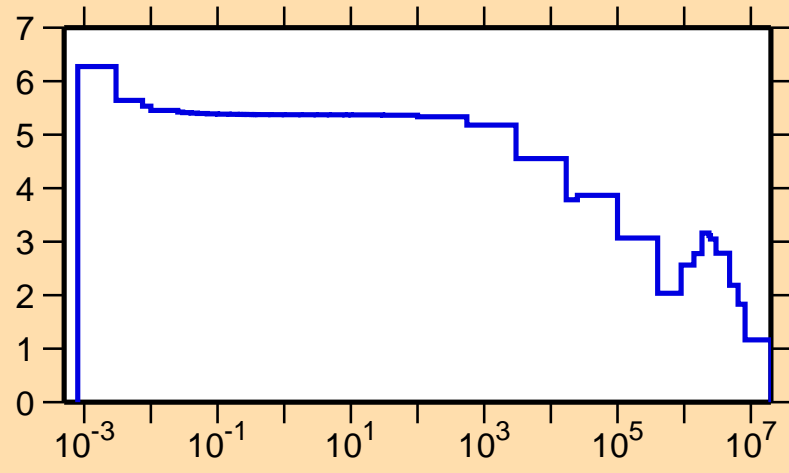

Correlation Matrix




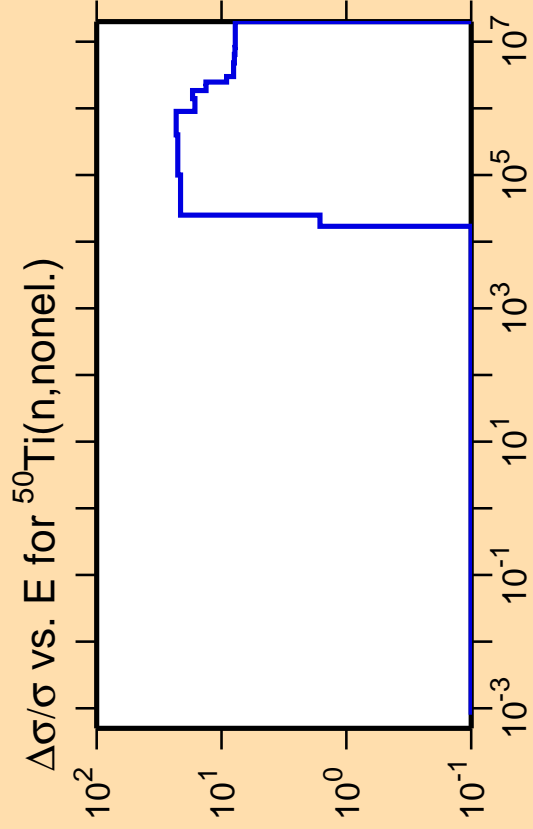


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

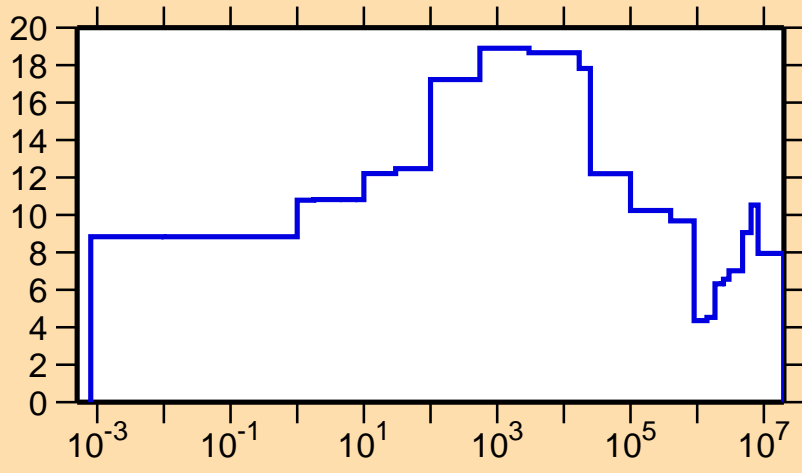

Correlation Matrix





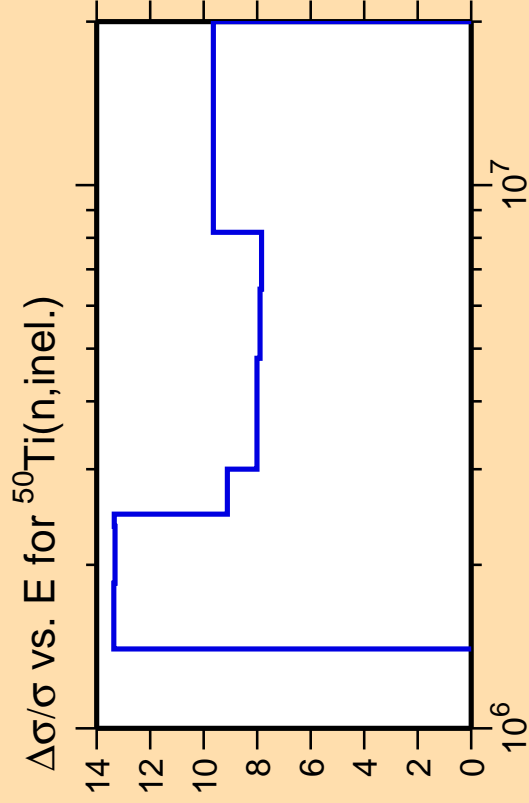

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

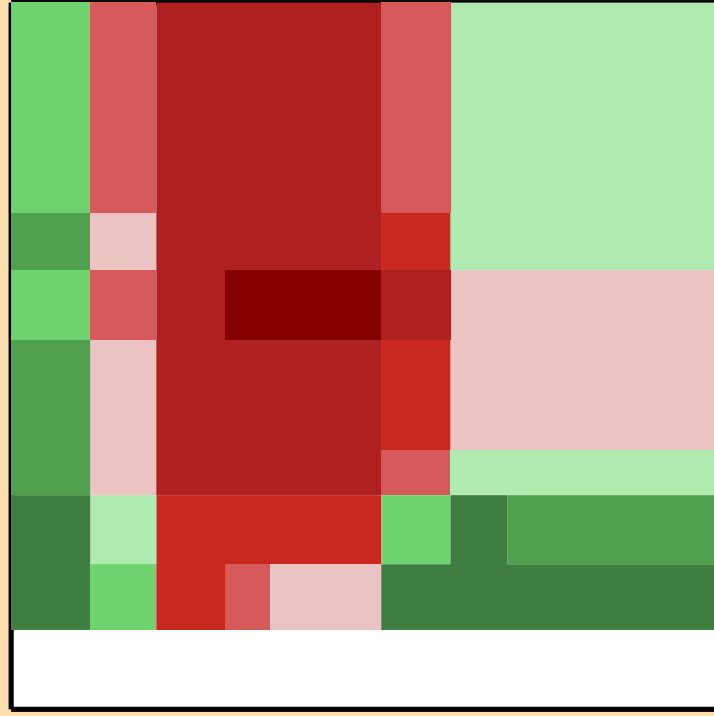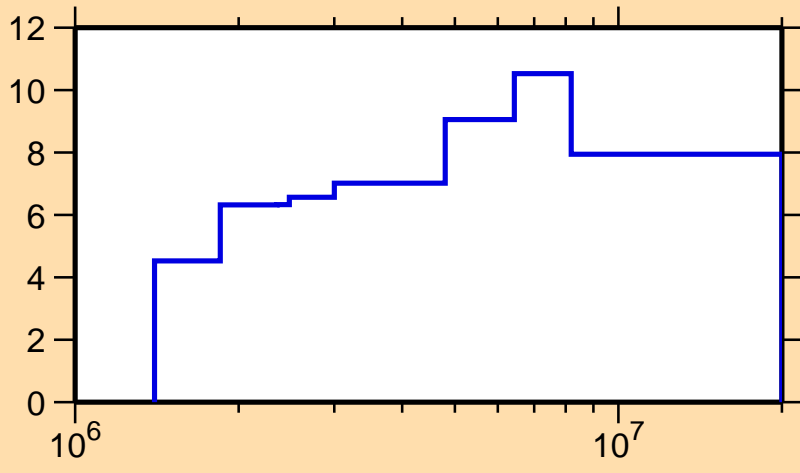

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

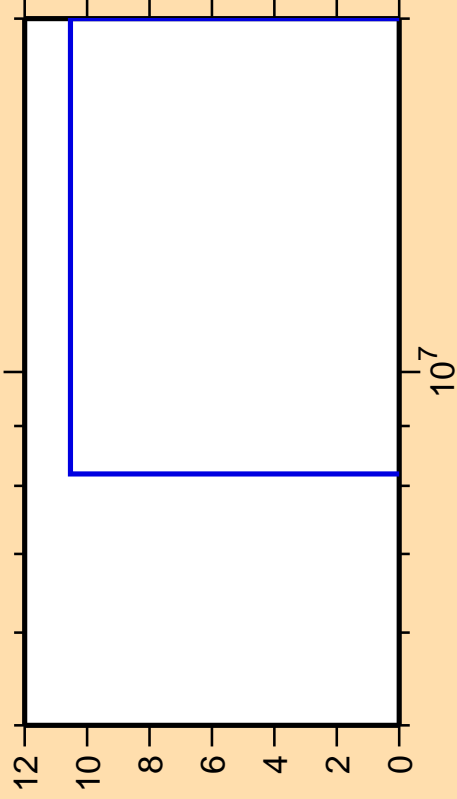

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

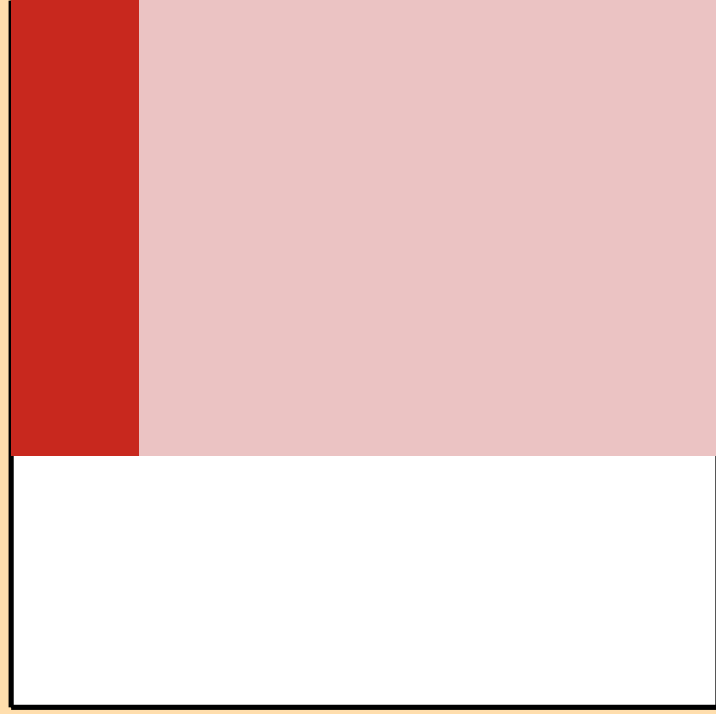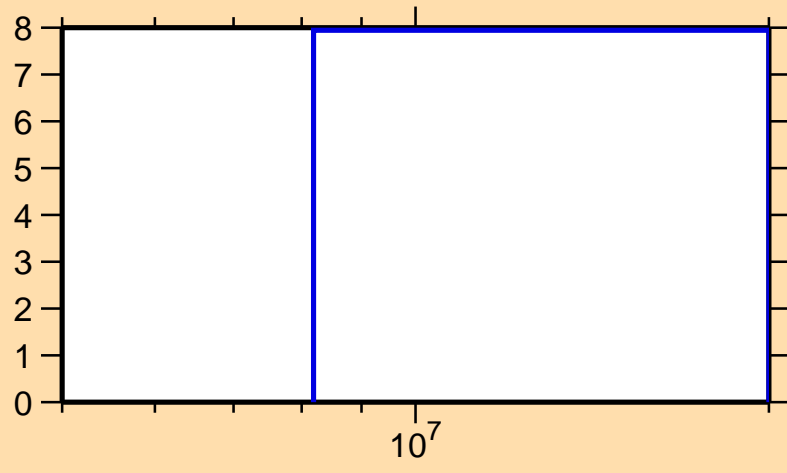

Correlation Matrix





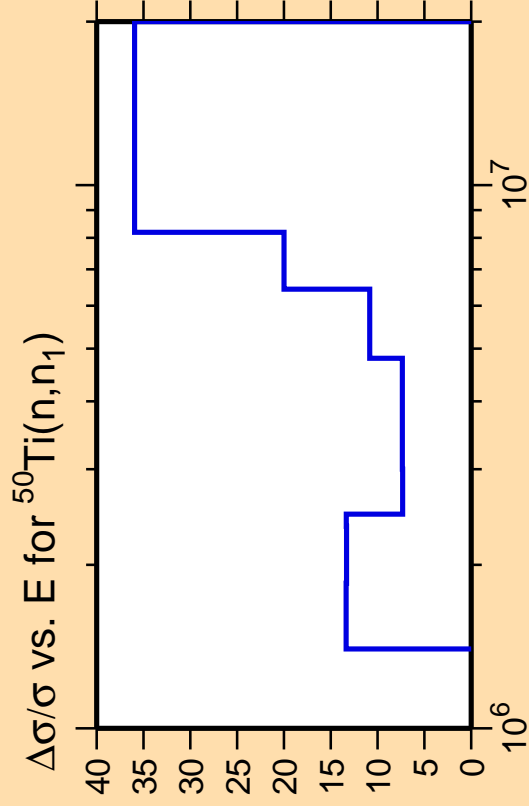

Ordinate scale is %  
relative standard deviation.




Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

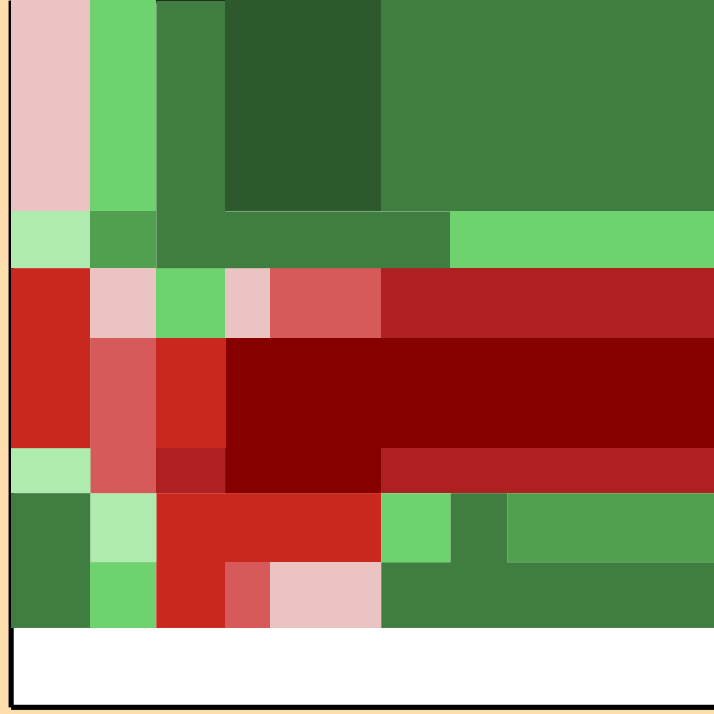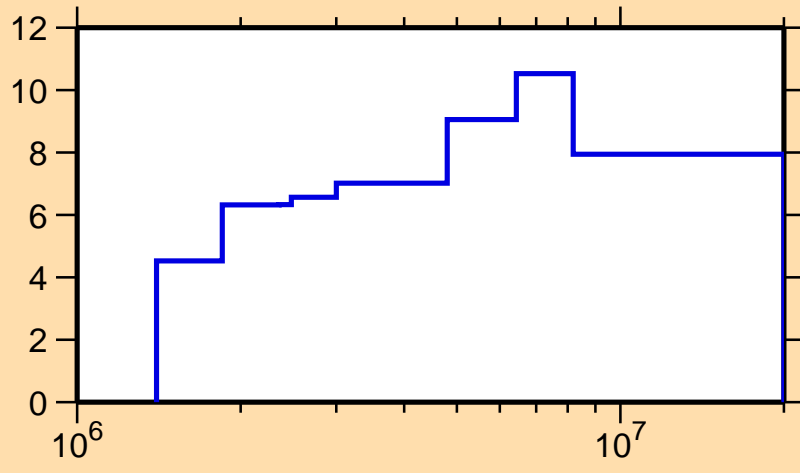


Correlation Matrix



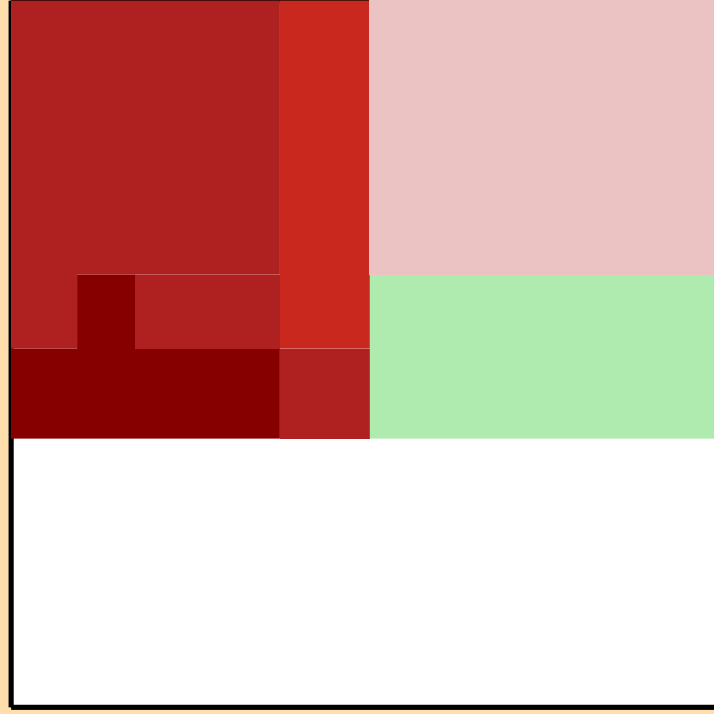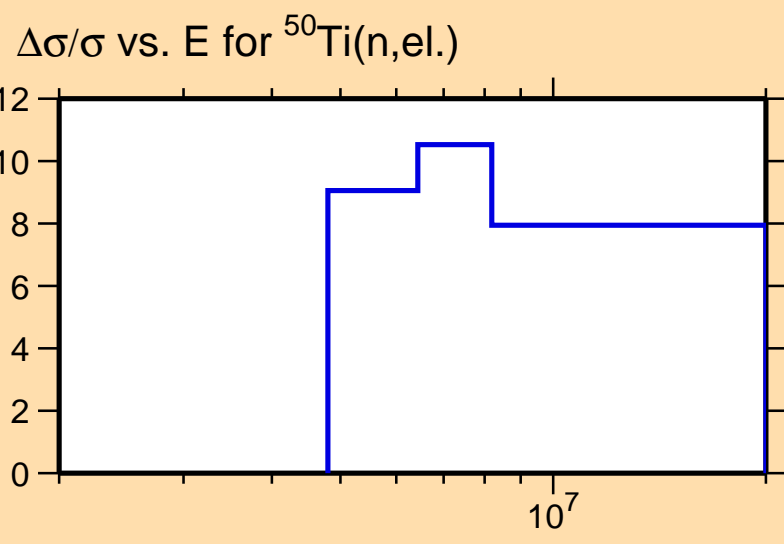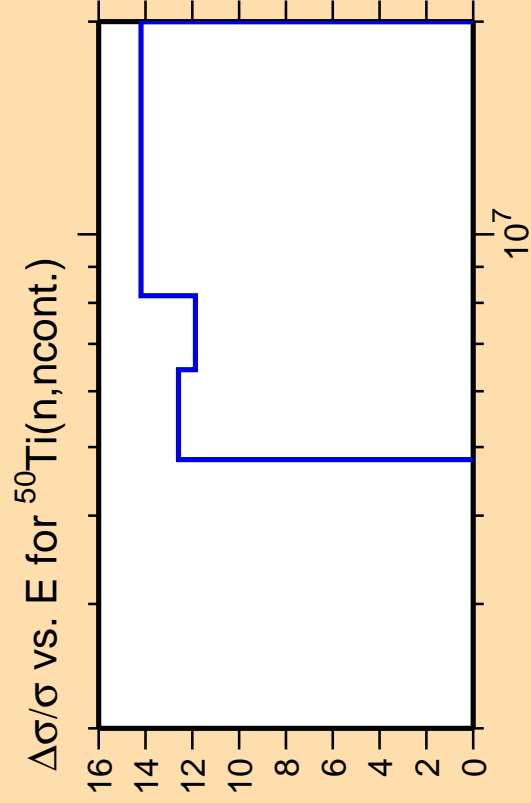




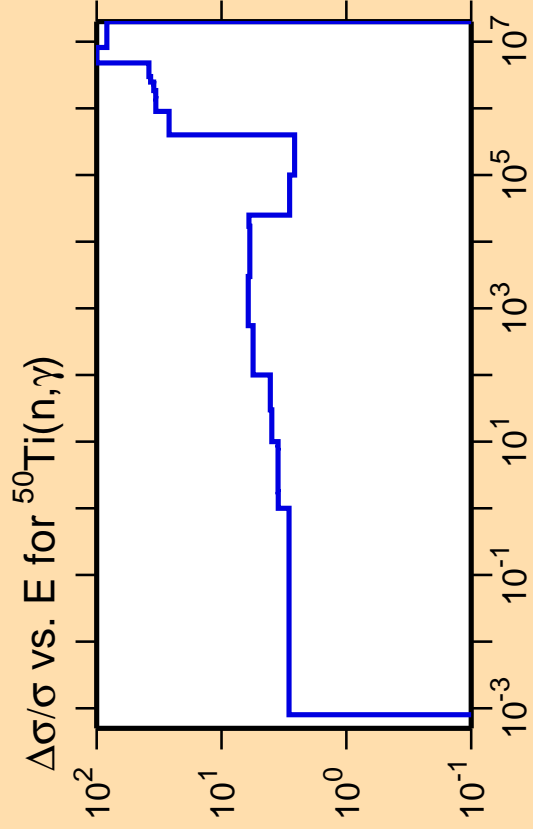


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

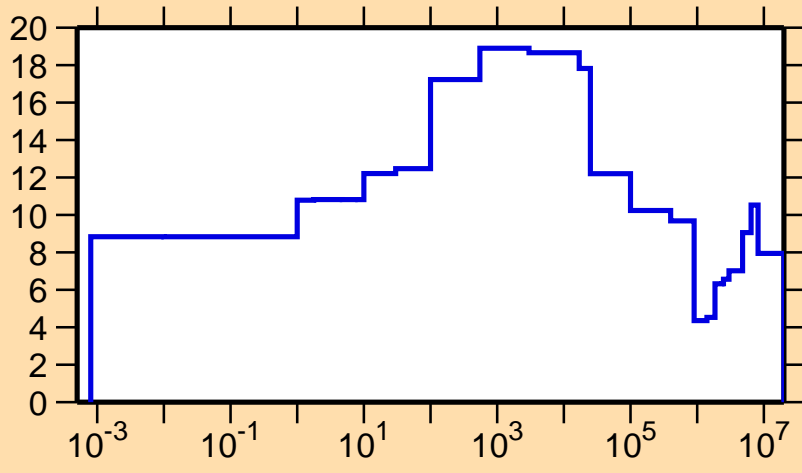

Correlation Matrix




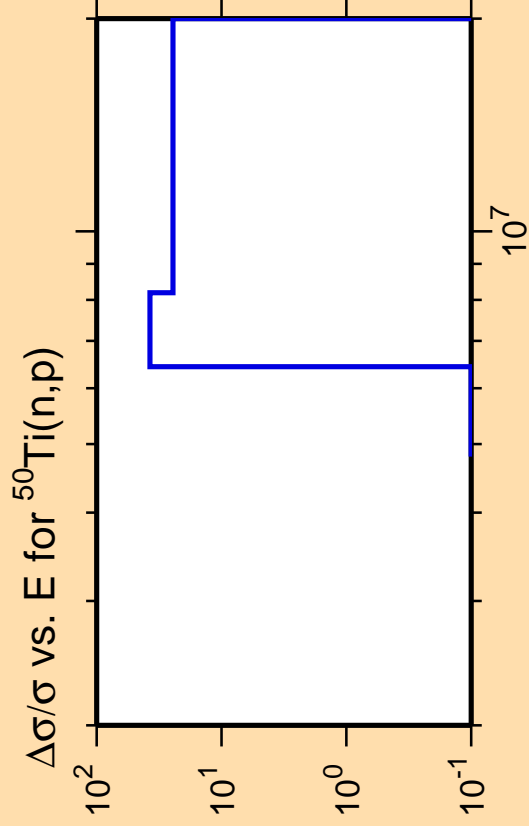


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

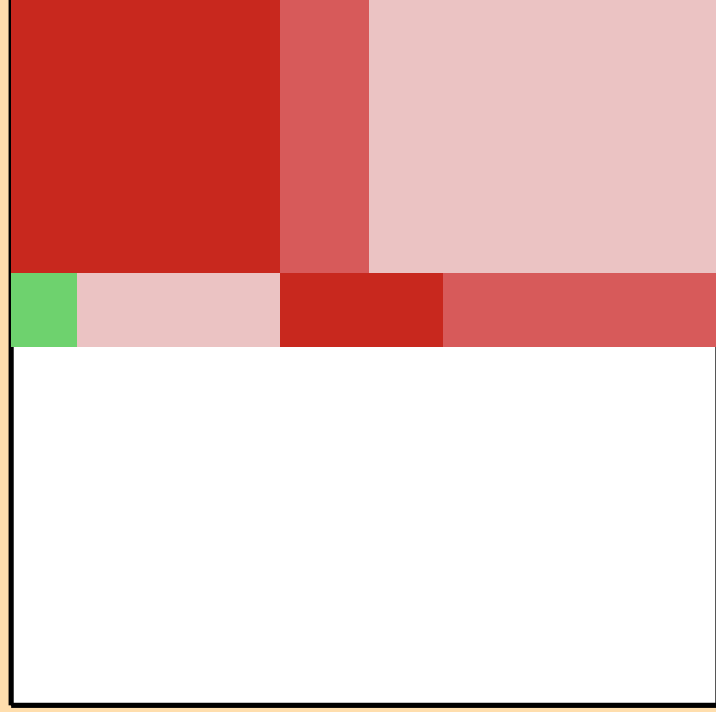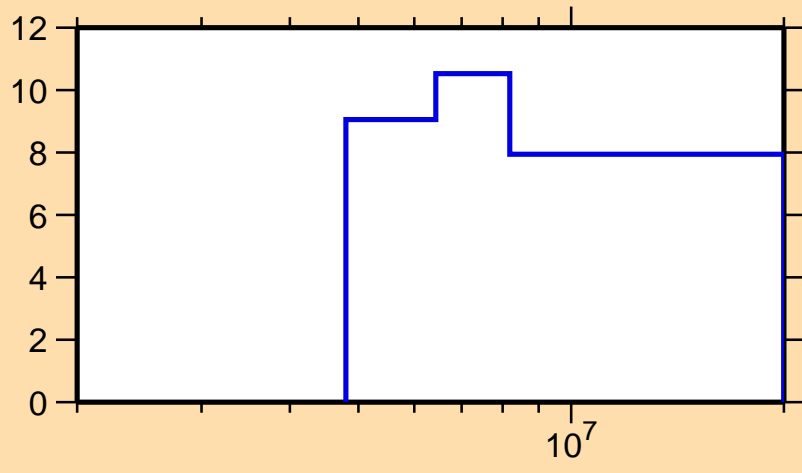

Correlation Matrix




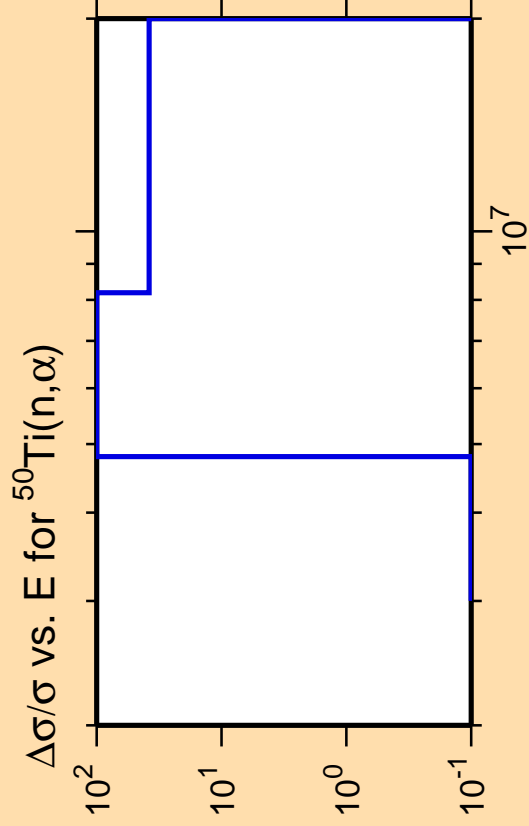


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

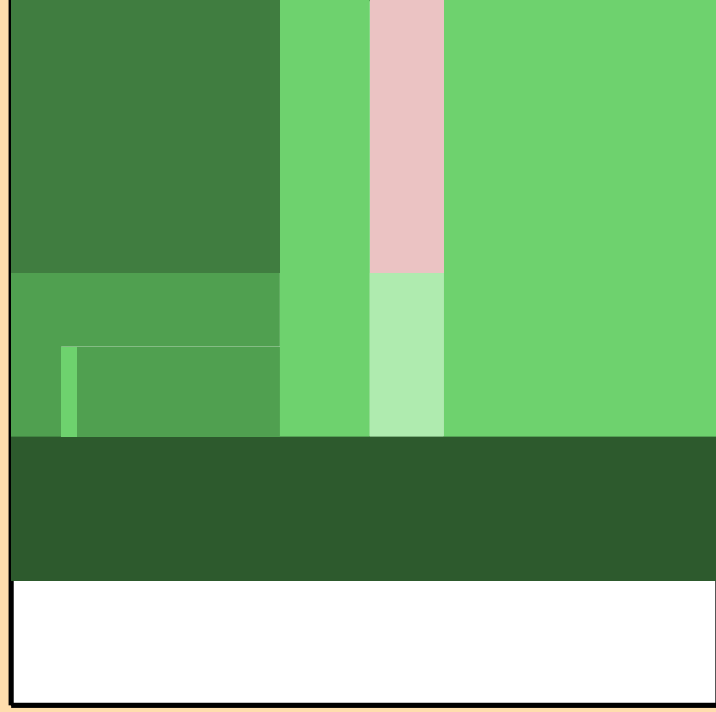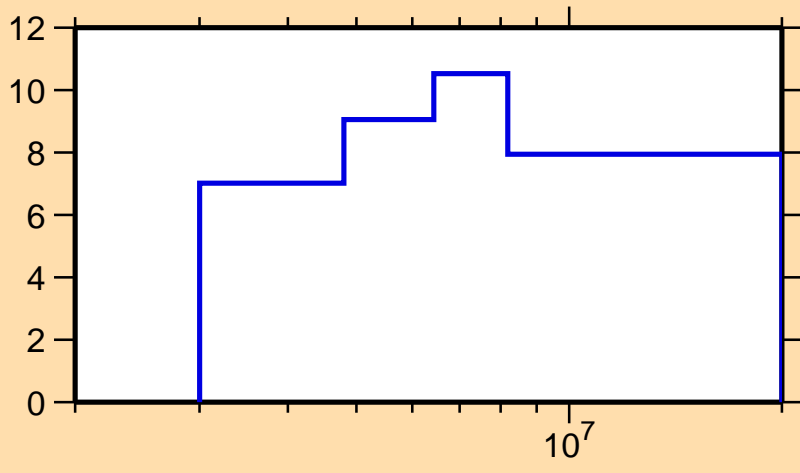

Correlation Matrix





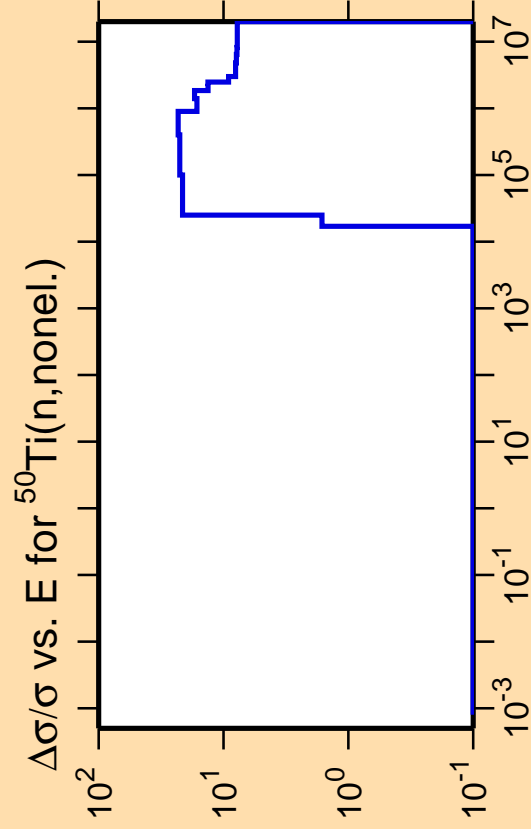

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

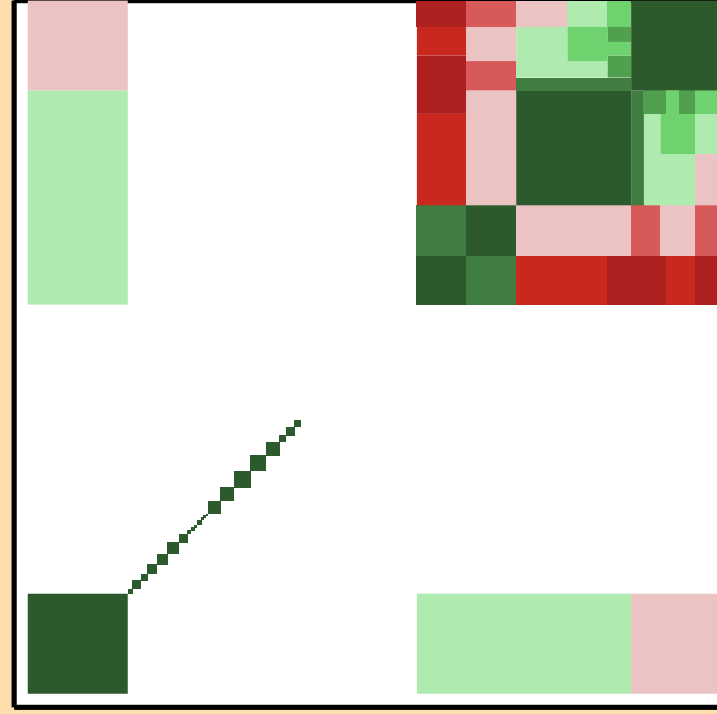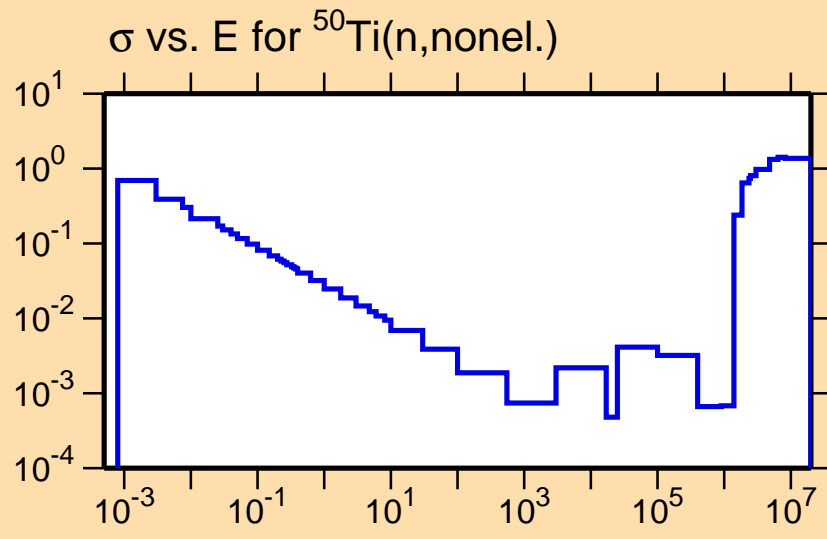



Correlation Matrix



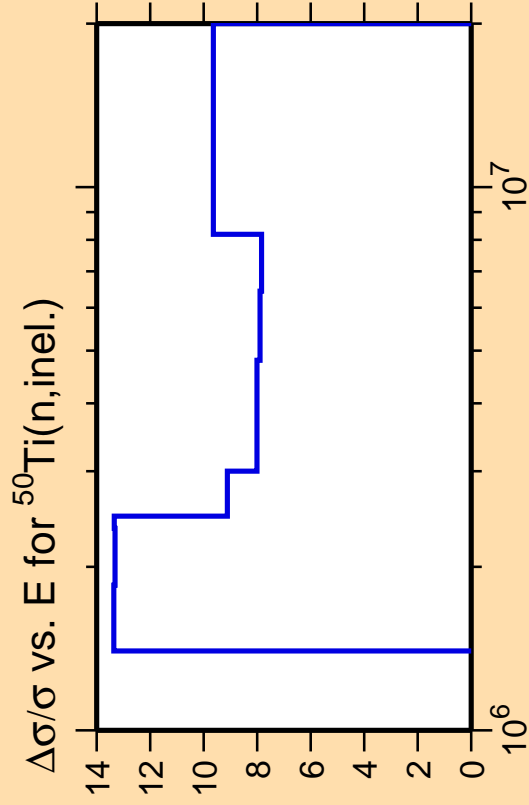

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

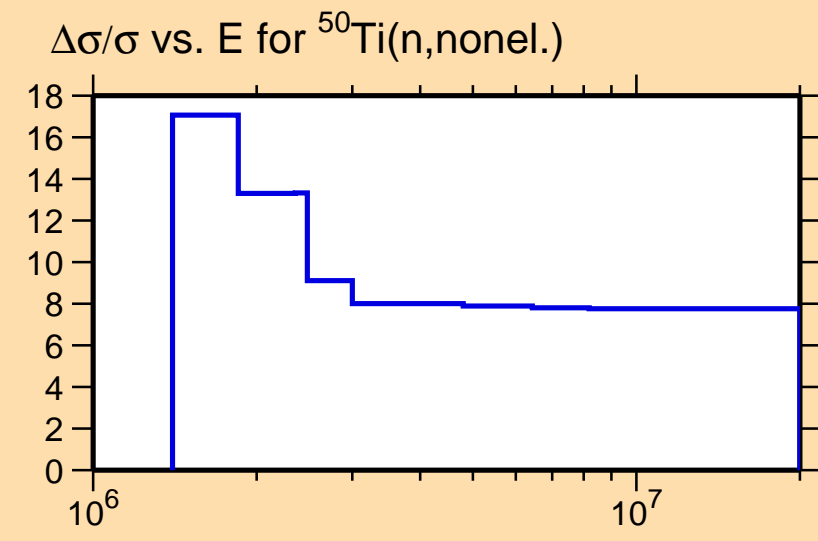

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

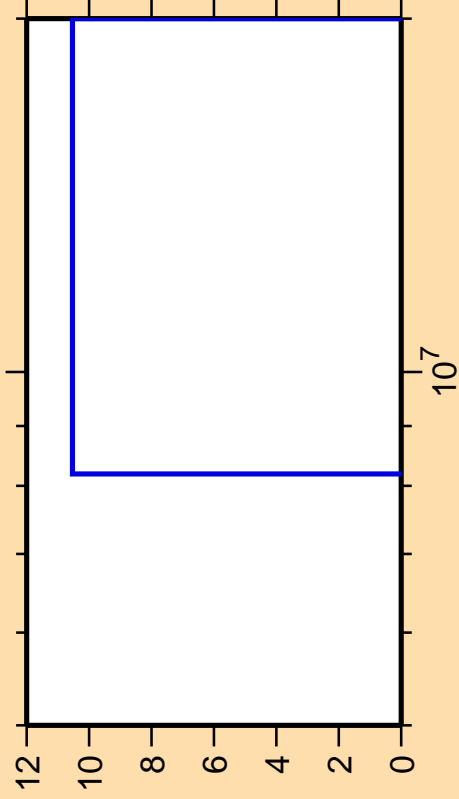

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

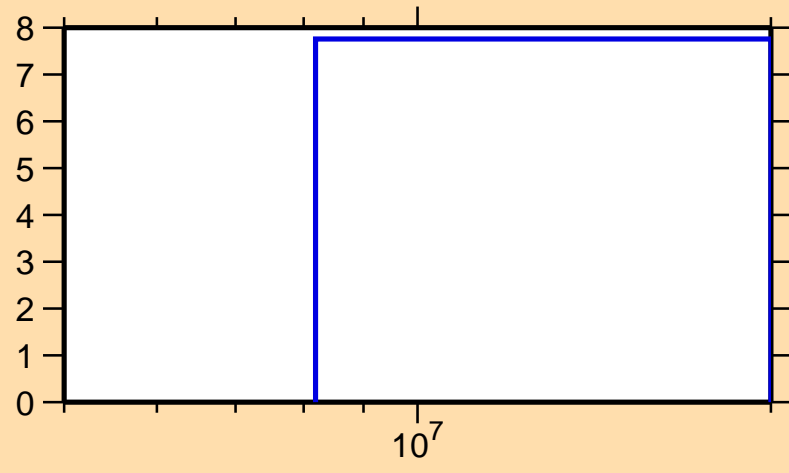



Correlation Matrix



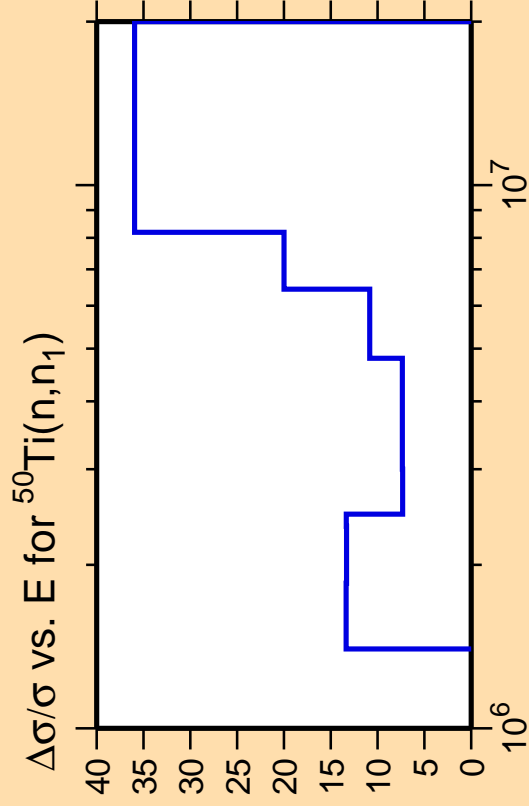

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

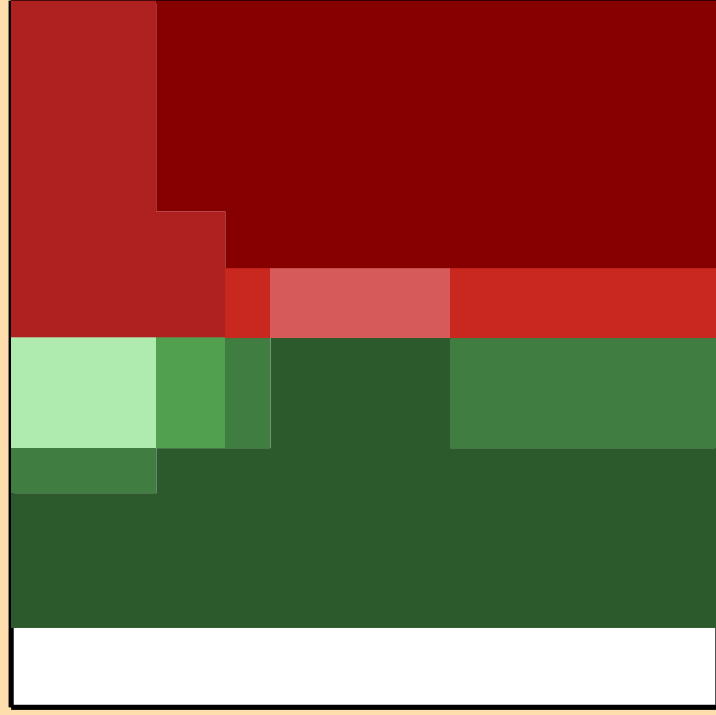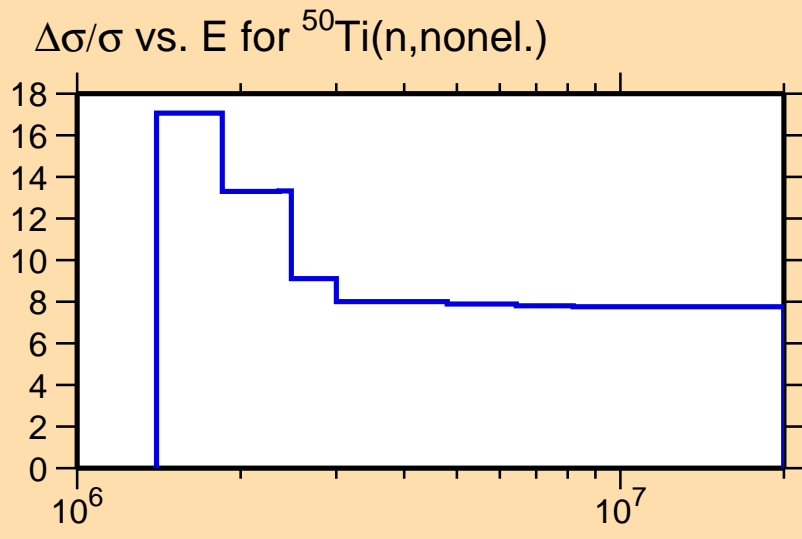

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

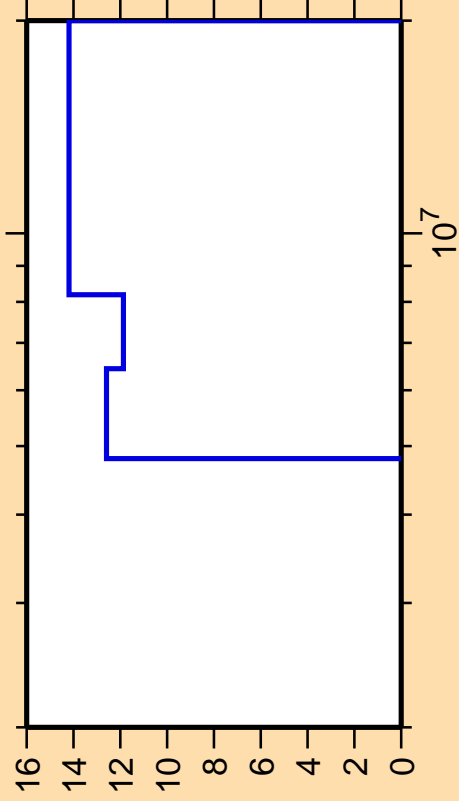

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

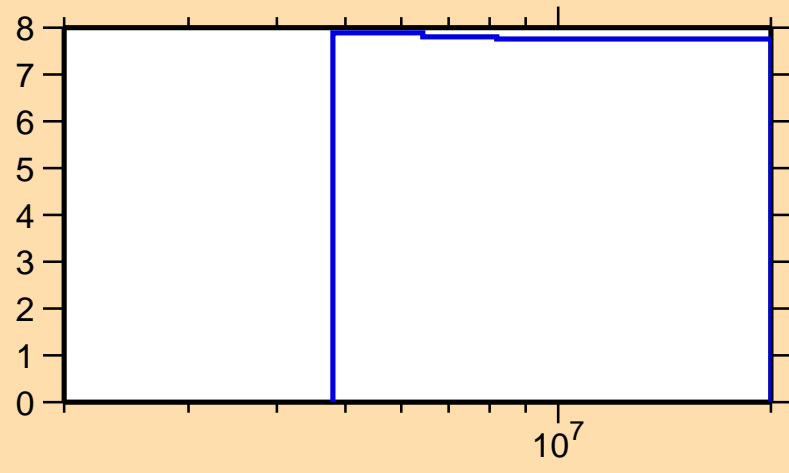

Correlation Matrix







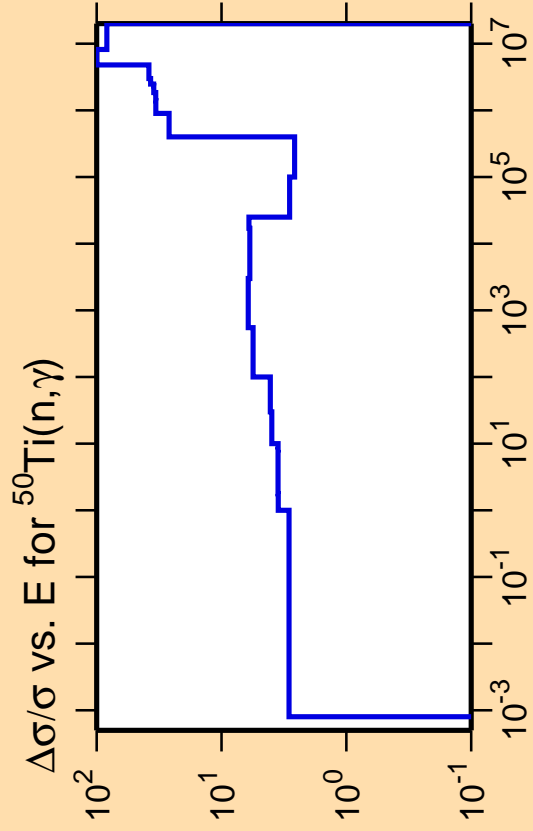

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

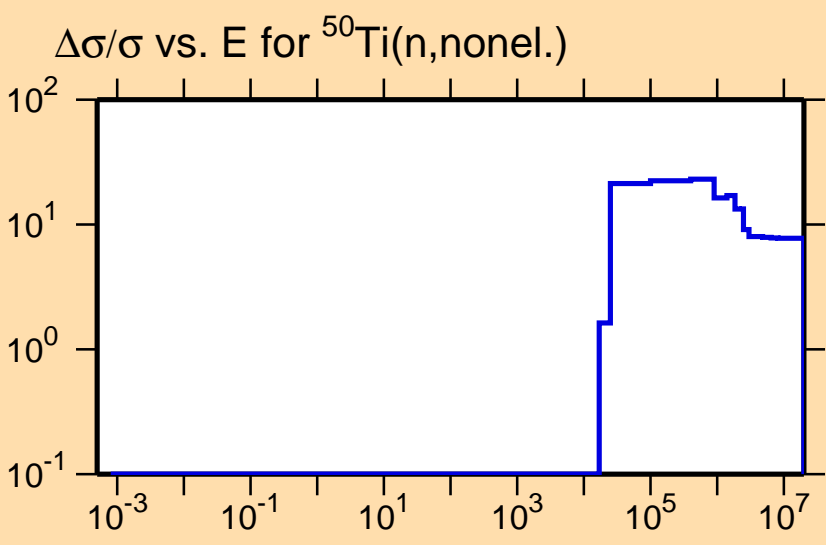

Correlation Matrix




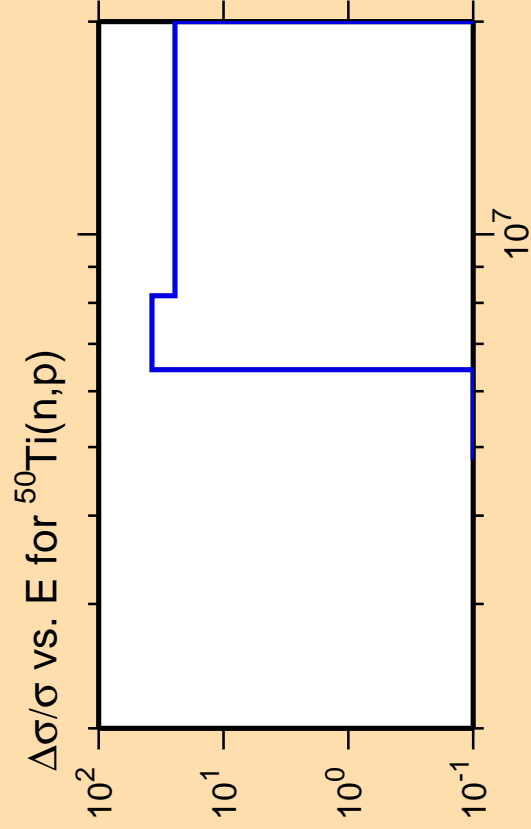


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

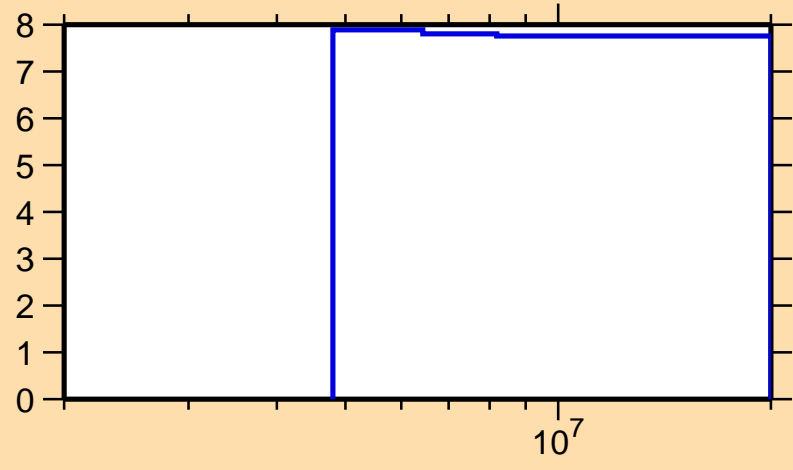

Correlation Matrix



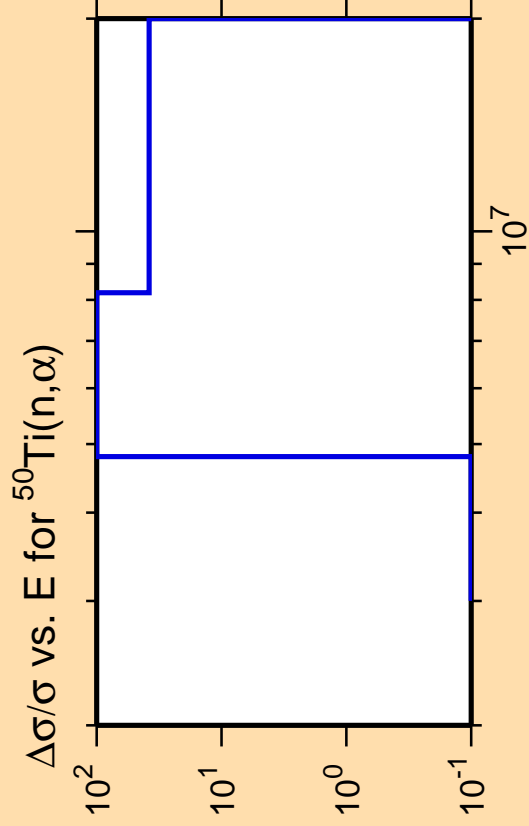


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\alpha)$


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

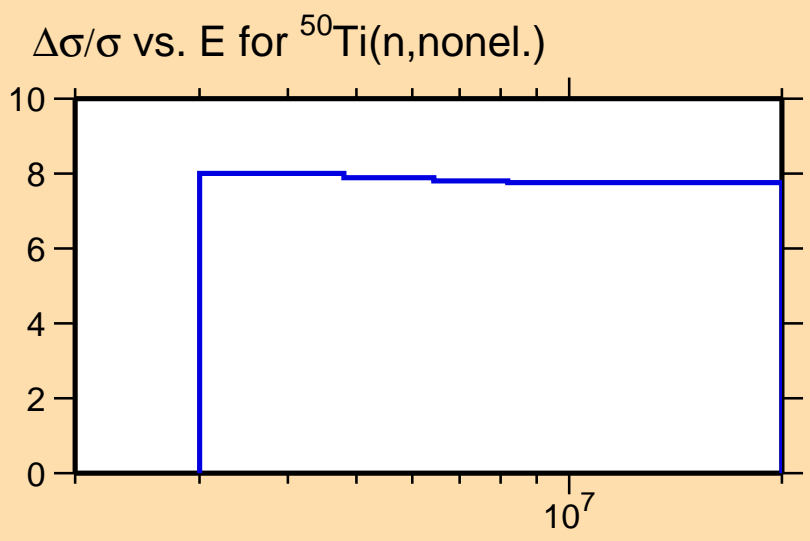


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$





Correlation Matrix

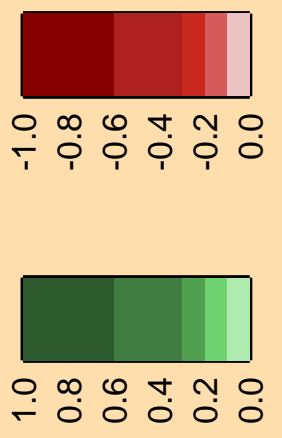

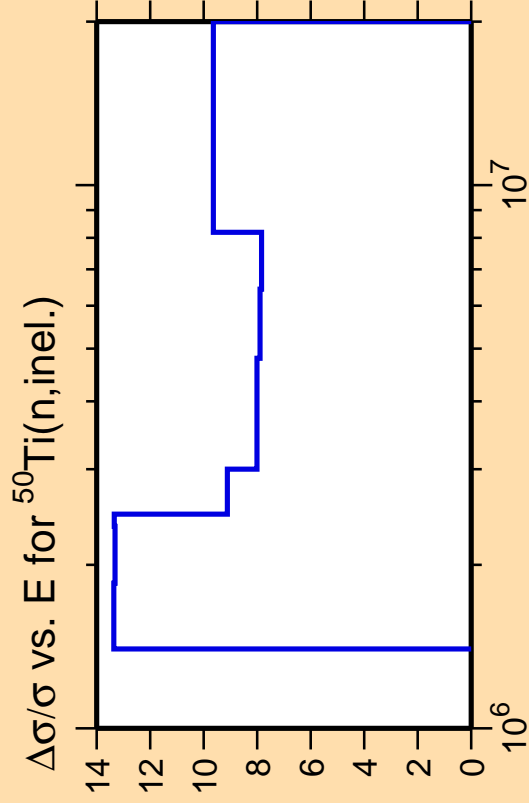

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

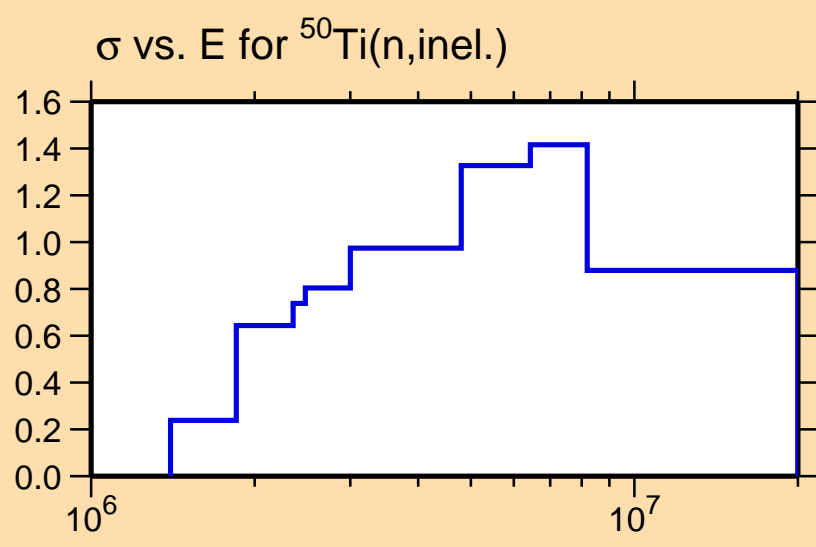

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

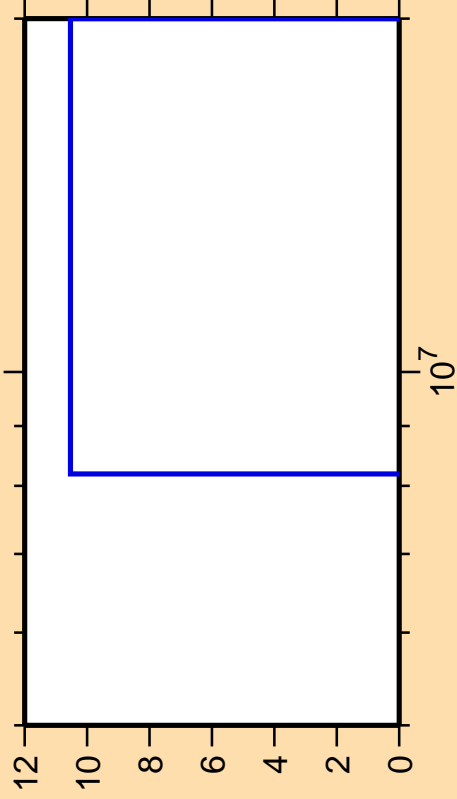

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

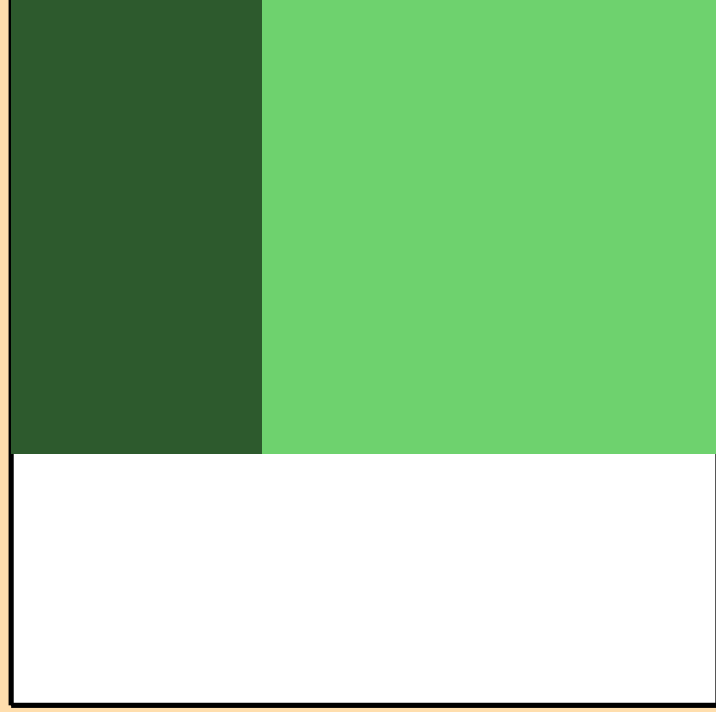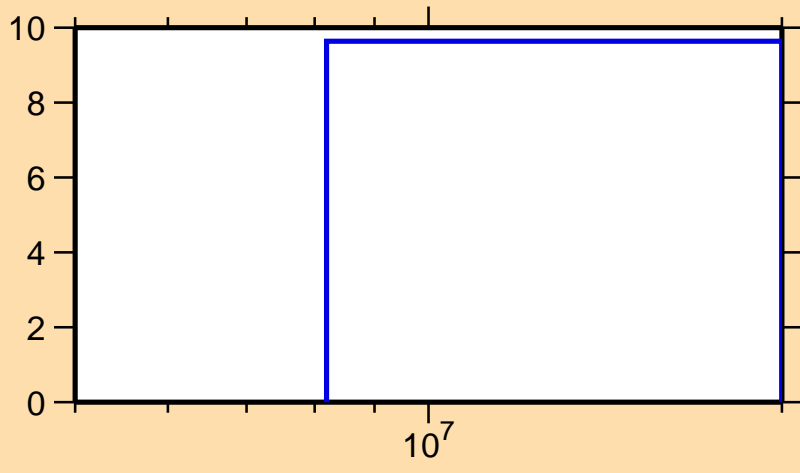

Correlation Matrix





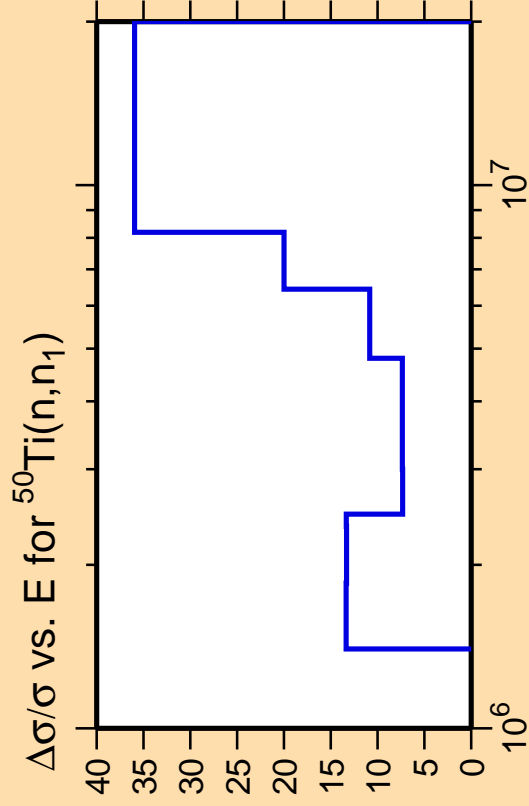

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

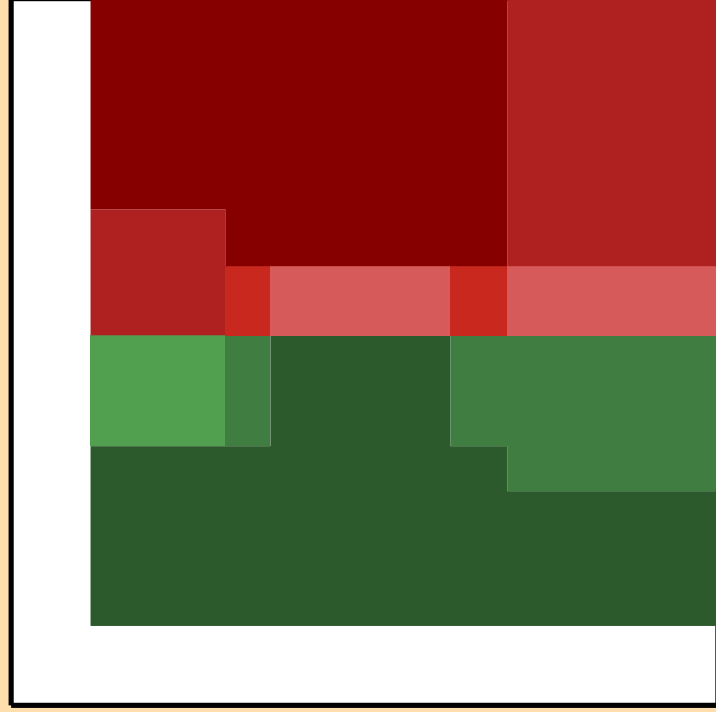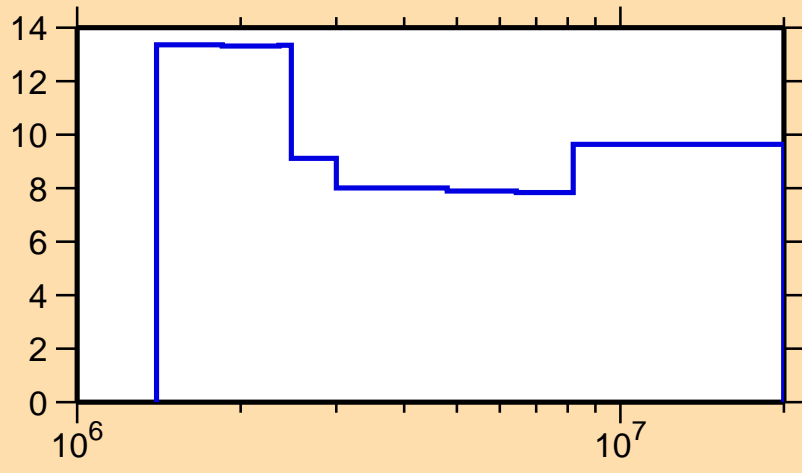

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

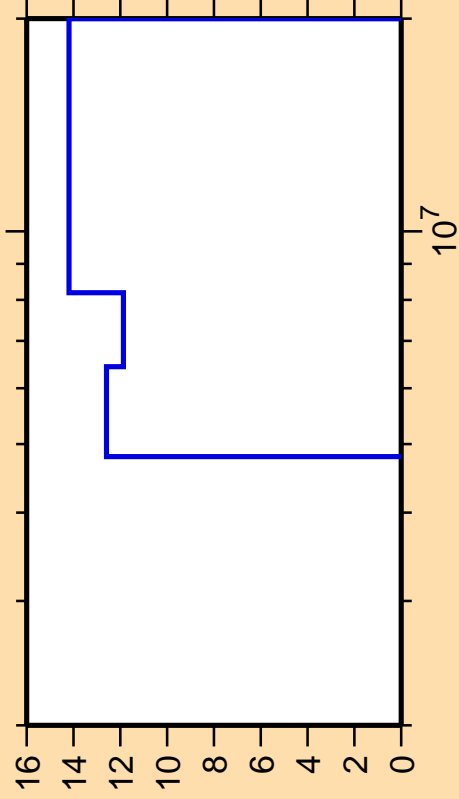

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

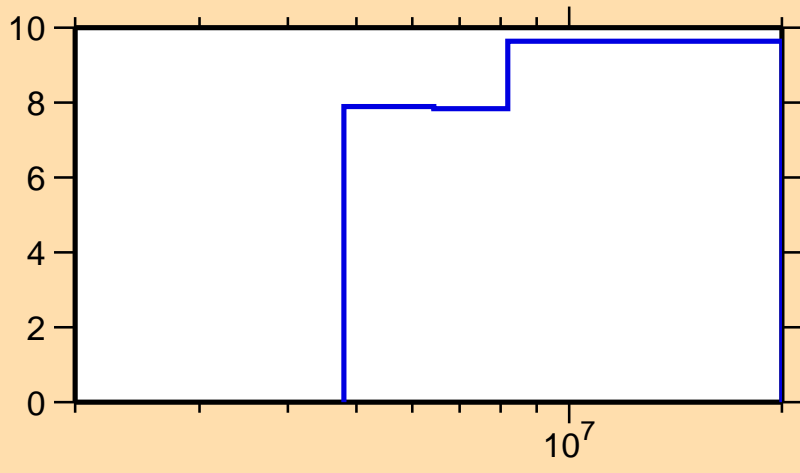

Correlation Matrix





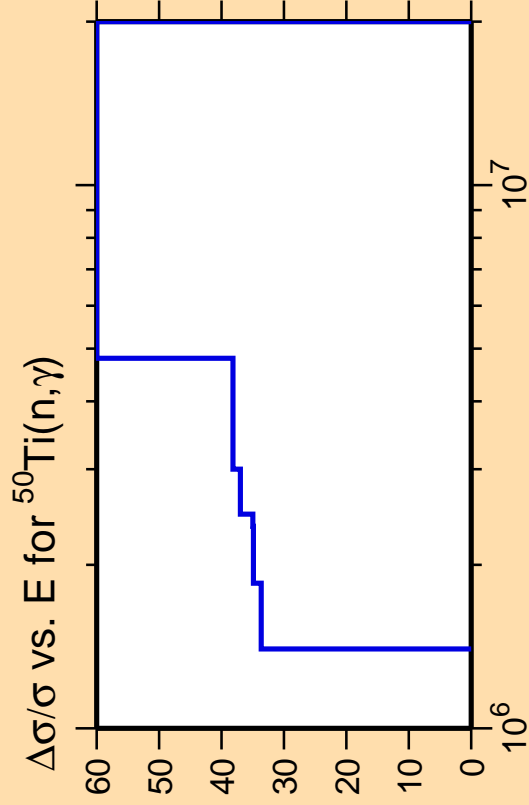

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

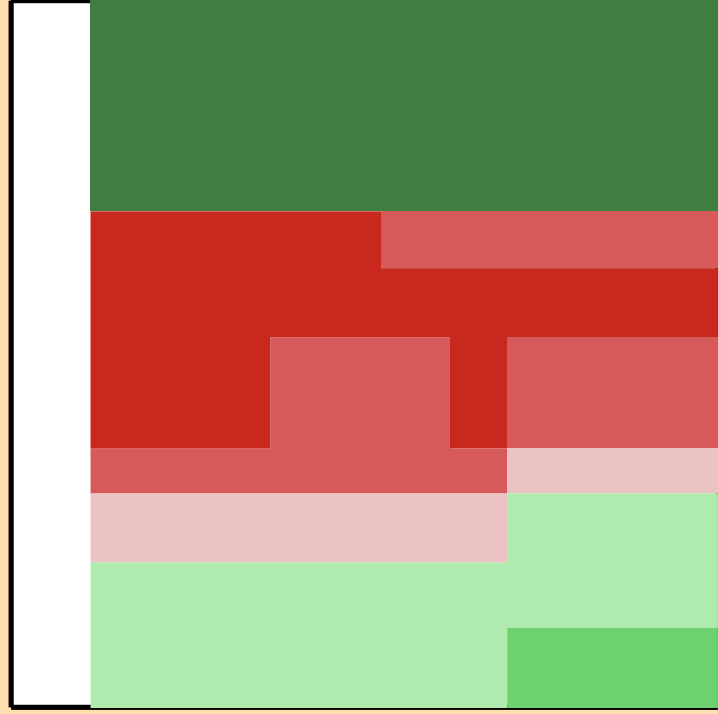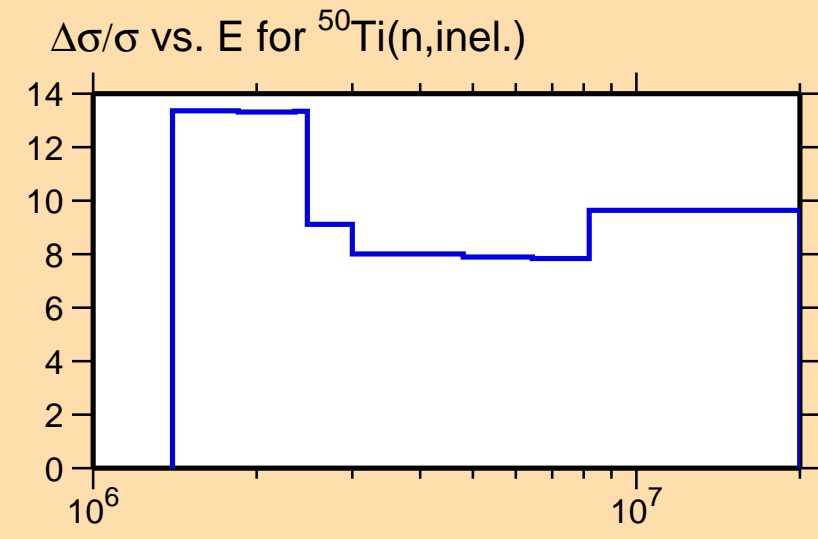

Correlation Matrix






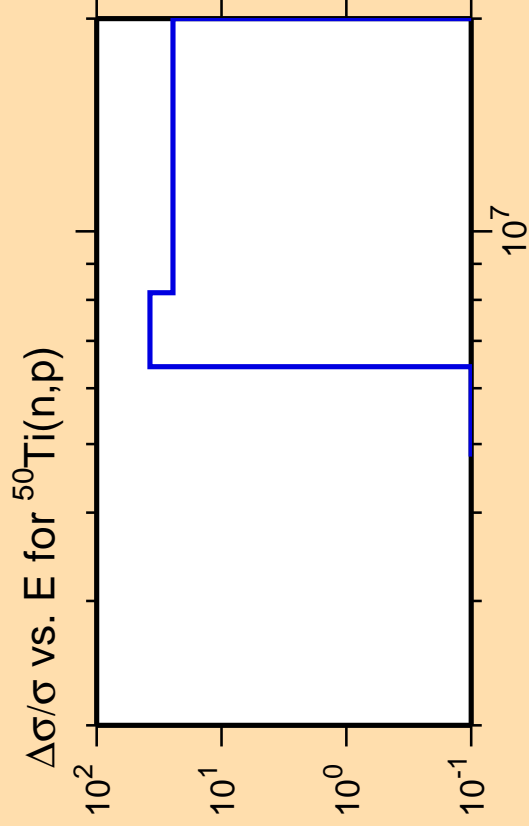

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

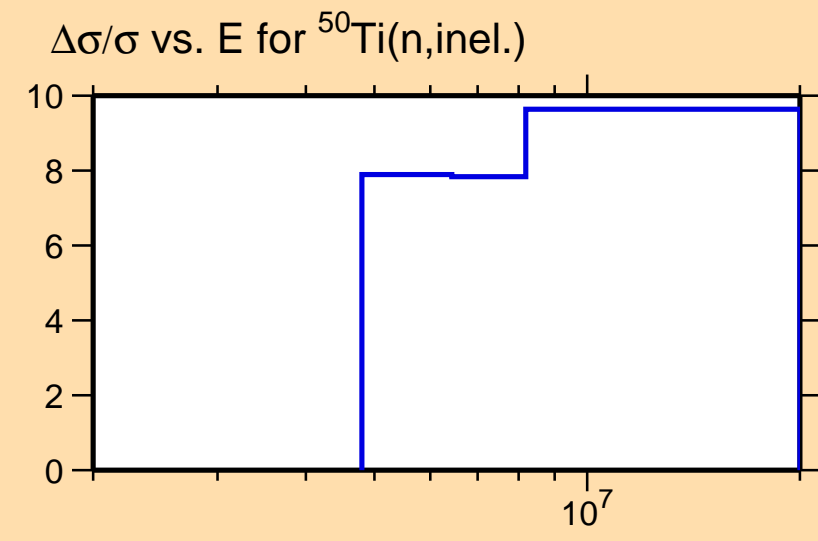

Correlation Matrix




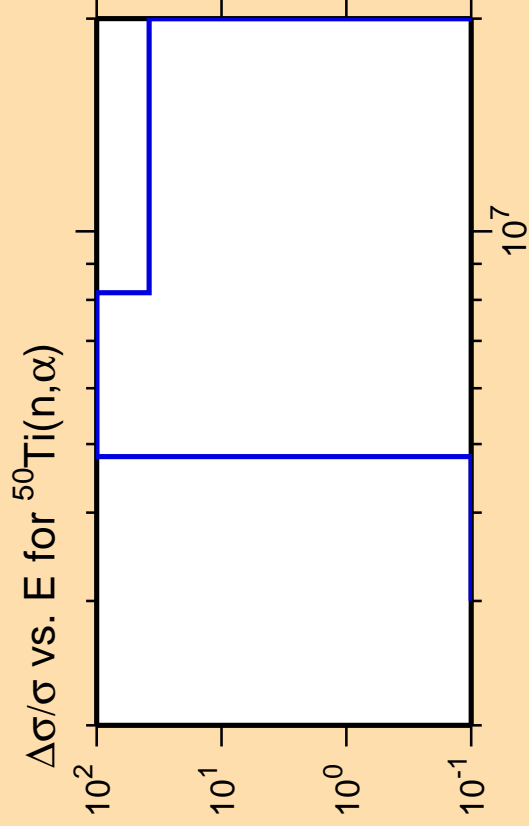


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

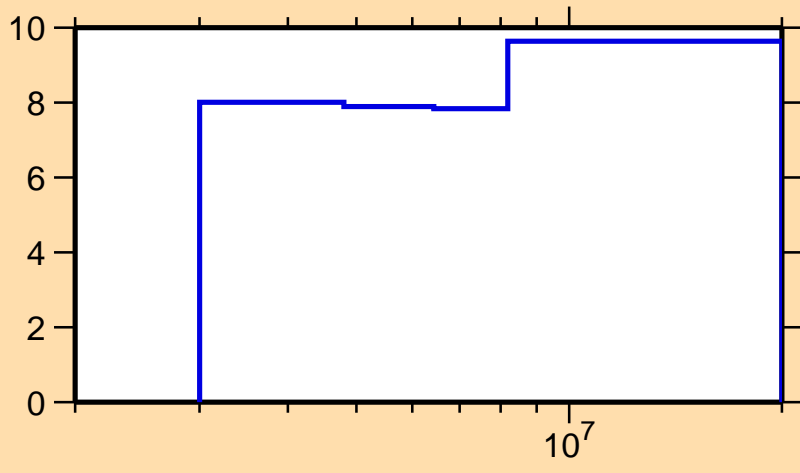

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

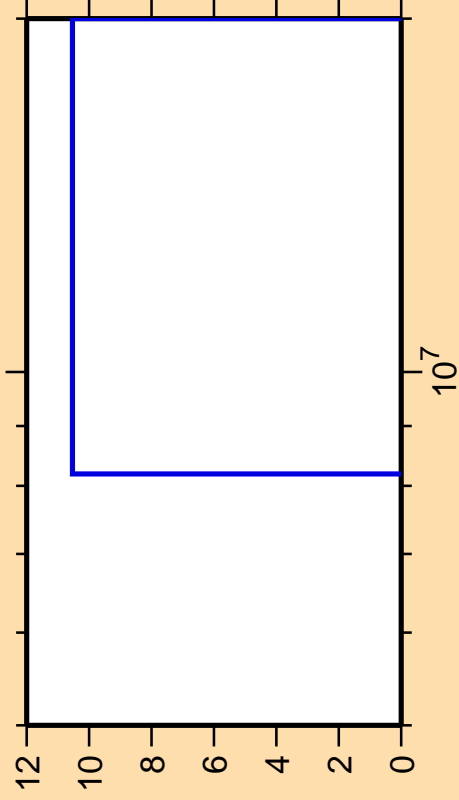

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

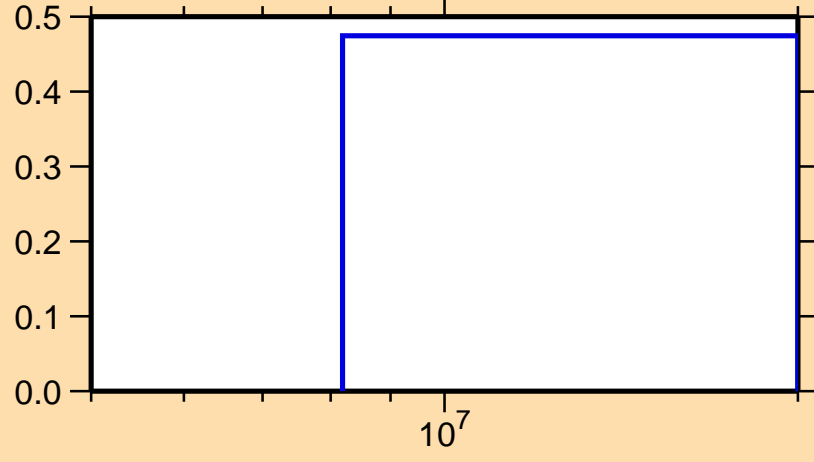

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

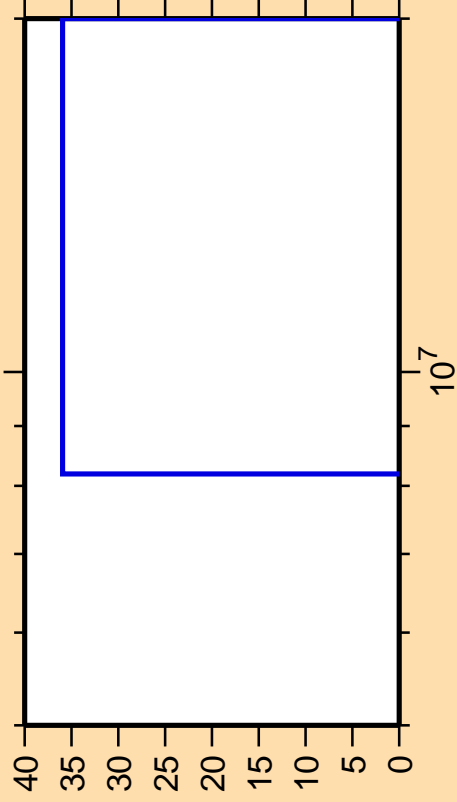

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

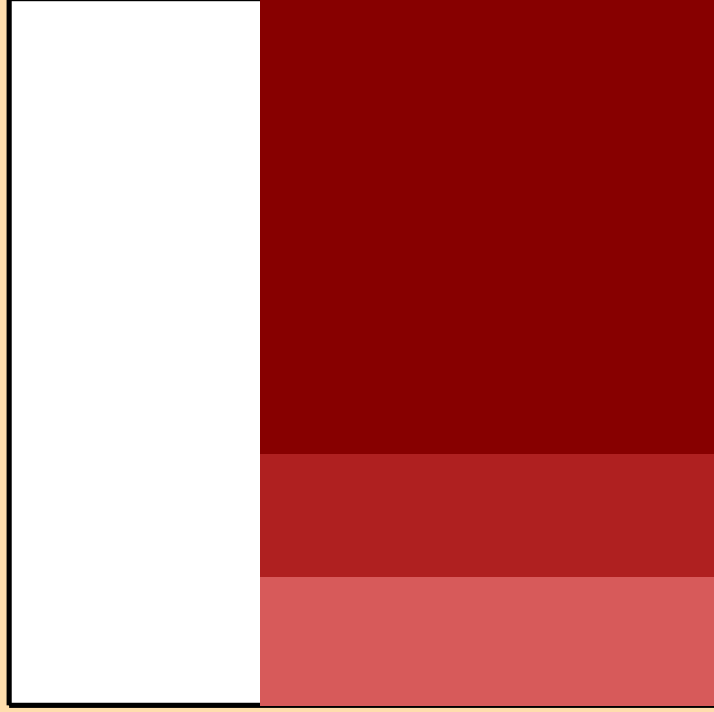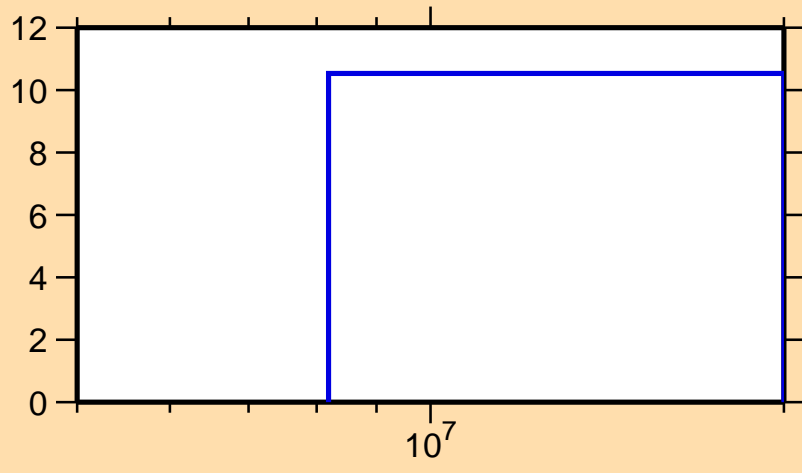

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

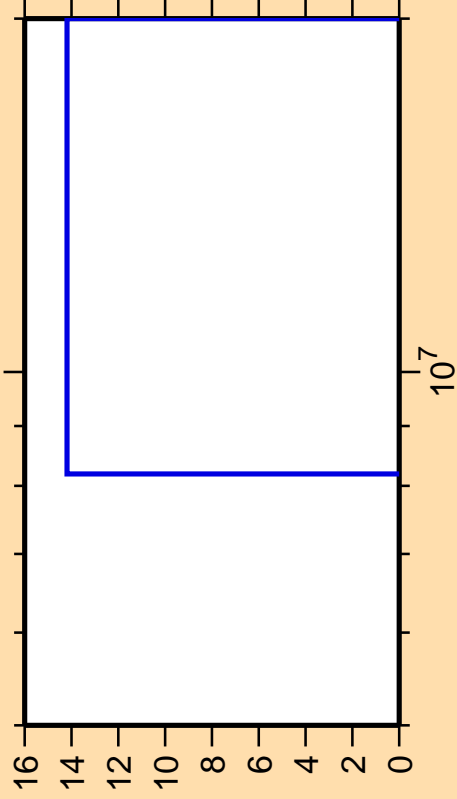

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

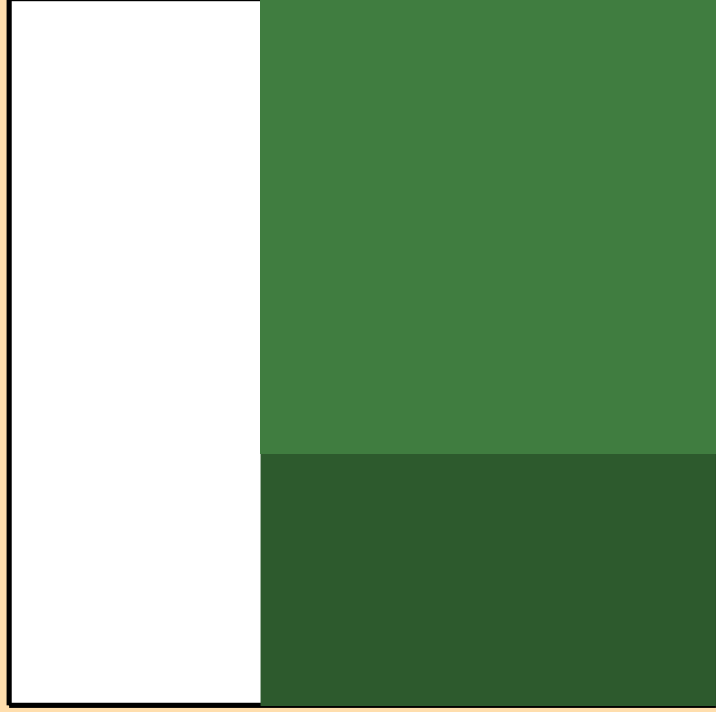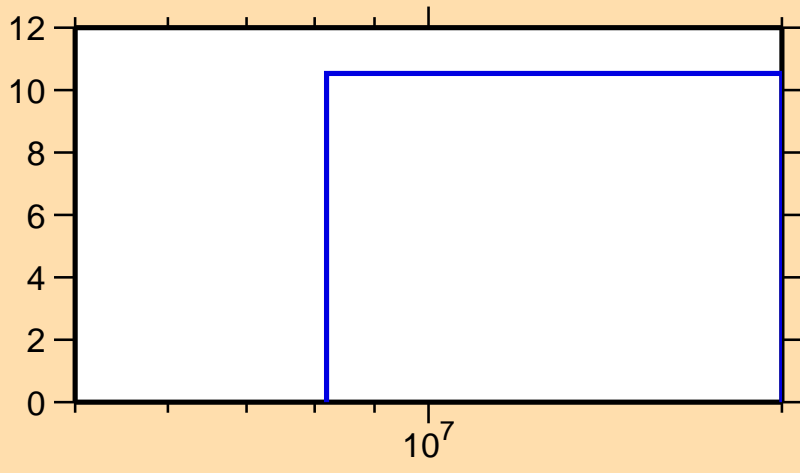

Correlation Matrix




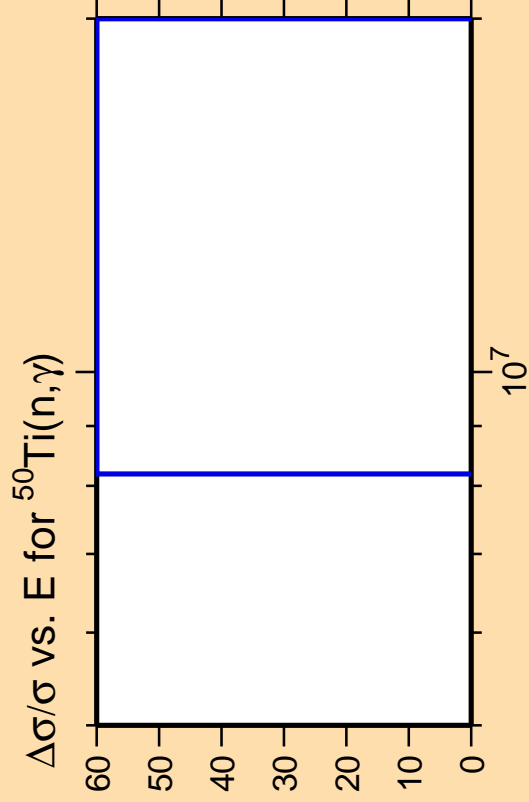


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

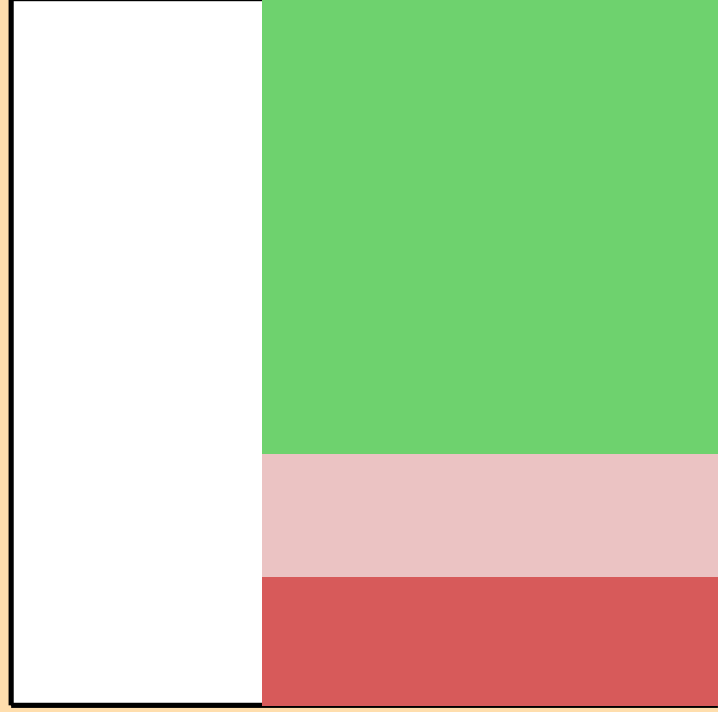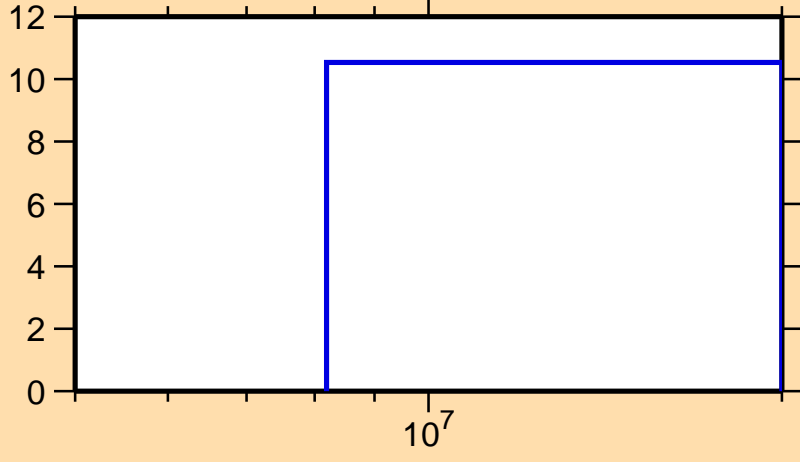



Correlation Matrix



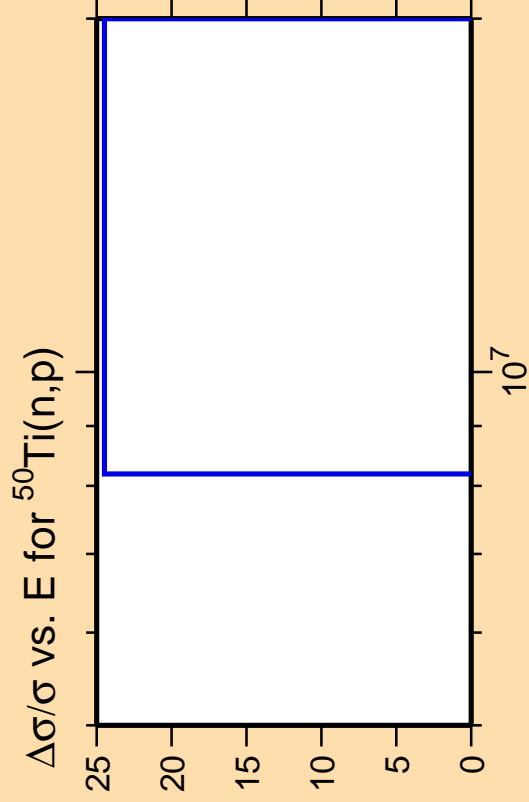

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

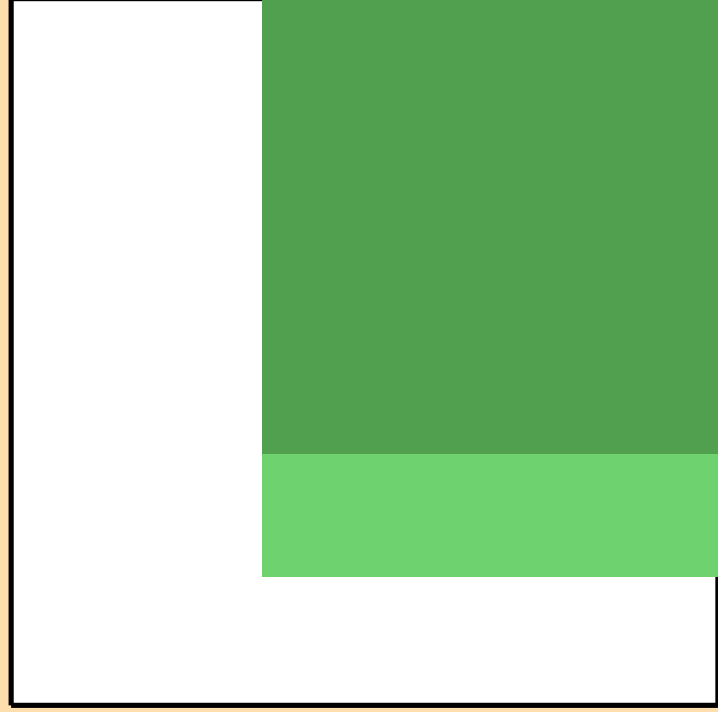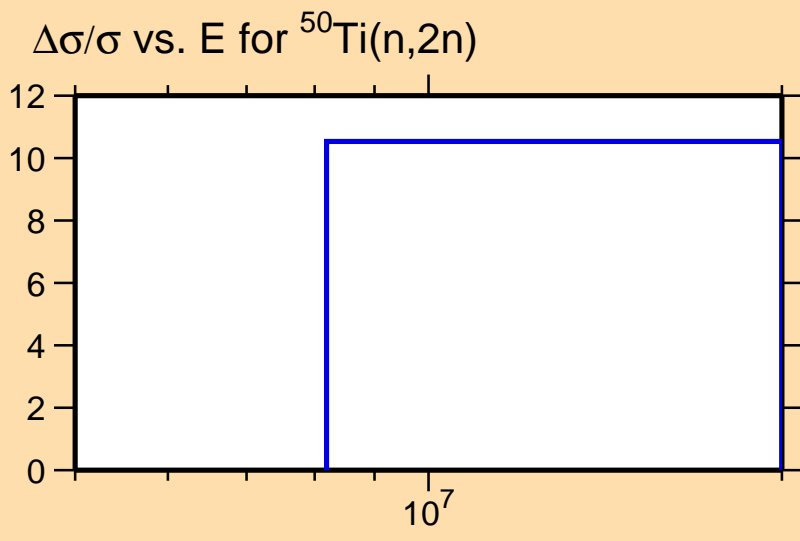

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\alpha)$

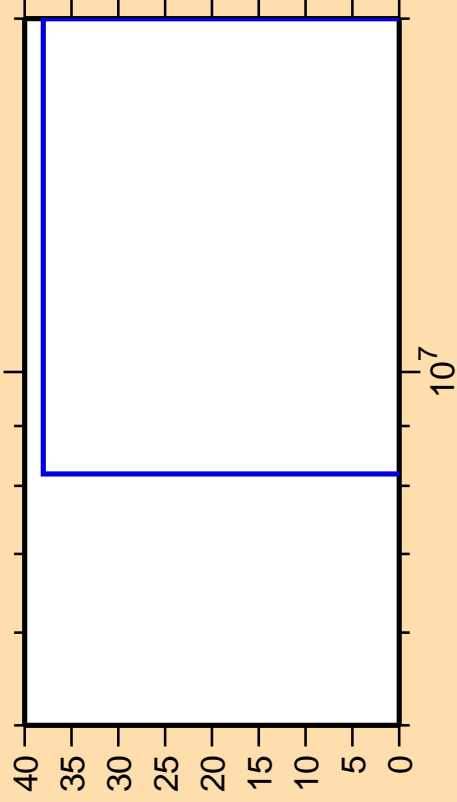

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

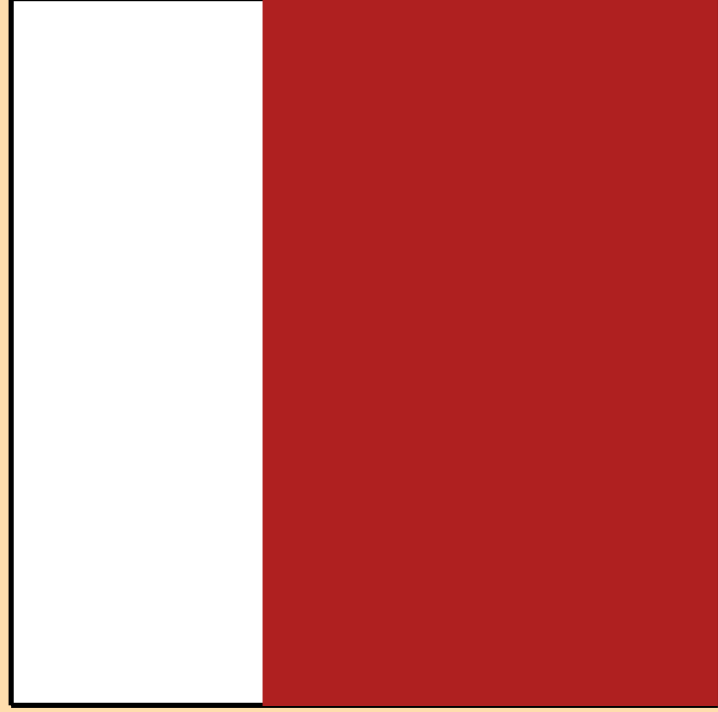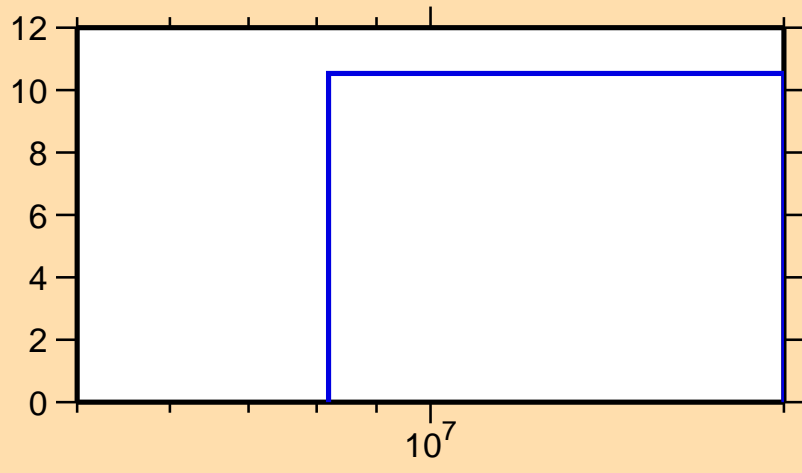


Correlation Matrix






$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,3n)$

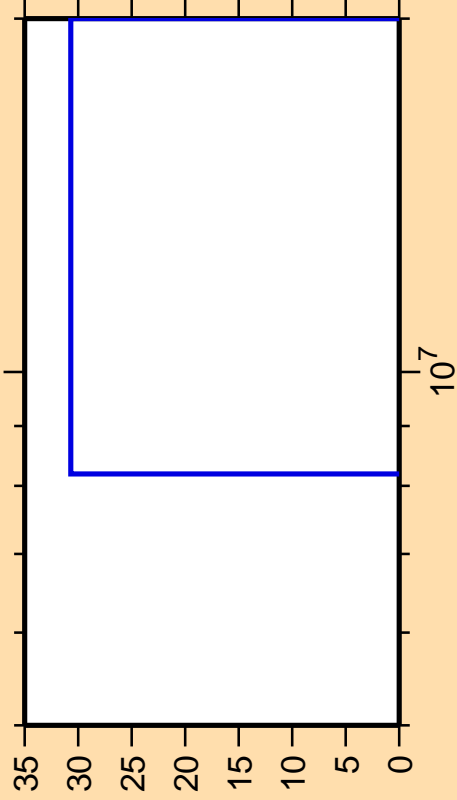

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,3n)$

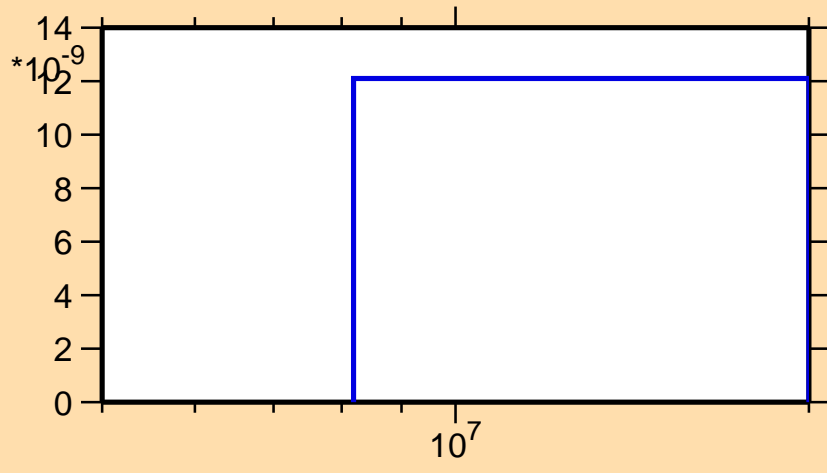

\*10<sup>-9</sup>

10<sup>7</sup>



Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\alpha)$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


$\sigma$  vs. E for  $^{50}\text{Ti}(n,n\alpha)$

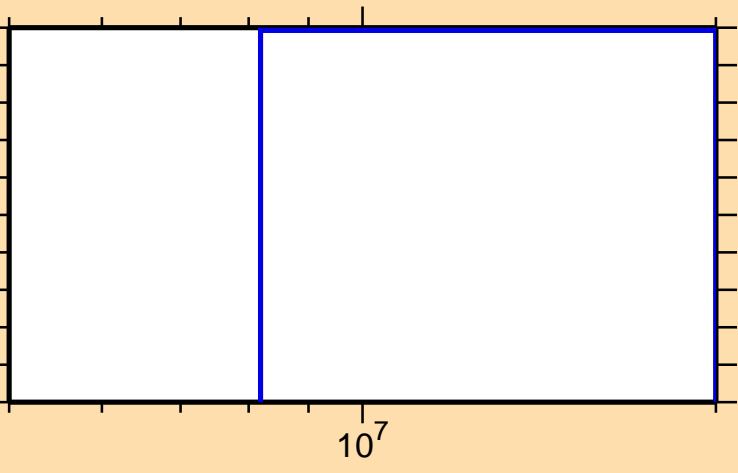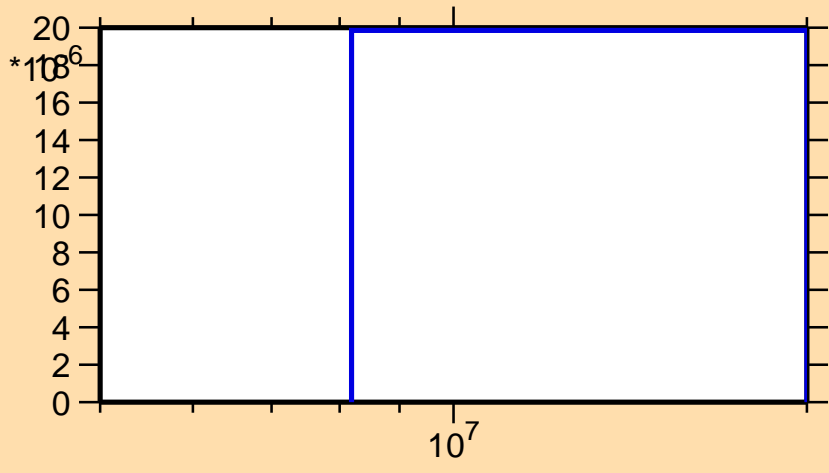

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,np)$

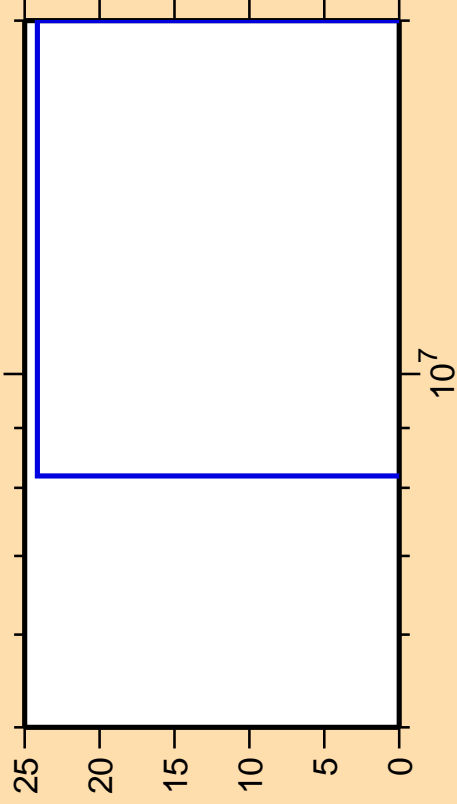

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,np)$

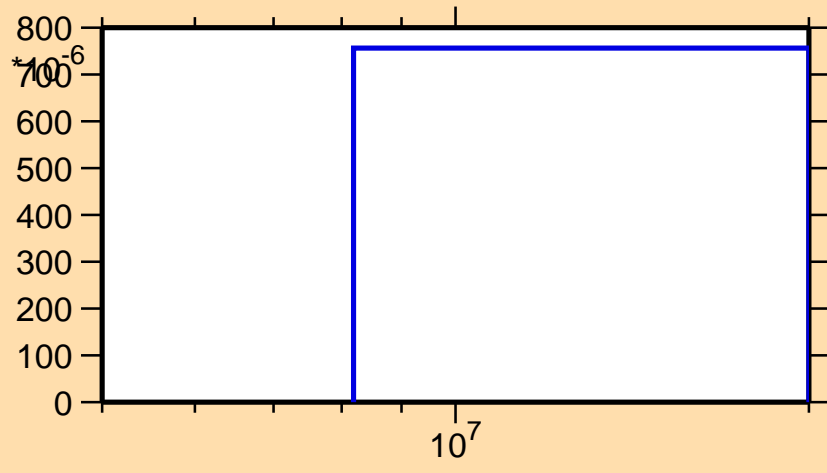


800  
700  
600  
500  
400  
300  
200  
100  
0

$10^7$





Correlation Matrix



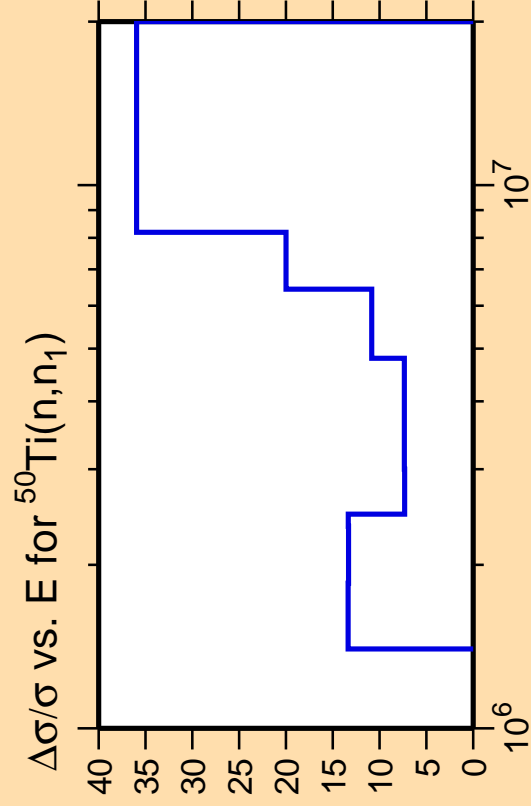


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

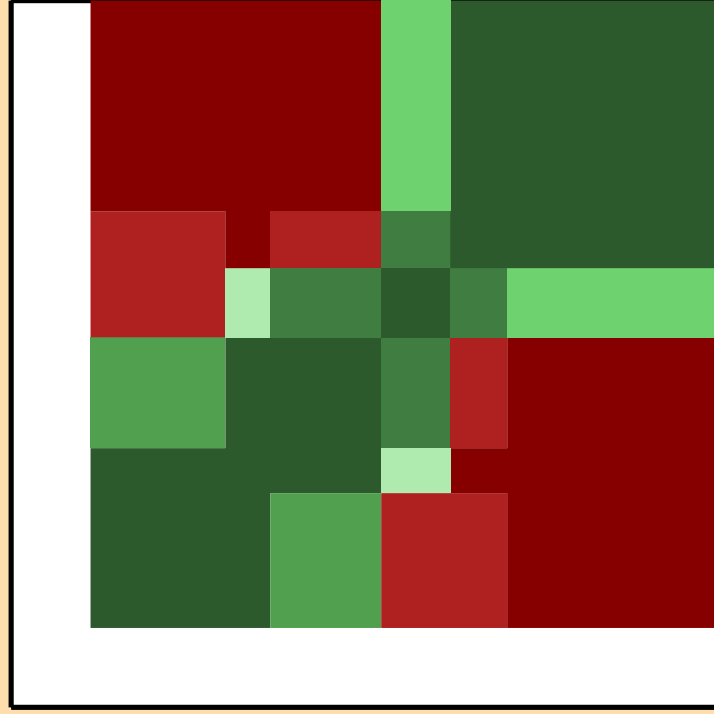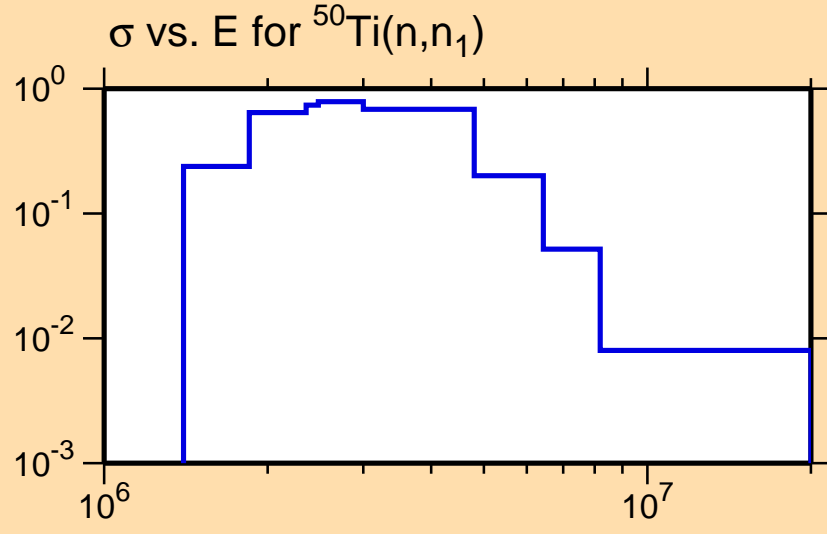



Correlation Matrix



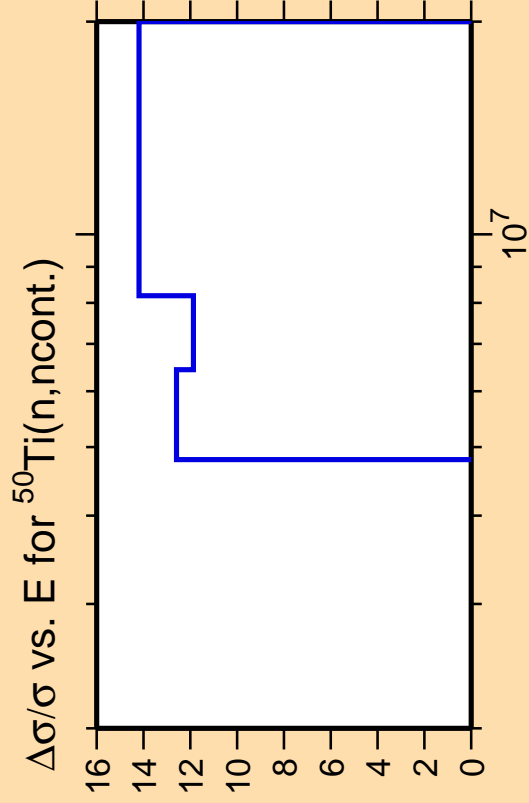


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

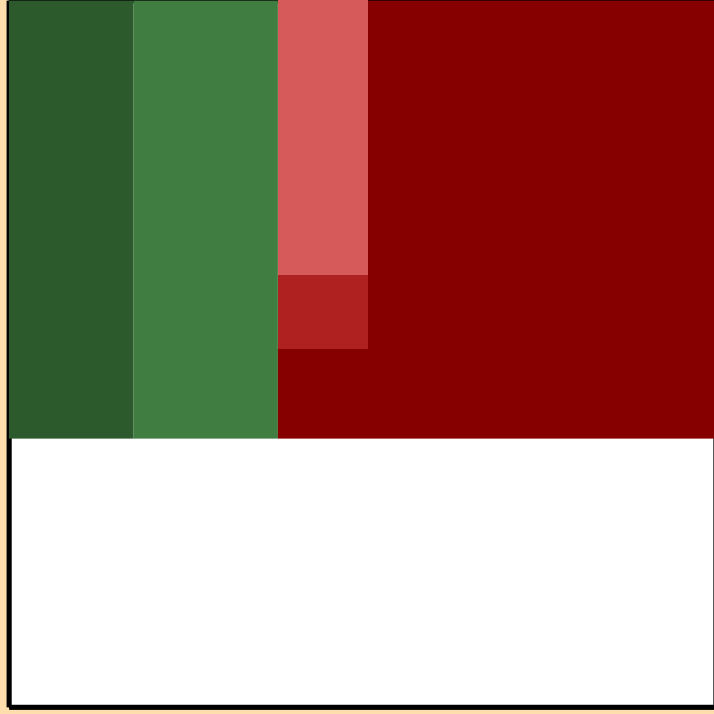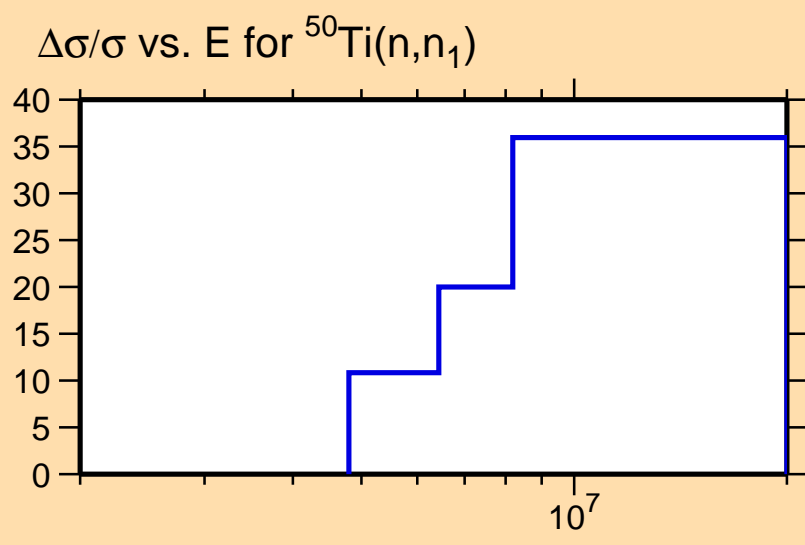

Correlation Matrix




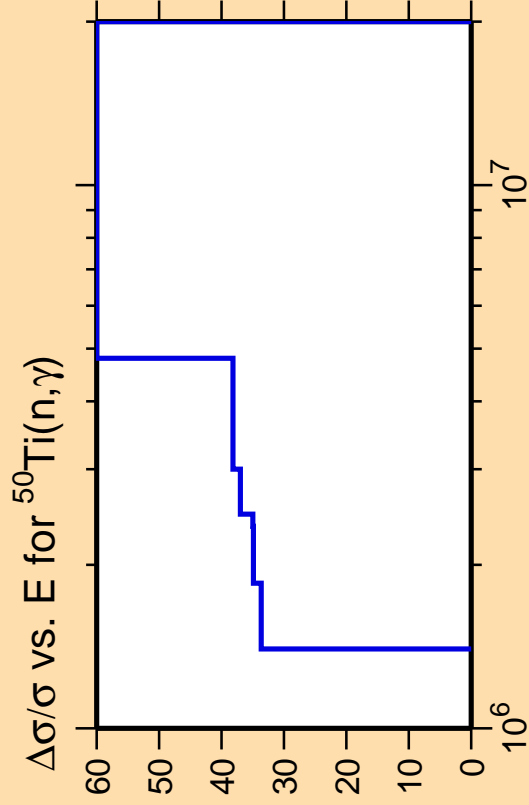


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

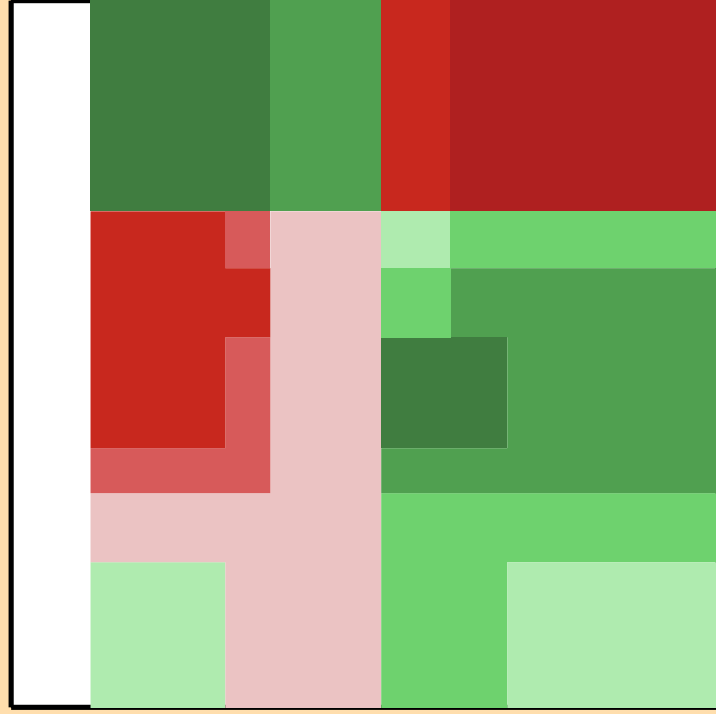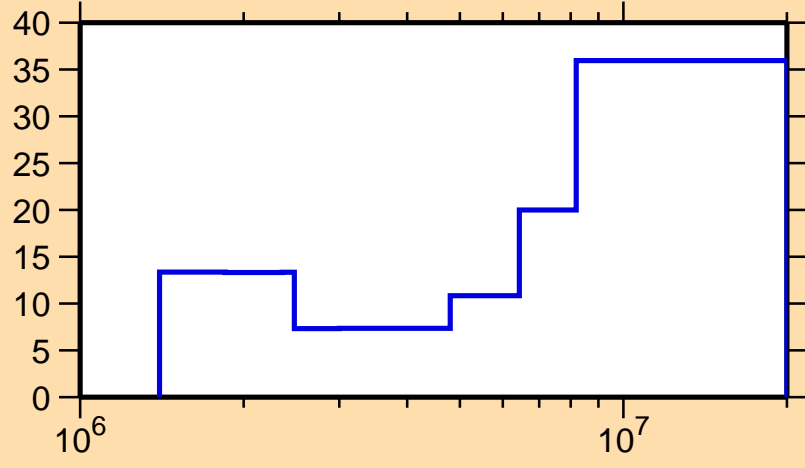

Correlation Matrix





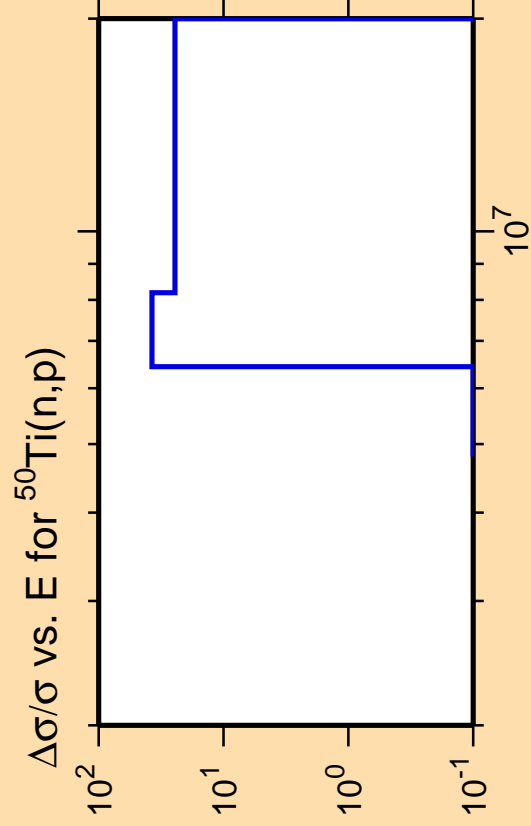

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

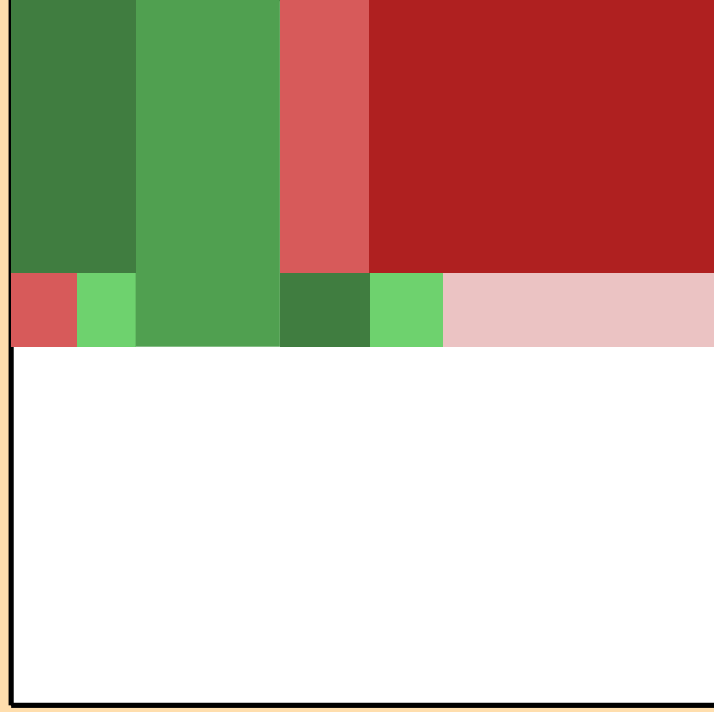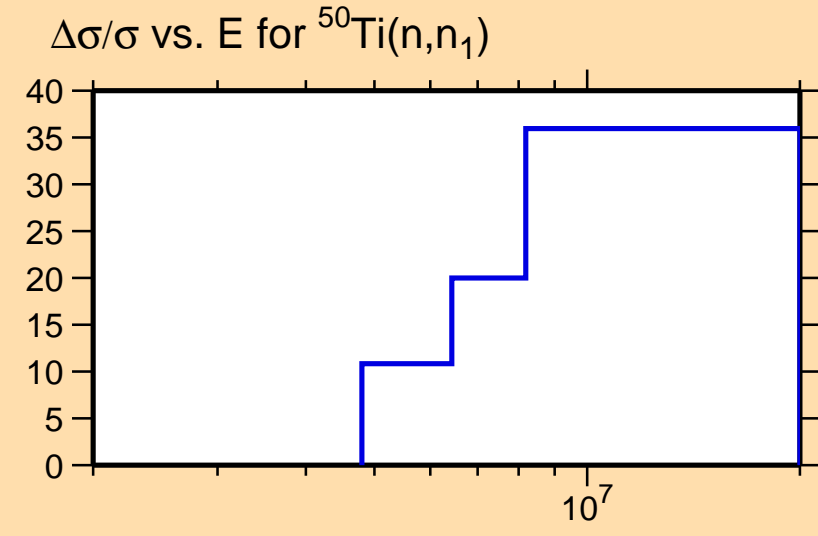

Correlation Matrix




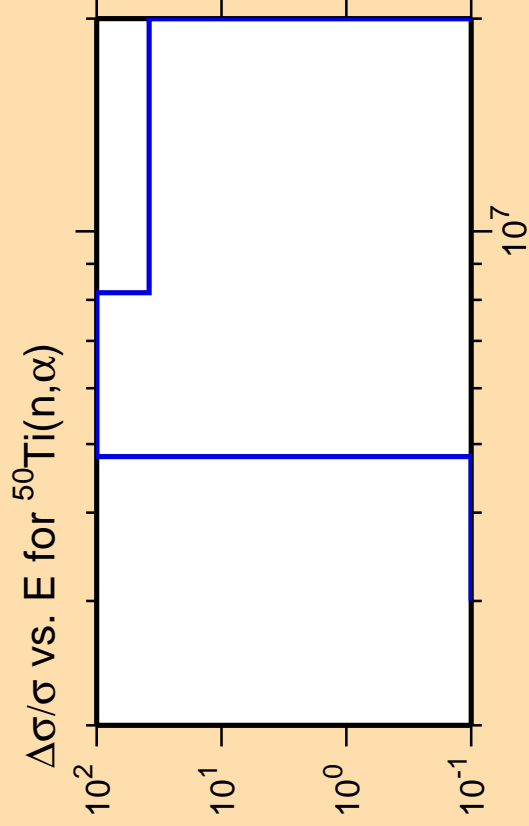


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

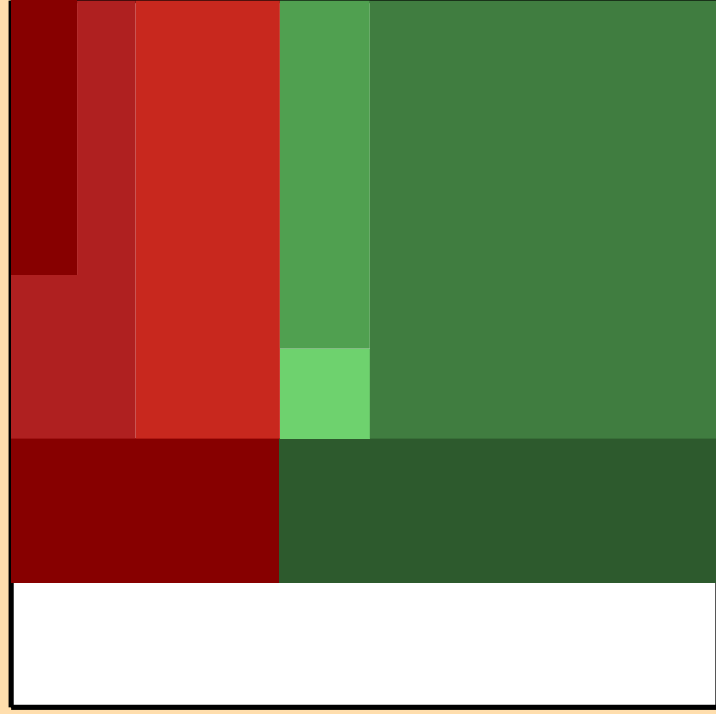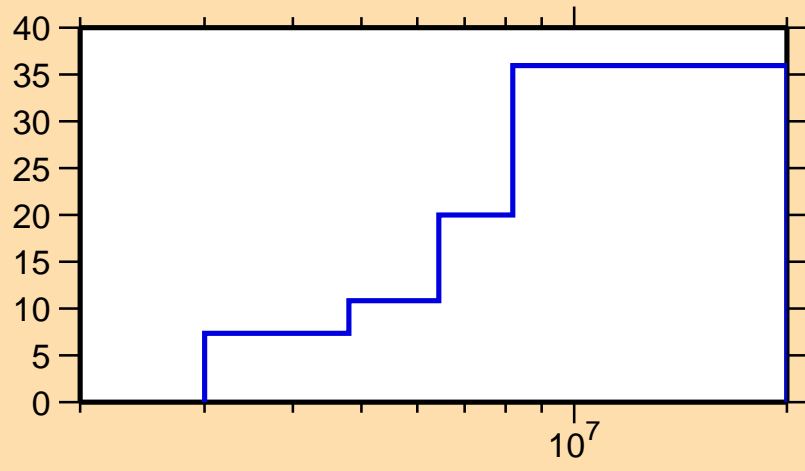

Correlation Matrix







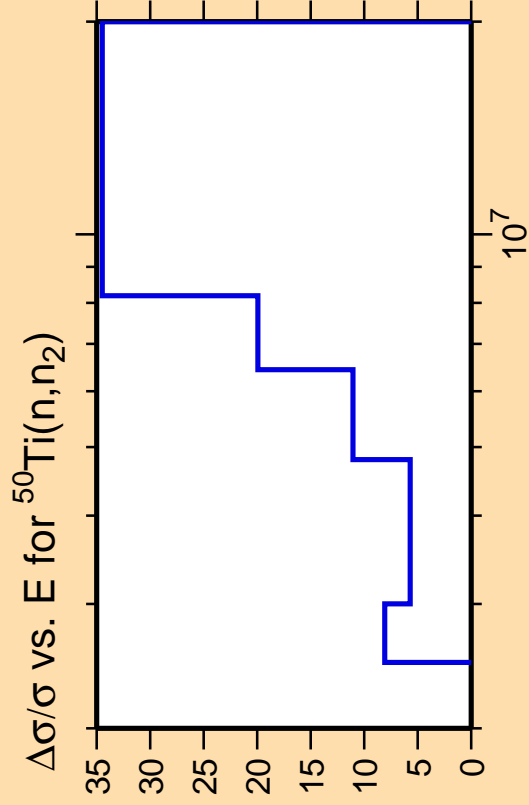

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

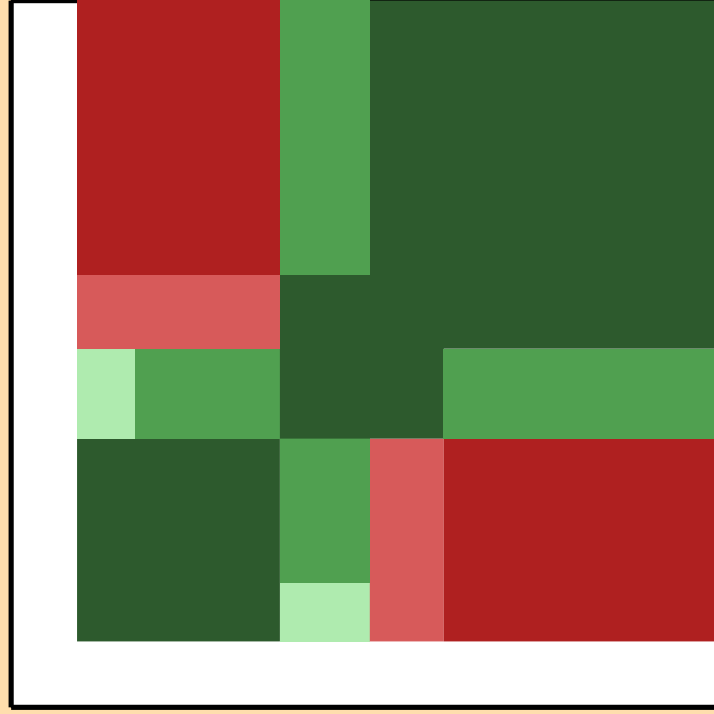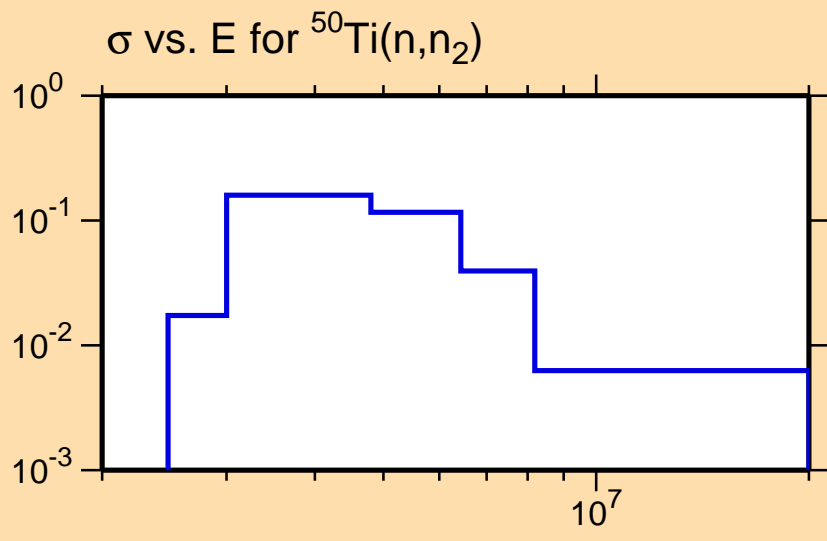

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_3)$

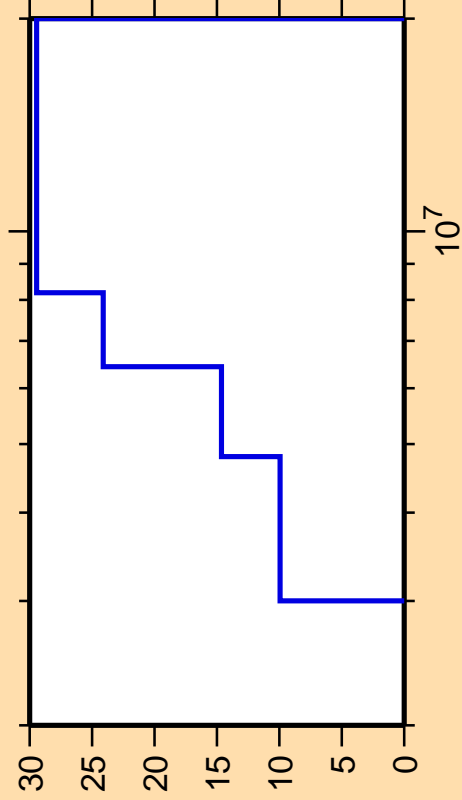

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,n_3)$

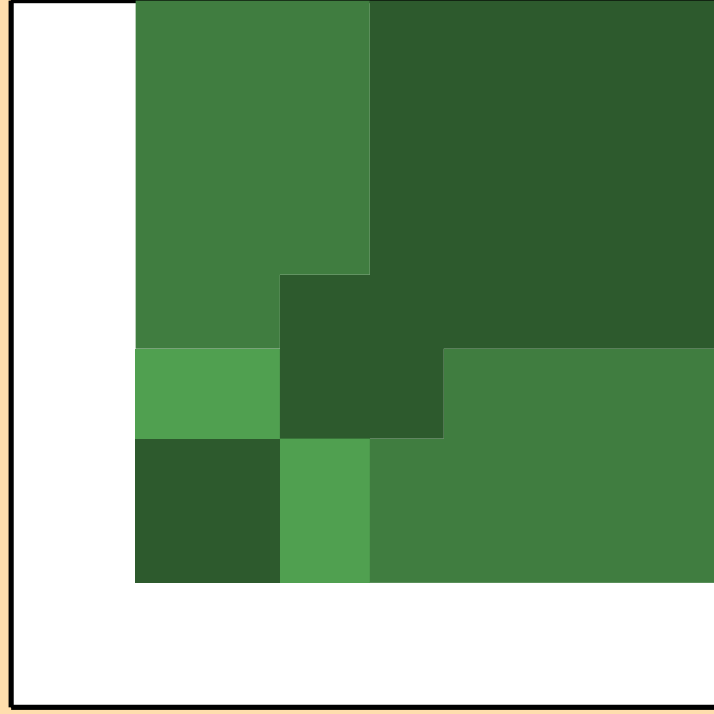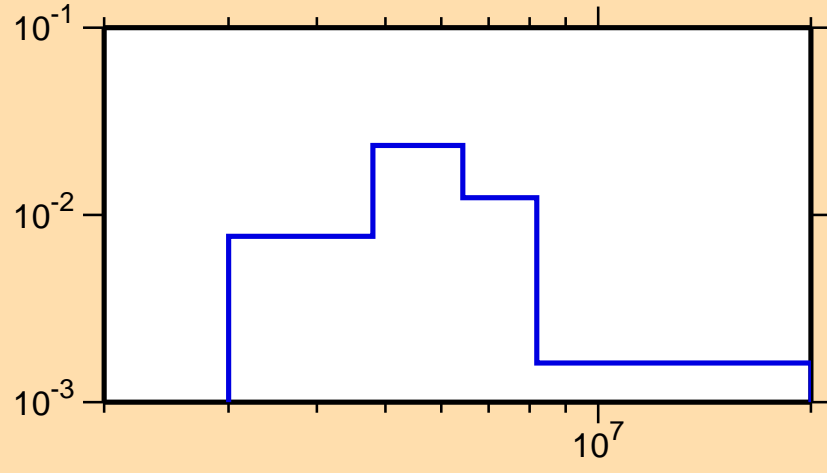



Correlation Matrix



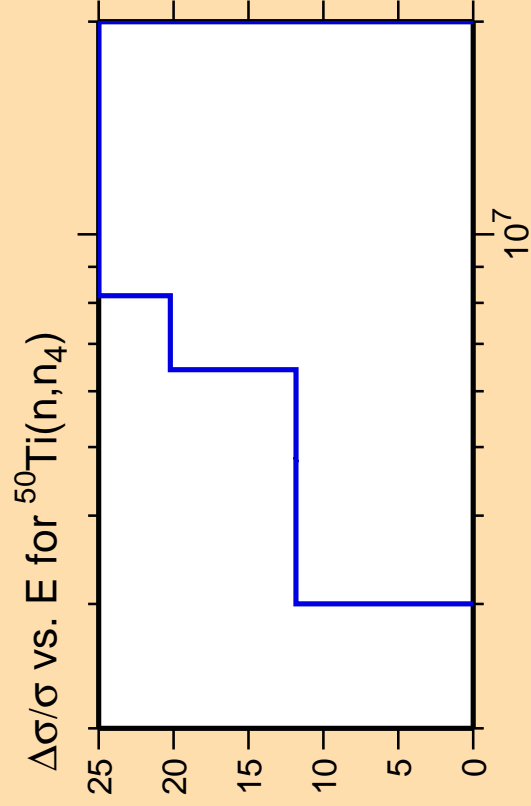

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

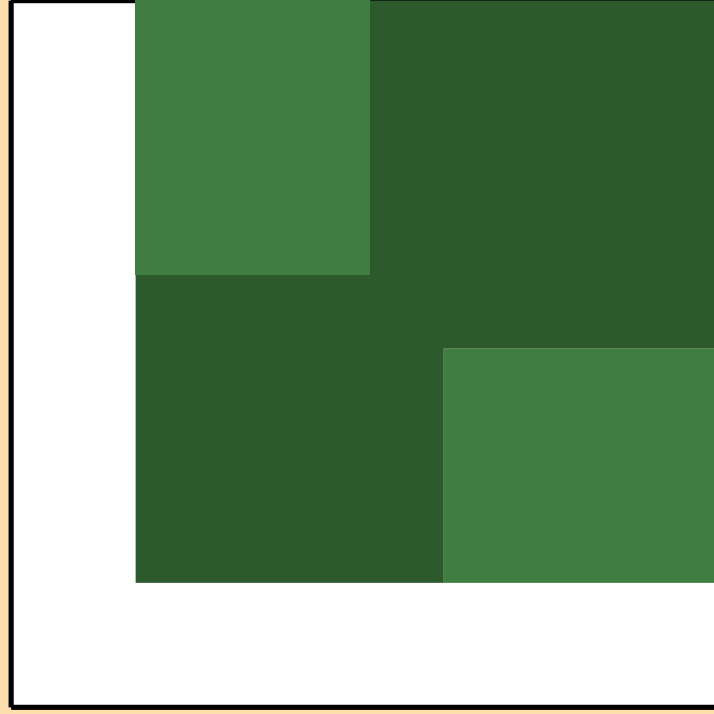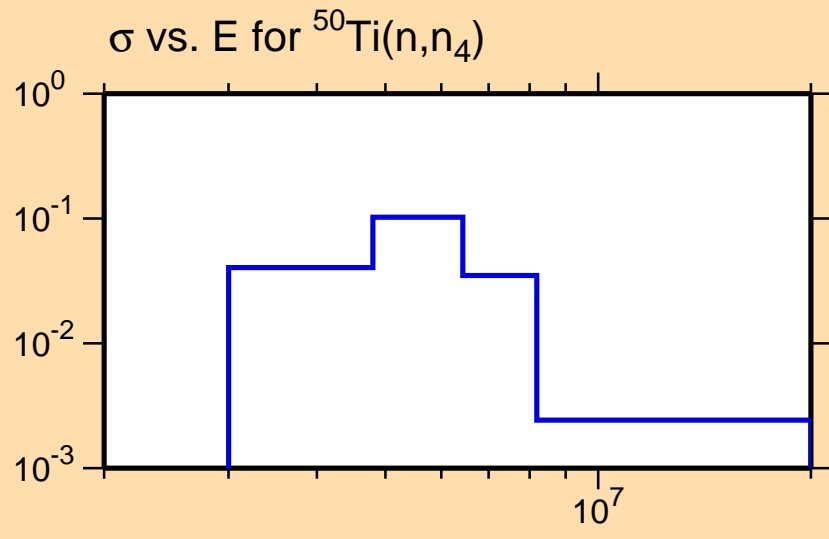

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

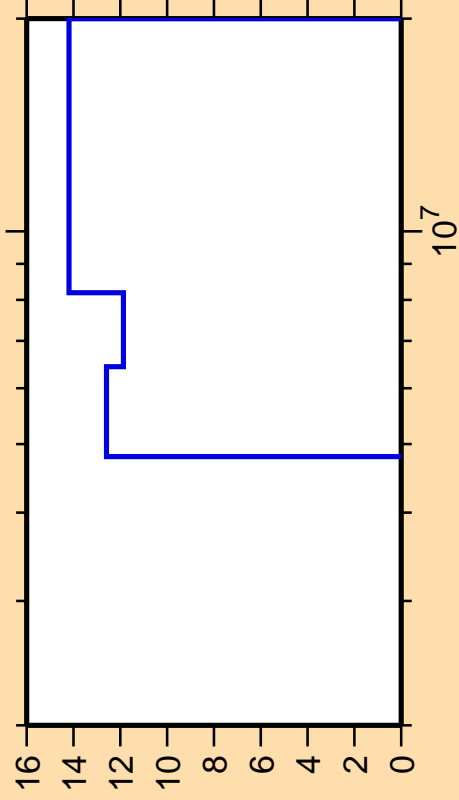

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

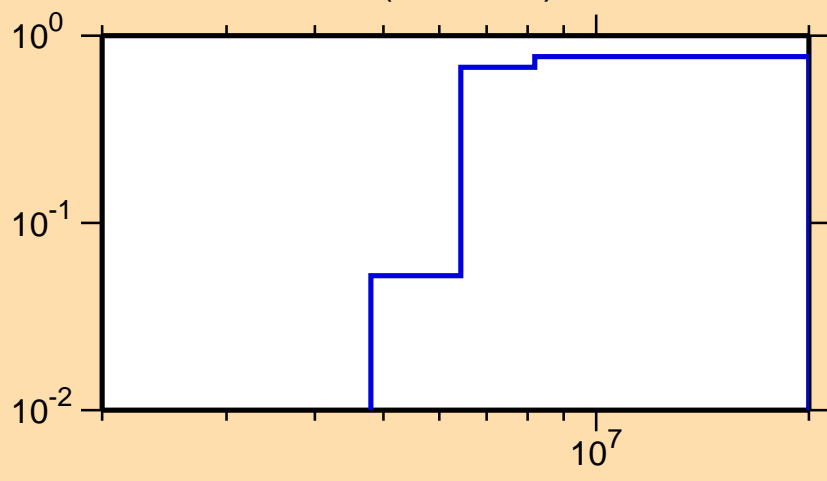

Correlation Matrix




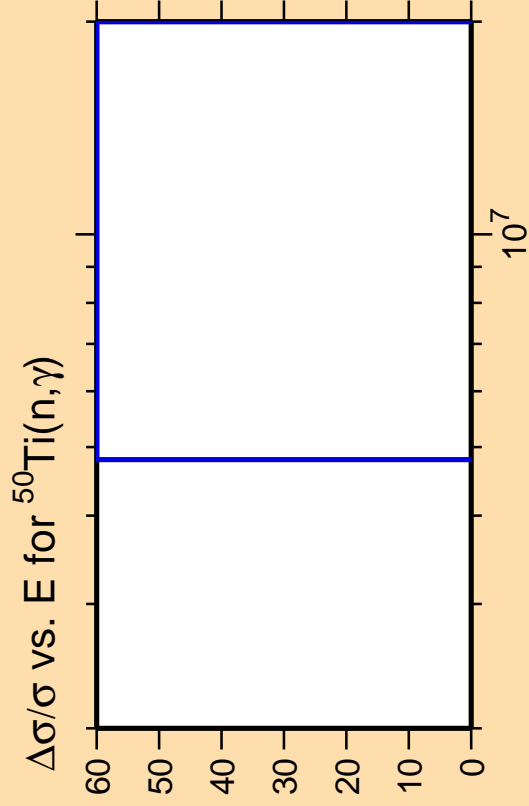


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

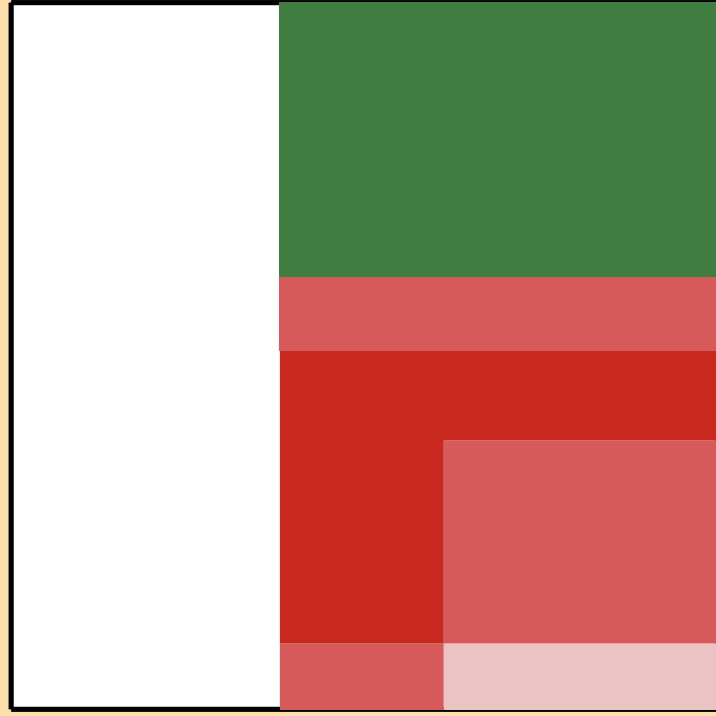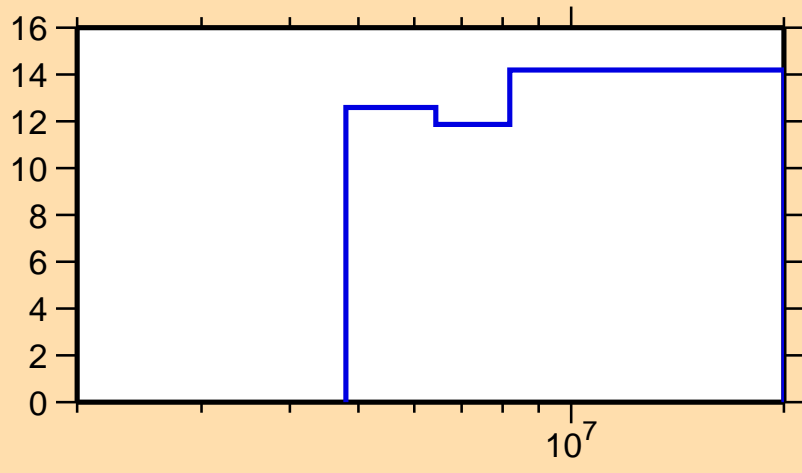

Correlation Matrix




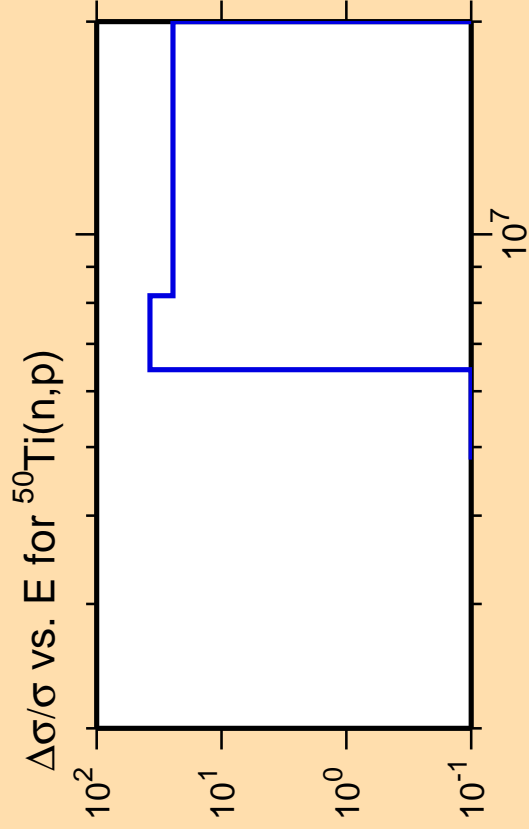


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

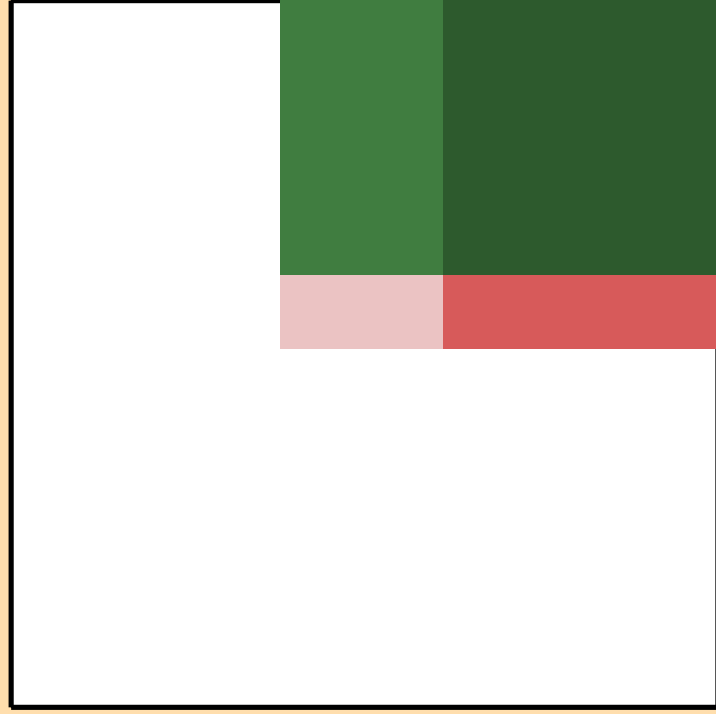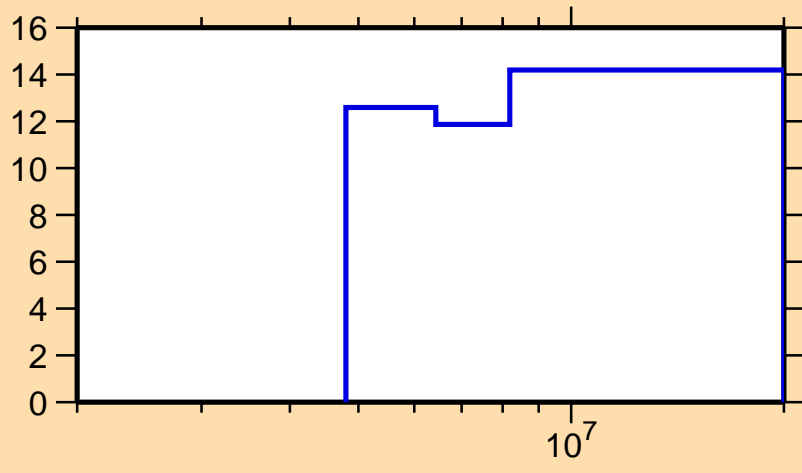

Correlation Matrix




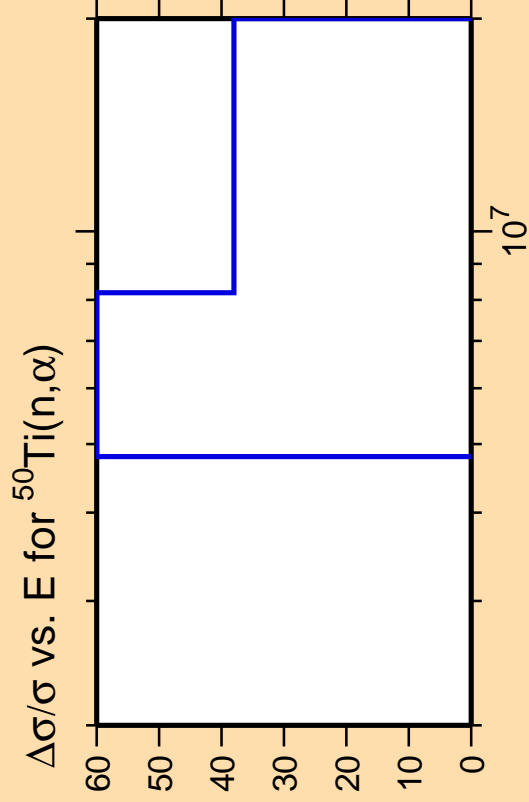


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

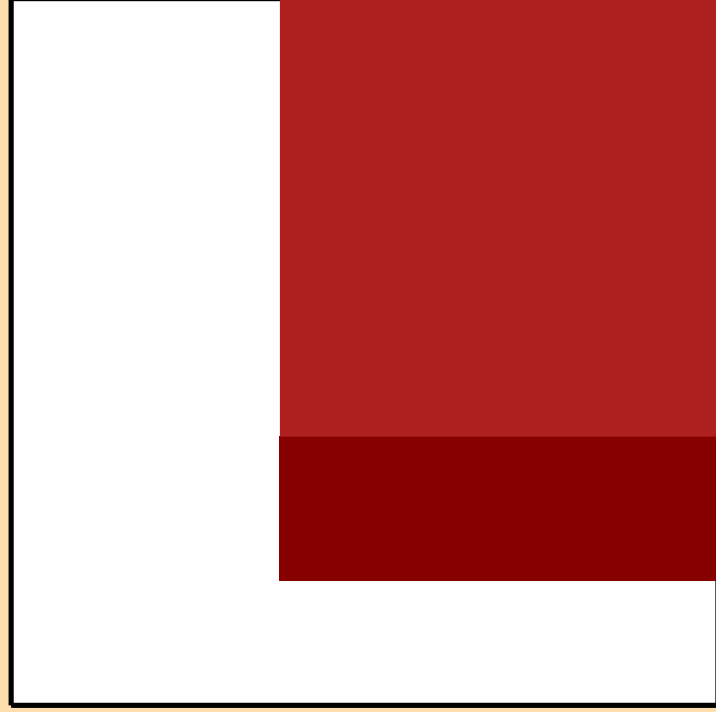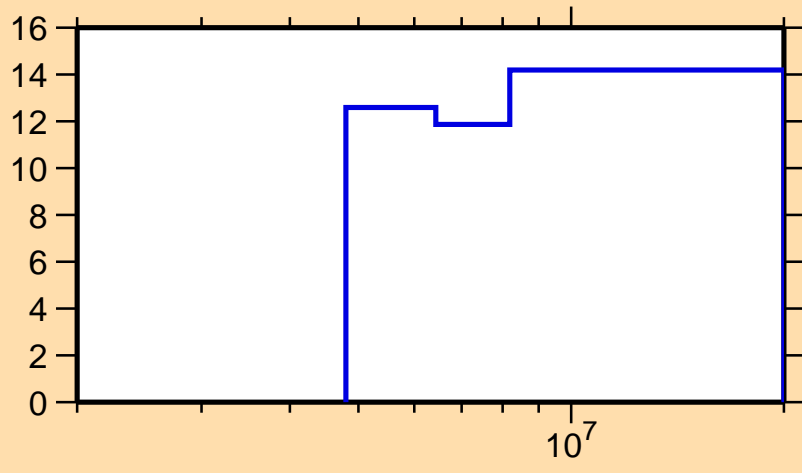

Correlation Matrix




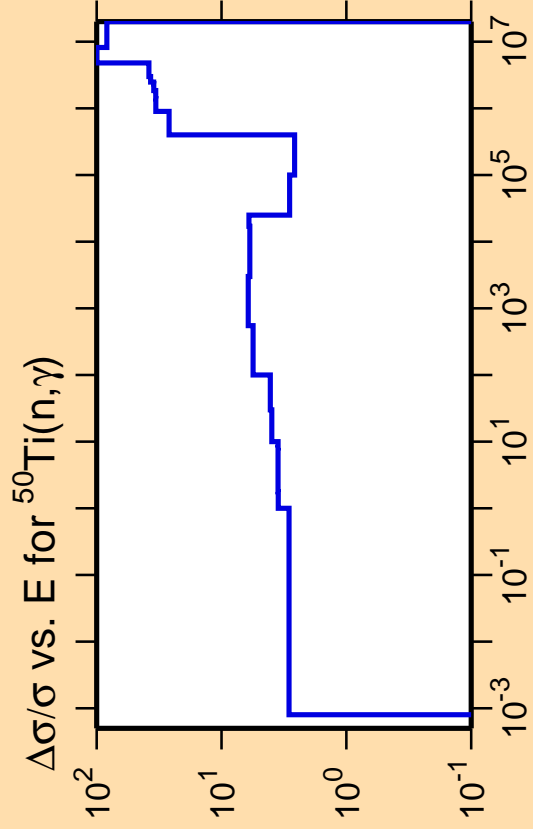


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

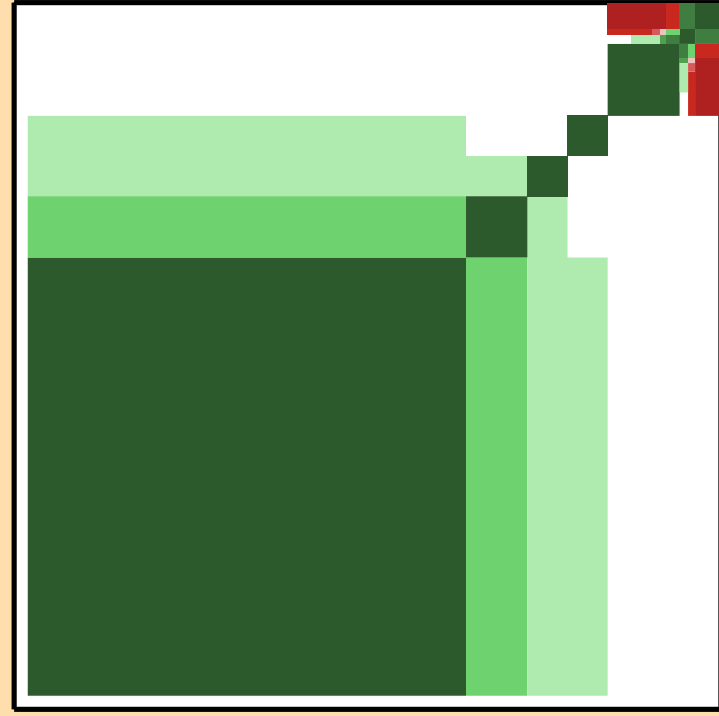


$\sigma$  vs. E for  $^{50}\text{Ti}(n,\gamma)$

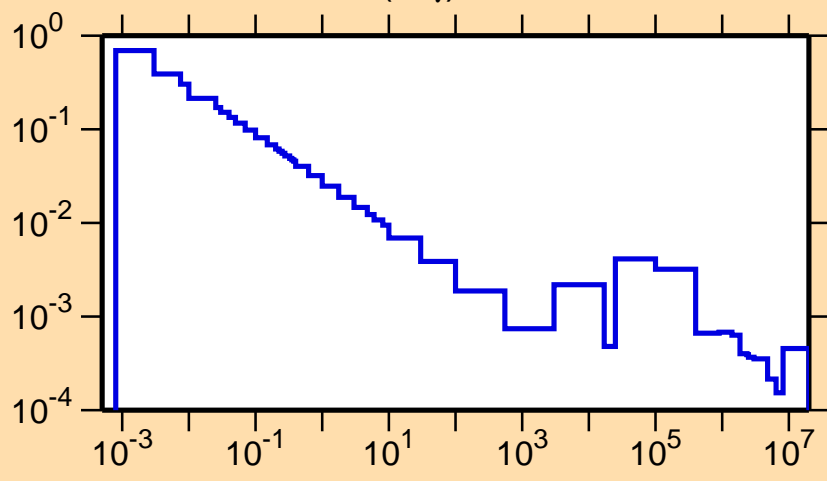

Correlation Matrix






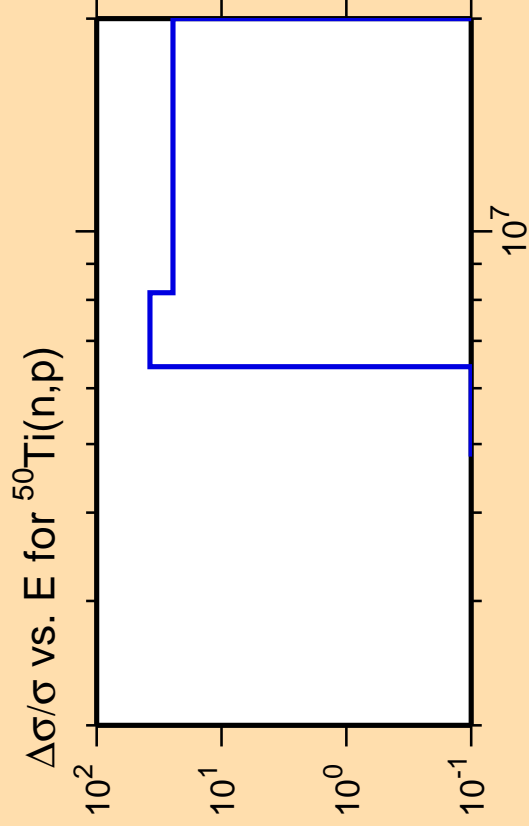


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\gamma)$

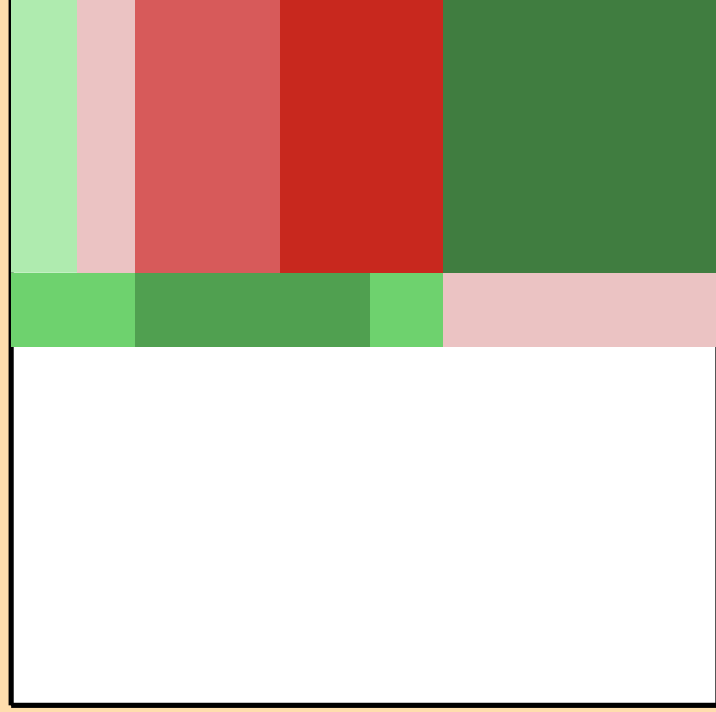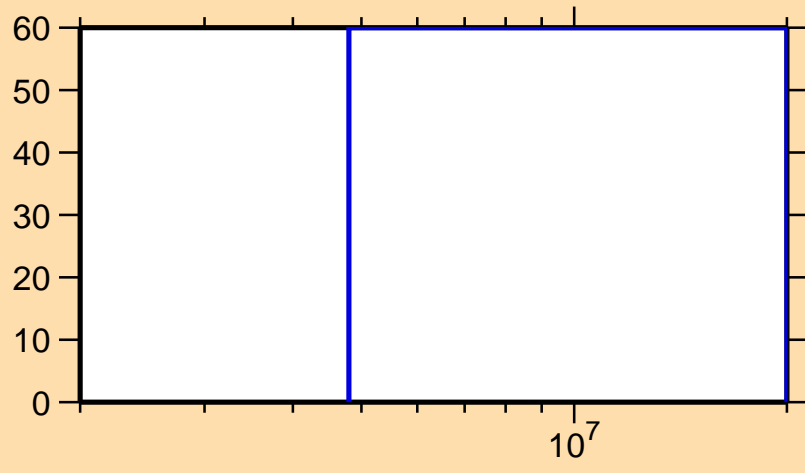

Correlation Matrix





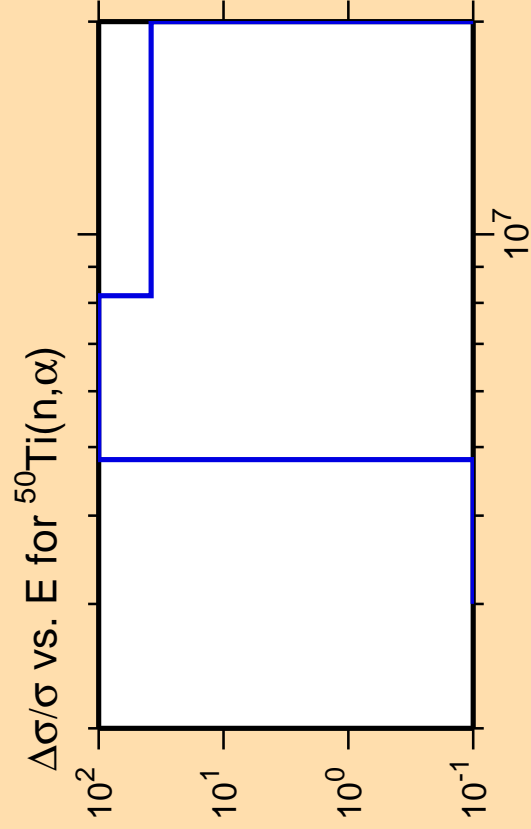

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

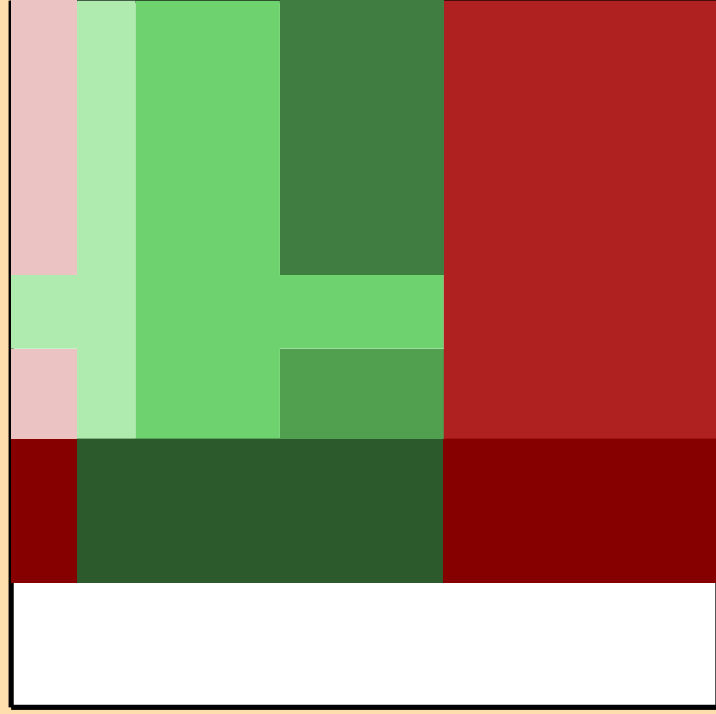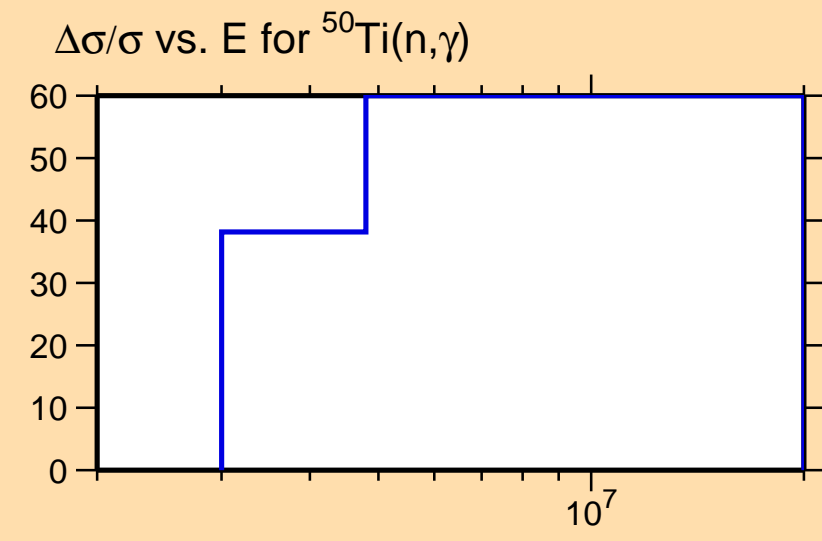

Correlation Matrix





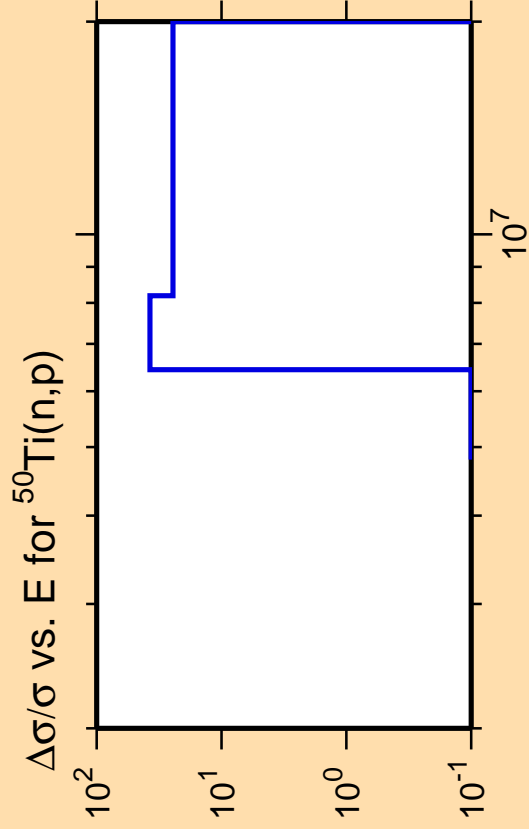

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

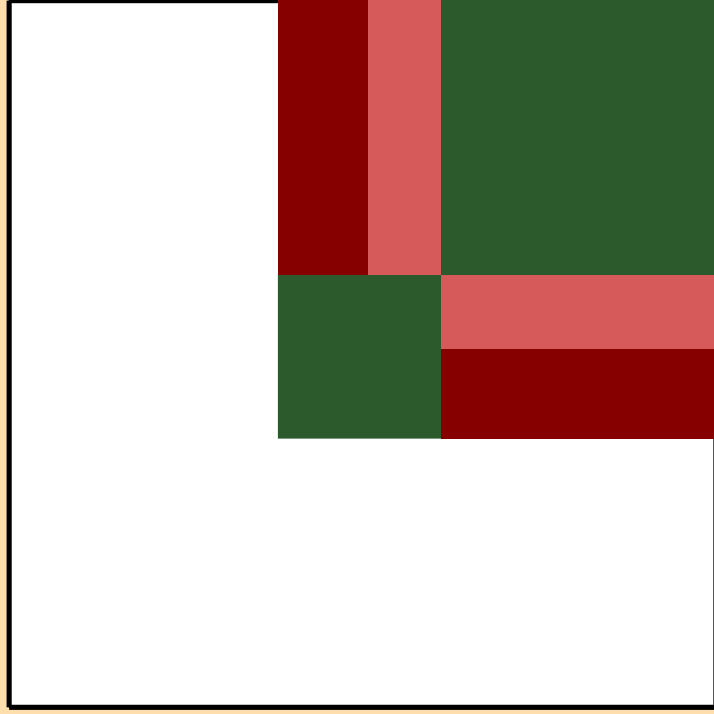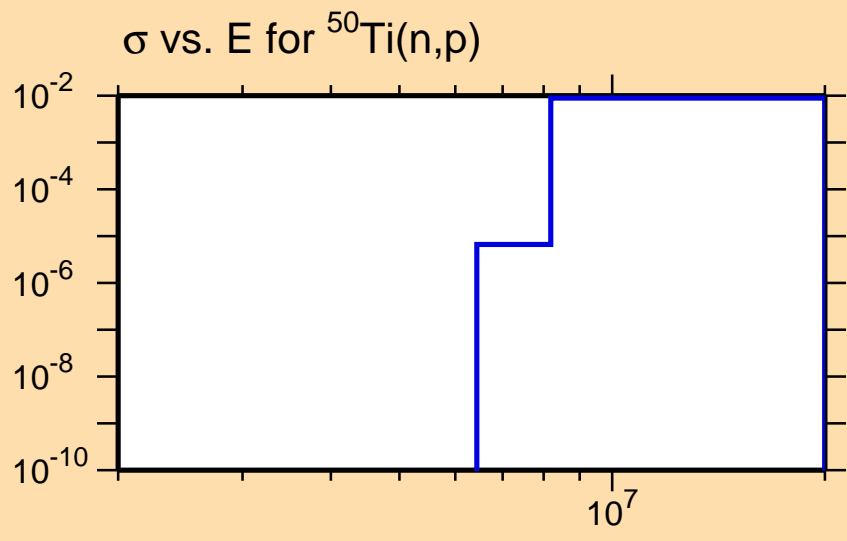

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,d)$

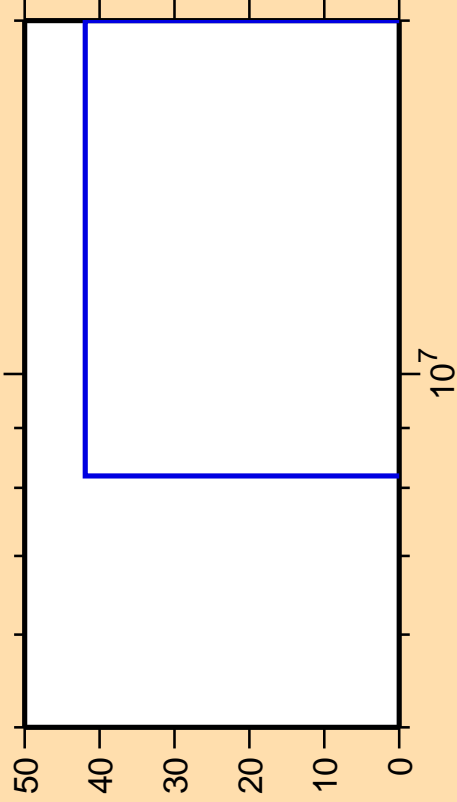

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,d)$

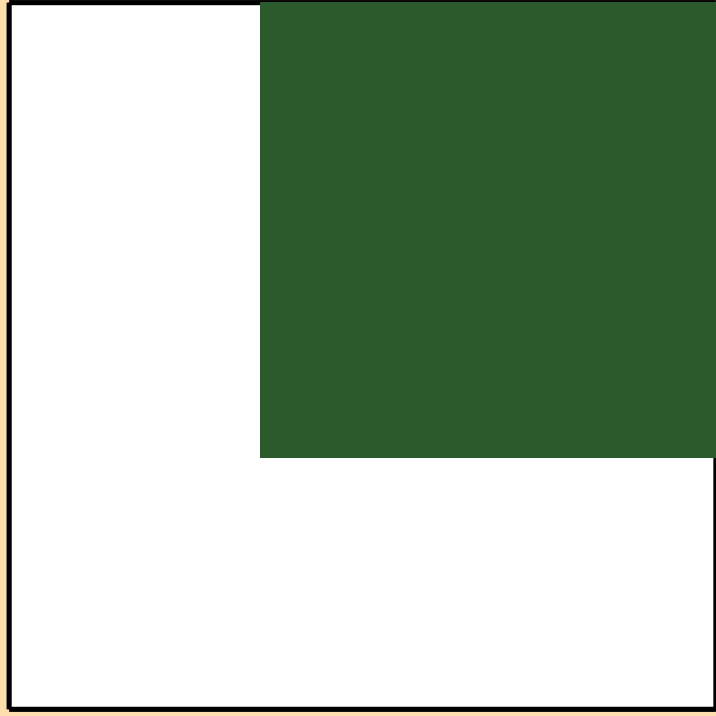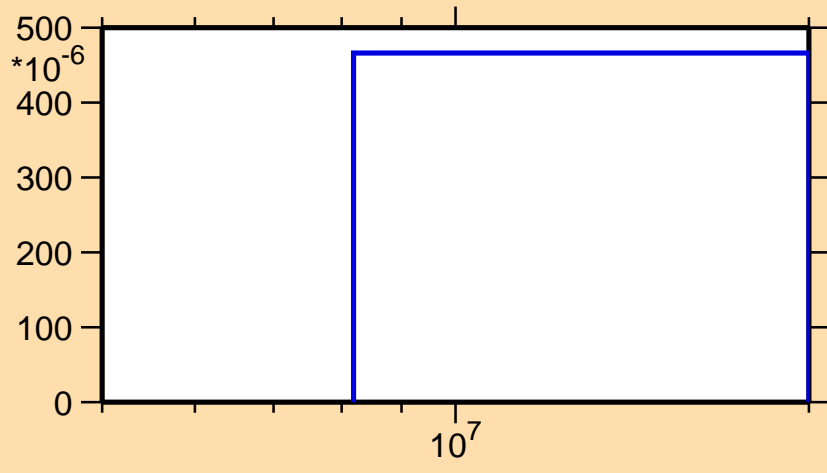

Correlation Matrix





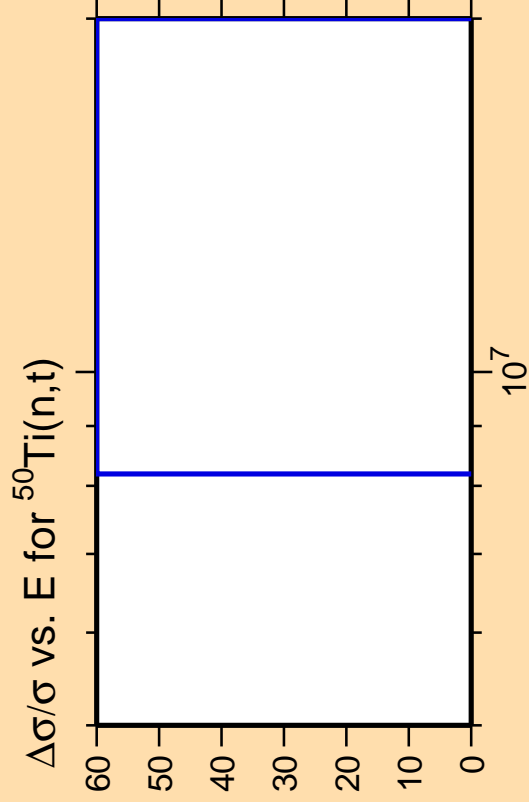

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

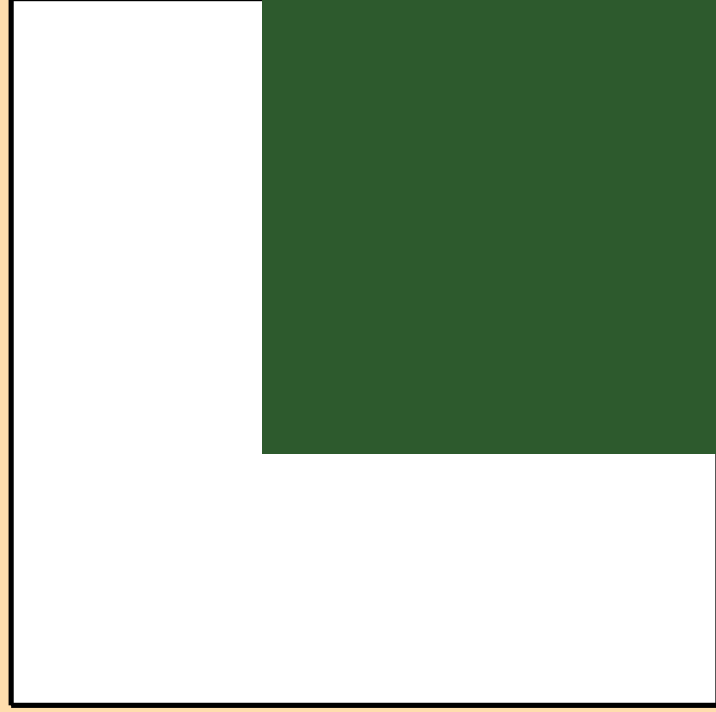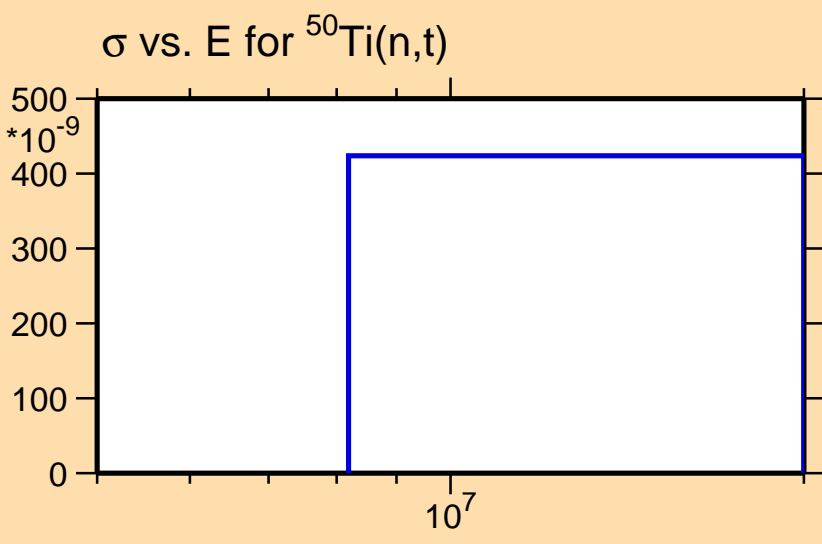

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{He3})$

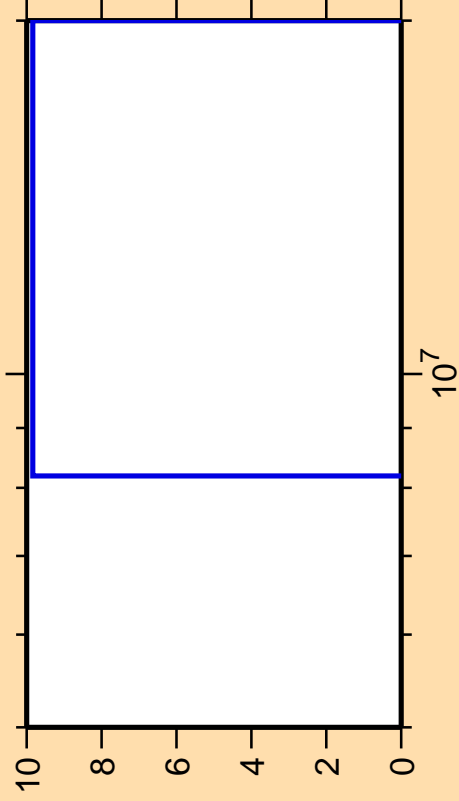

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{He3})$

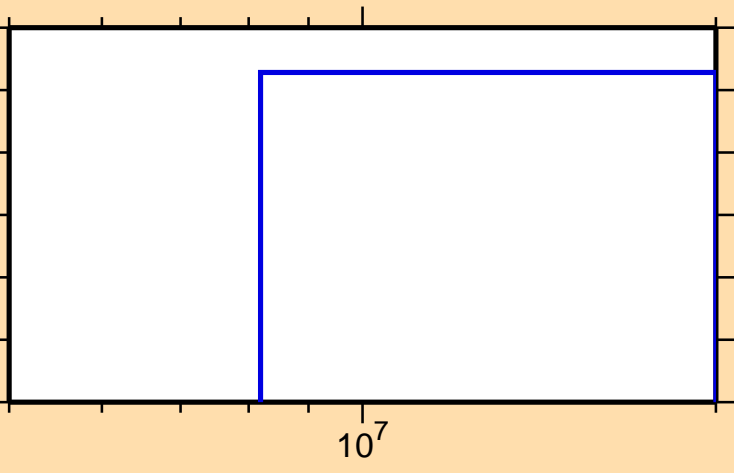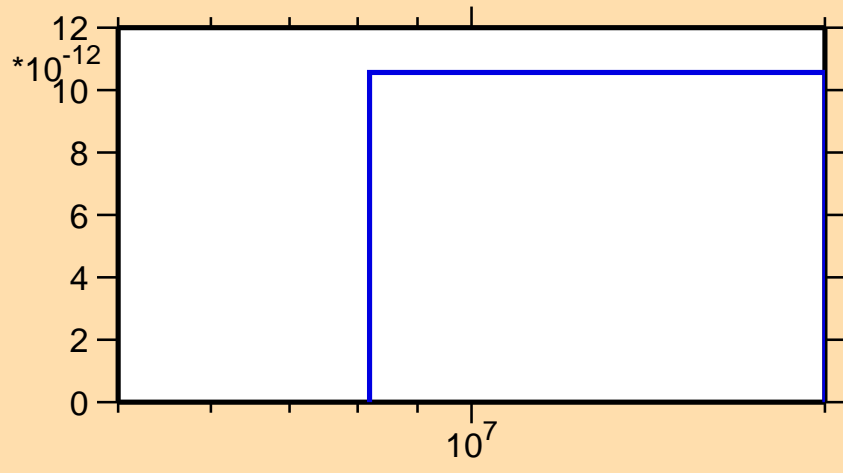

Correlation Matrix




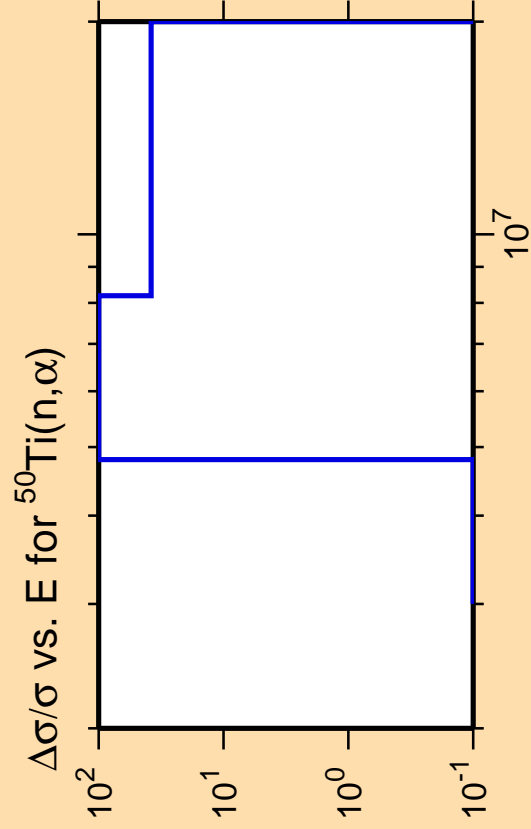

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

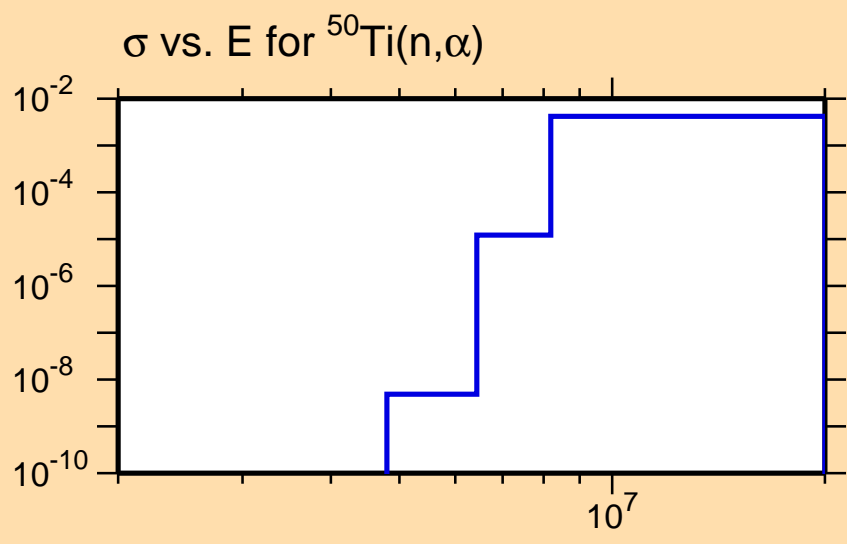

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p\alpha)$

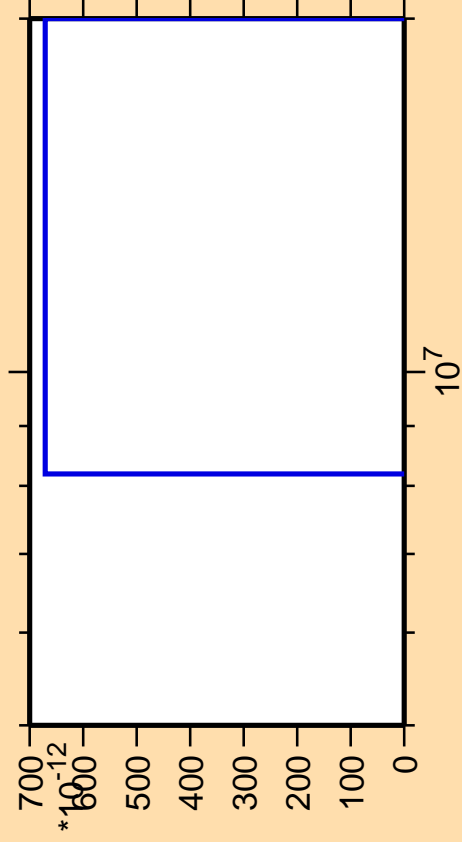

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,p\alpha)$

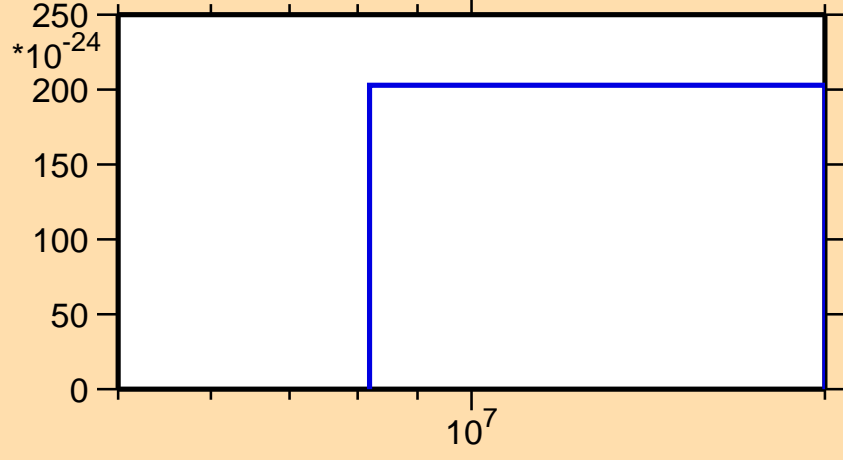


Correlation Matrix






$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,pd)$

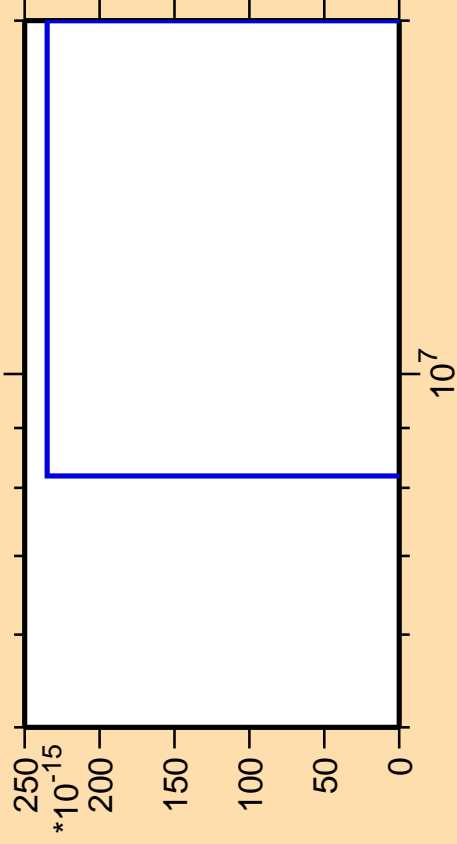

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,pd)$

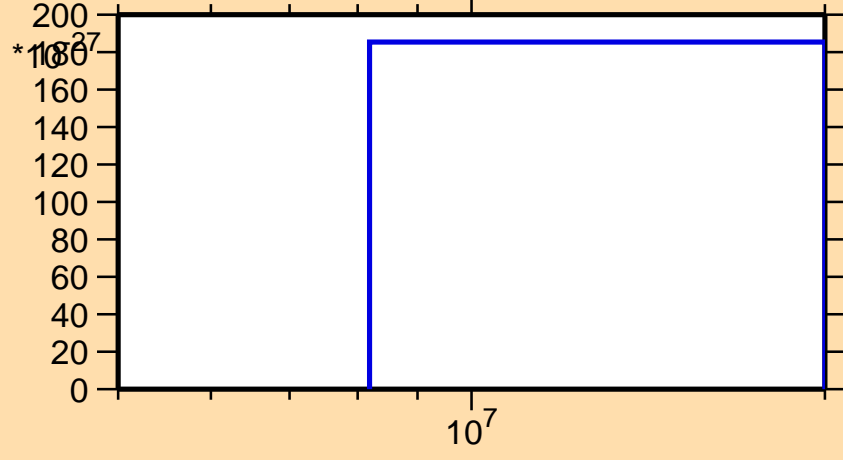

Correlation Matrix

