
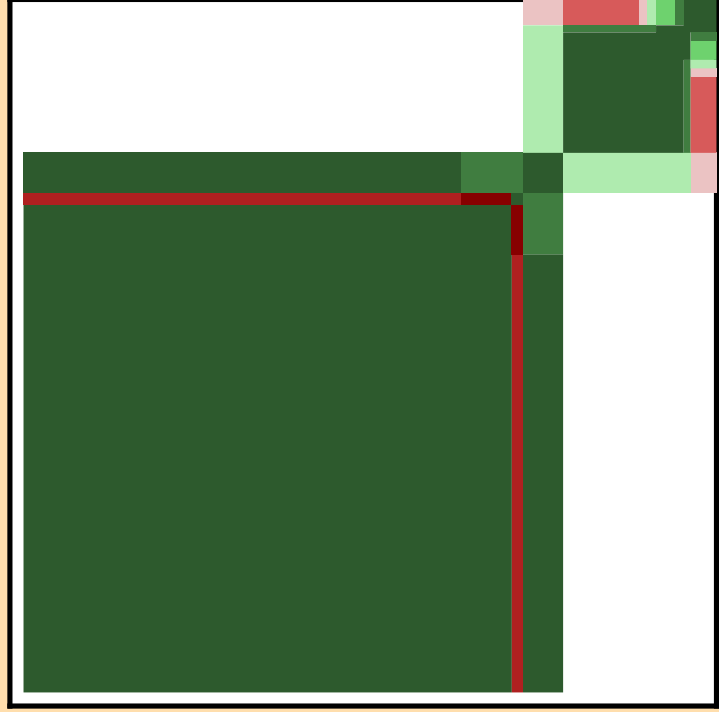


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

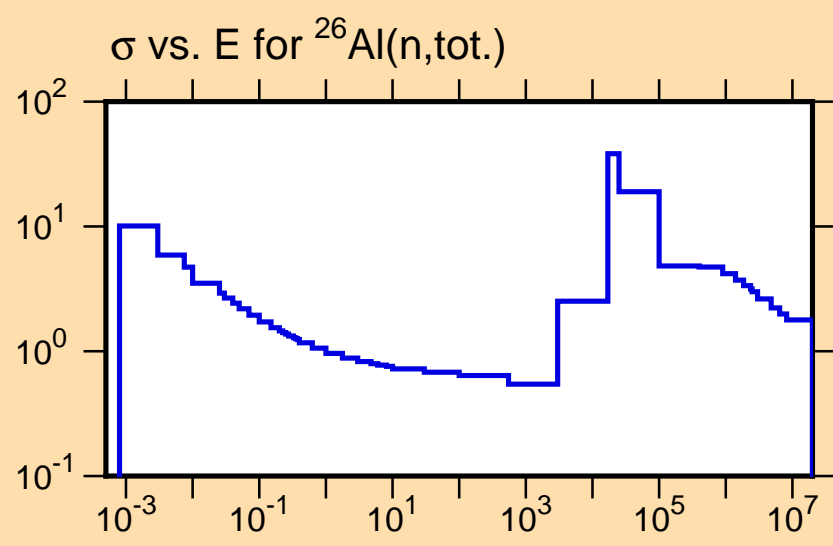

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$


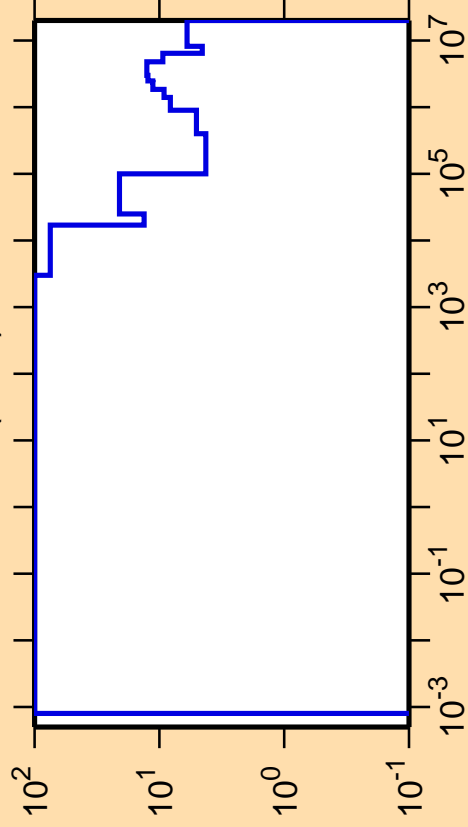


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

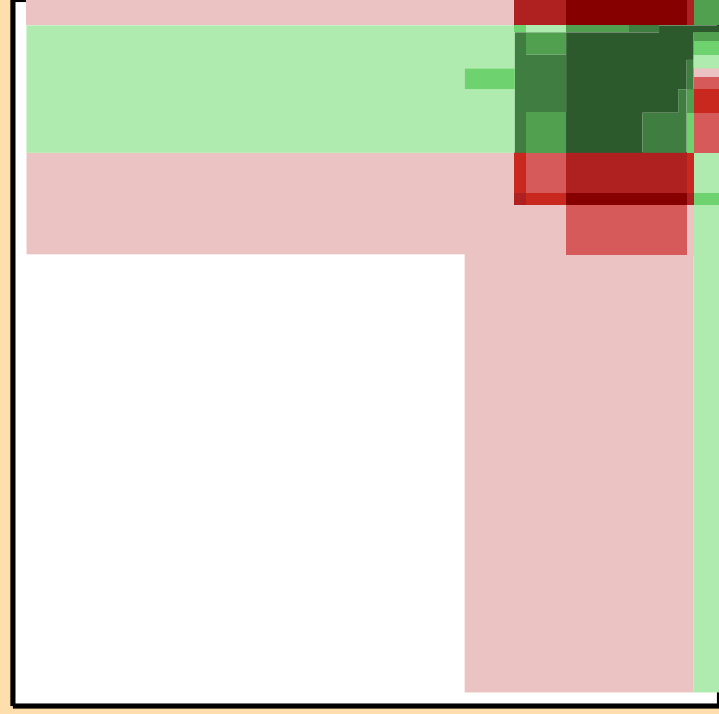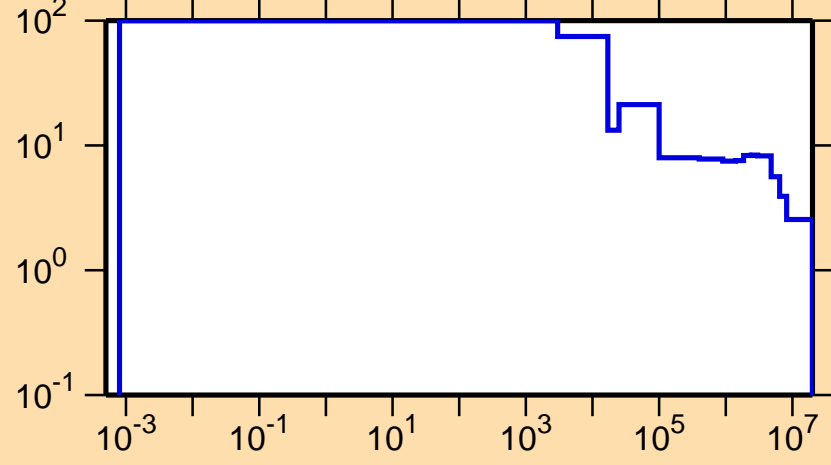

Correlation Matrix

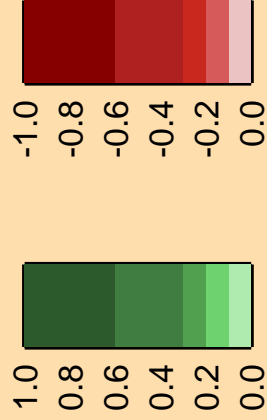

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$


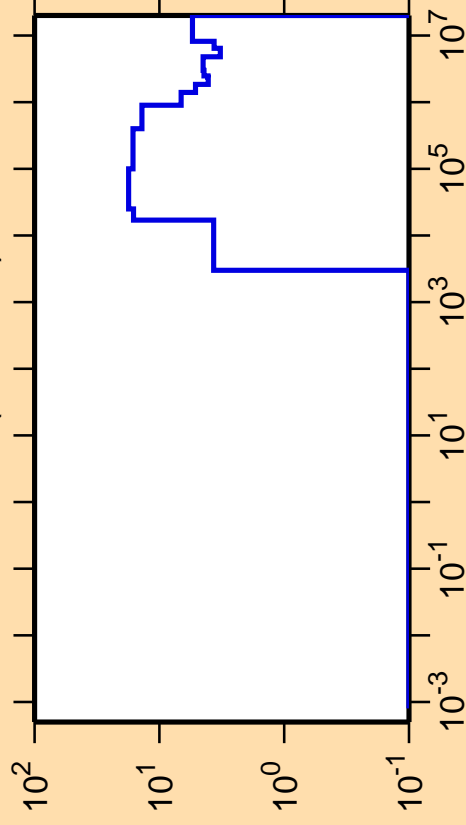


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

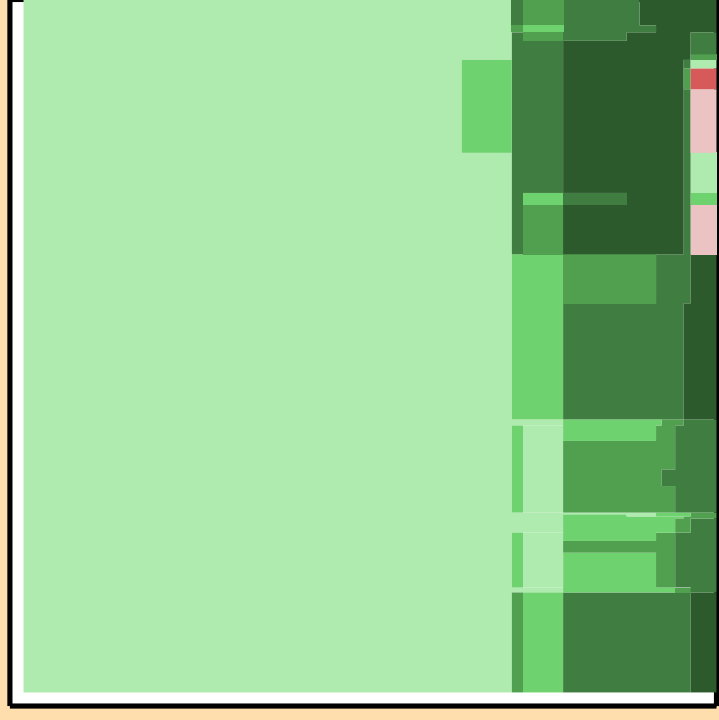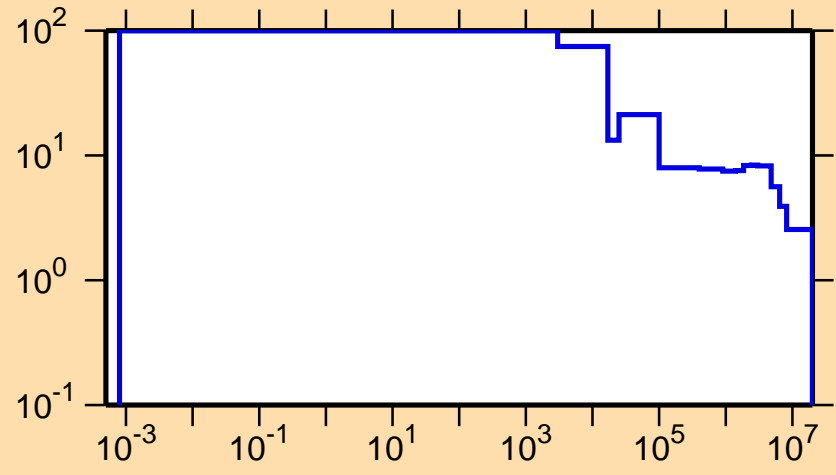

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{inel.})$

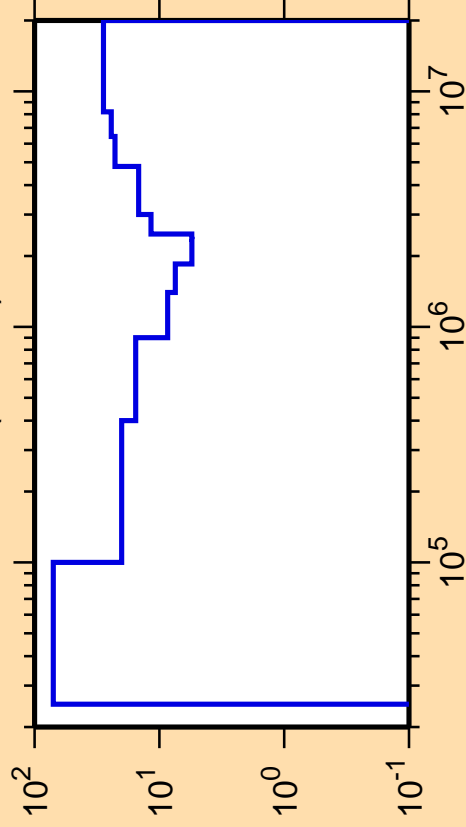

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

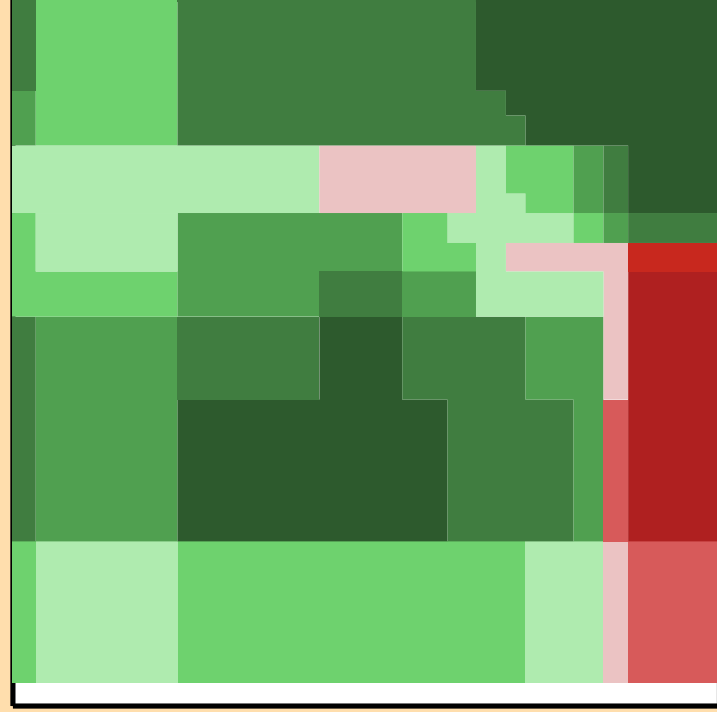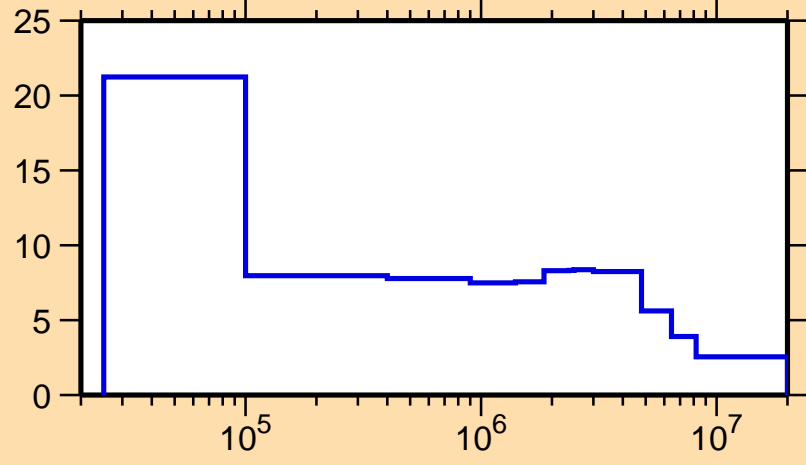

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

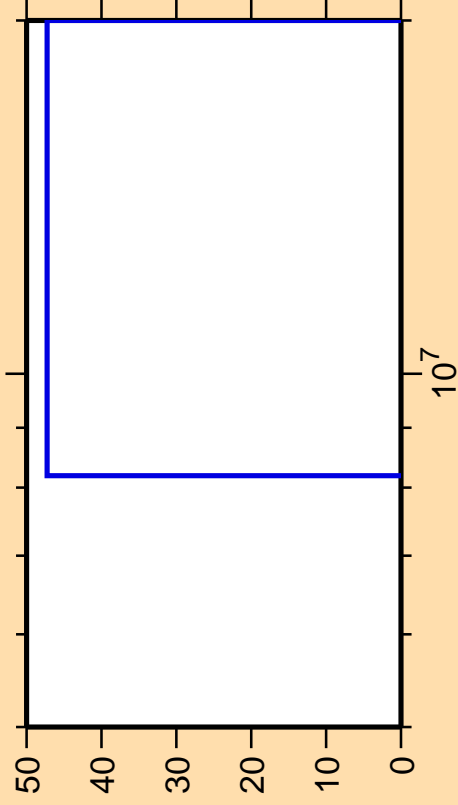

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

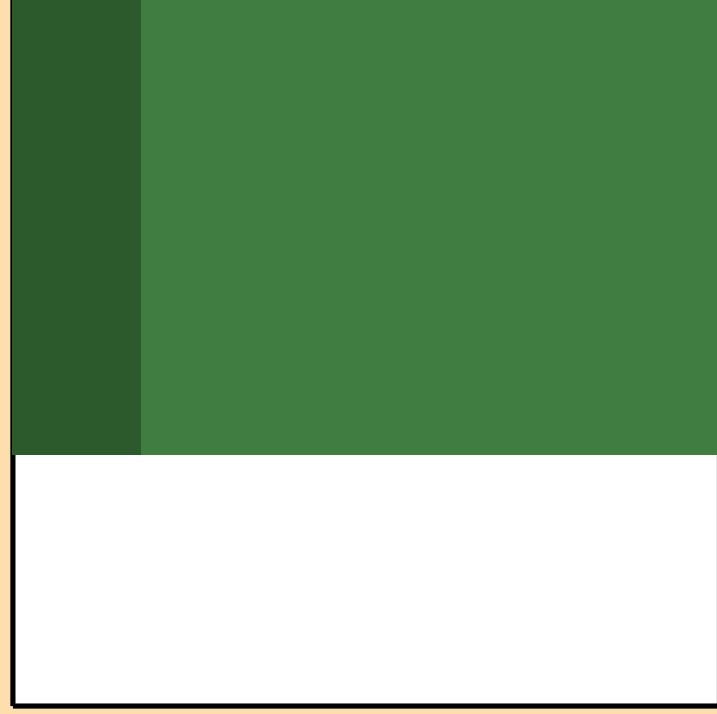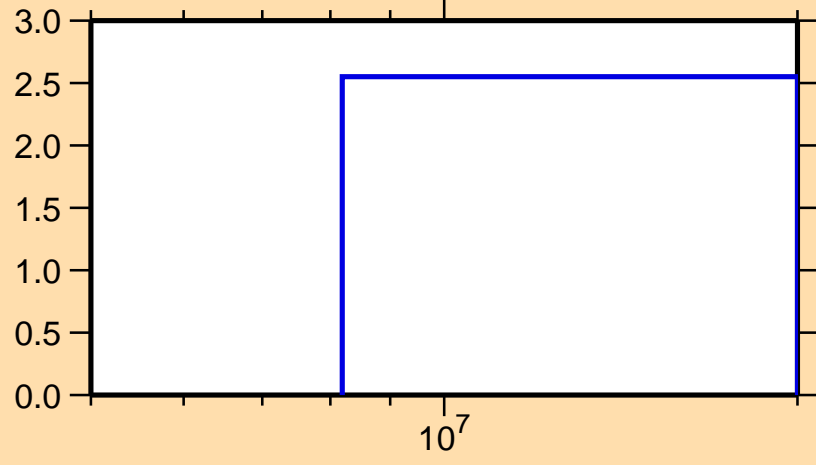

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

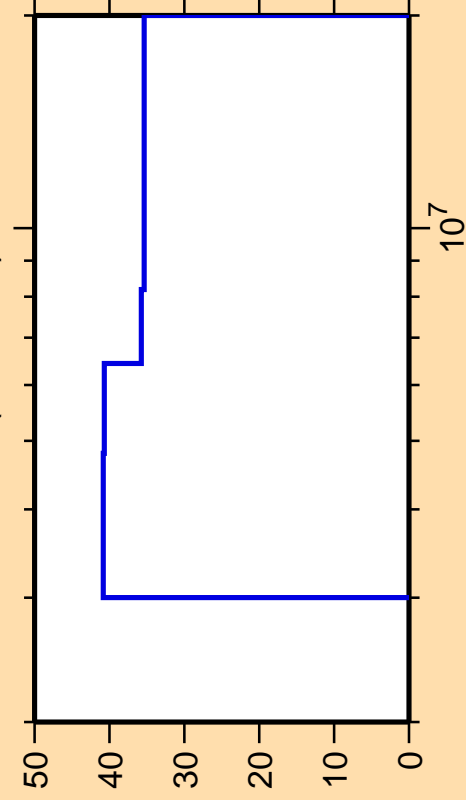

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

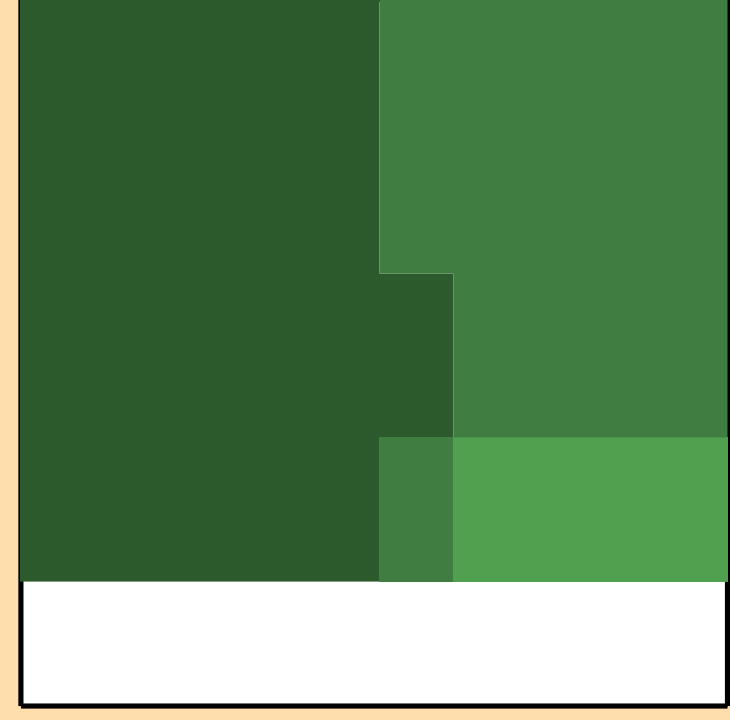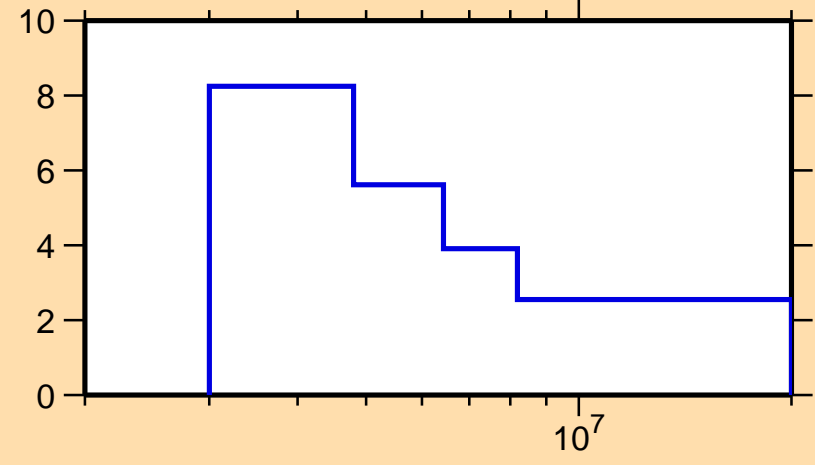

Correlation Matrix





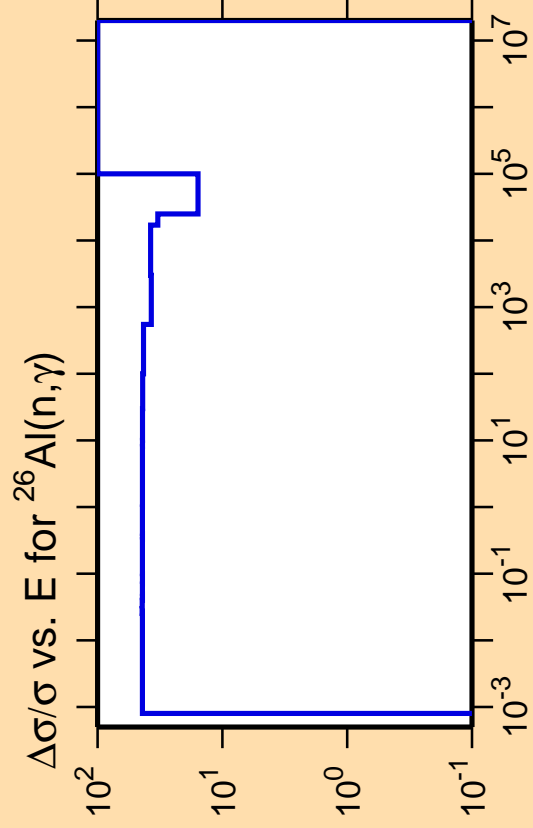

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

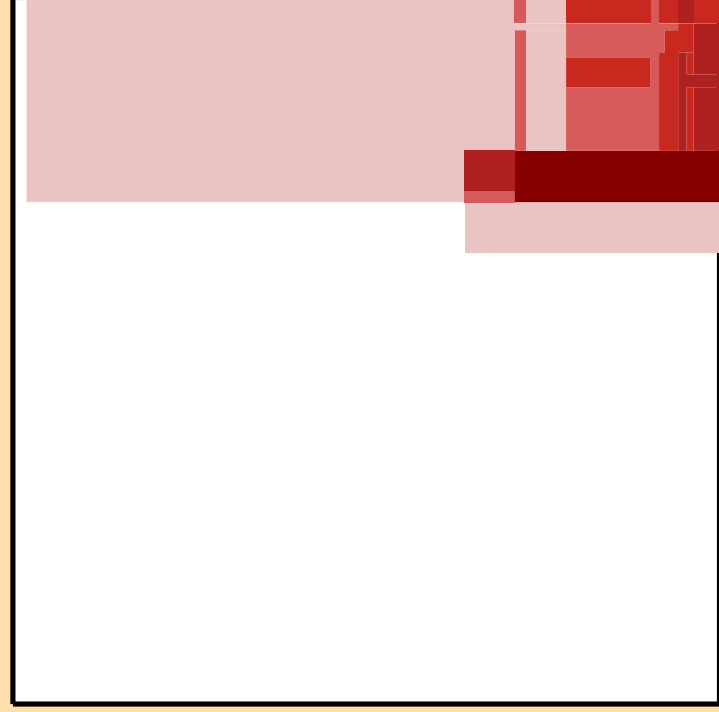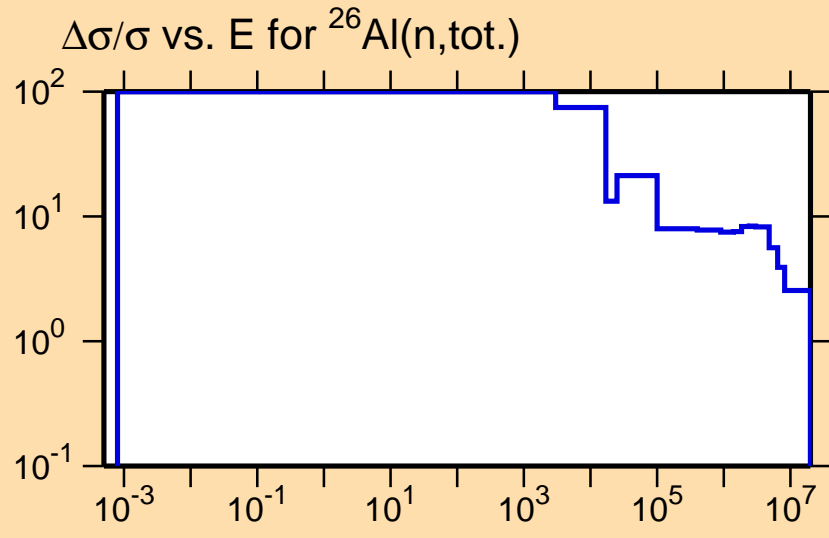

Correlation Matrix





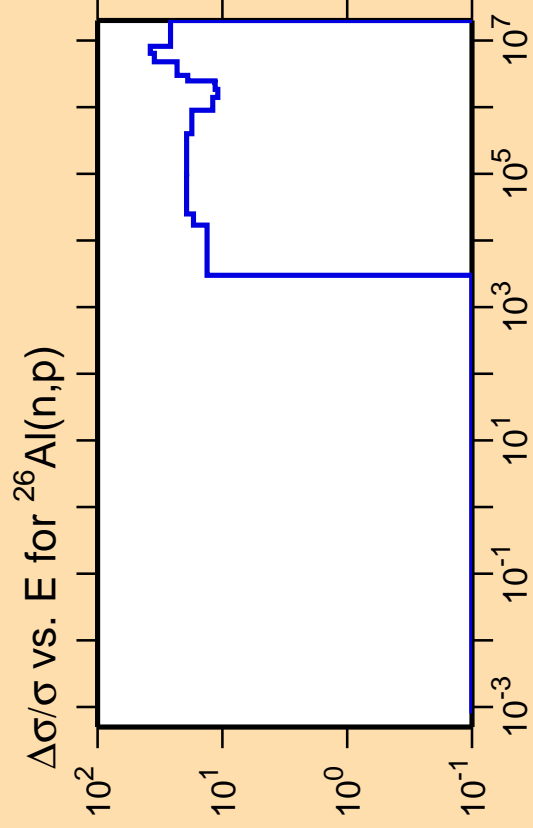

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

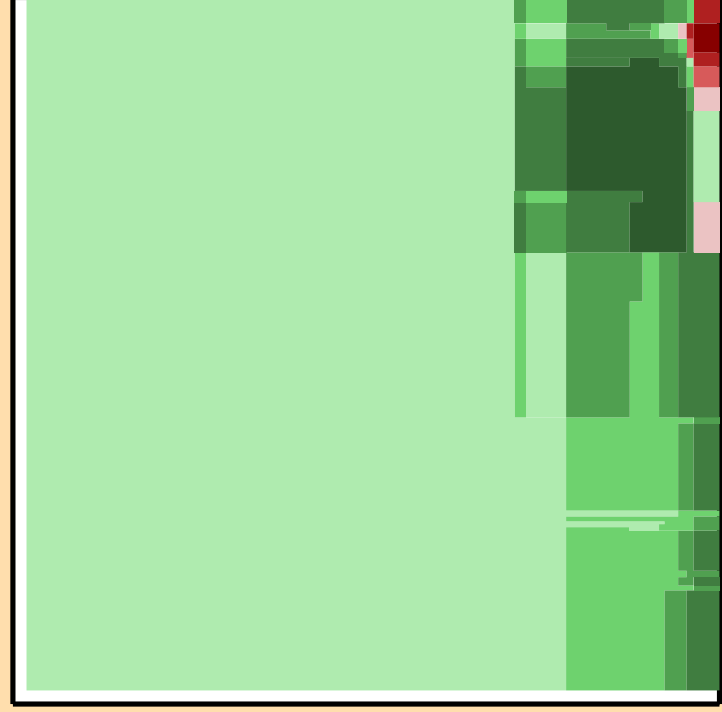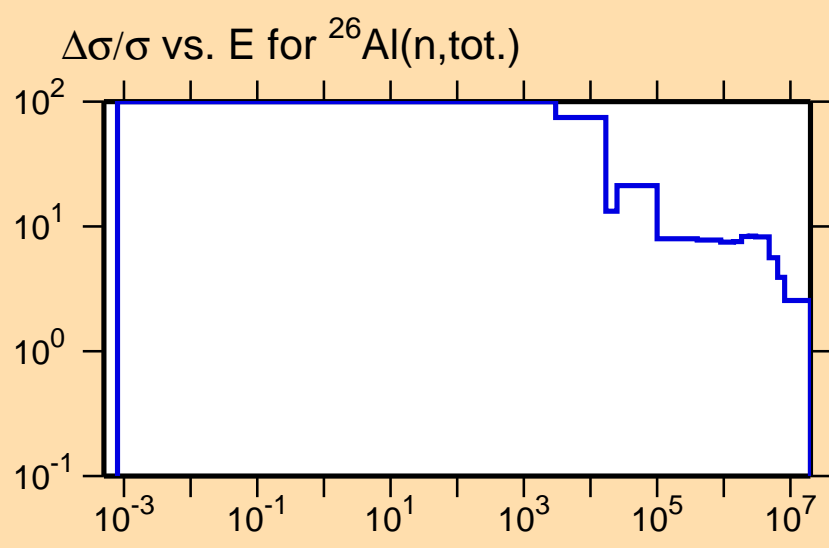

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$


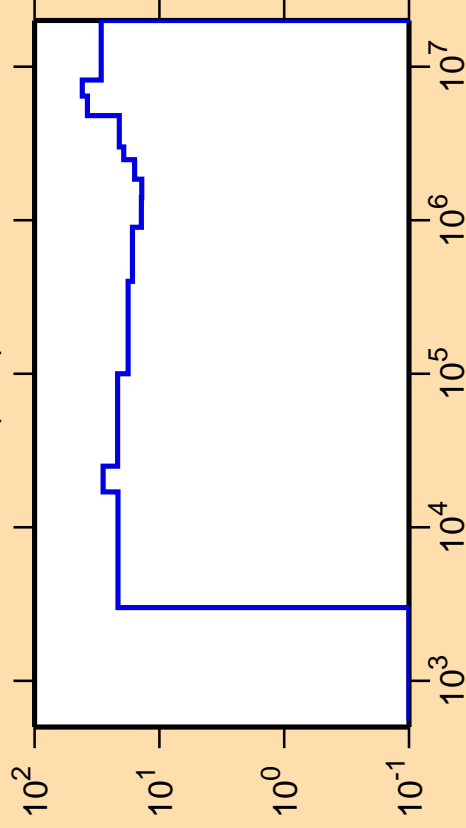


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

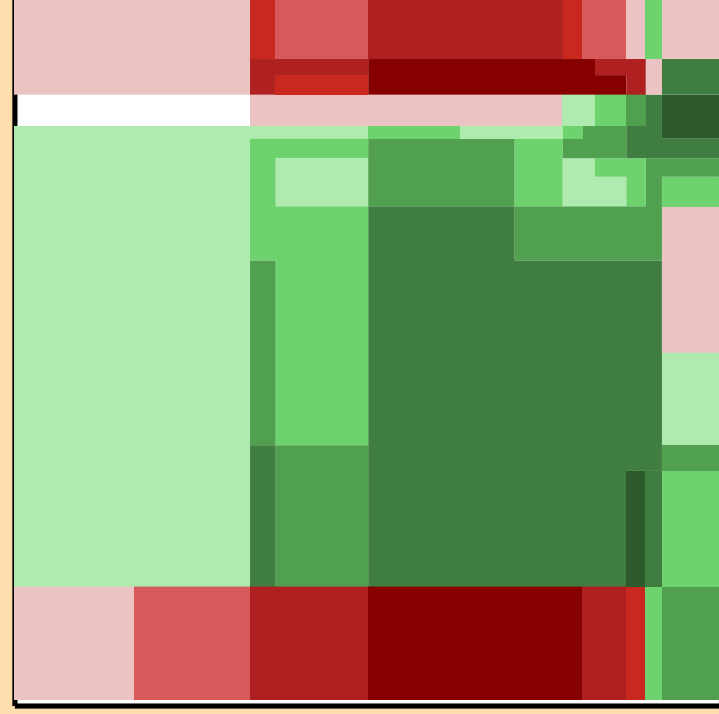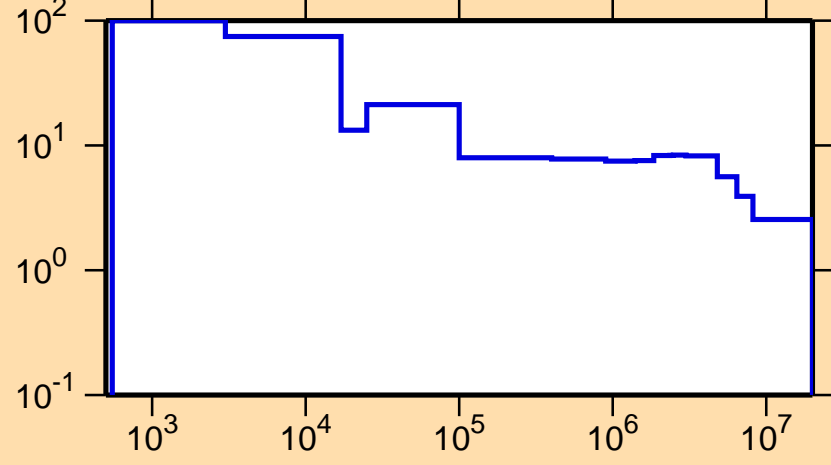

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$


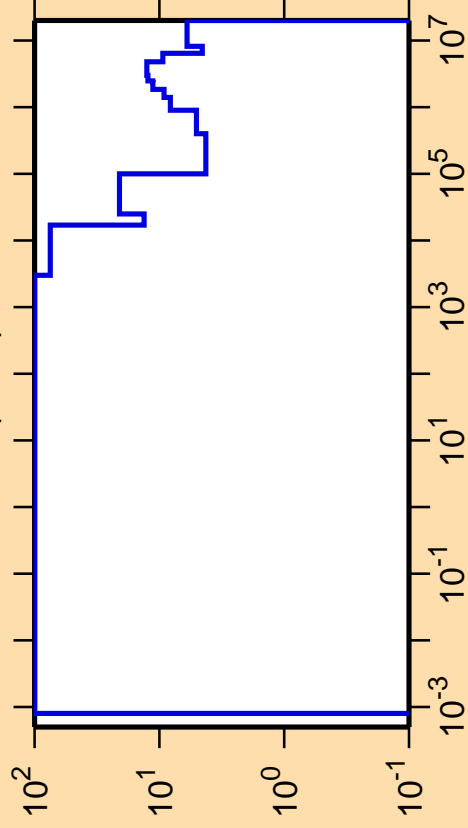


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{26}\text{Al}(n,\text{el.})$

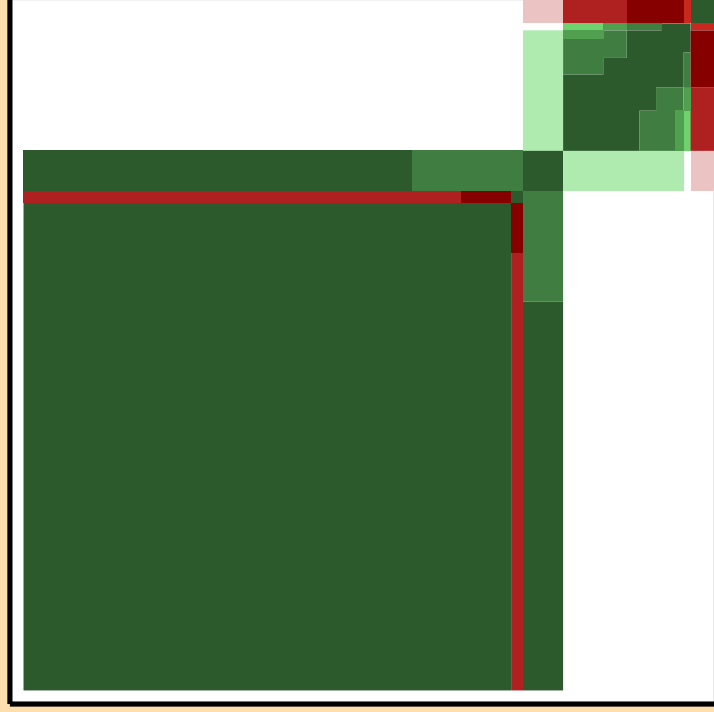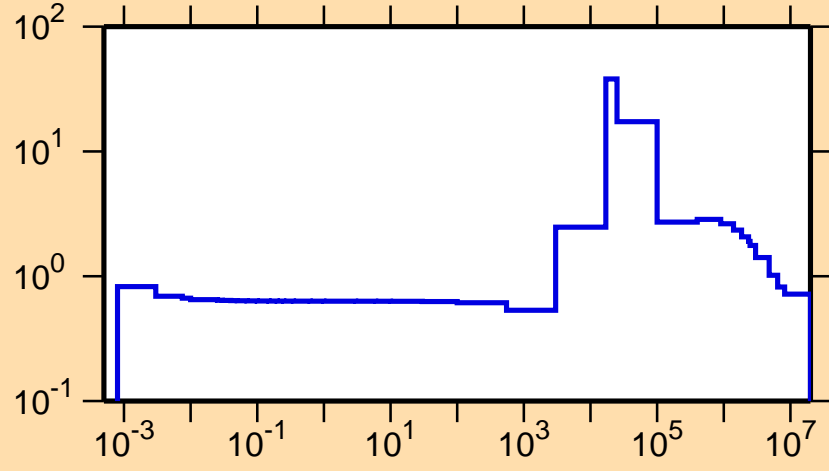

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$


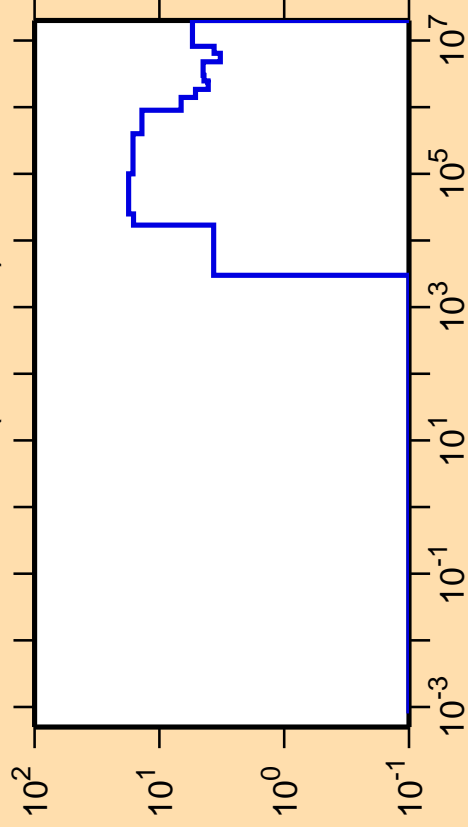


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

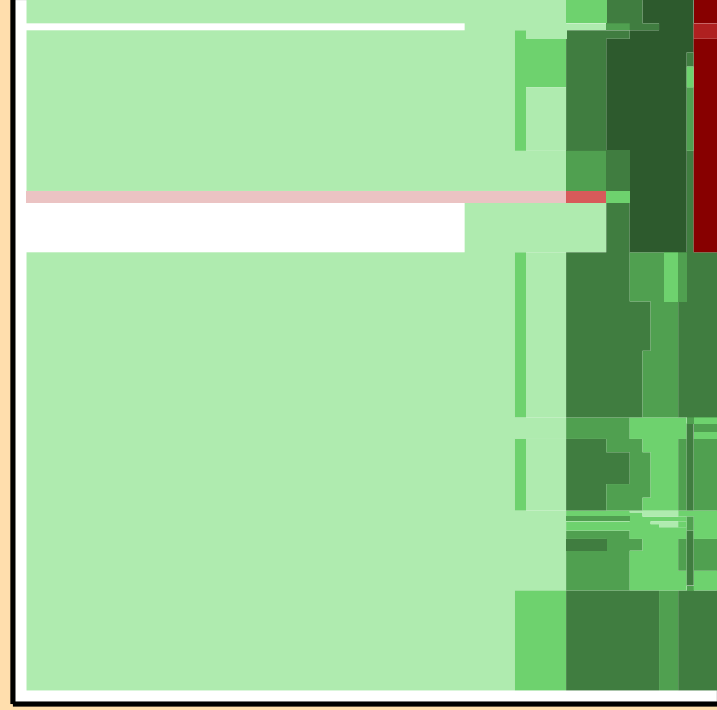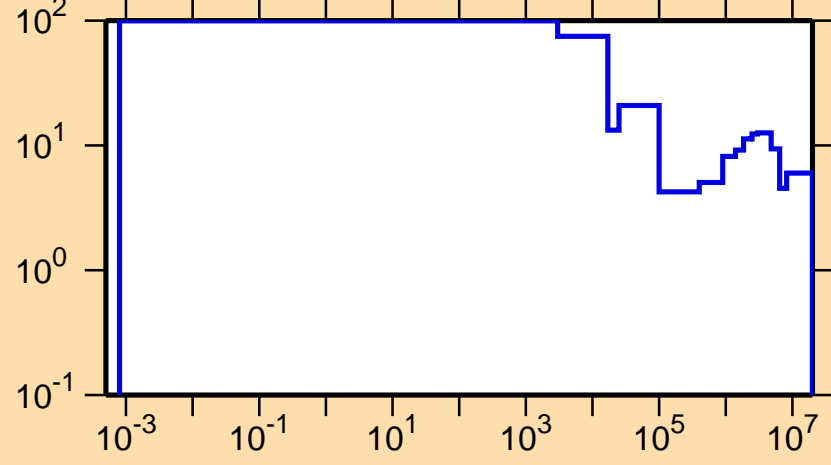



Correlation Matrix



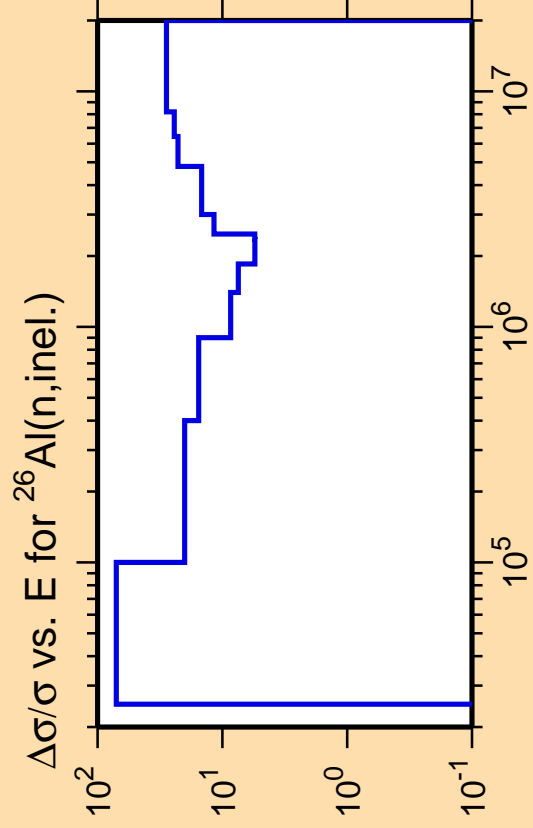

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

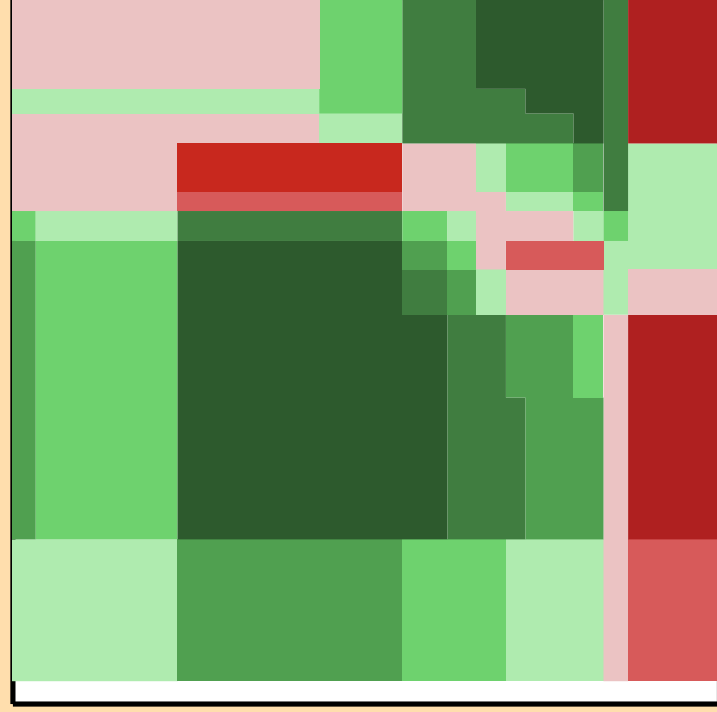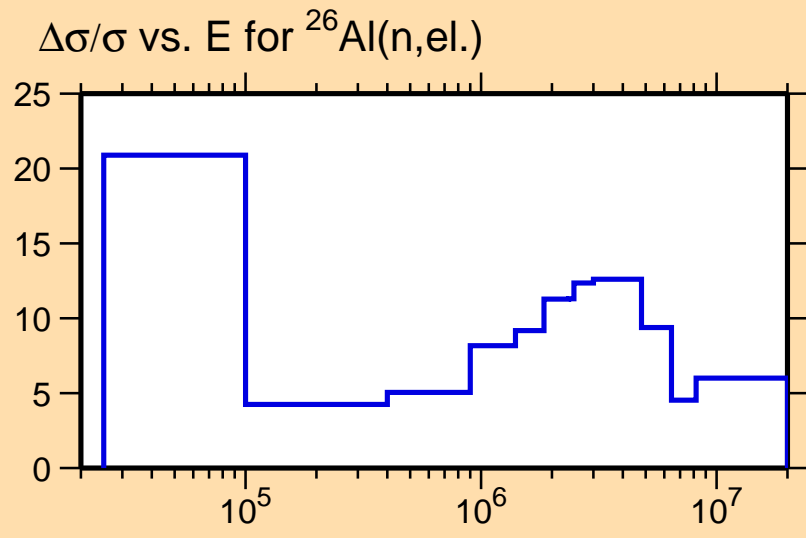

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

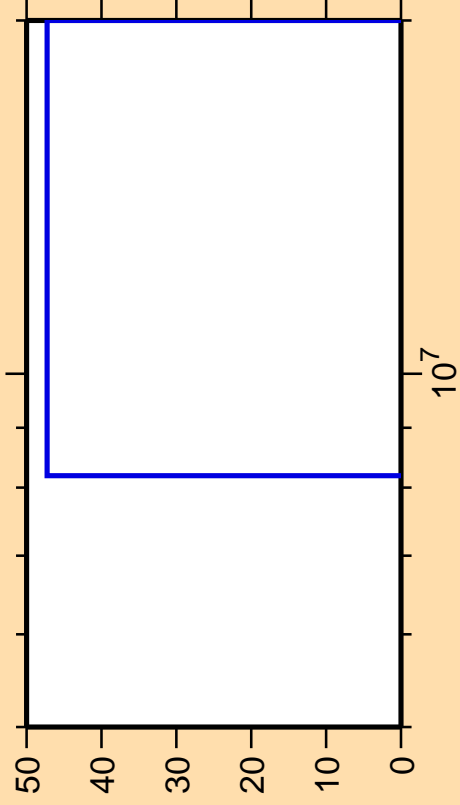

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

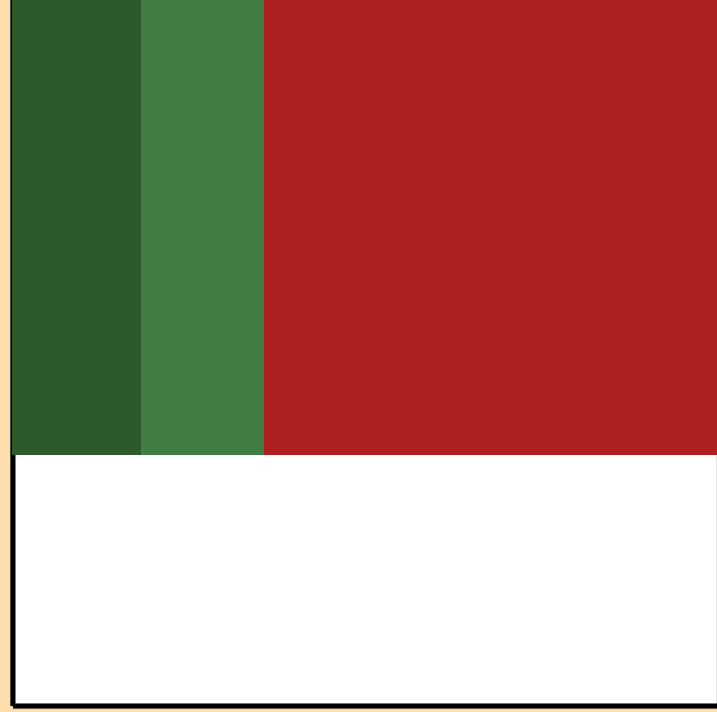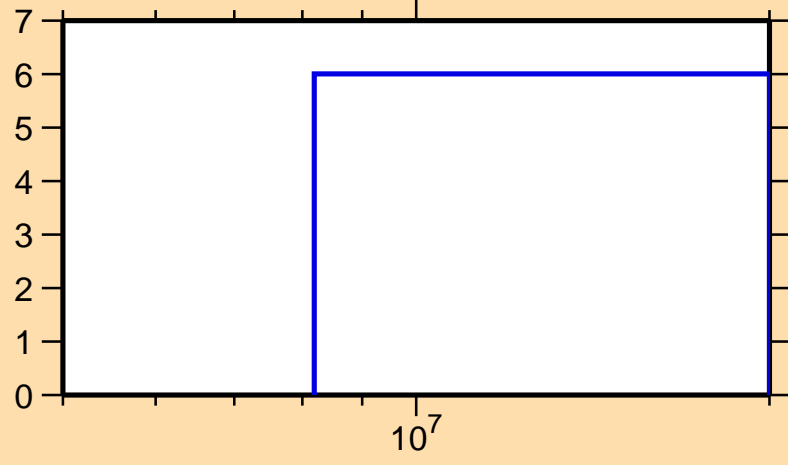

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

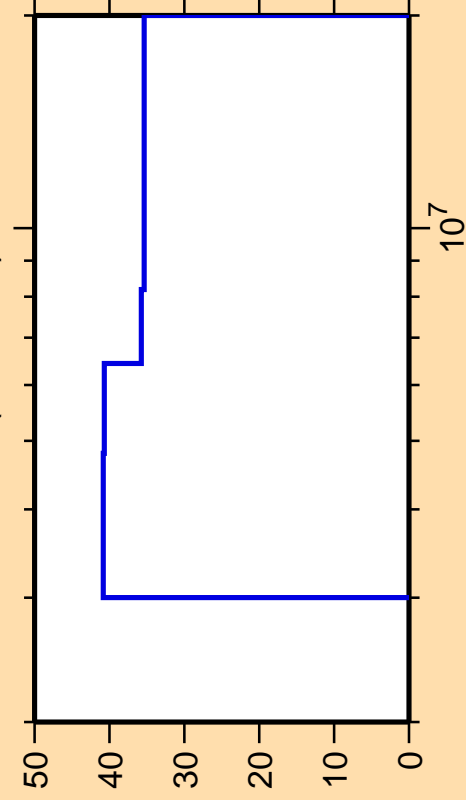

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

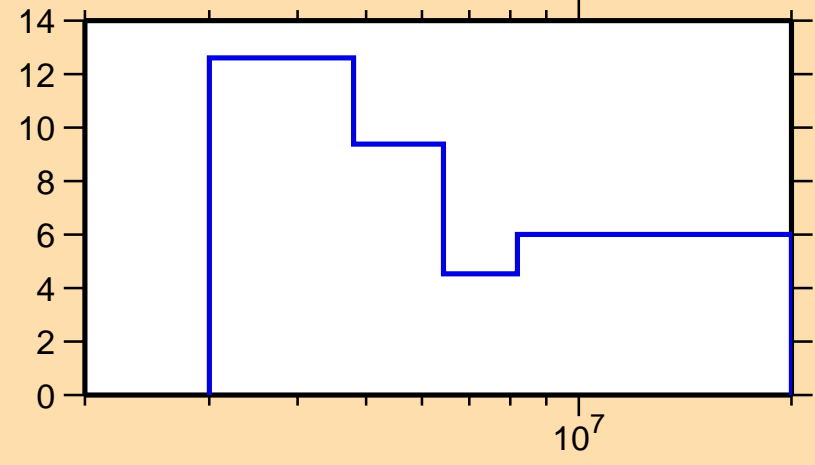

Correlation Matrix





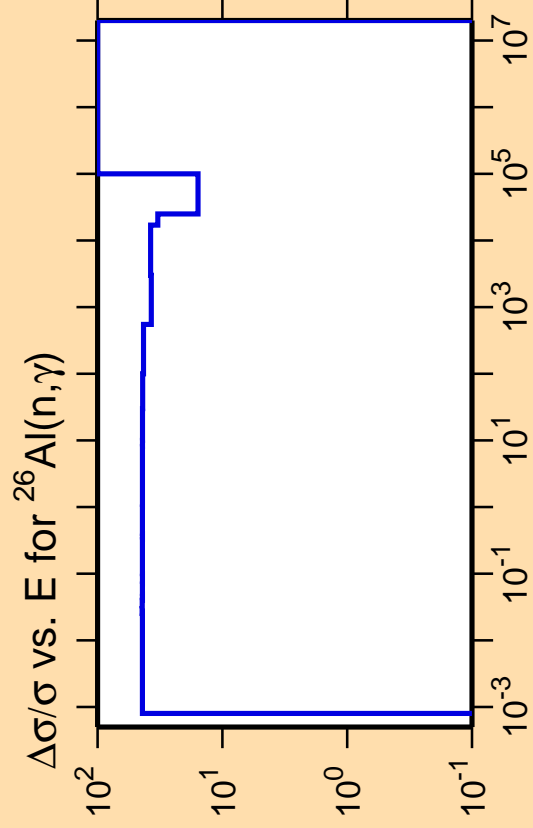

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

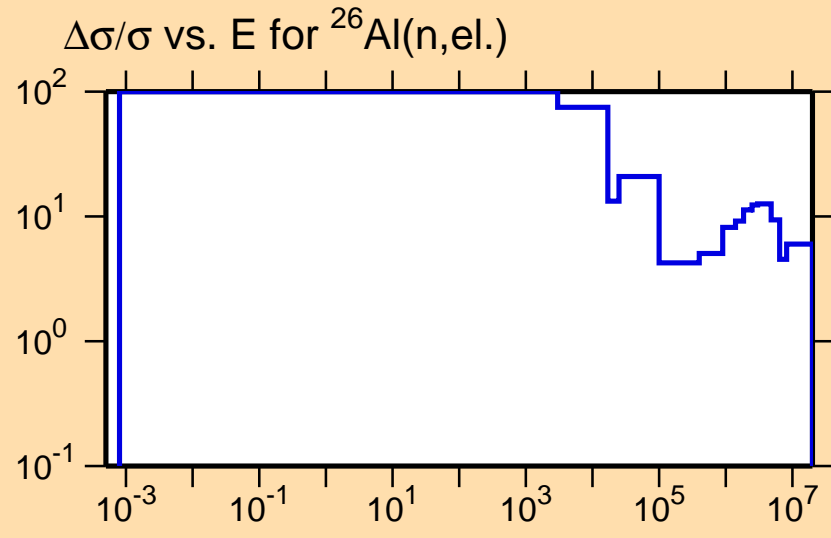

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$


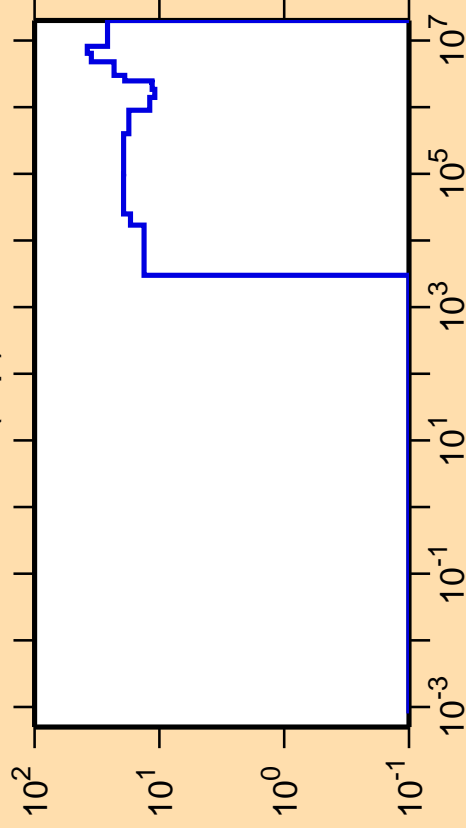


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

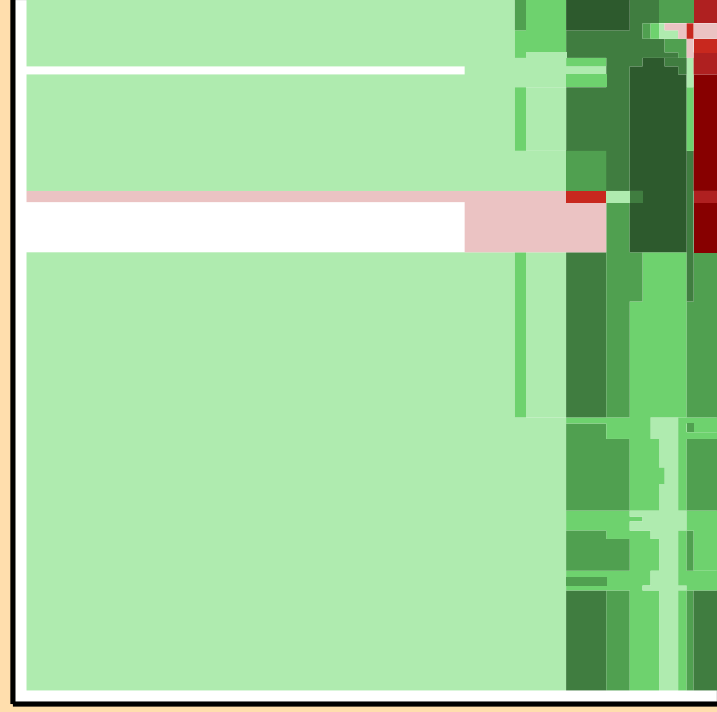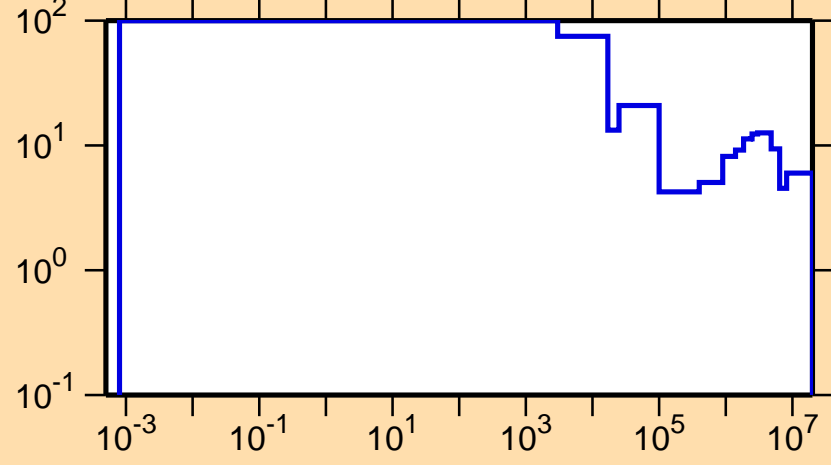

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$


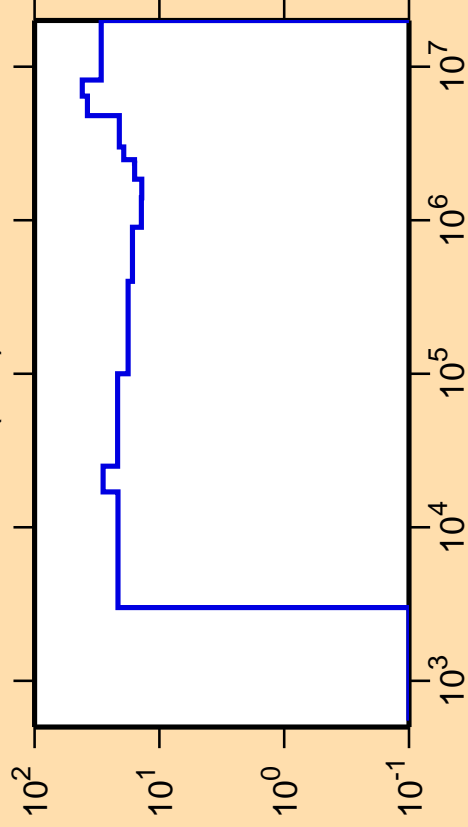


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

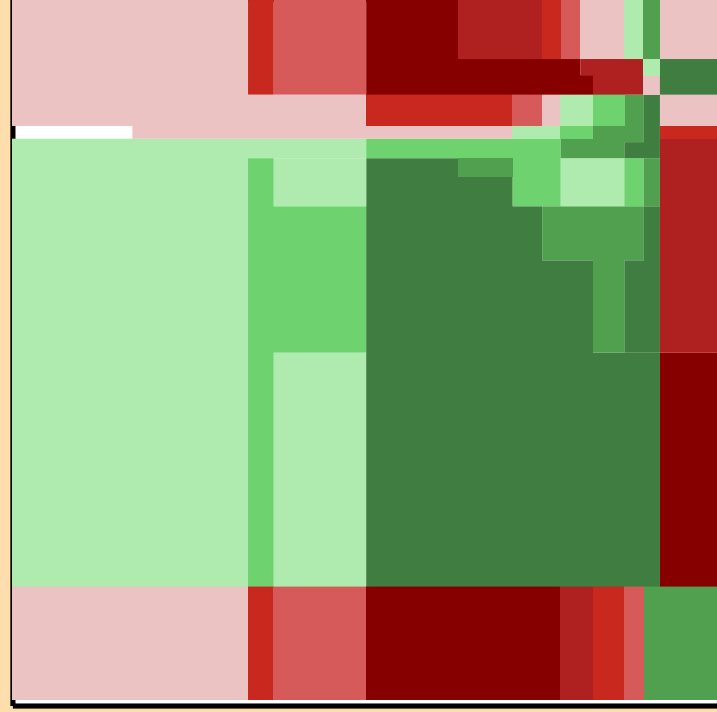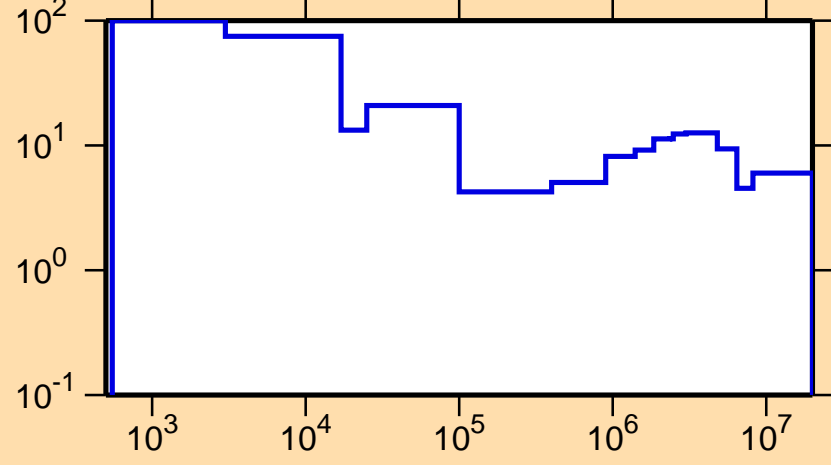

Correlation Matrix

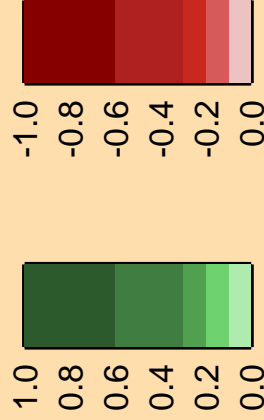


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

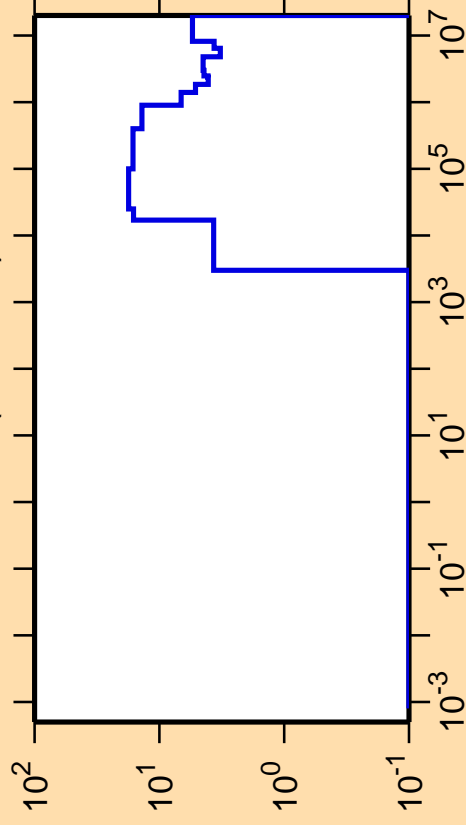


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

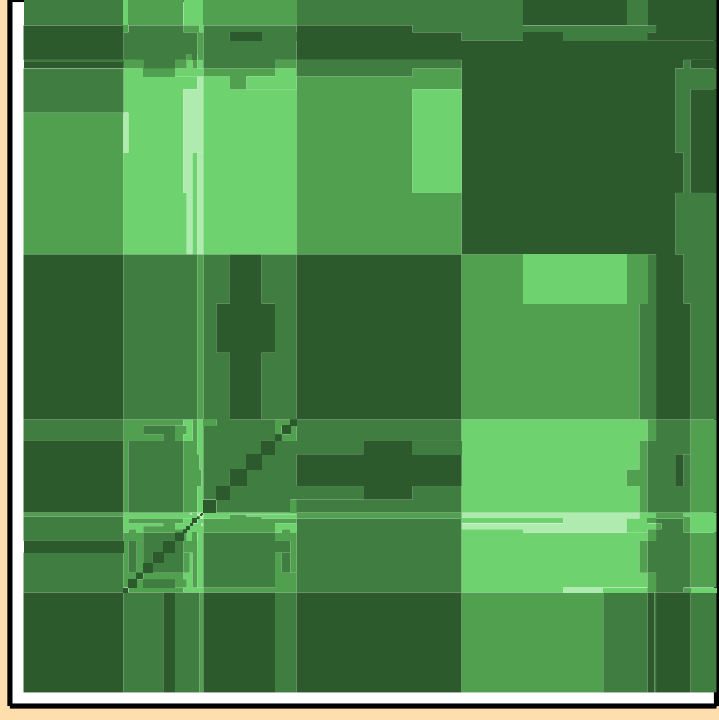


Correlation Matrix

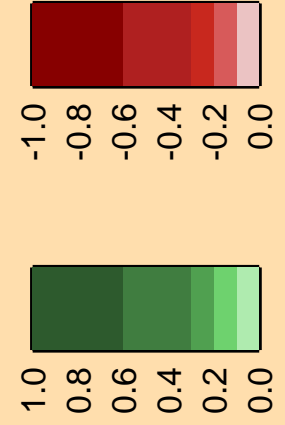

σ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

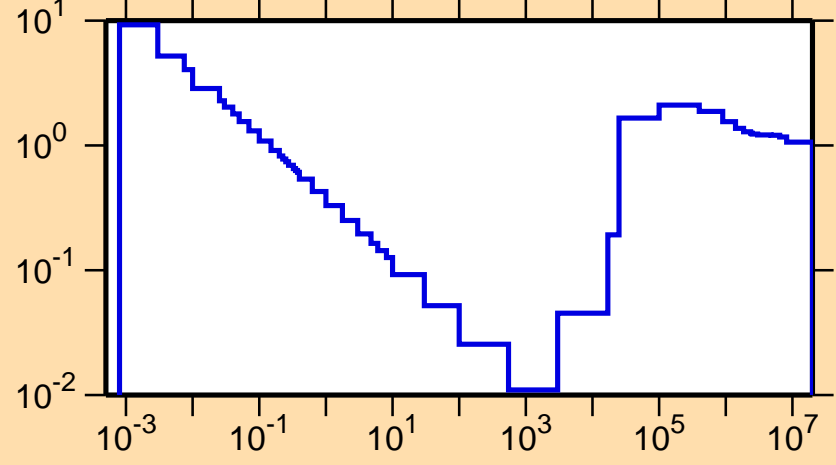



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{inel.})$

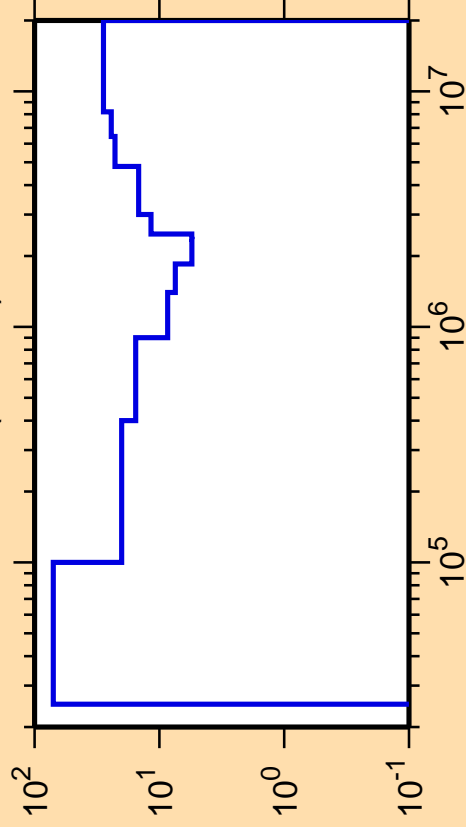

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

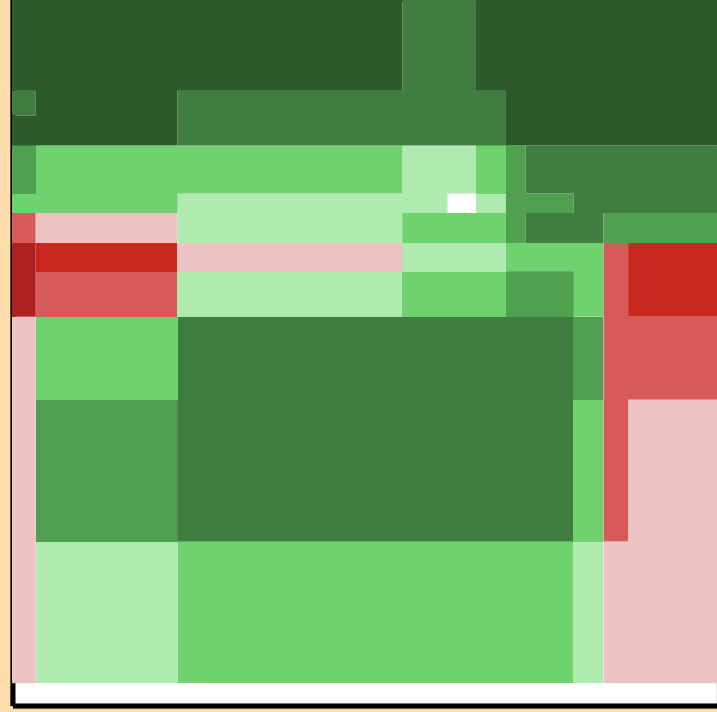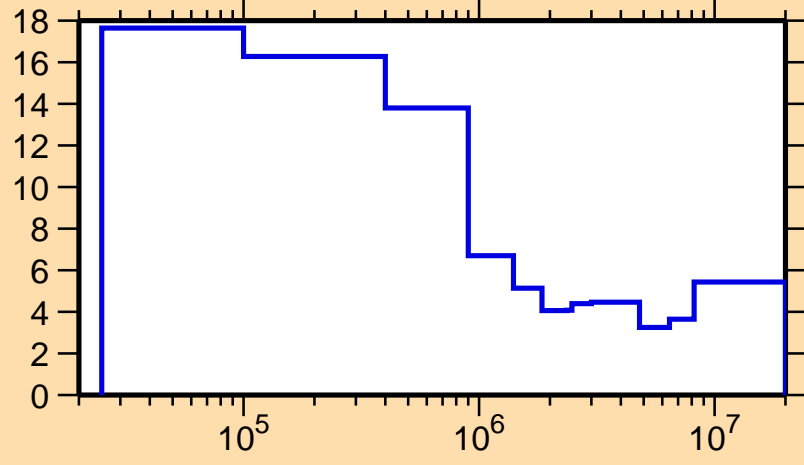

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

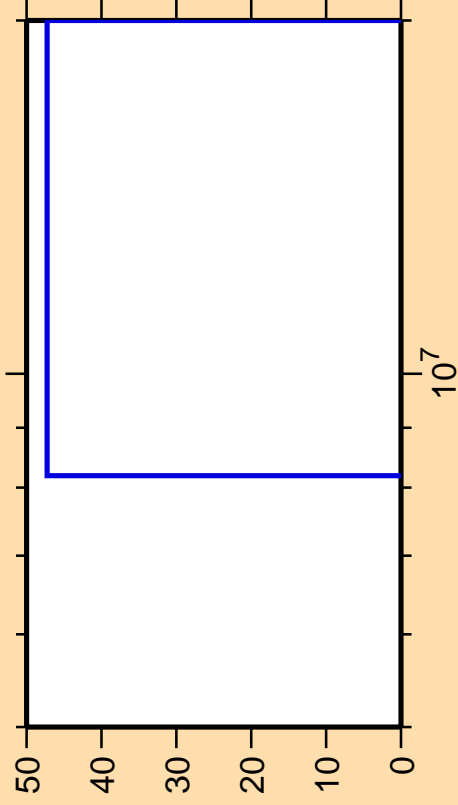

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

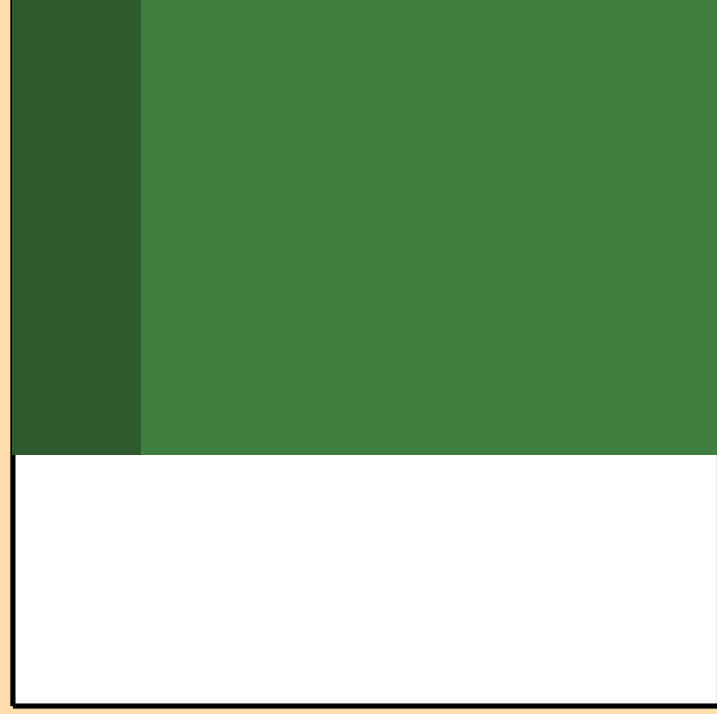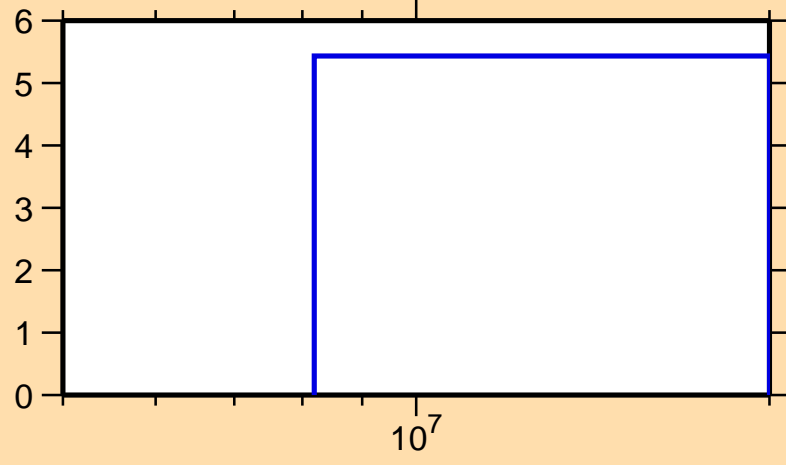

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,ncont.)$

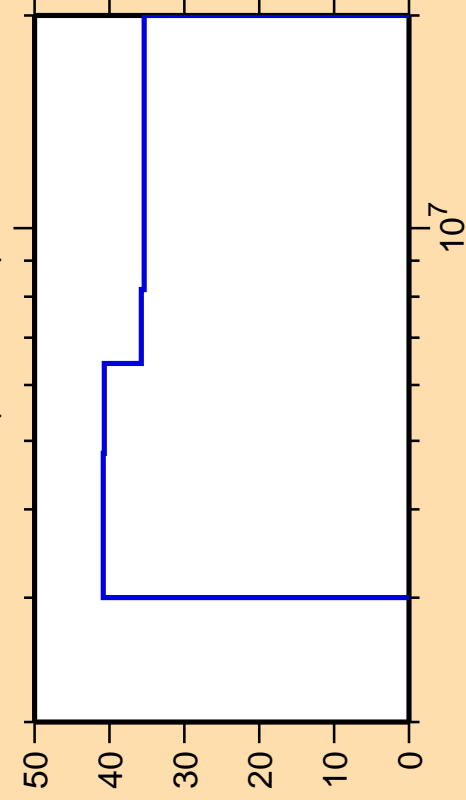

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,nonel.)$

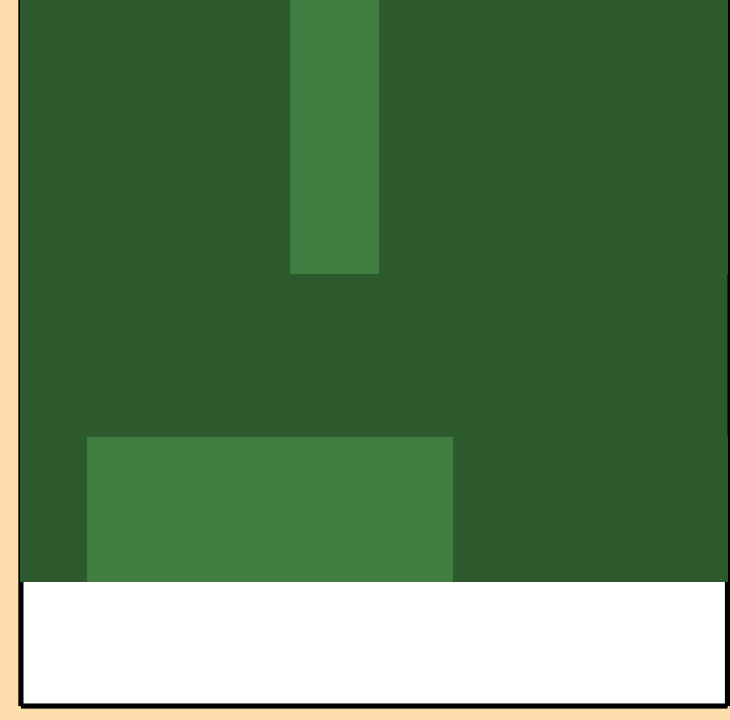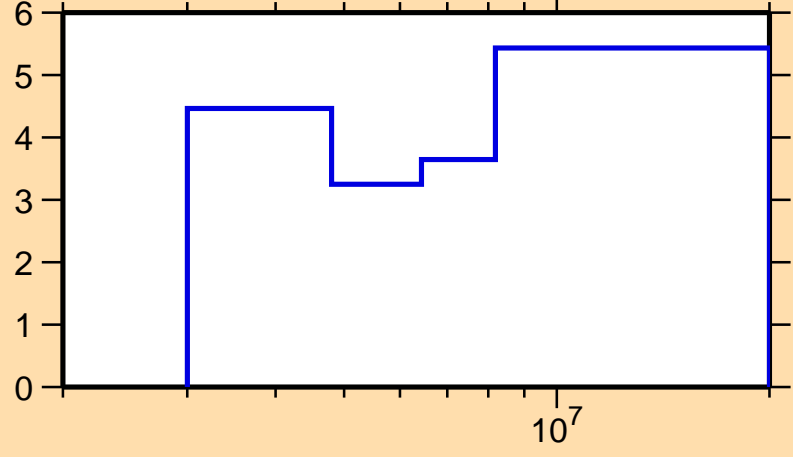

Correlation Matrix





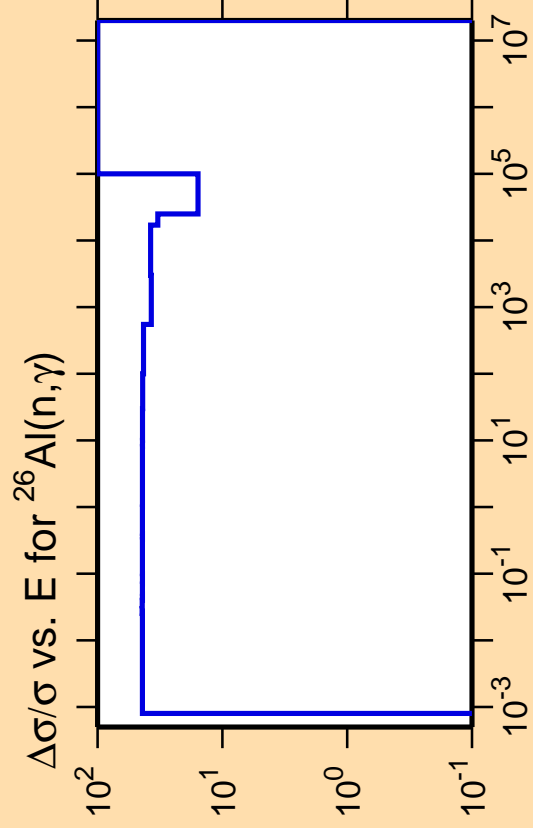

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

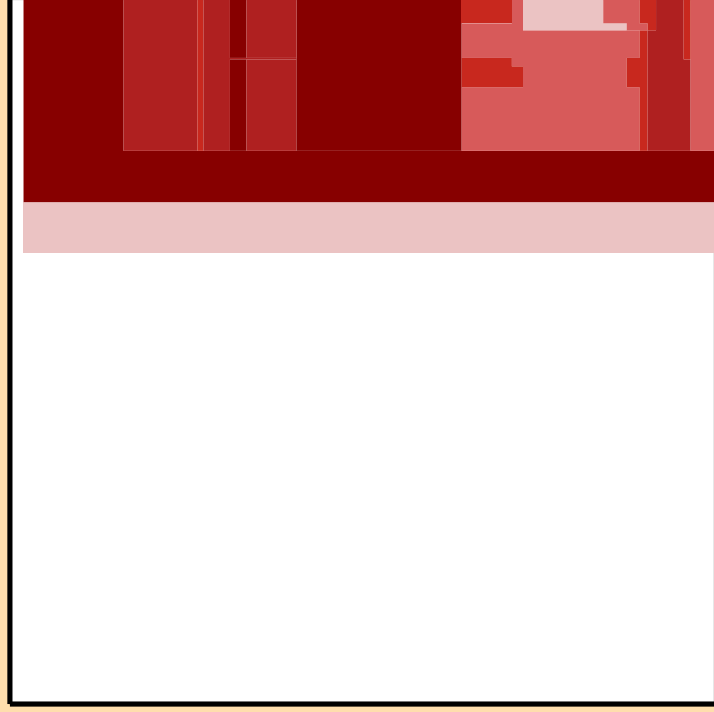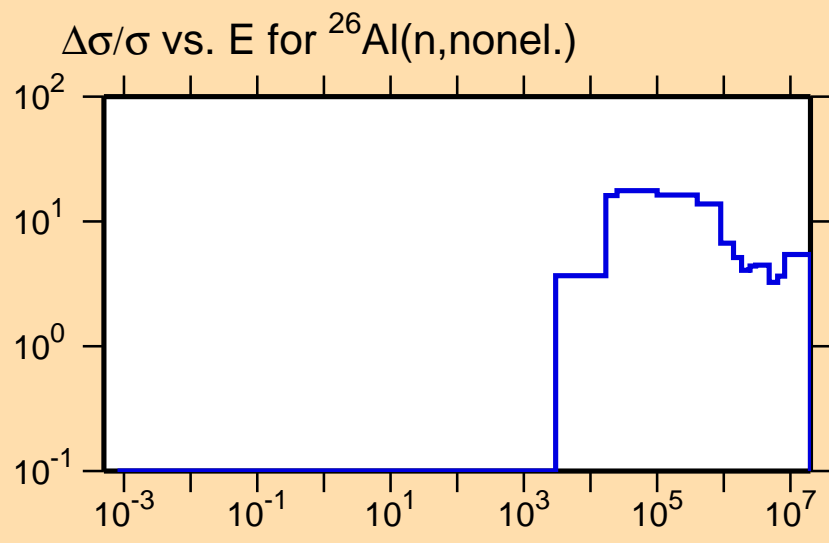

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$


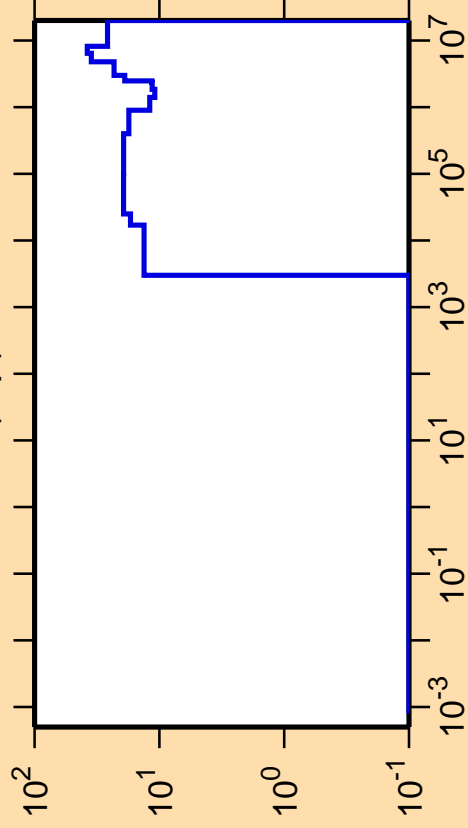


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

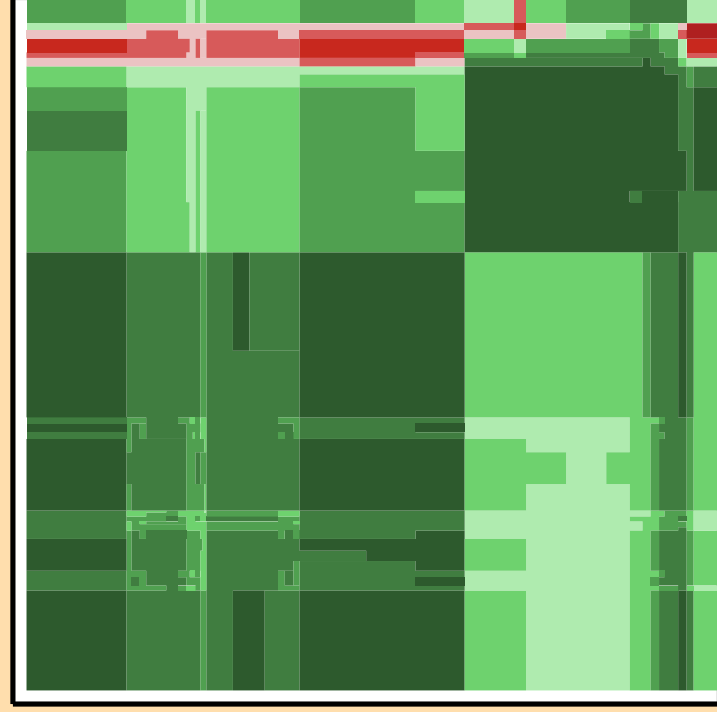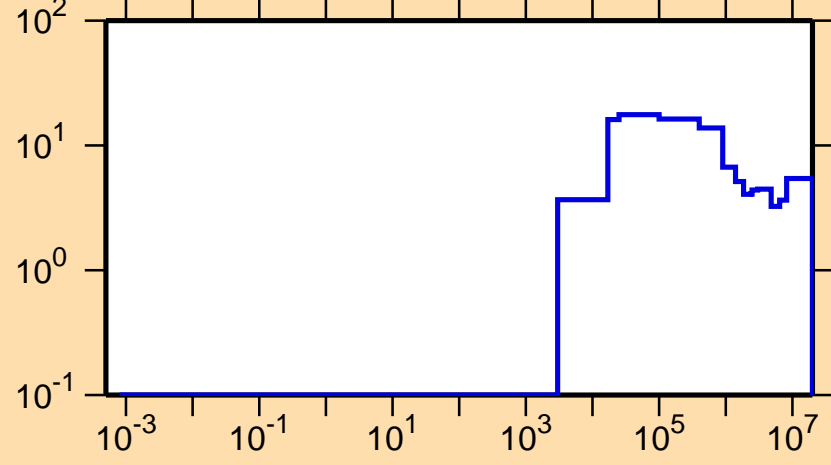

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$


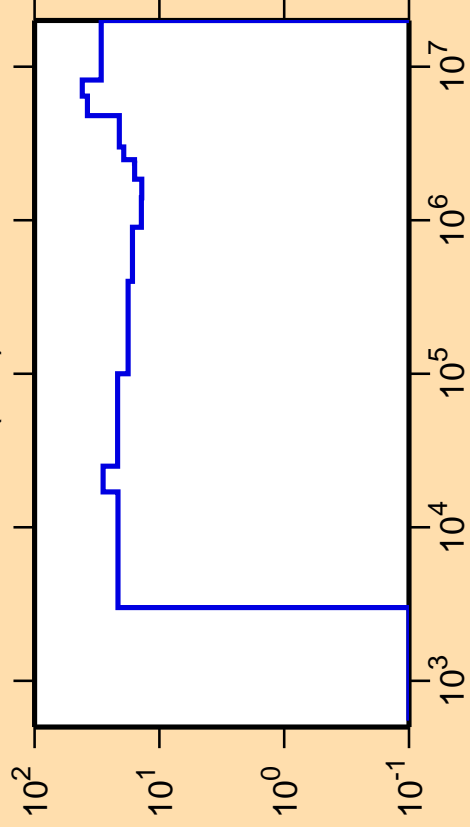


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

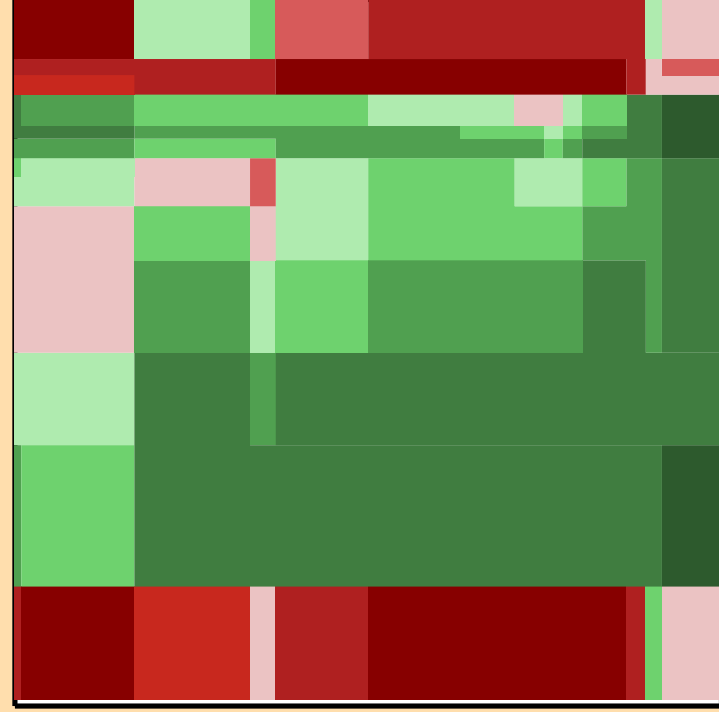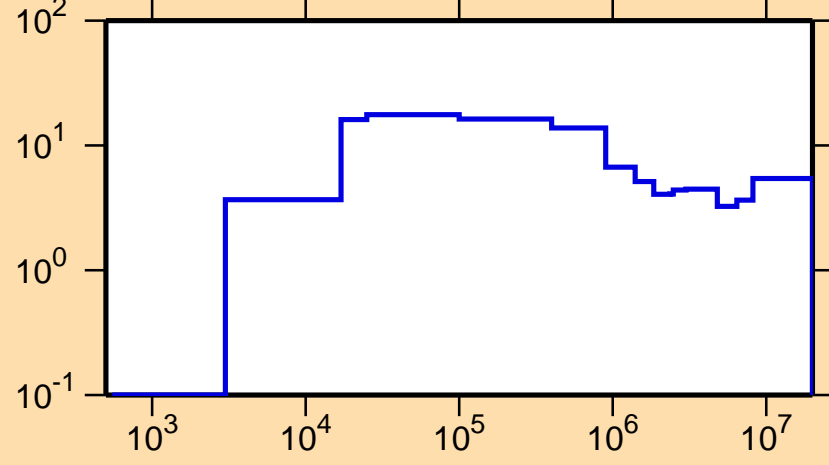

Correlation Matrix

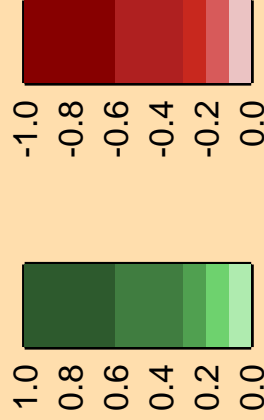



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{inel.})$

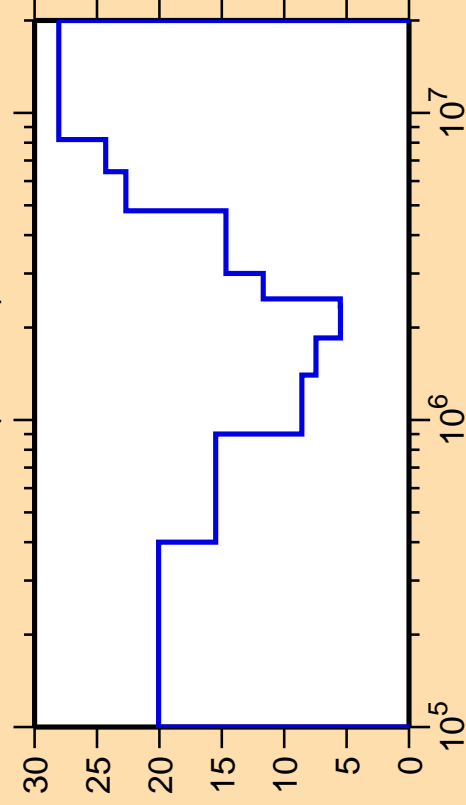

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,\text{inel.})$

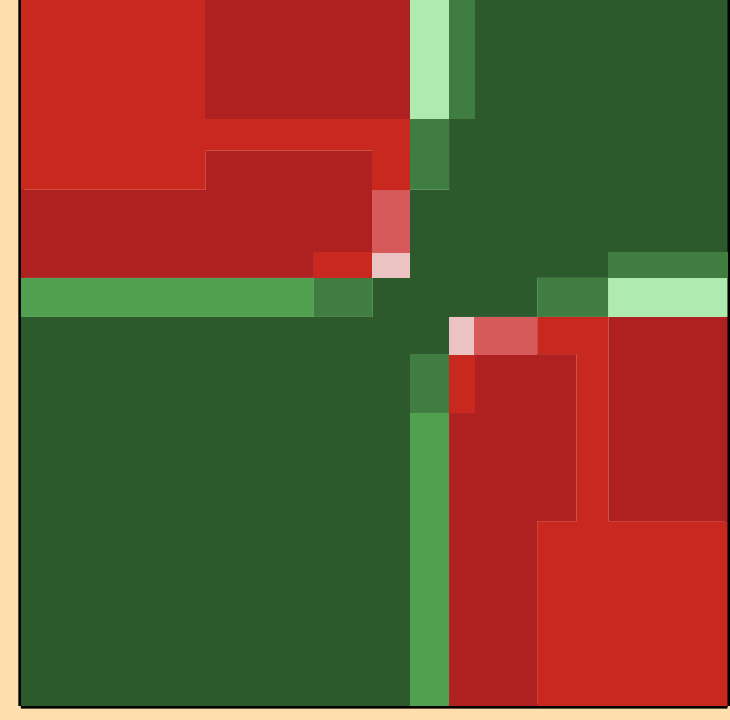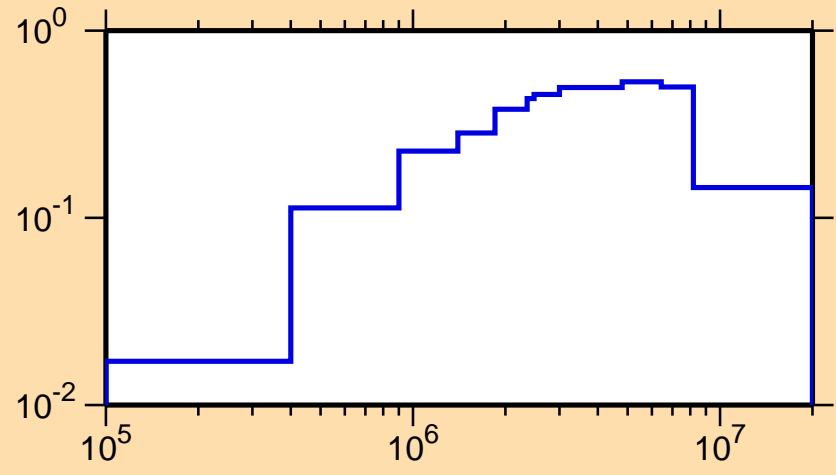

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

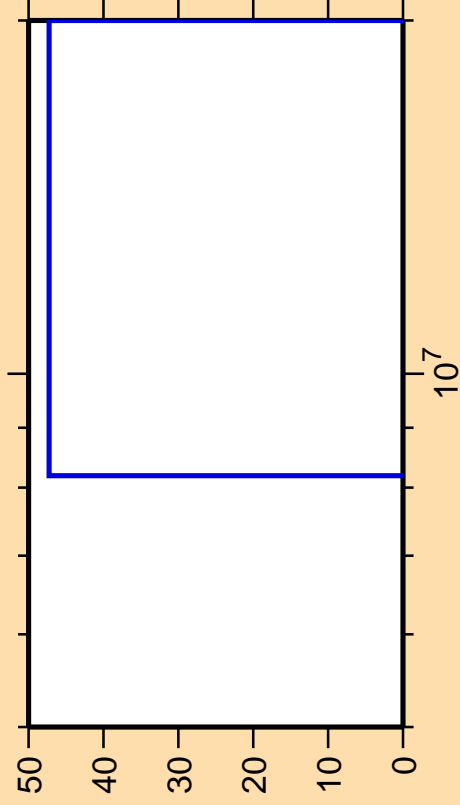

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,2n)$

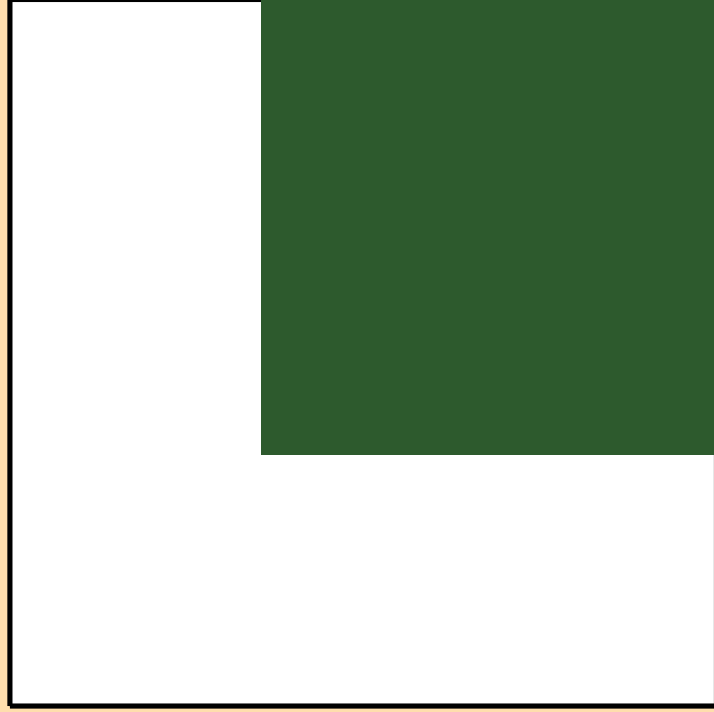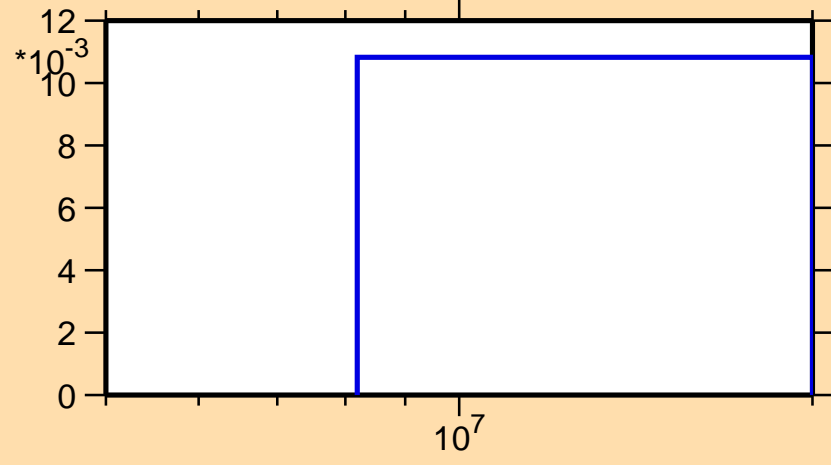

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

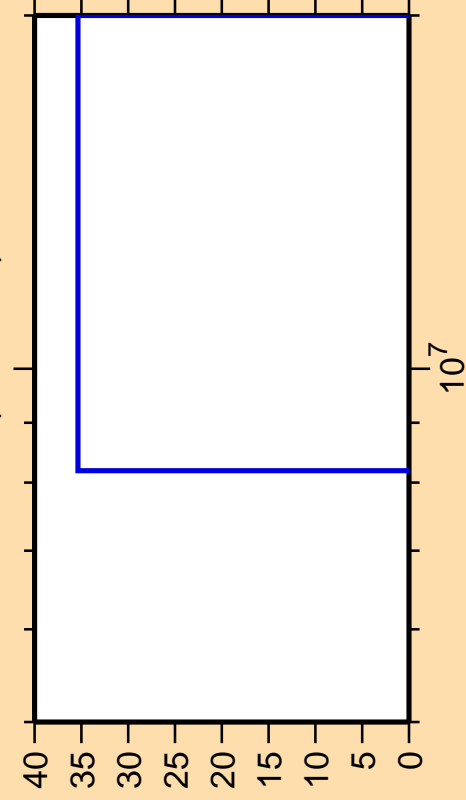

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

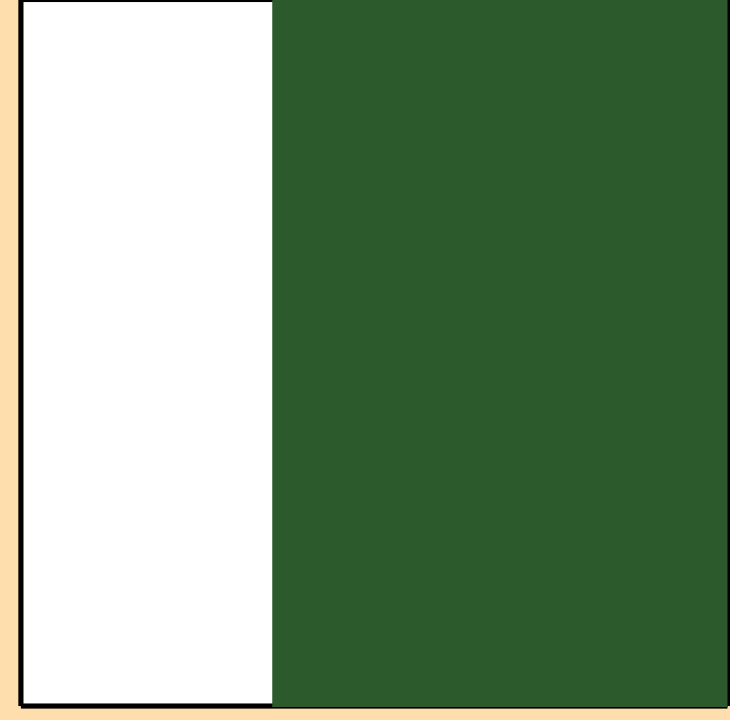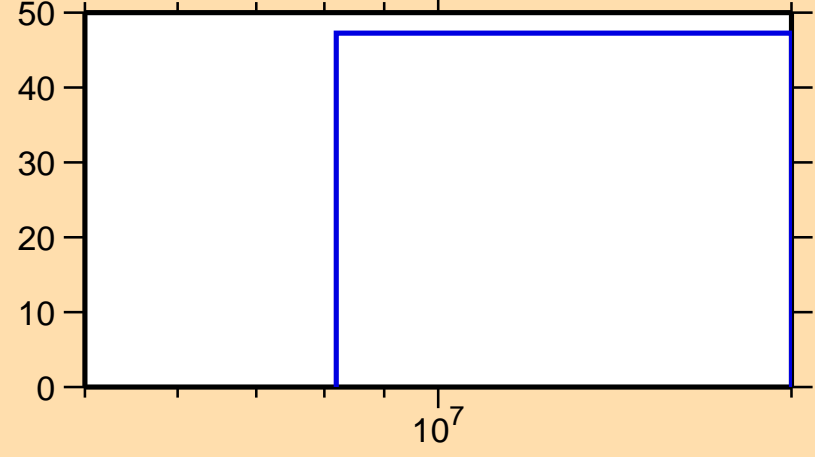

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\gamma)$


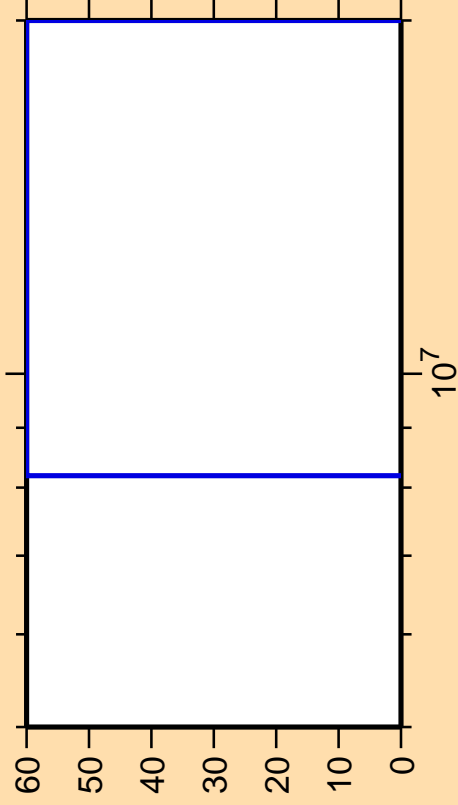


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

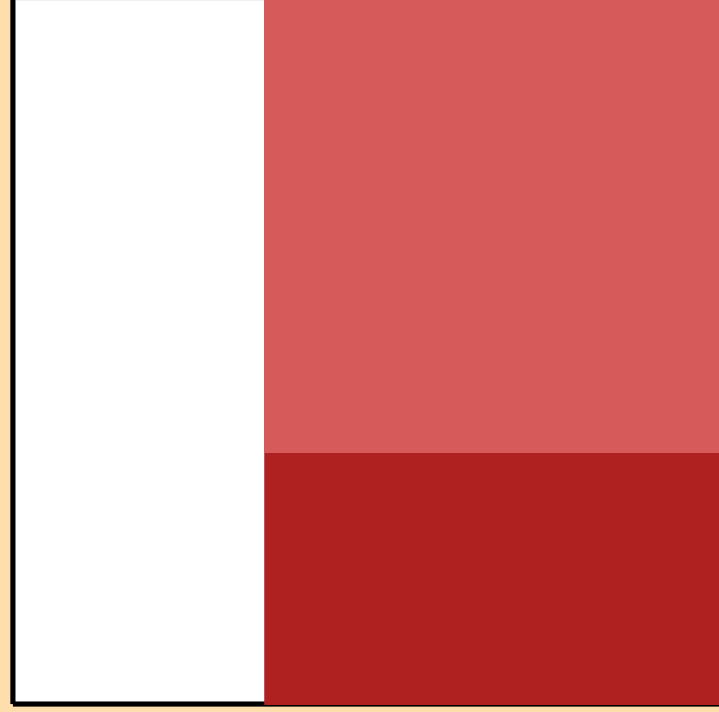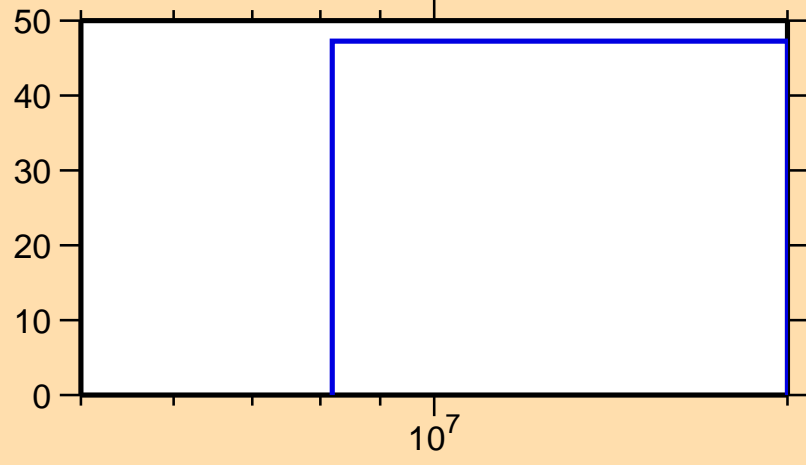

Correlation Matrix

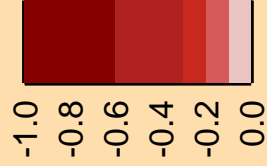



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$

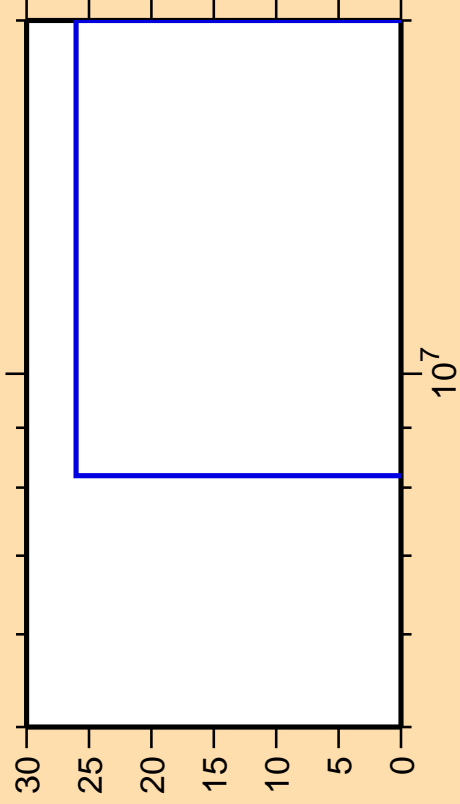

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

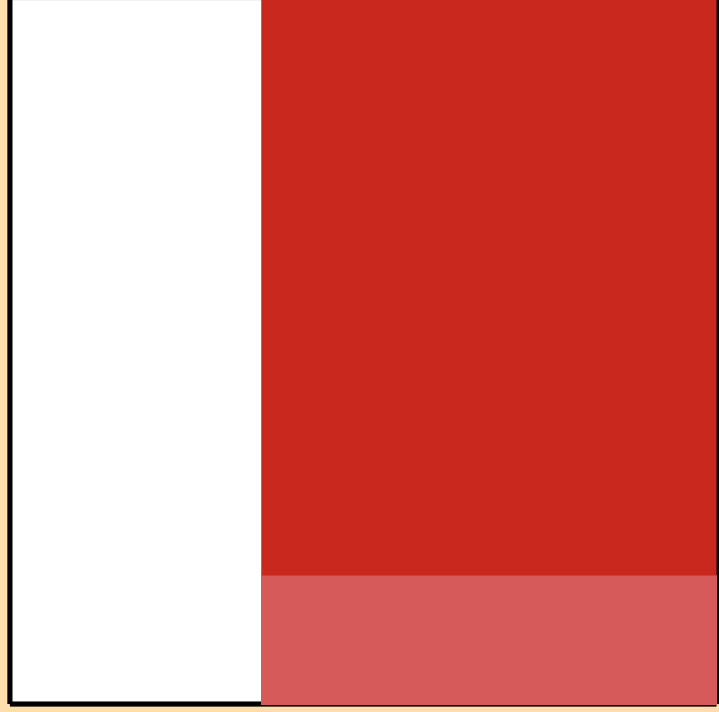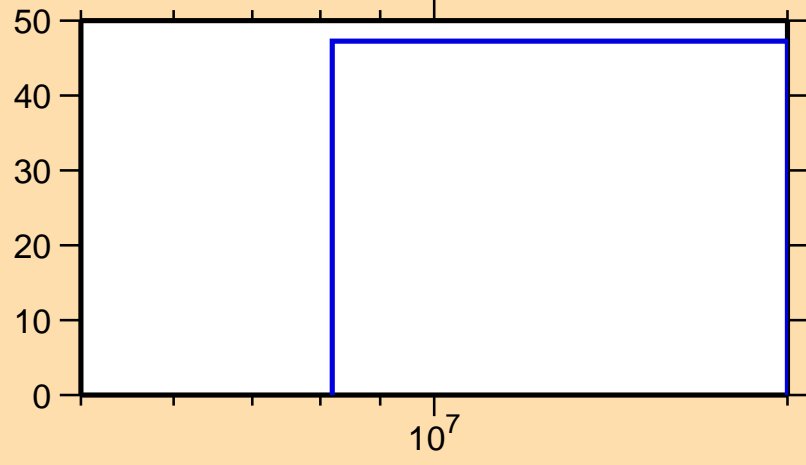



Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$

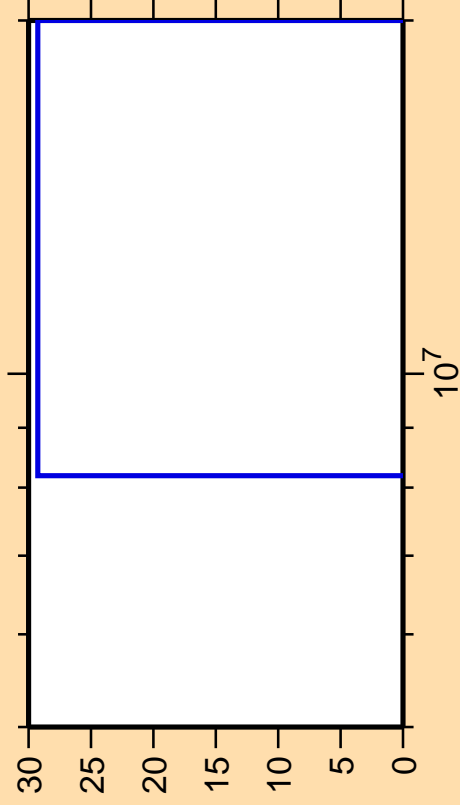


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

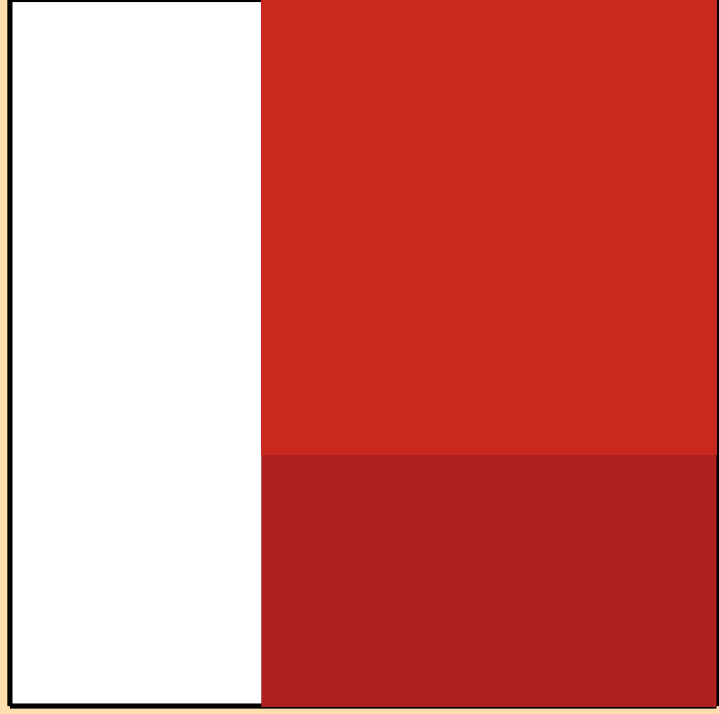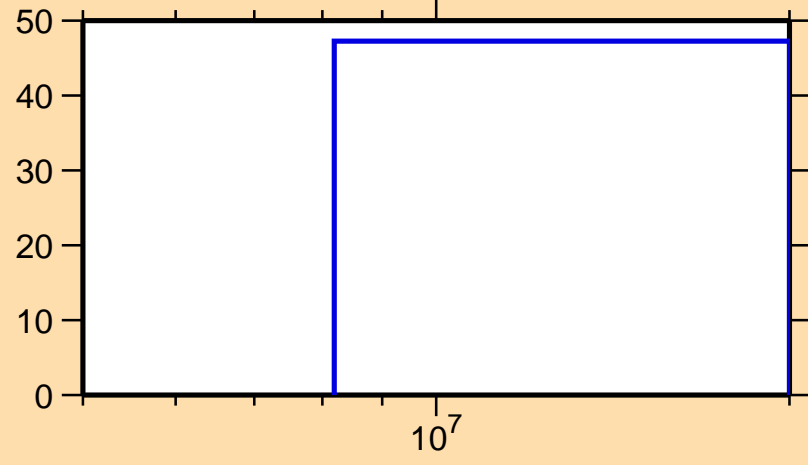

Correlation Matrix

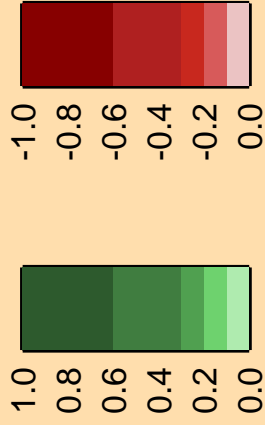


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\alpha)$

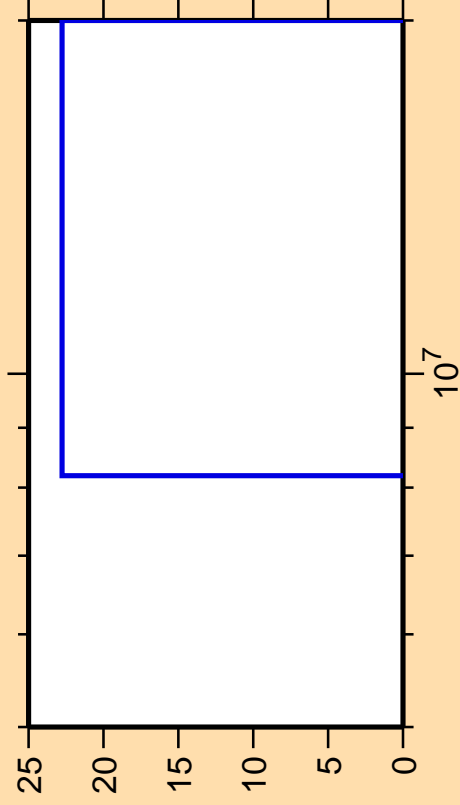


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{26}\text{Al}(n,n\alpha)$

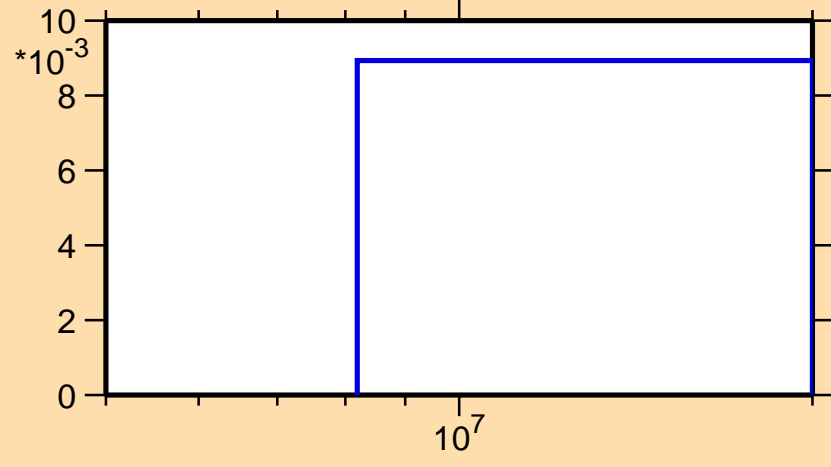


σ vs. E for $^{26}\text{Al}(n,n\alpha)$

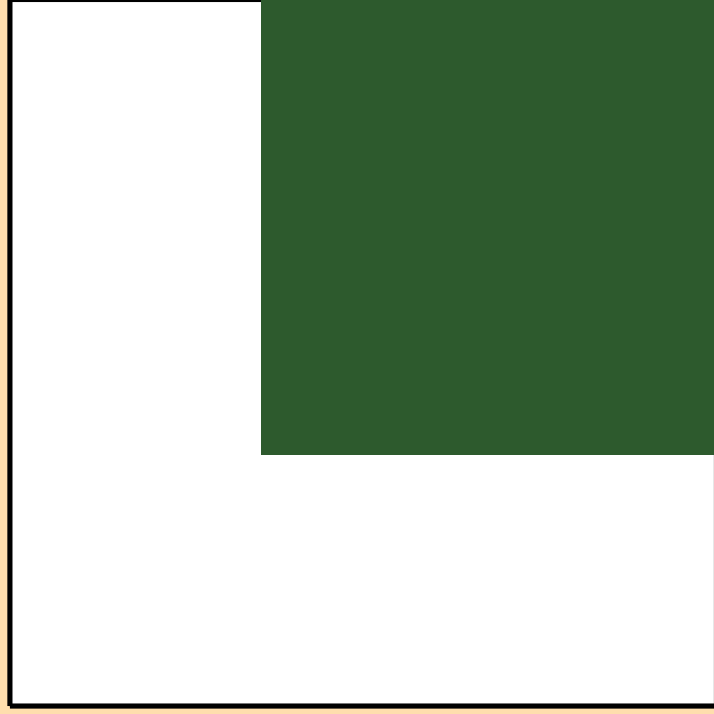

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,np)$

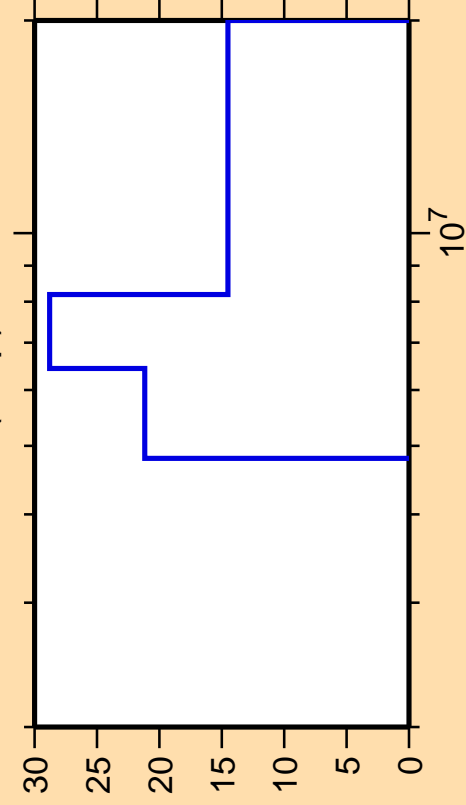


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

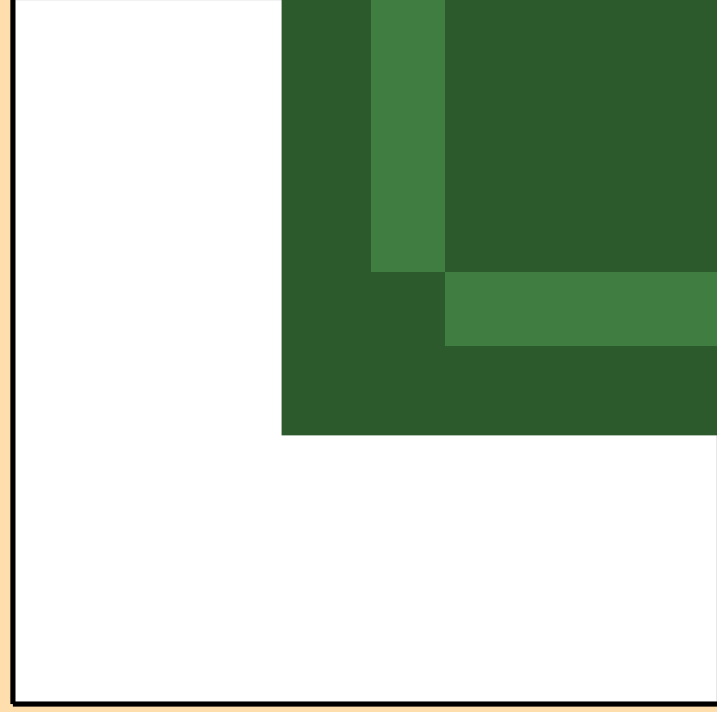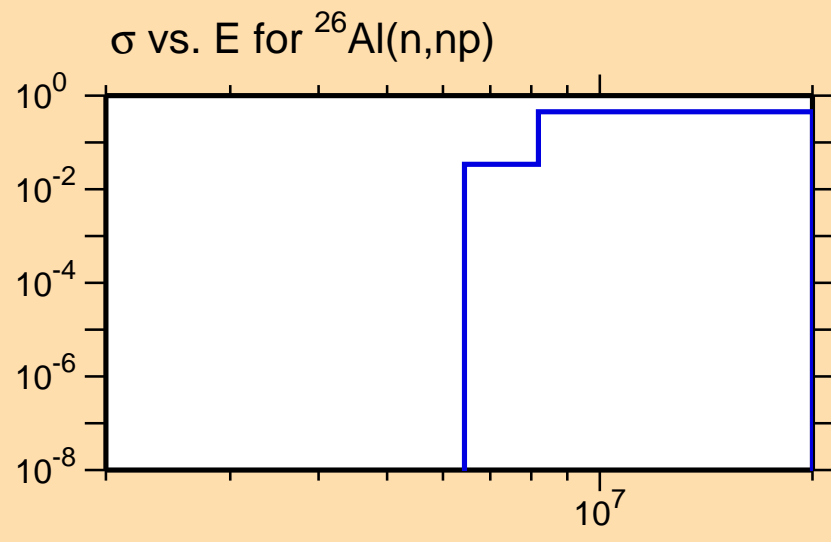



Correlation Matrix

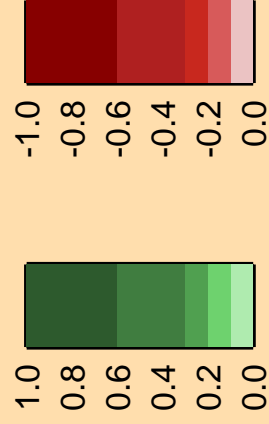


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nd})$

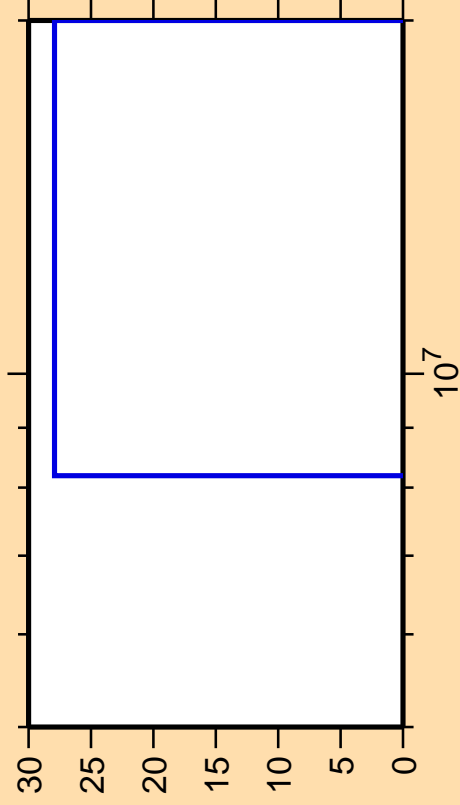


σ vs. E for $^{26}\text{Al}(n,\text{nd})$

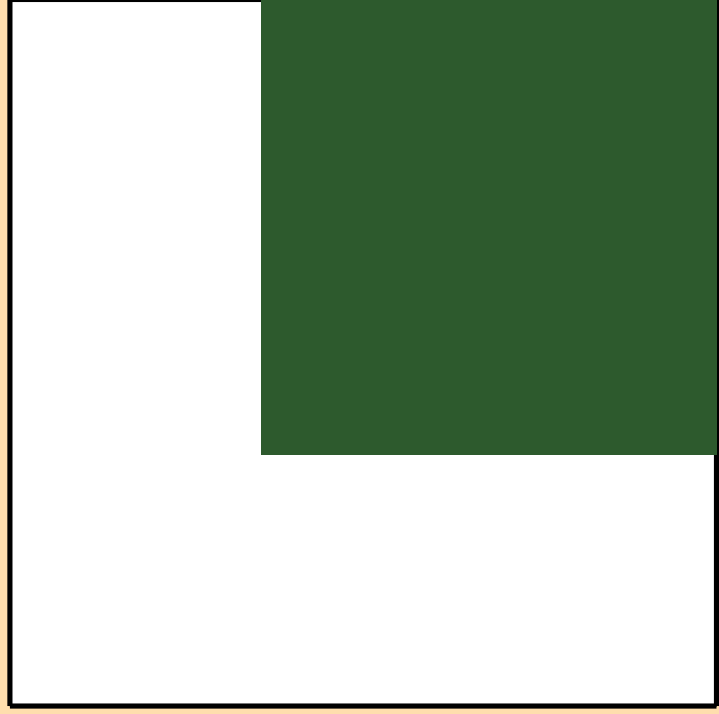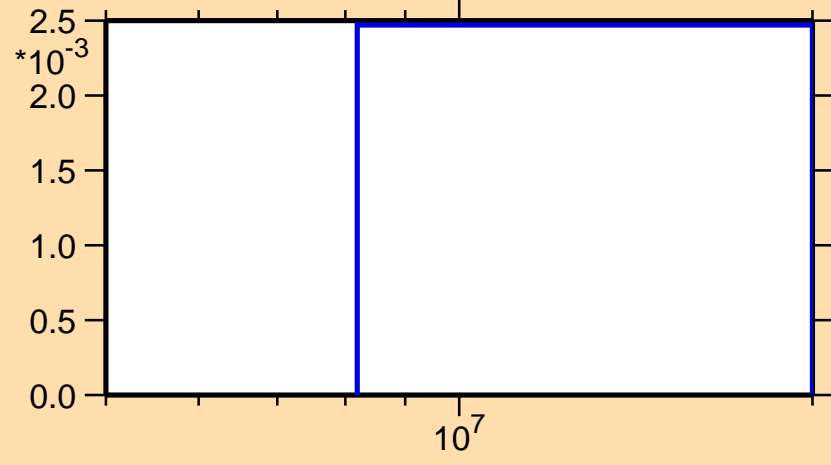



Correlation Matrix

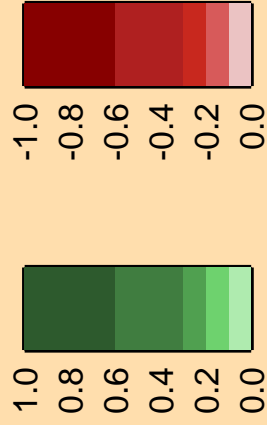

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(\text{mt } 34)$

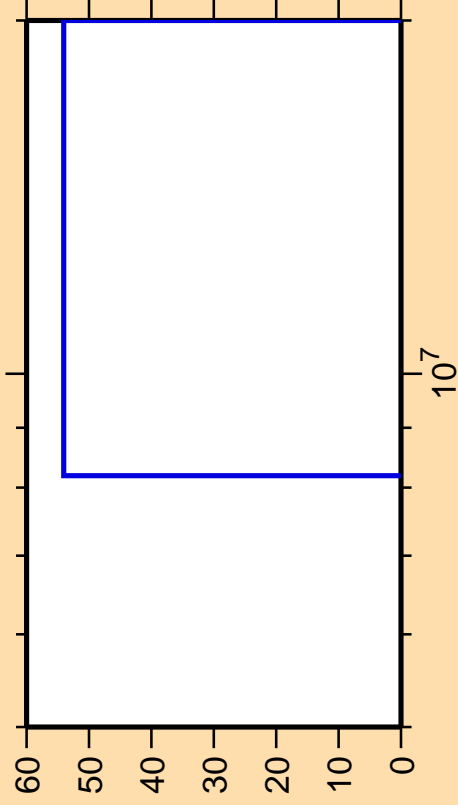

σ vs. E for $^{26}\text{Al}(\text{mt } 34)$

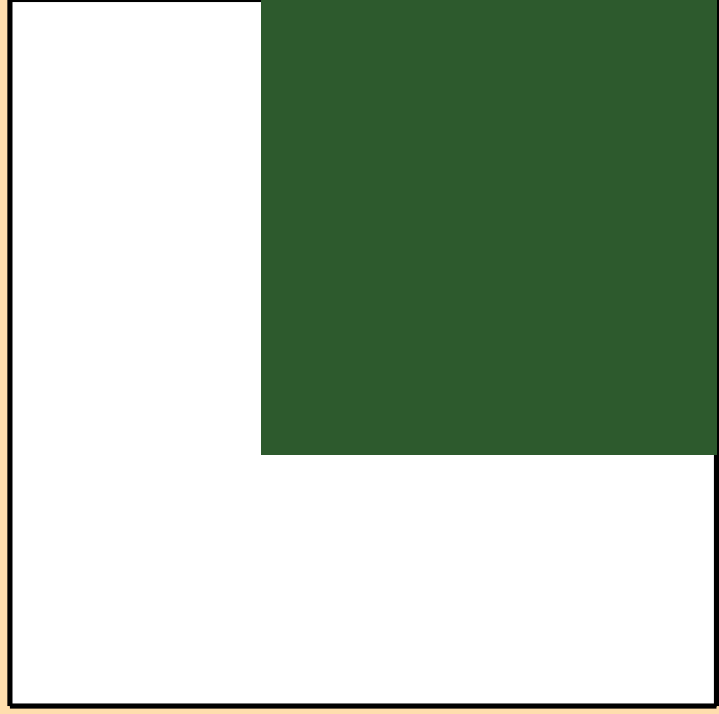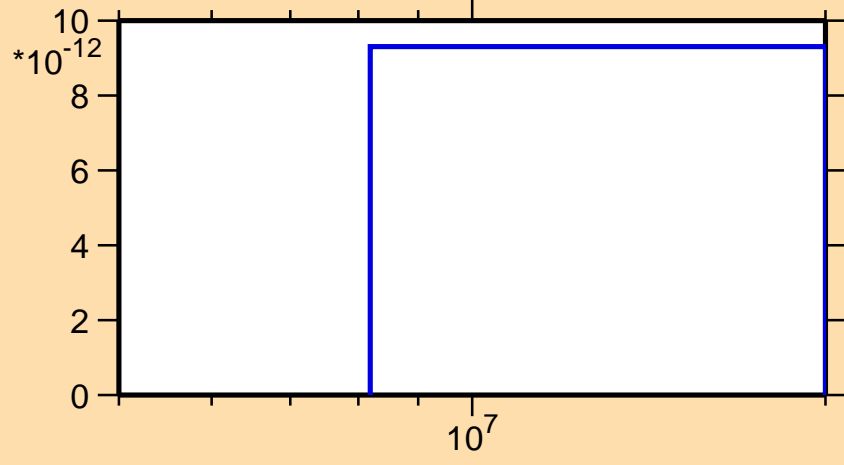

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2np)$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,2np)$

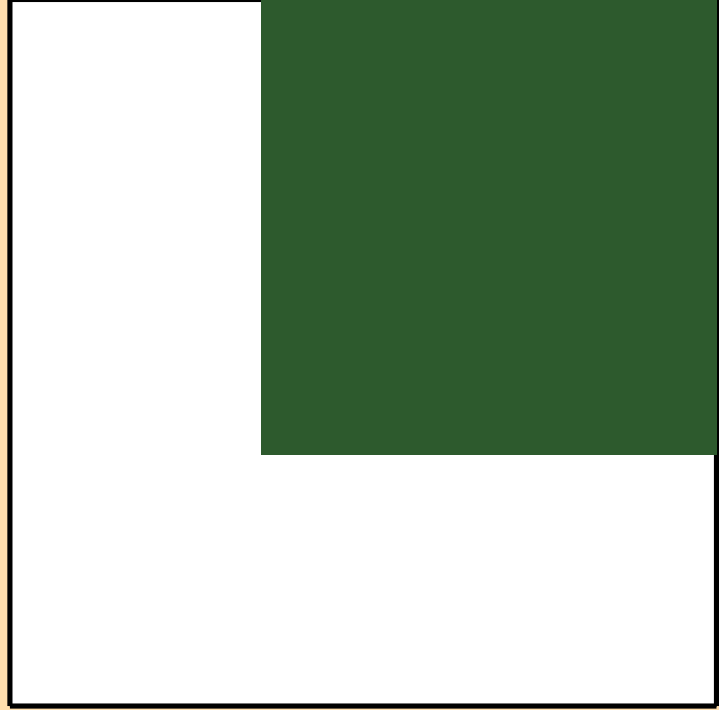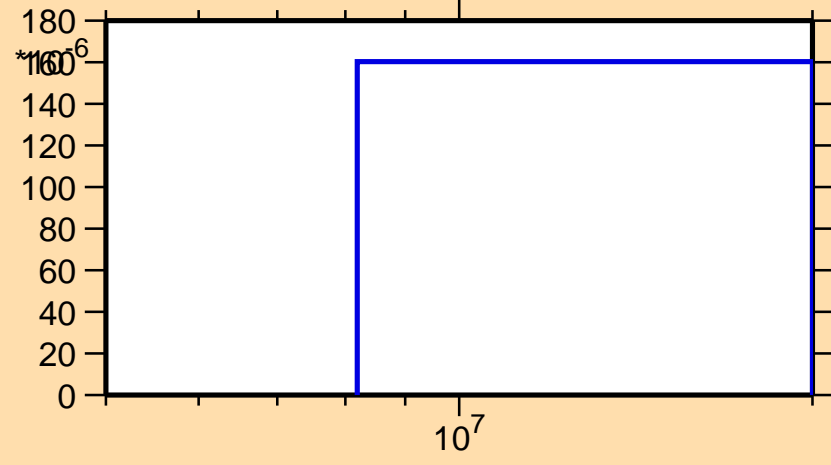

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(\text{mt } 45)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(\text{mt } 45)$

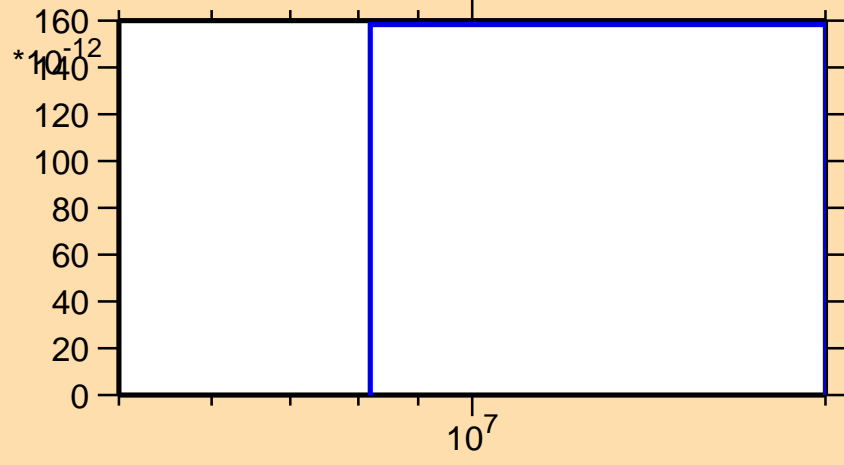


160
140
120
100
80
60
40
20
0


10^7

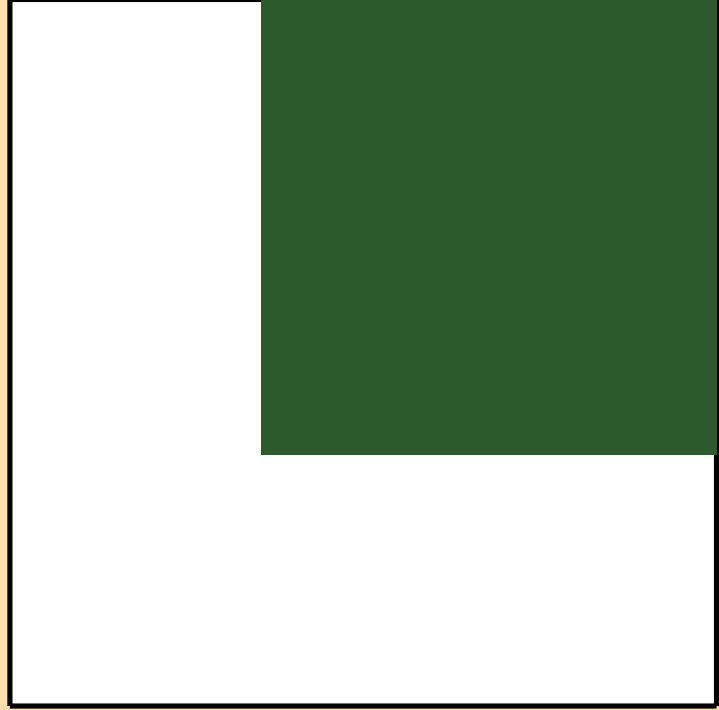

Correlation Matrix

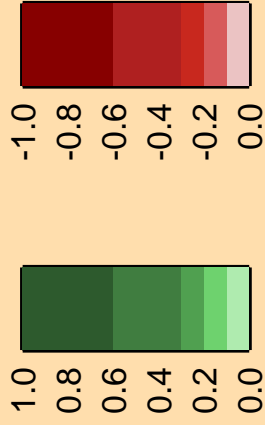


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_2)$

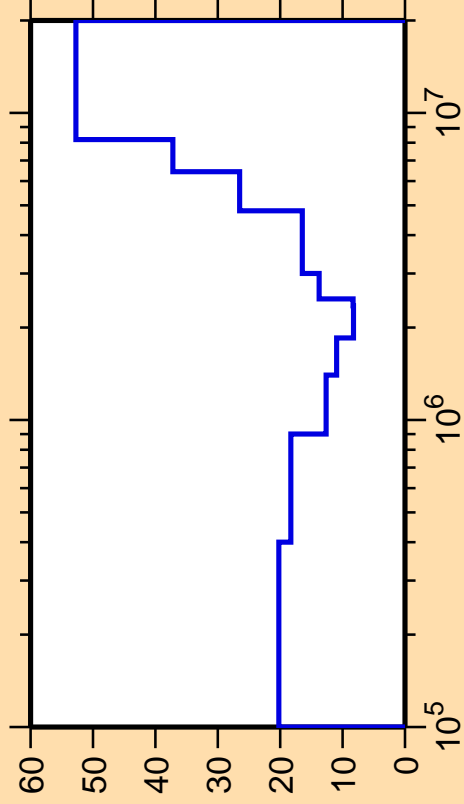

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,n_2)$

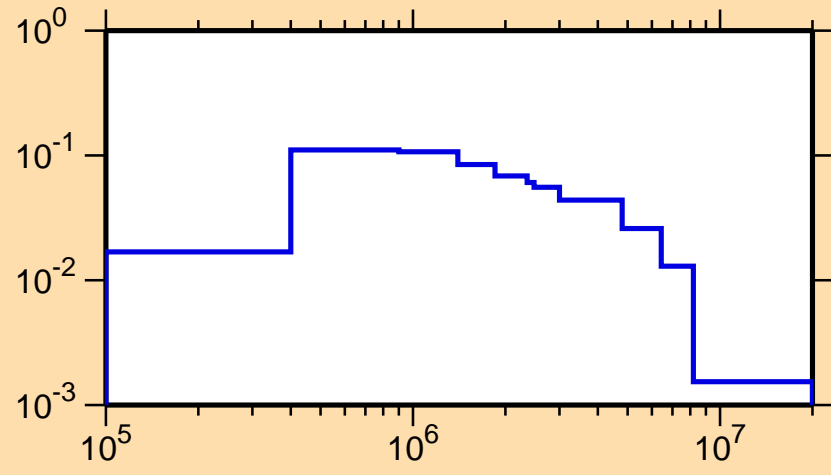

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_3)$

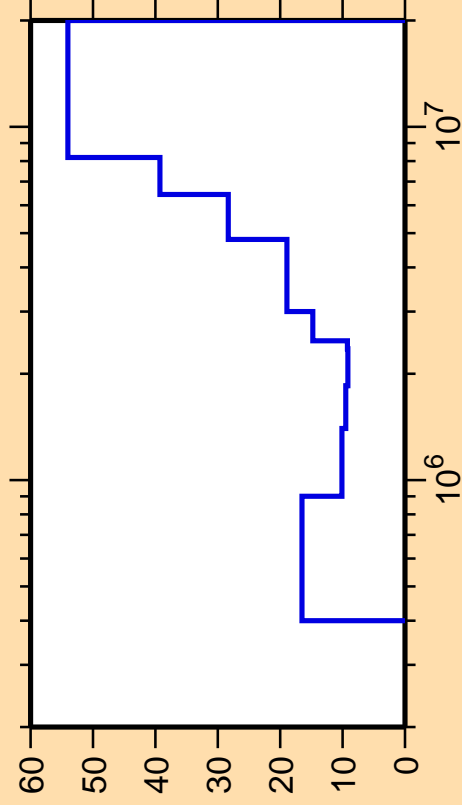


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,n_3)$

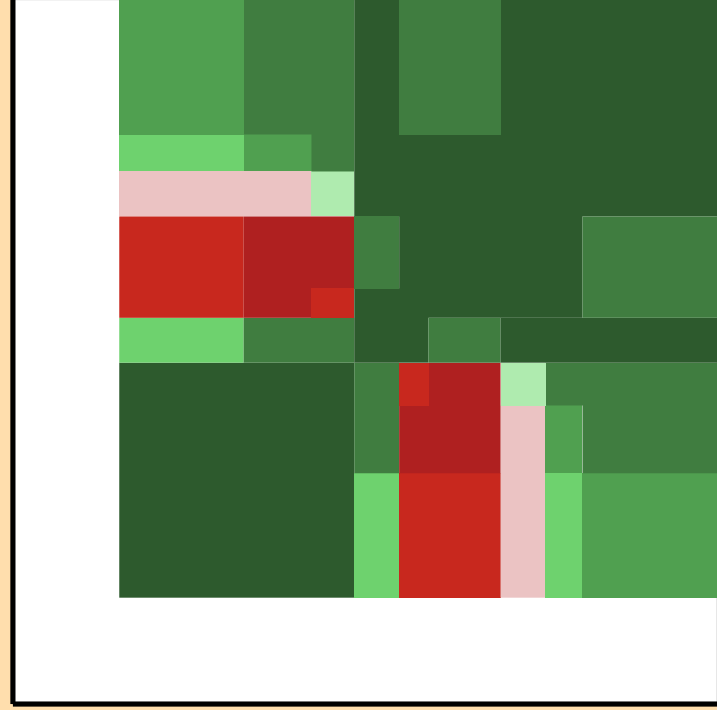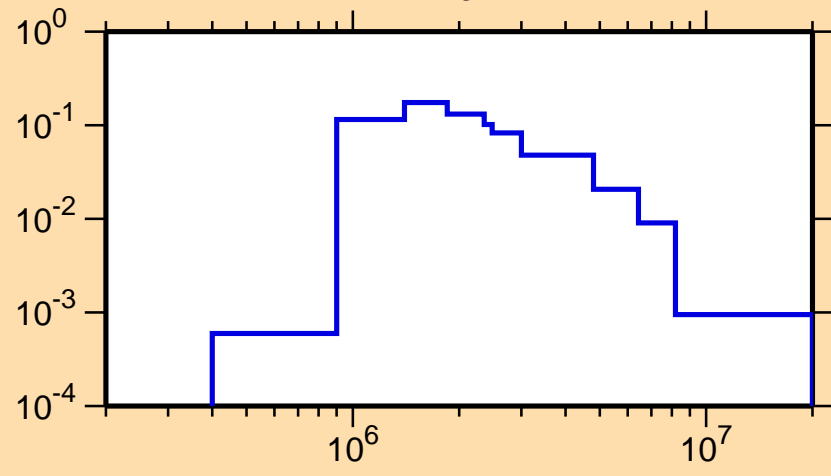

Correlation Matrix

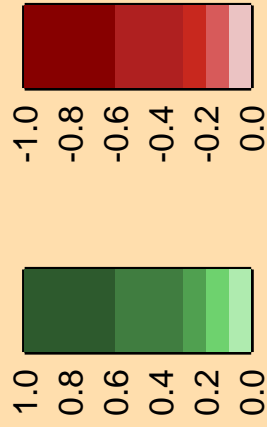



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_4)$

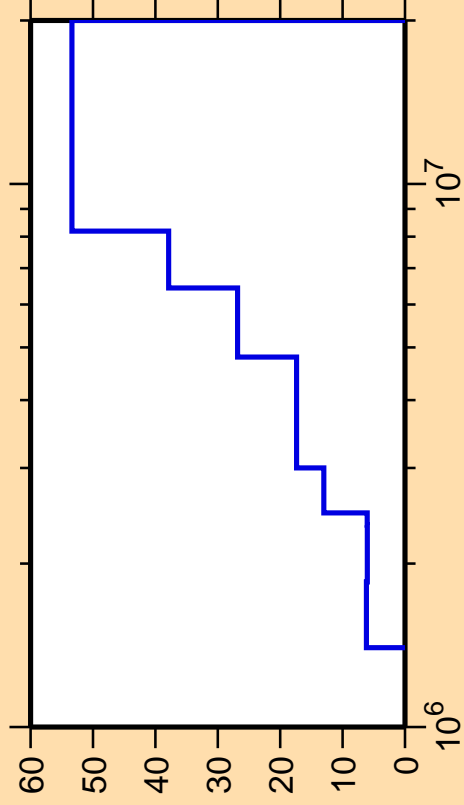

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,n_4)$

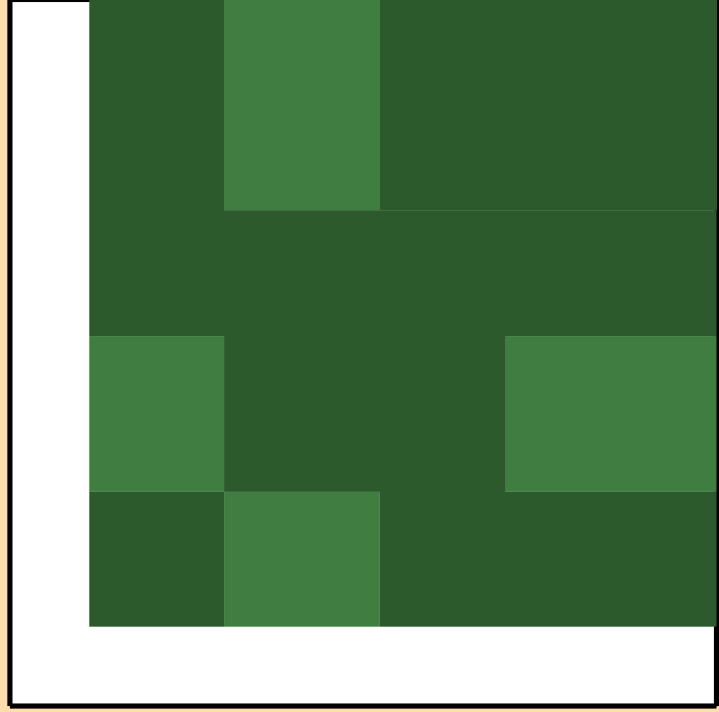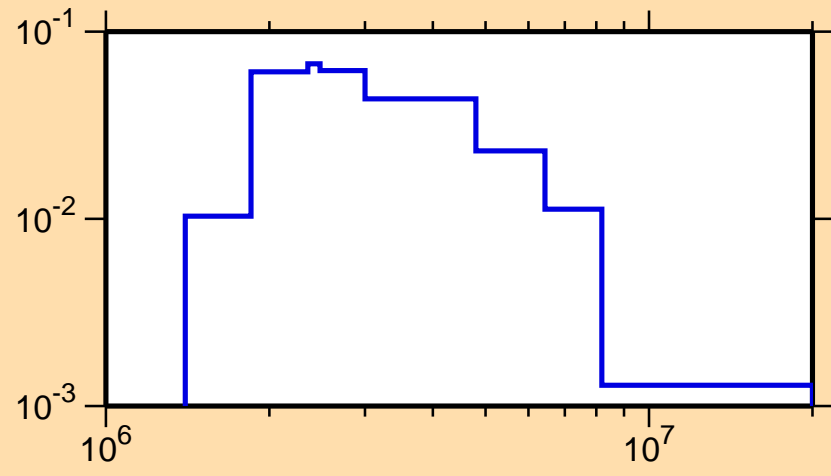

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

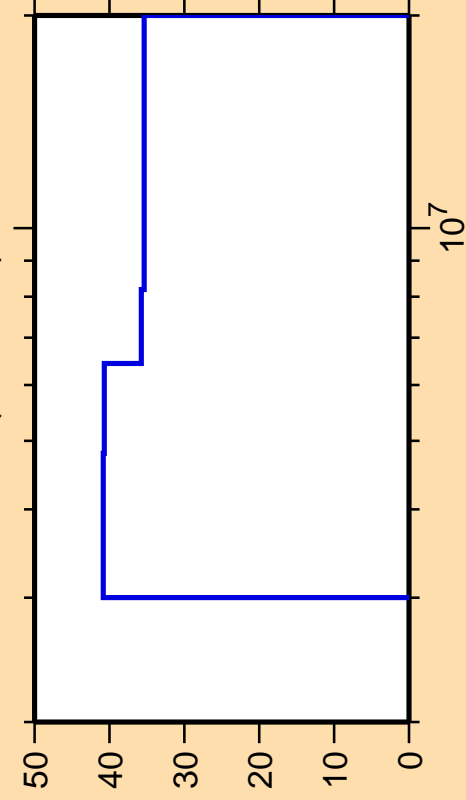


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

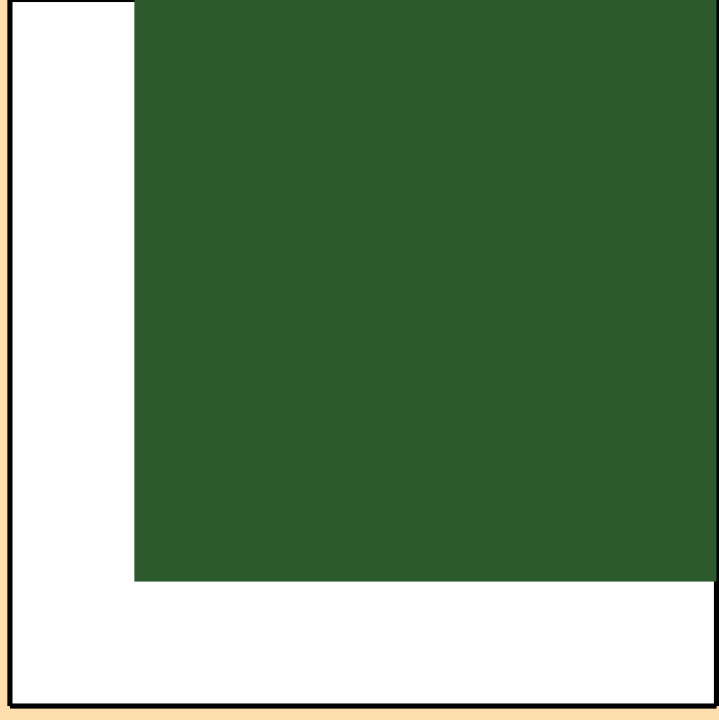


σ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

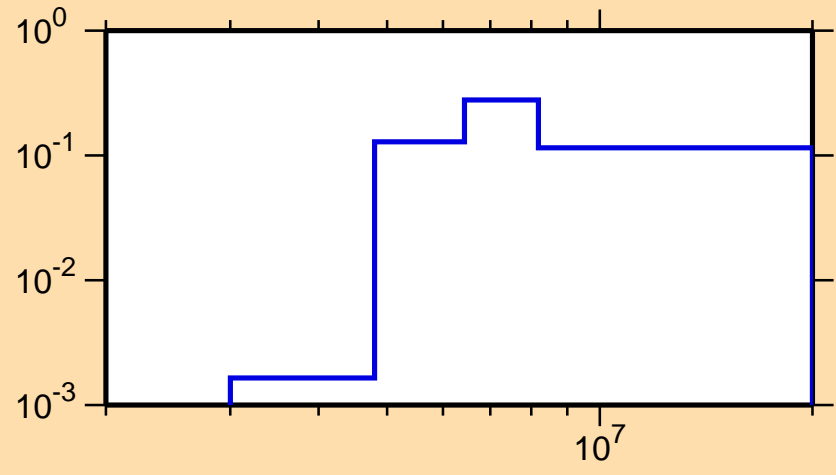

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\gamma)$


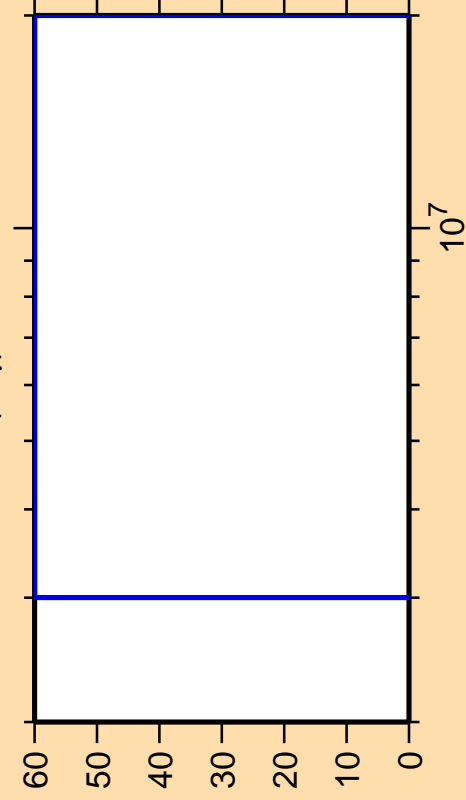


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,ncont.)$

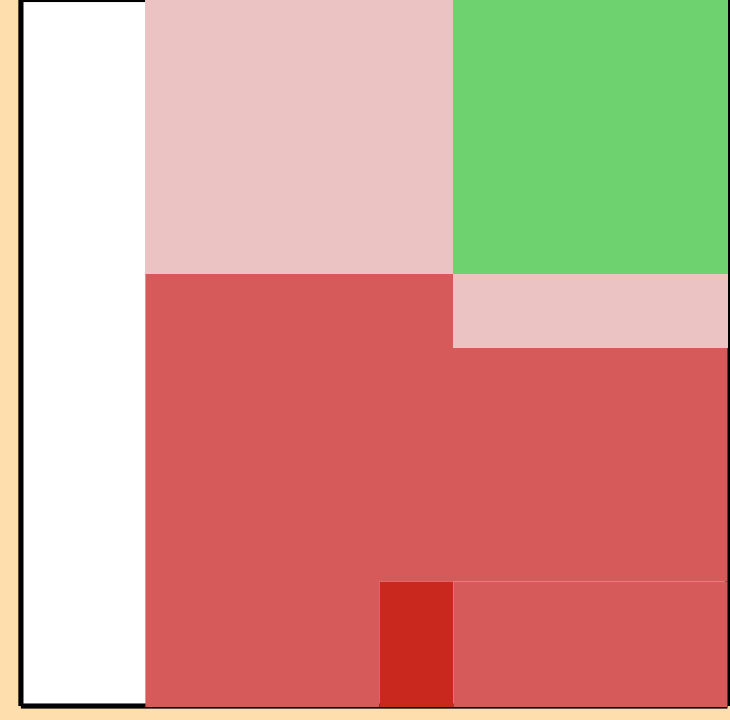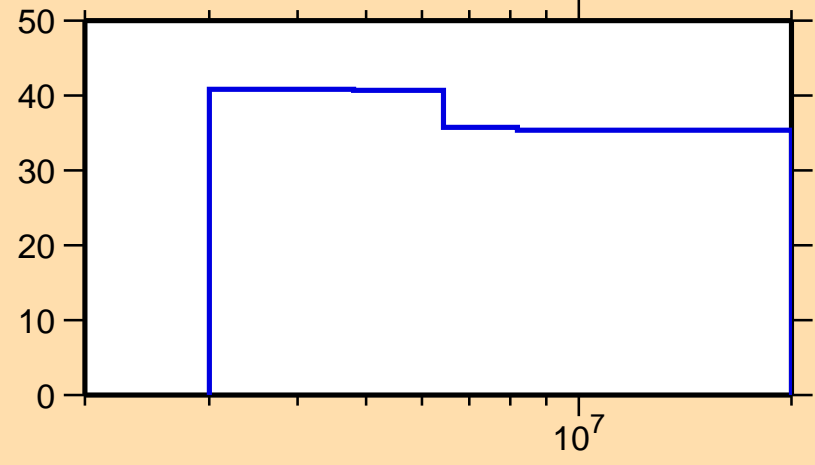

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$

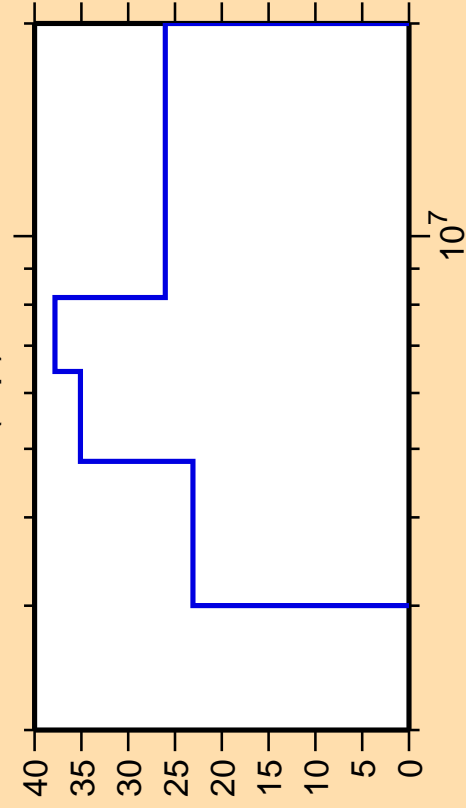

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,ncont.)$

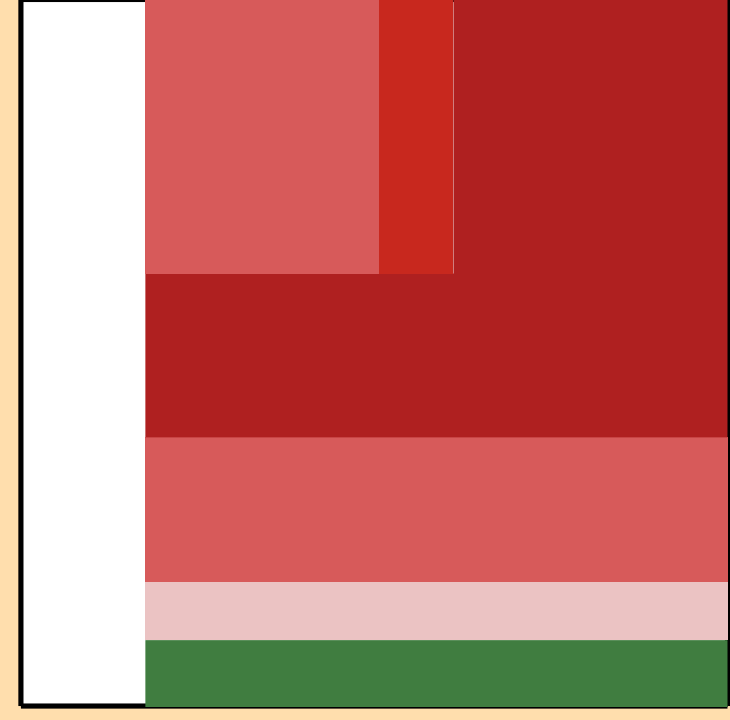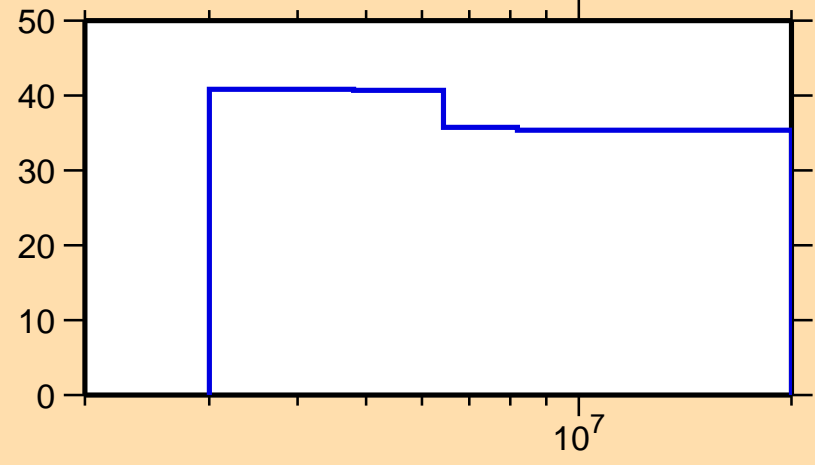

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$

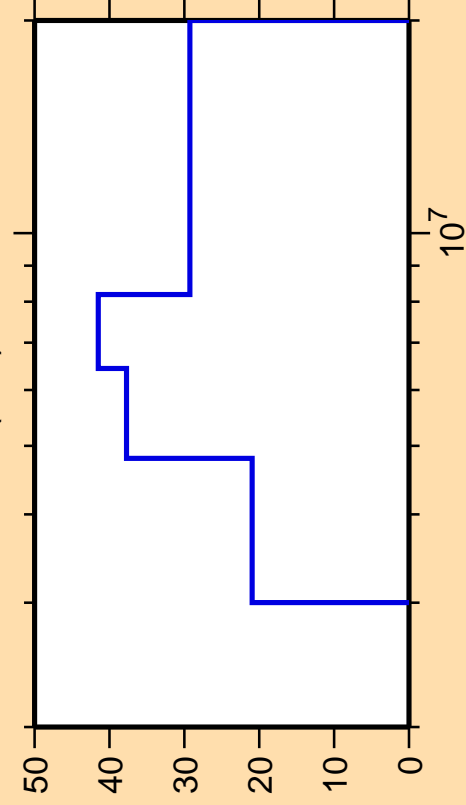



Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,ncont.)$

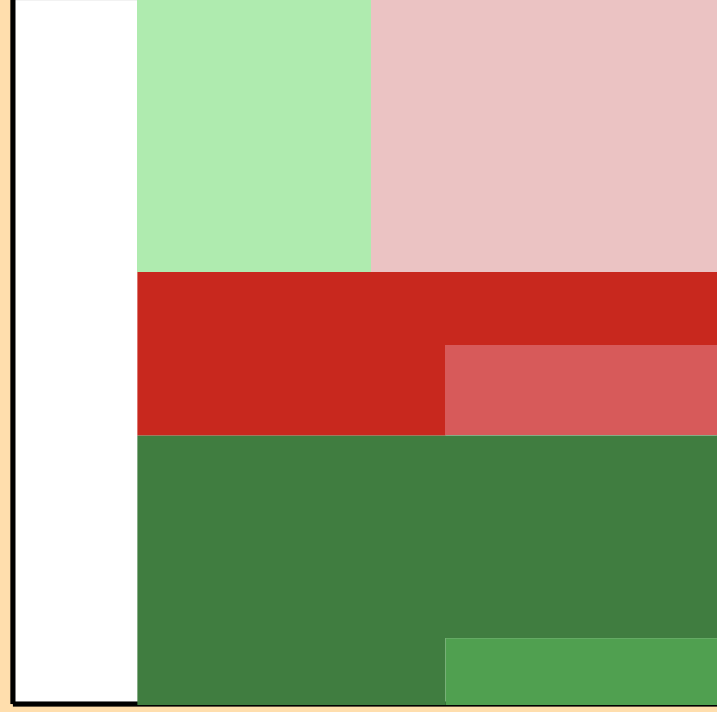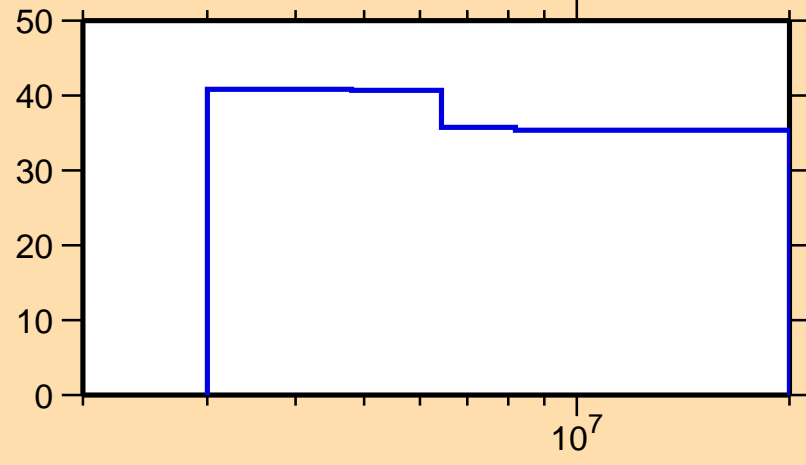

Correlation Matrix

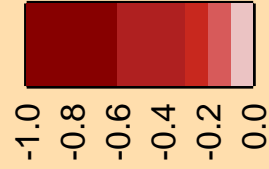
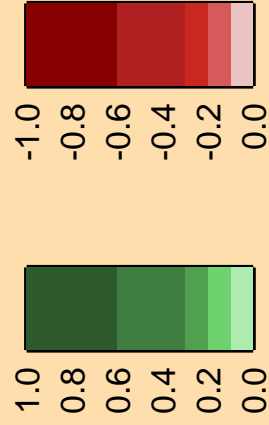


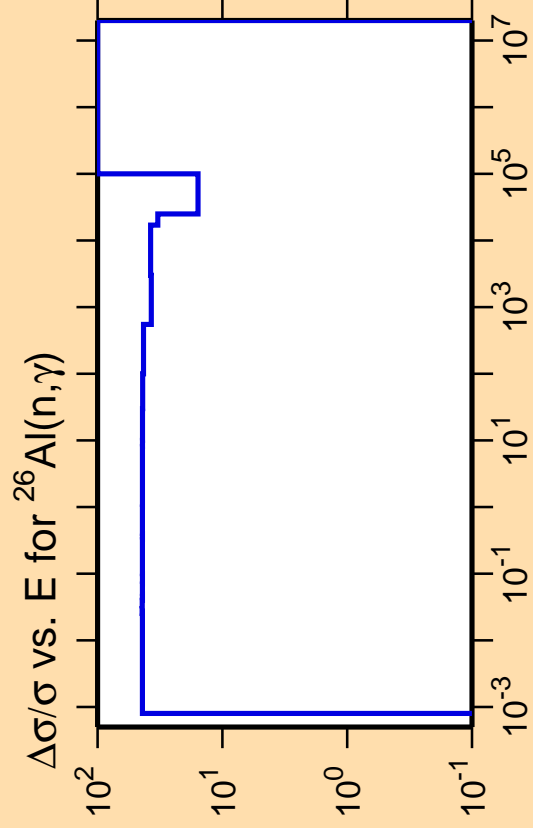

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

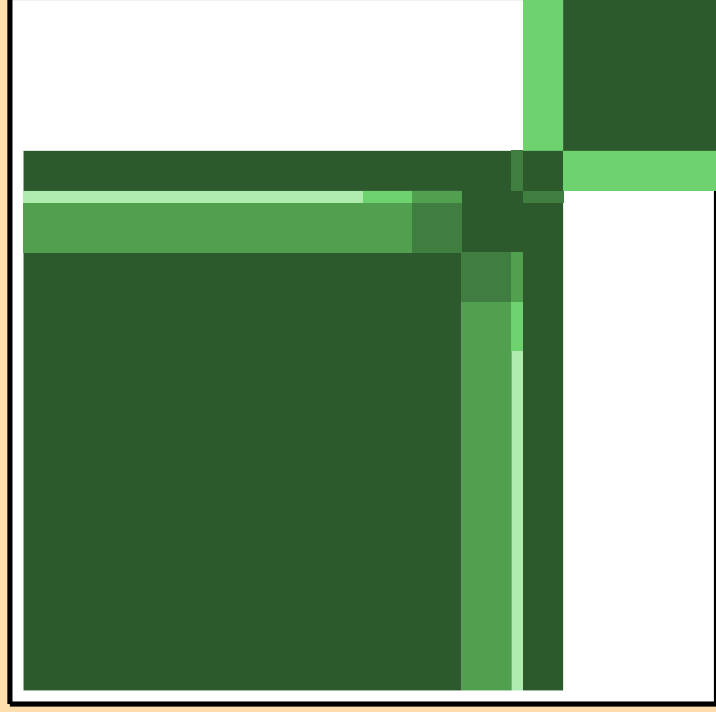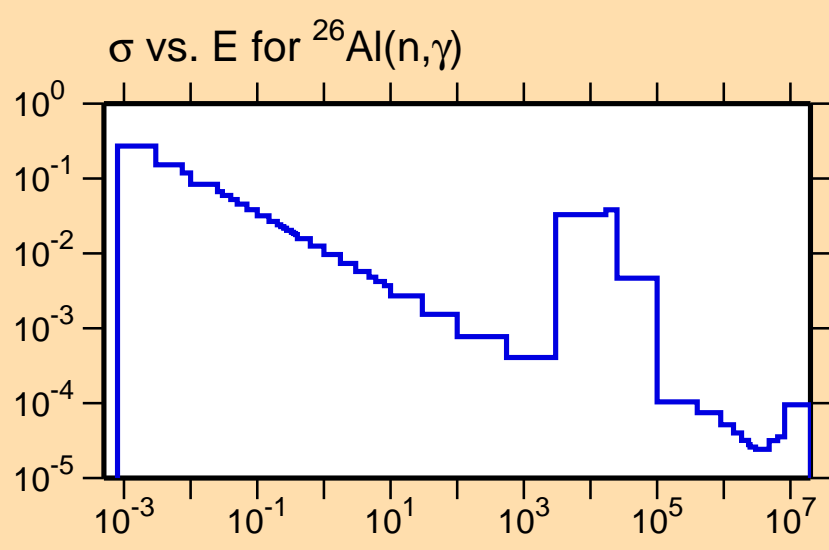

Correlation Matrix





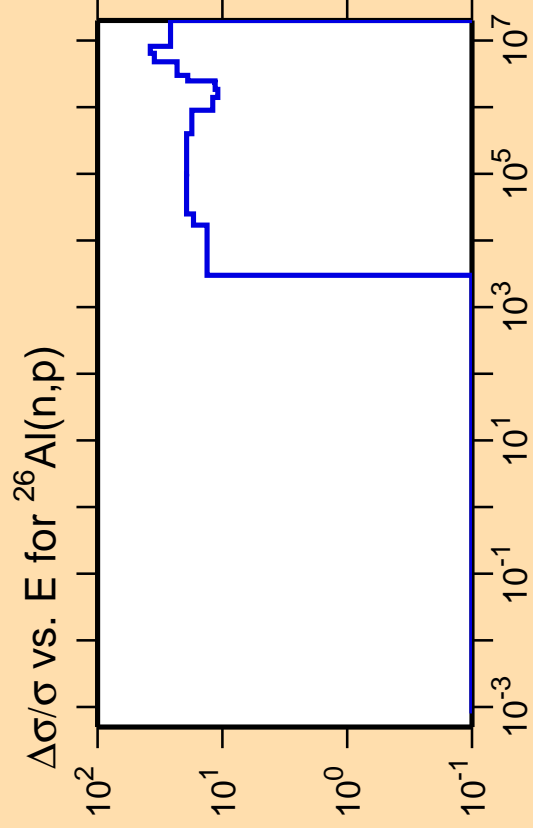

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

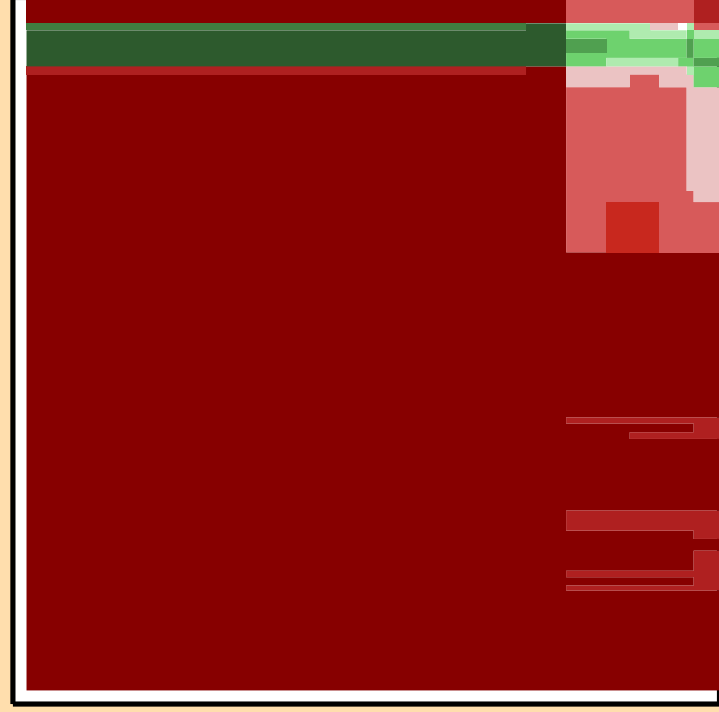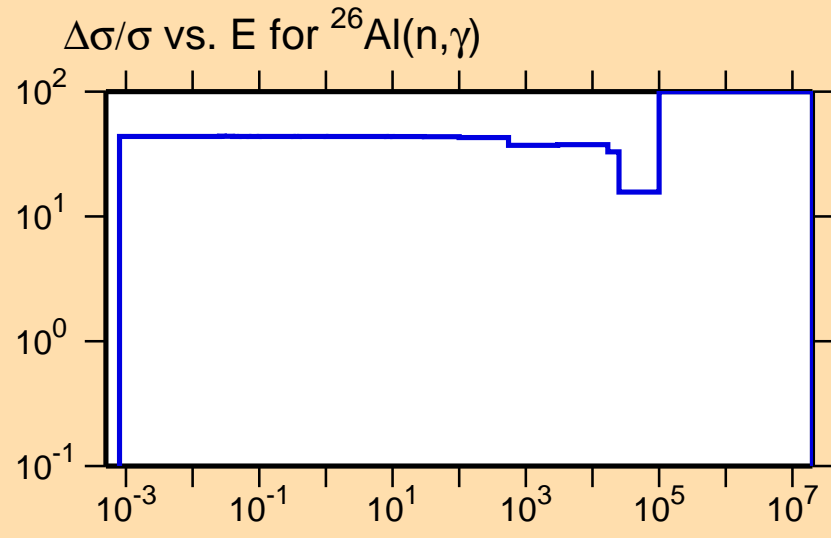

Correlation Matrix





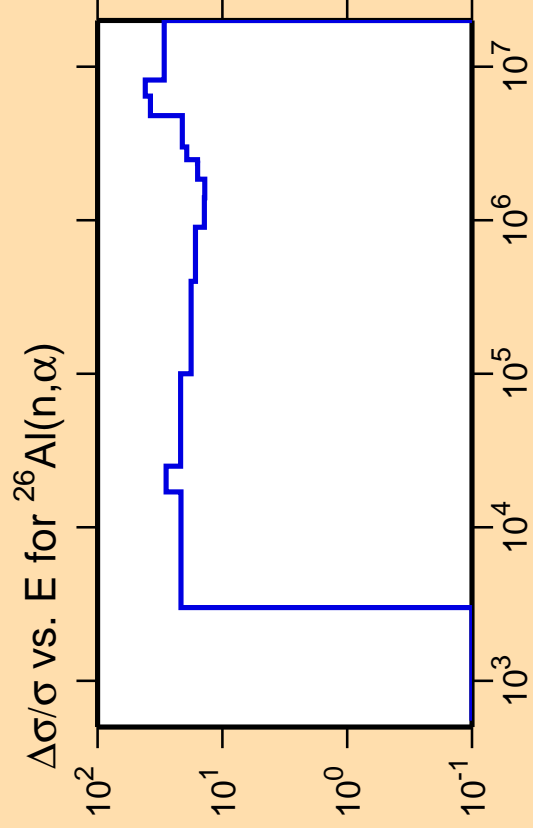

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

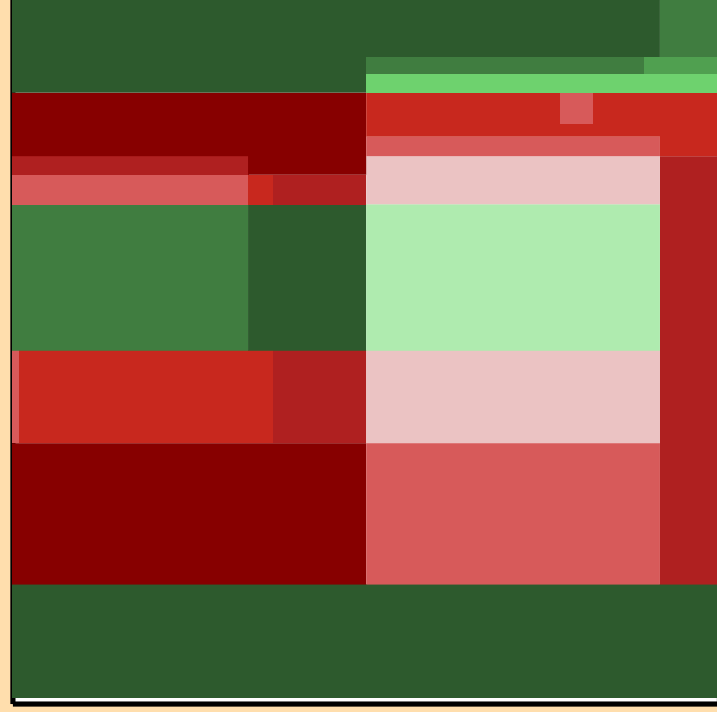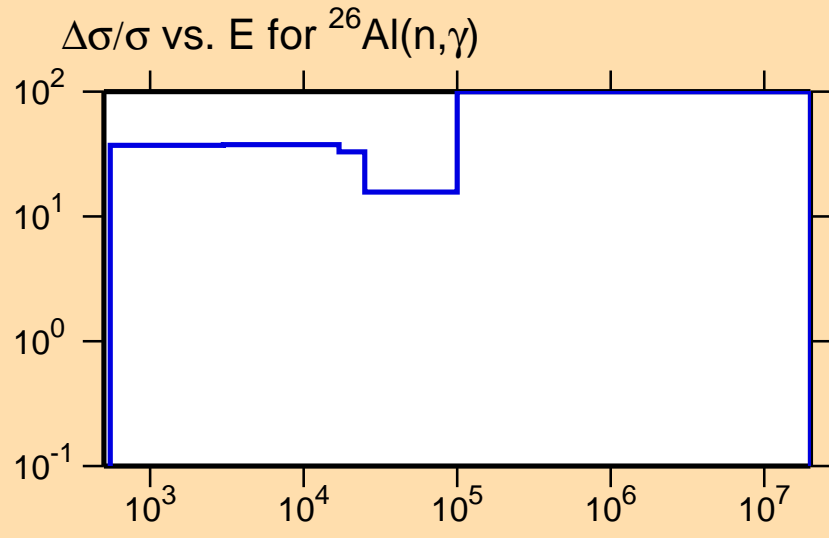

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$


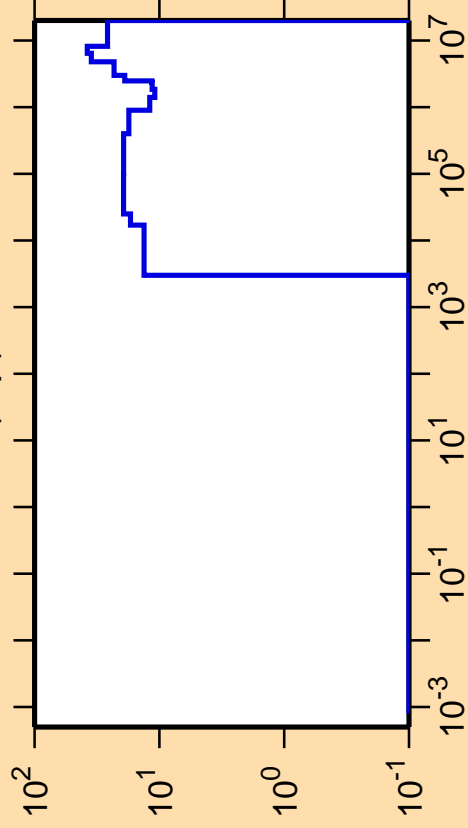


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,p)$

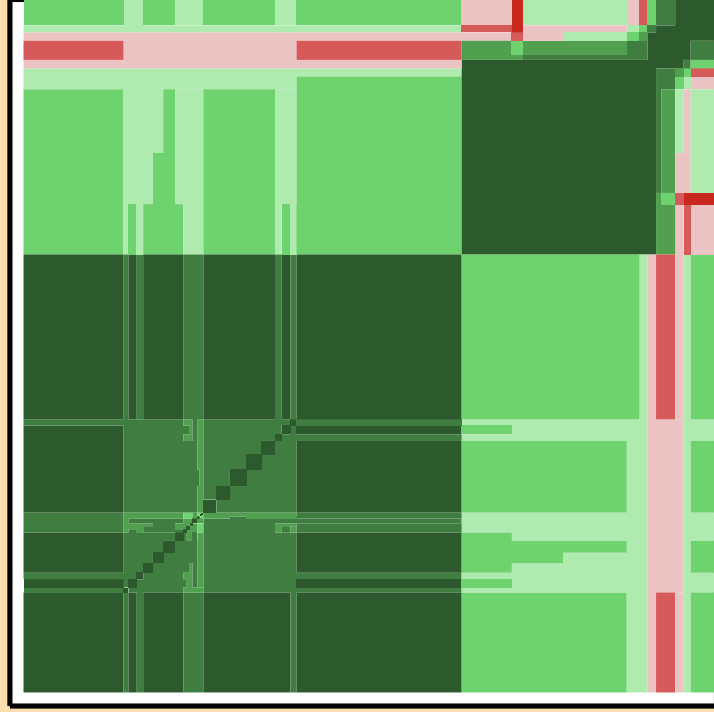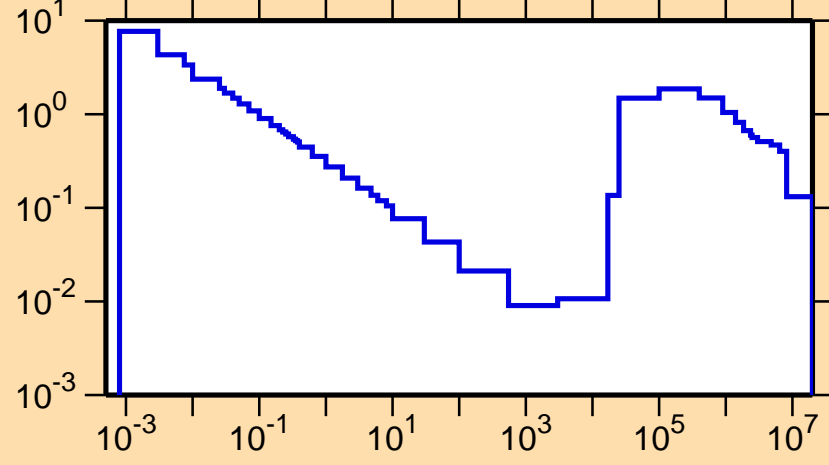

Correlation Matrix






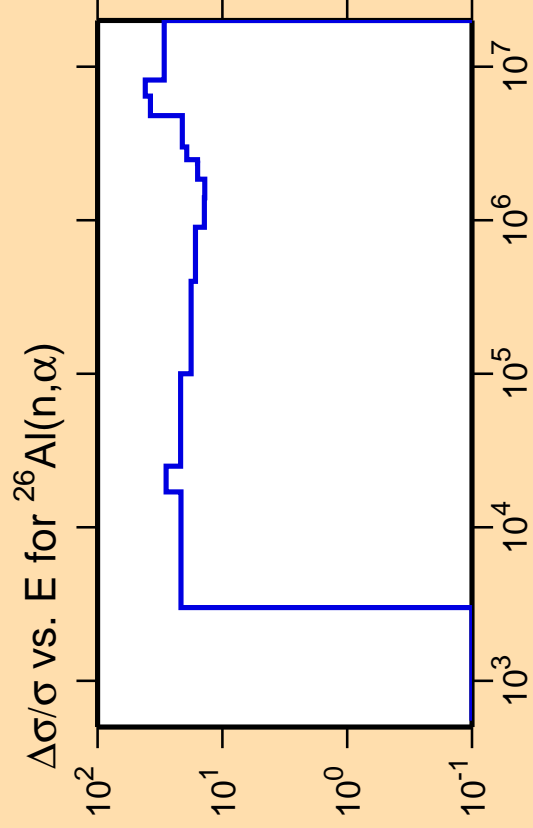


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

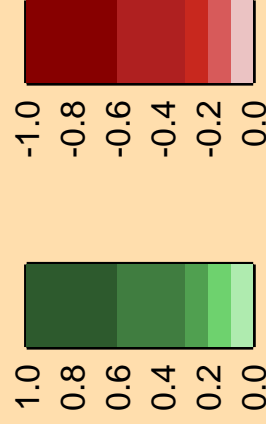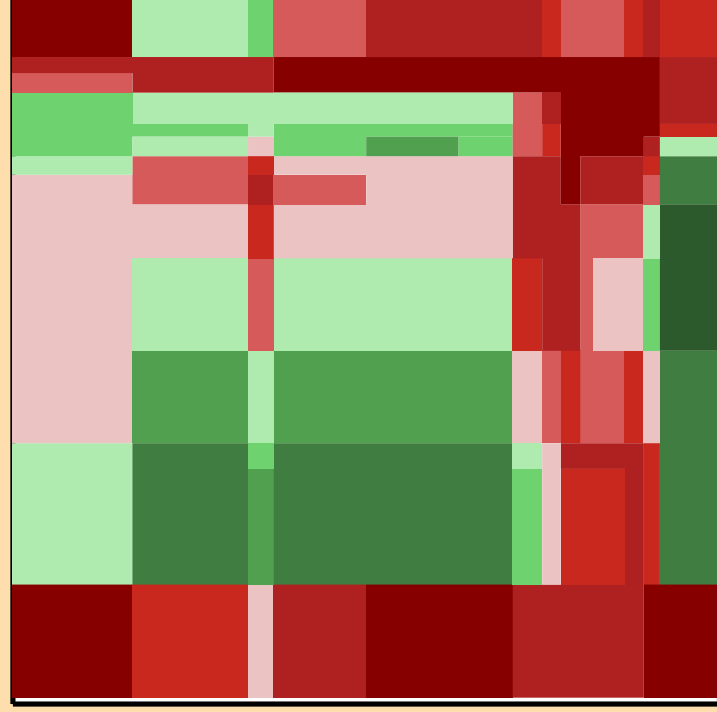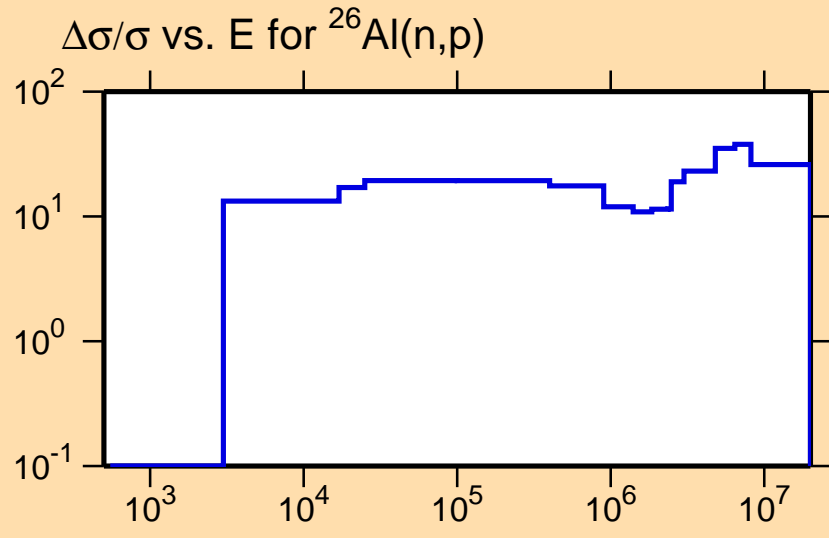



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,d)$

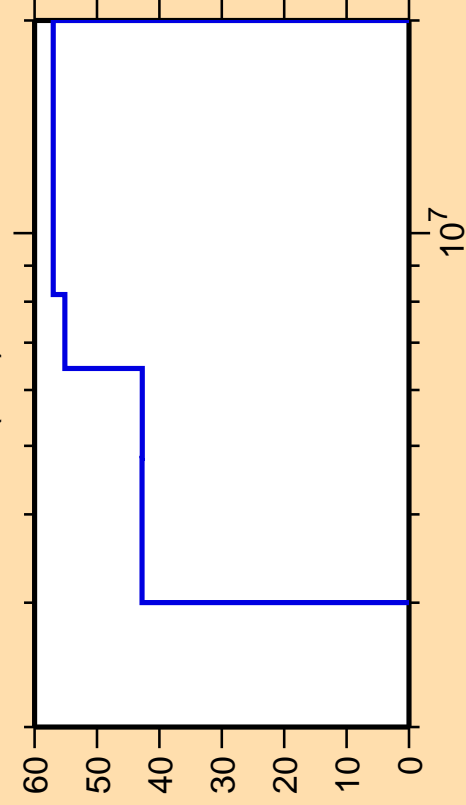


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,d)$

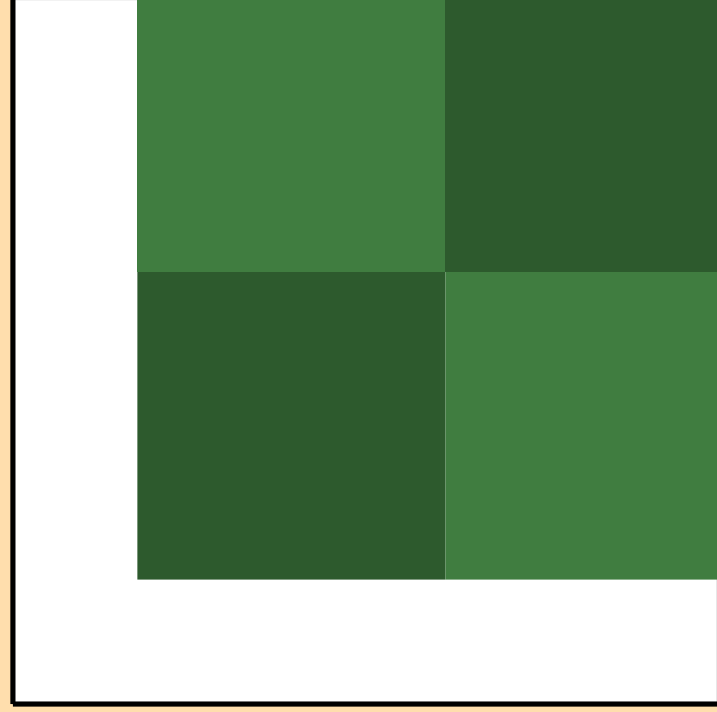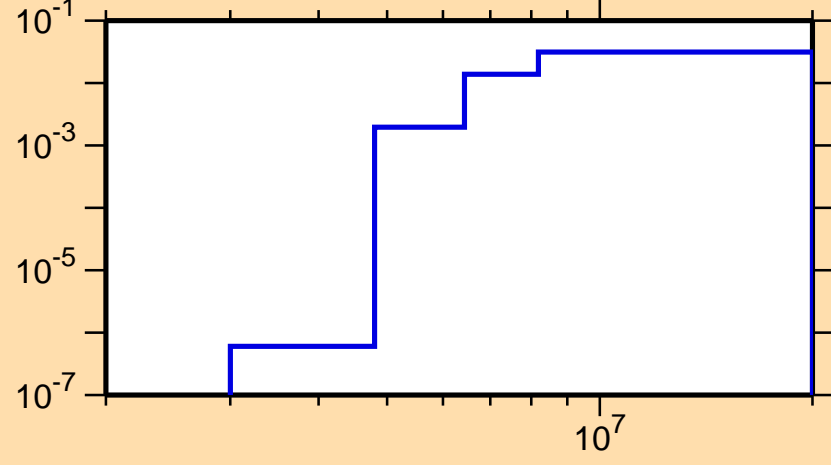

Correlation Matrix

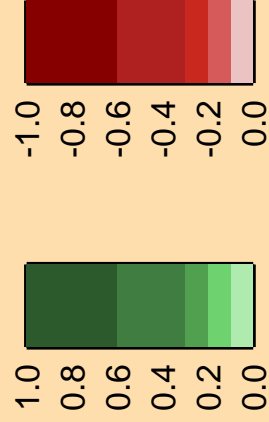


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,t)$

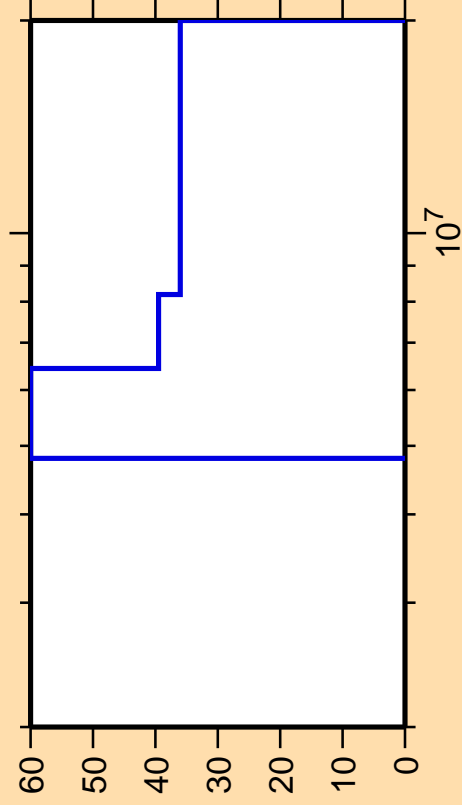

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

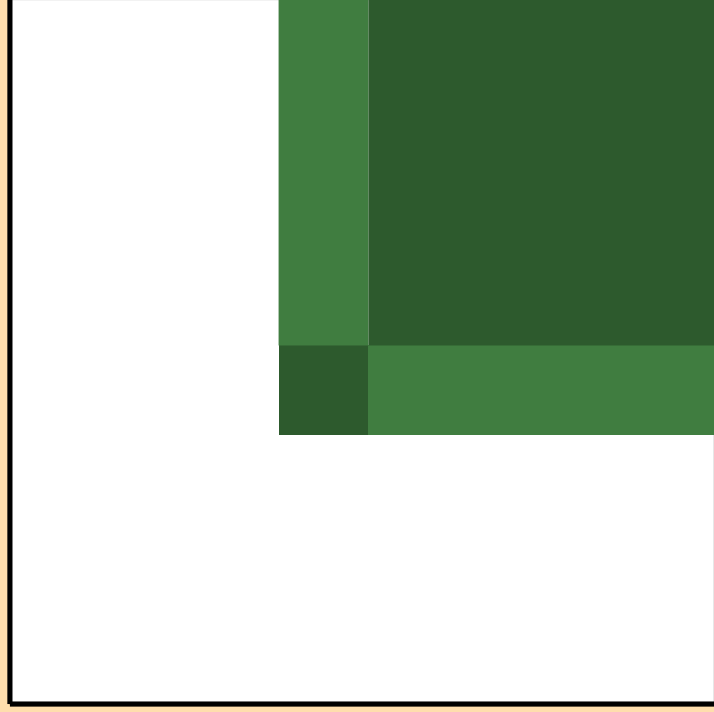

Correlation Matrix



σ vs. E for $^{26}\text{Al}(n,t)$

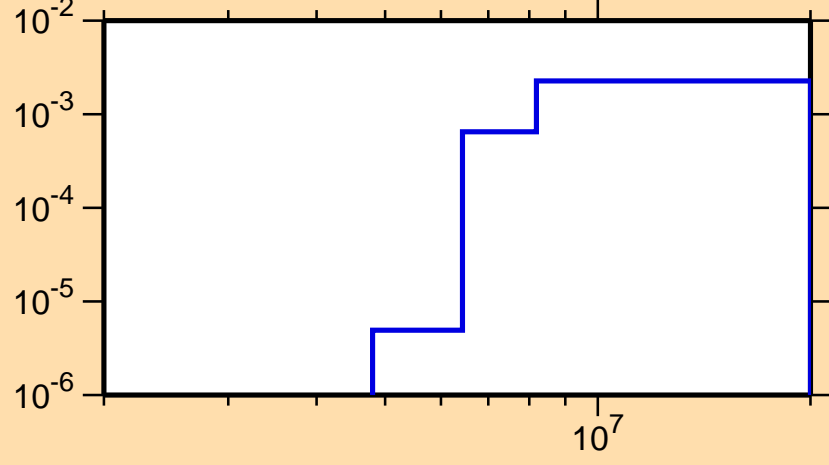

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{He3})$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{26}\text{Al}(n,\text{He3})$

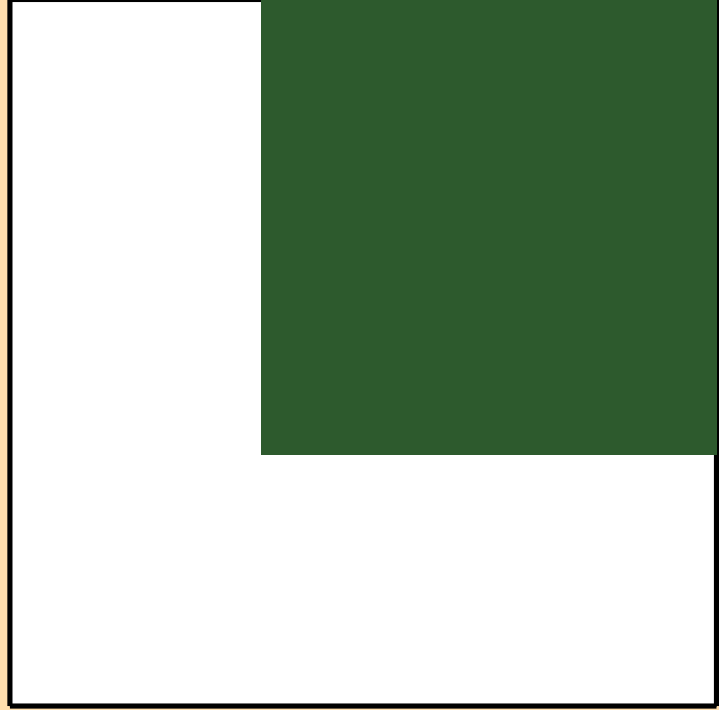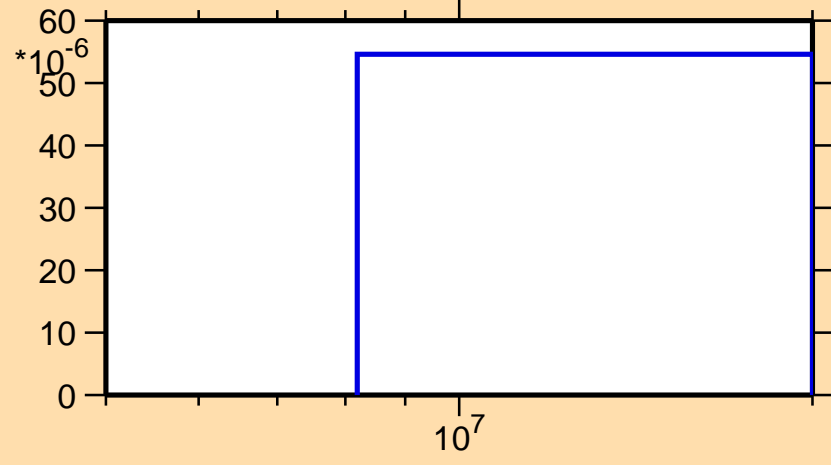

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$


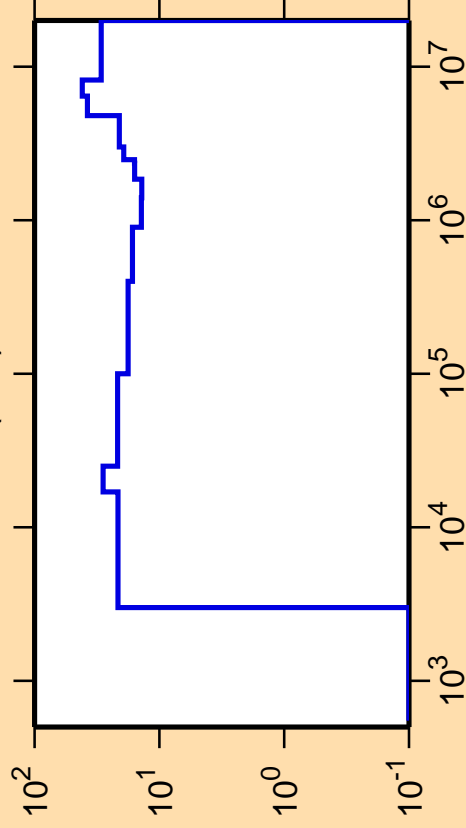


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{26}\text{Al}(n,\alpha)$

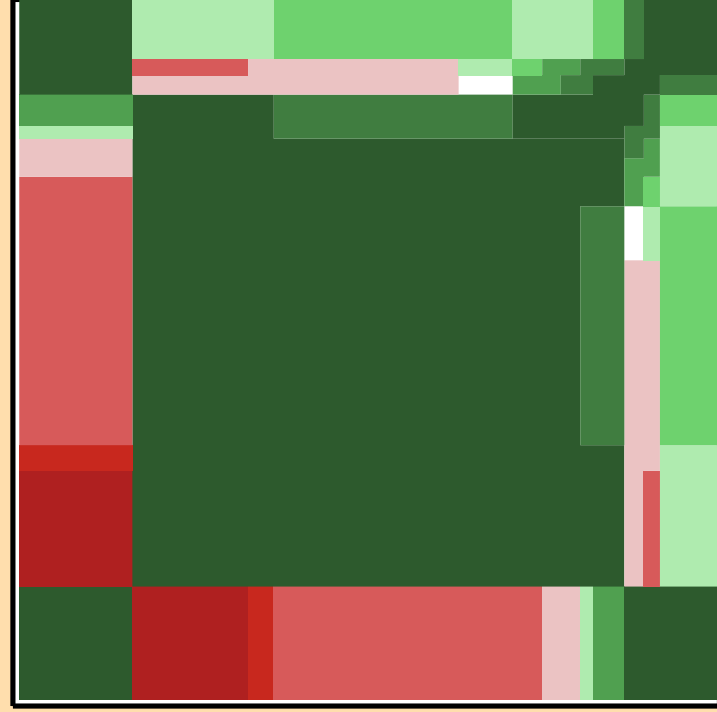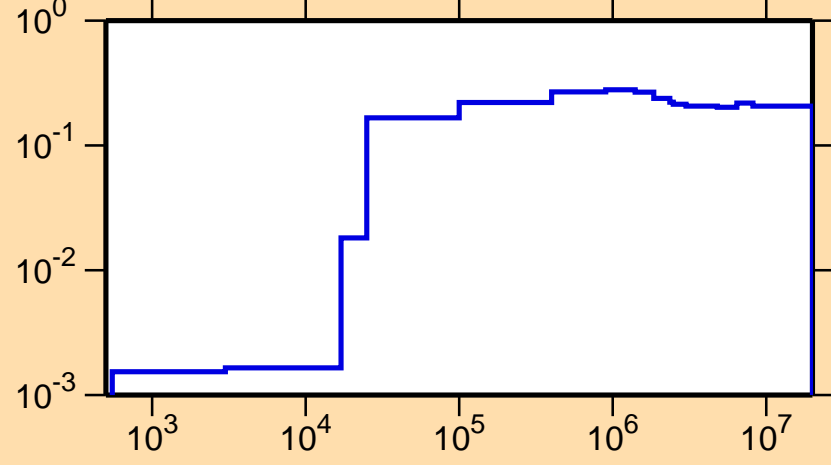

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p\alpha)$

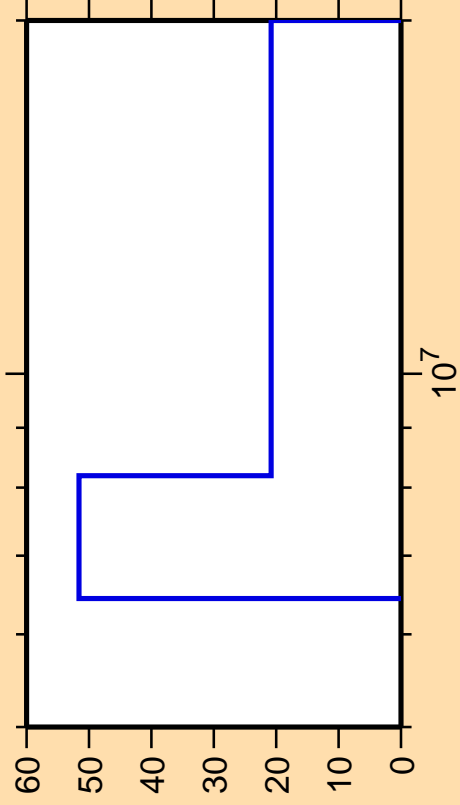

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{26}\text{Al}(n,p\alpha)$

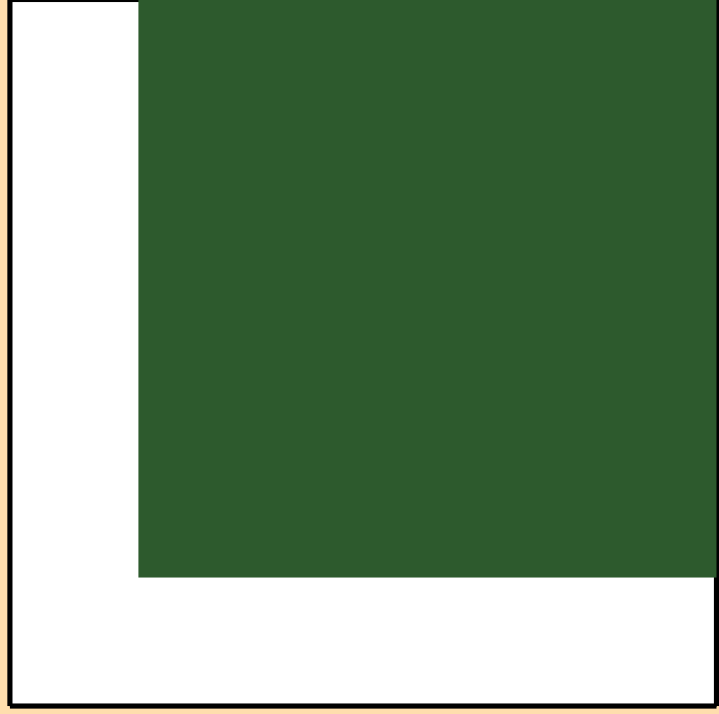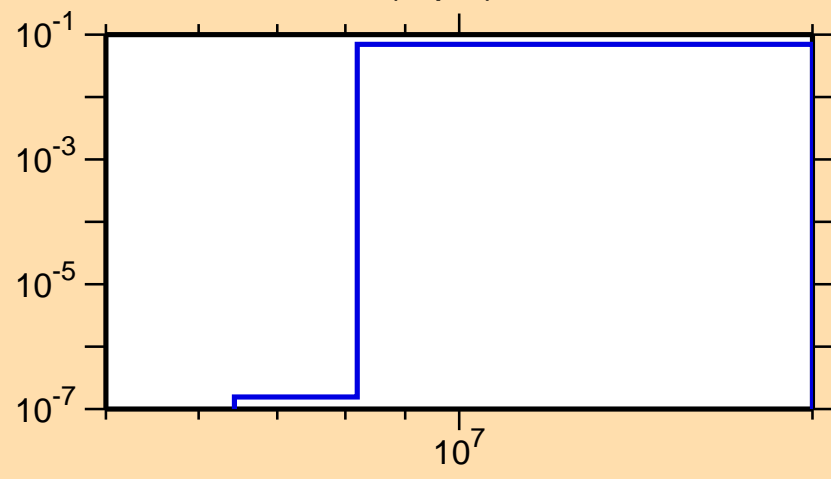

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,pd)$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{26}\text{Al}(n,pd)$

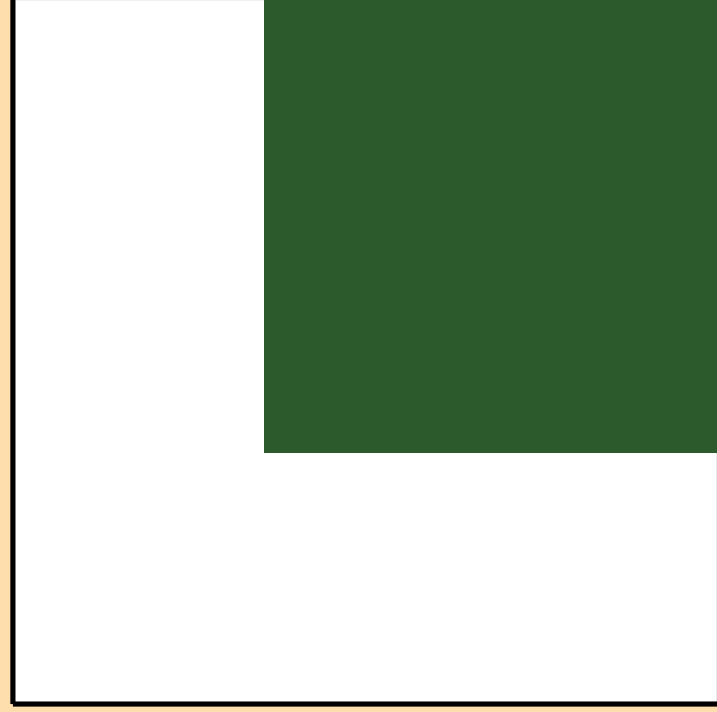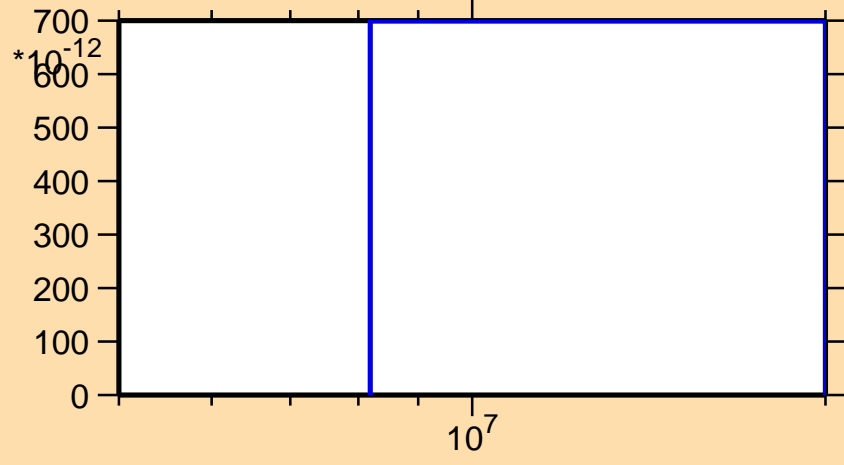

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{pt})$

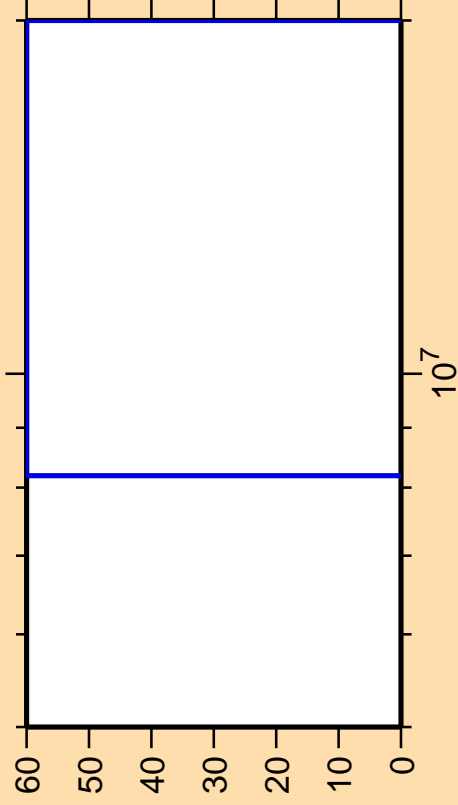


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,\text{pt})$

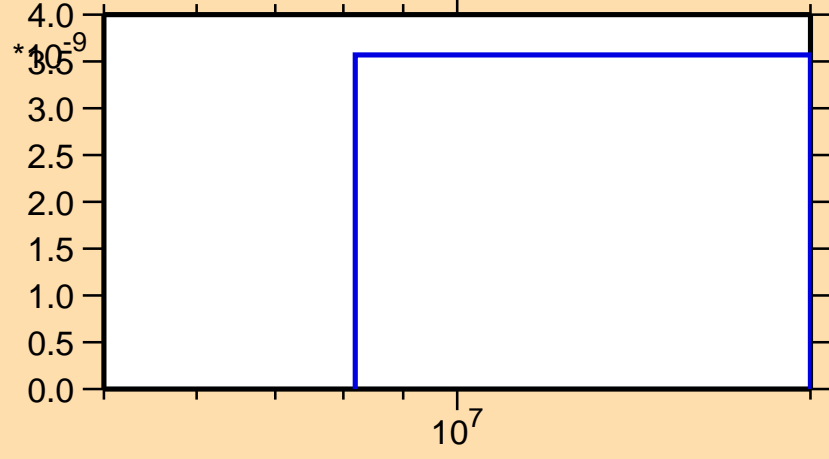


$\times 10^{-9}$


10^7

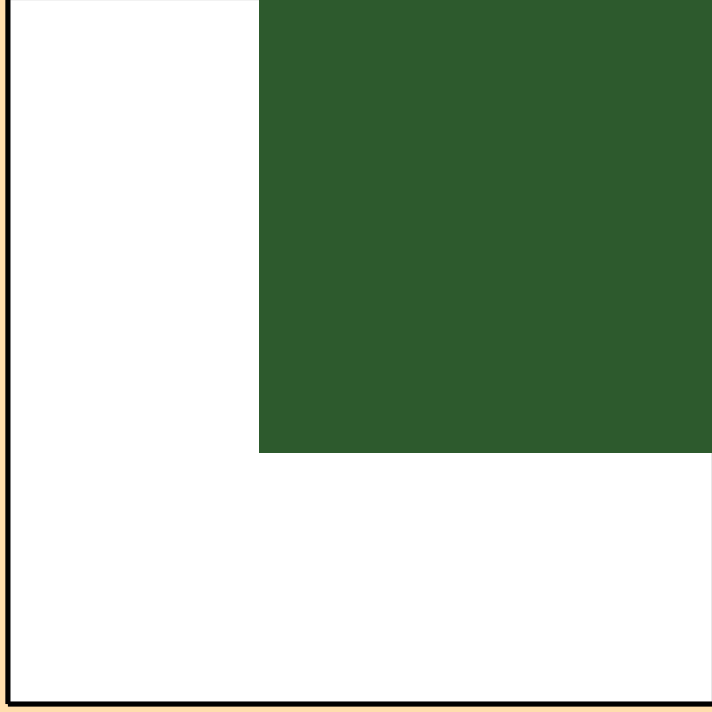

Correlation Matrix

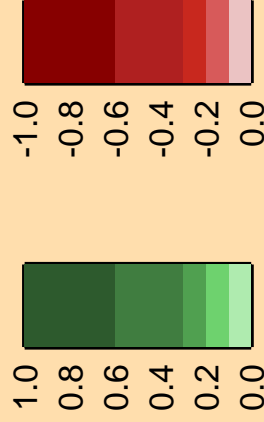



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(\text{mt117})$

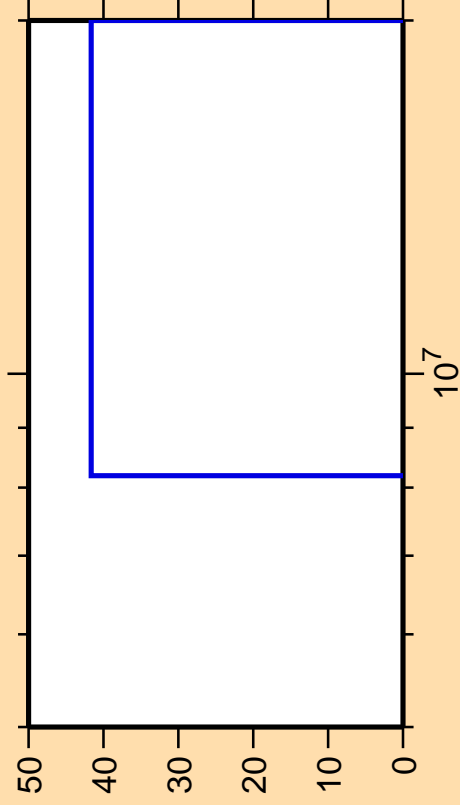

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{26}\text{Al}(\text{mt117})$

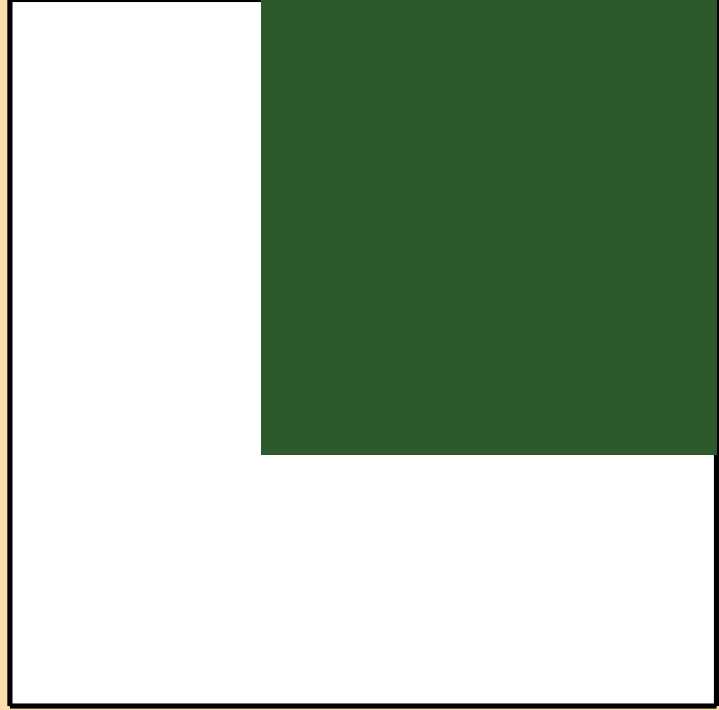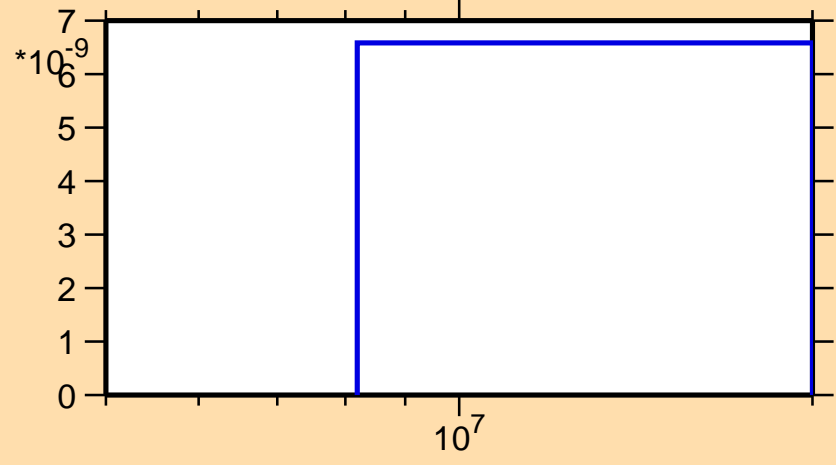

Correlation Matrix

