



Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

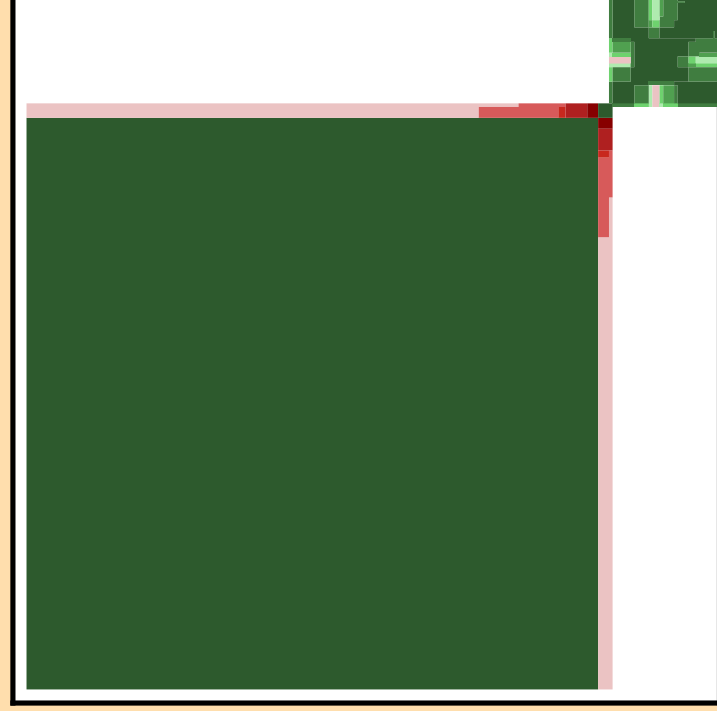

Correlation Matrix

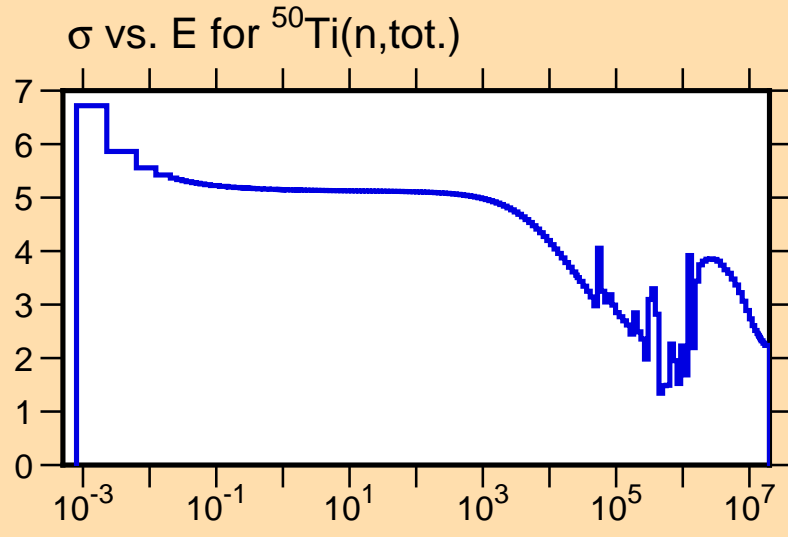



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

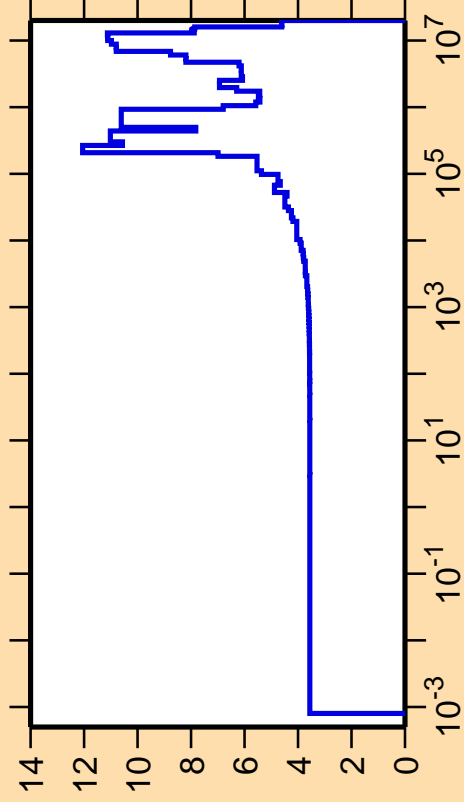

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

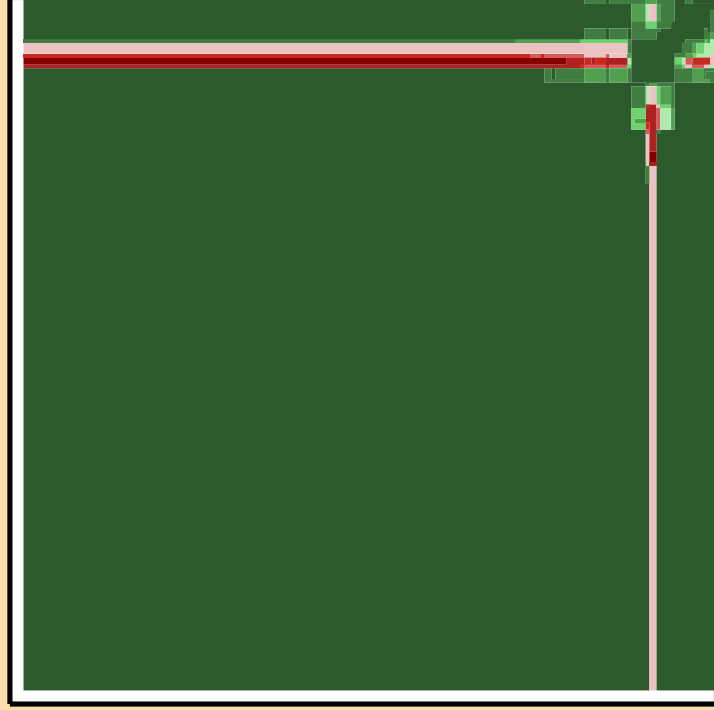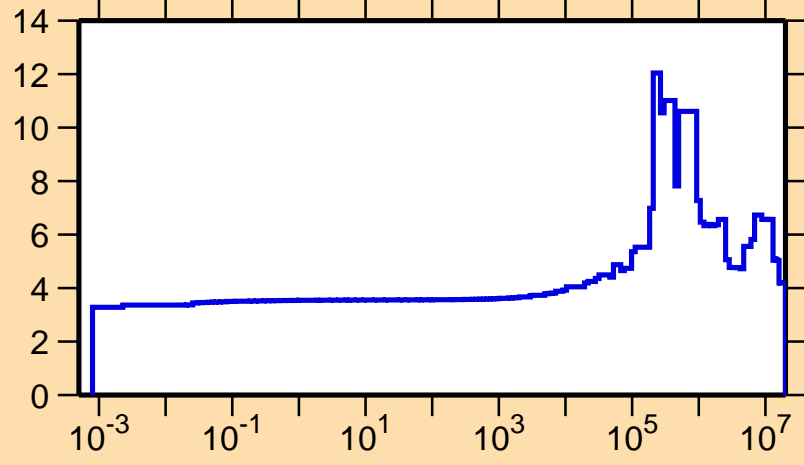

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

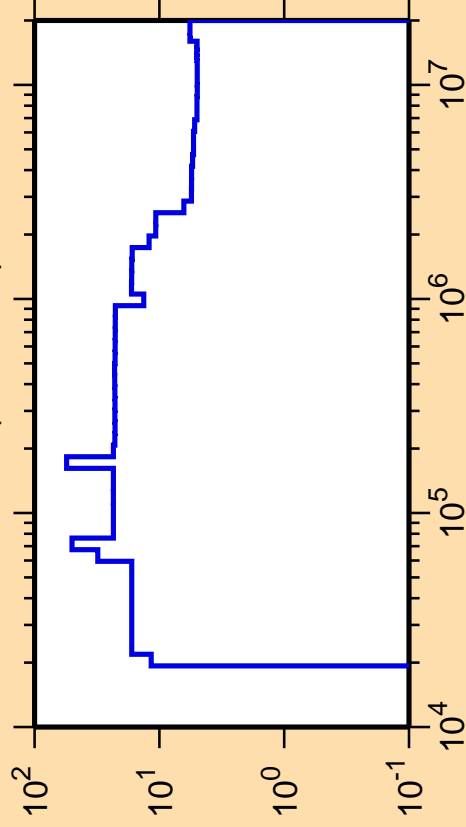

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

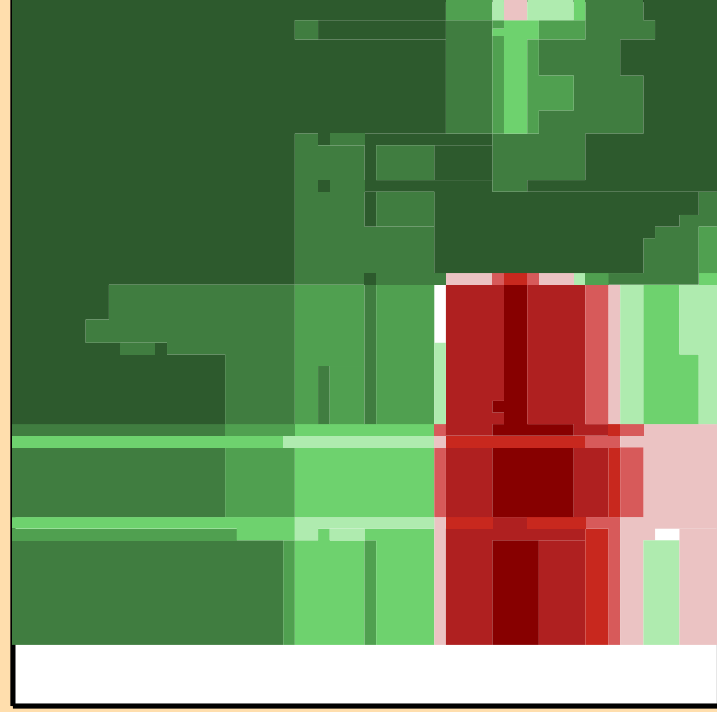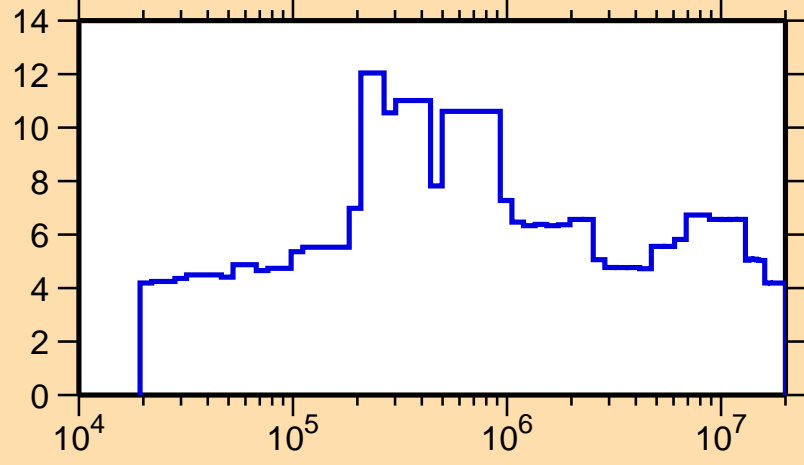


Correlation Matrix



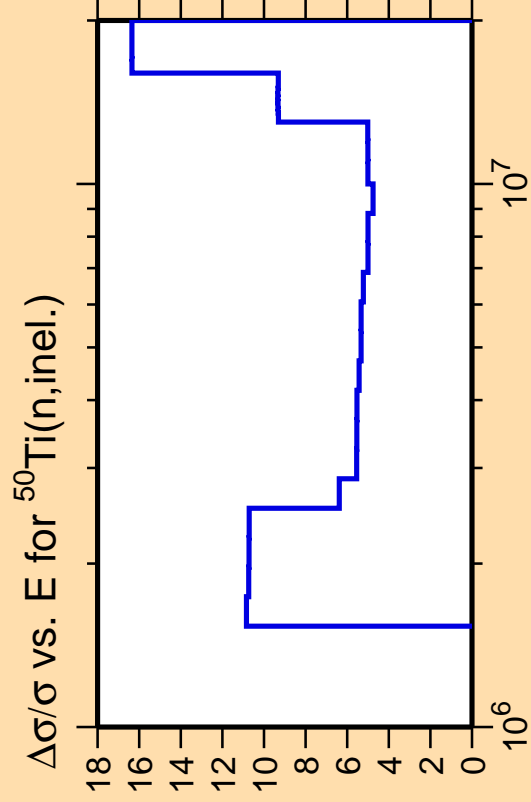

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

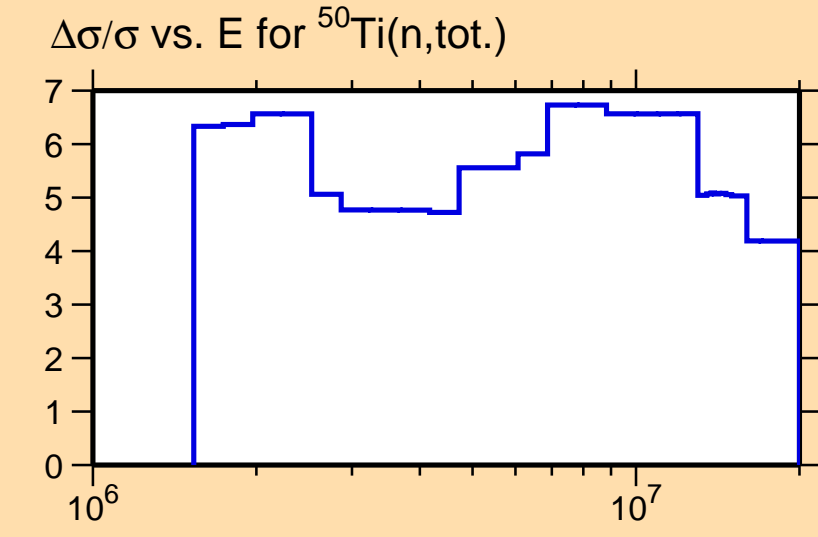

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

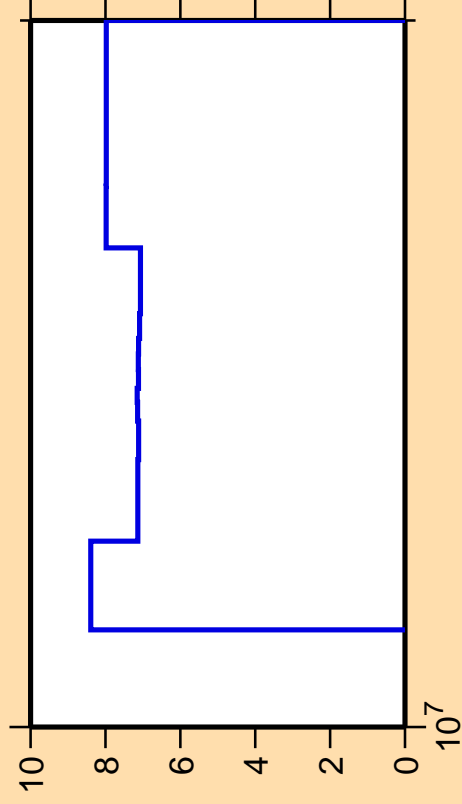

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

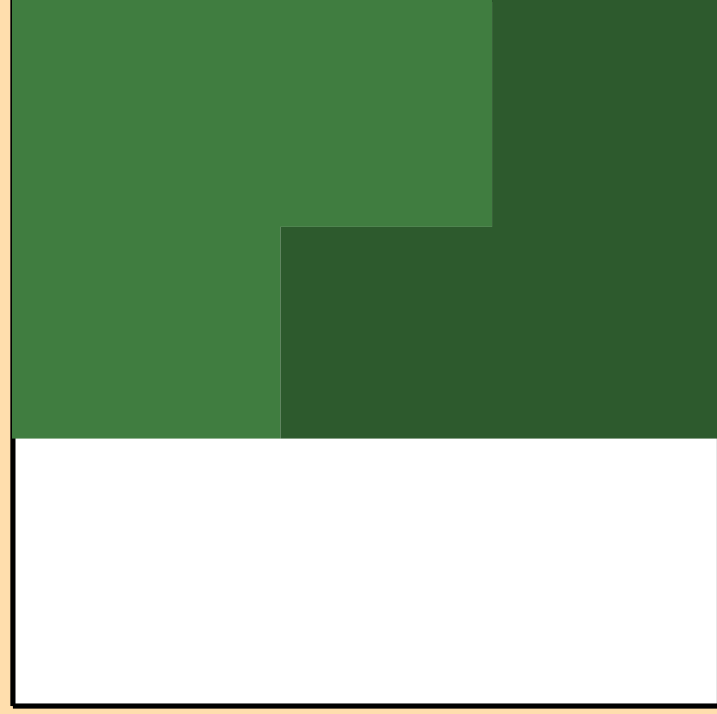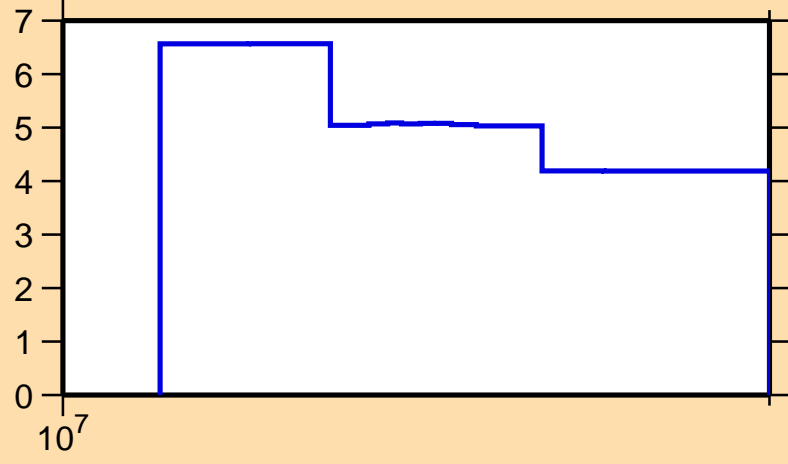

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

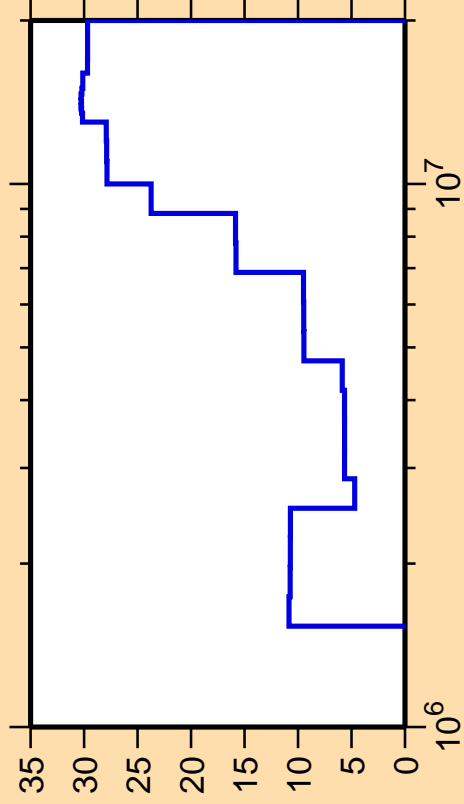

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

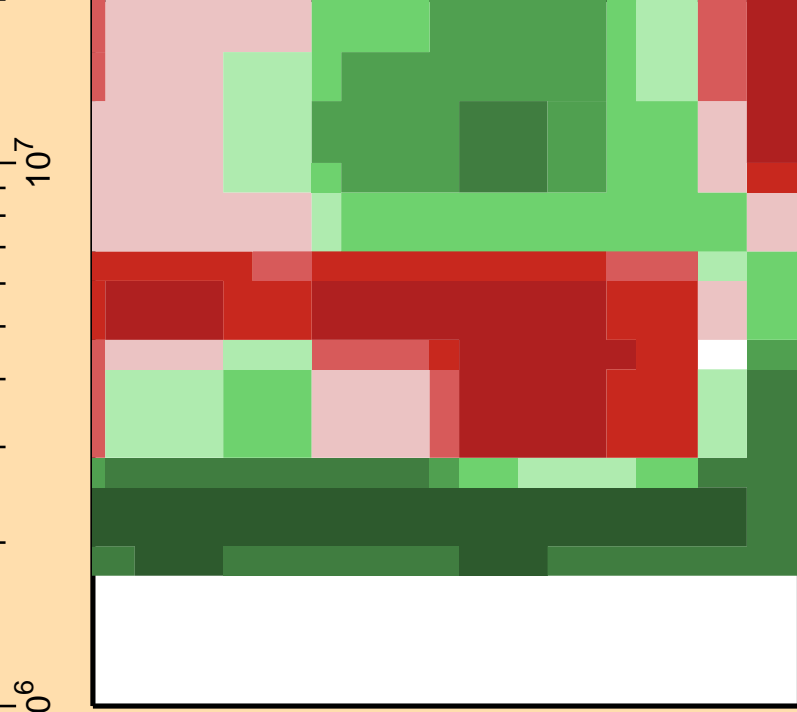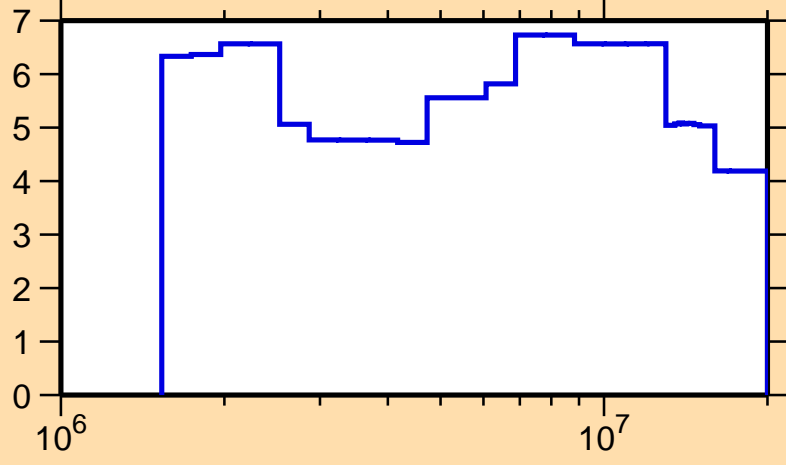

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

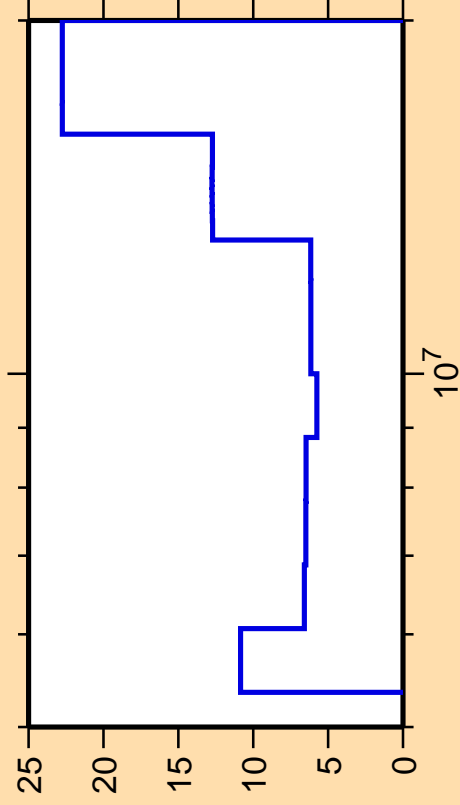

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

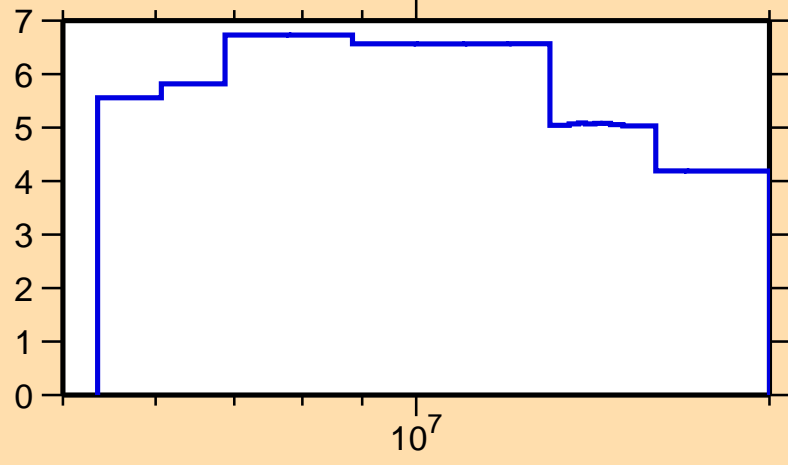


$10^7$



Correlation Matrix



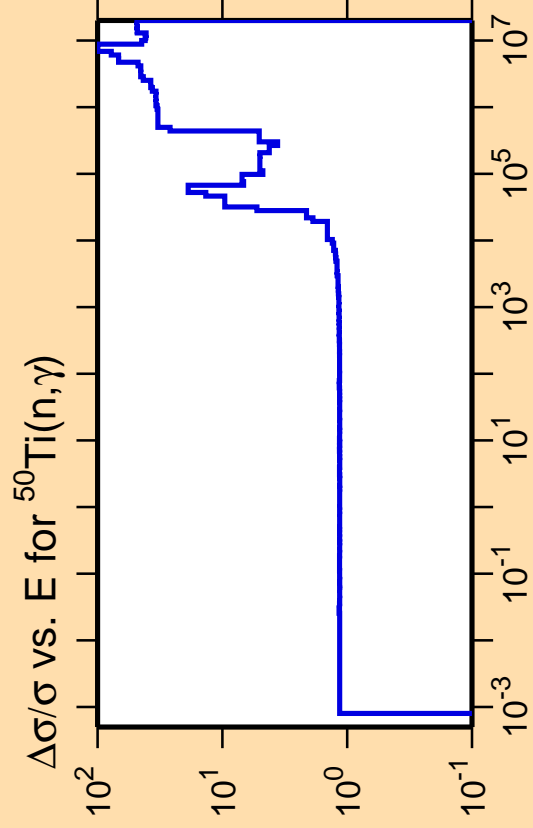


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

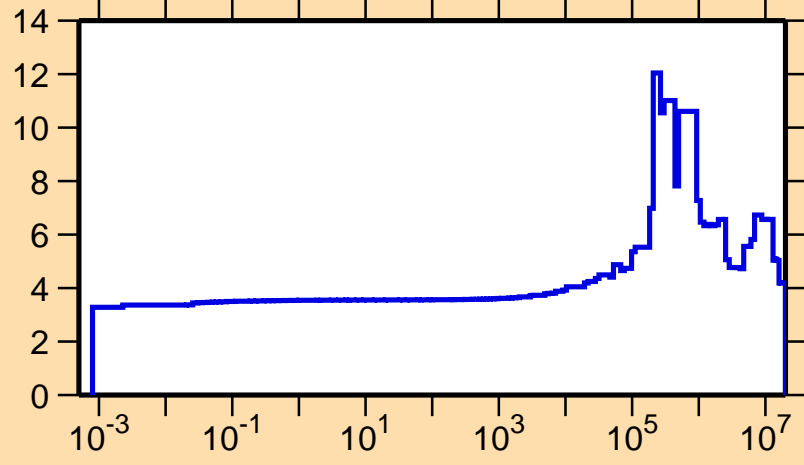


Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$

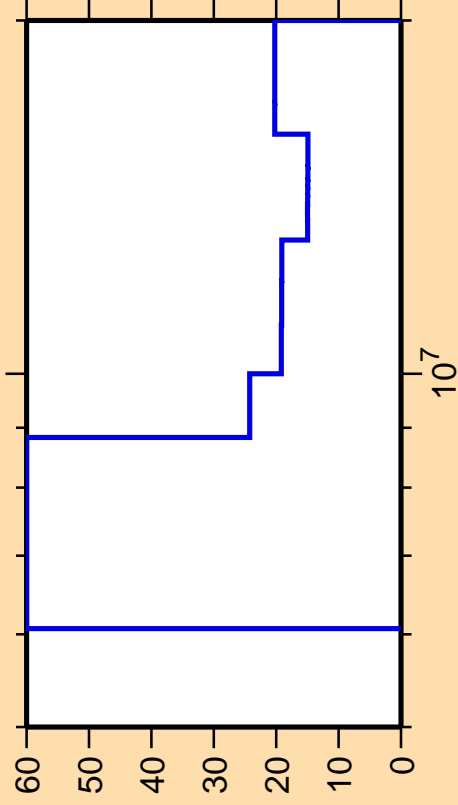


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$10^7$

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{tot.})$

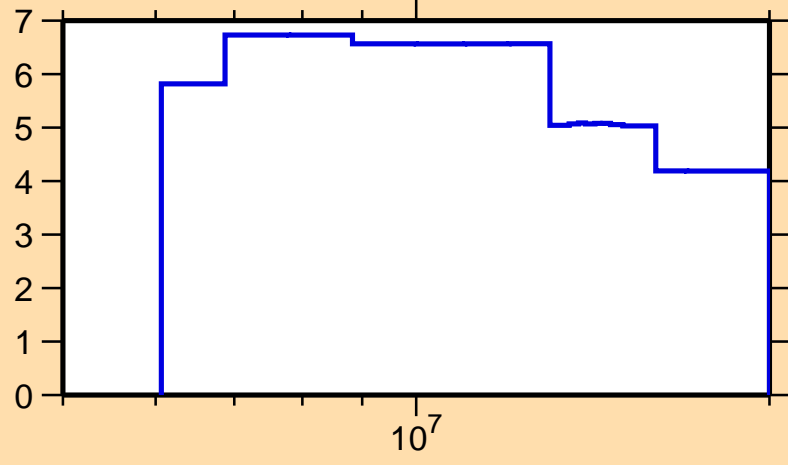


$10^7$

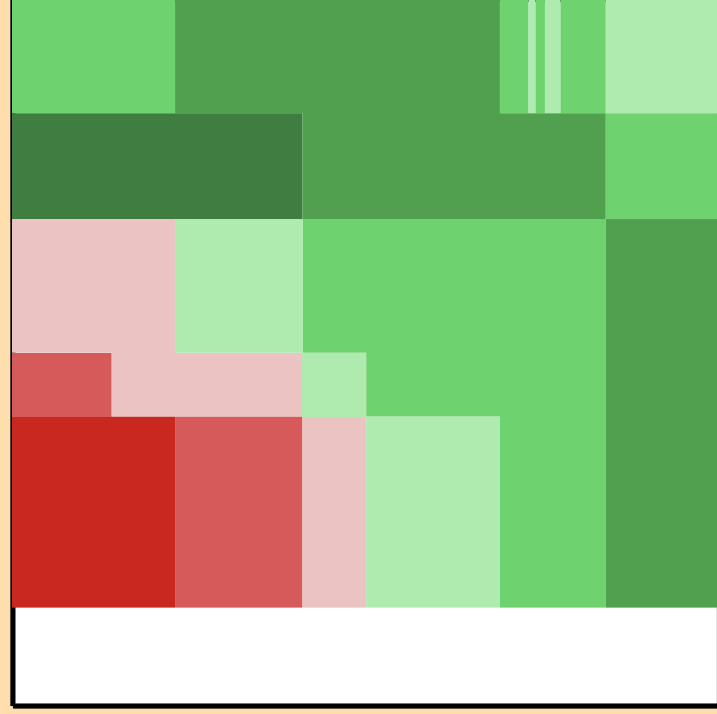

Correlation Matrix




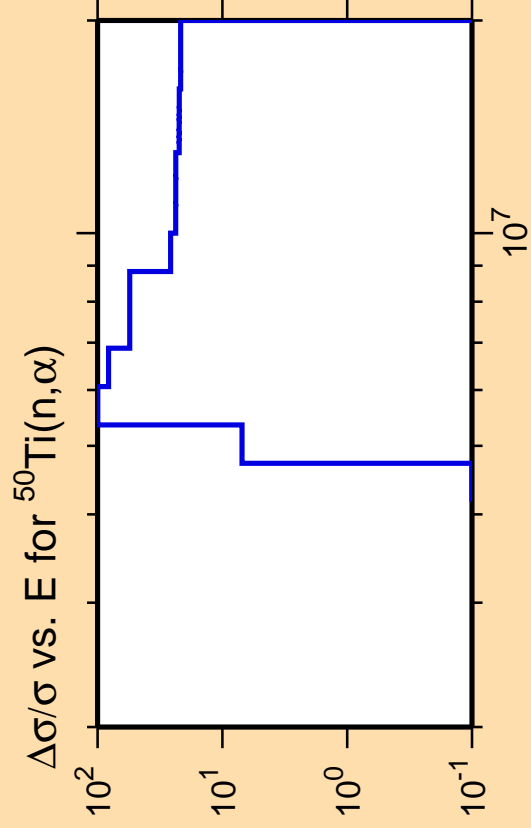

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

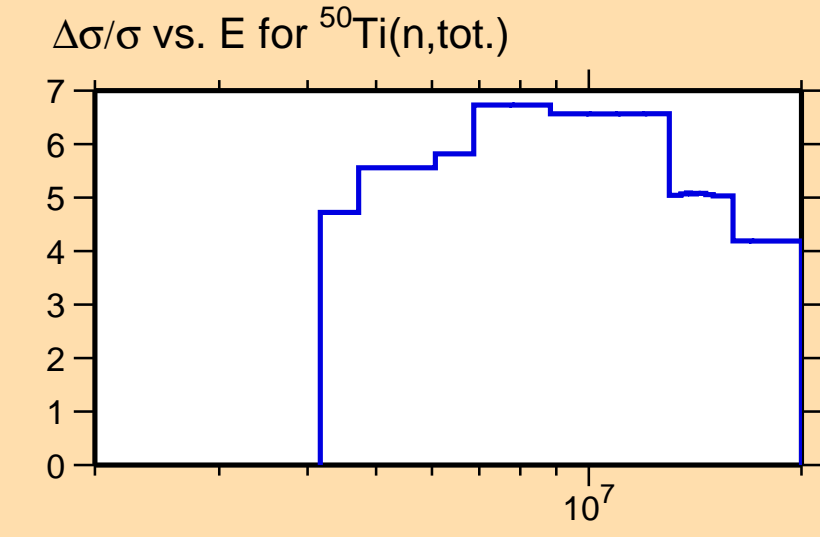



Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

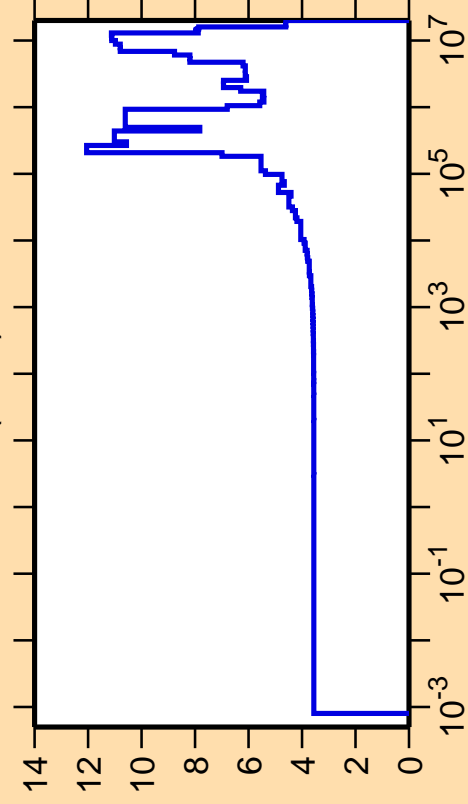


$\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

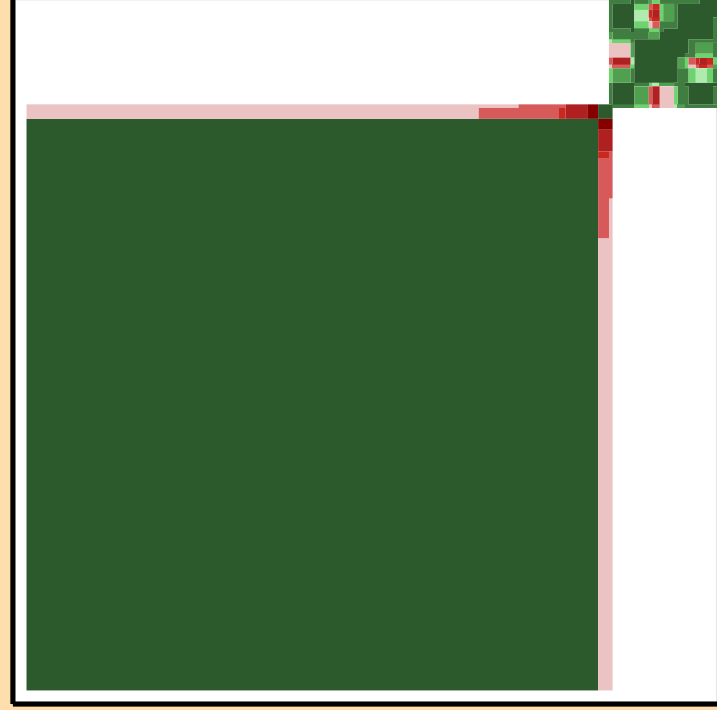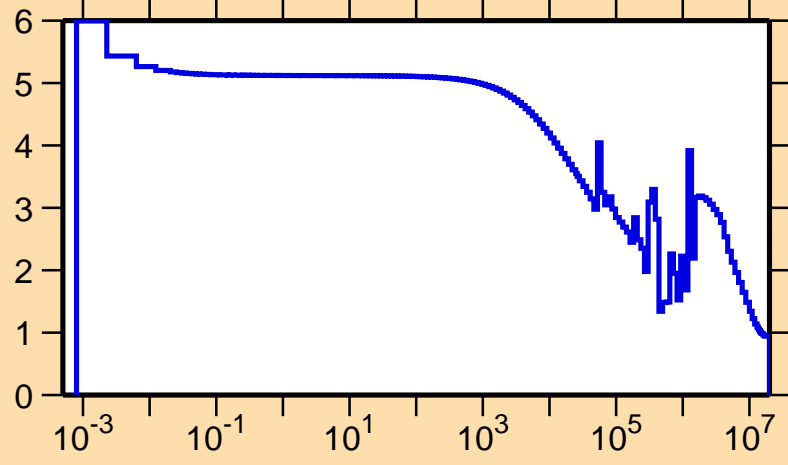

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

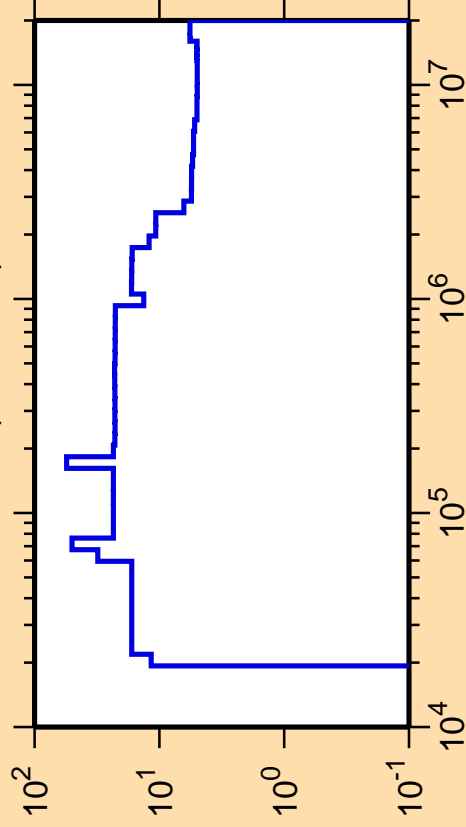

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

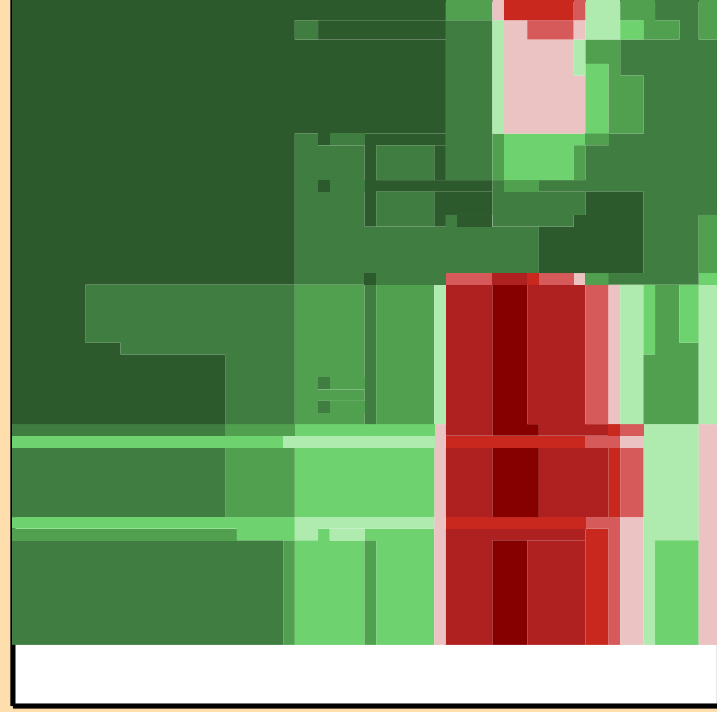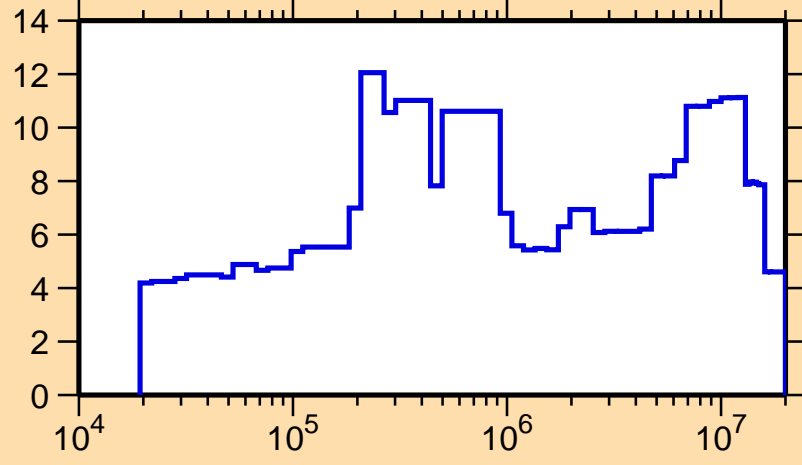


Correlation Matrix



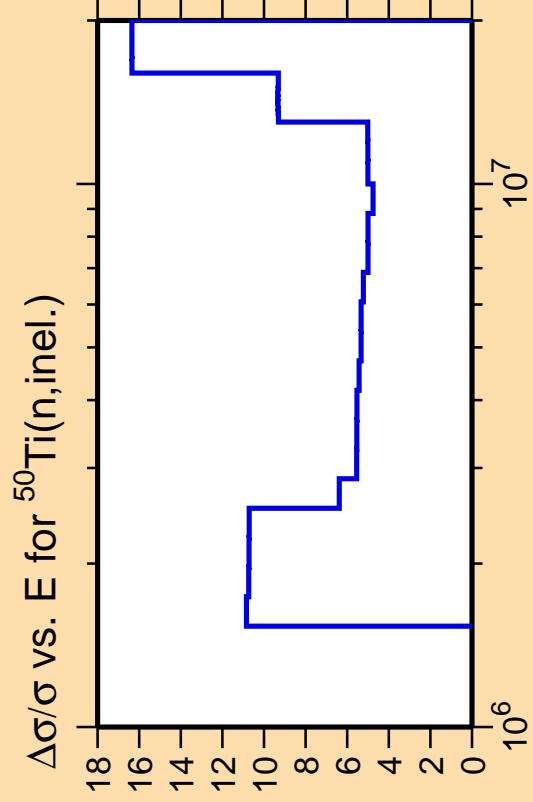

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

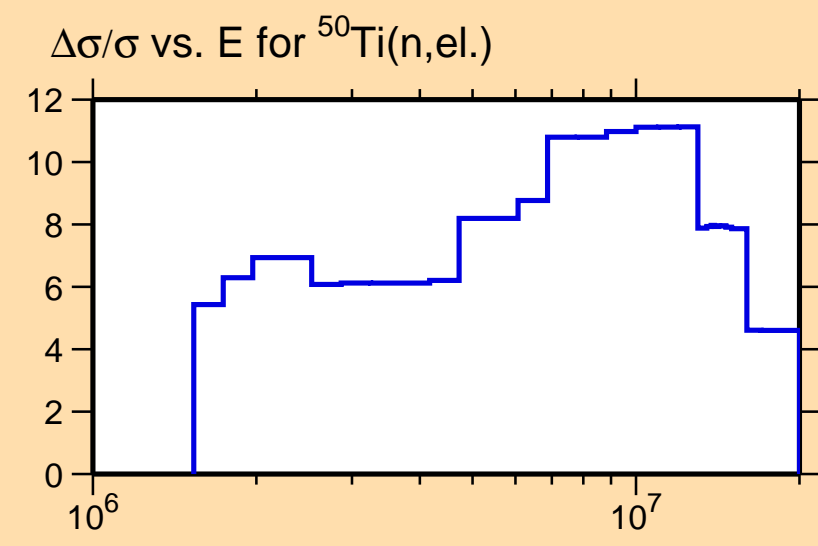

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

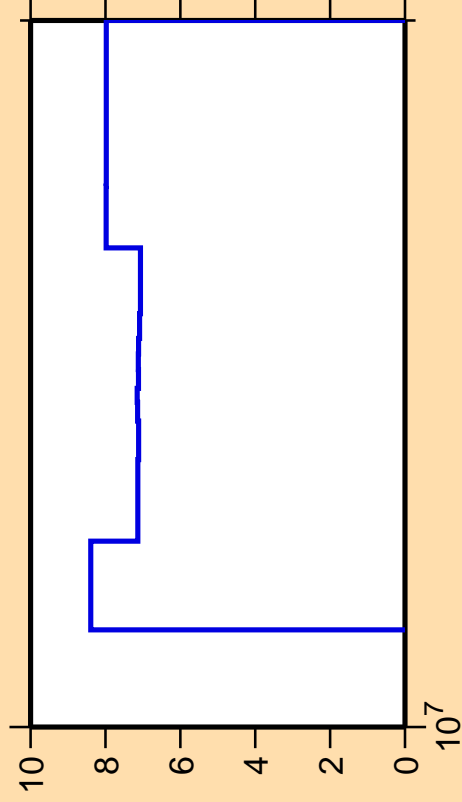

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

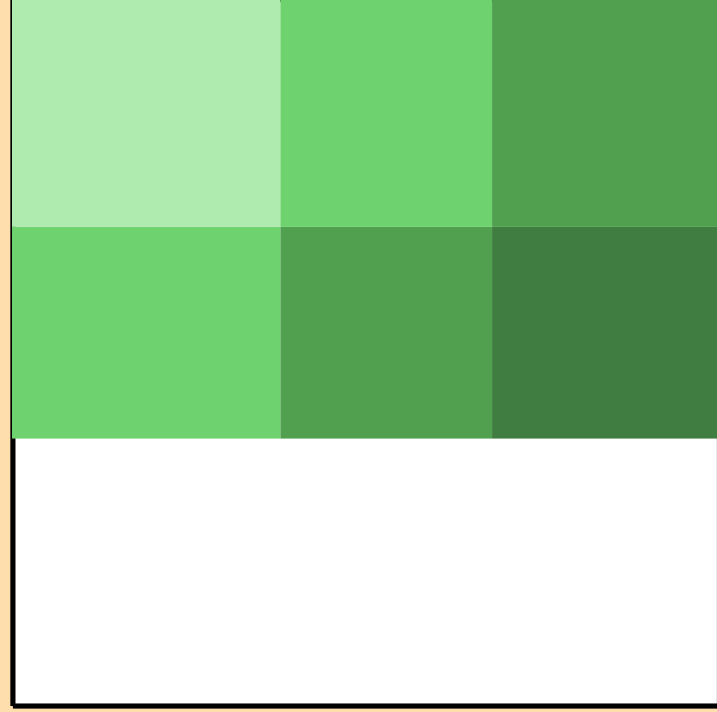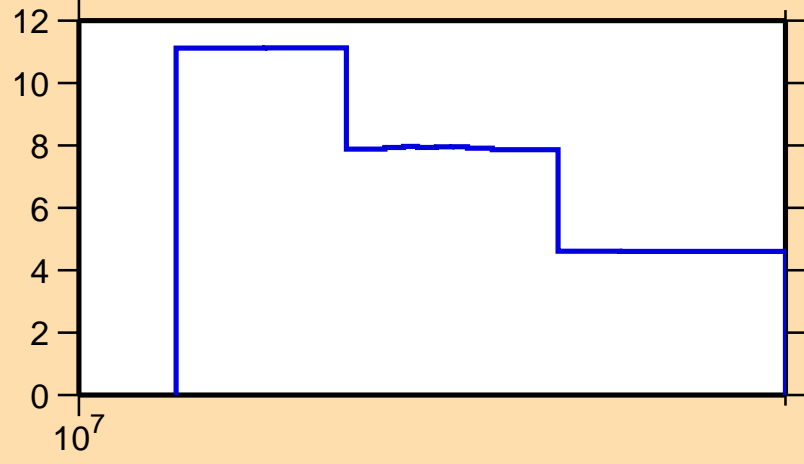

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

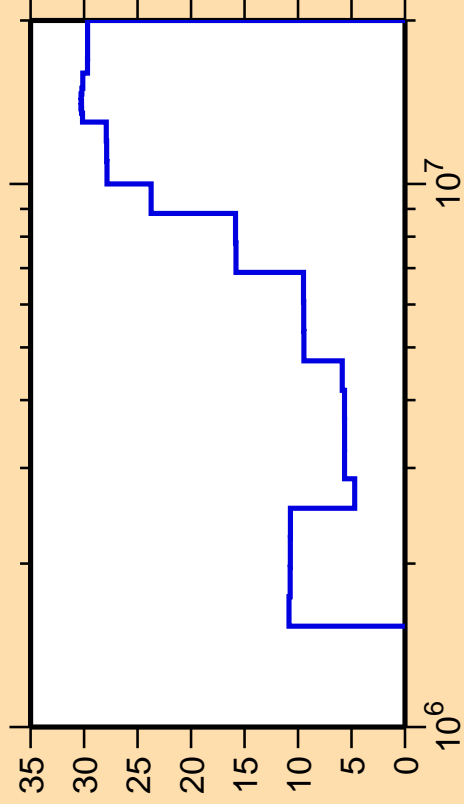

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

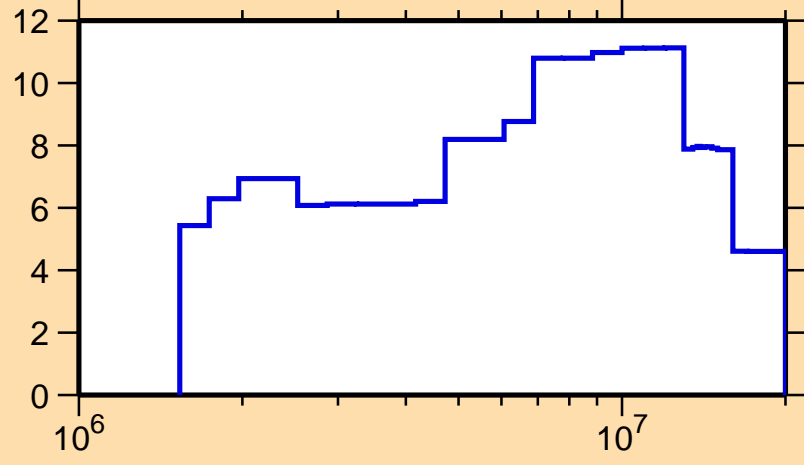

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

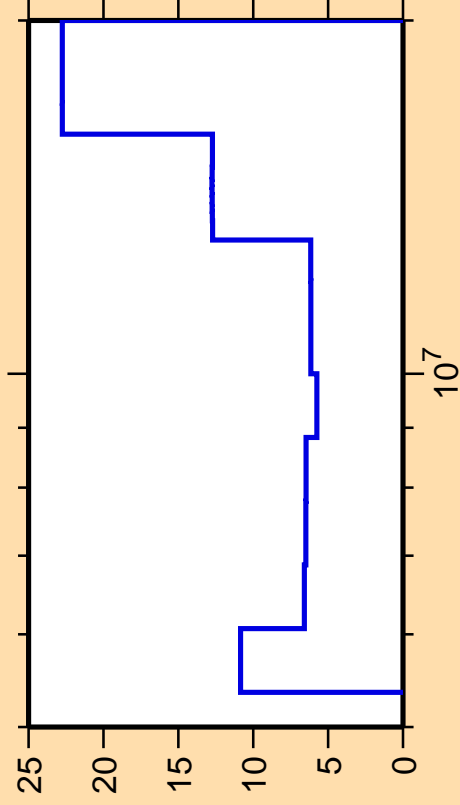


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

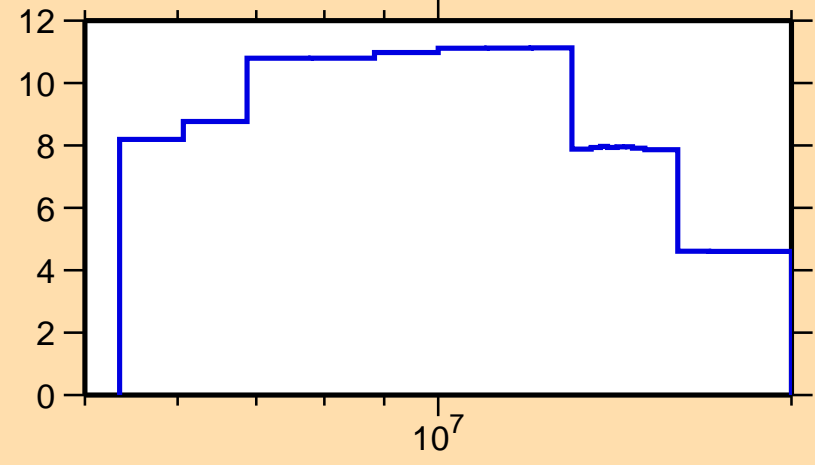


$10^7$

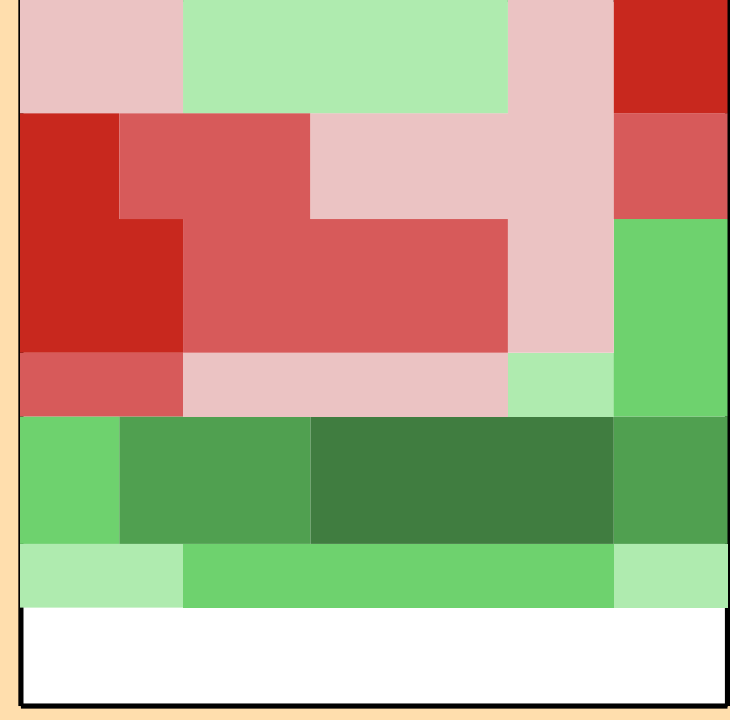

Correlation Matrix






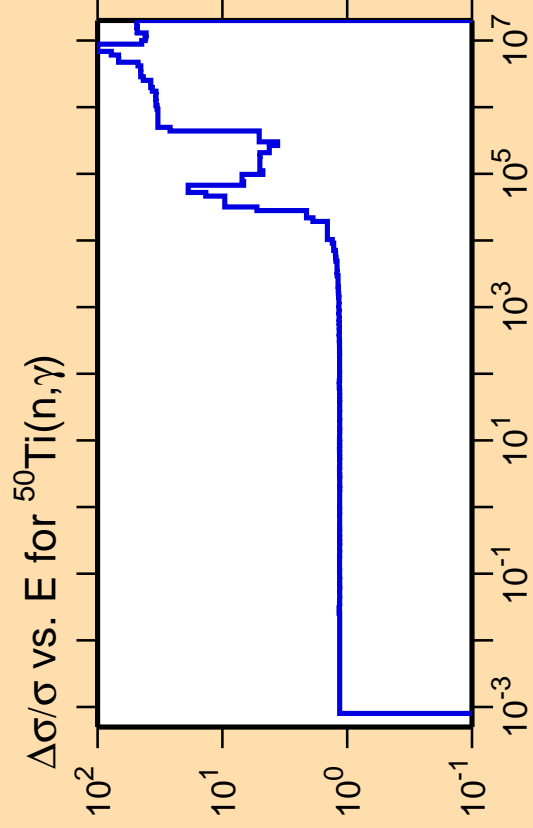


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{el.})$

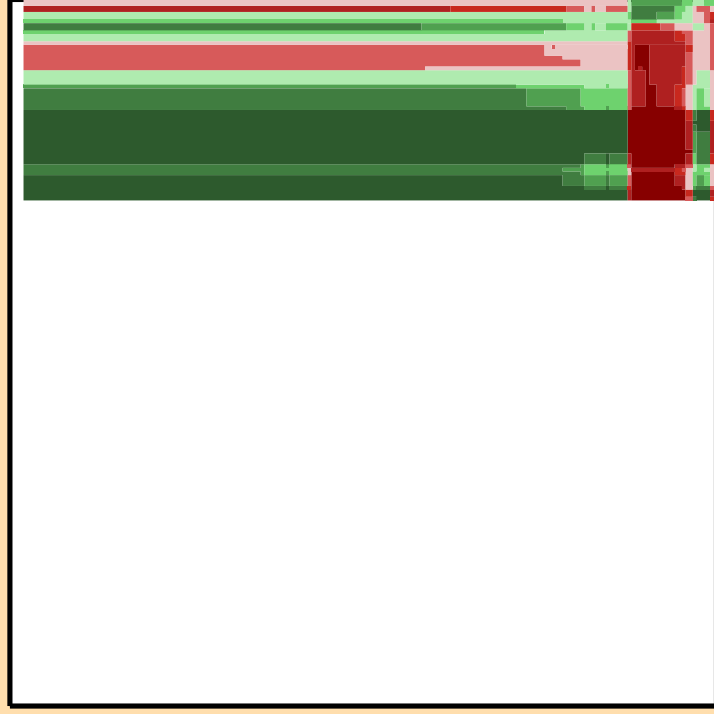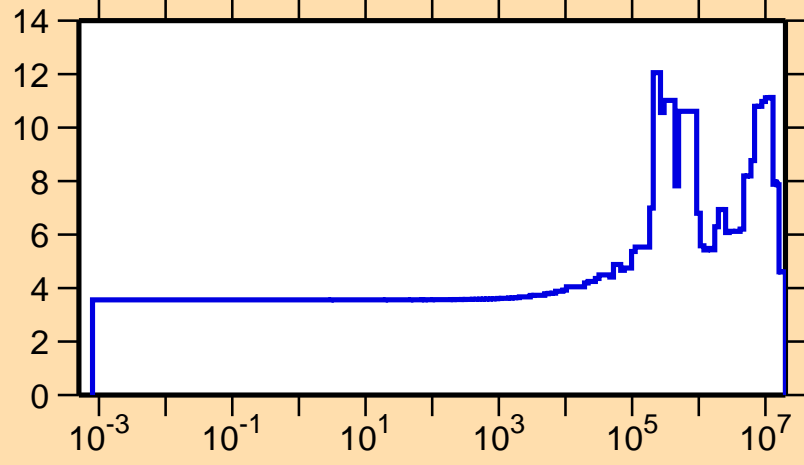

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$


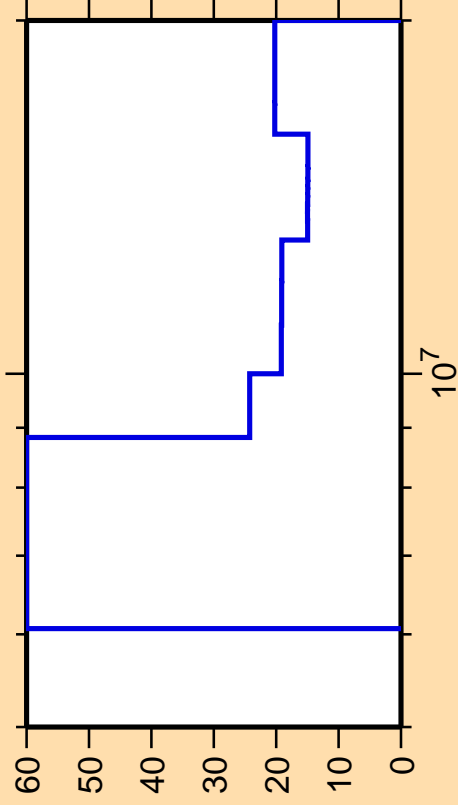


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,el.)$

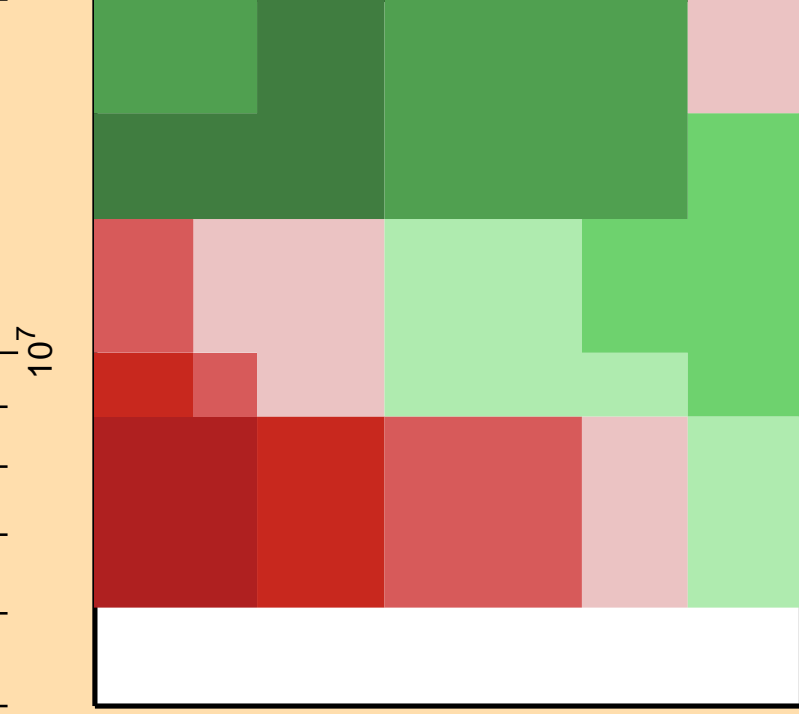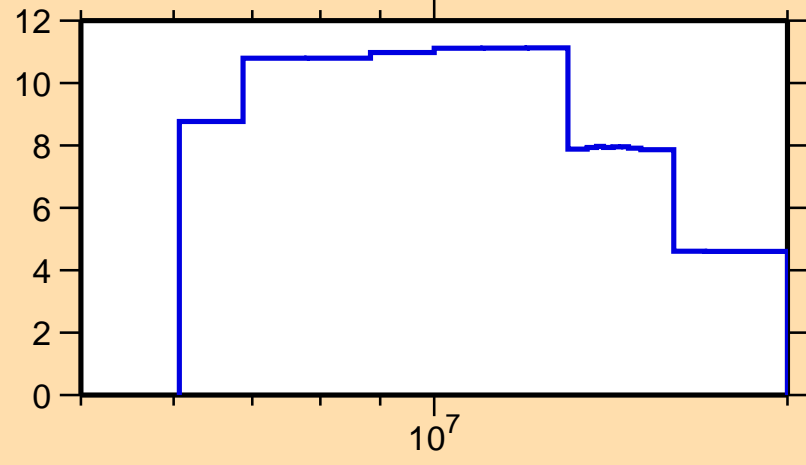

Correlation Matrix




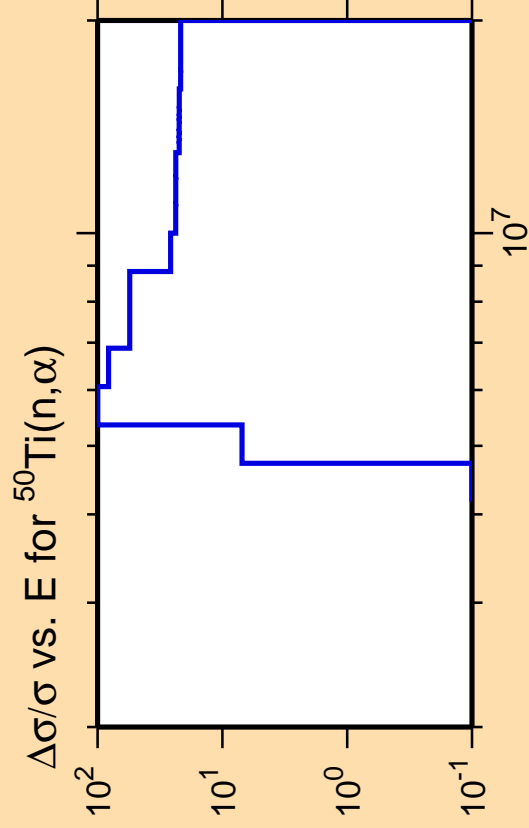

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

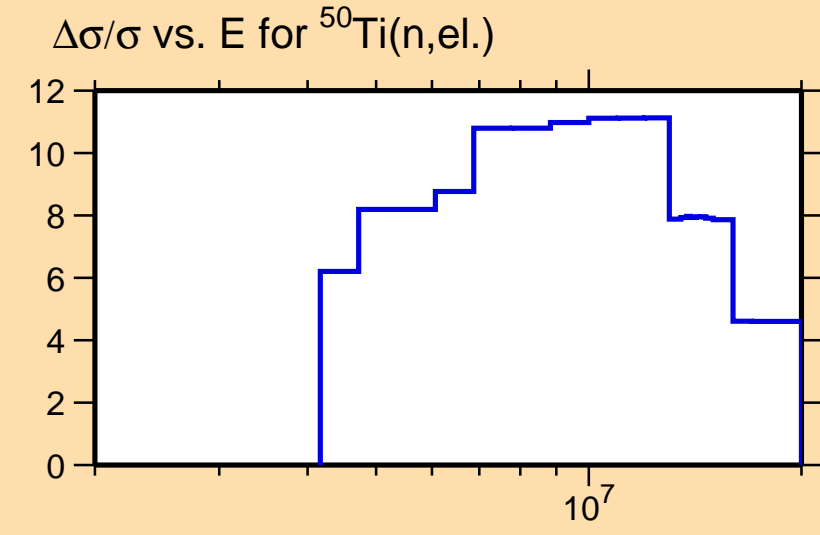



Correlation Matrix



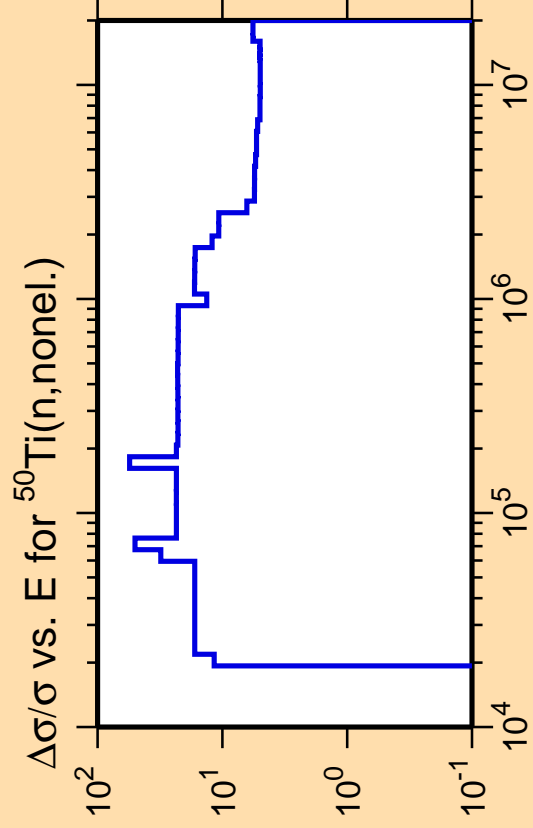

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

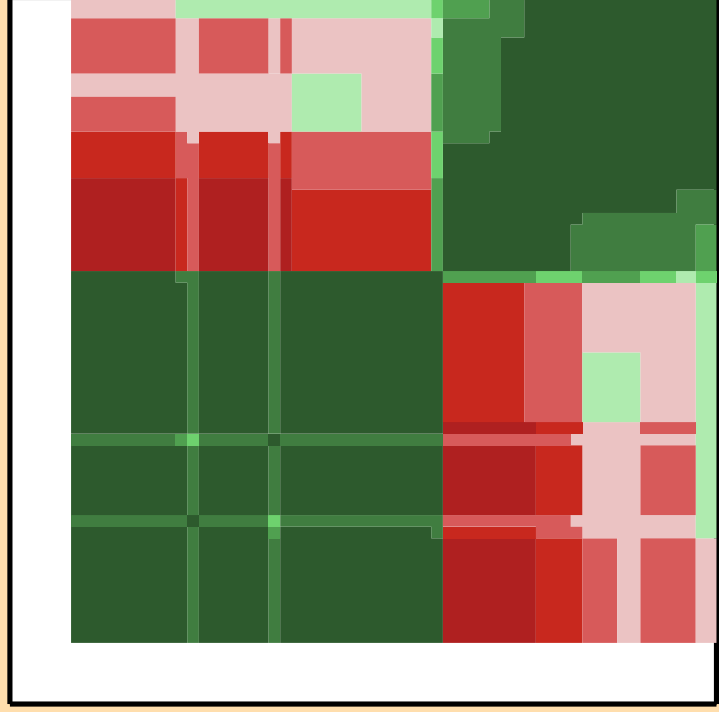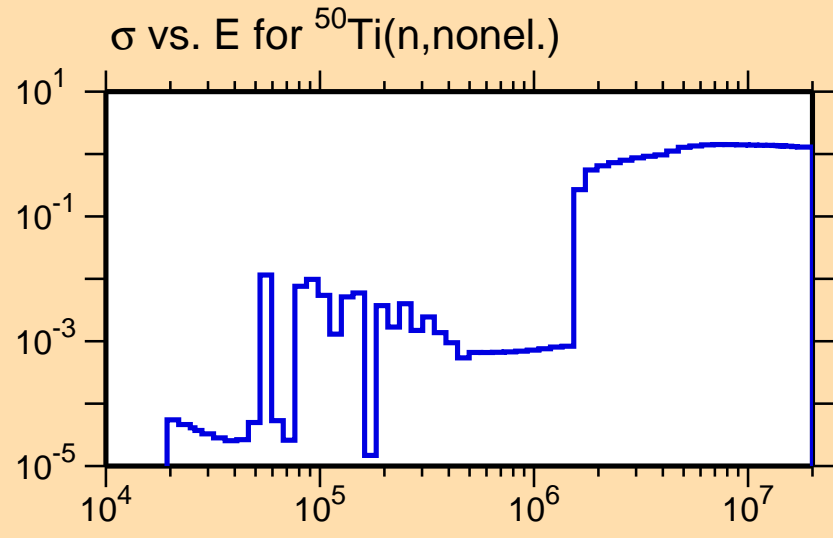

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

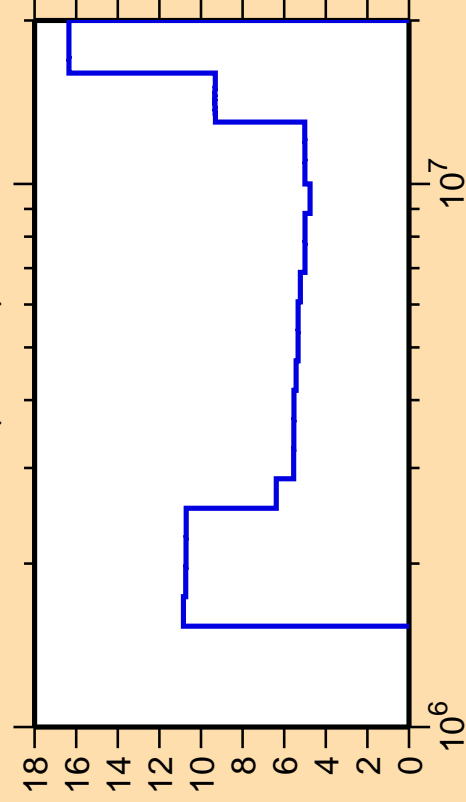

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

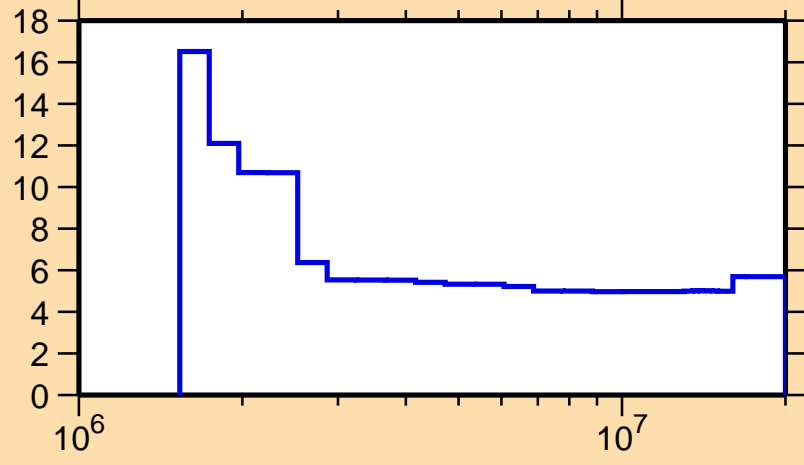

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

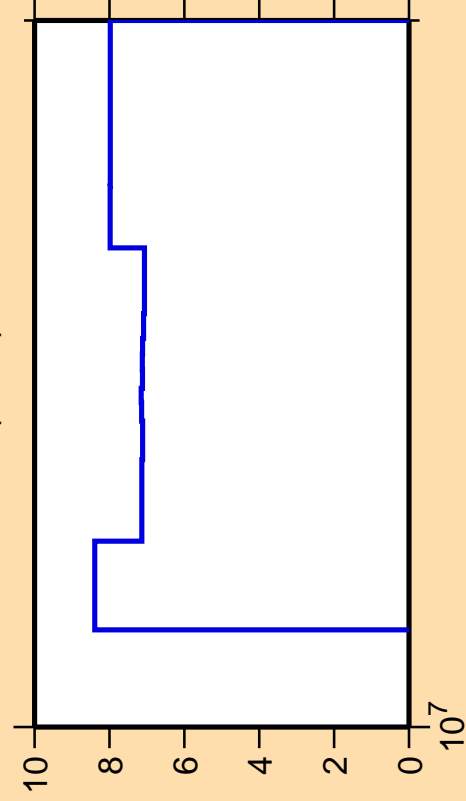

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

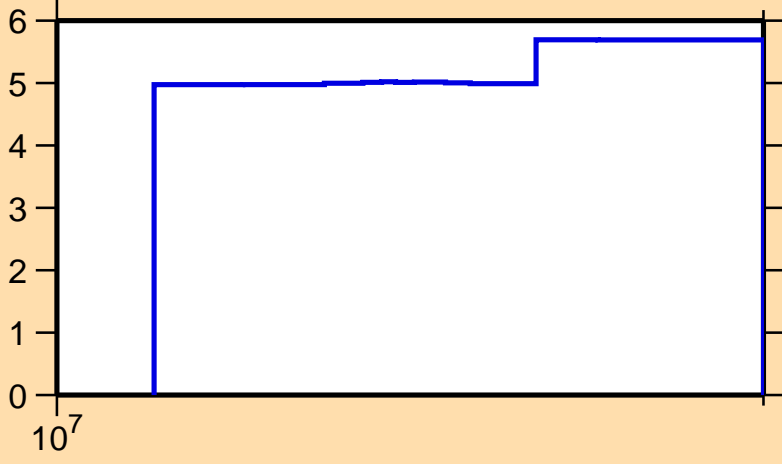

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

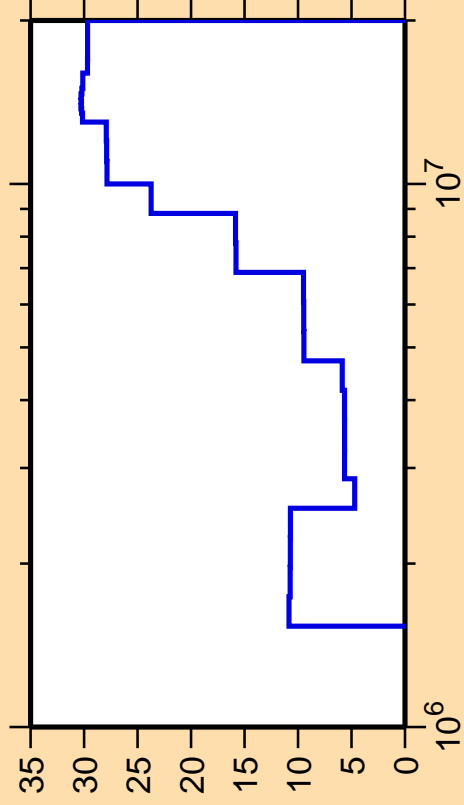

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{nonel.})$

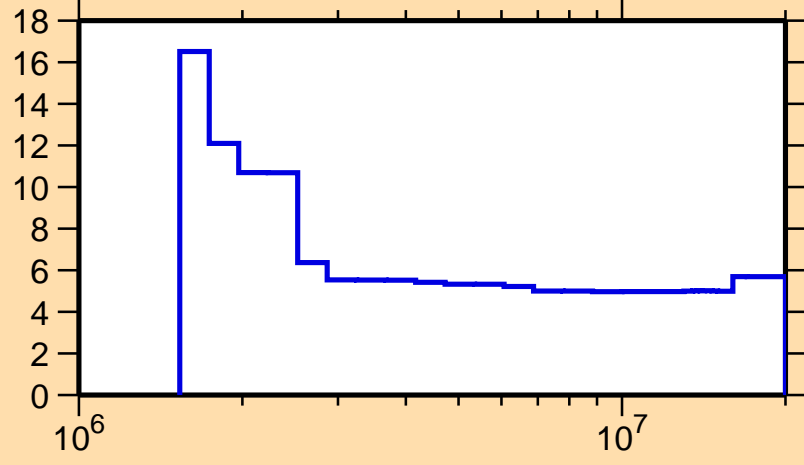

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

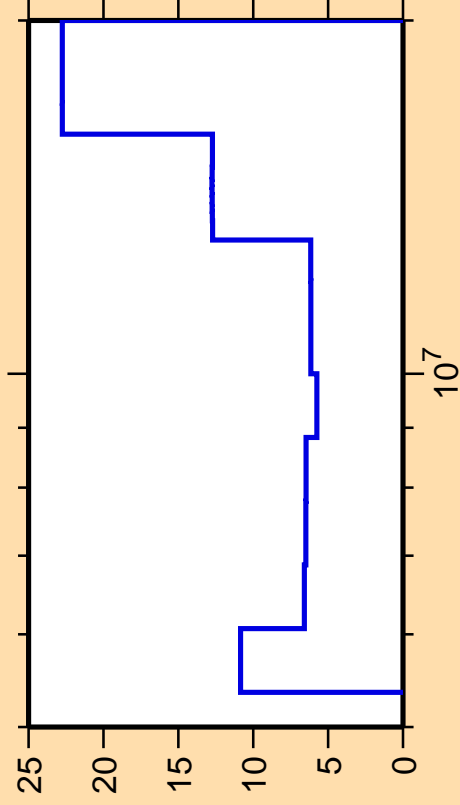

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{nonel.})$

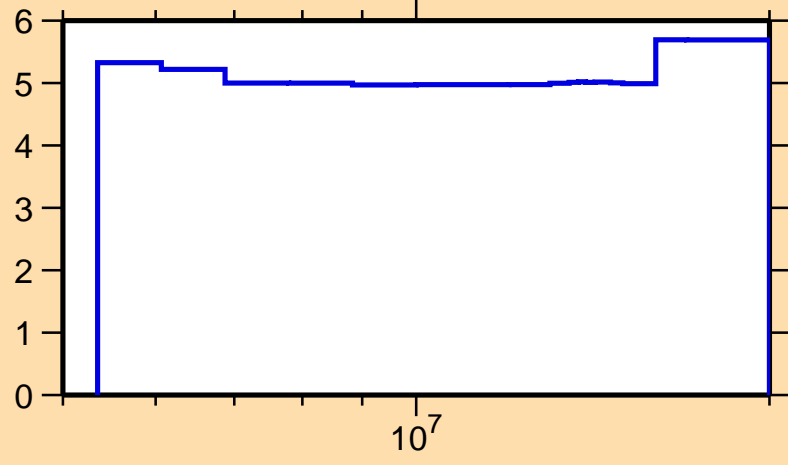

Correlation Matrix







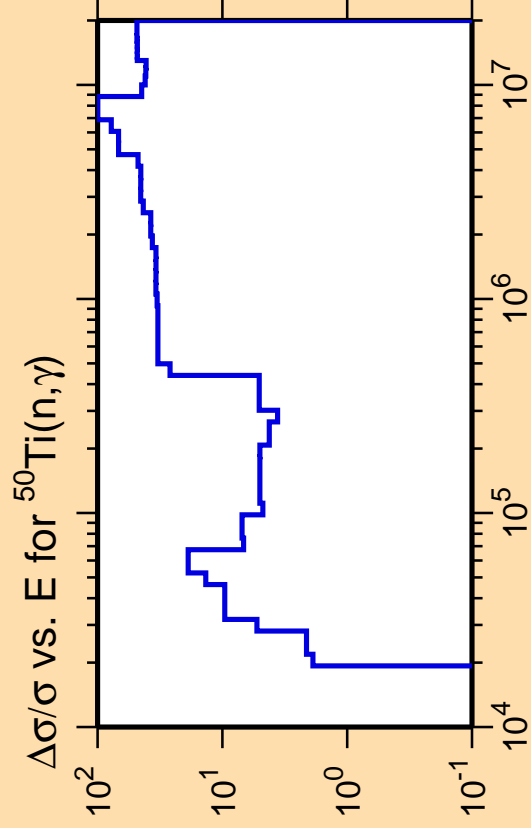

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

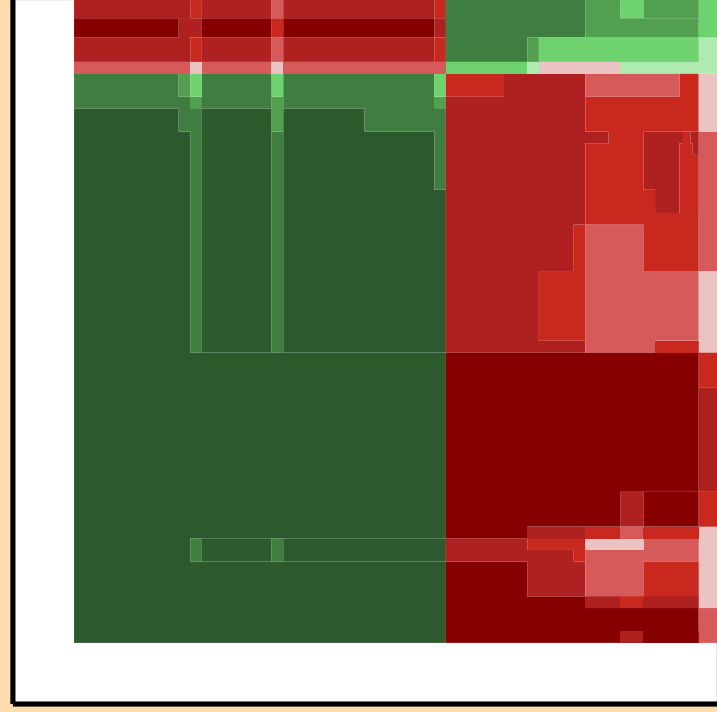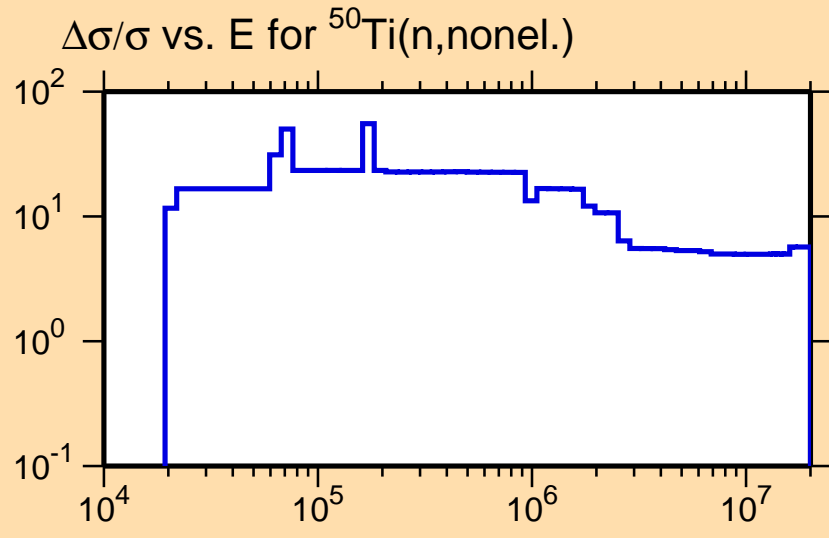

Correlation Matrix






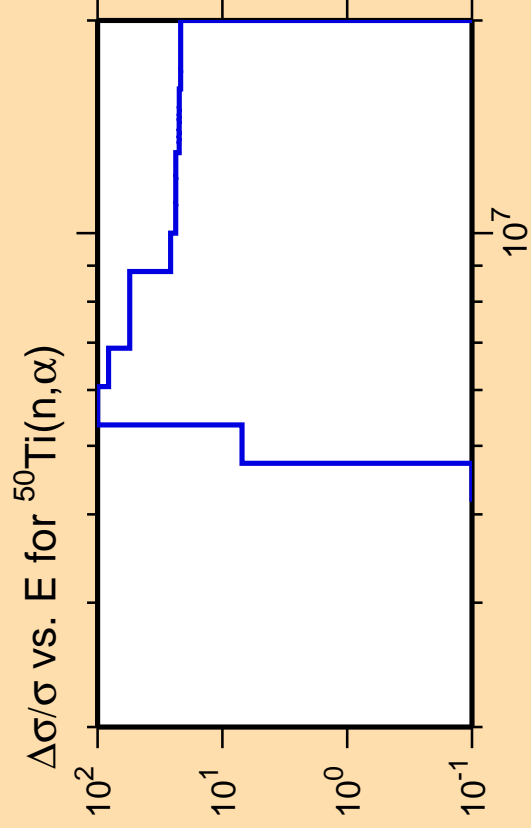

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

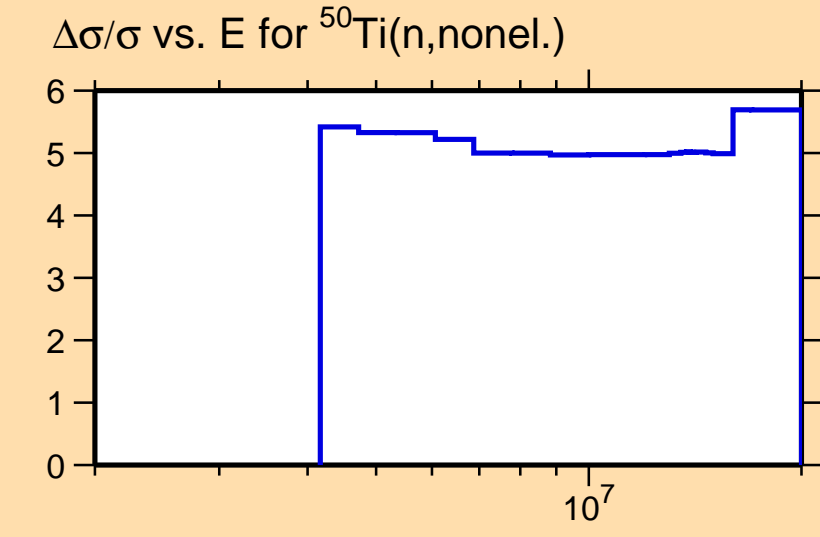



Correlation Matrix



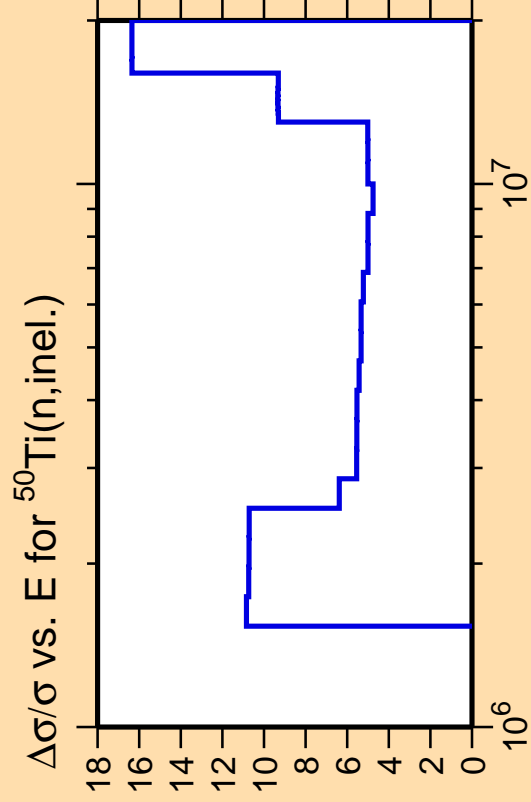

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

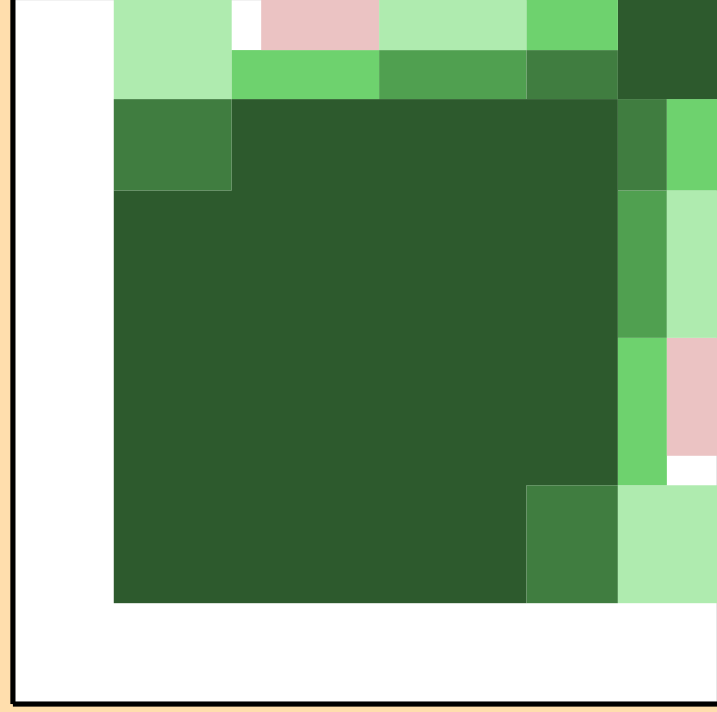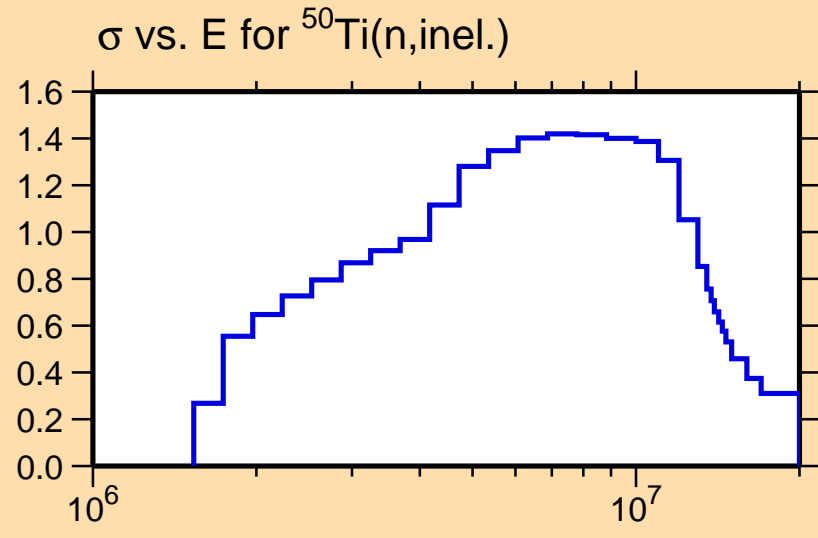

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

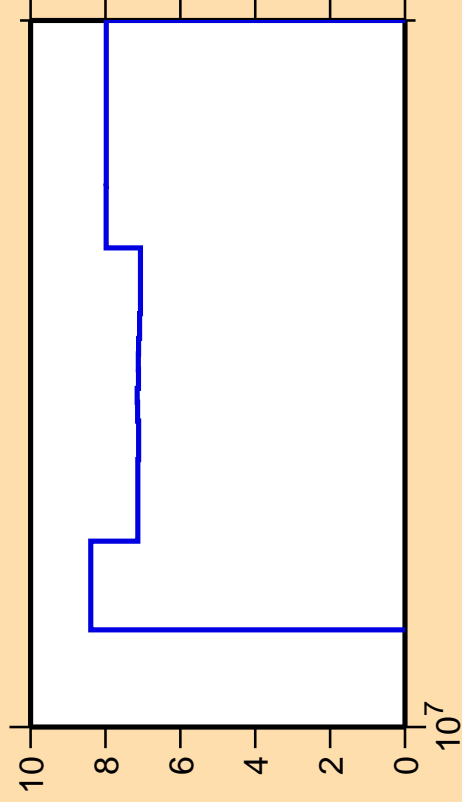

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

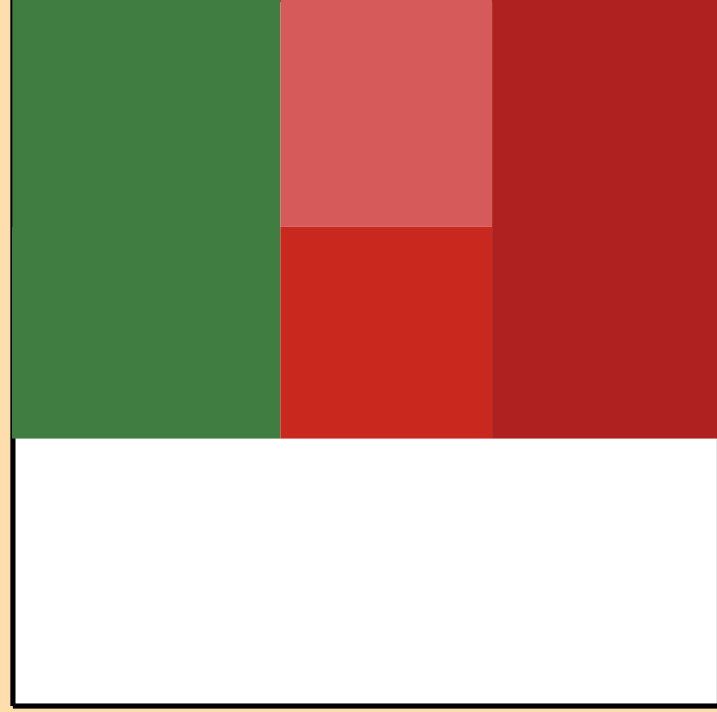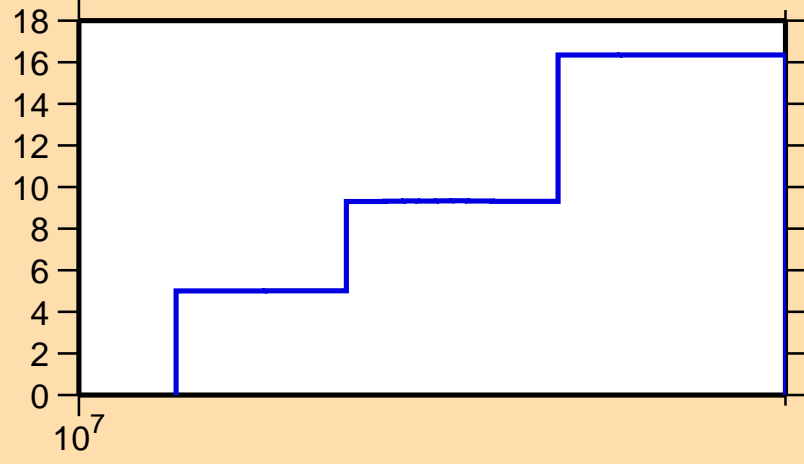

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

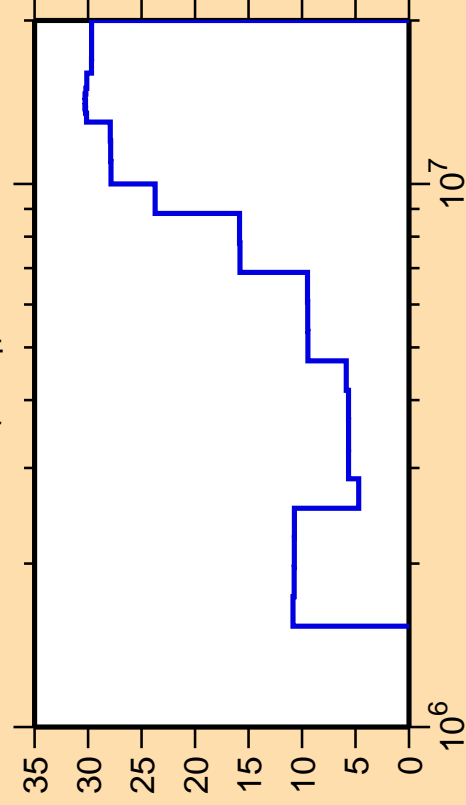


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

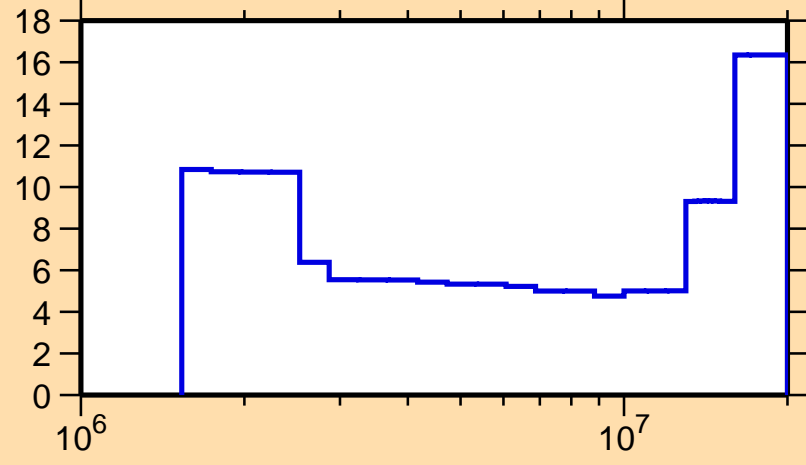

Correlation Matrix

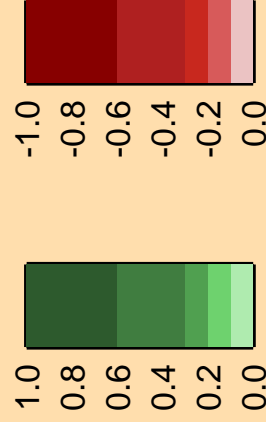



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

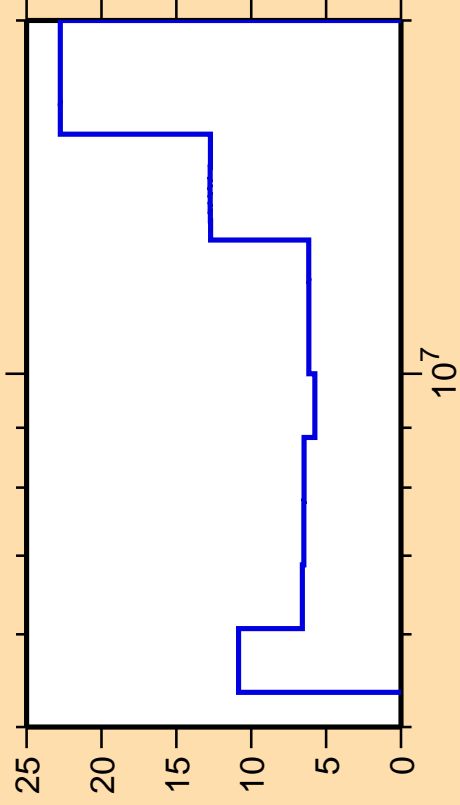

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

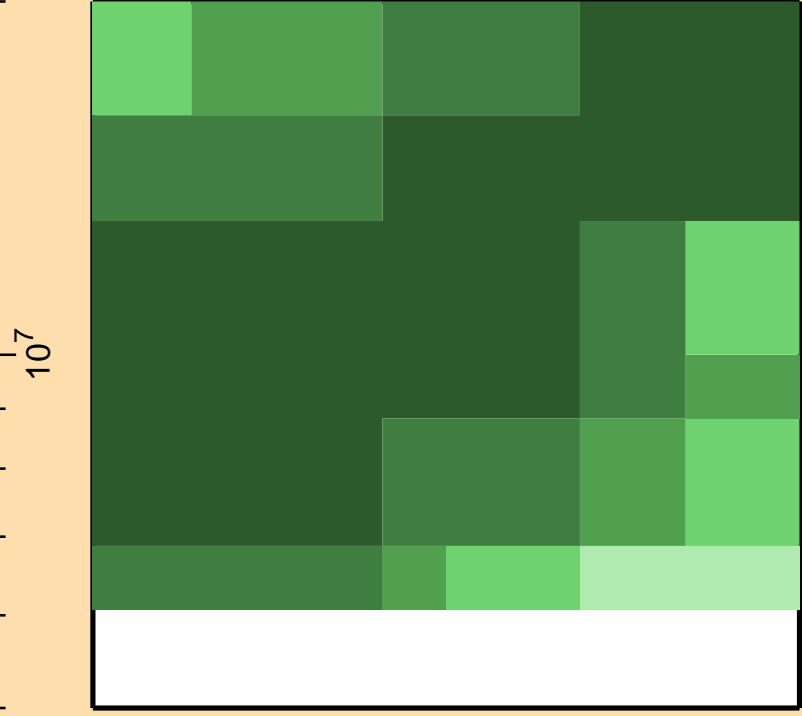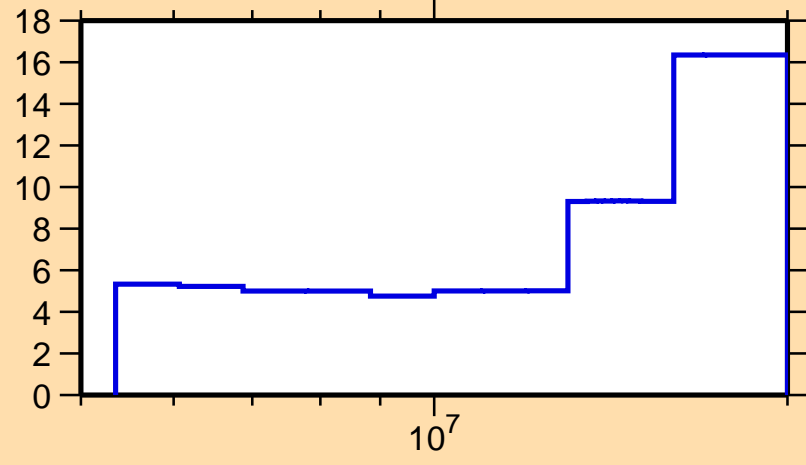

Correlation Matrix





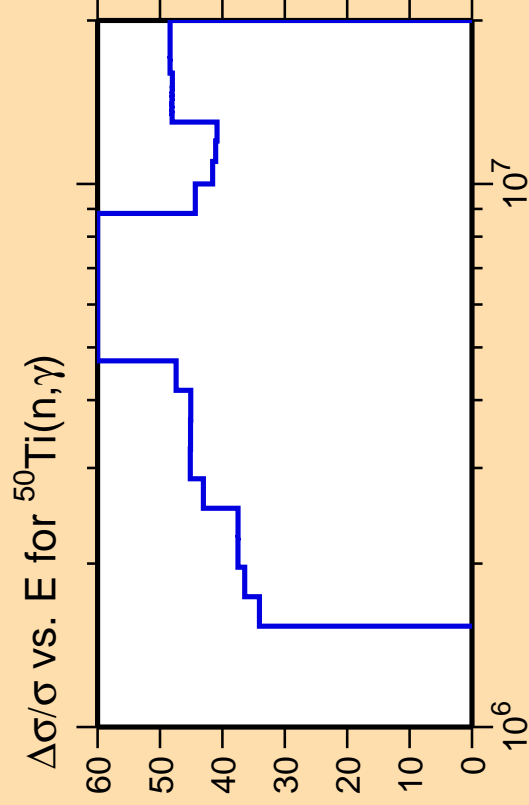

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

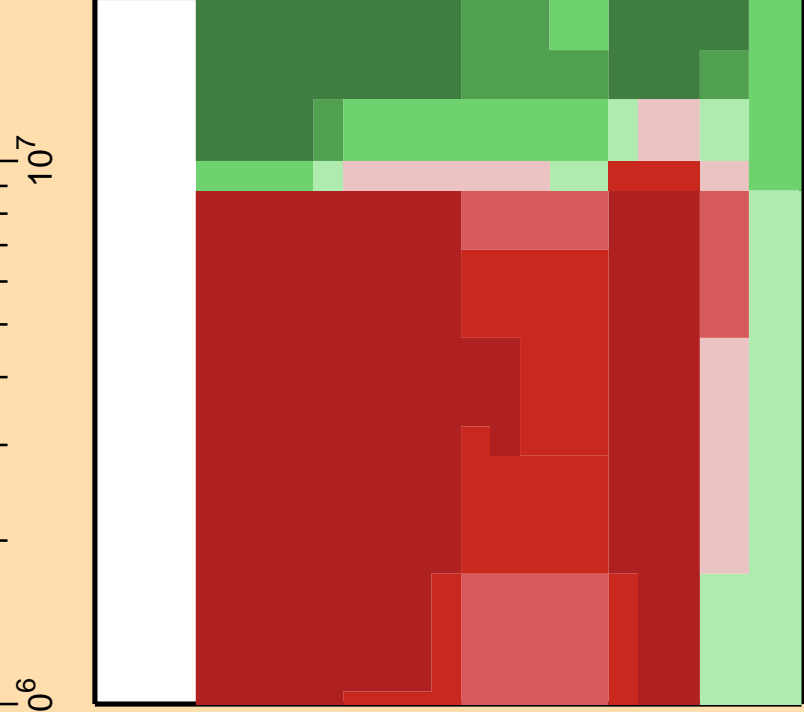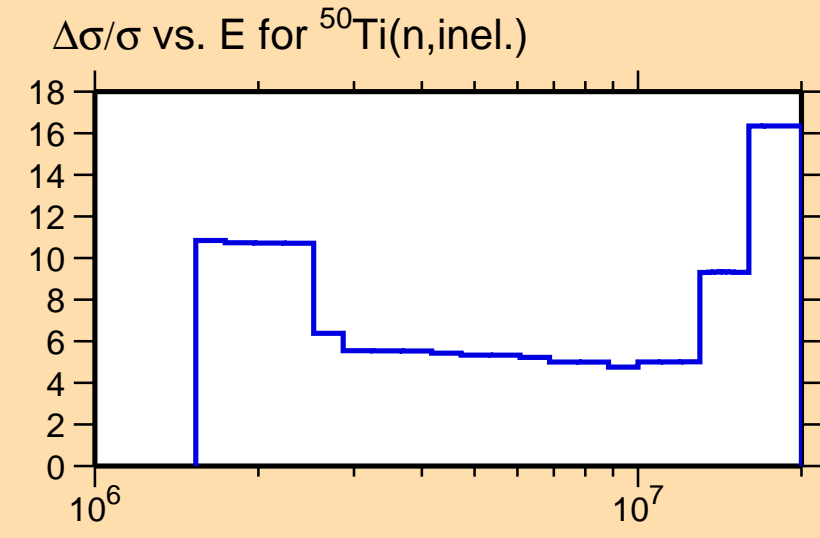


Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$

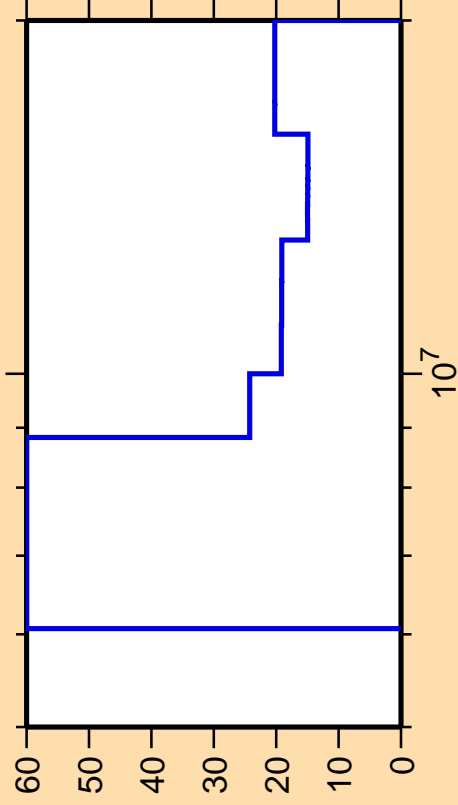


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).



Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{inel.})$

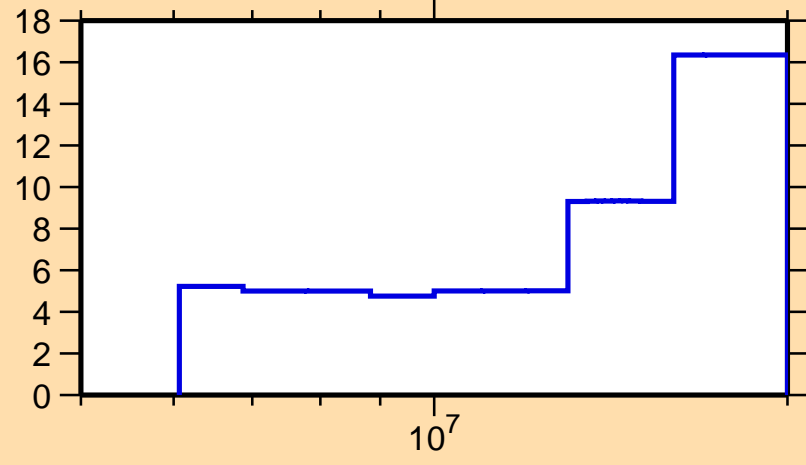

Correlation Matrix




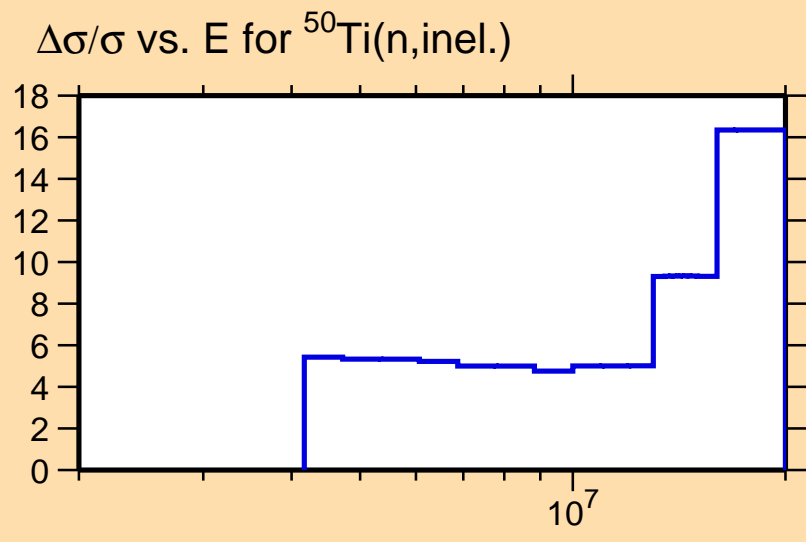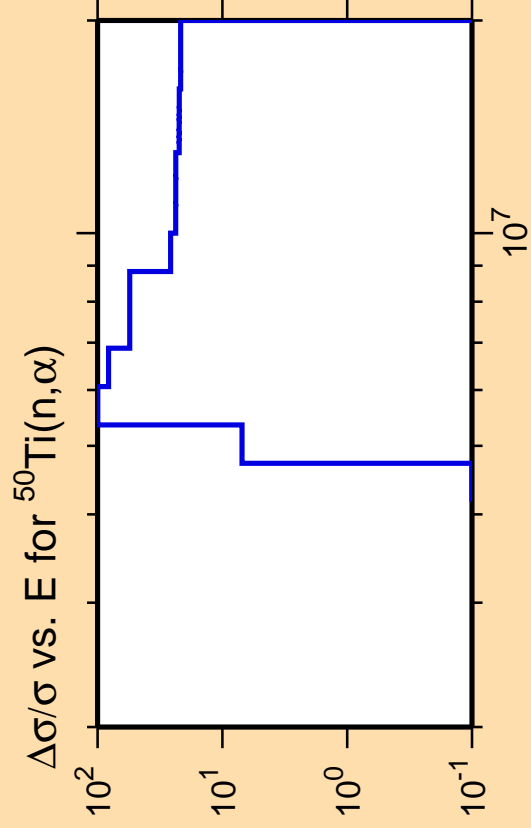

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

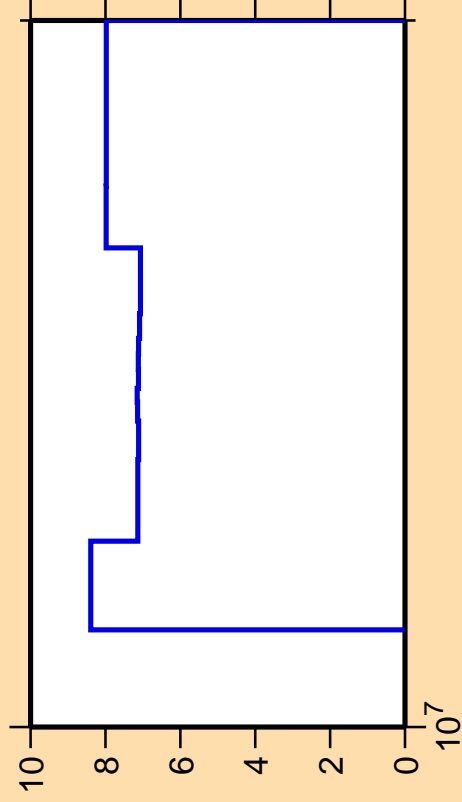


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

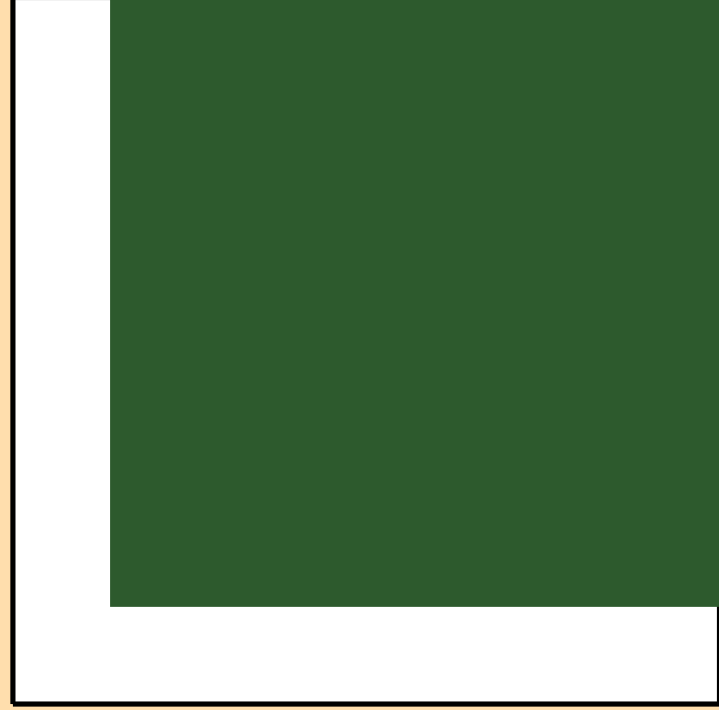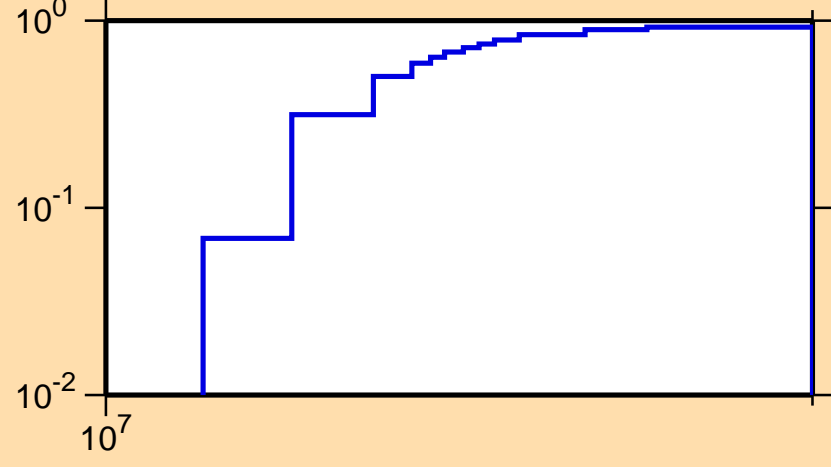

Correlation Matrix

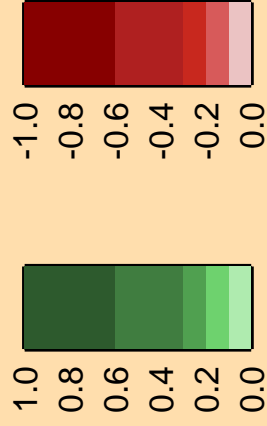



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

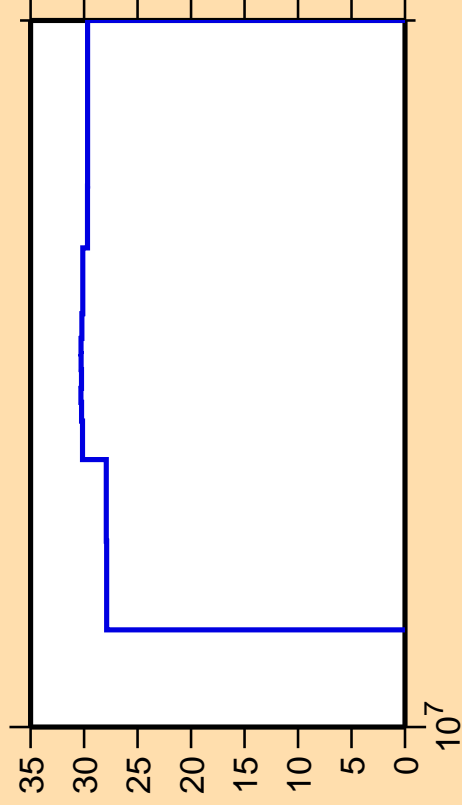

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

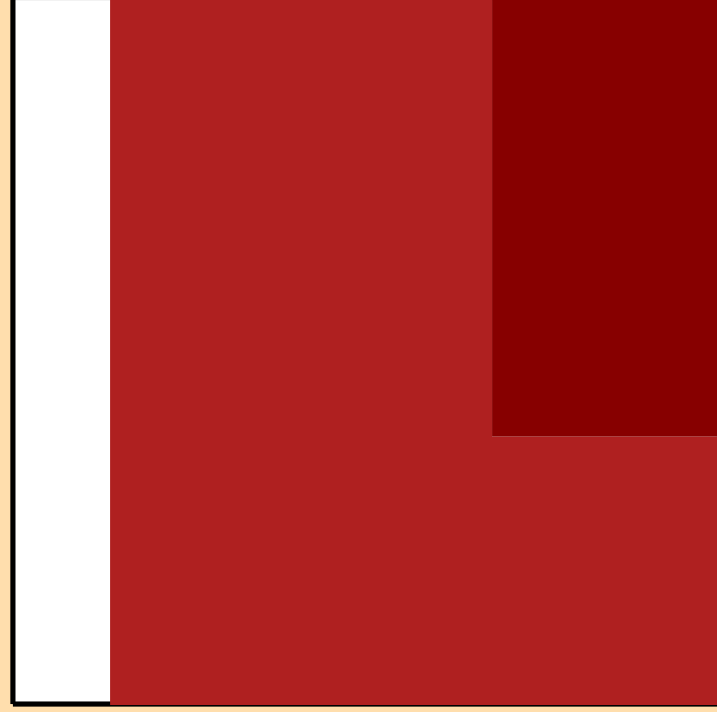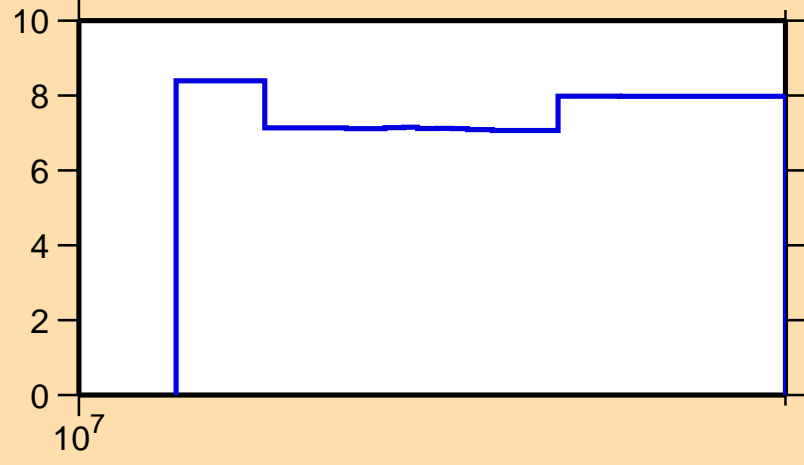

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

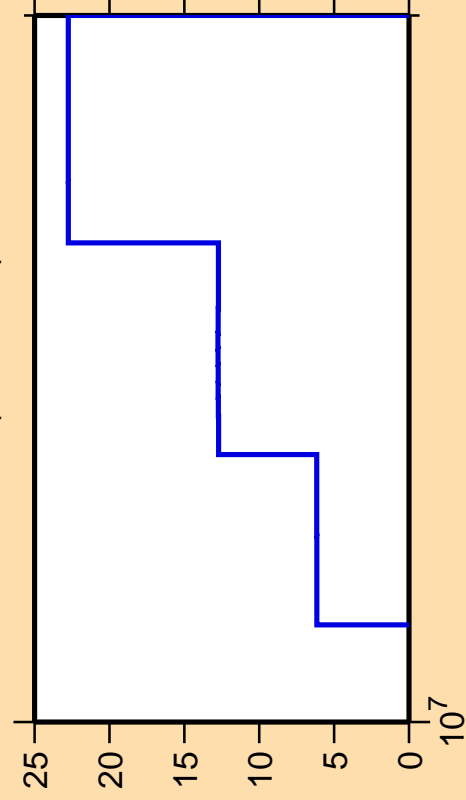

Ordinate scale is %  
relative standard deviation.

Abcissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

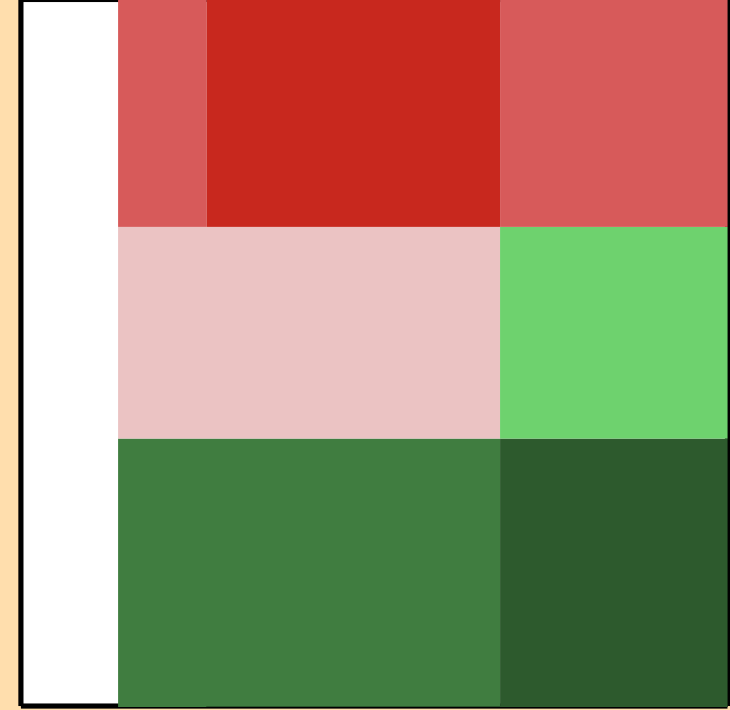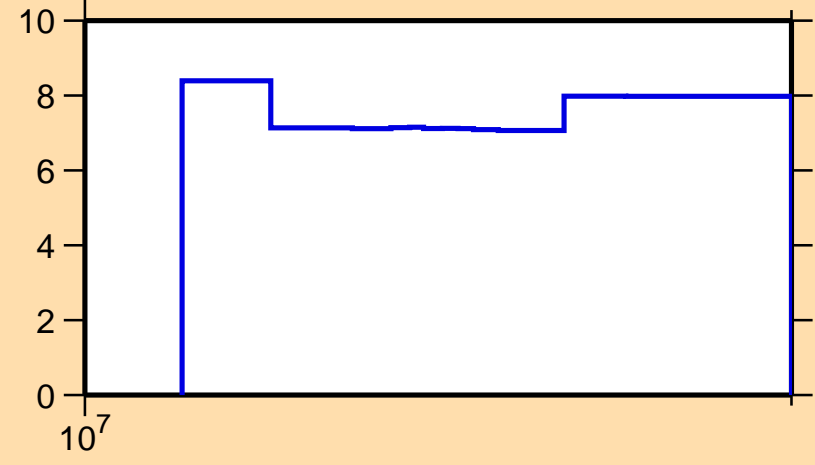

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\gamma)$

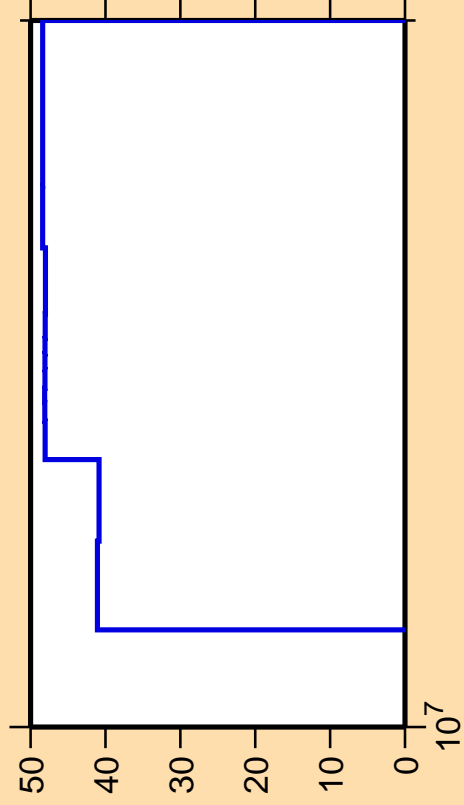

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

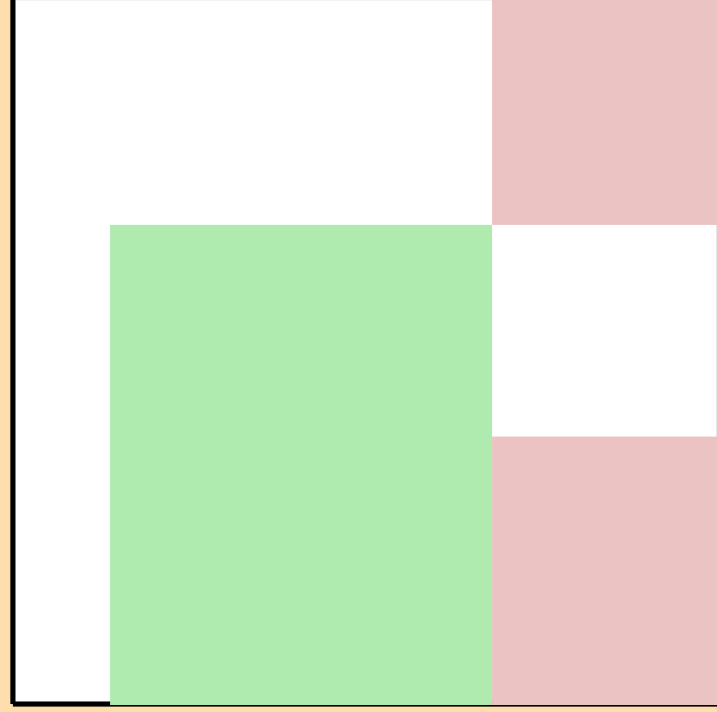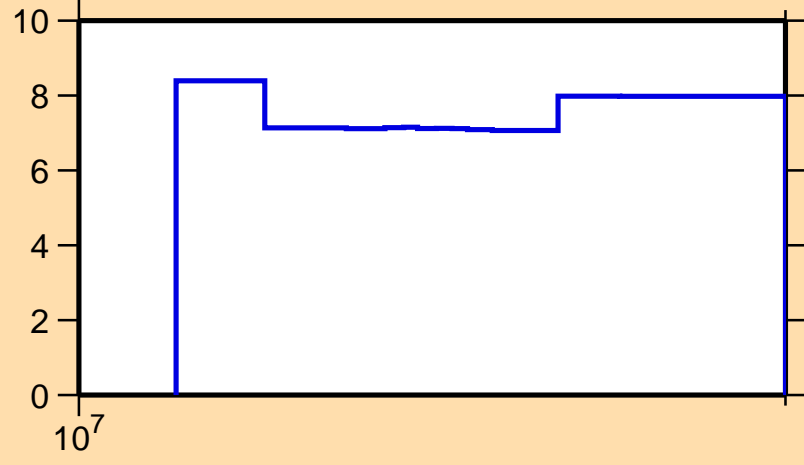

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$

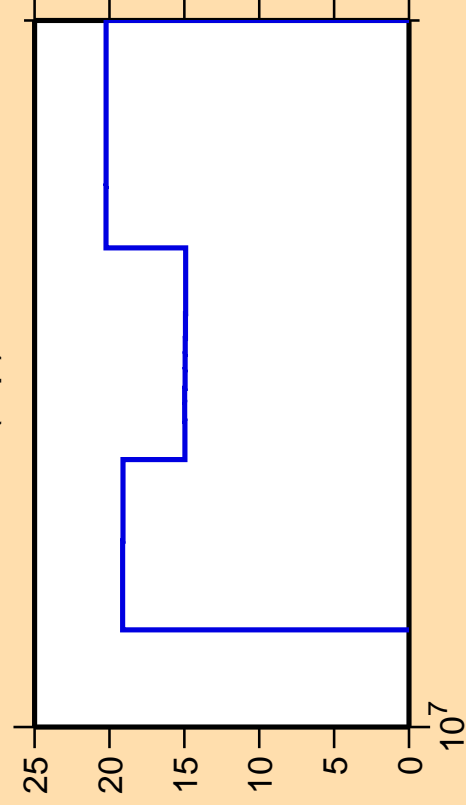

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

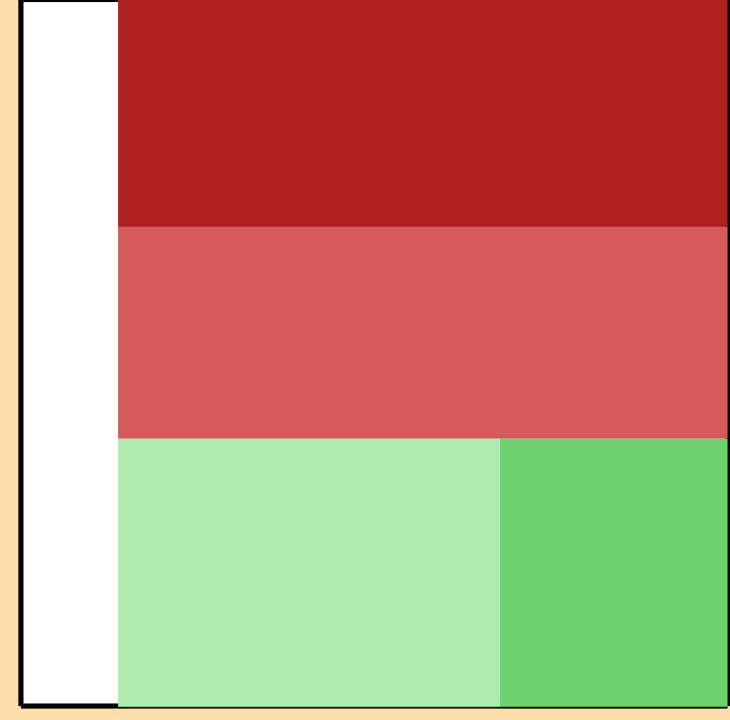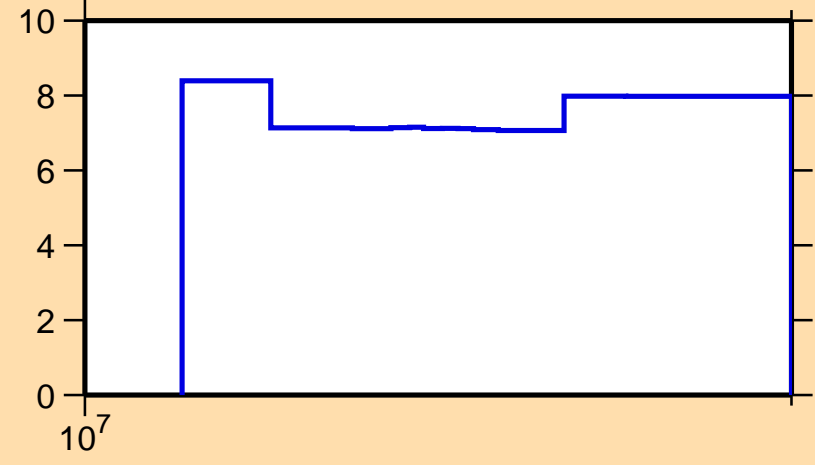

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\alpha)$

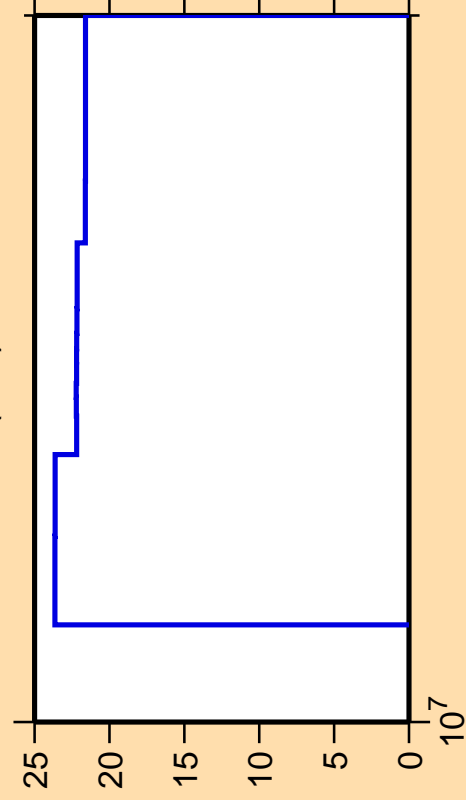

Ordinate scale is %  
relative standard deviation.

Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,2n)$

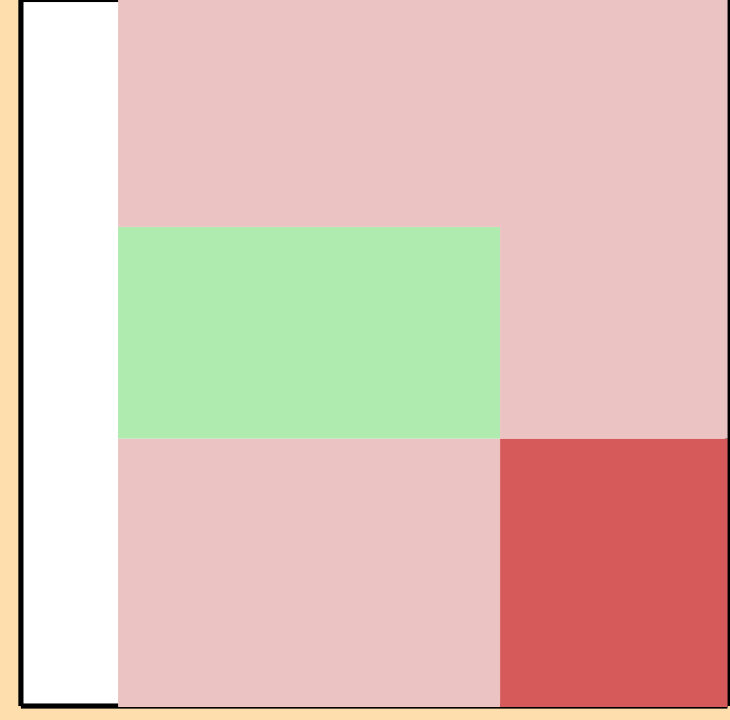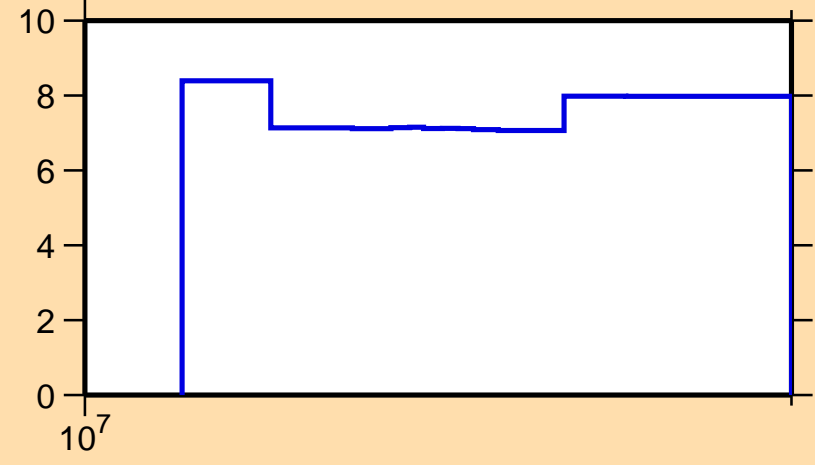


Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,3n)$

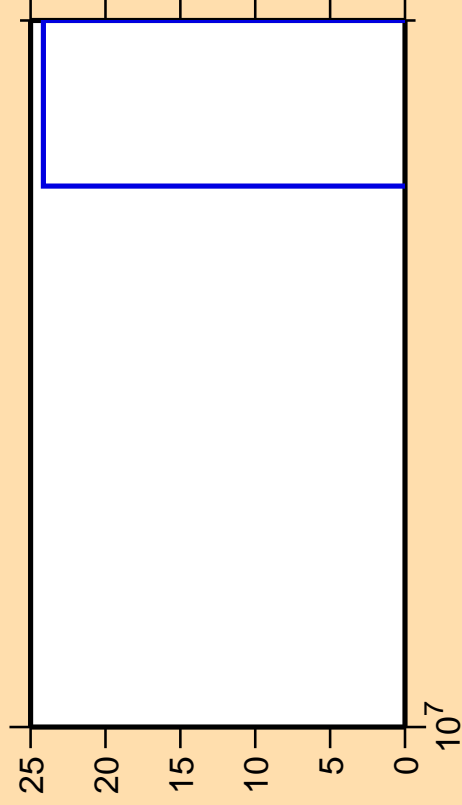

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,3n)$




$10^7$

$10^9$

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\alpha)$

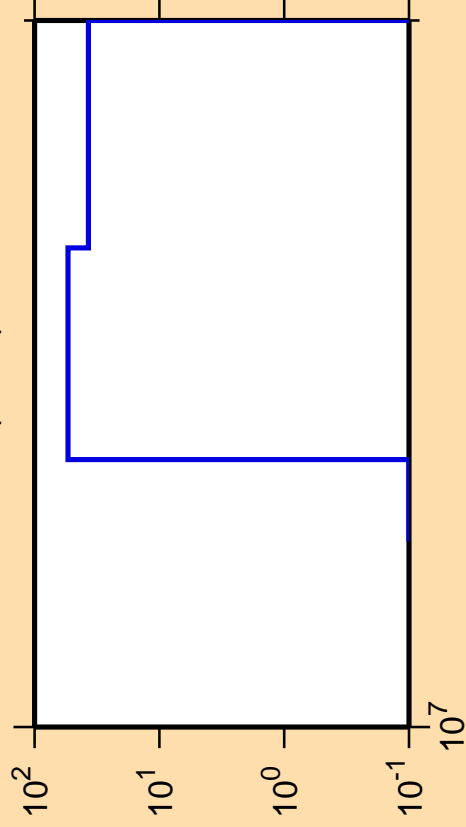


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{50}\text{Ti}(n,n\alpha)$

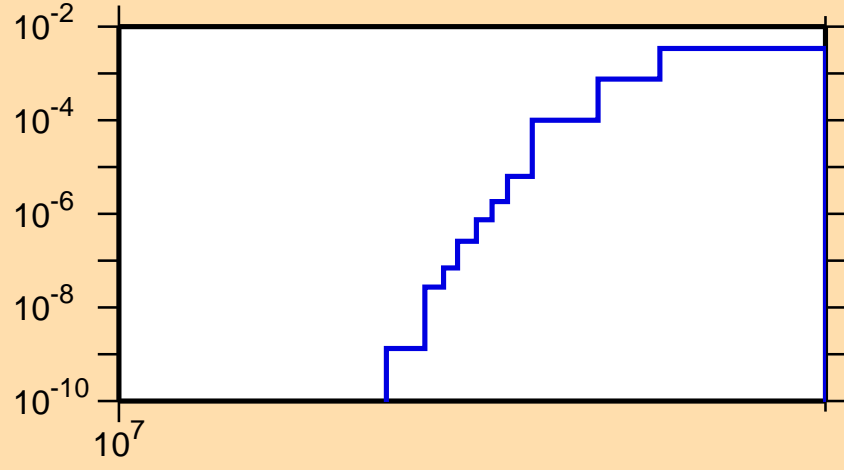

$10^7$


$10^{-10}$

$10^{-8}$


$10^{-4}$

$10^{-2}$

Correlation Matrix

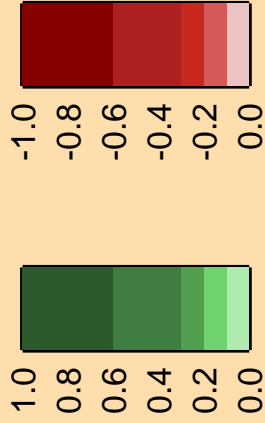



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,np)$

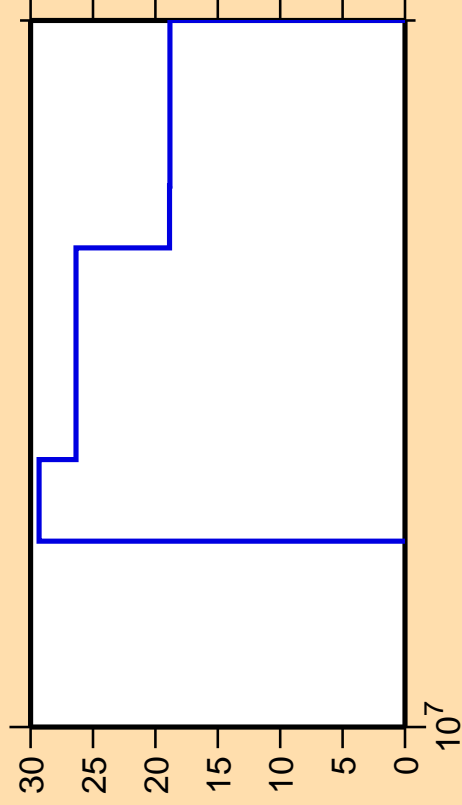

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{50}\text{Ti}(n,np)$

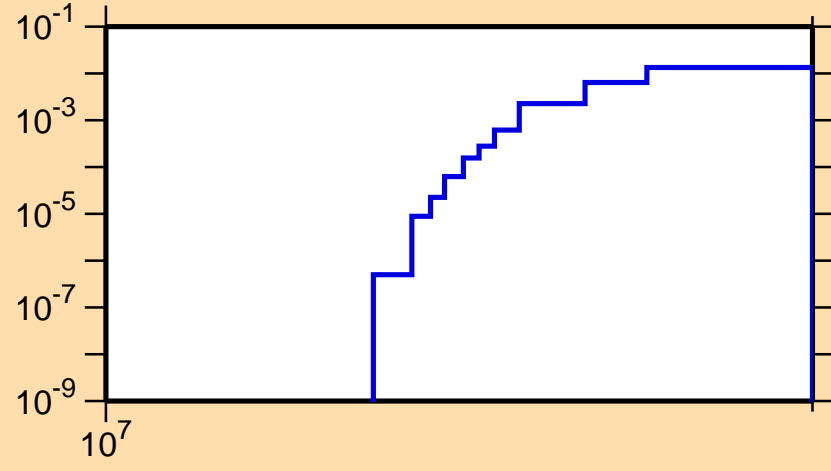

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

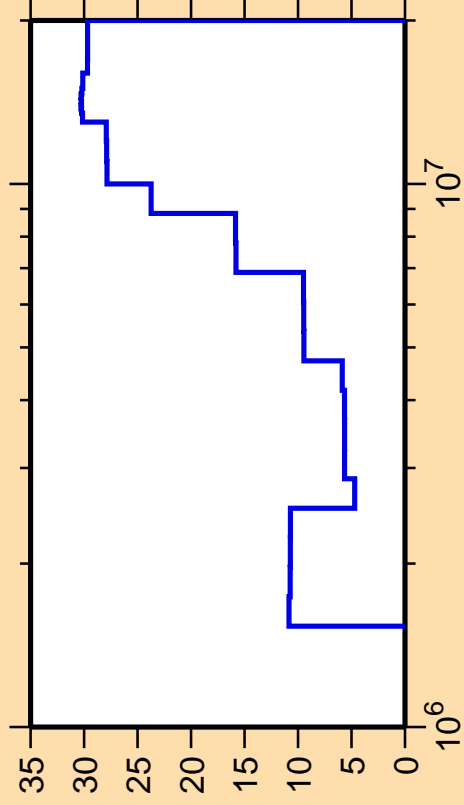

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

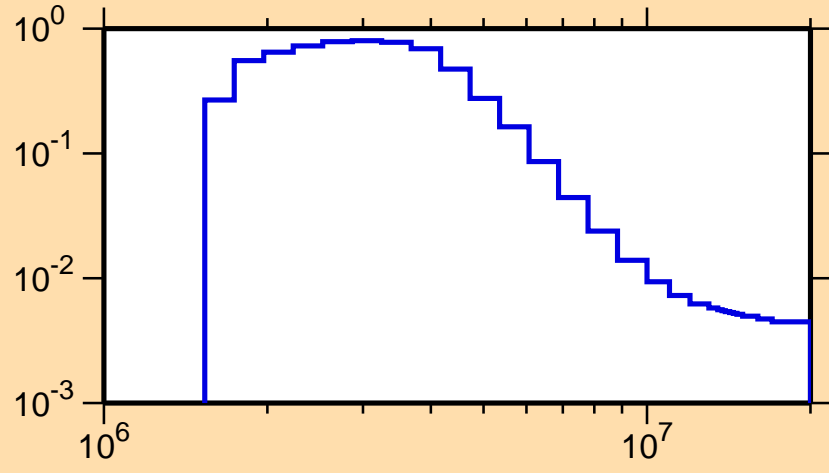

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_{\text{cont}})$ .

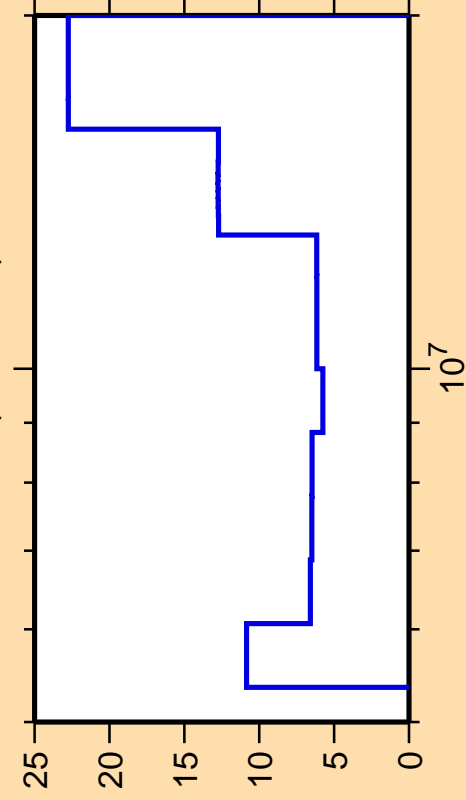

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

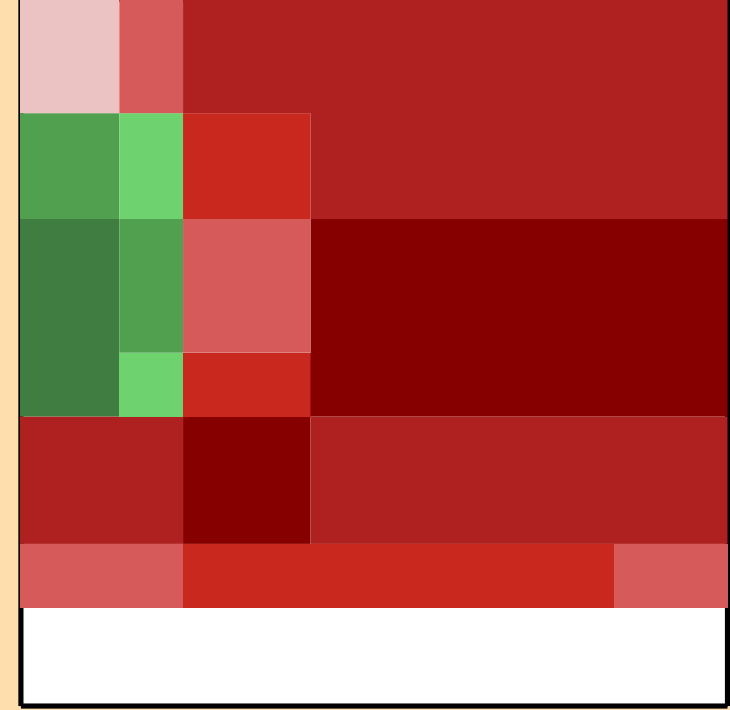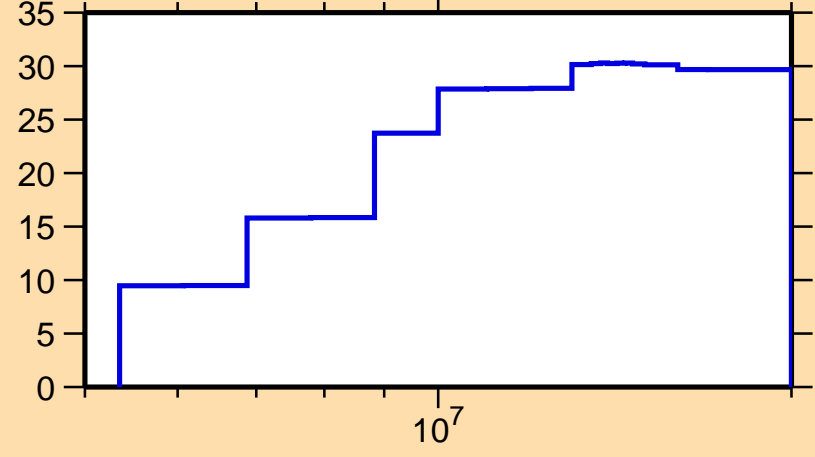

Correlation Matrix





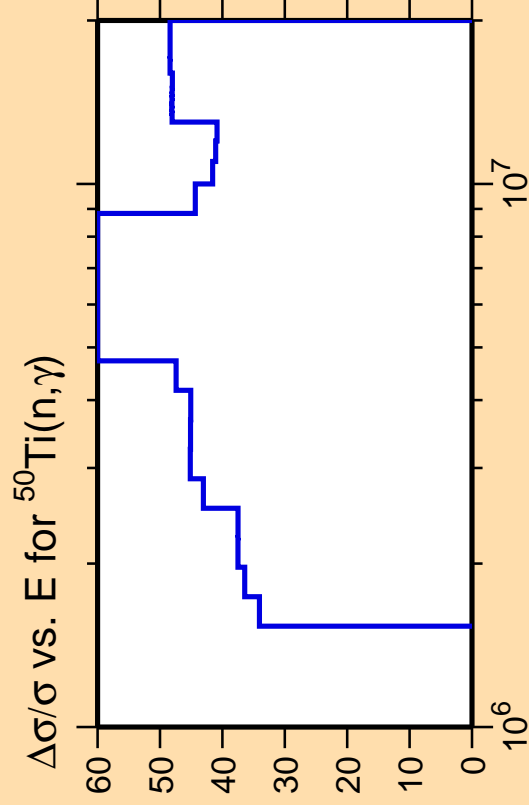

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

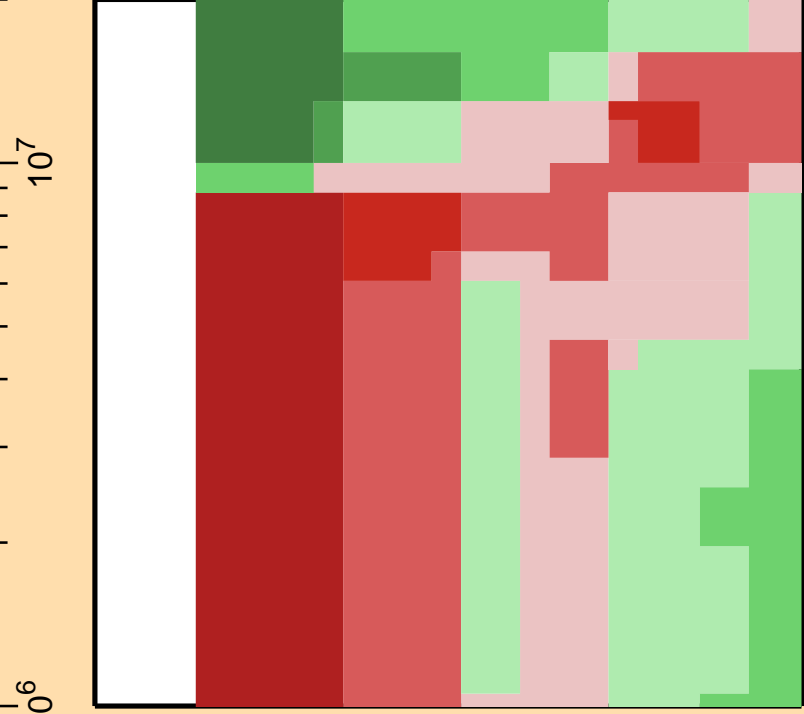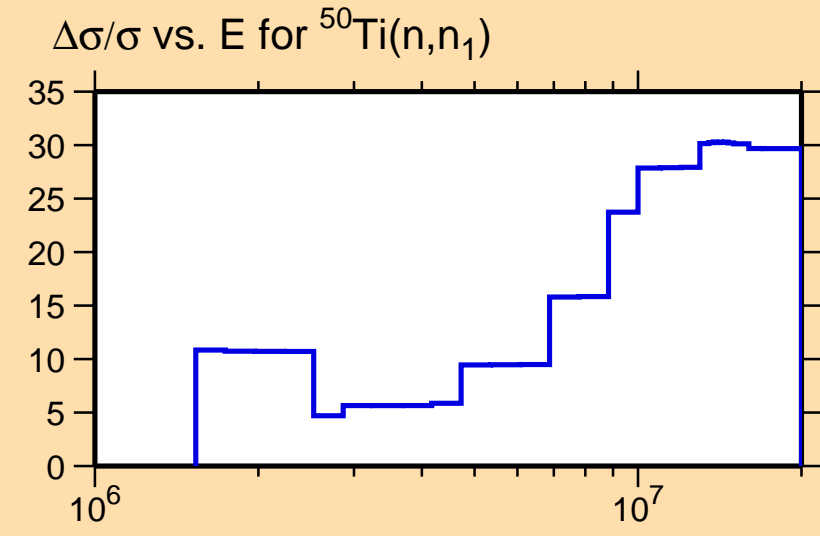

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$

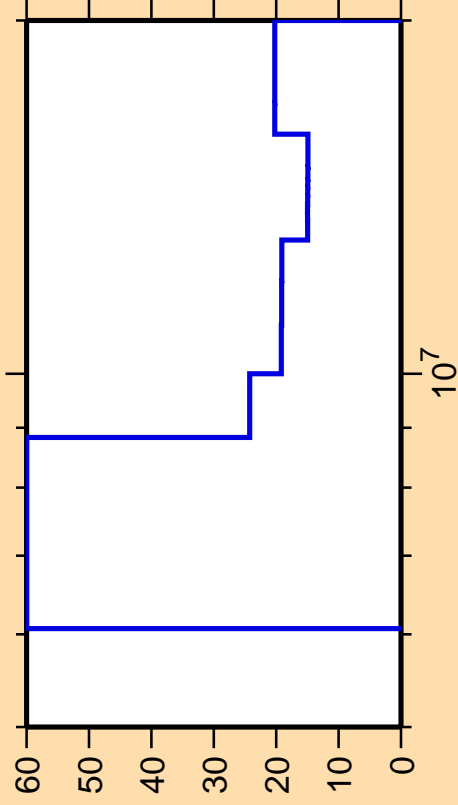


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_1)$

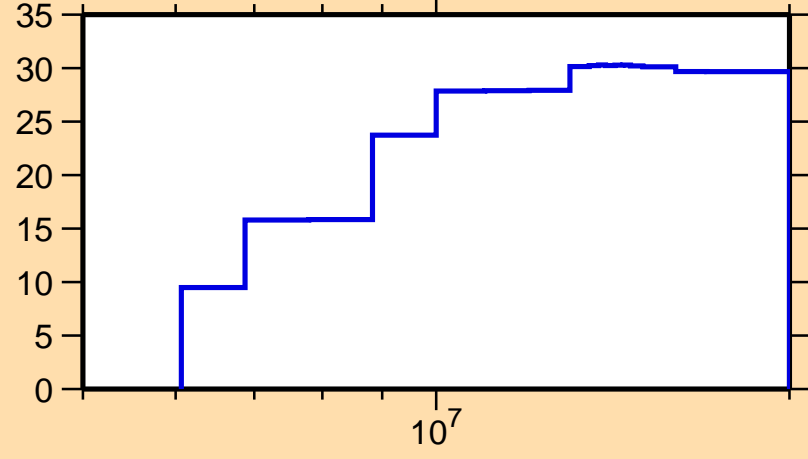


10<sup>7</sup>

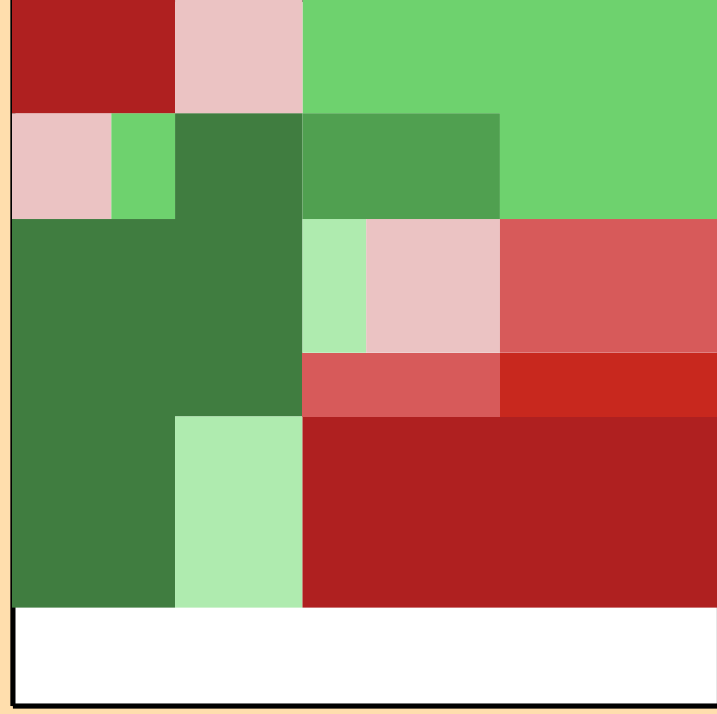

Correlation Matrix




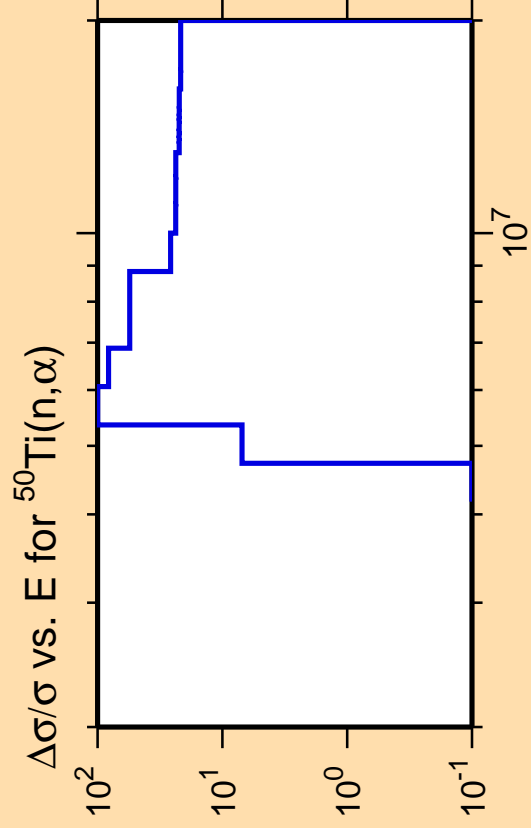

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

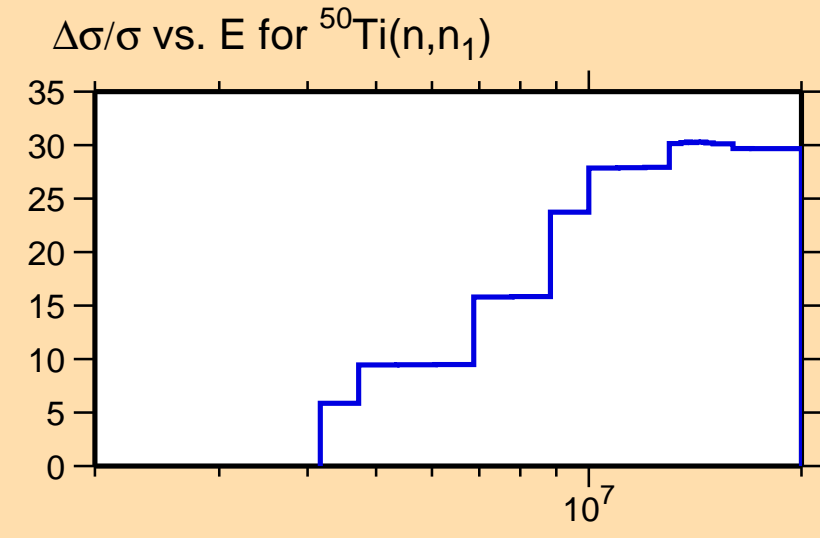


Correlation Matrix







$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n_2)$

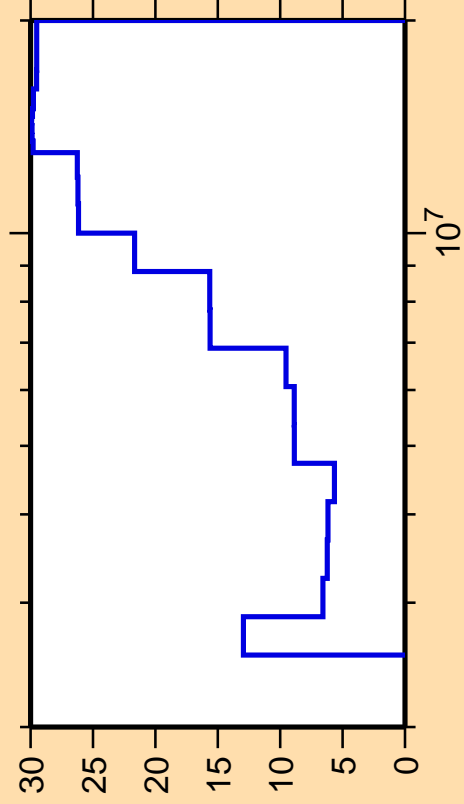


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

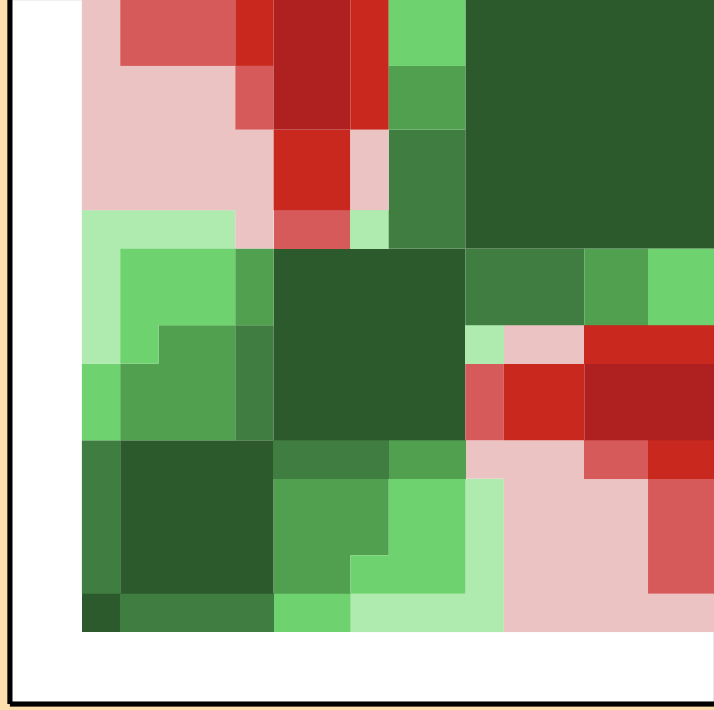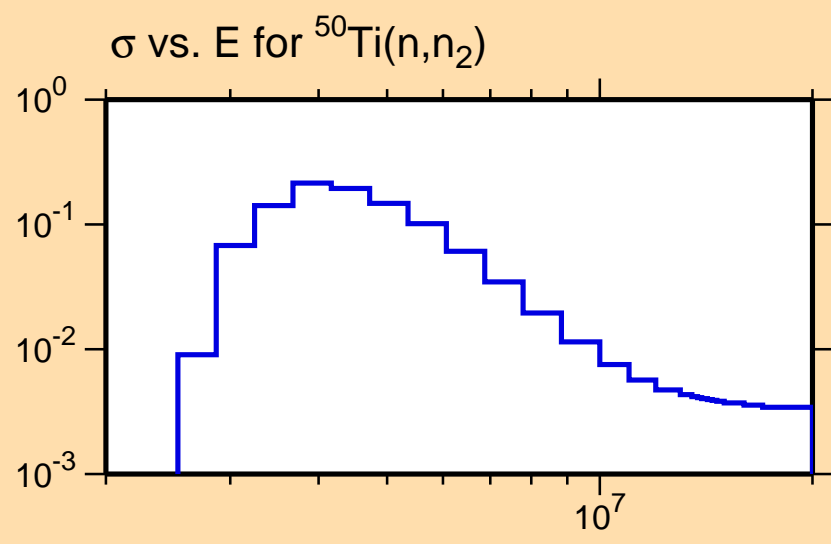


Correlation Matrix



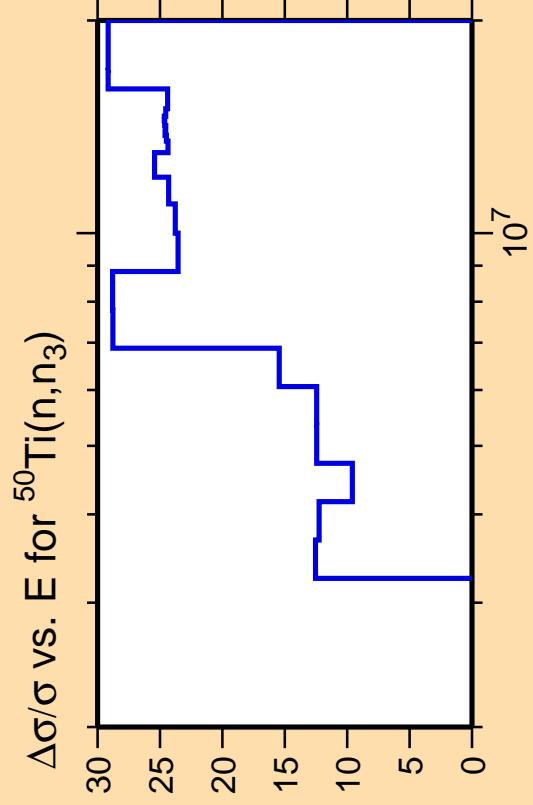


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

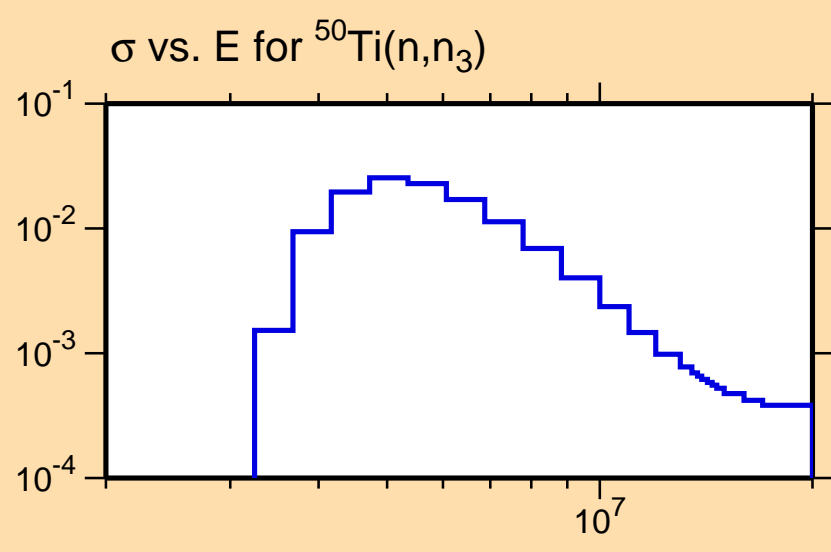



Correlation Matrix



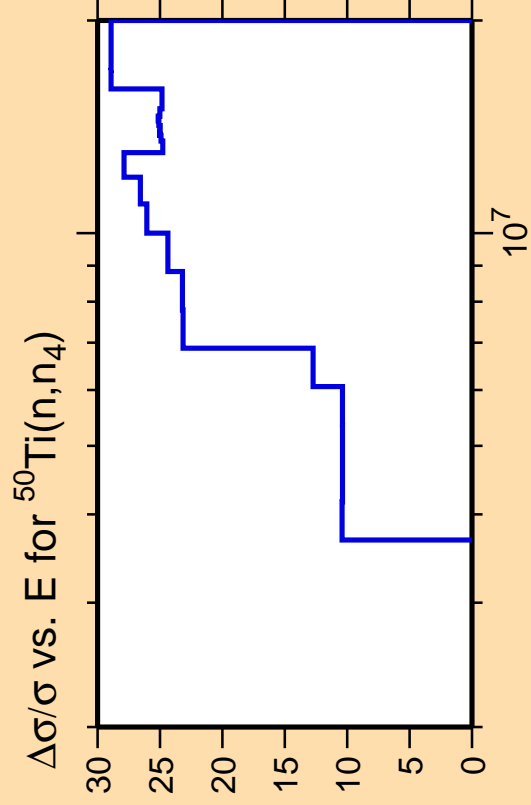

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

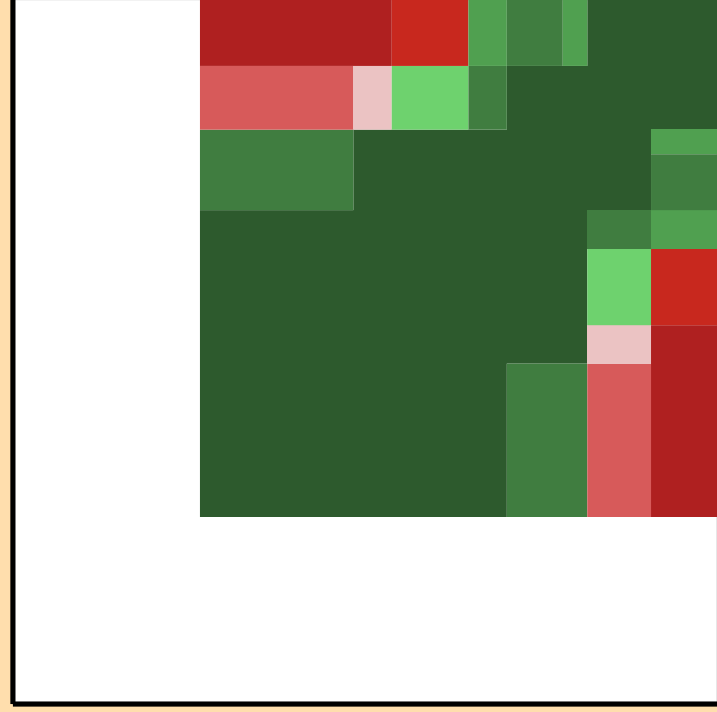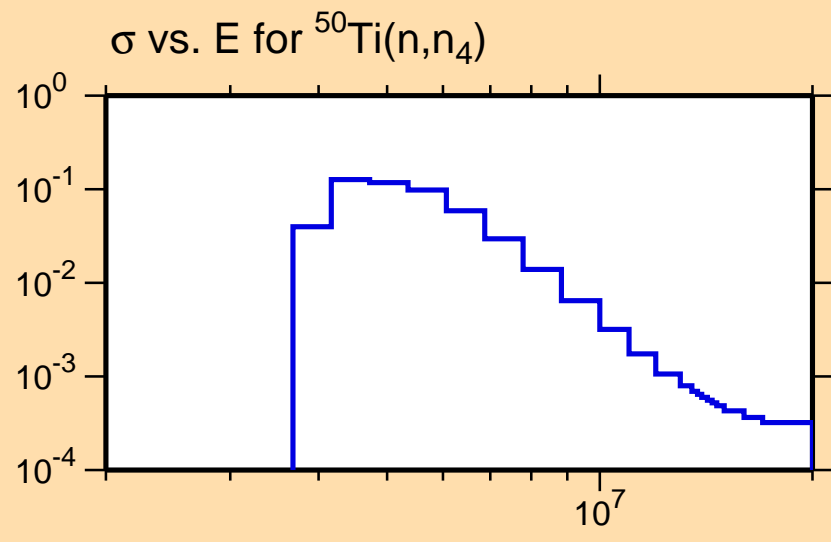

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

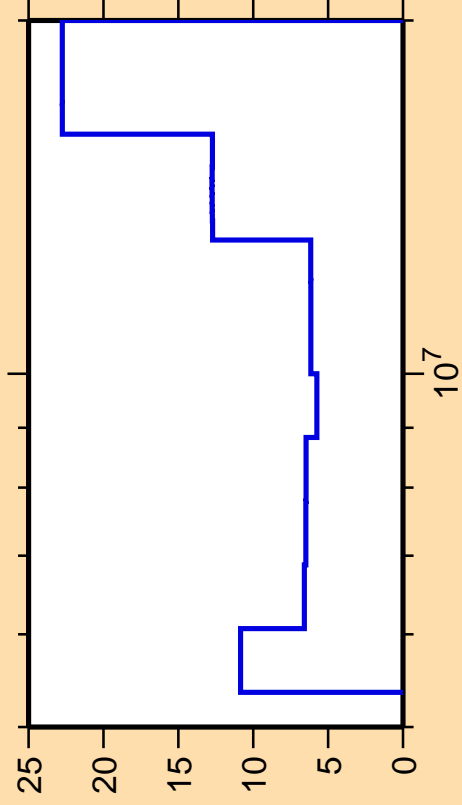


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

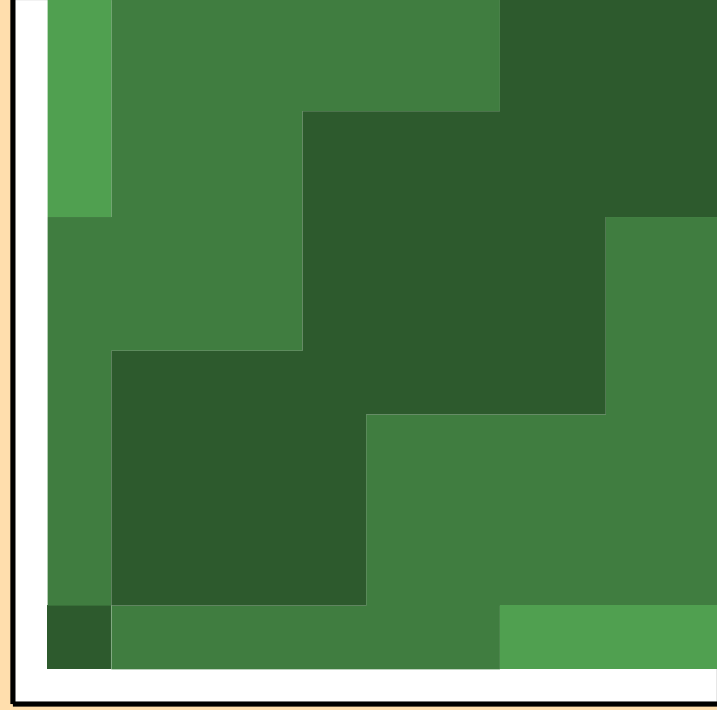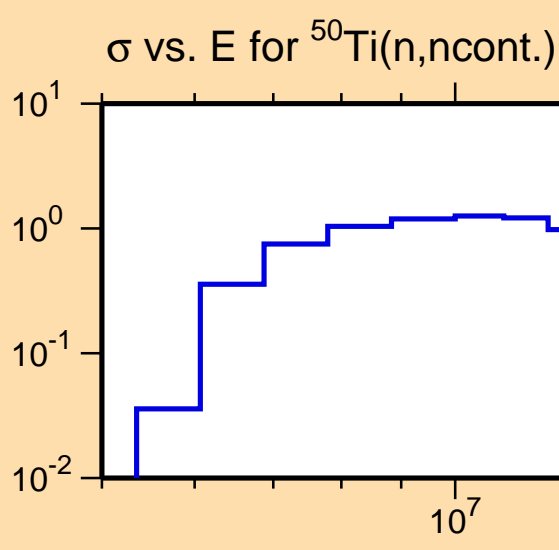

Correlation Matrix





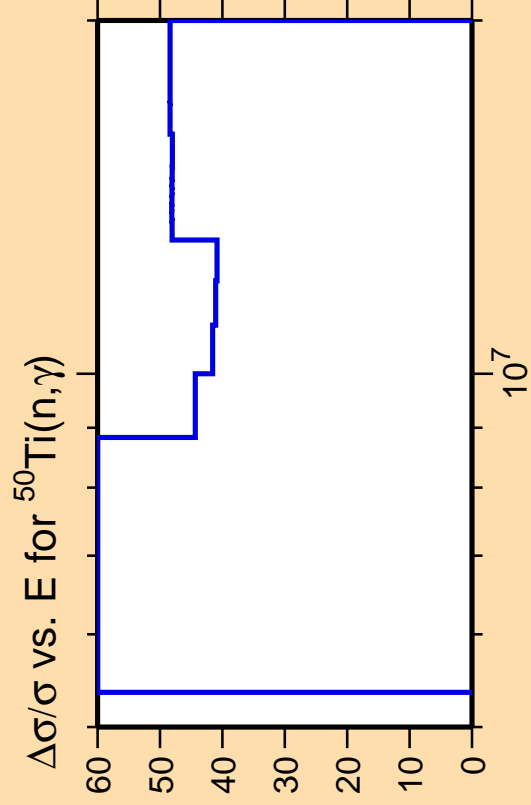

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

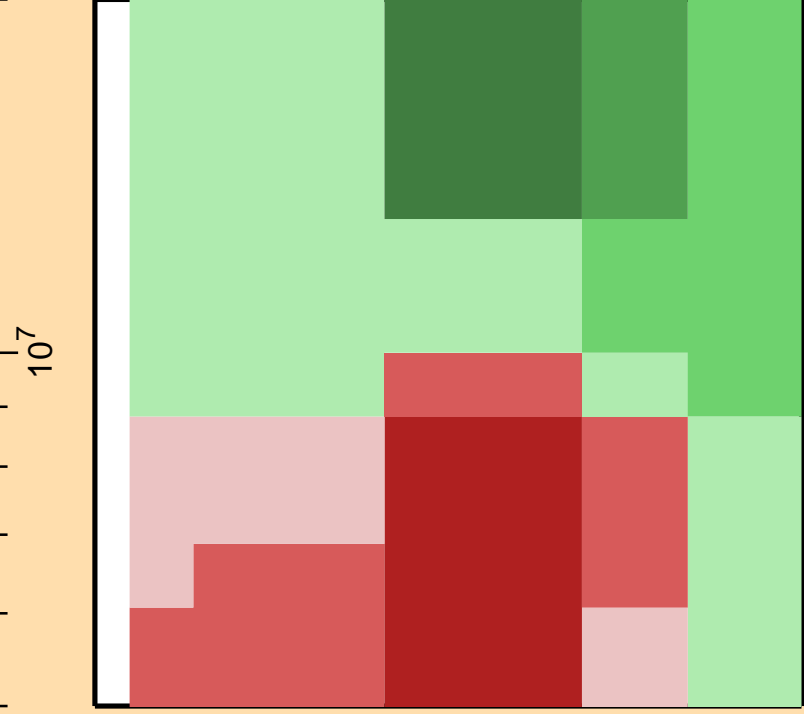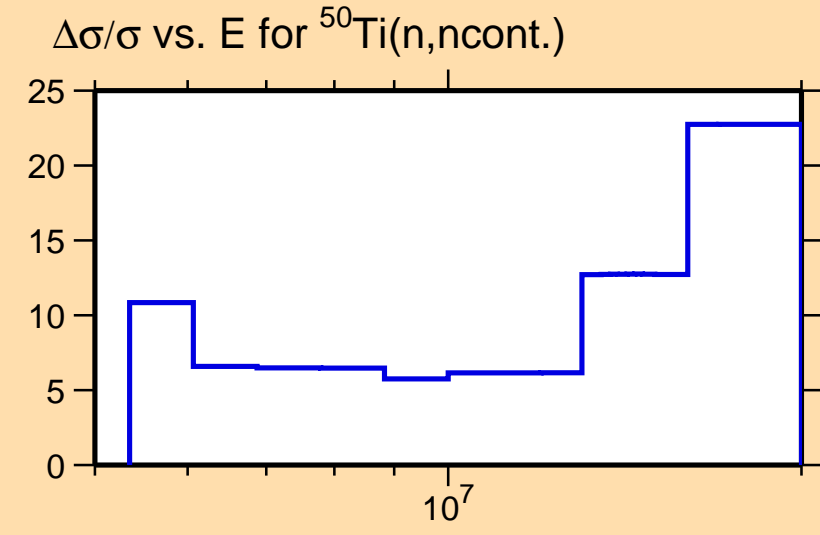

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$


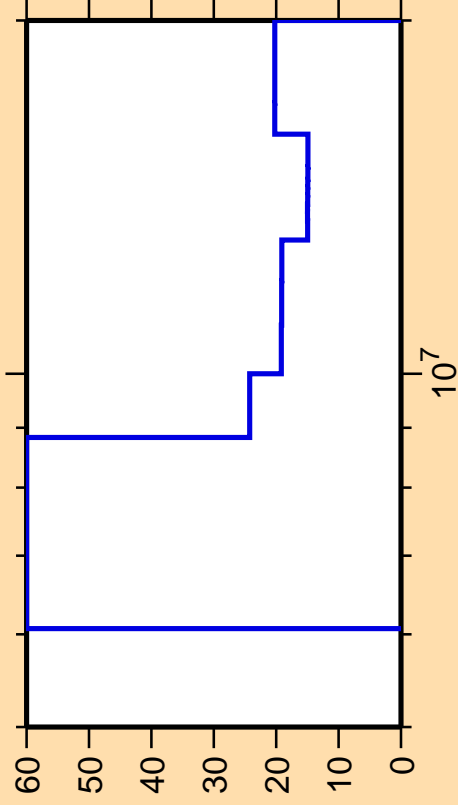


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,ncont.)$

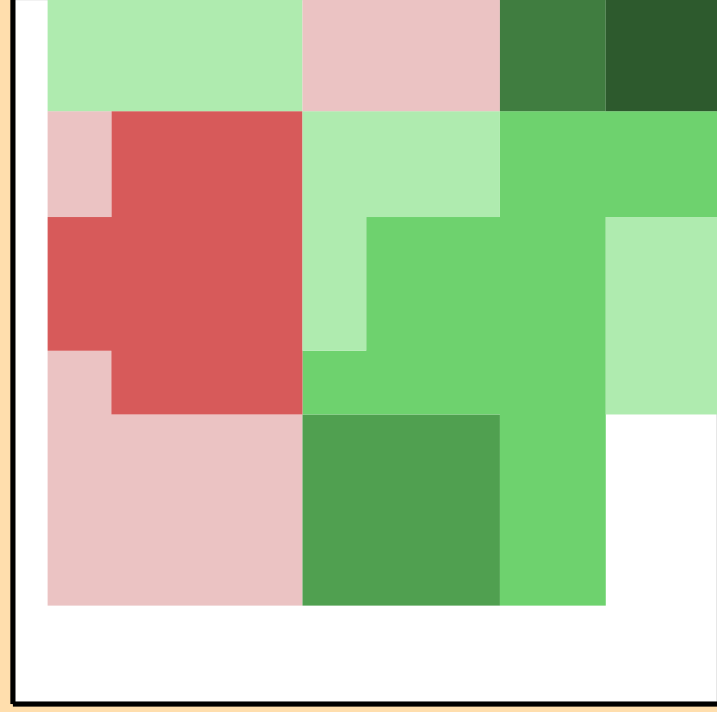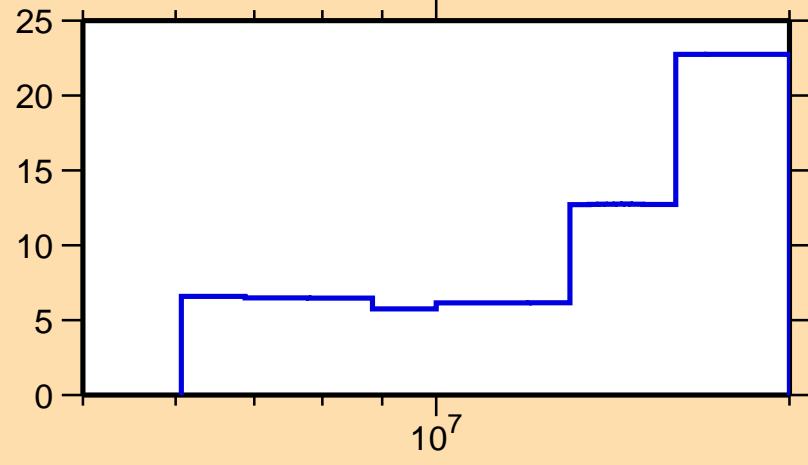

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\alpha)$


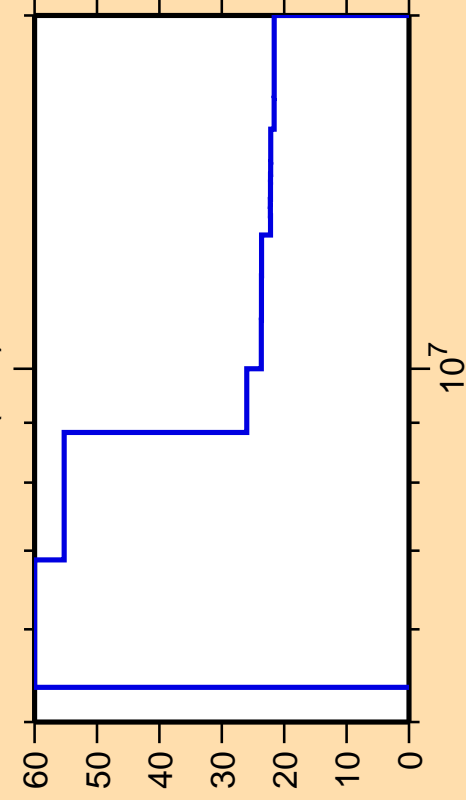


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,n\text{cont.})$

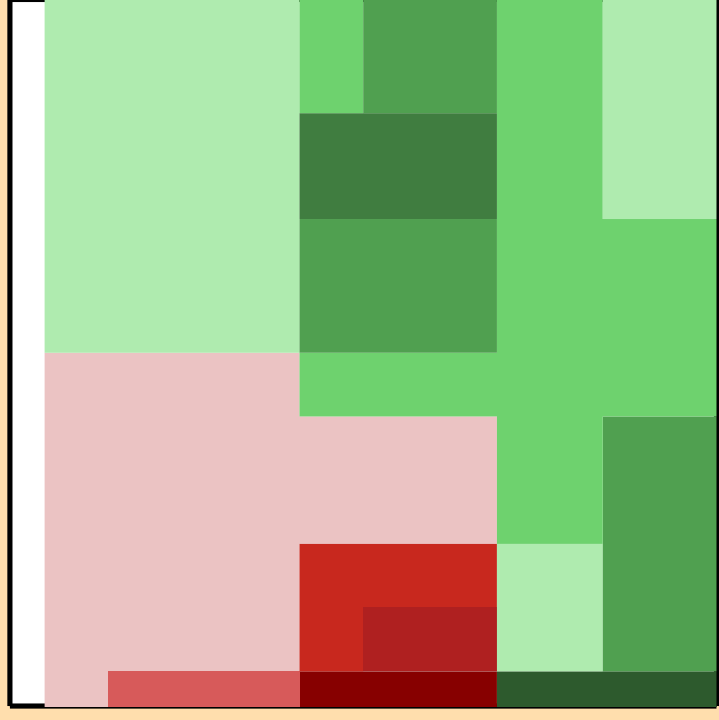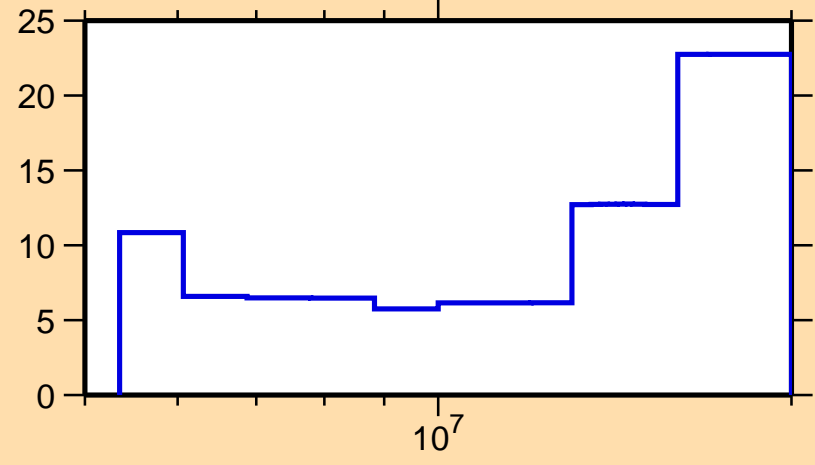

Correlation Matrix





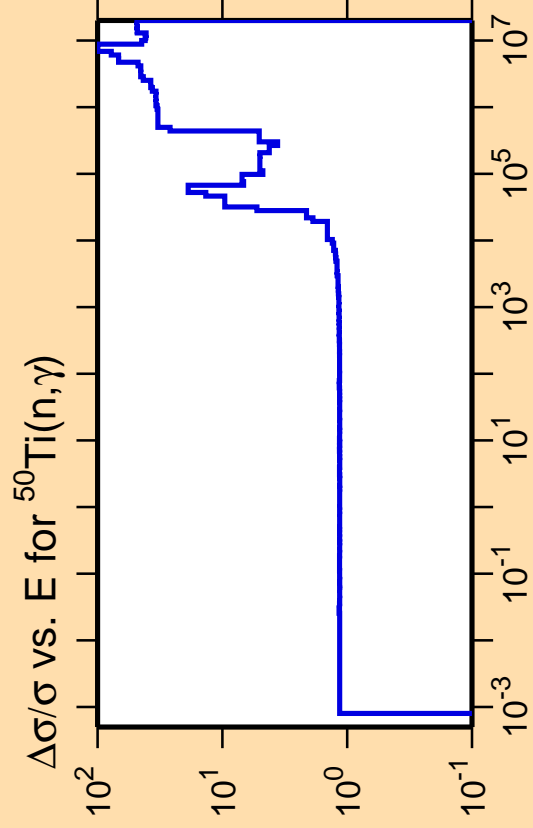

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

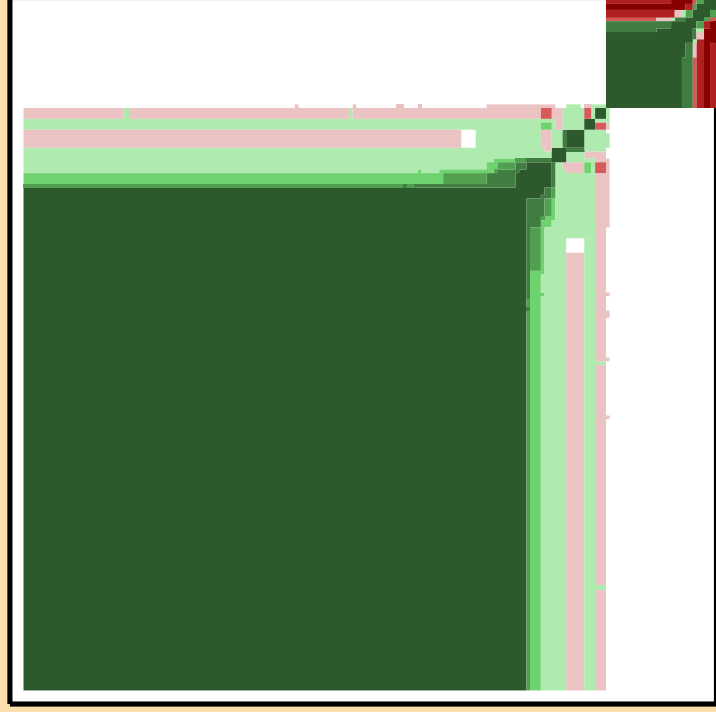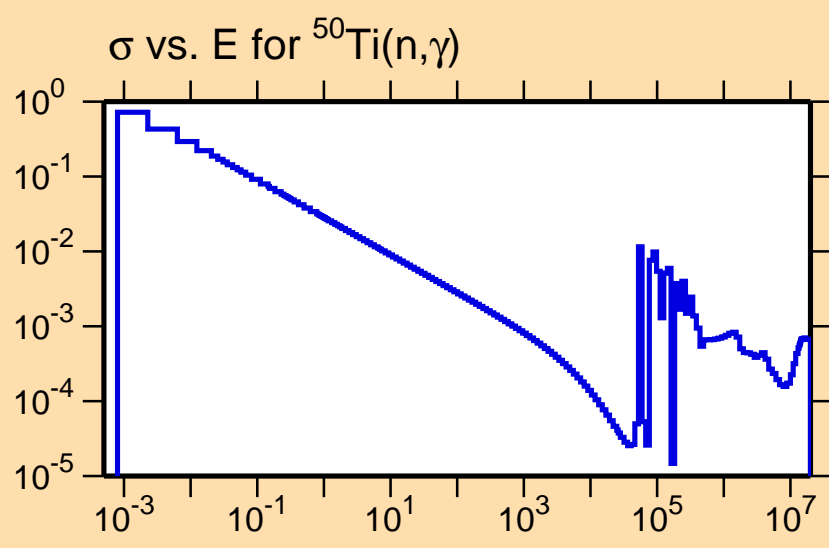


Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$

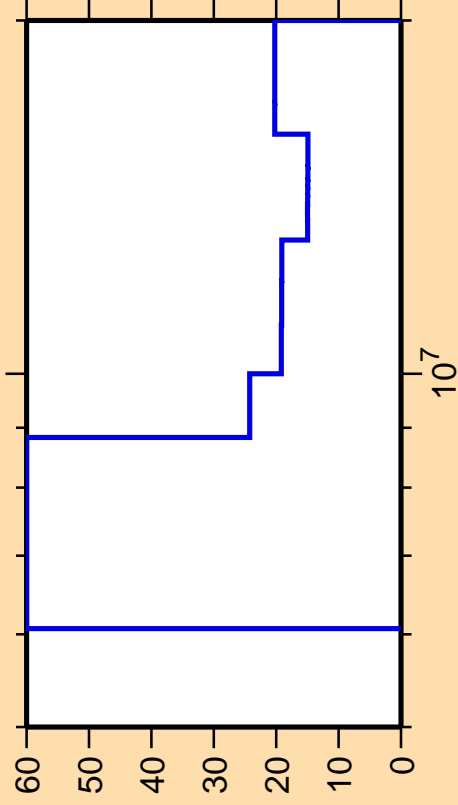


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\gamma)$

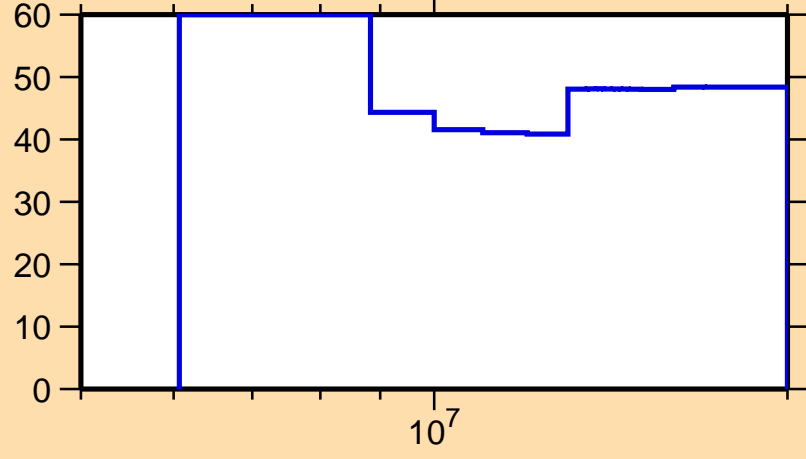


$10^7$

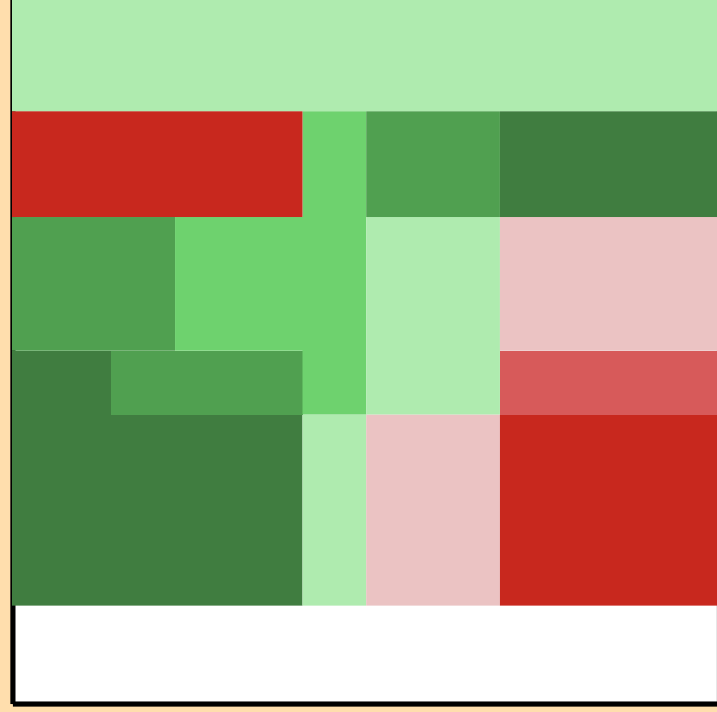

Correlation Matrix





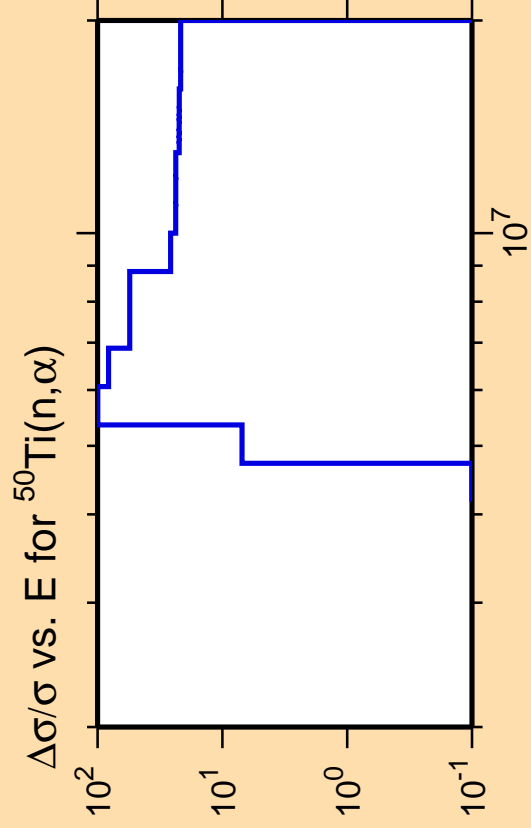

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

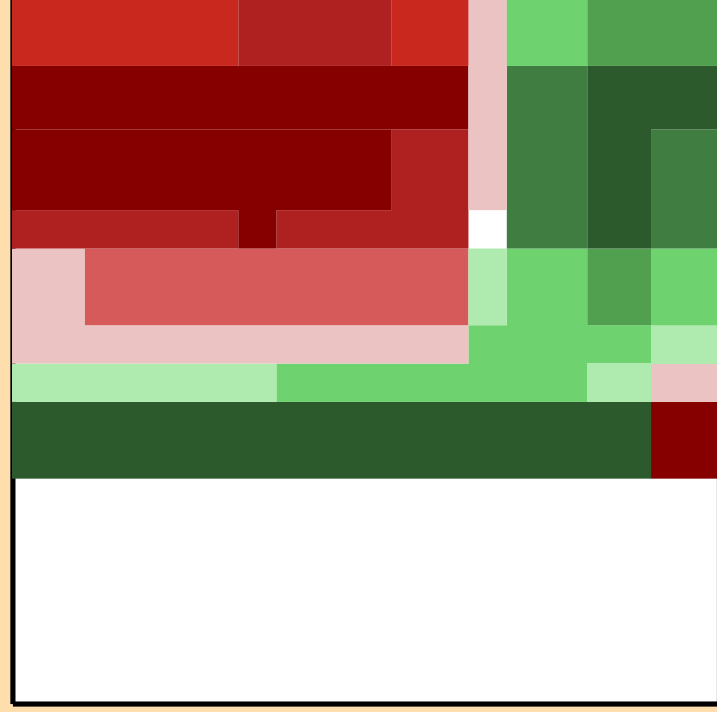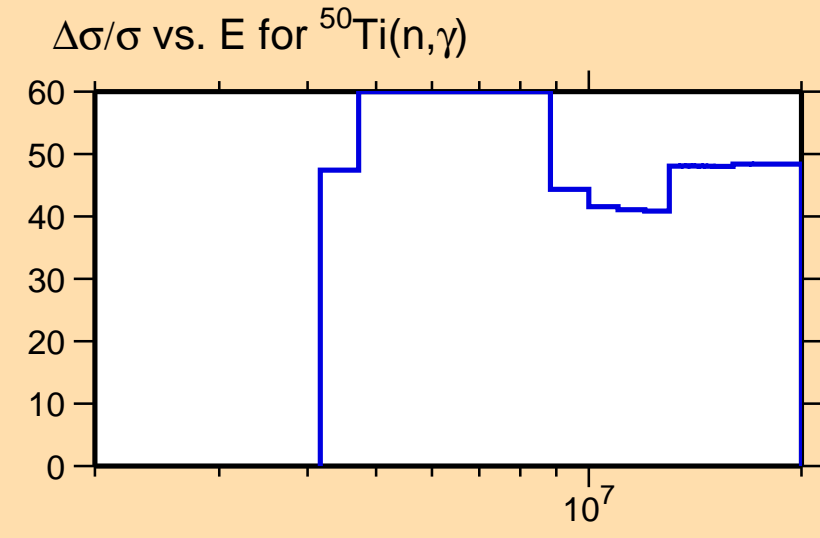

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$


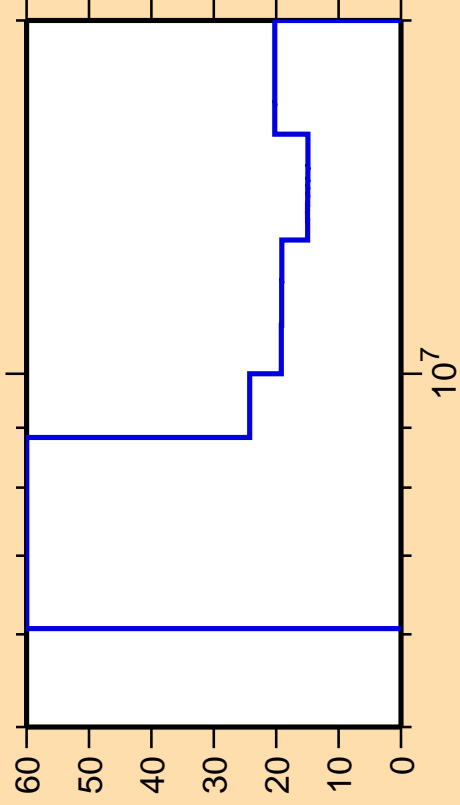


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


$\sigma$  vs. E for  $^{50}\text{Ti}(n,p)$

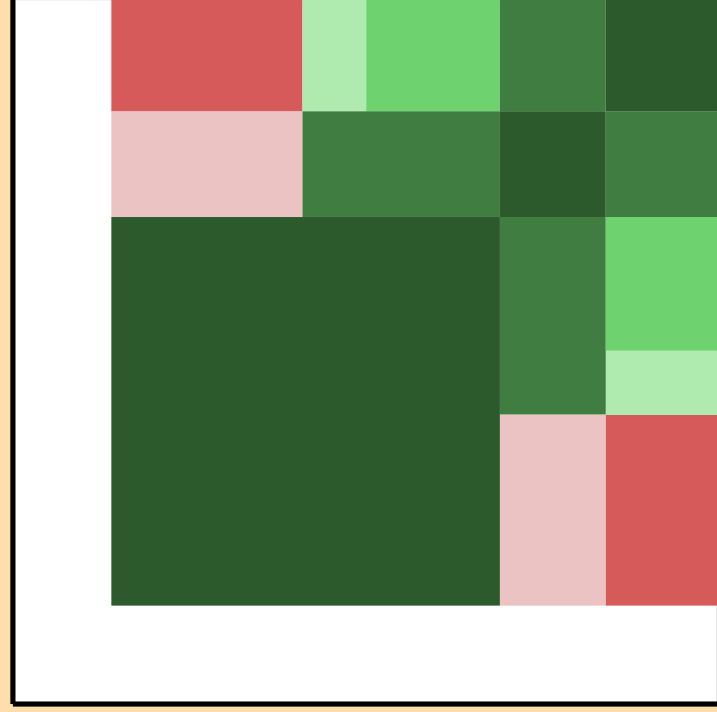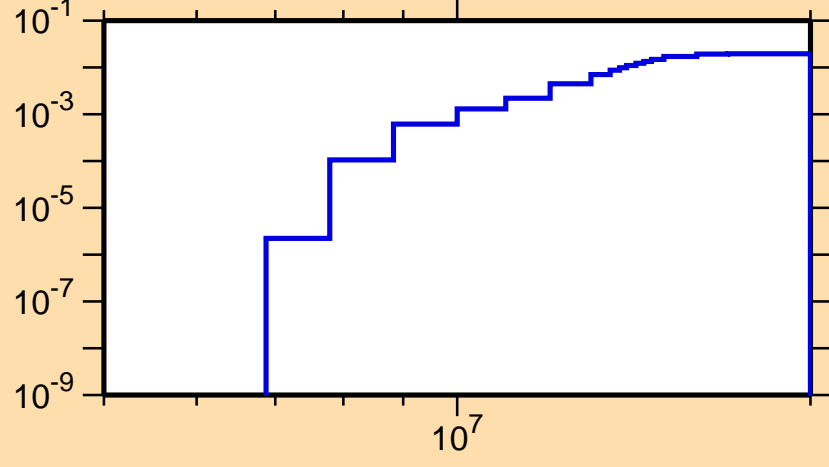

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,d)$

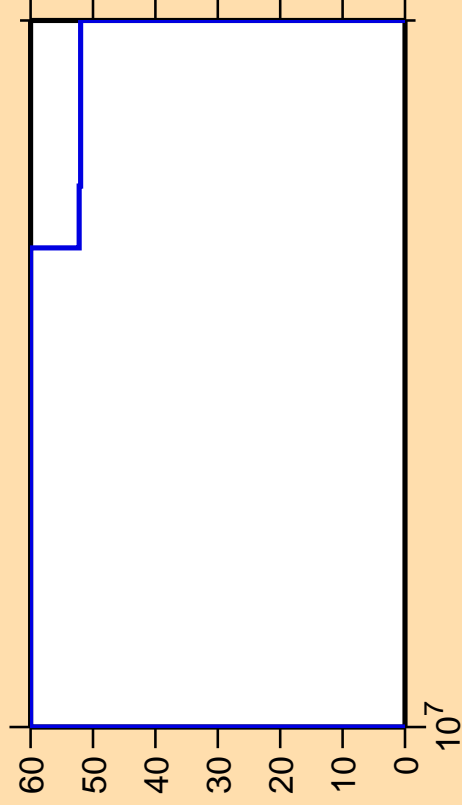


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{50}\text{Ti}(n,d)$

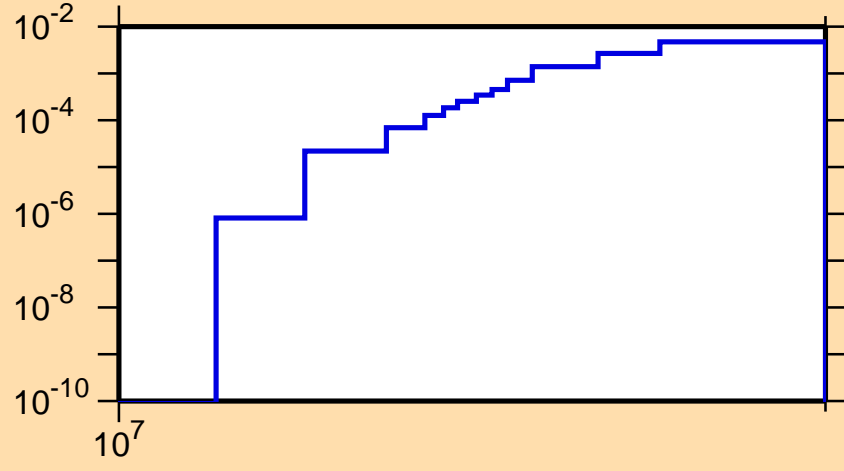

$10^7$

$10^{-10}$

$10^{-8}$

$10^{-6}$

$10^{-4}$

$10^{-2}$

Correlation Matrix



-1.0

-0.8

-0.6

-0.4

-0.2

0.0

1.0

0.8


0.6

0.4

0.2

0.0

$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,t)$

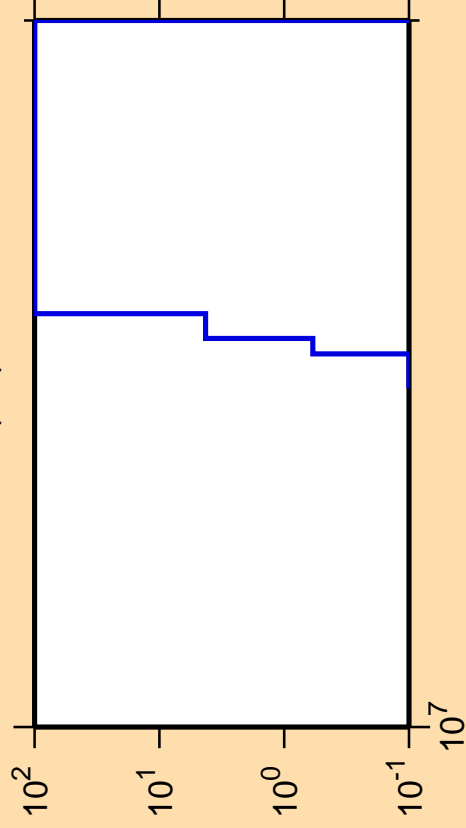


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{50}\text{Ti}(n,t)$

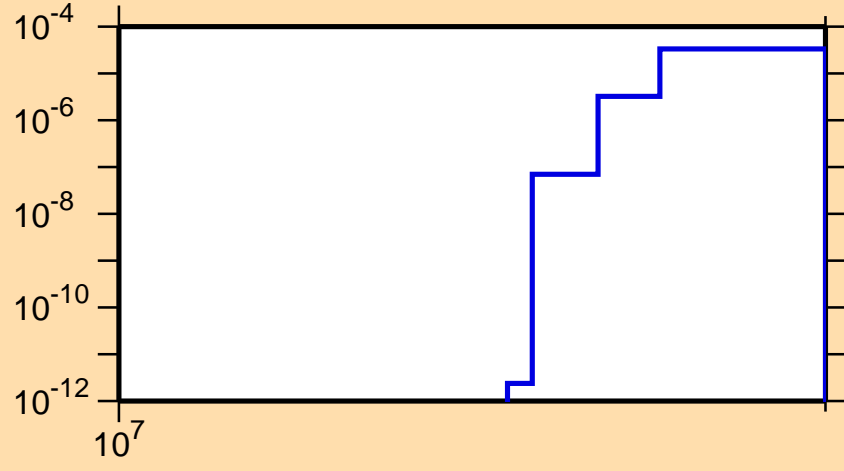


$10^7$



Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{He}3)$

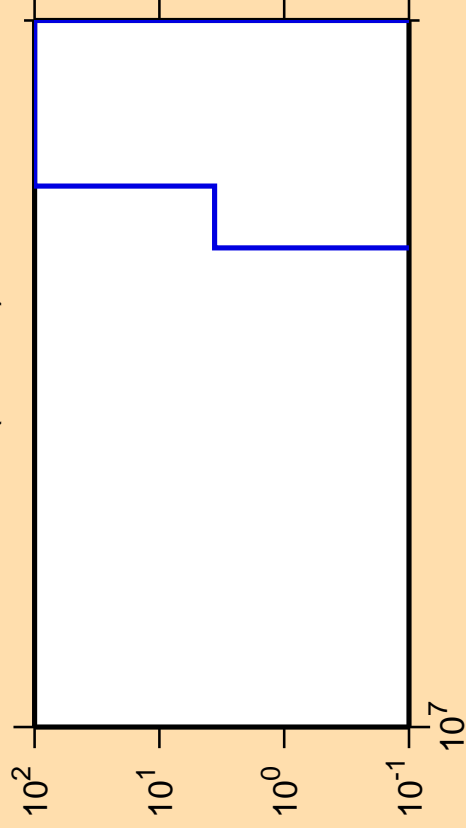


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{He}3)$

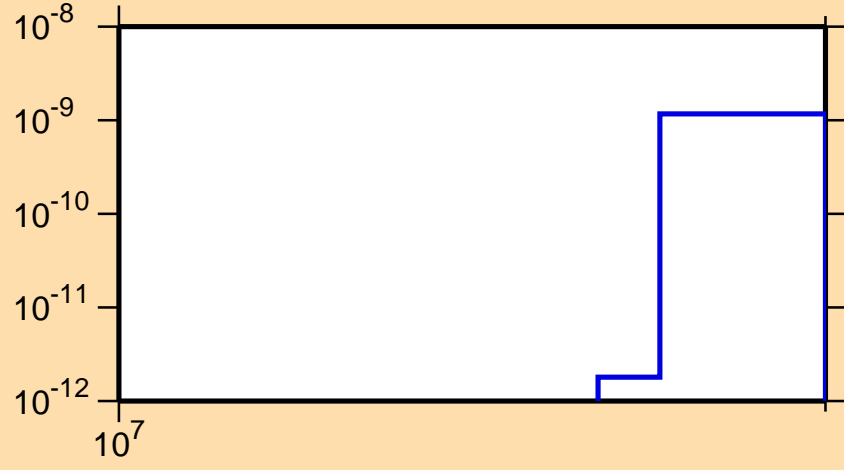


10<sup>7</sup>



Correlation Matrix





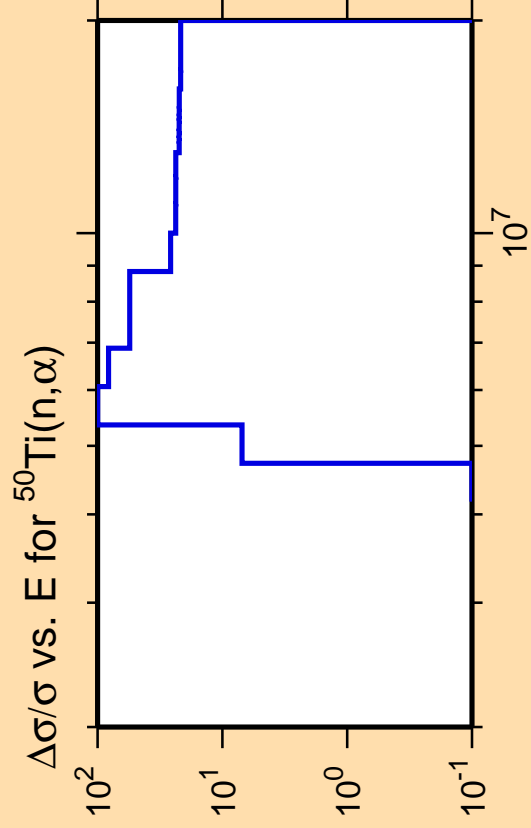

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

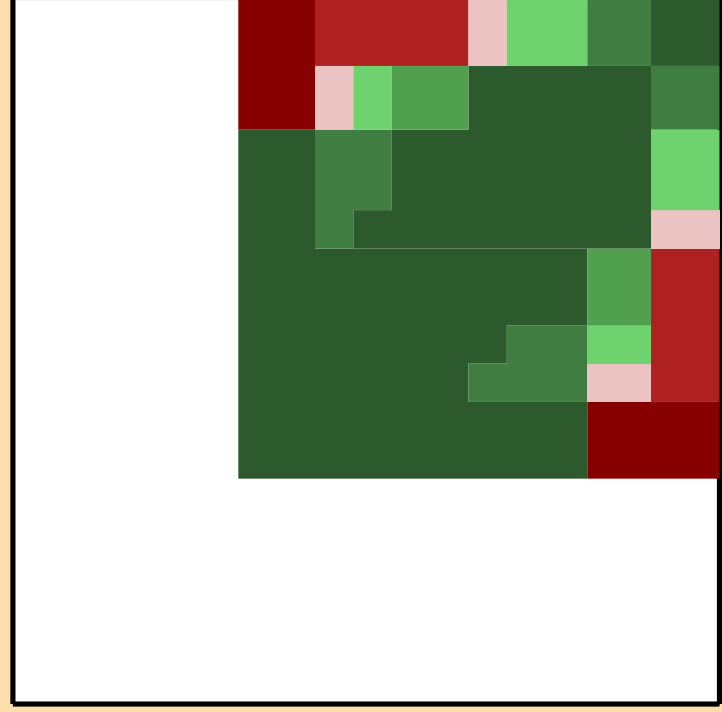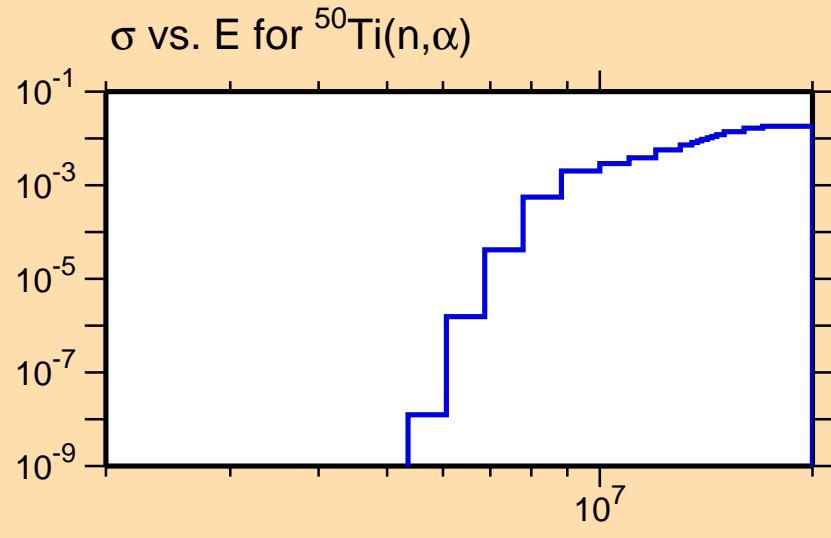

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,p\alpha)$

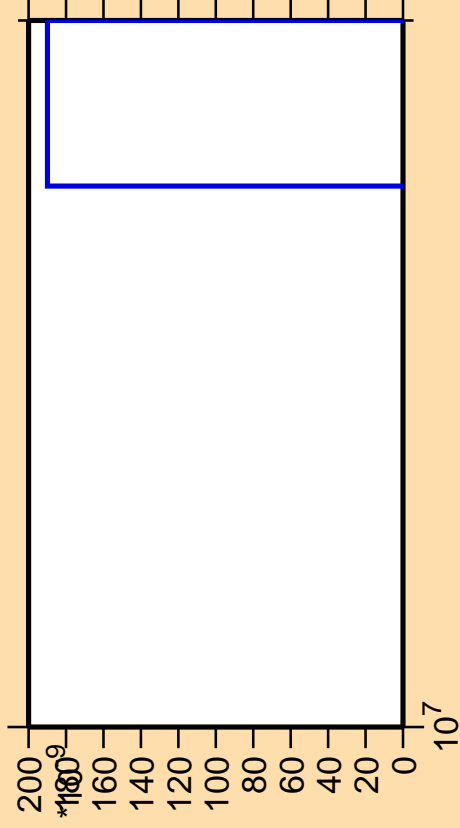

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,p\alpha)$




Correlation Matrix






$\Delta\sigma/\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{pd})$

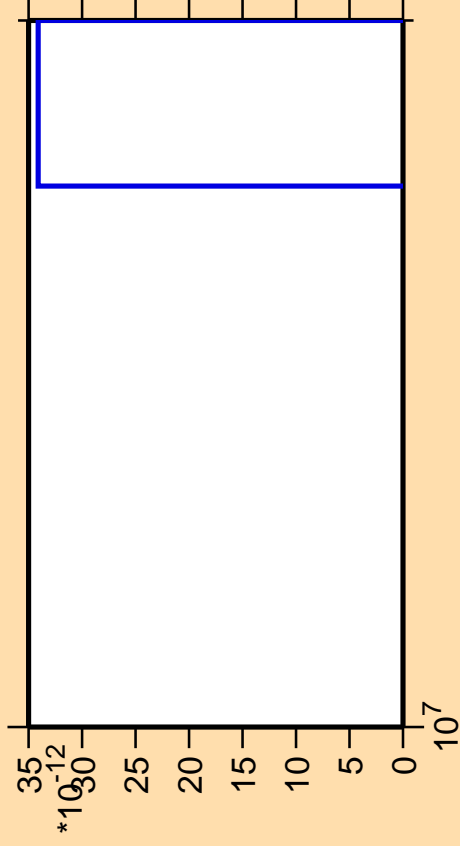

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{50}\text{Ti}(n,\text{pd})$



Correlation Matrix

