




$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

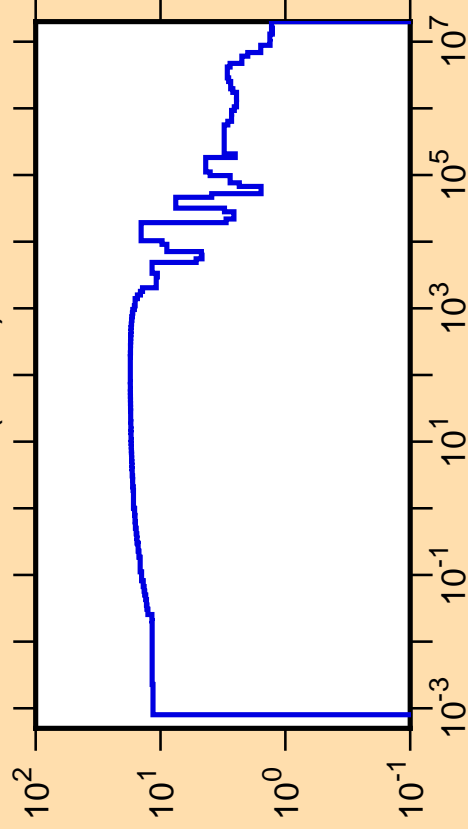

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,\text{tot.})$

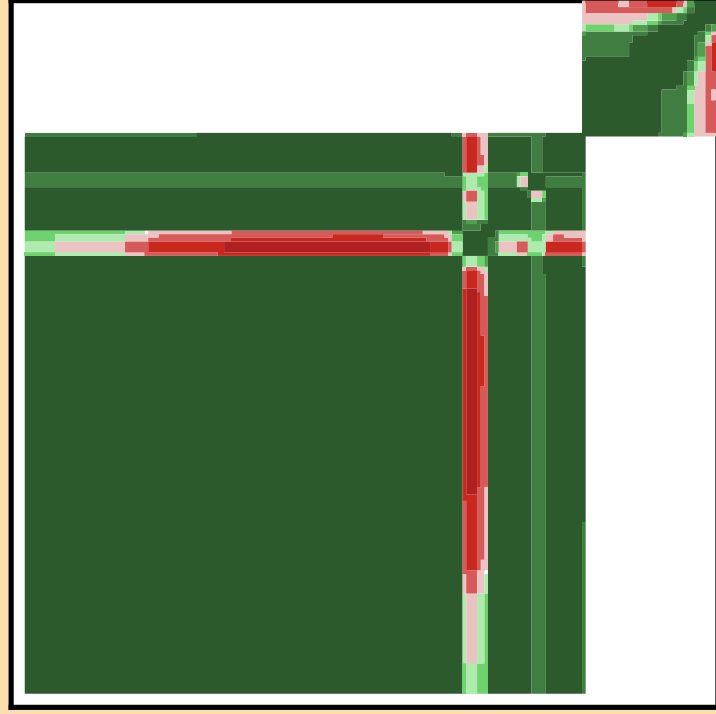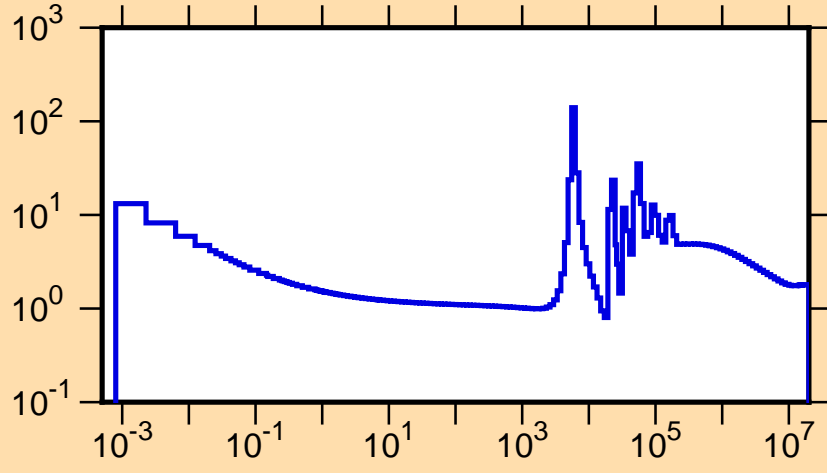

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

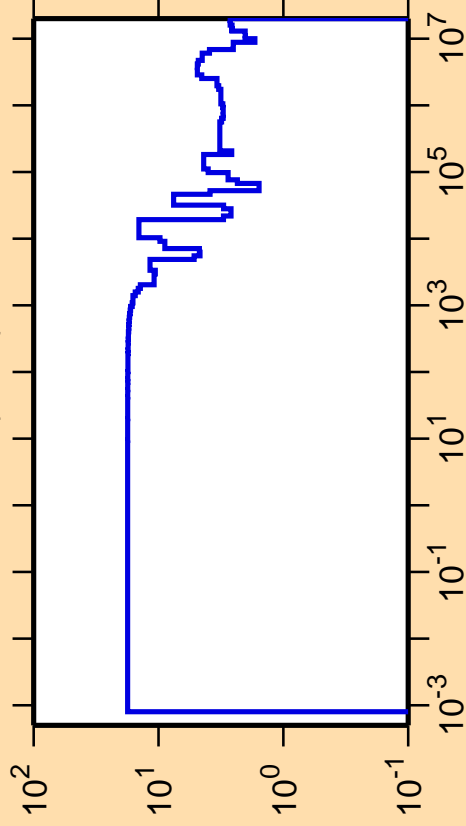

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

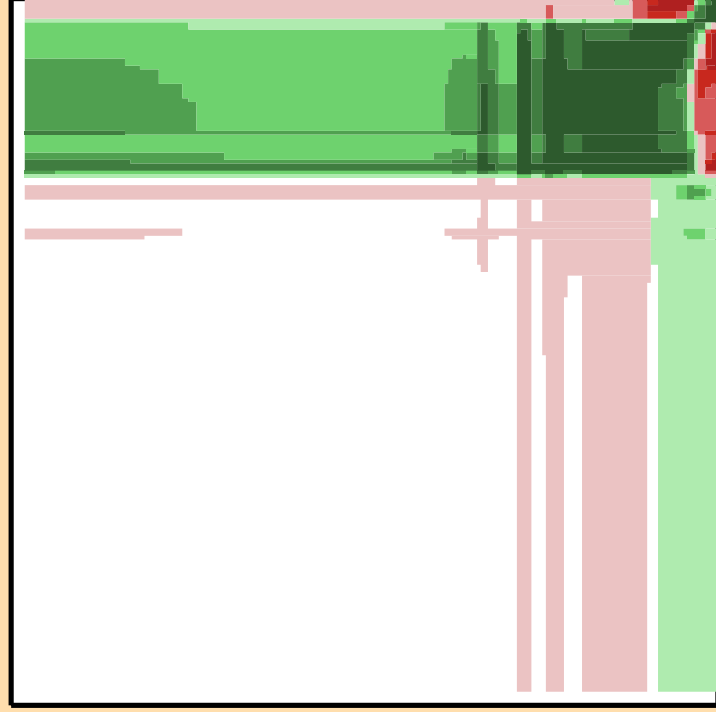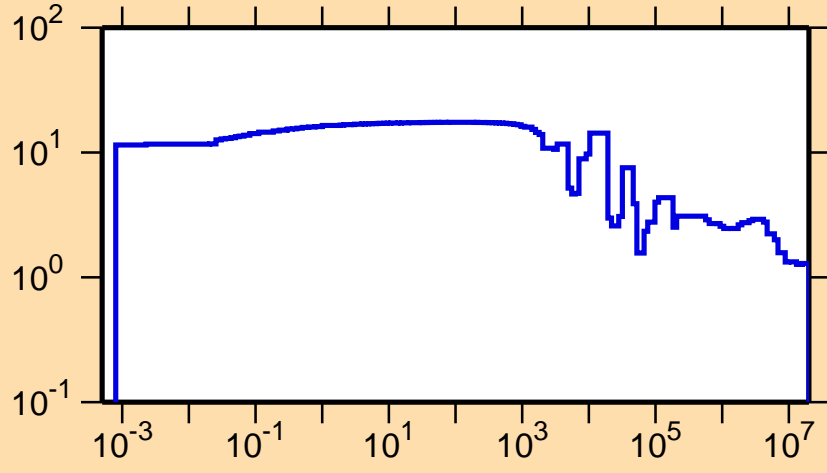

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$


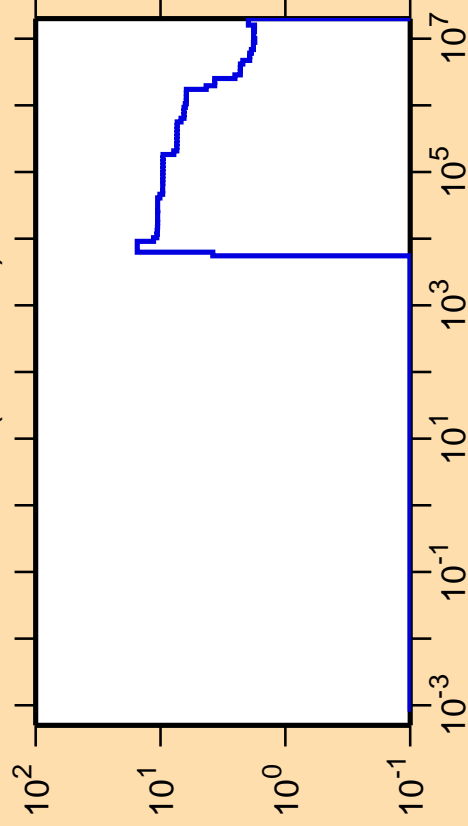


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

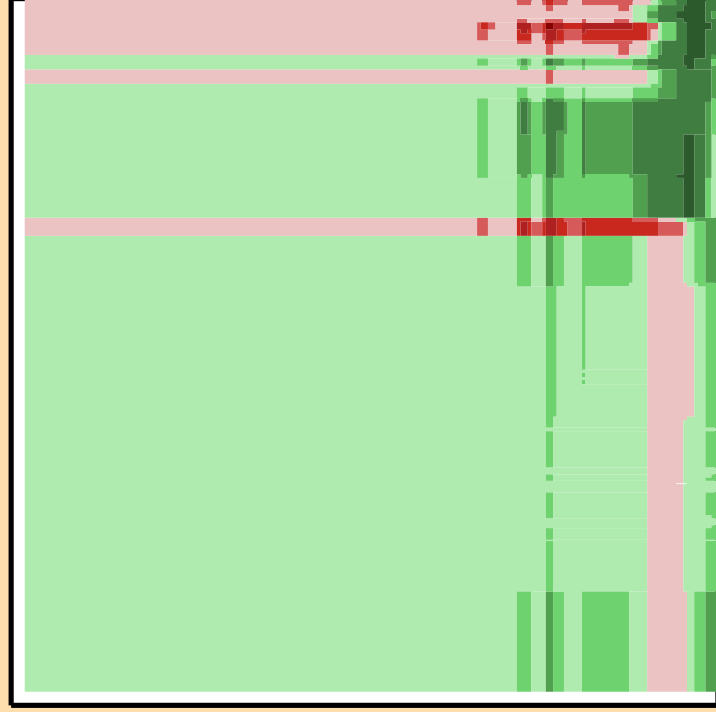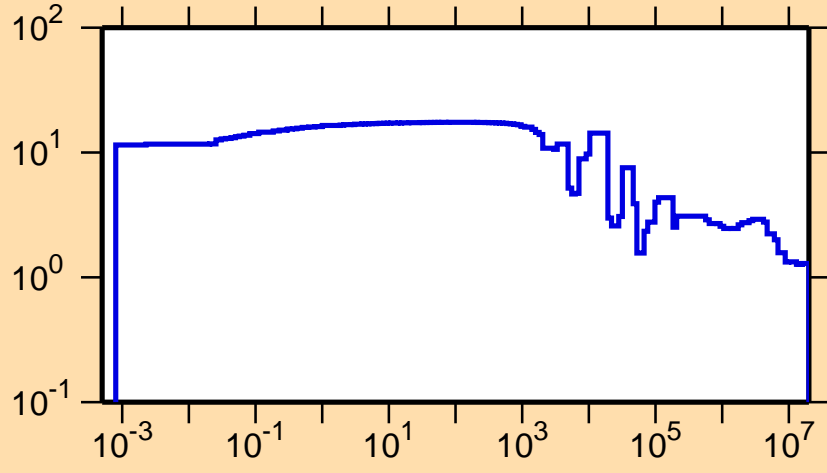

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{inel.})$

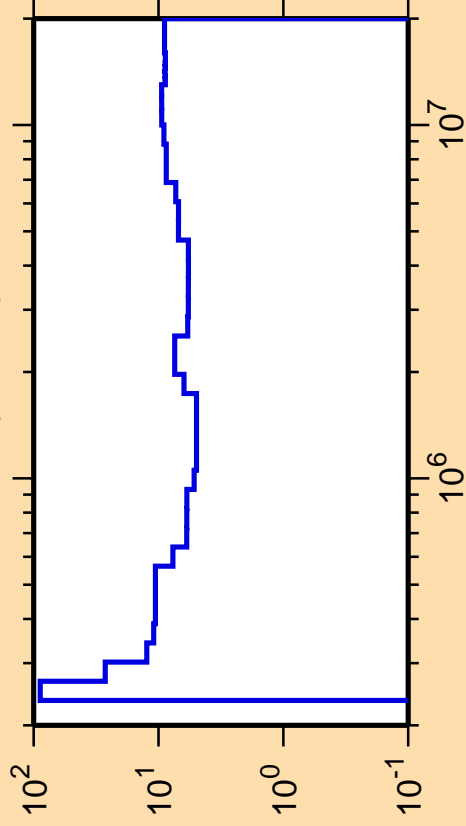

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

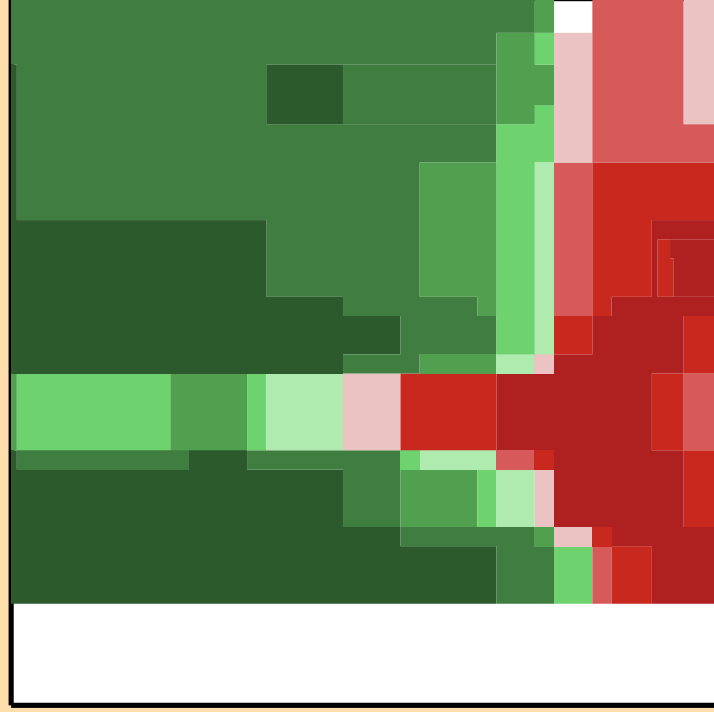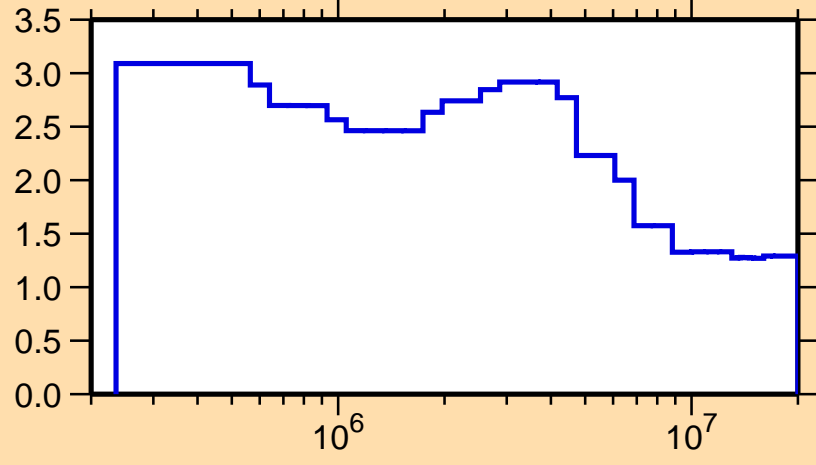

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$


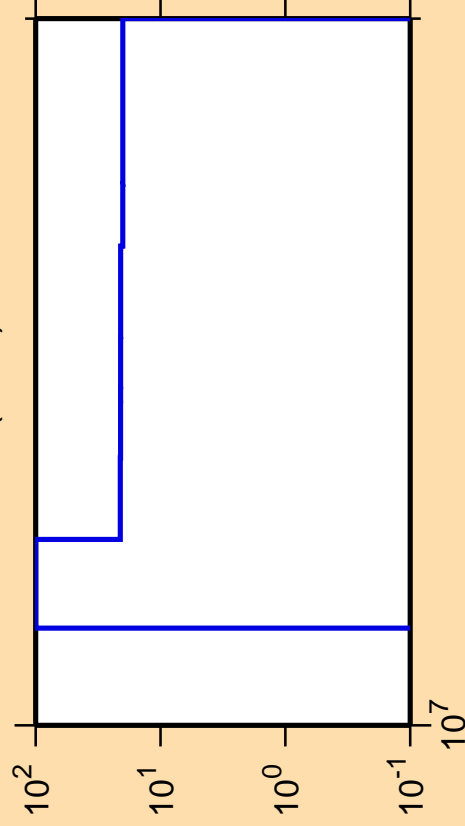


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

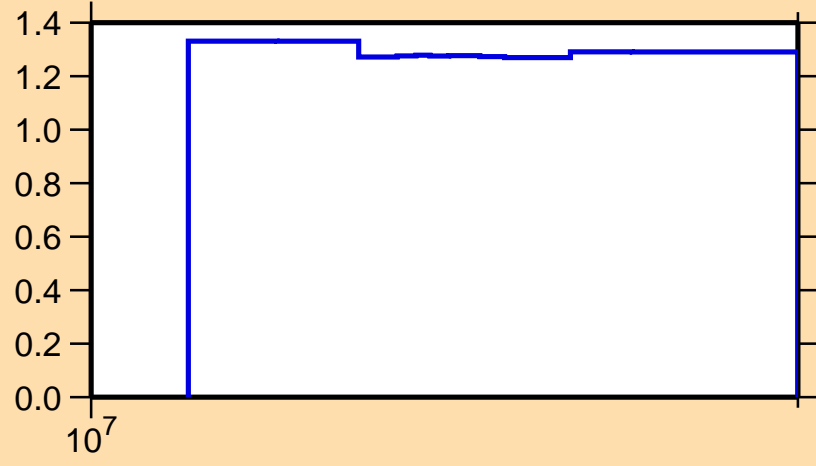



Correlation Matrix



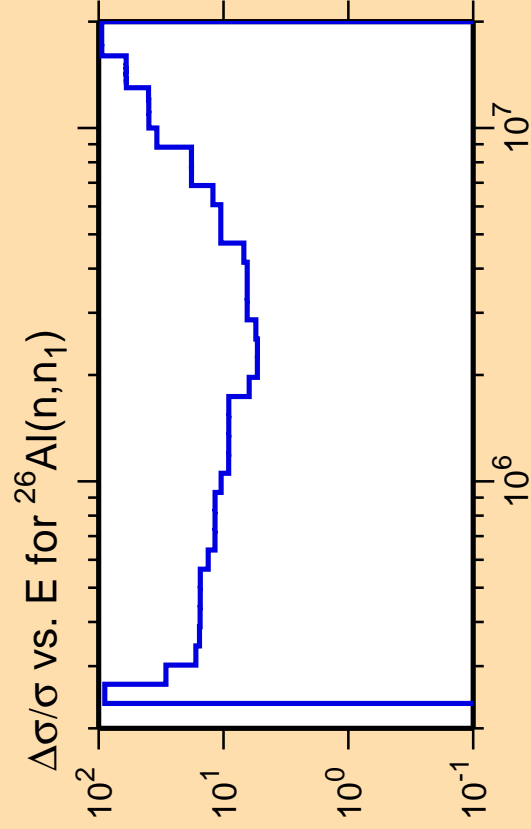

Ordinate scale is %
relative standard deviation.


Abcissa scales are energy (eV).

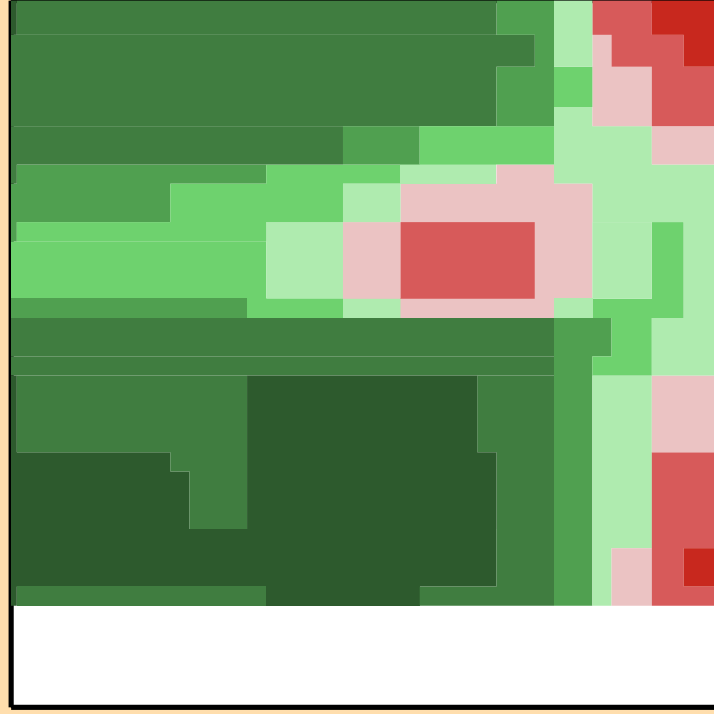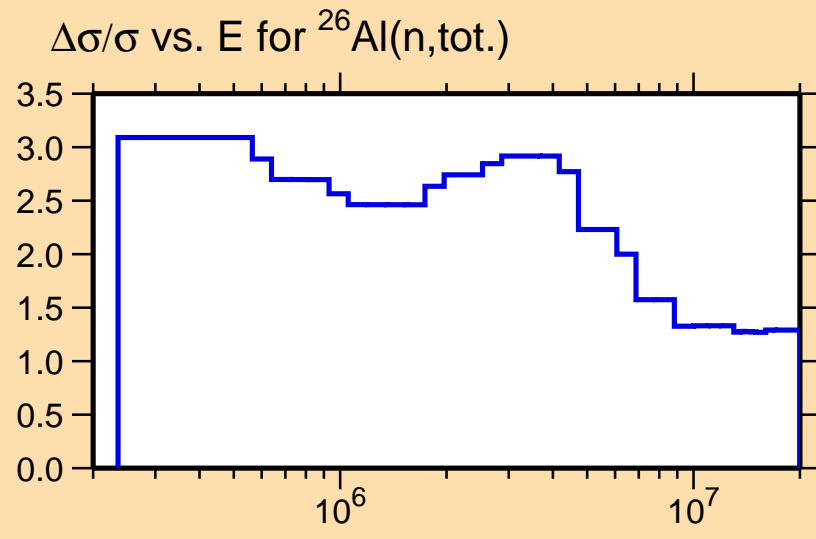

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

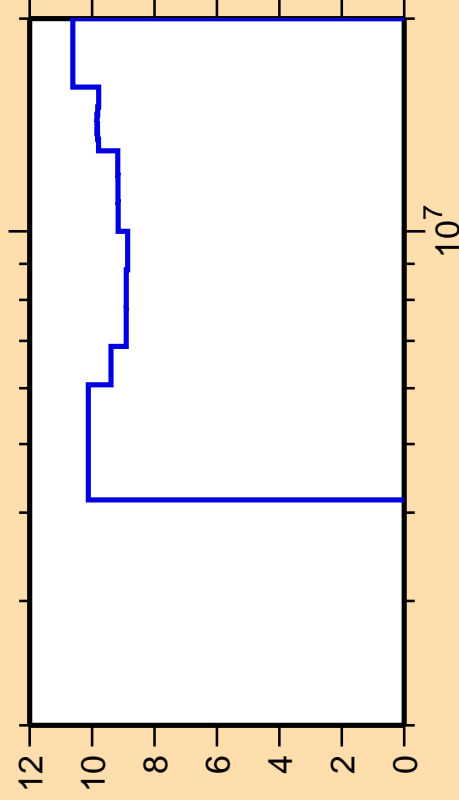

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

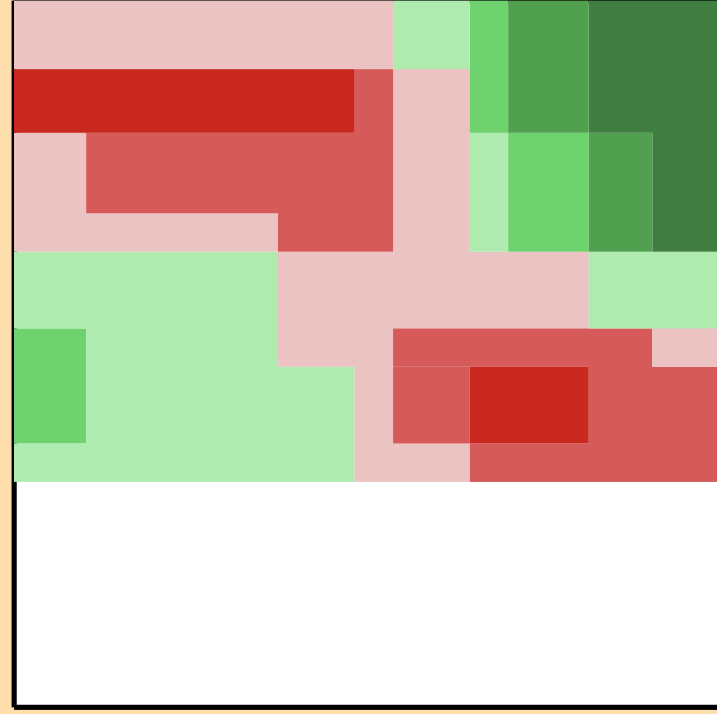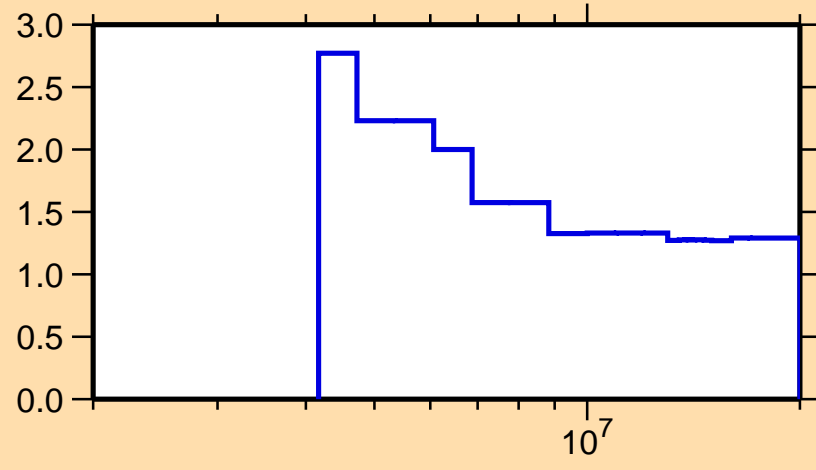



Correlation Matrix



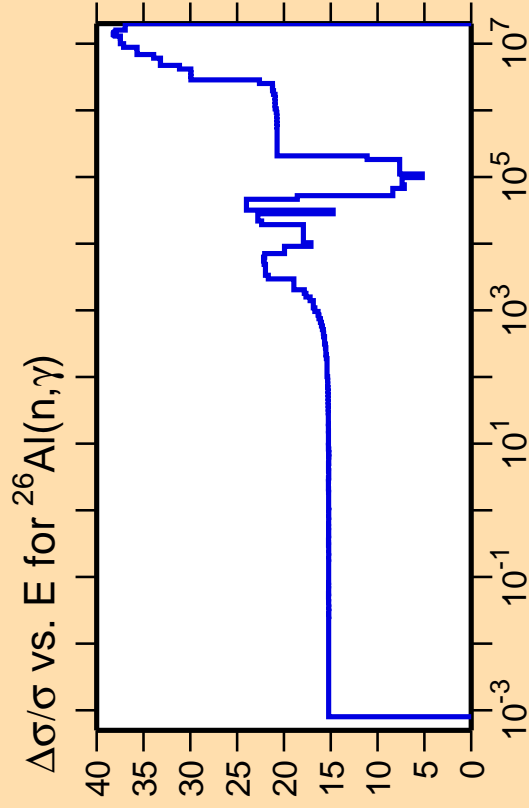


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

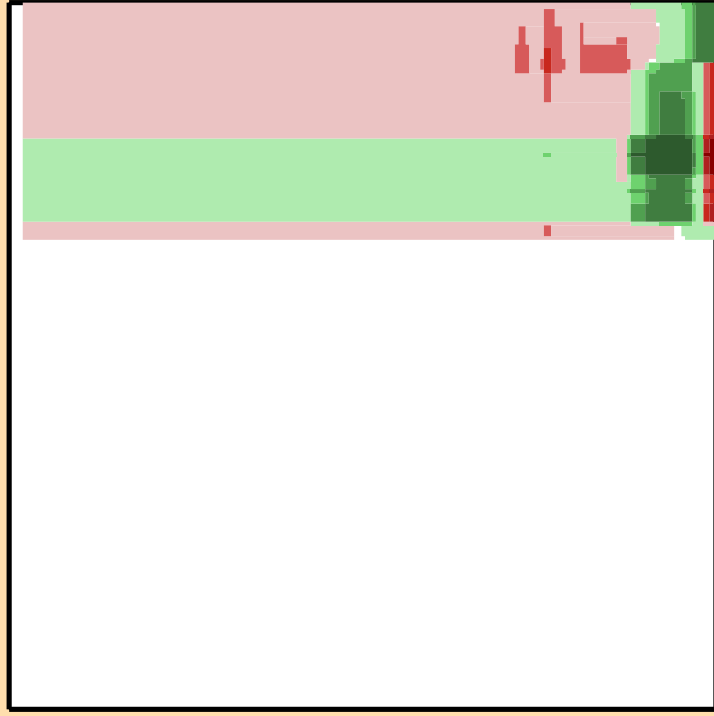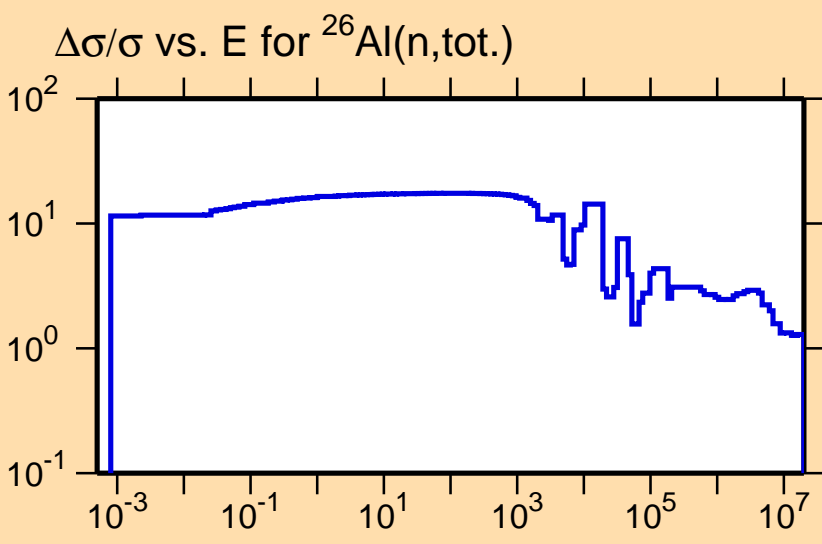

Correlation Matrix




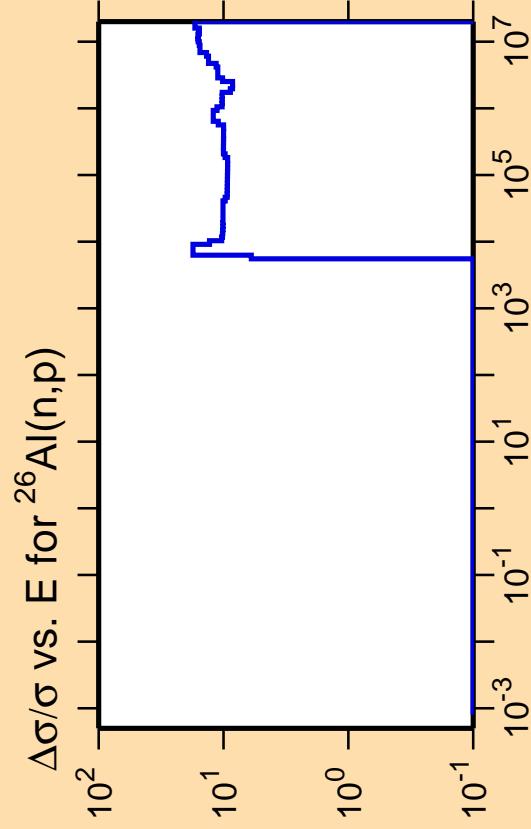


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

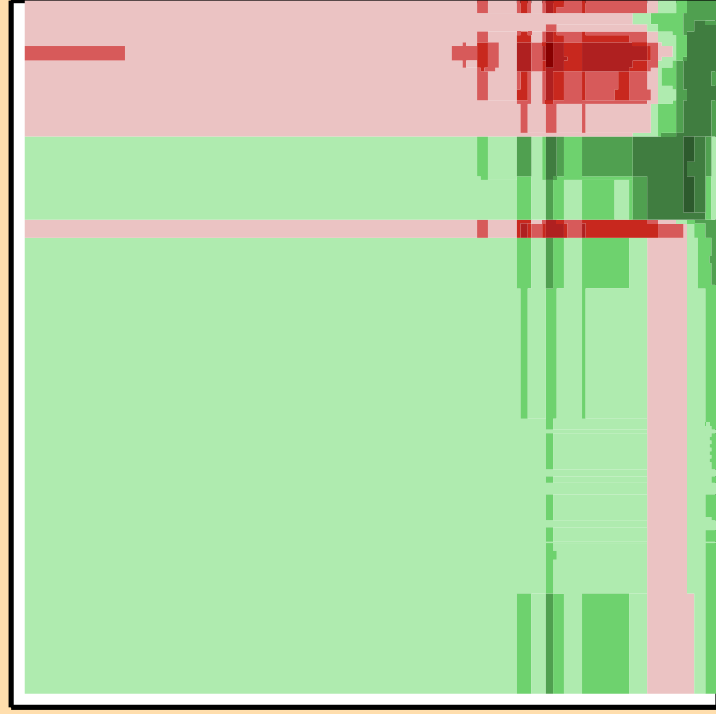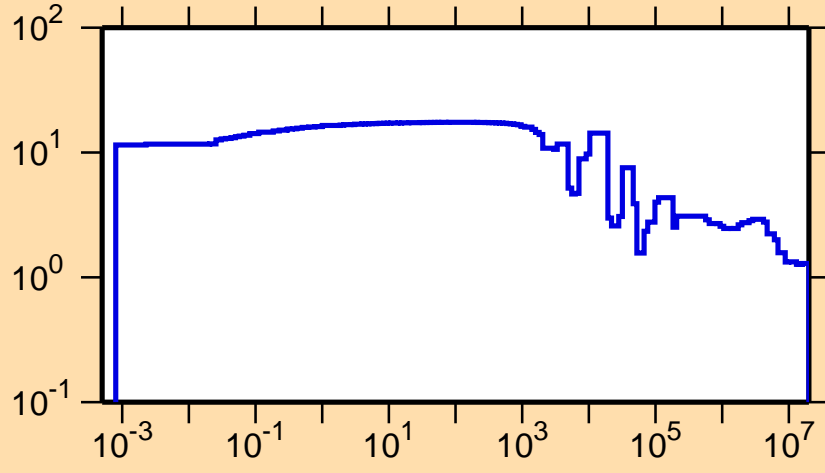

Correlation Matrix




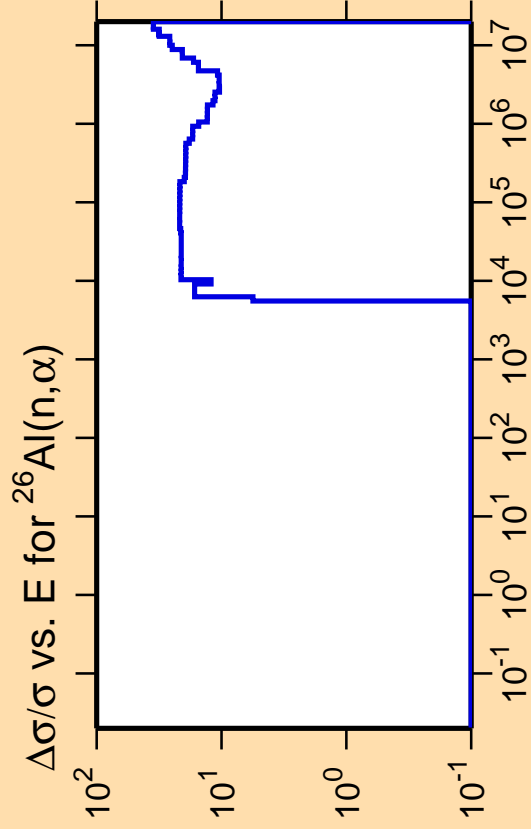


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{tot.})$

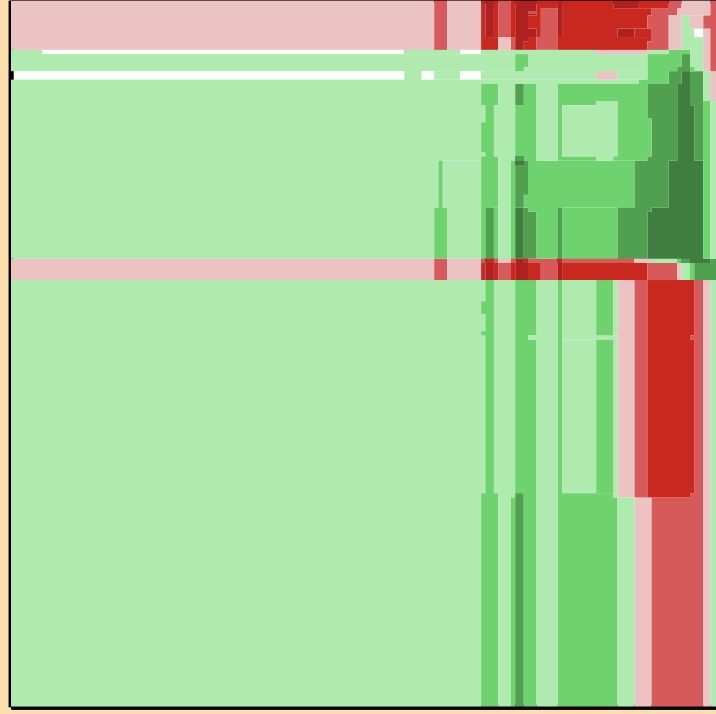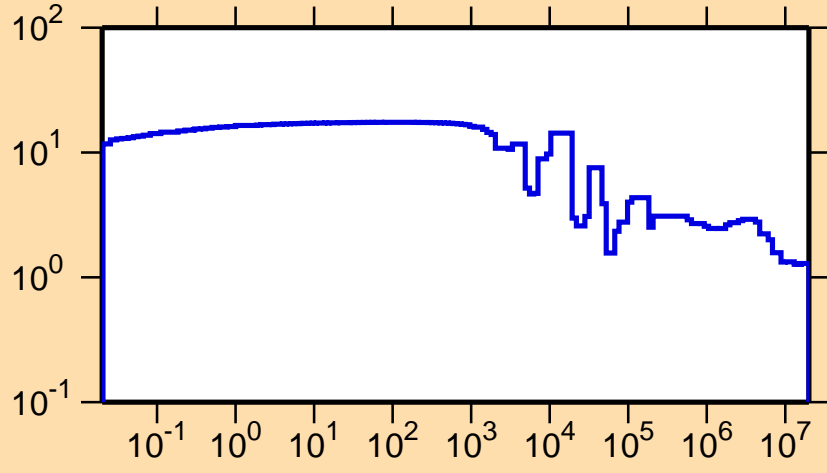

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

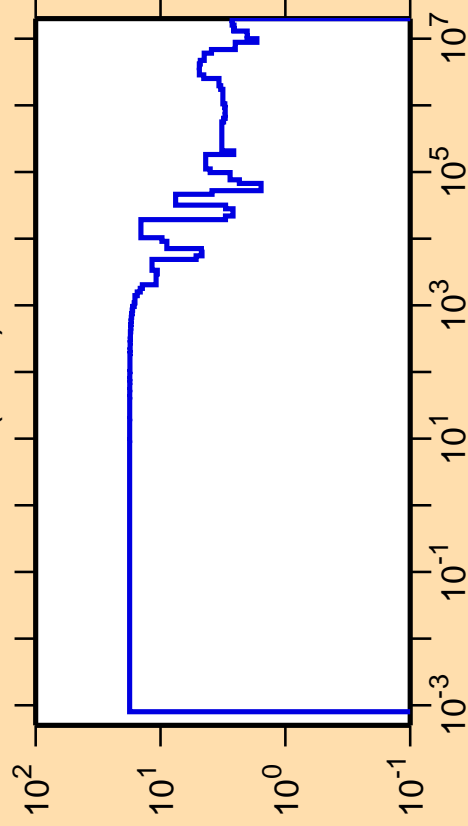

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,\text{el.})$

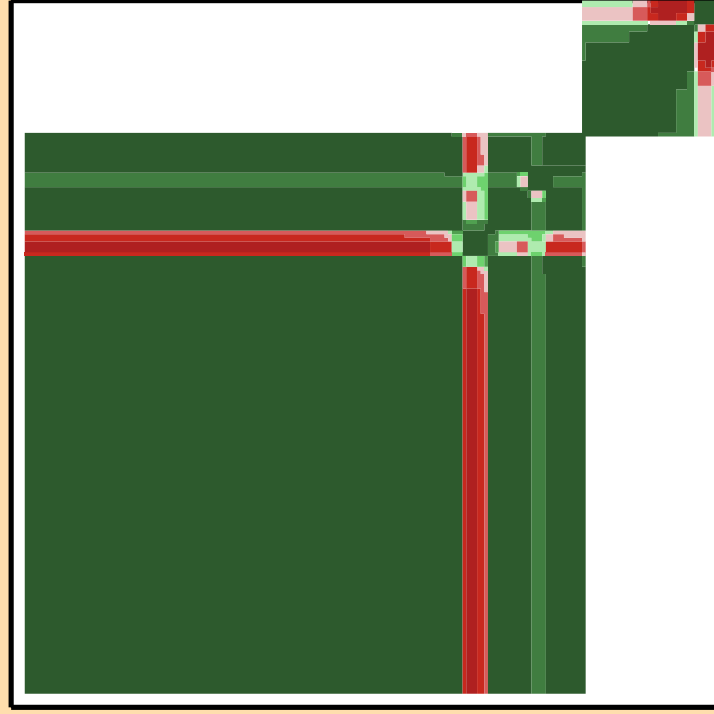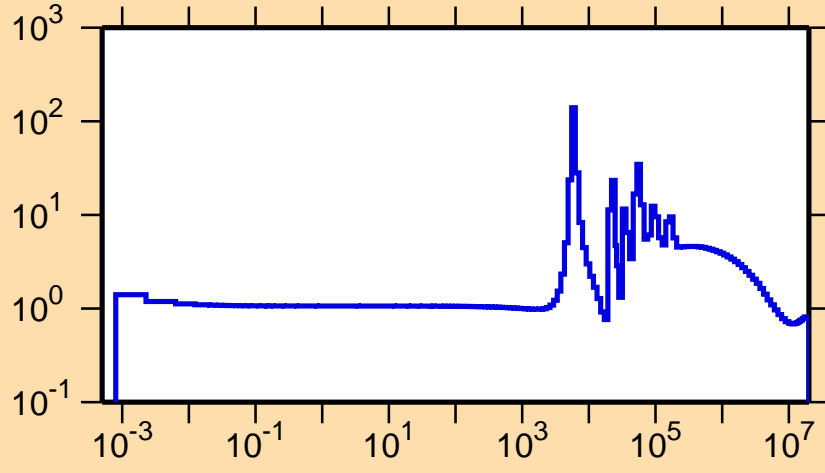

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$


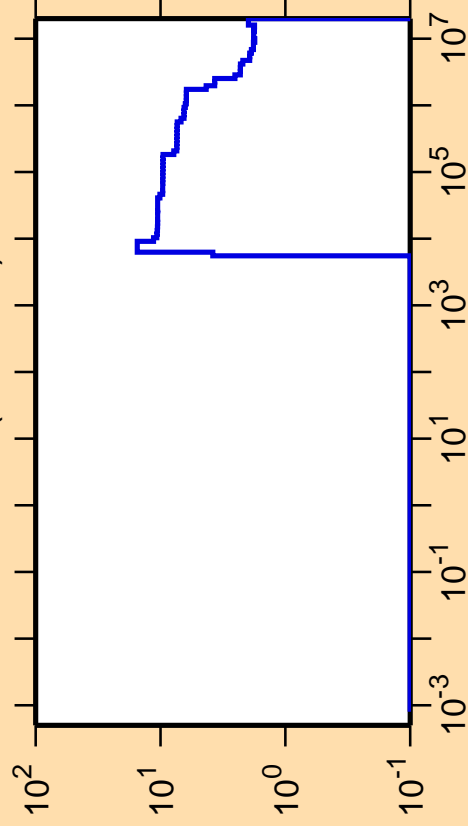


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

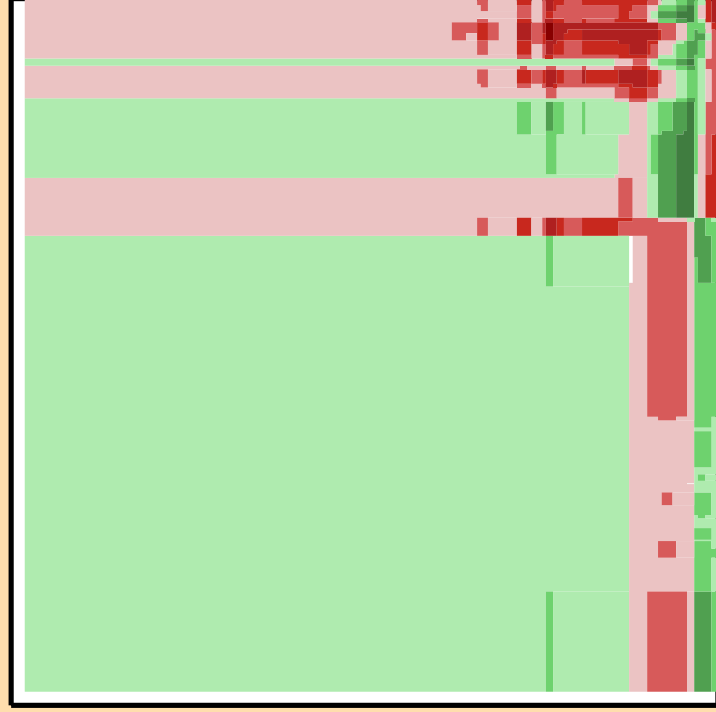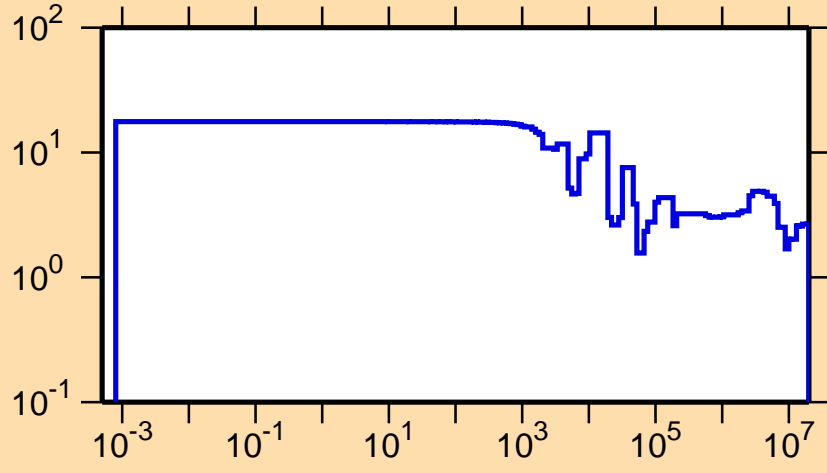

Correlation Matrix




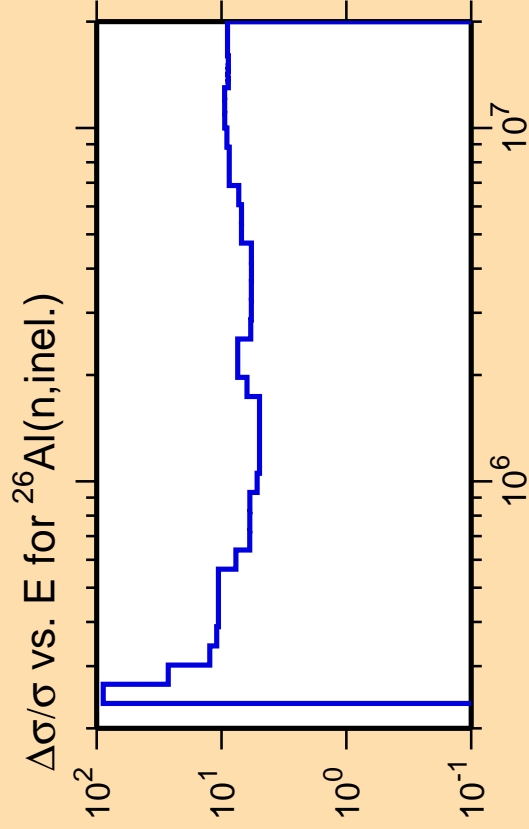

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

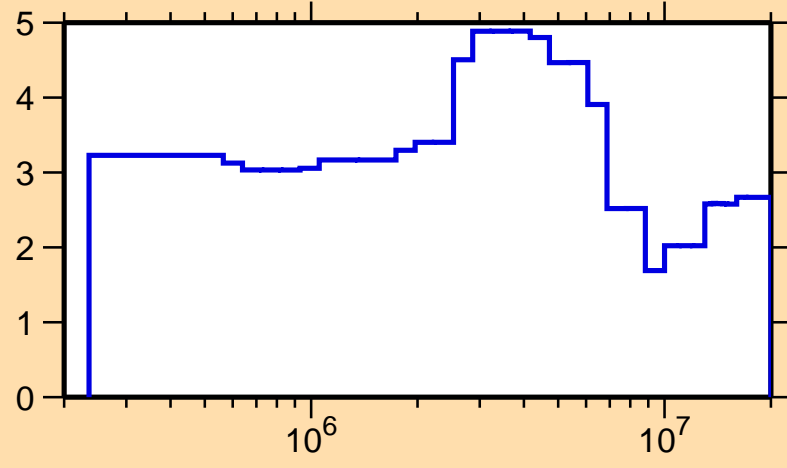

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$


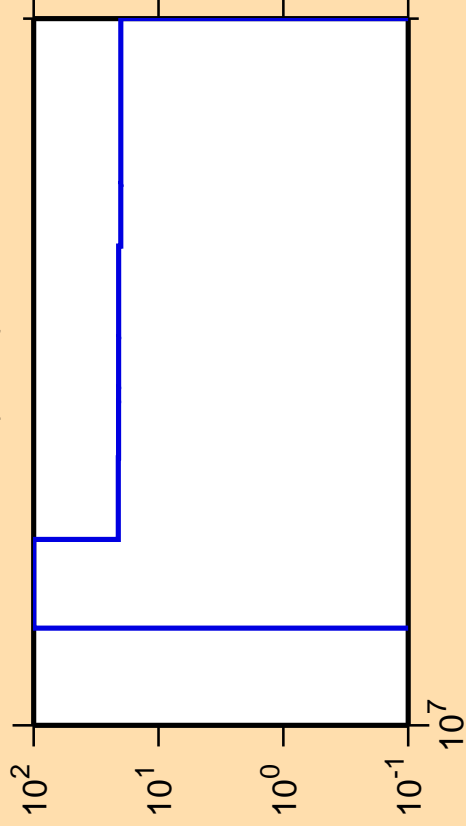


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

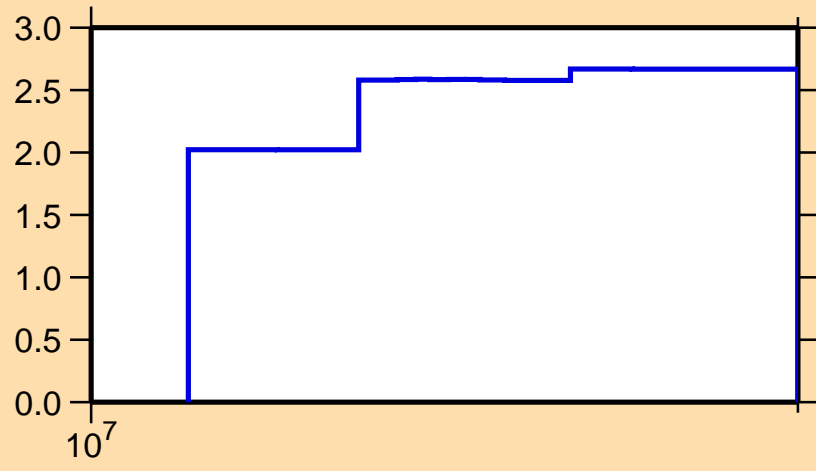

Correlation Matrix





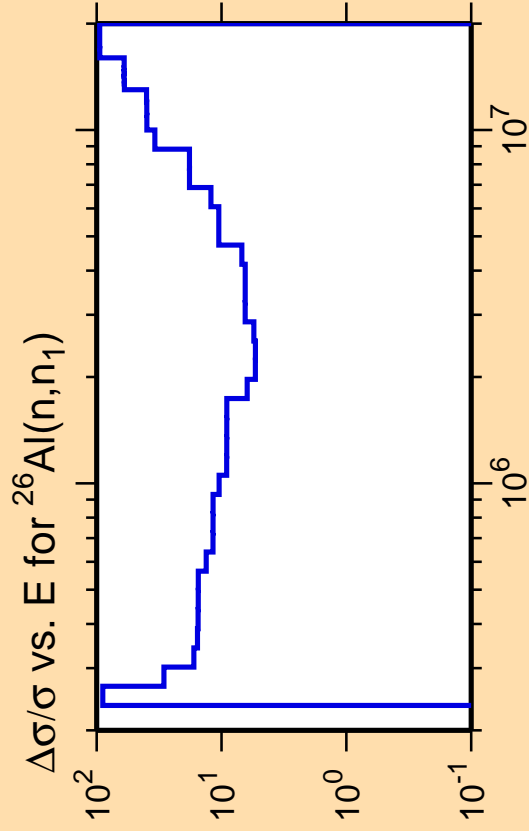

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

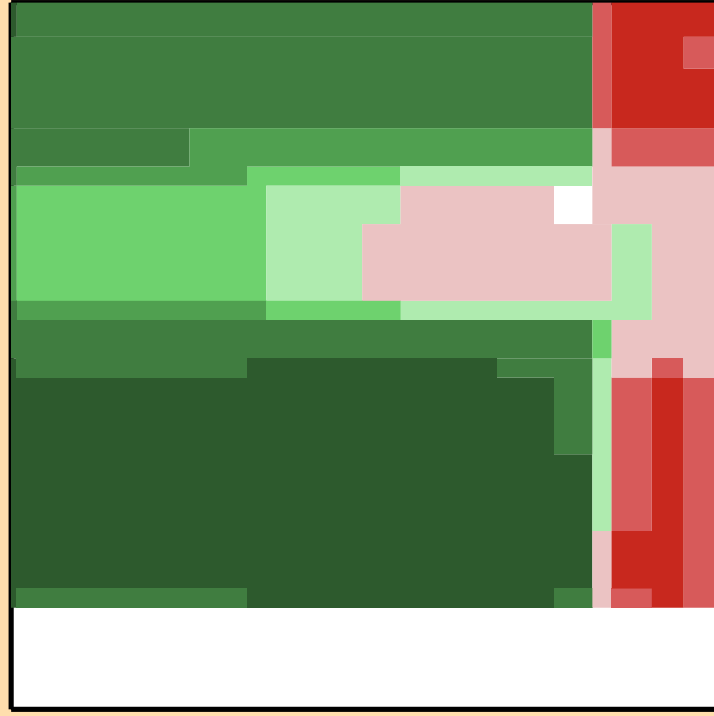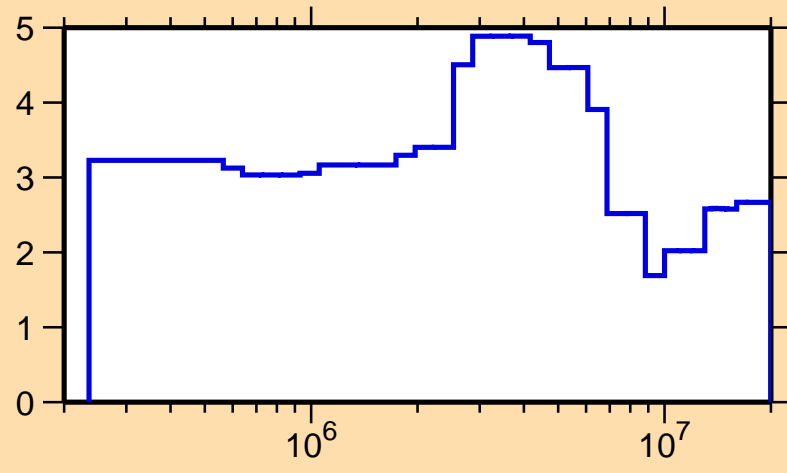

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

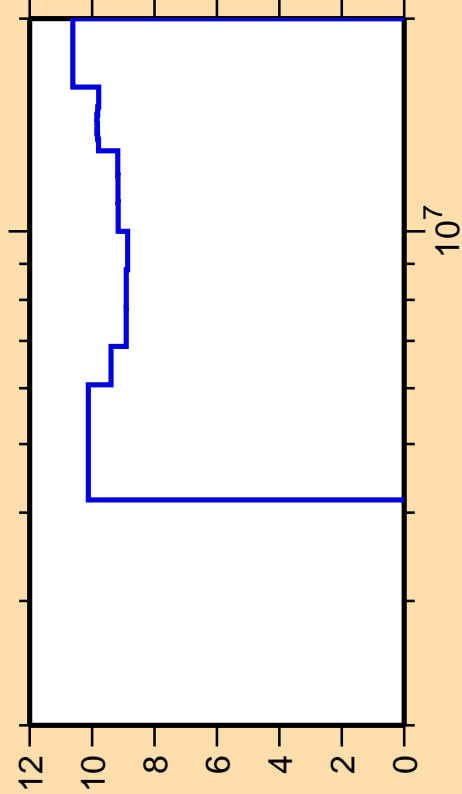


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

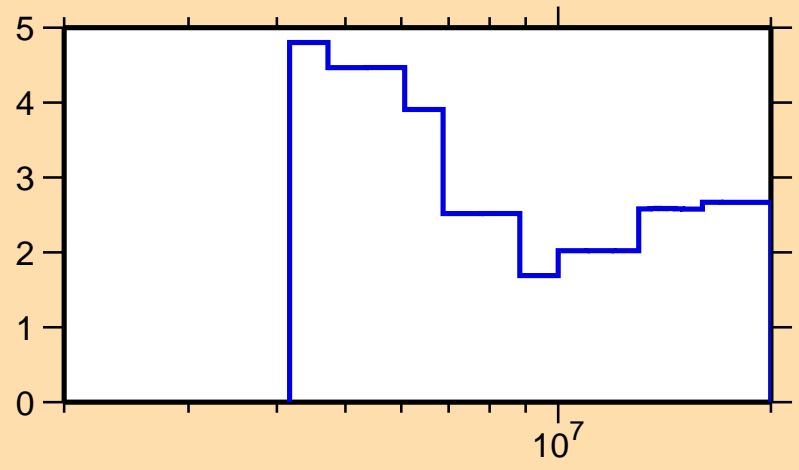

Correlation Matrix

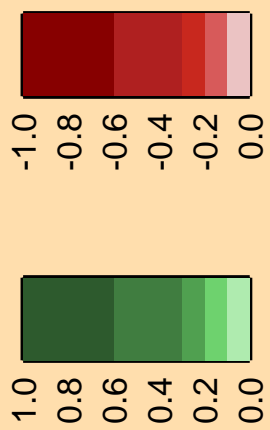



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\gamma)$

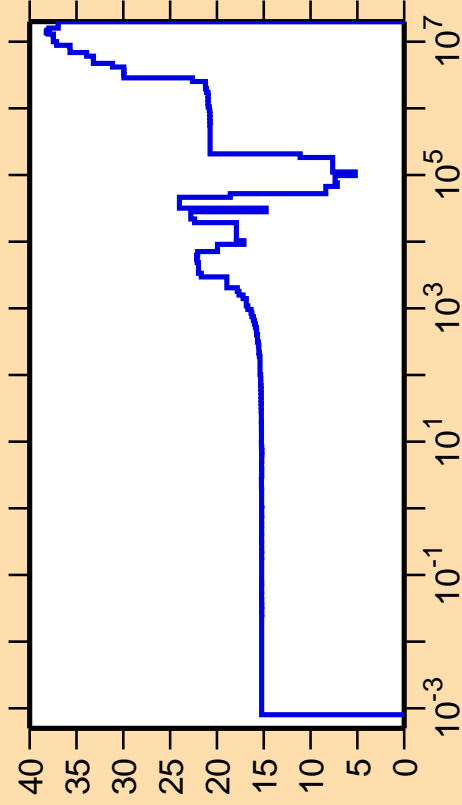

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

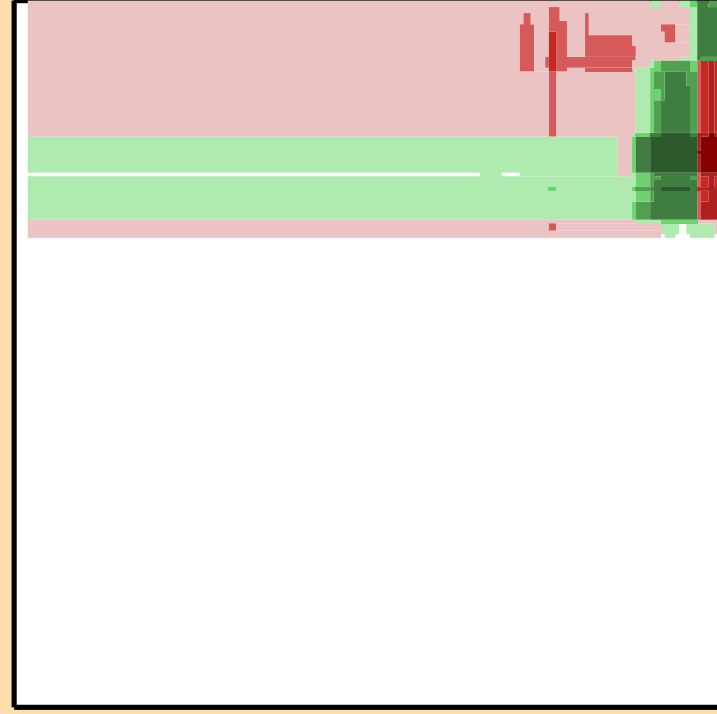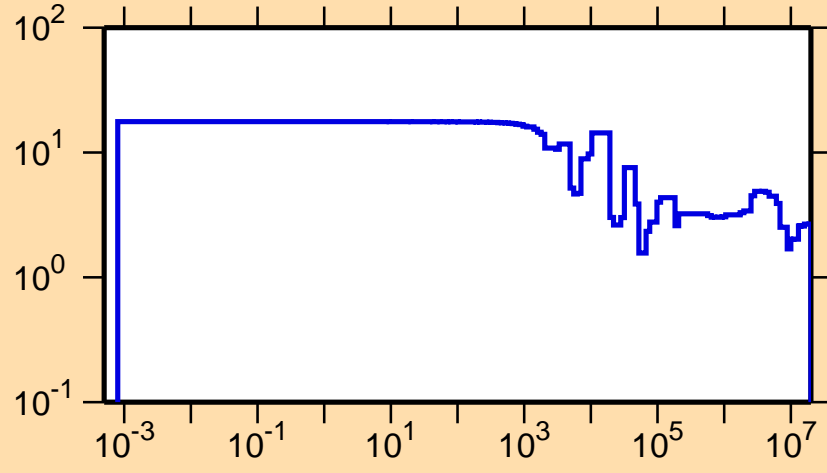

Correlation Matrix




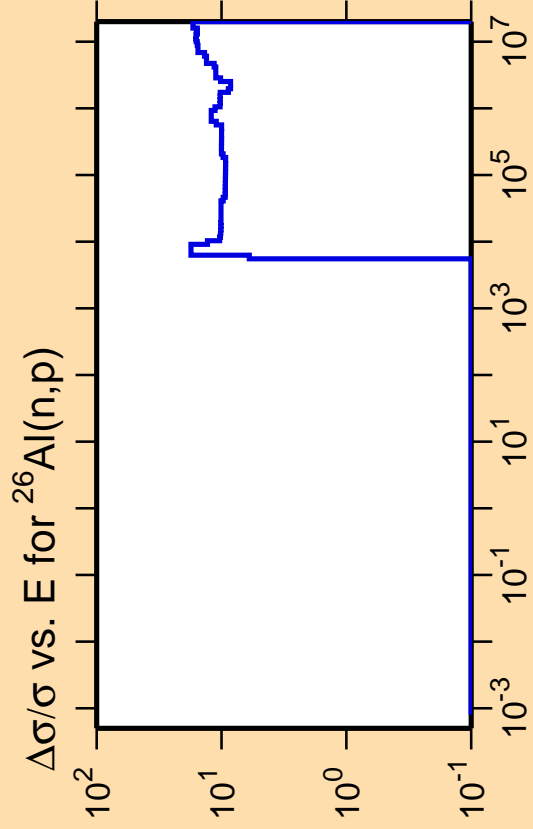


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{el.})$

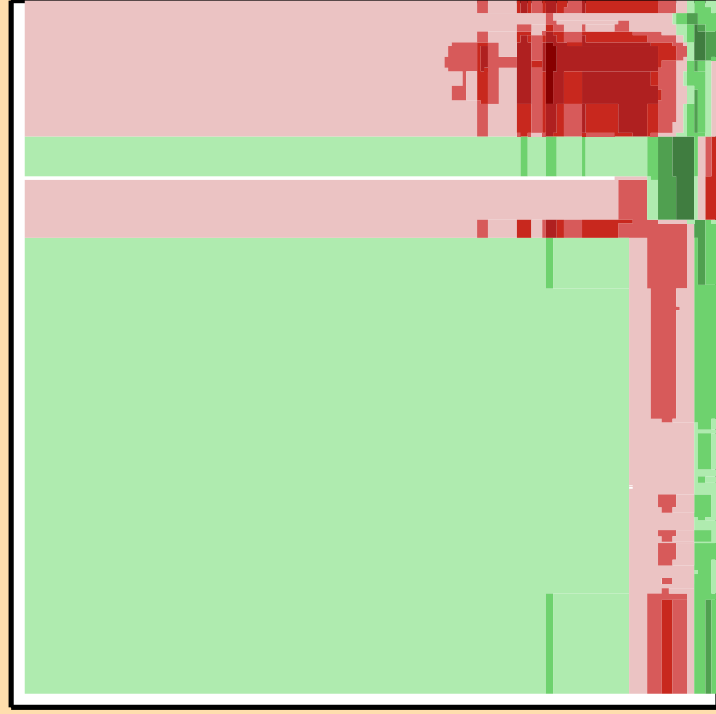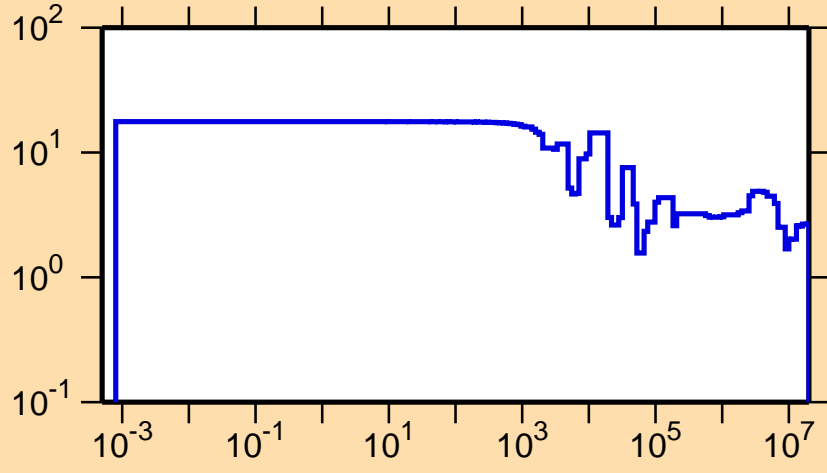

Correlation Matrix





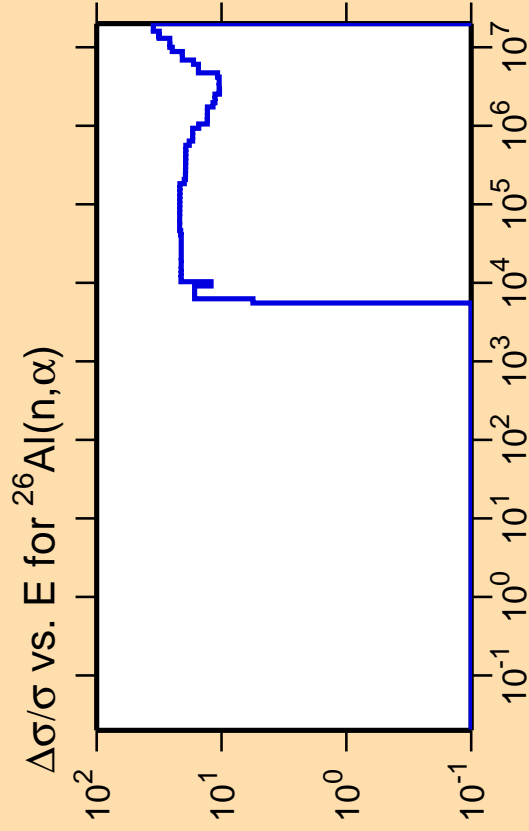

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

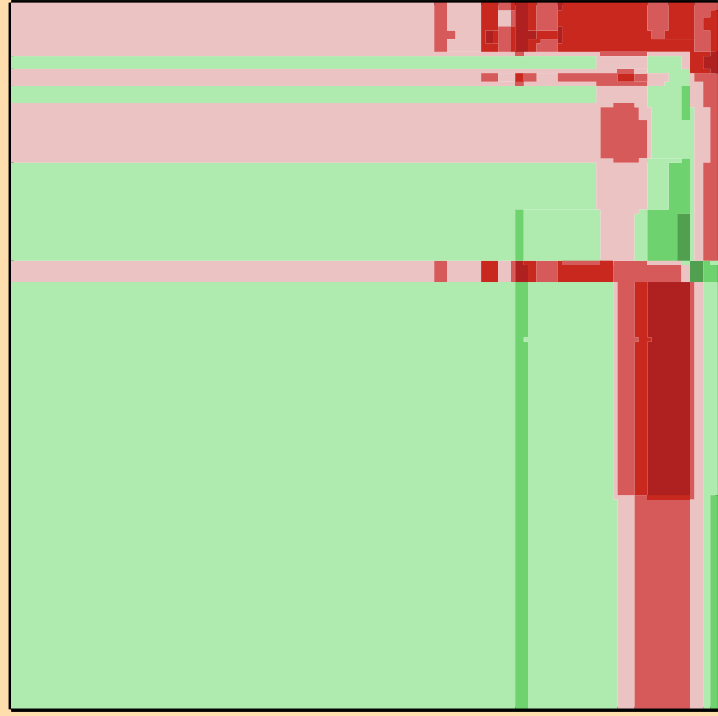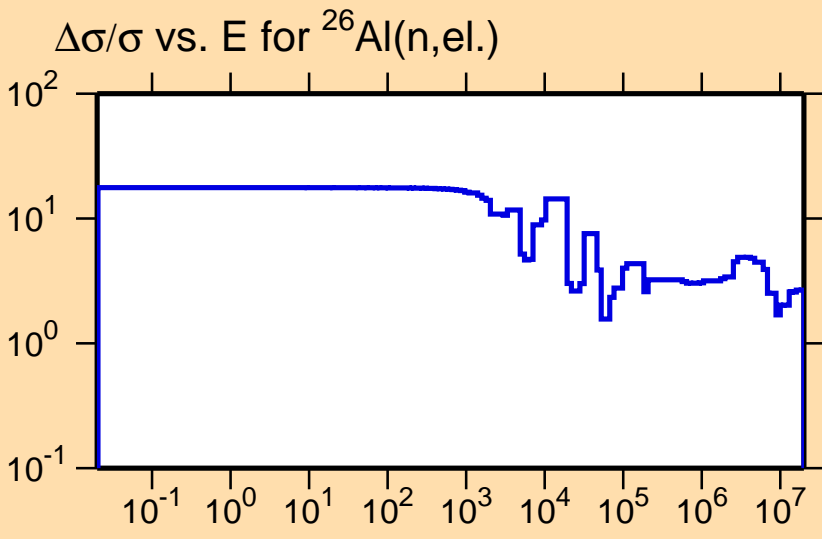

Correlation Matrix





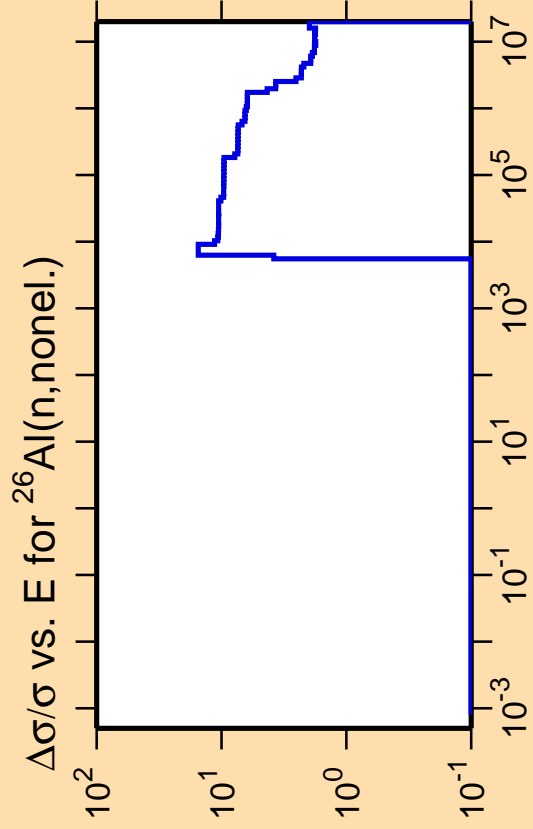

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

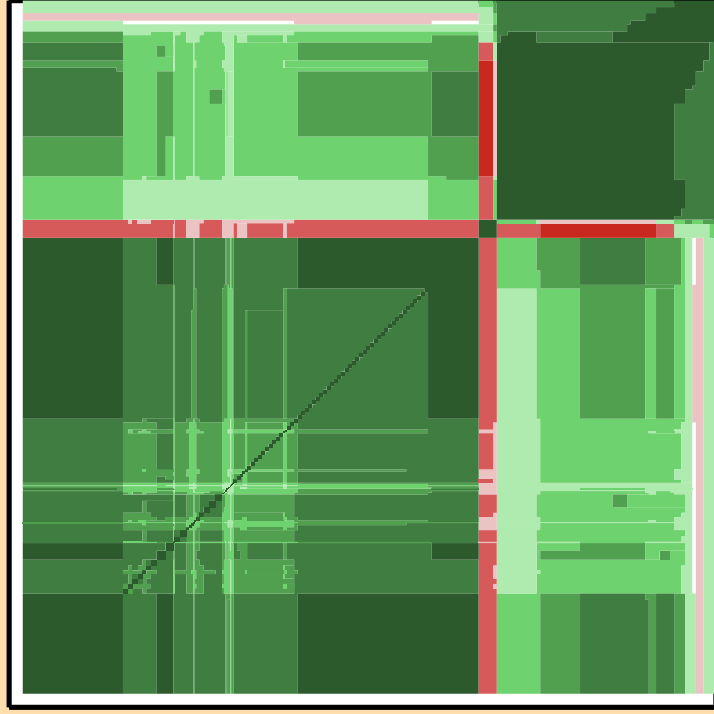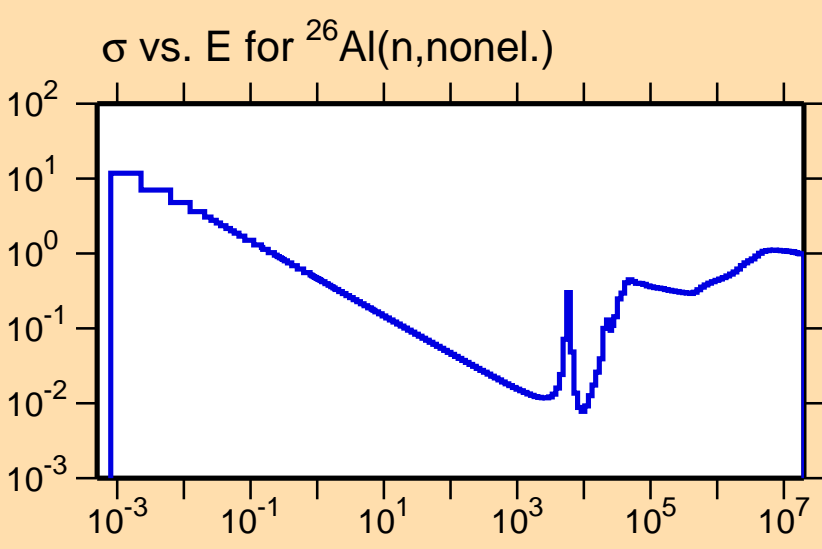

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{inel.})$

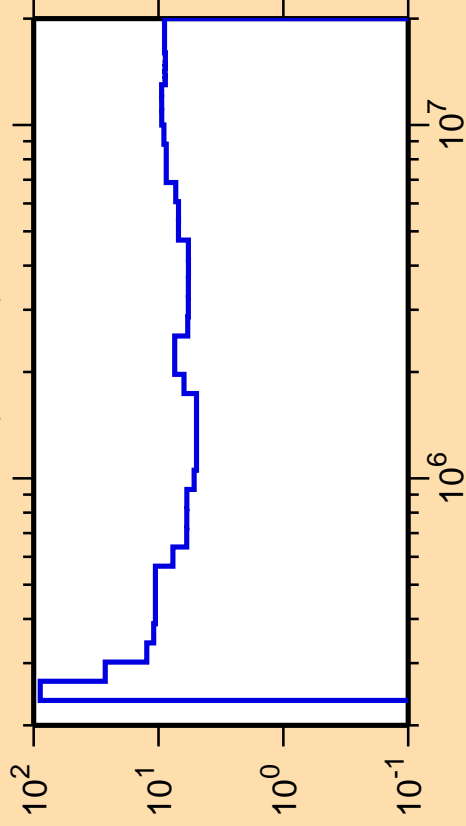

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

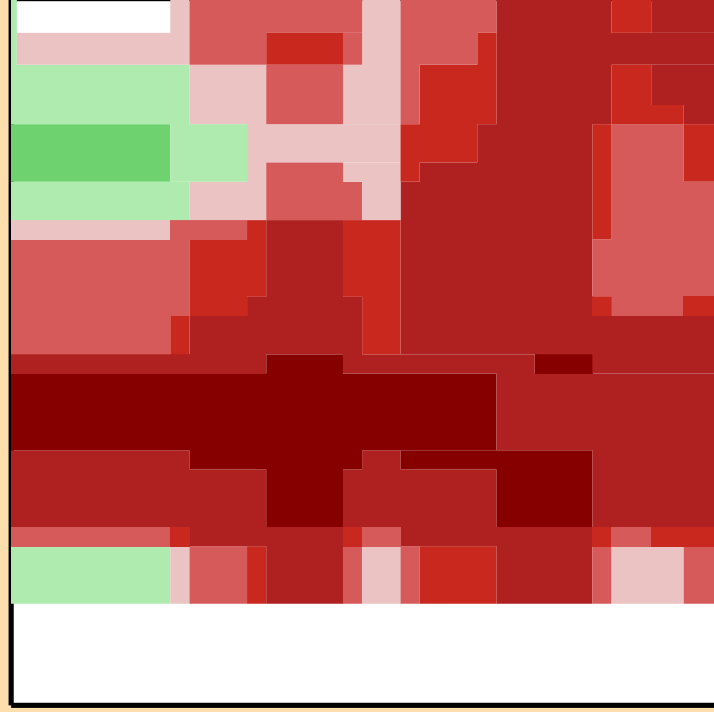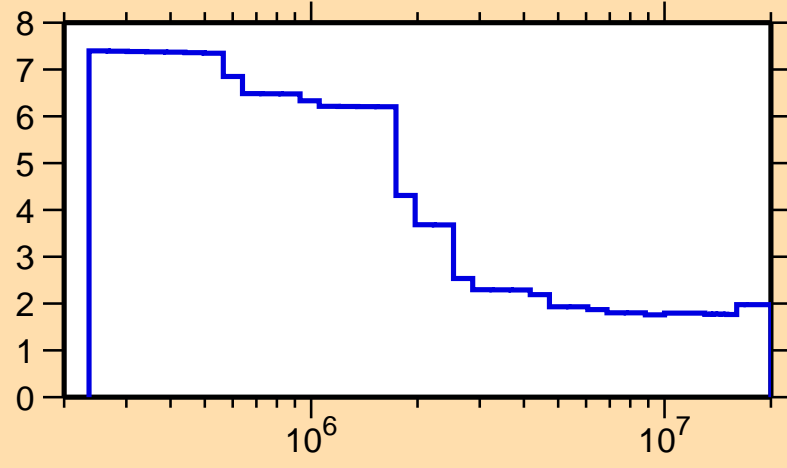

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$


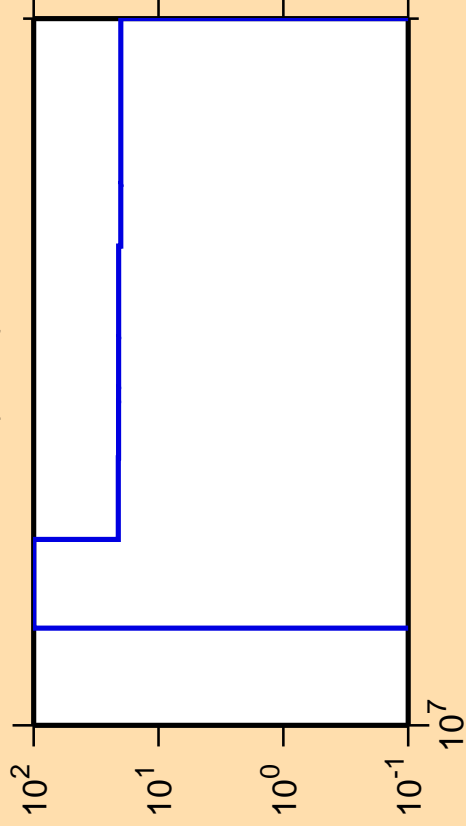


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

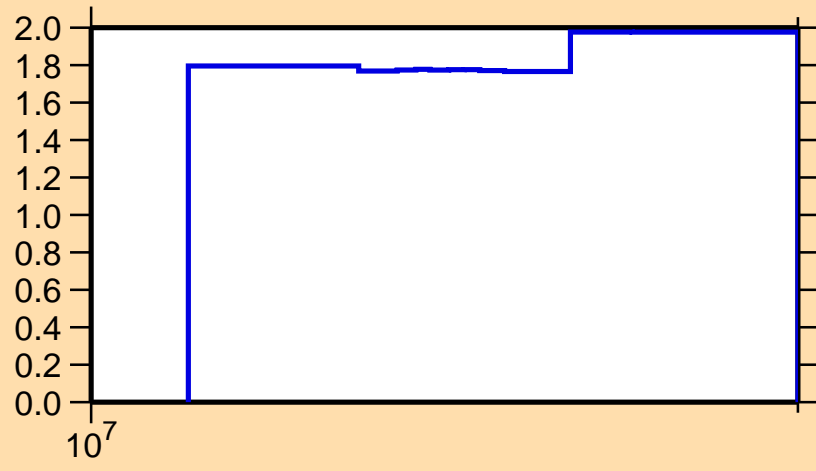

Correlation Matrix





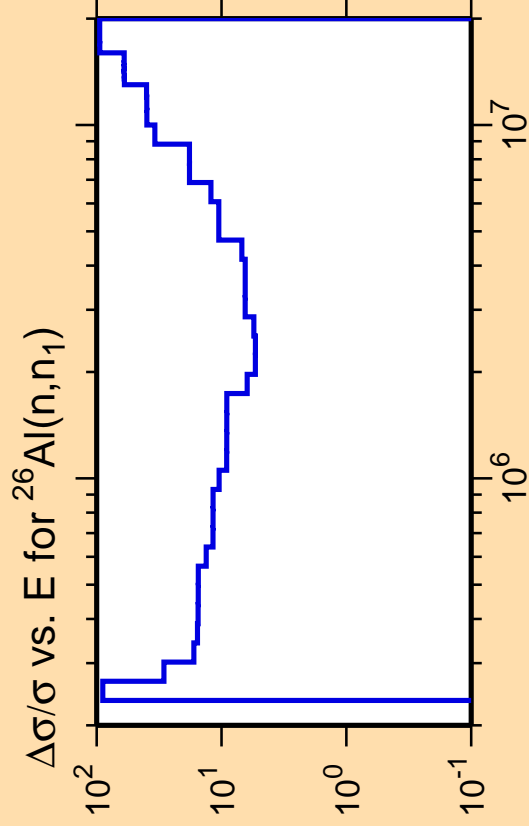

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

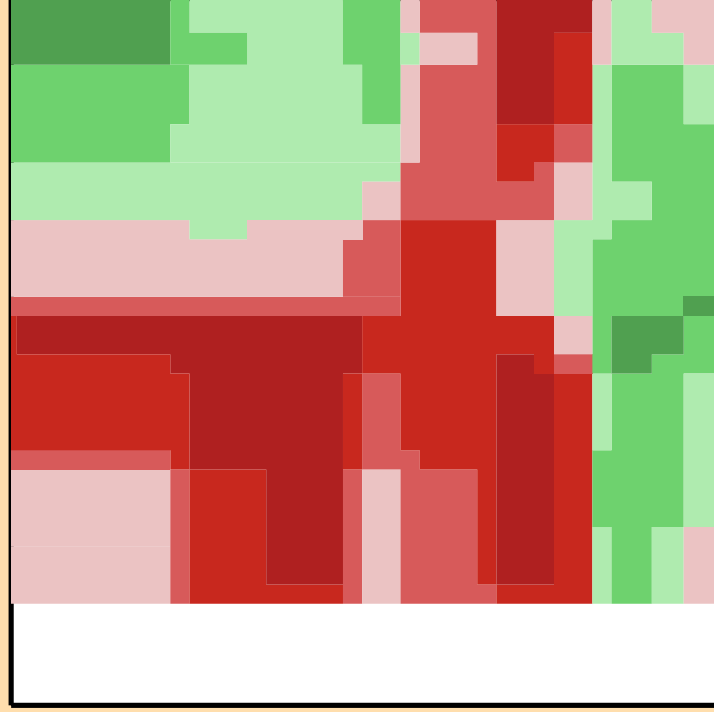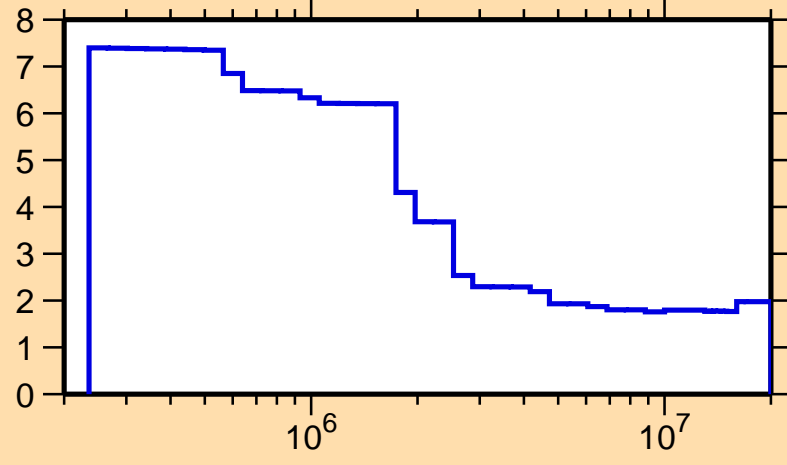

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

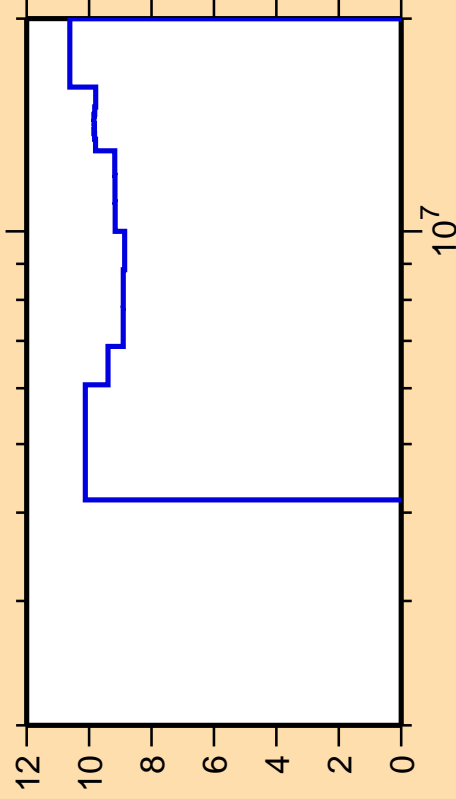

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

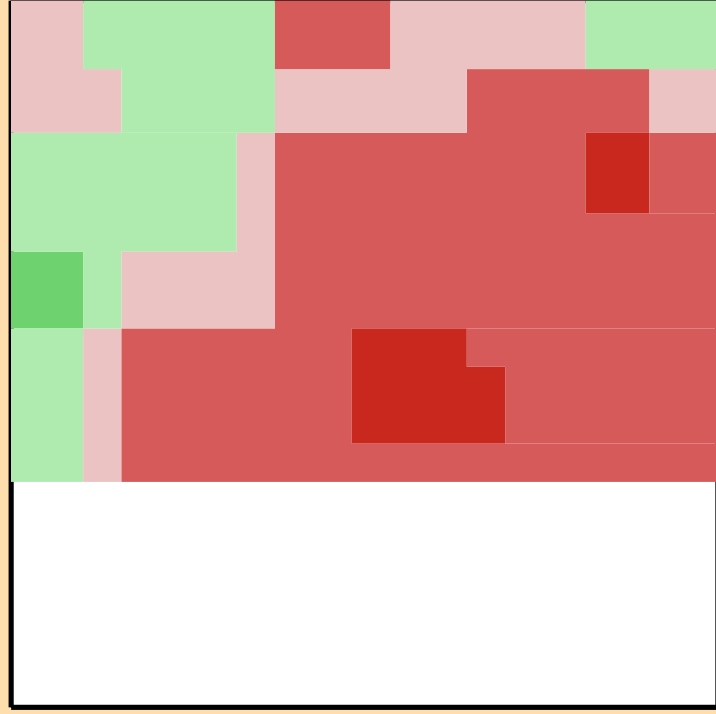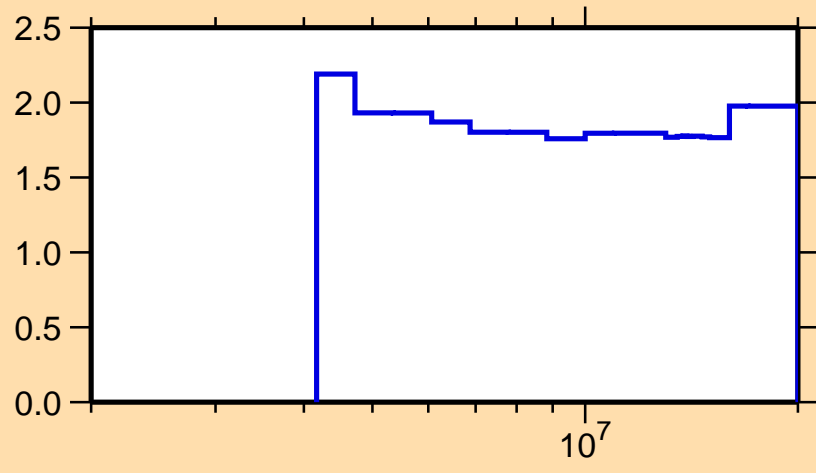

Correlation Matrix




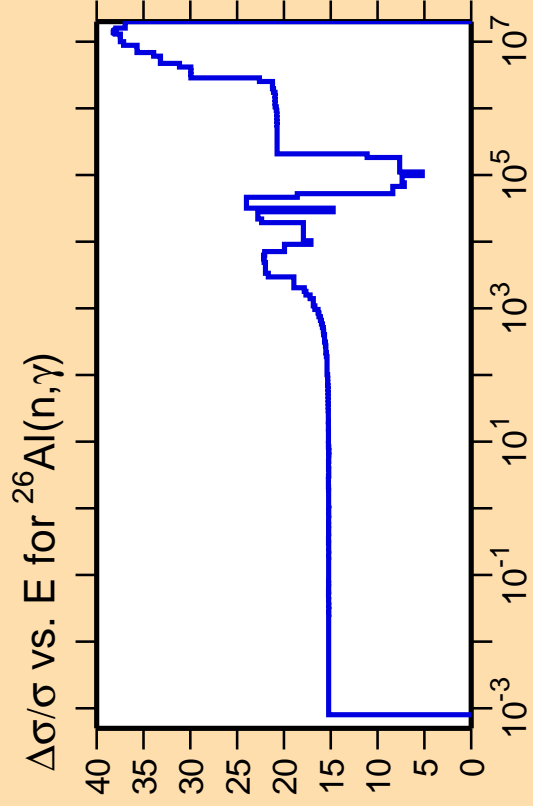


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

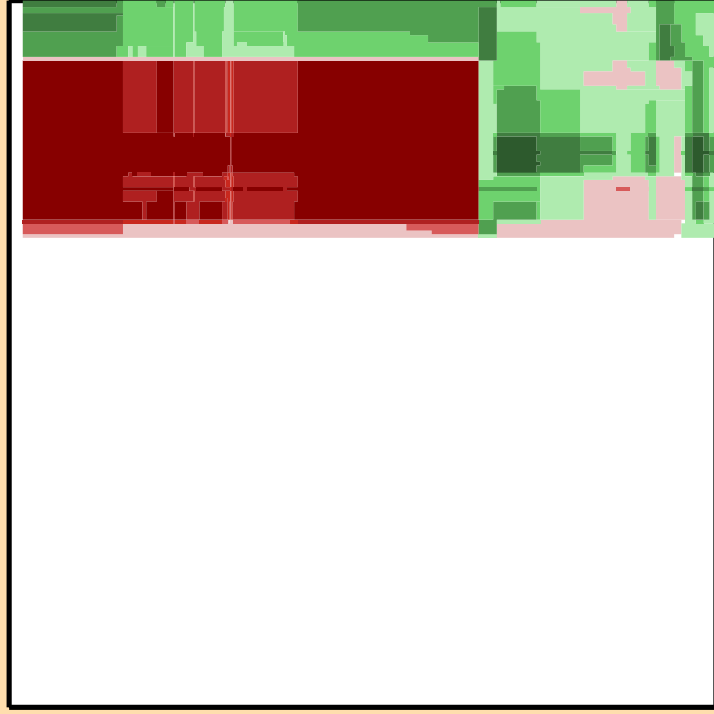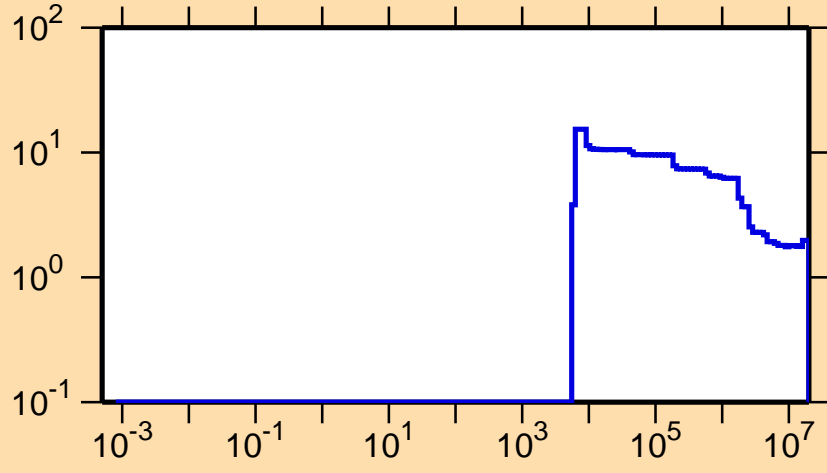

Correlation Matrix




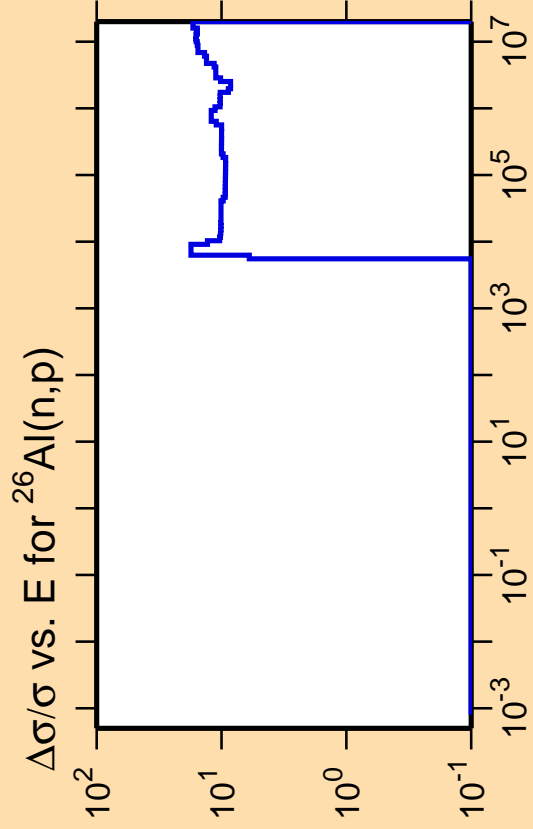


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

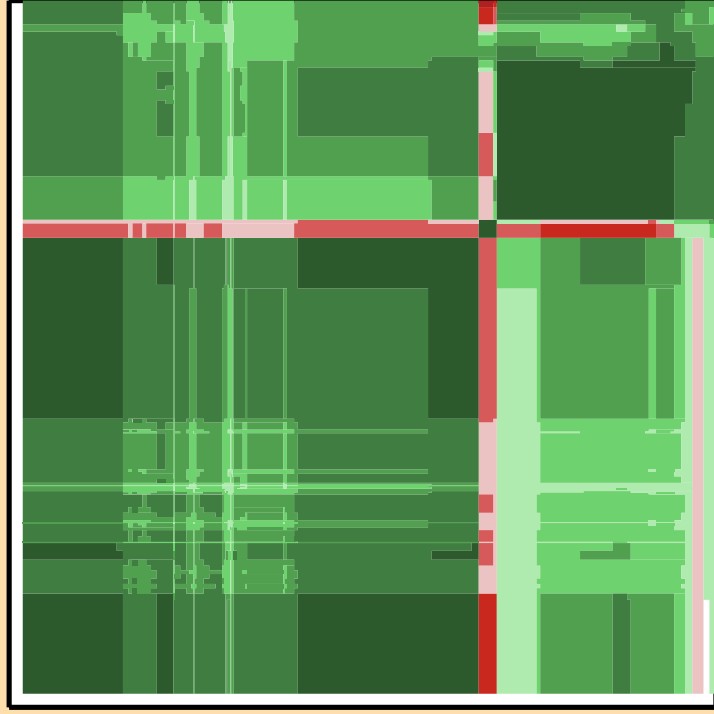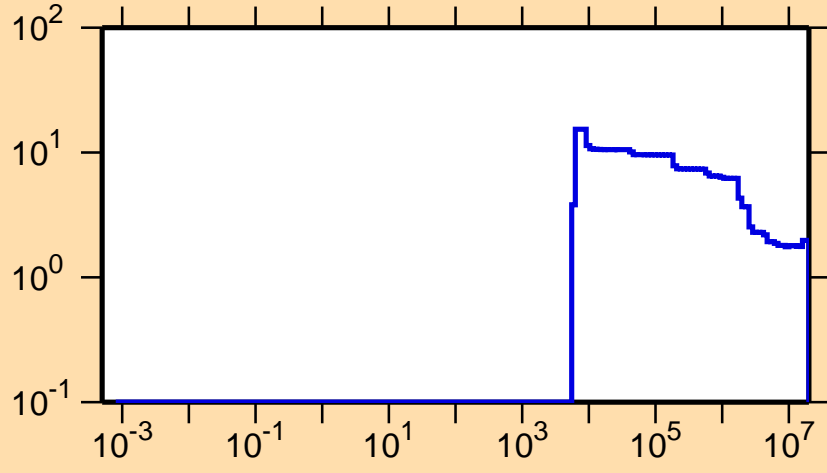

Correlation Matrix



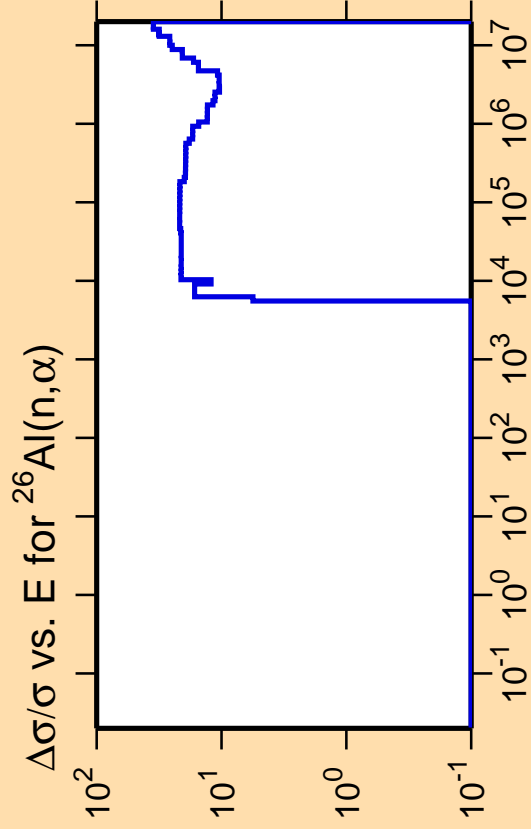


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nonel.})$

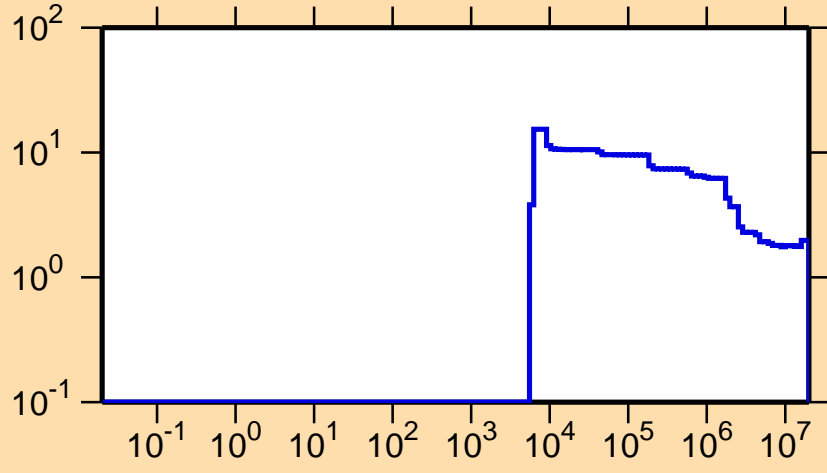

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{inel.})$

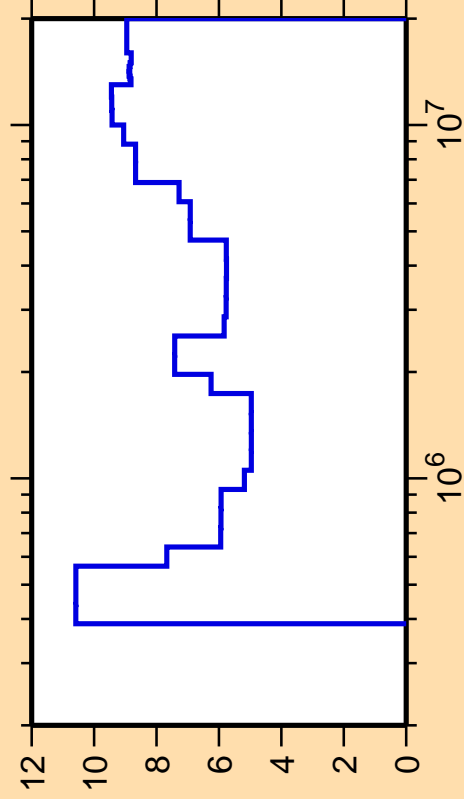

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,\text{inel.})$

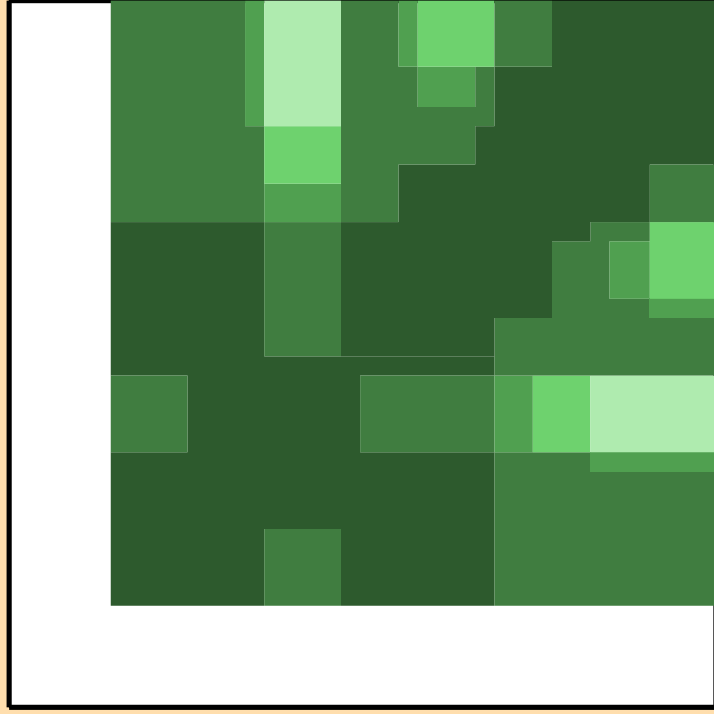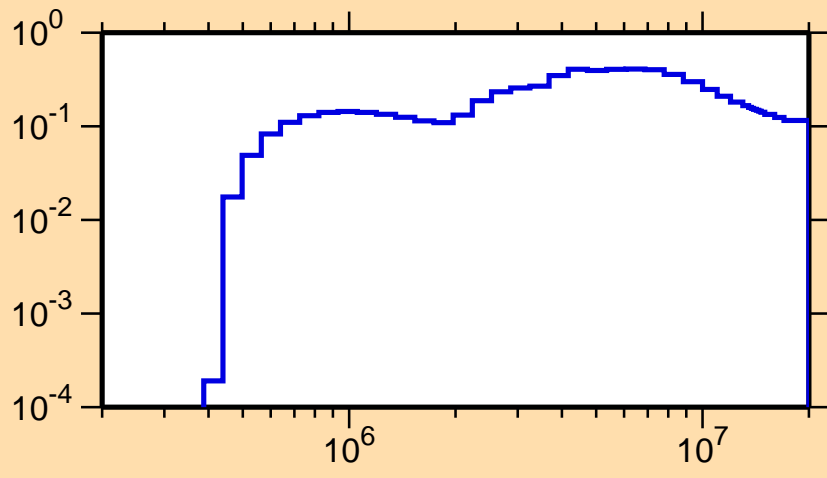

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_1)$


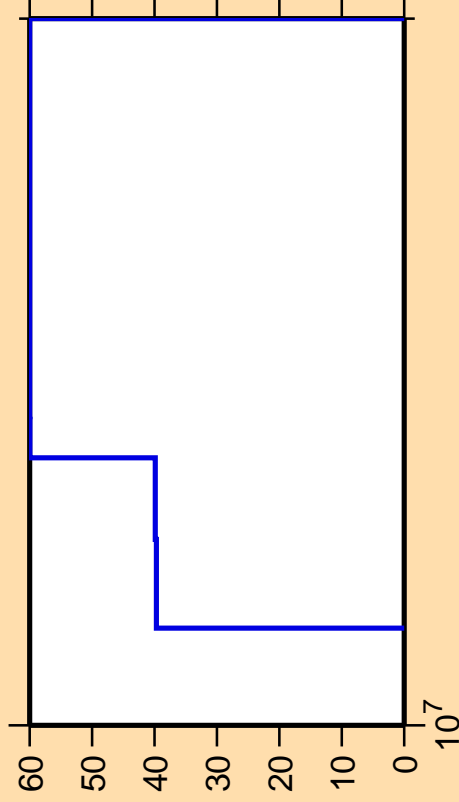


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

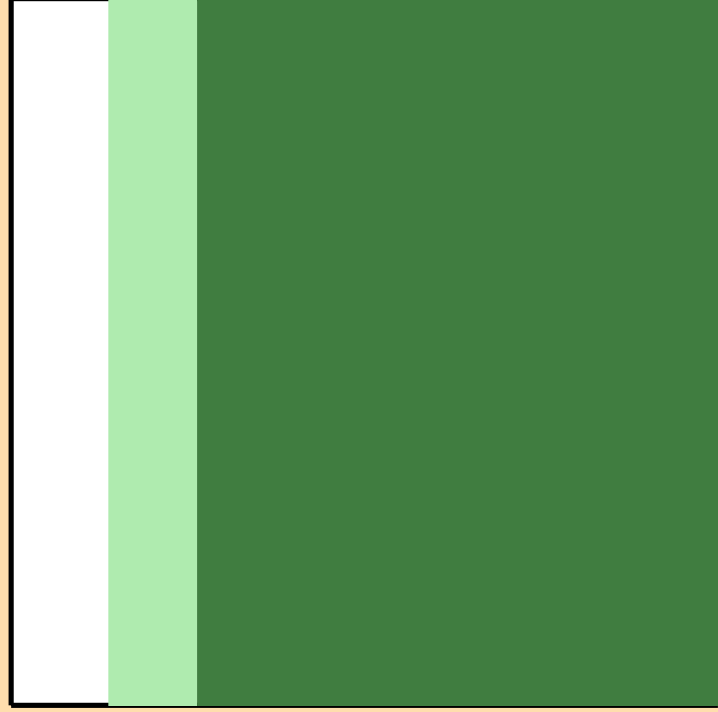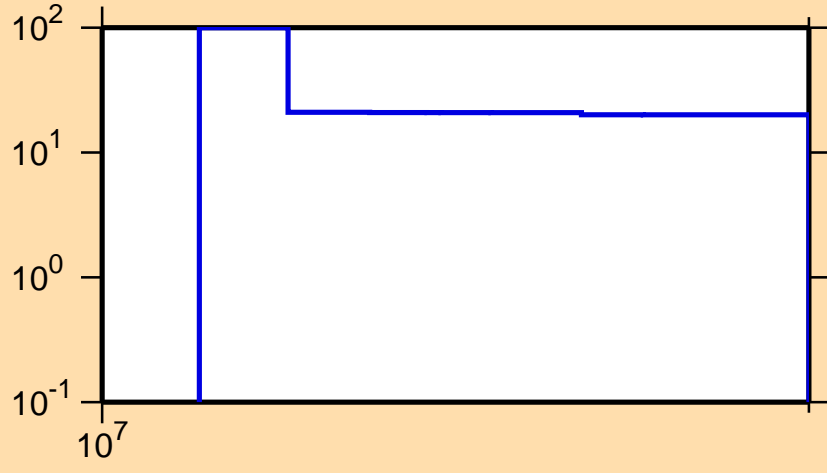

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$


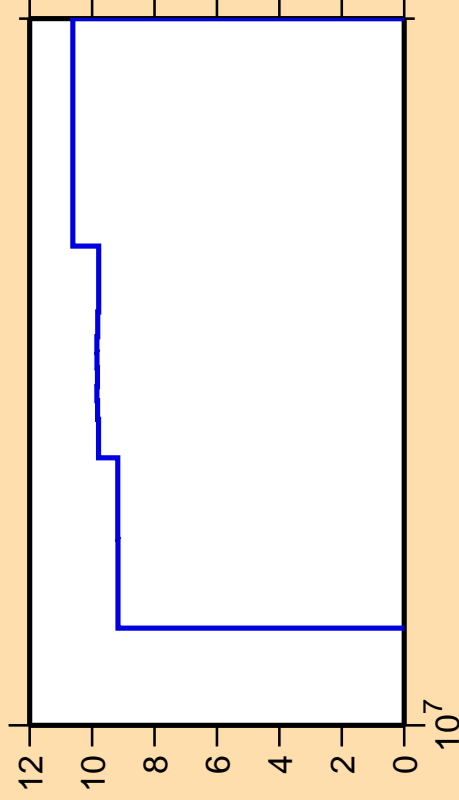


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

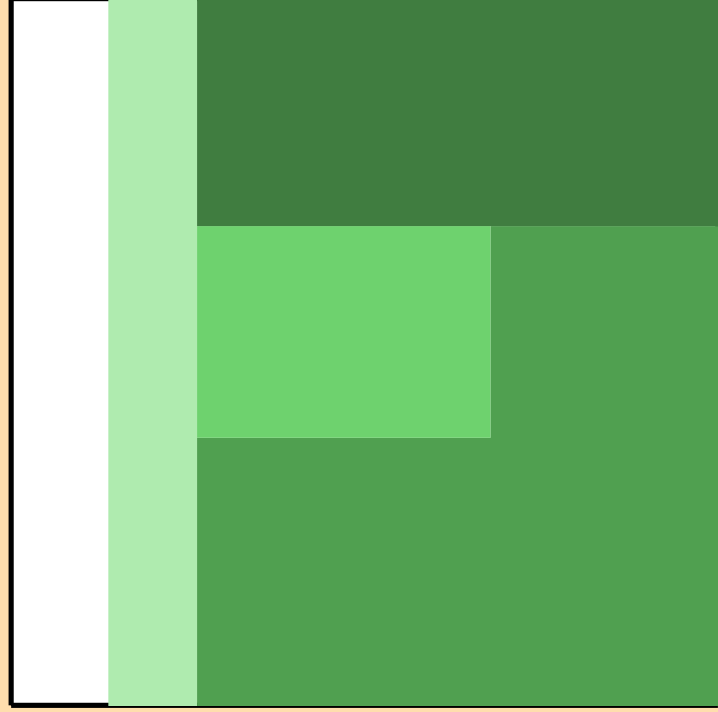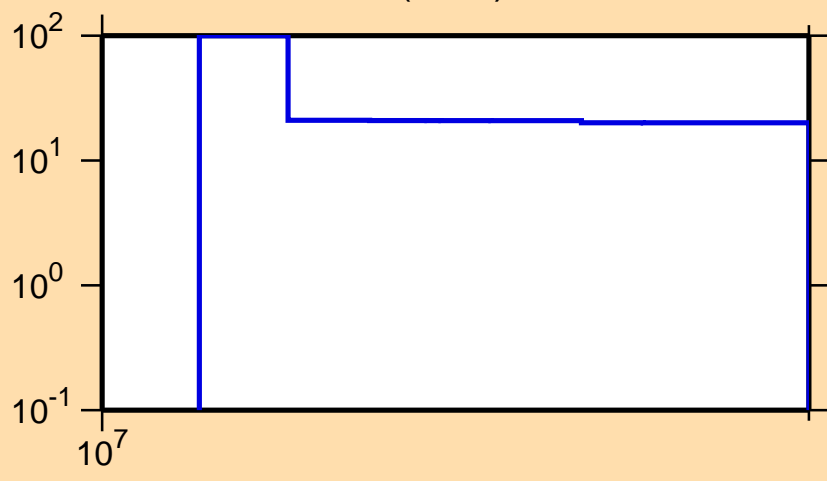

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\gamma)$


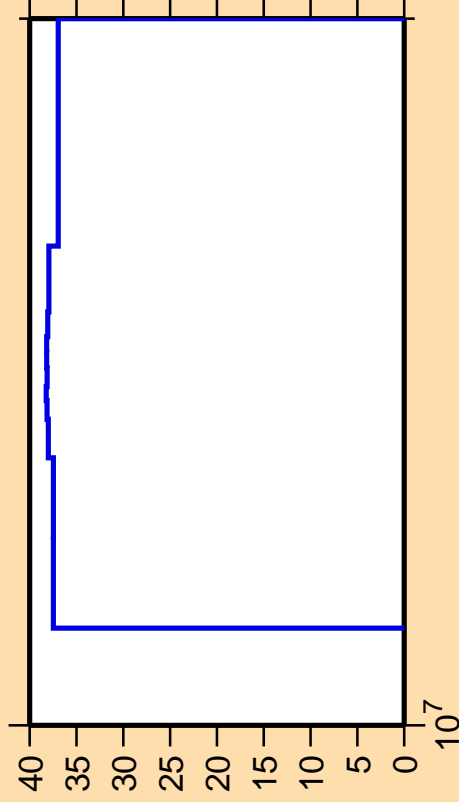


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

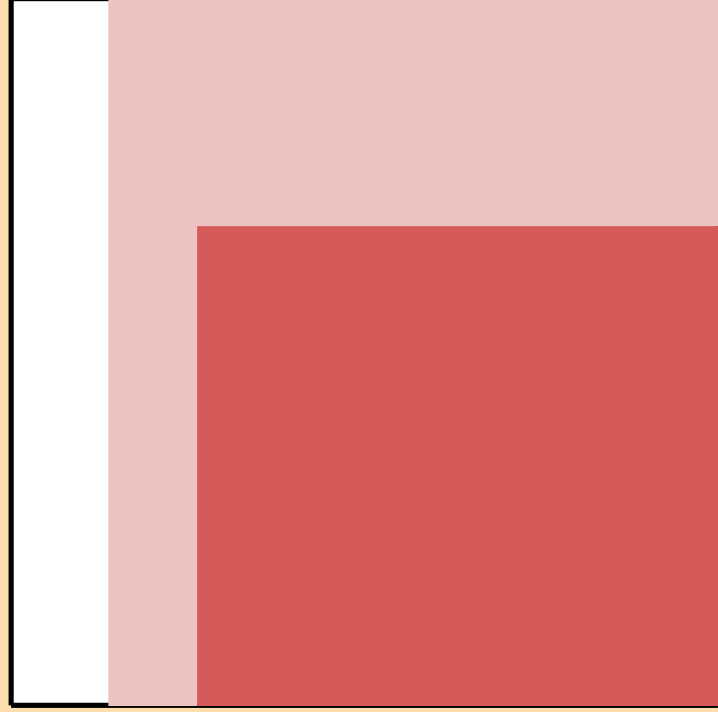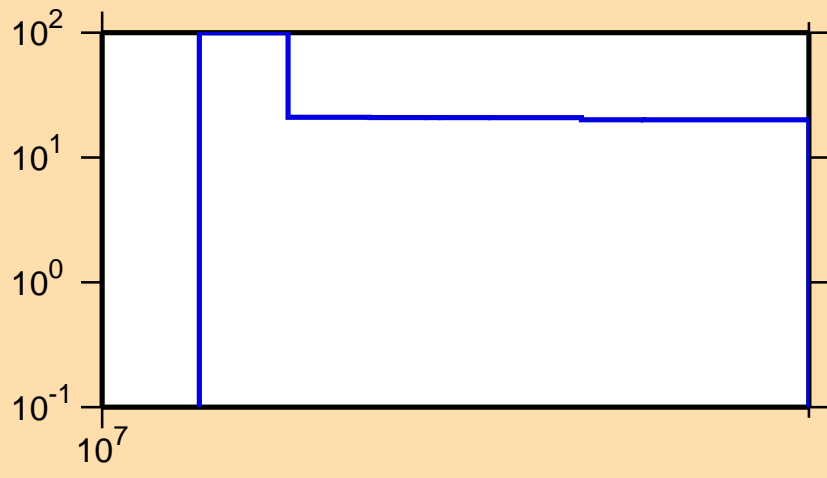

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$


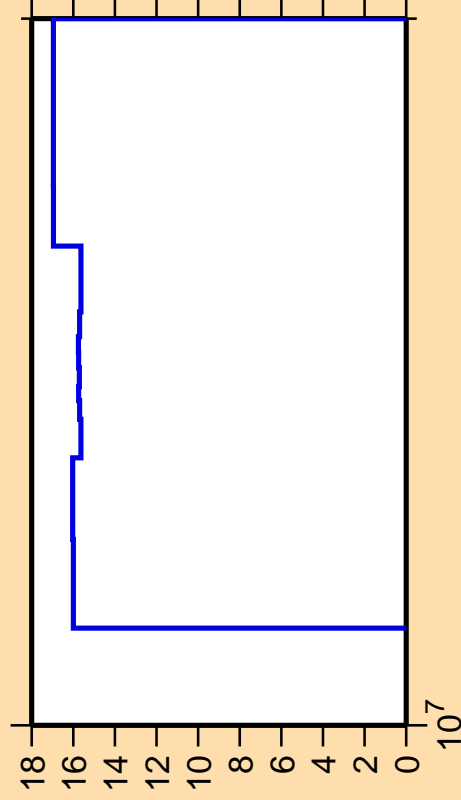


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

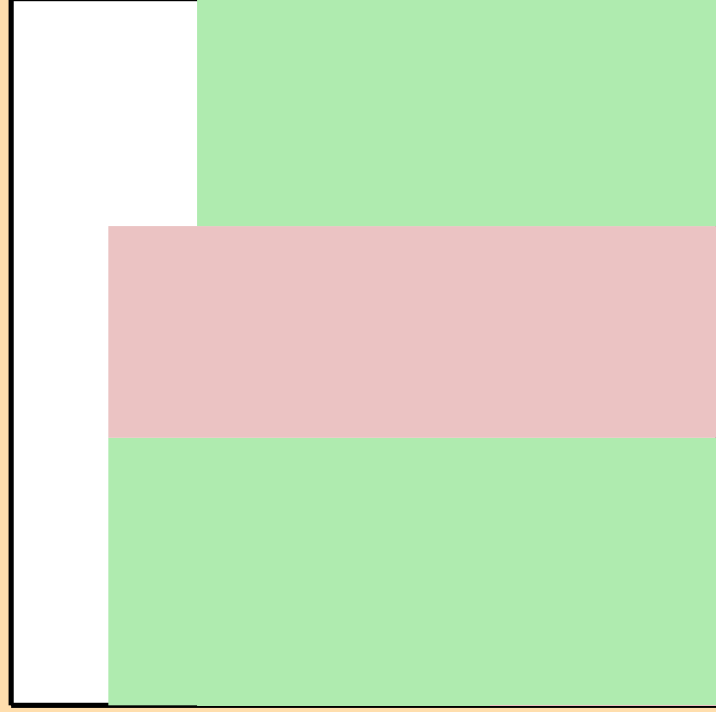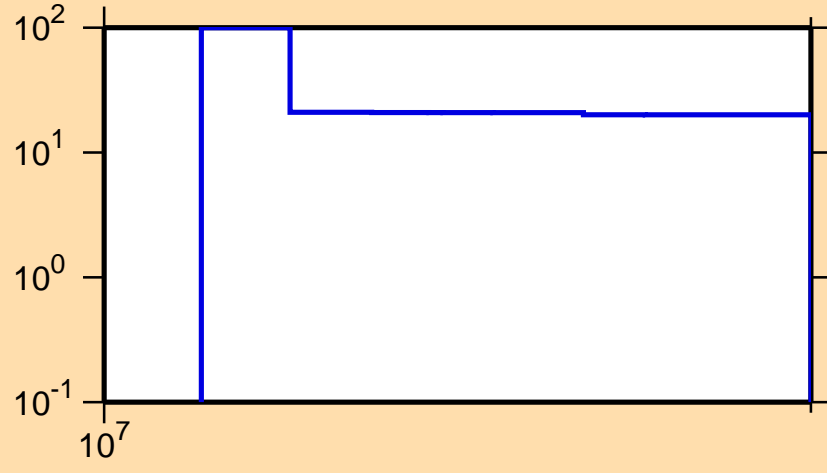

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$


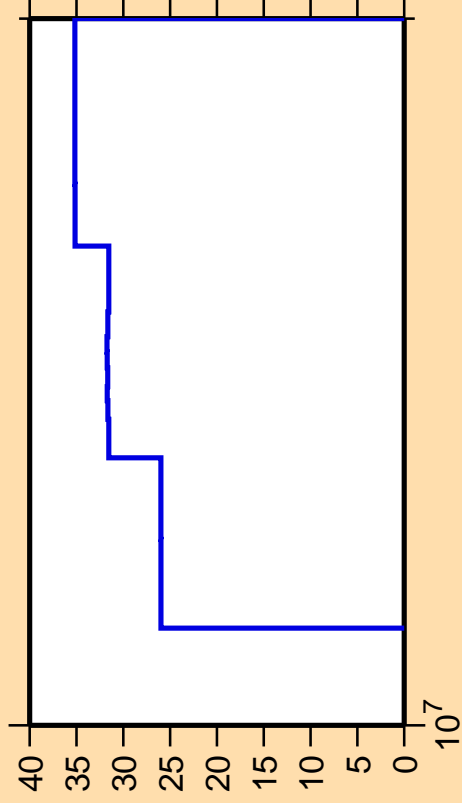


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2n)$

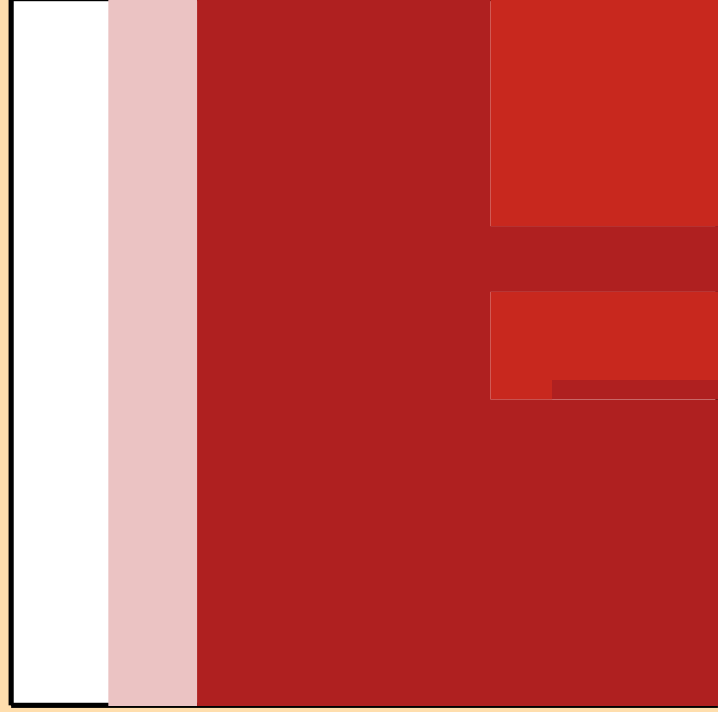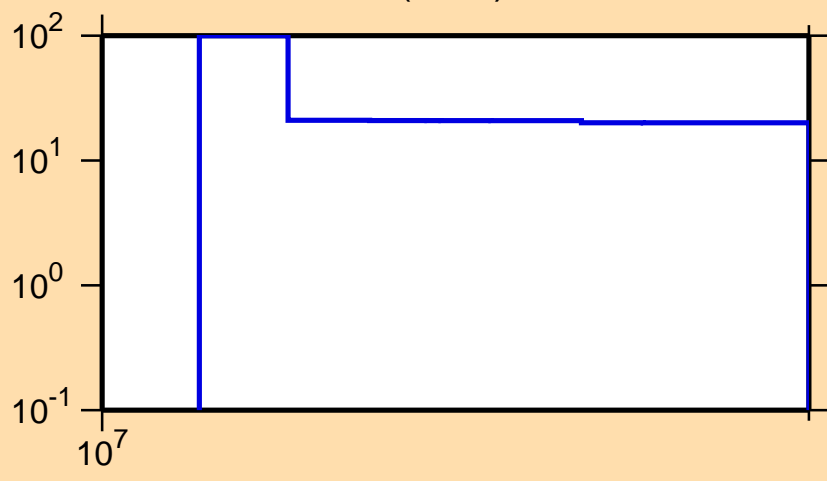

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\alpha)$

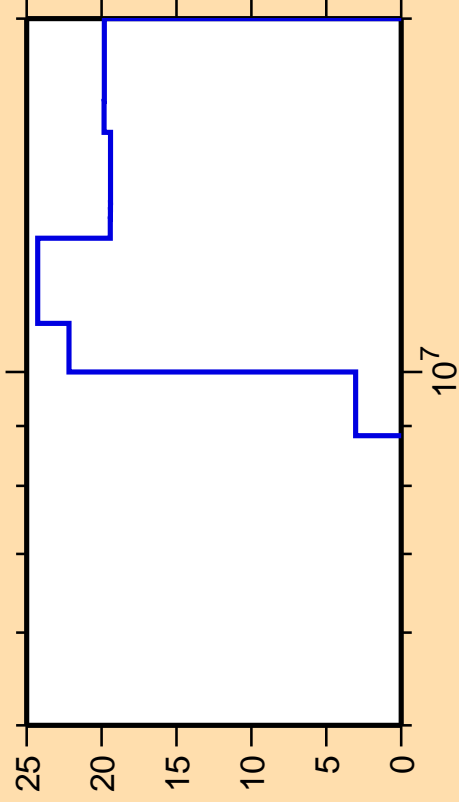

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,n\alpha)$

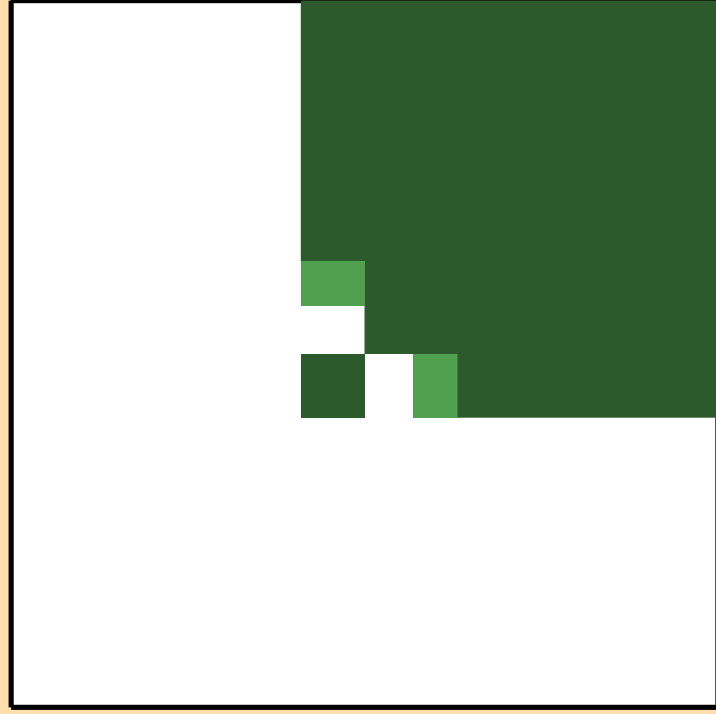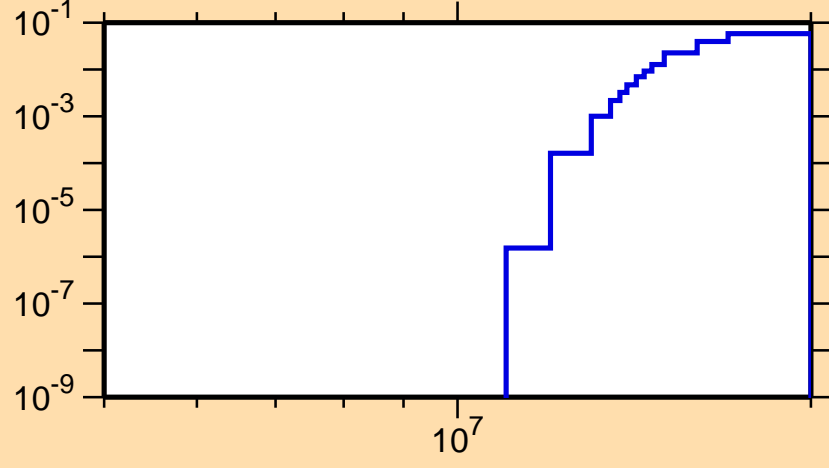

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,np)$

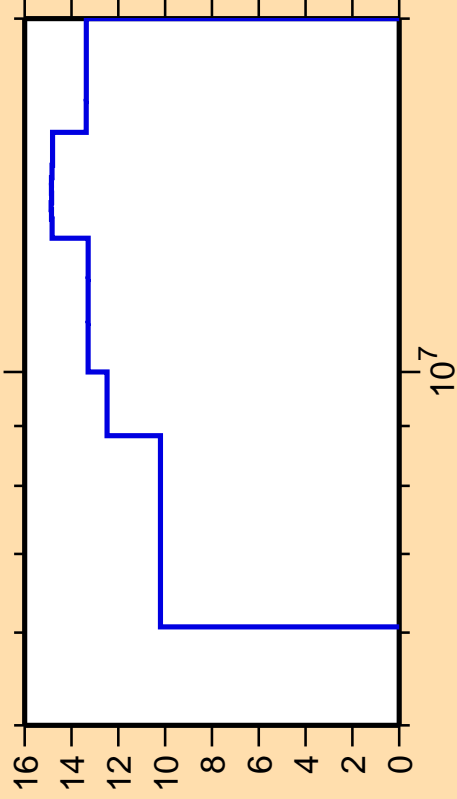

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,np)$

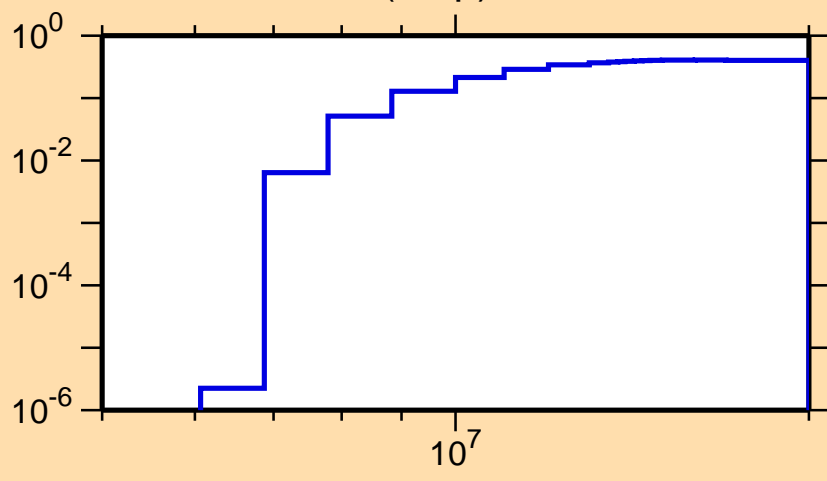

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{nd})$

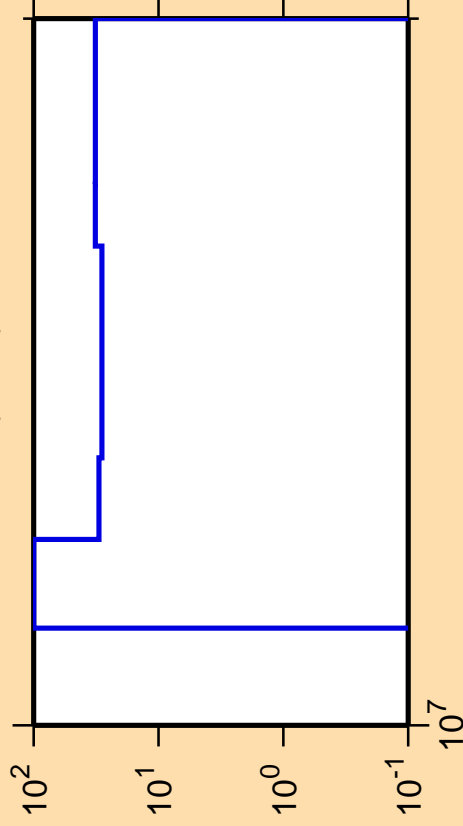


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,\text{nd})$

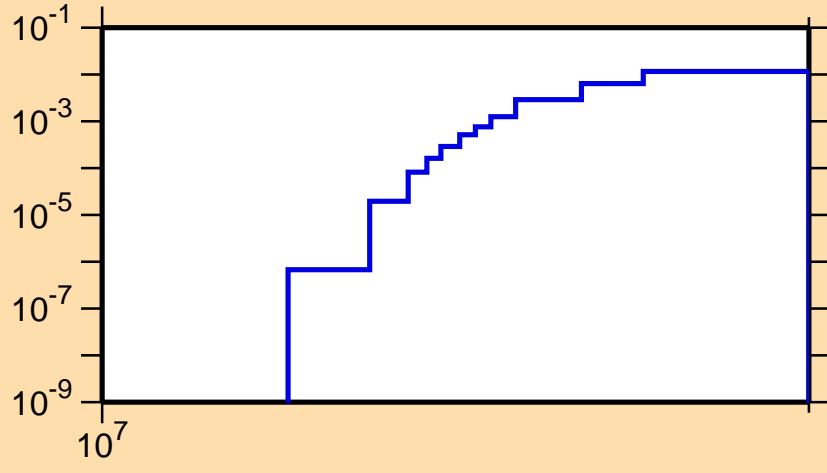

10^7

10^{-1}

10^{-3}

10^{-5}

10^{-7}

10^{-9}

10^7

10^7

10^7

10^7

10^7

10^7

10^7


10^7

10^7

10^7

10^7

Correlation Matrix

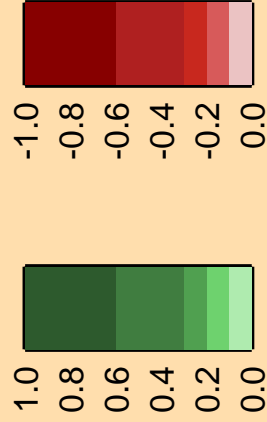

1.0
0.8
0.6
0.4
0.2
0.0

-1.0
-0.8
-0.6
-0.4
-0.2
0.0

$\Delta\sigma/\sigma$ vs. E for ^{26}Al (mt 34)



Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for ^{26}Al (mt 34)



Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,2np)$

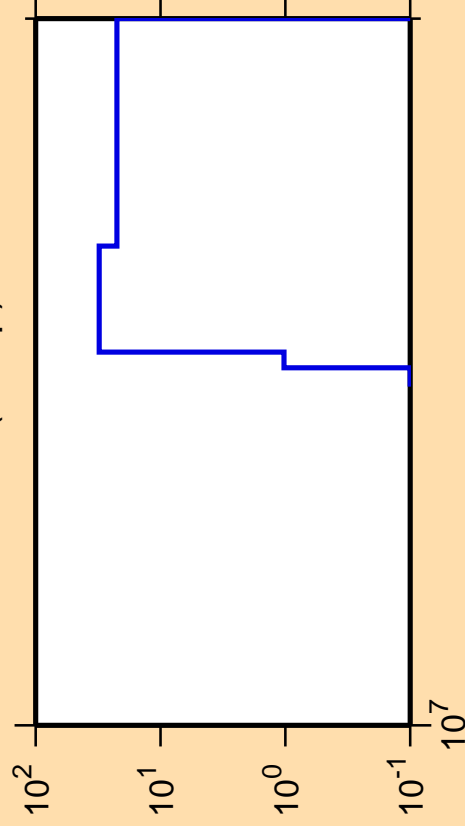


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,2np)$

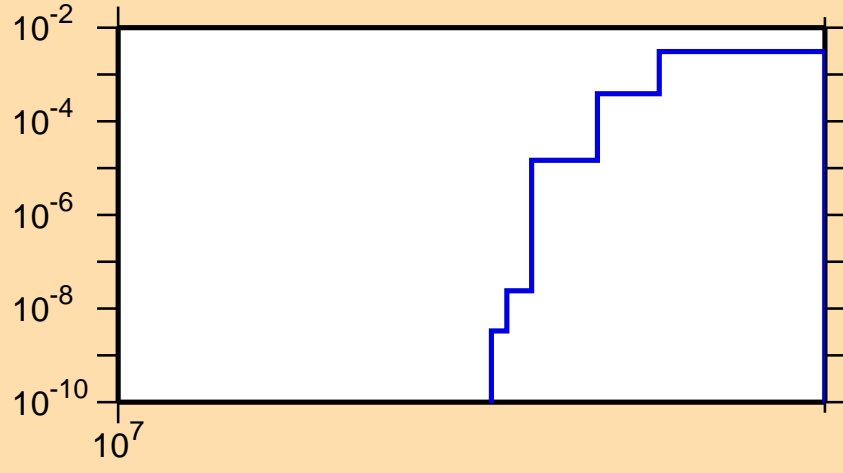

10^7

10^{-2}

10^{-4}

10^{-6}

10^{-8}

10^{-10}


10^{-7}

10^{-5}

10^{-3}

10^1

Correlation Matrix

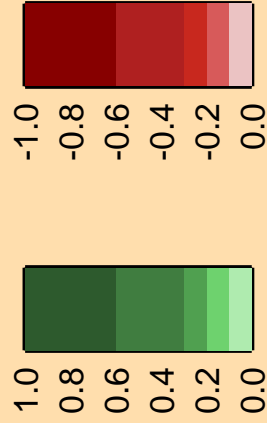

1.0

0.8

0.6

0.4

0.2

0.0

-1.0

-0.8


-0.6

-0.4

-0.2

0.0

$\Delta\sigma/\sigma$ vs. E for ^{26}Al (mt 45)

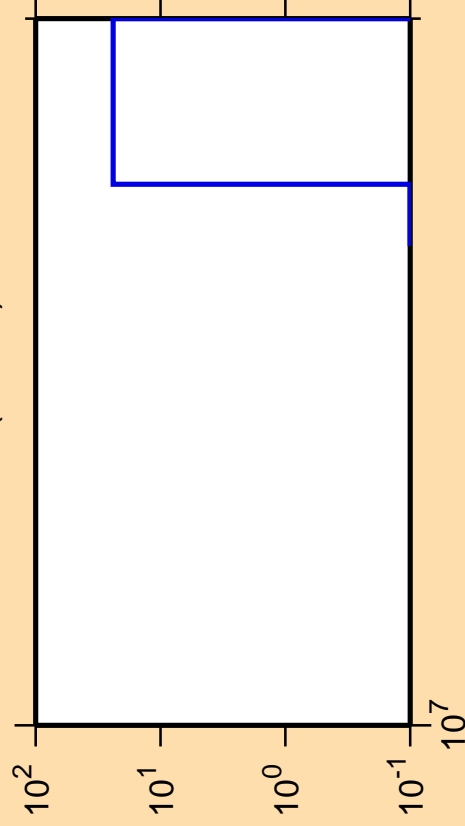


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for ^{26}Al (mt 45)

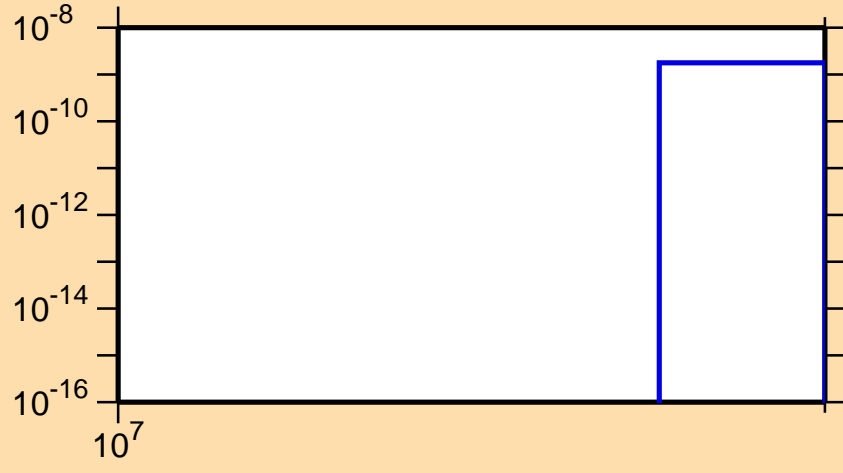

10^7

10^{-8}

10^{-10}


10^{-12}

10^{-14}

10^{-16}



Correlation Matrix



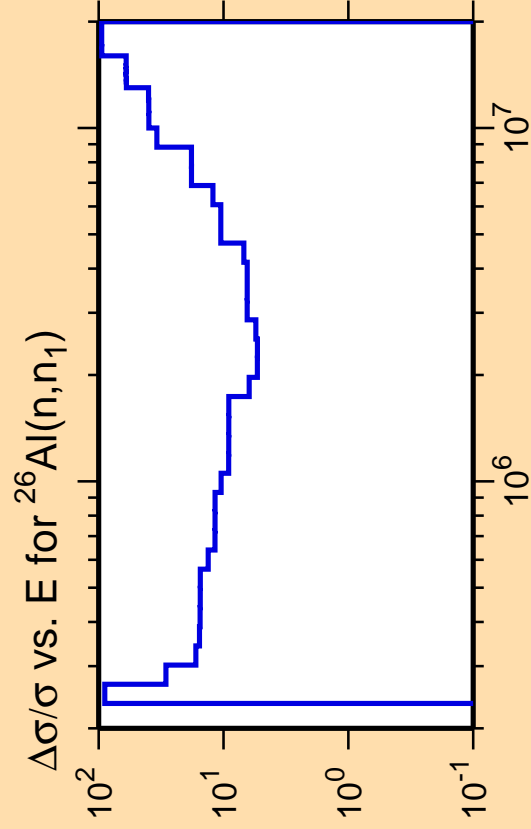

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

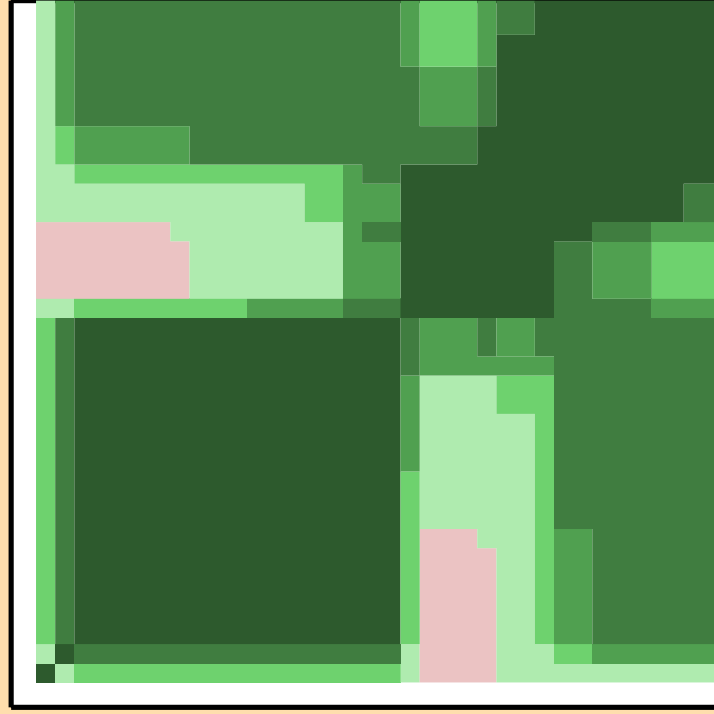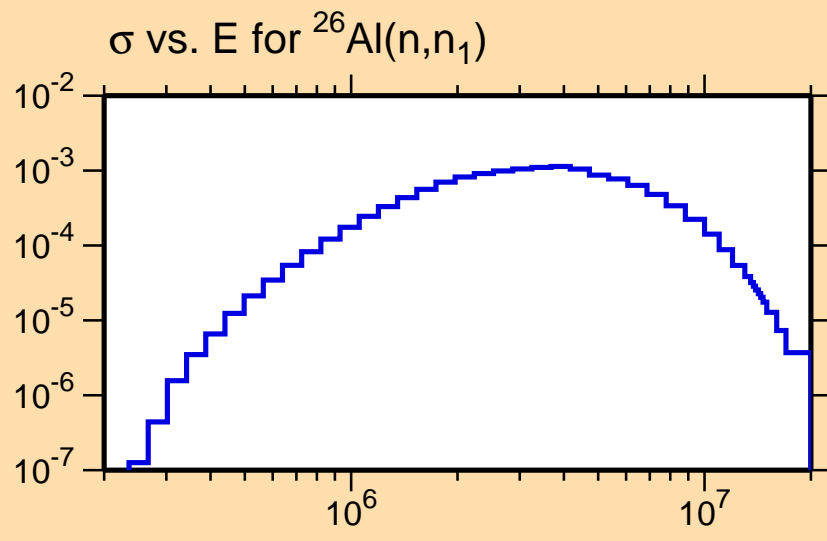

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_{\text{cont}})$.

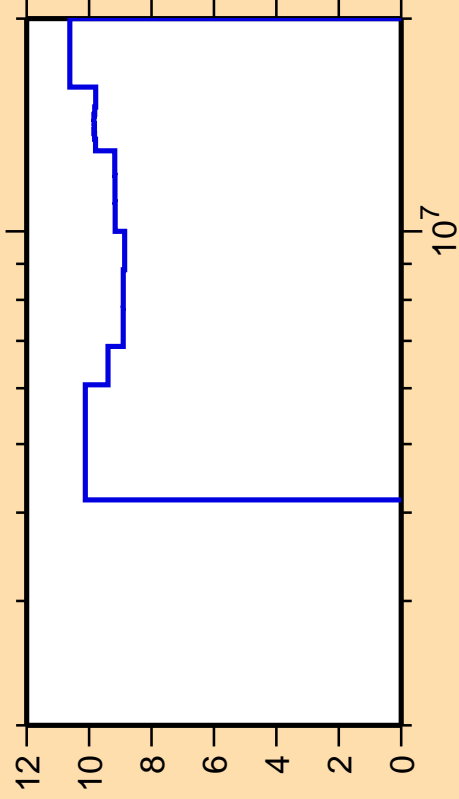

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n, n_1)$

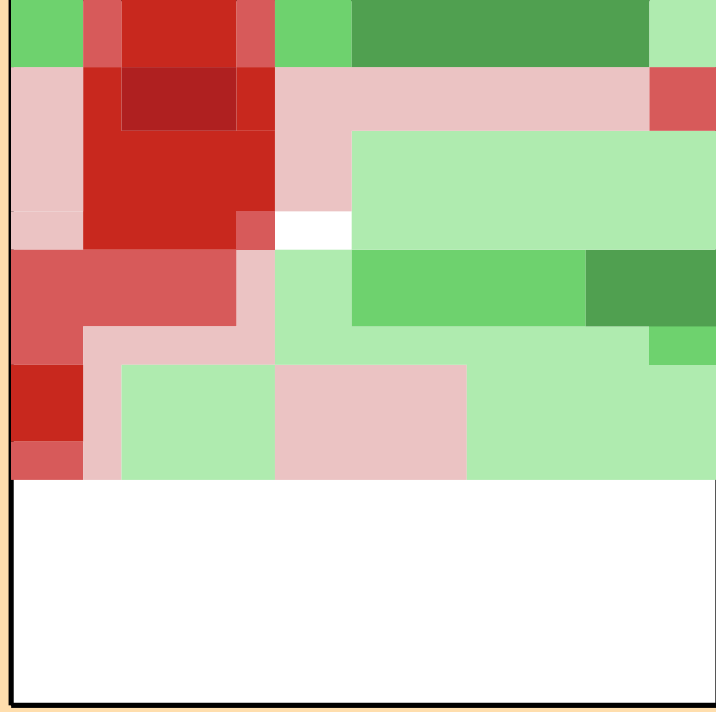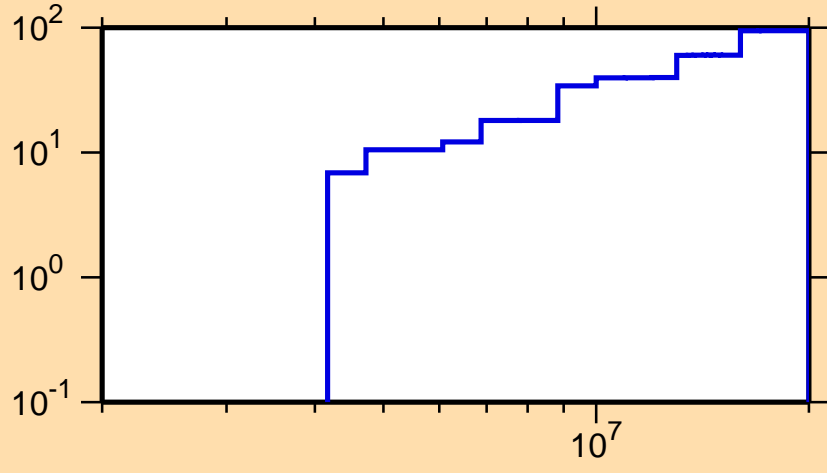



Correlation Matrix



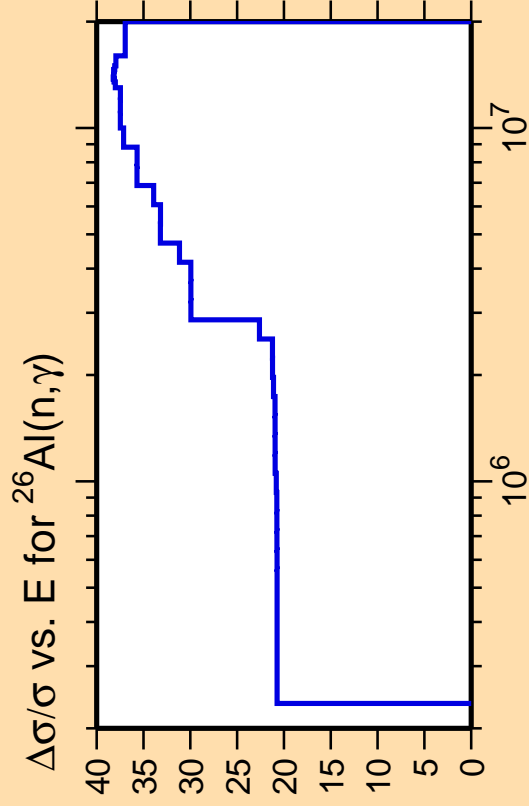

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

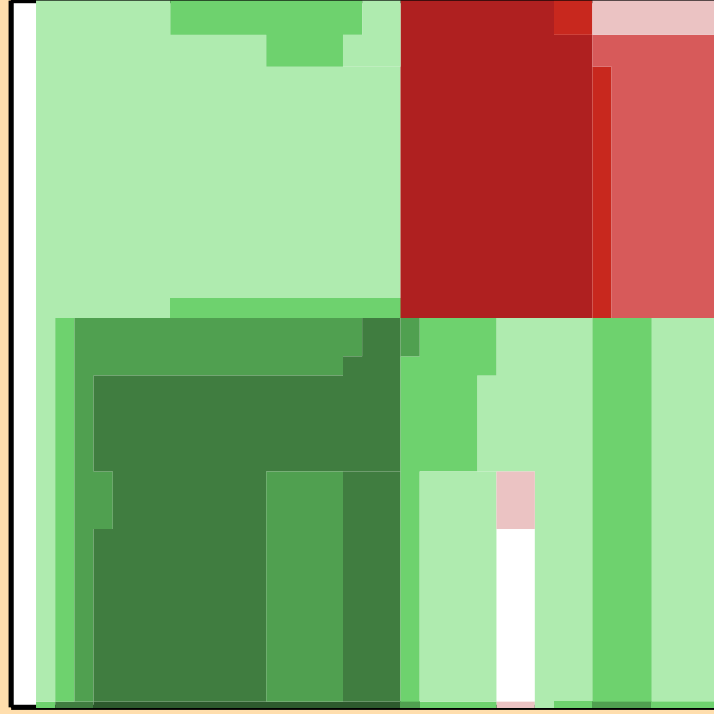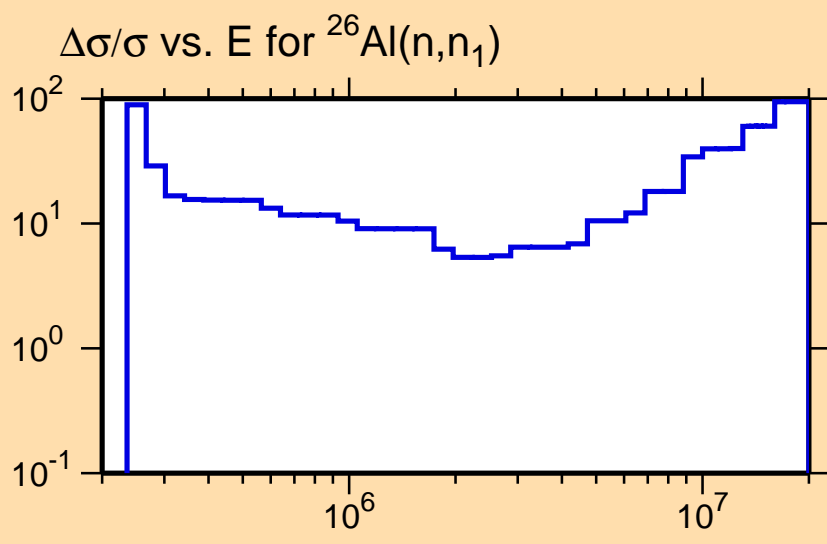

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$

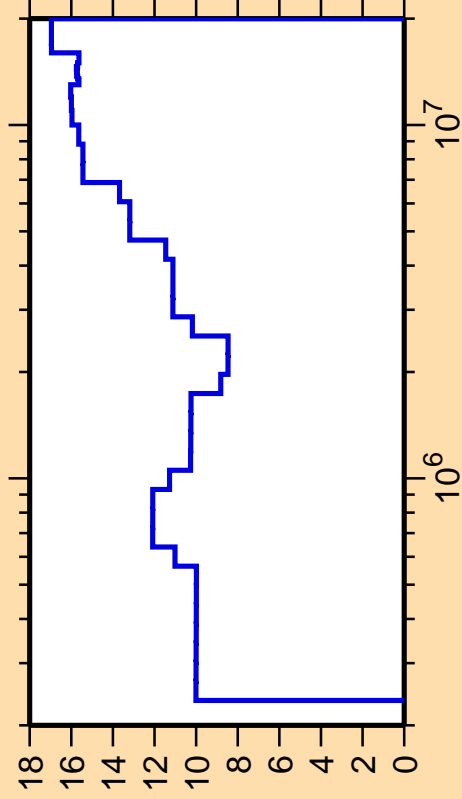

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_1)$

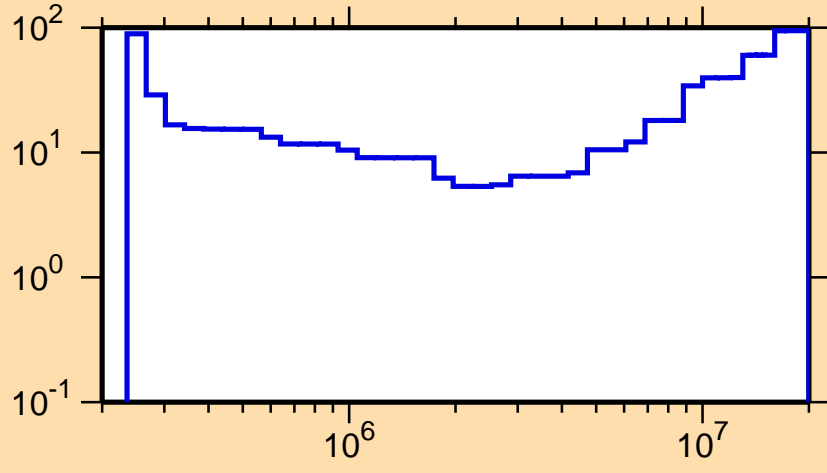

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\alpha)$

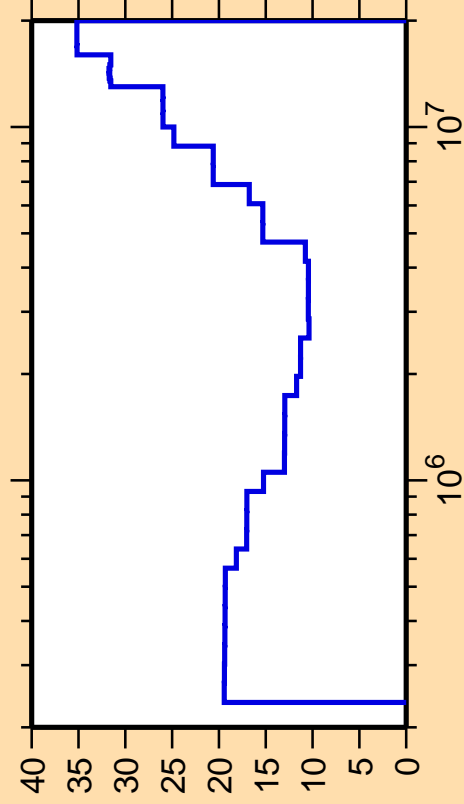

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_1)$

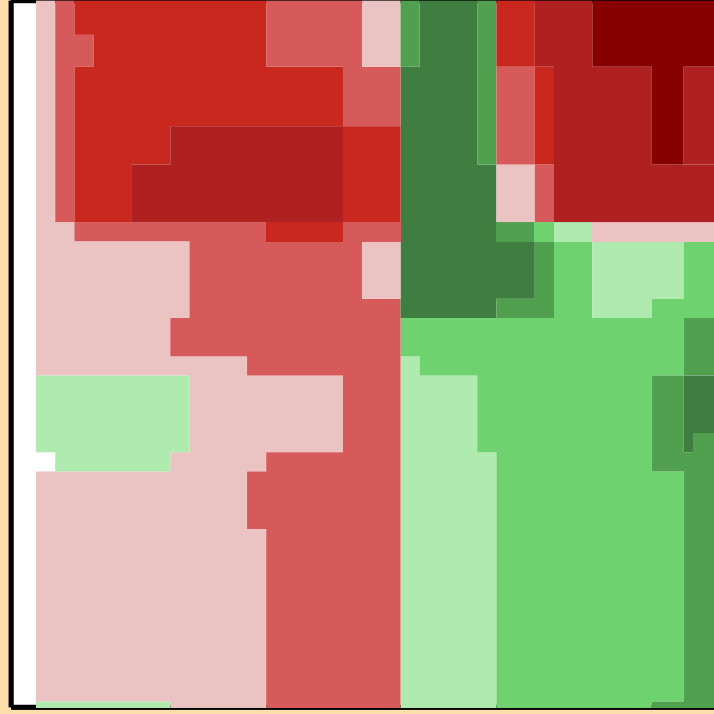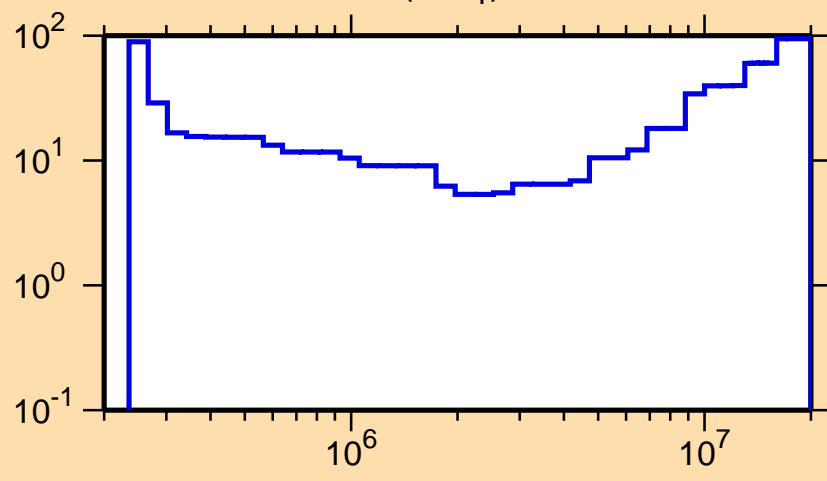

Correlation Matrix




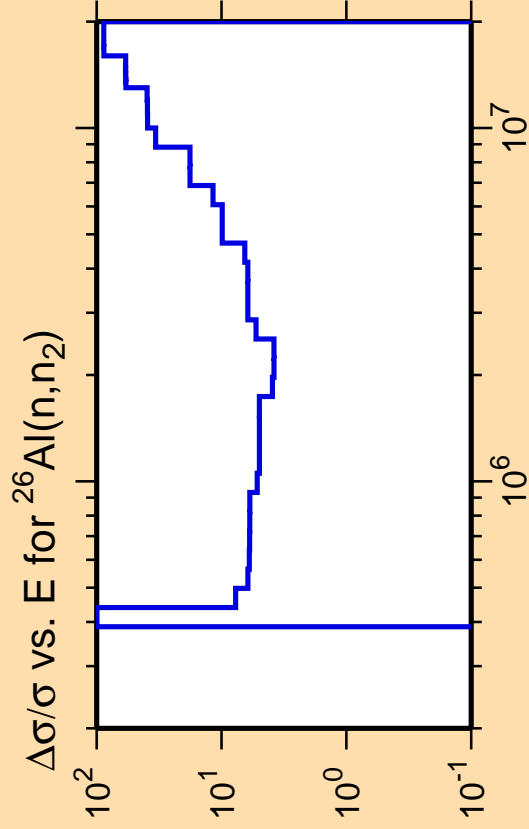


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,n_2)$

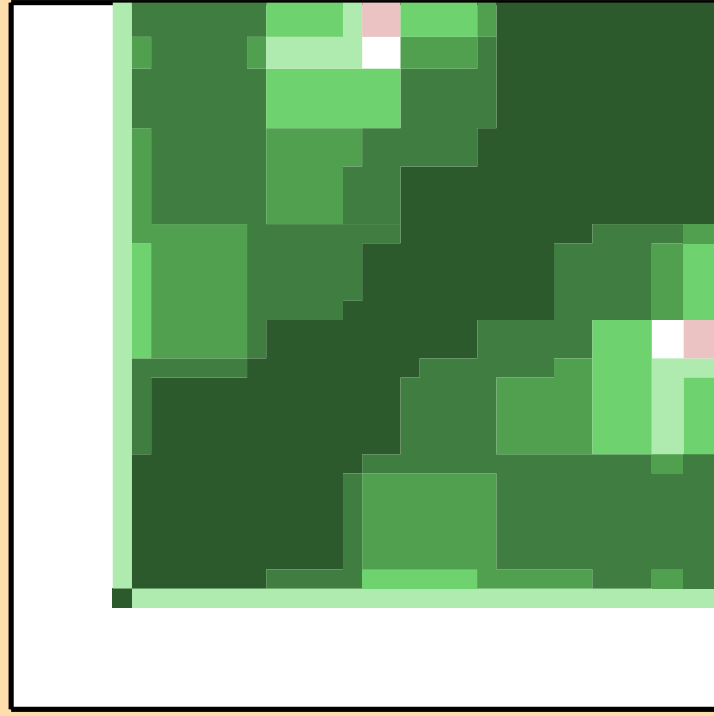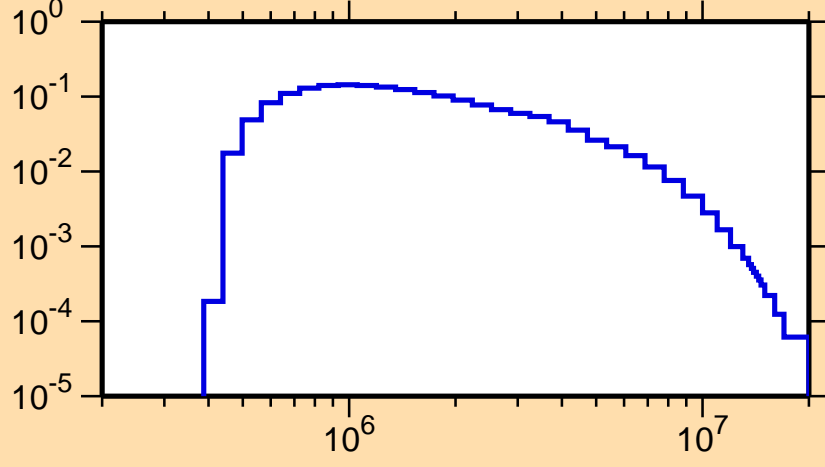



Correlation Matrix



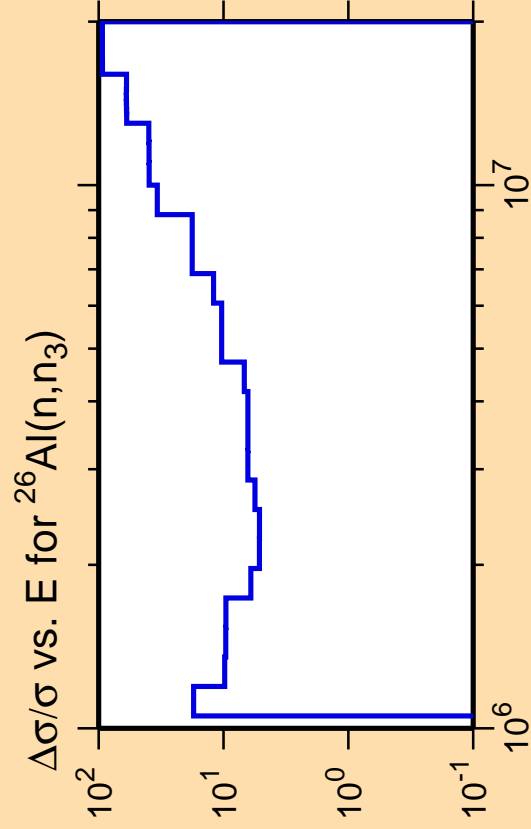

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

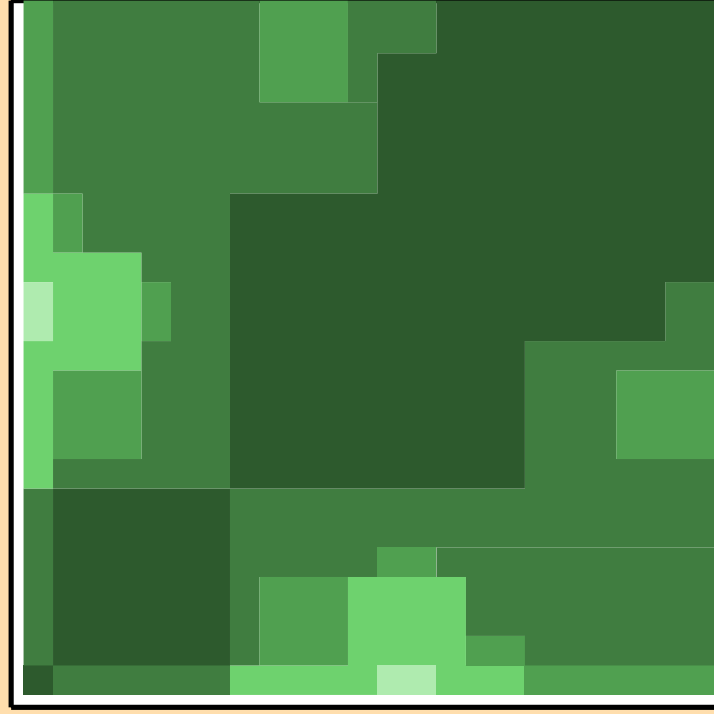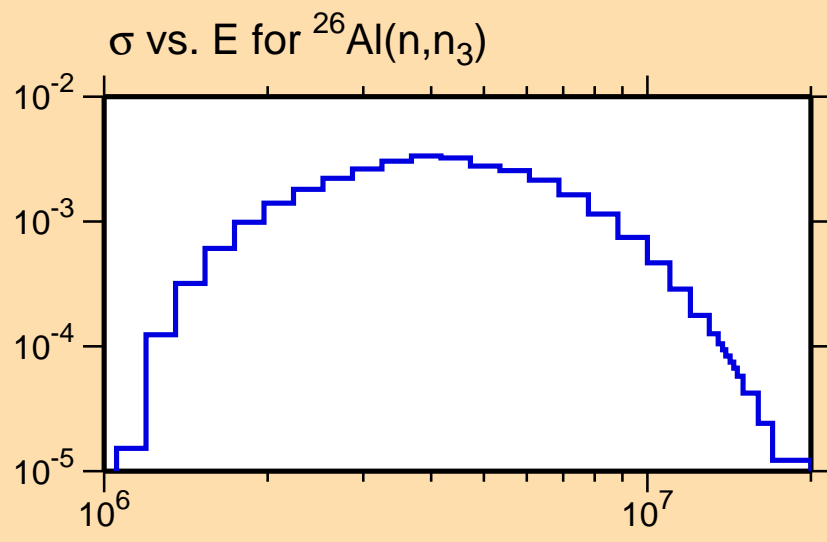

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n_4)$

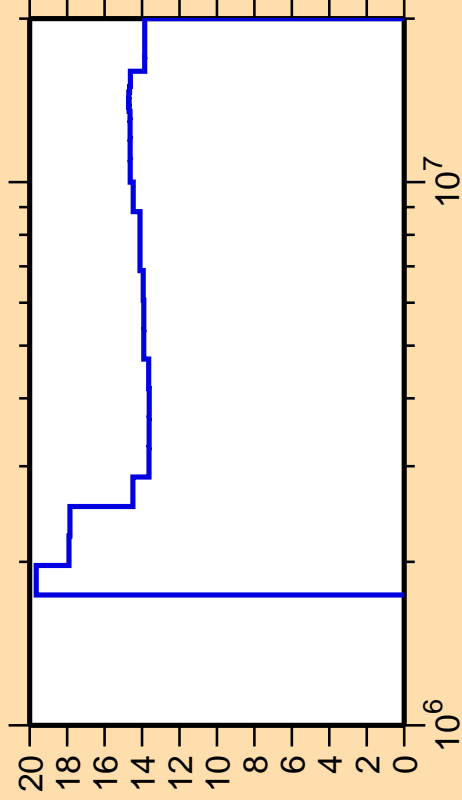

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{26}\text{Al}(n,n_4)$

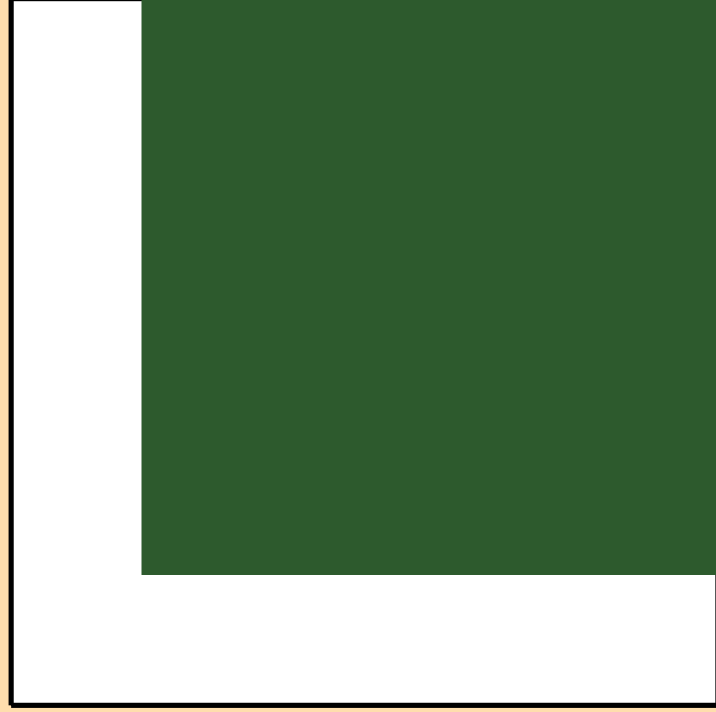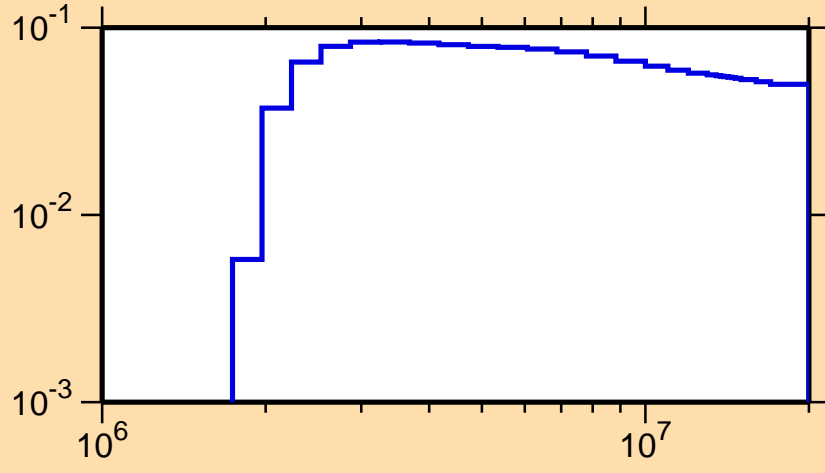

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

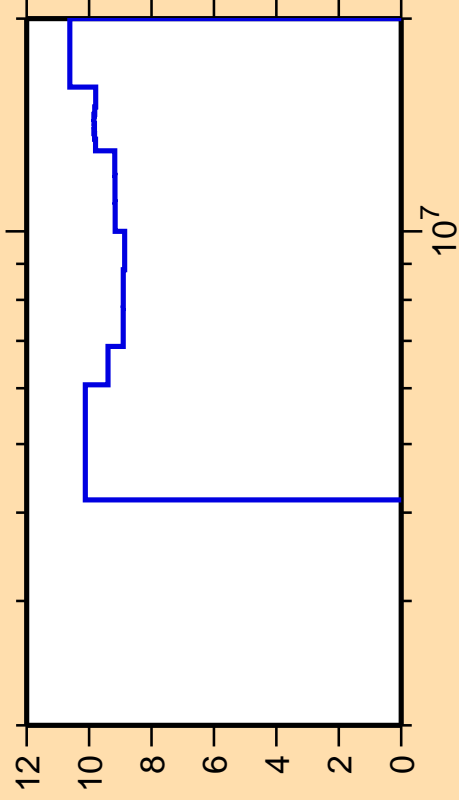

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

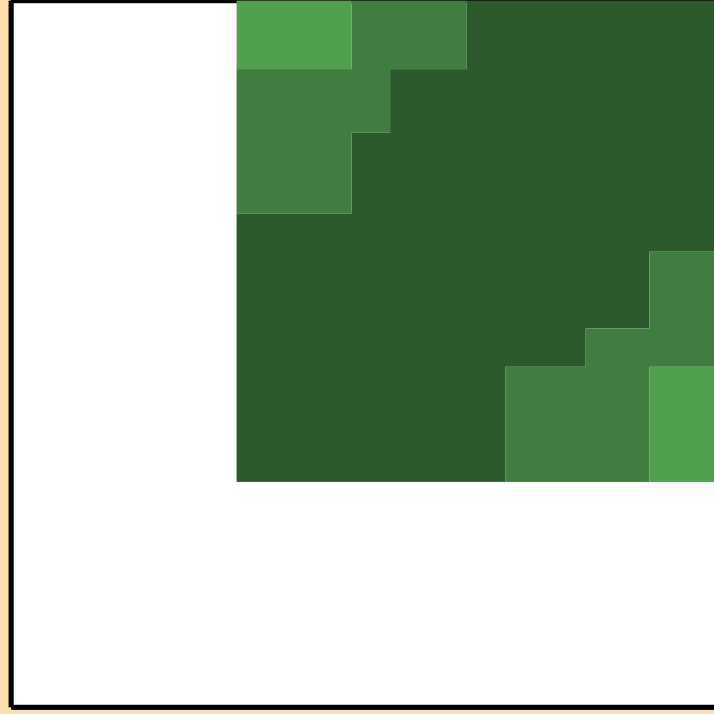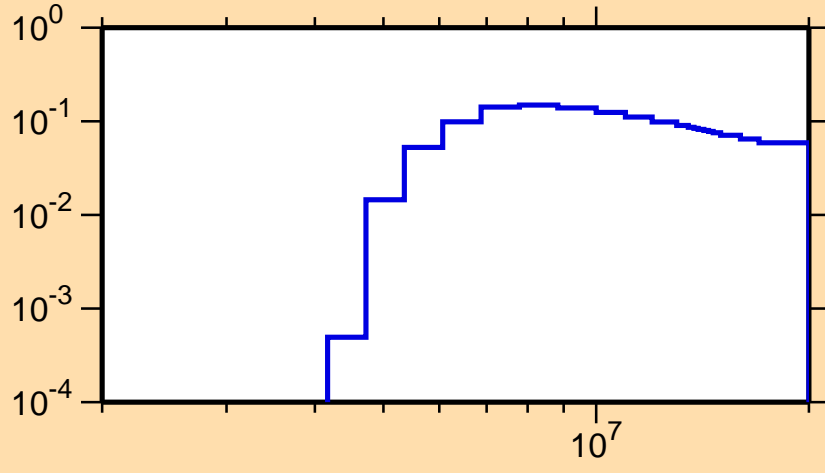



Correlation Matrix



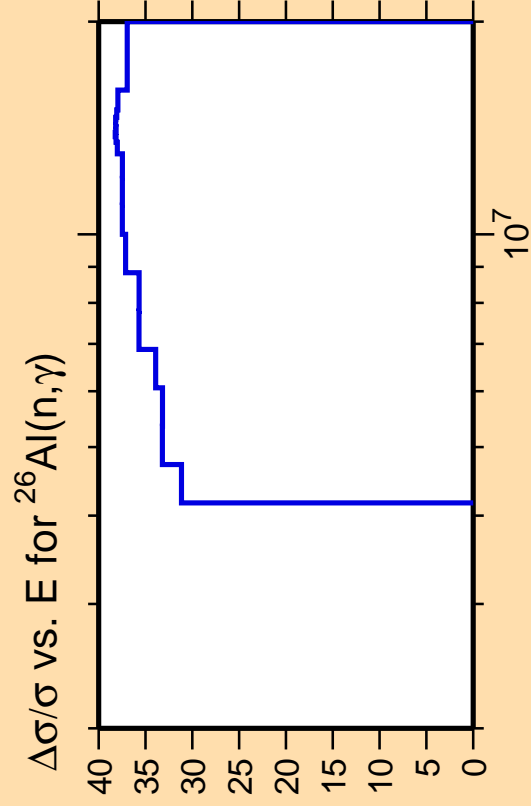

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

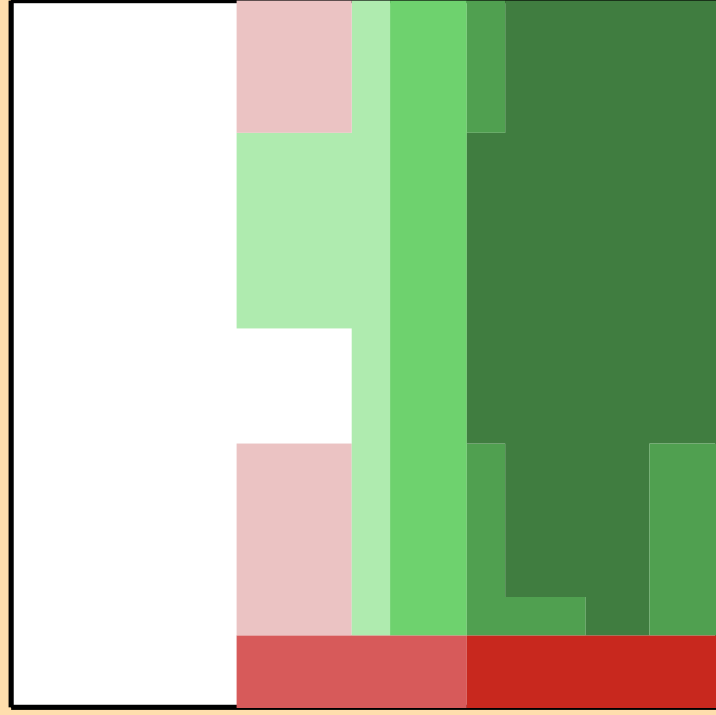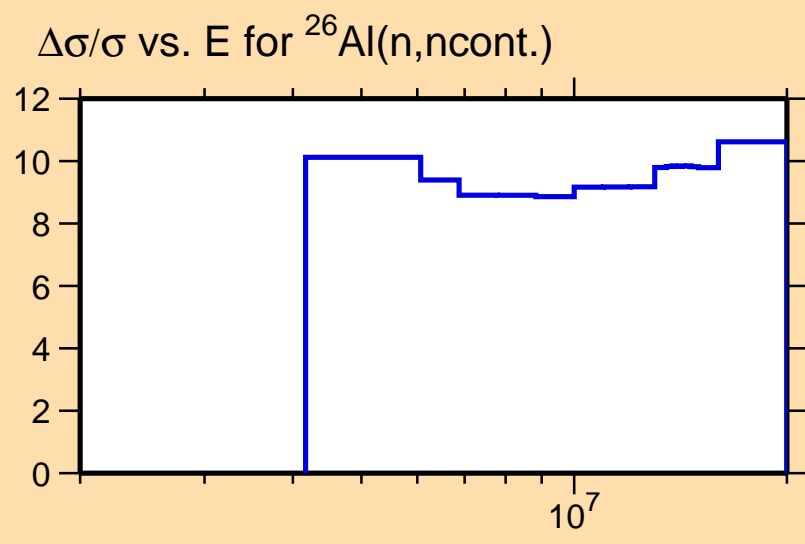

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$

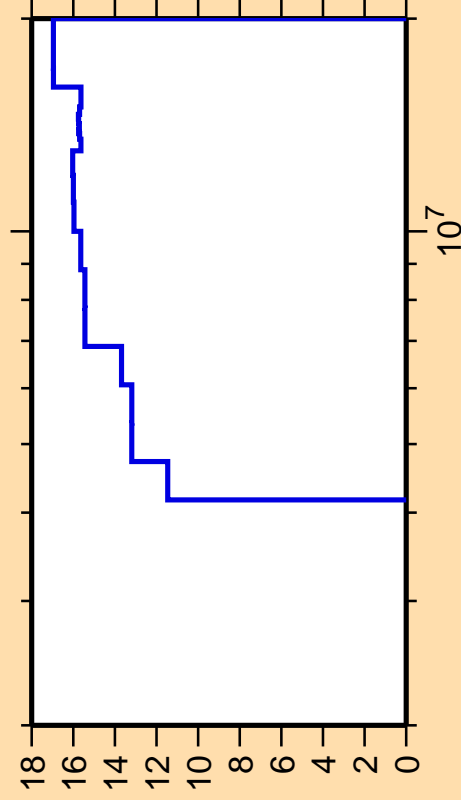

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

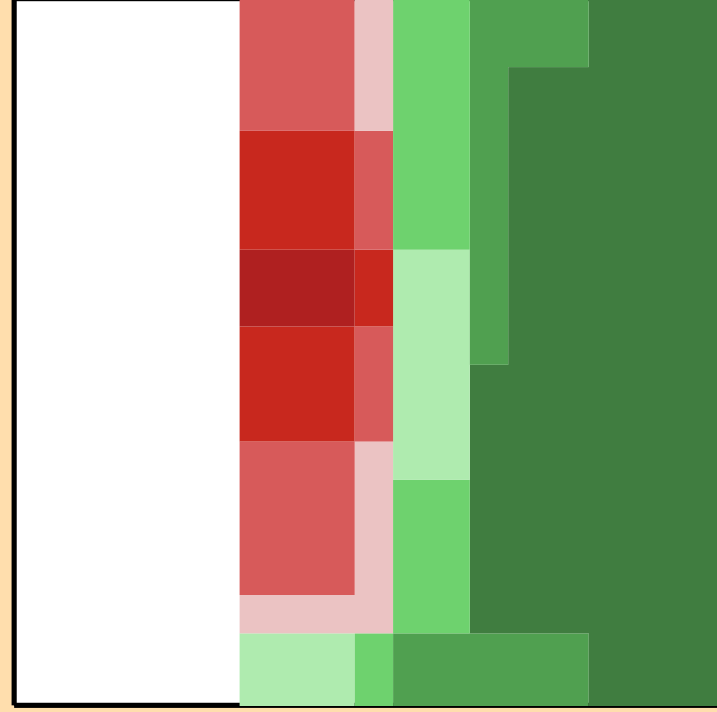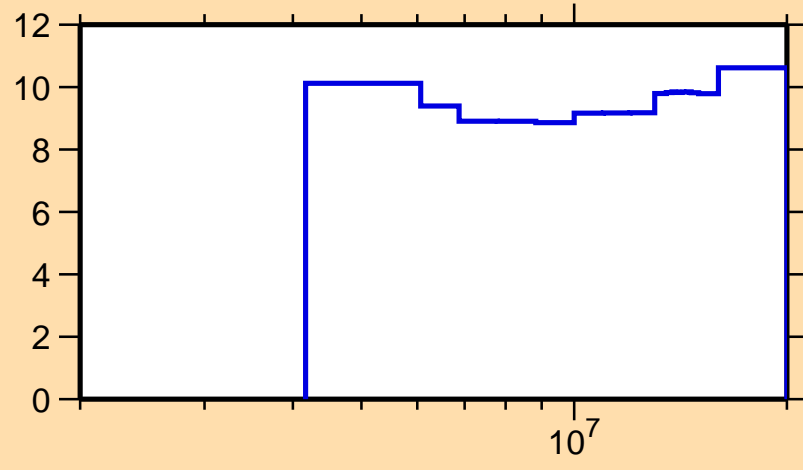

Correlation Matrix





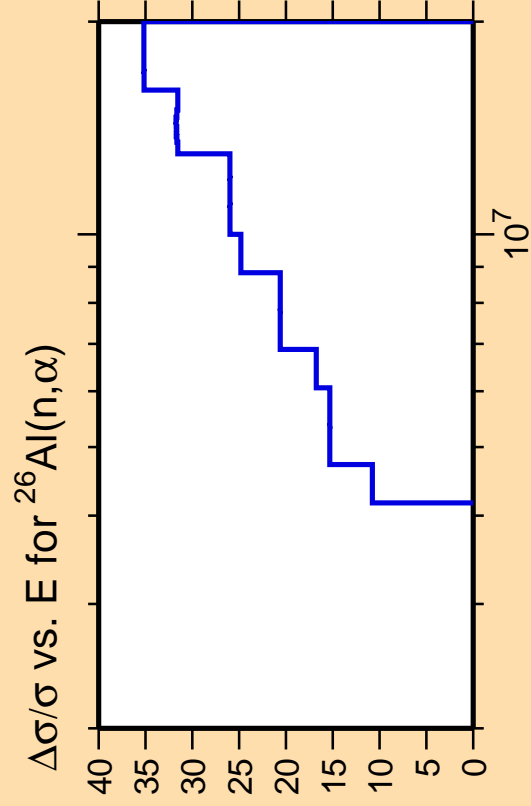

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,n\text{cont.})$

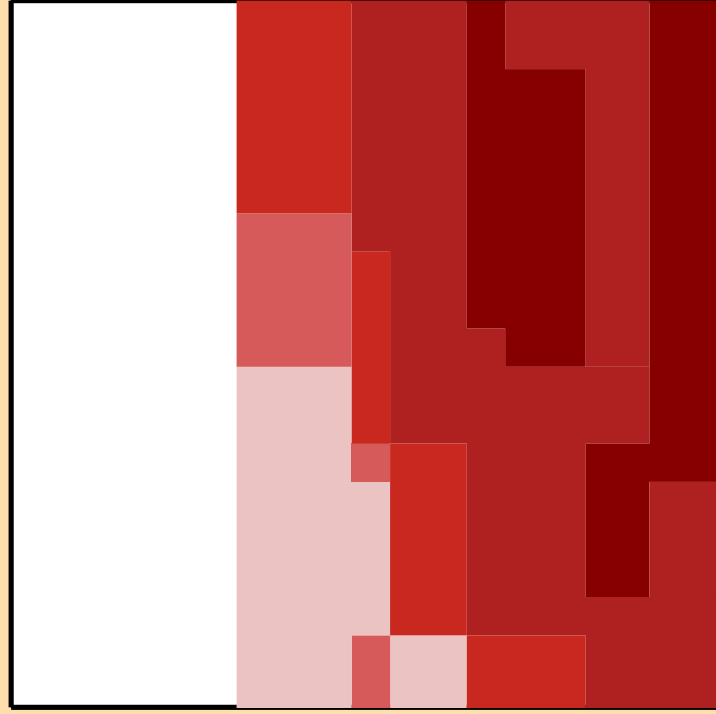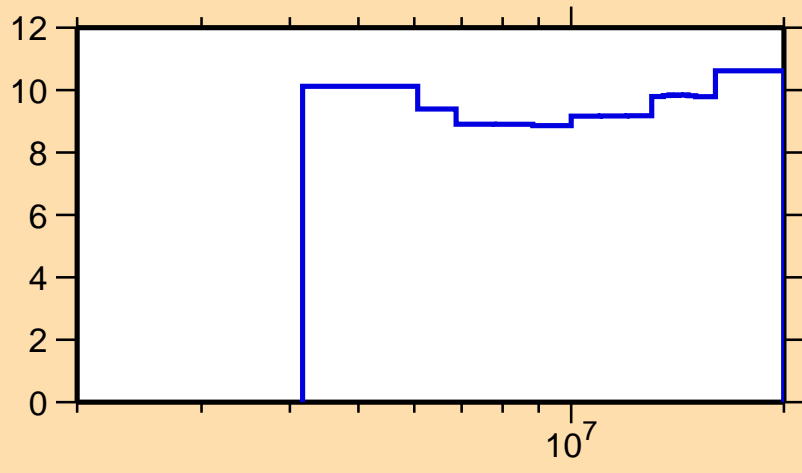

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\gamma)$

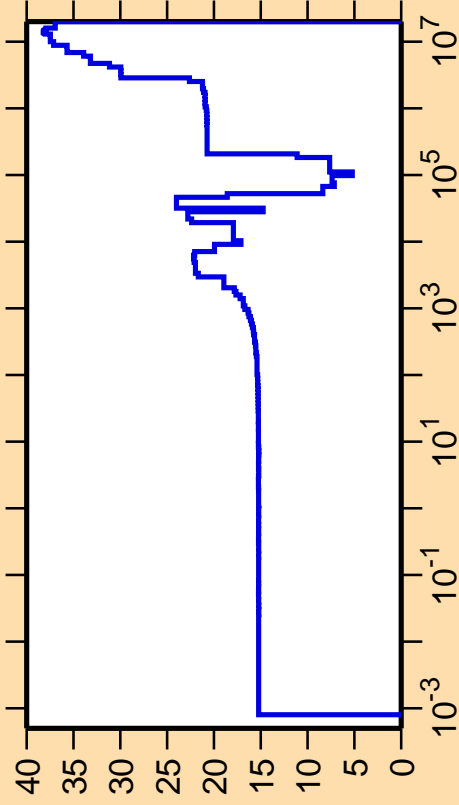

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{26}\text{Al}(n,\gamma)$

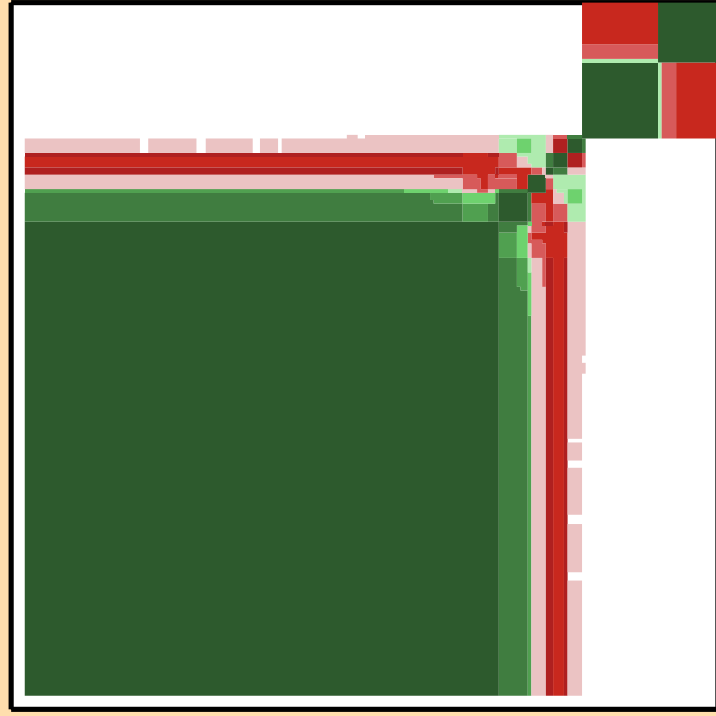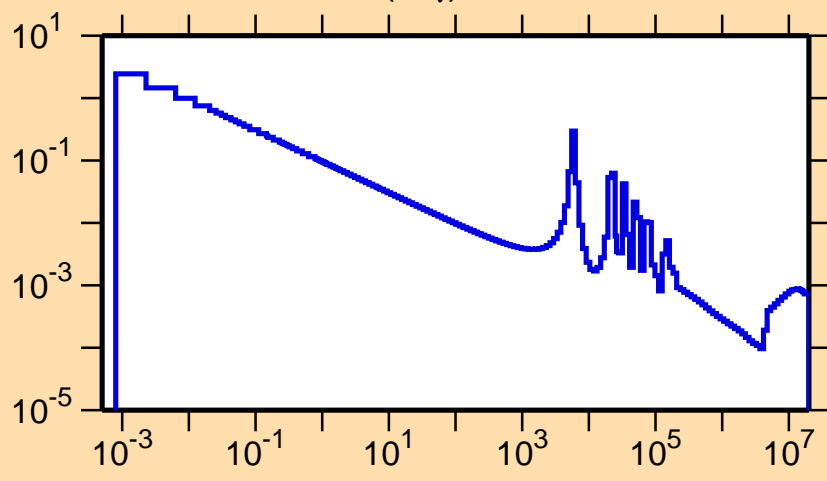

Correlation Matrix




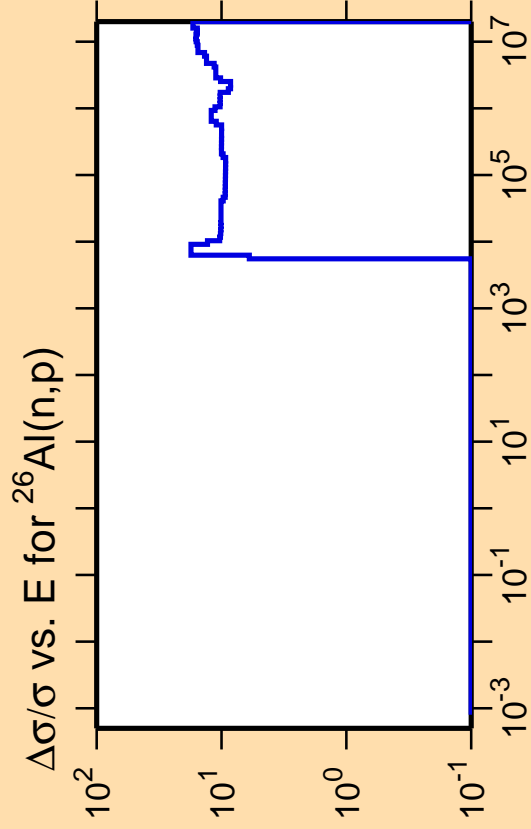


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\gamma)$

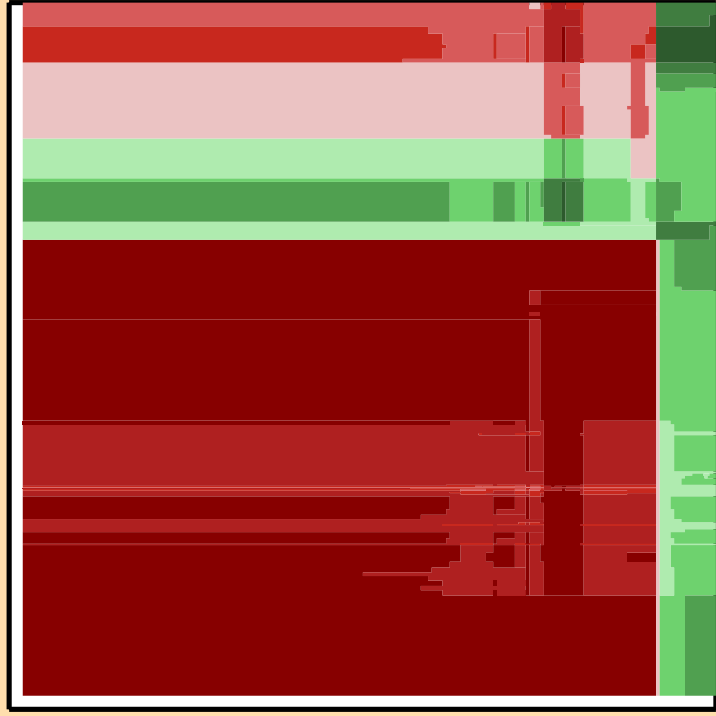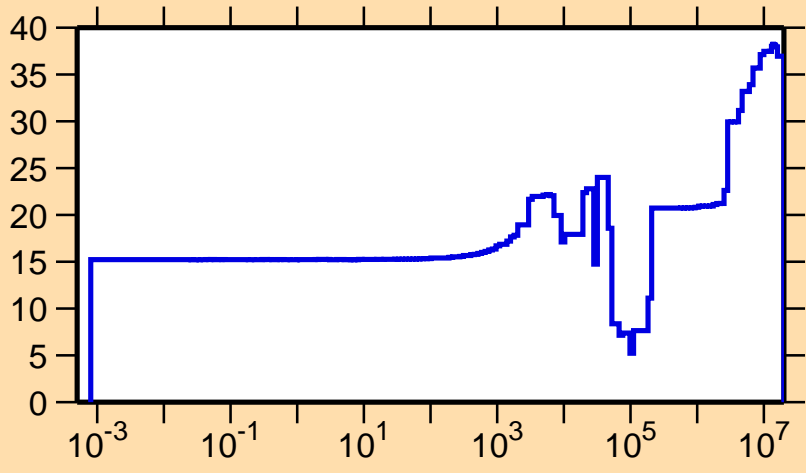

Correlation Matrix



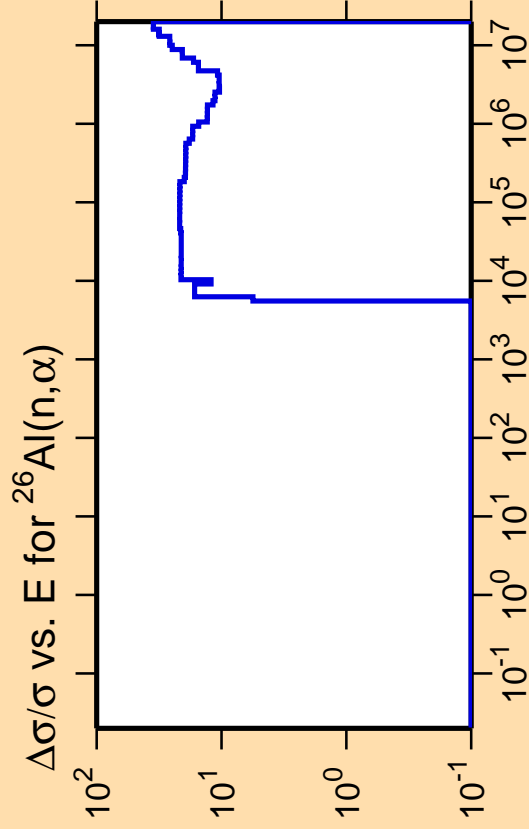


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\gamma)$

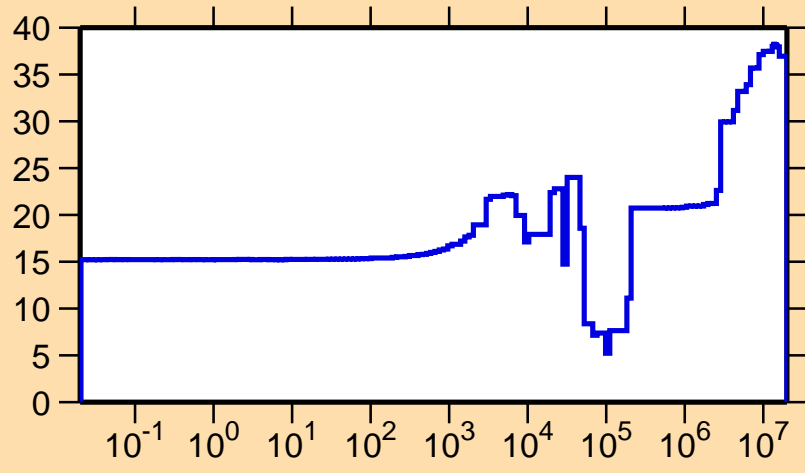

Correlation Matrix




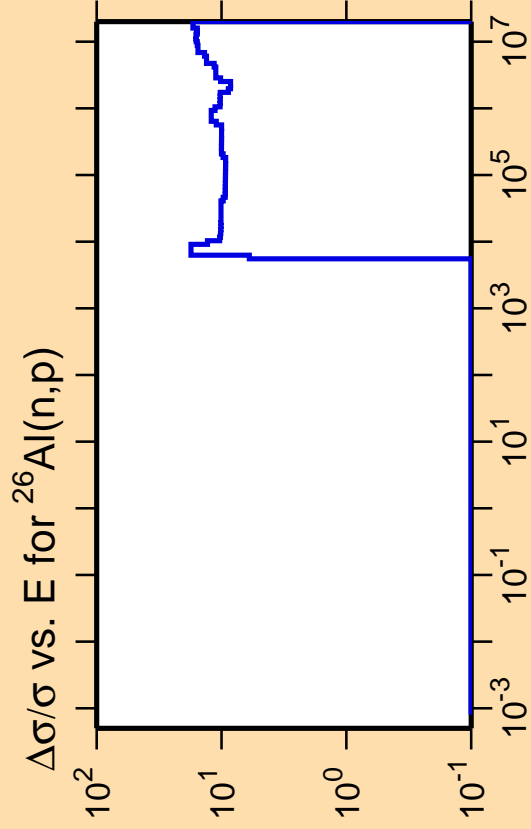


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

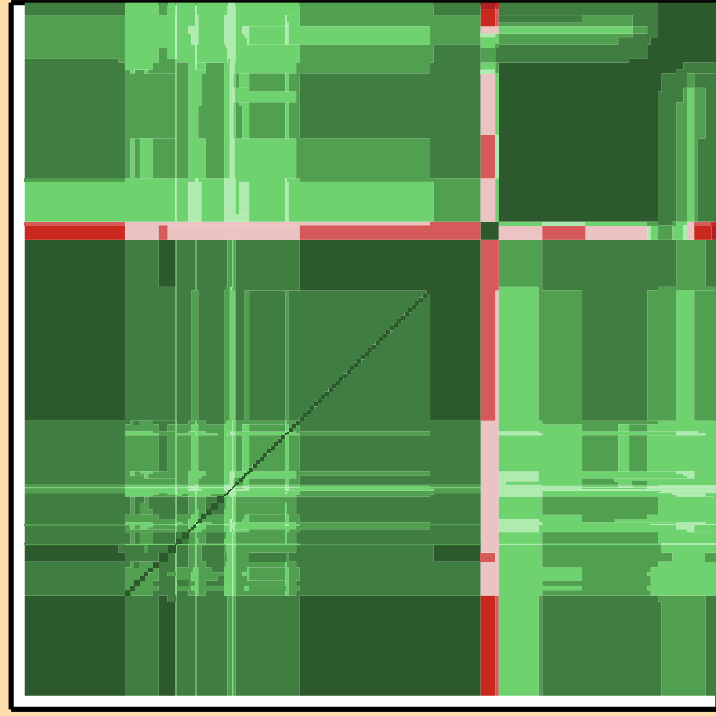

Correlation Matrix

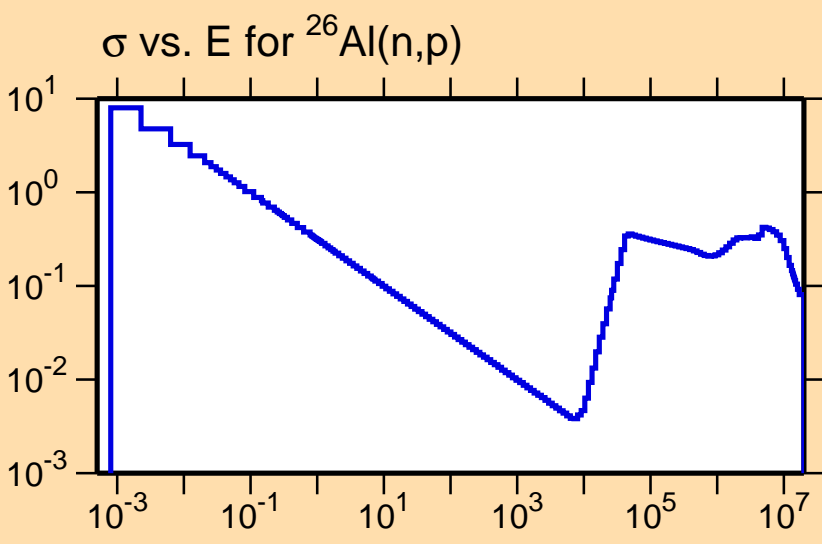

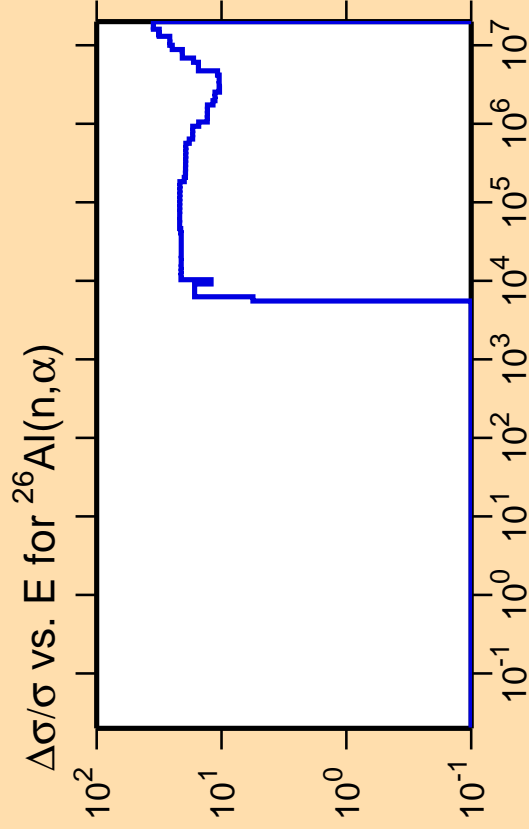


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,p)$

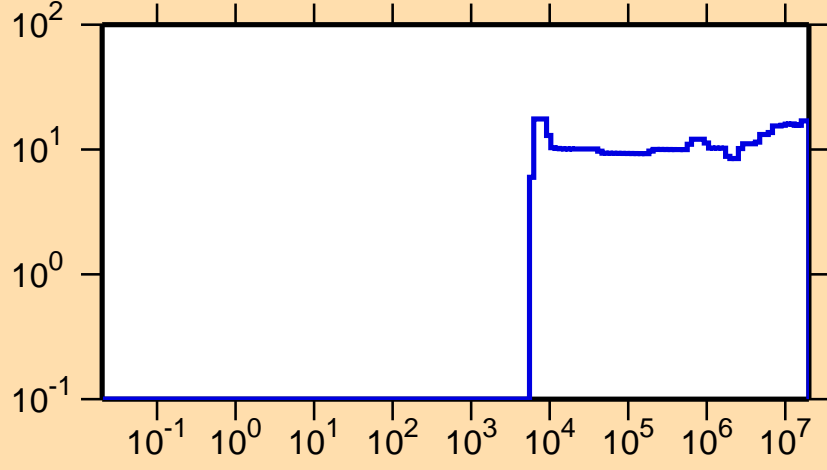

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,d)$

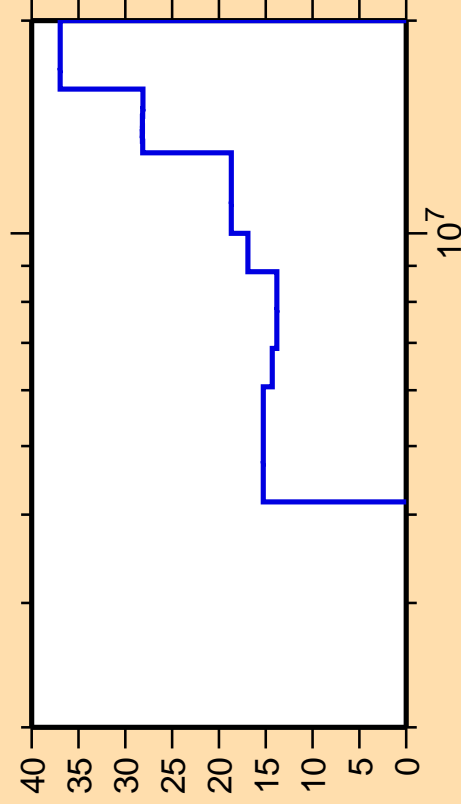

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{26}\text{Al}(n,d)$

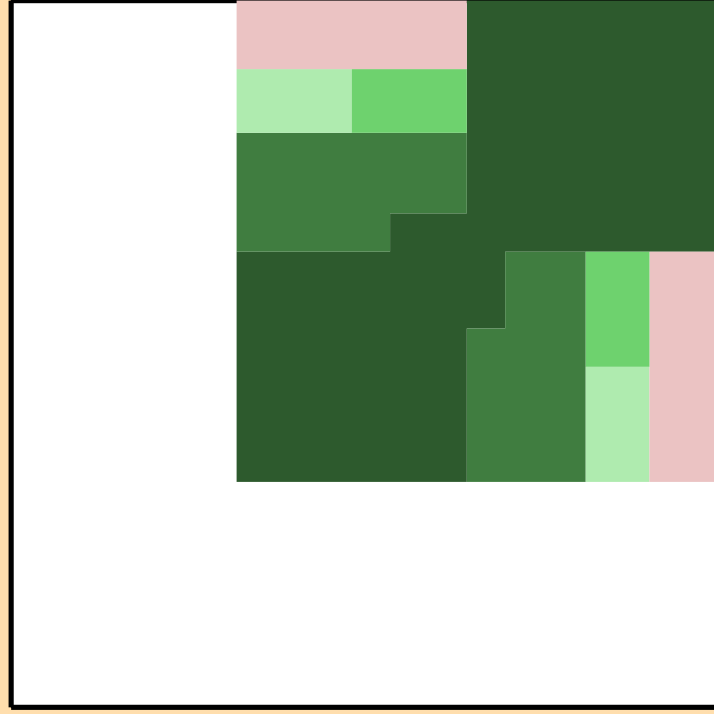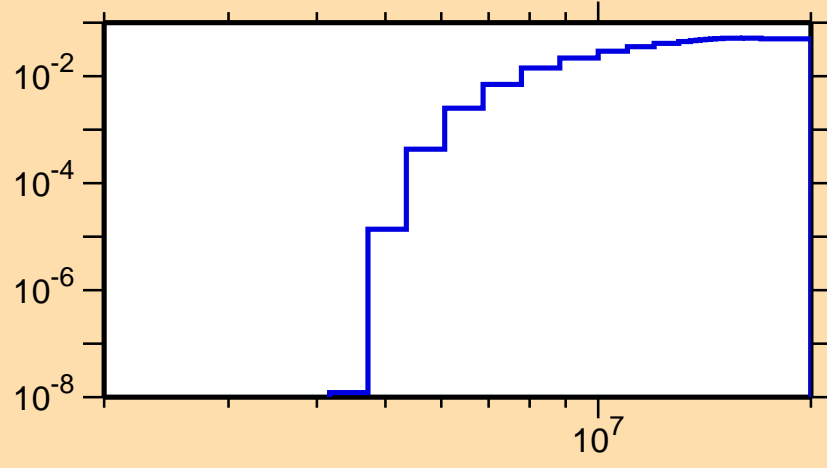

Correlation Matrix




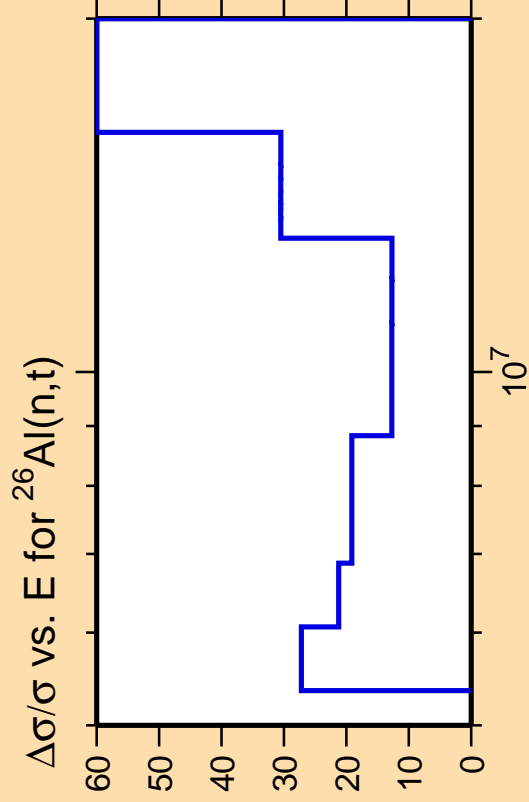


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

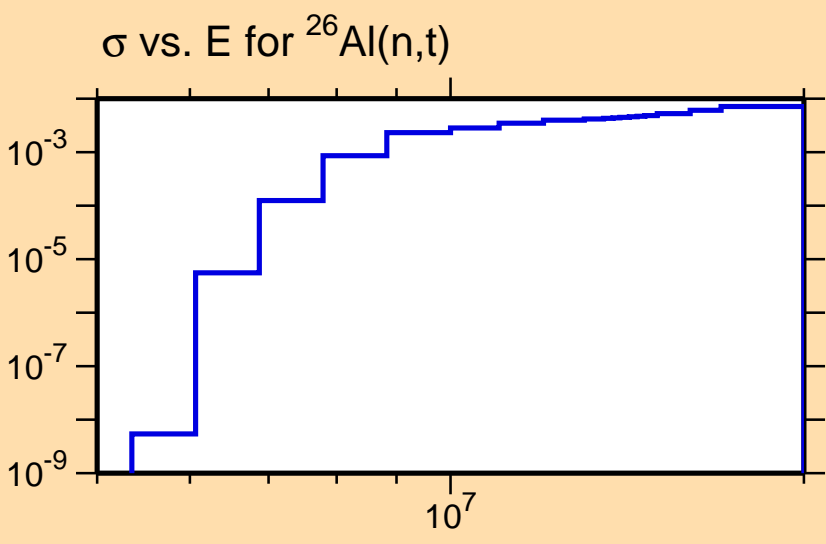


σ vs. E for $^{26}\text{Al}(n,t)$

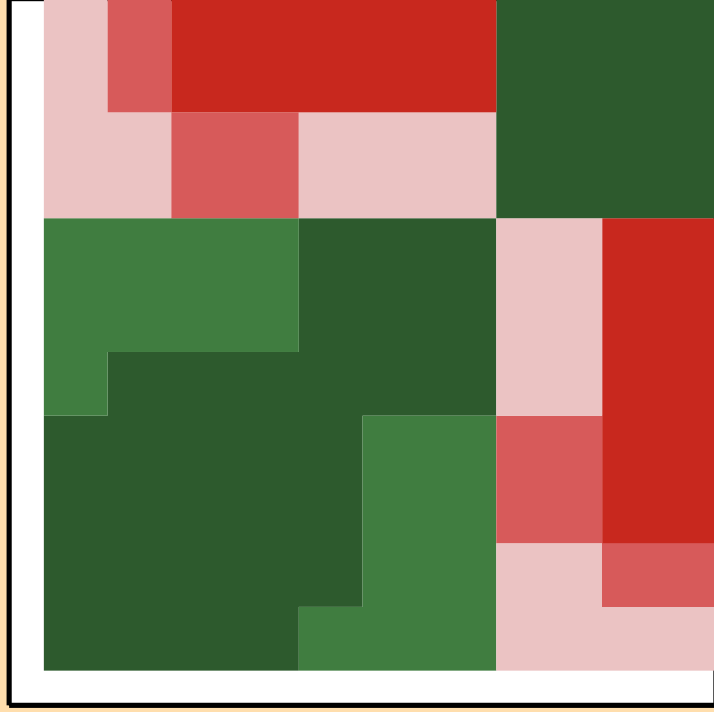

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{He}3)$

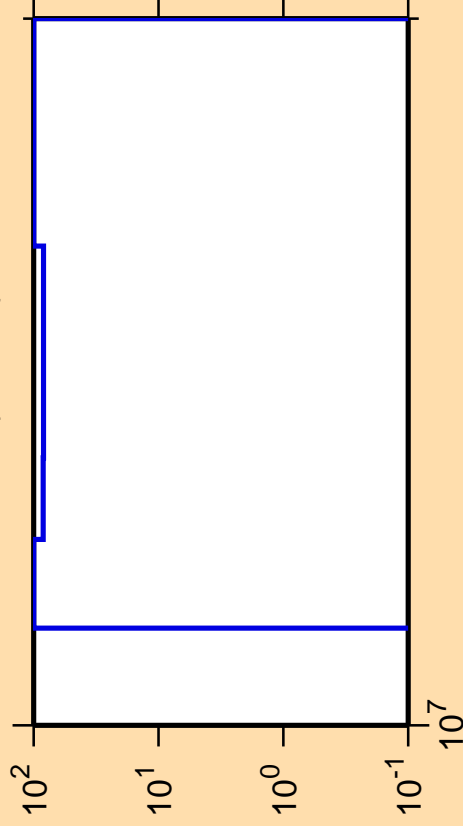


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,\text{He}3)$

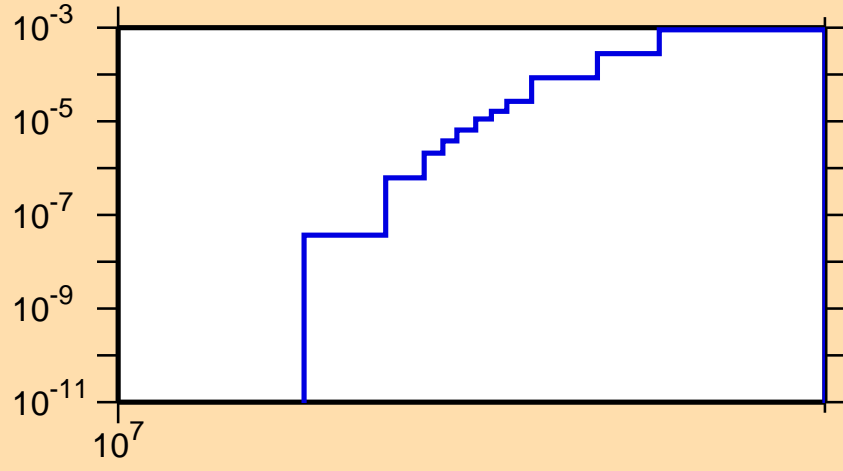


10^7

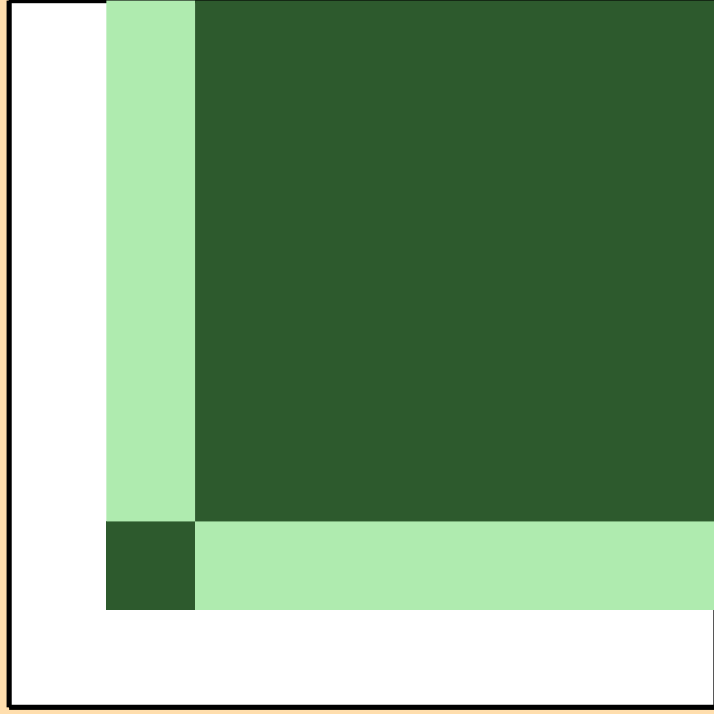

Correlation Matrix





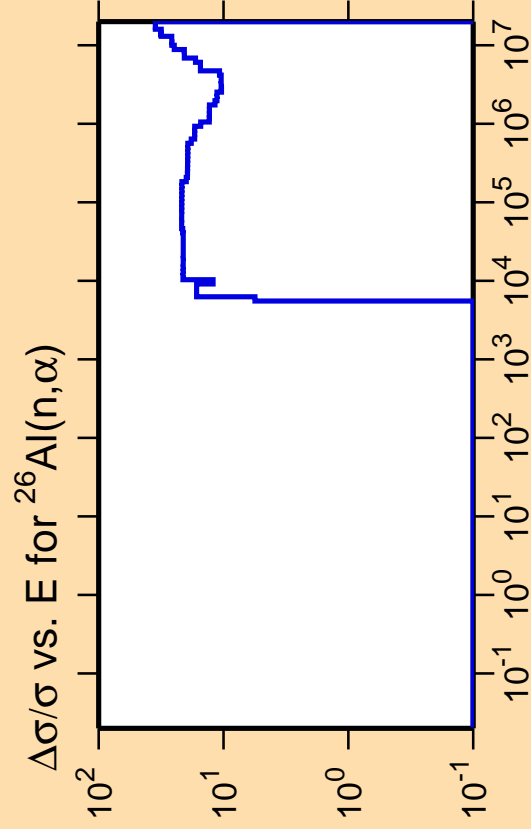

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

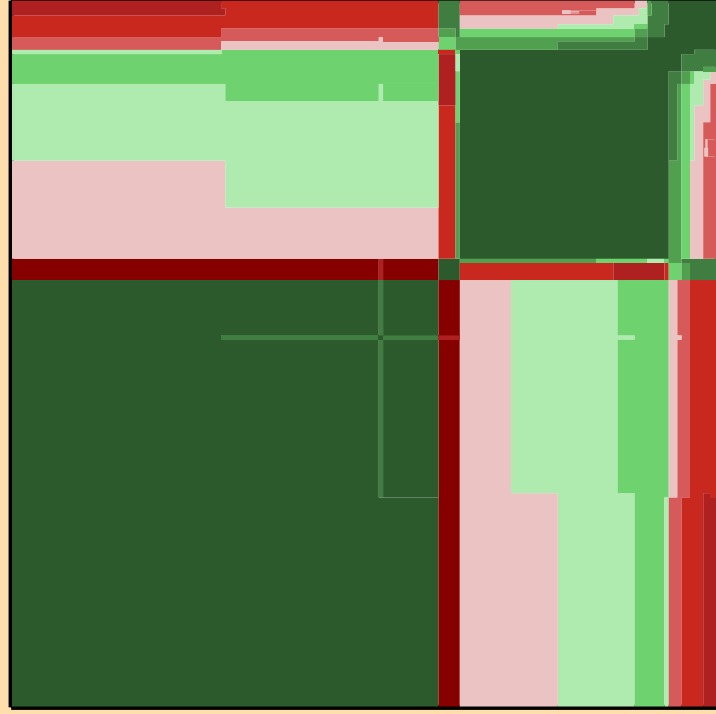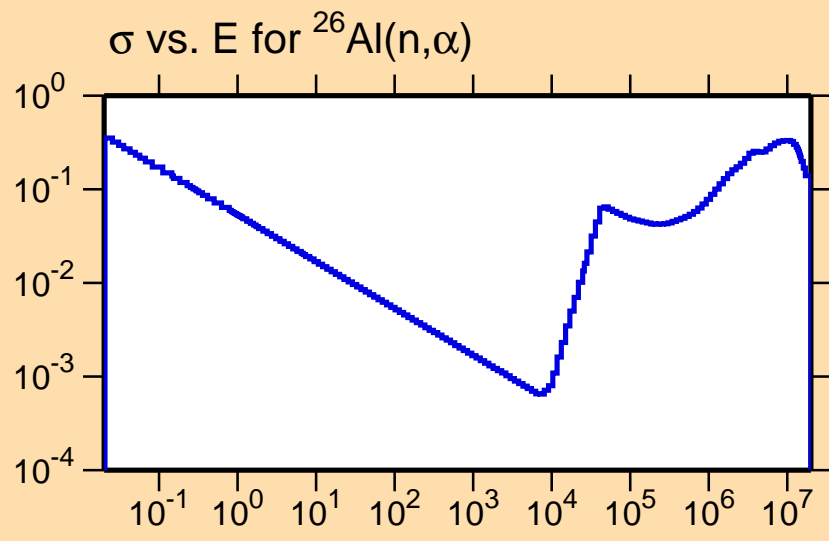

Correlation Matrix




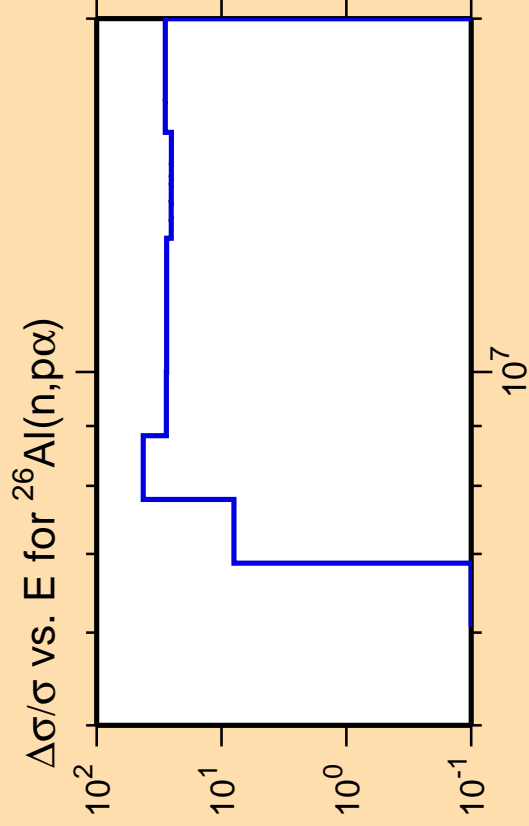

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

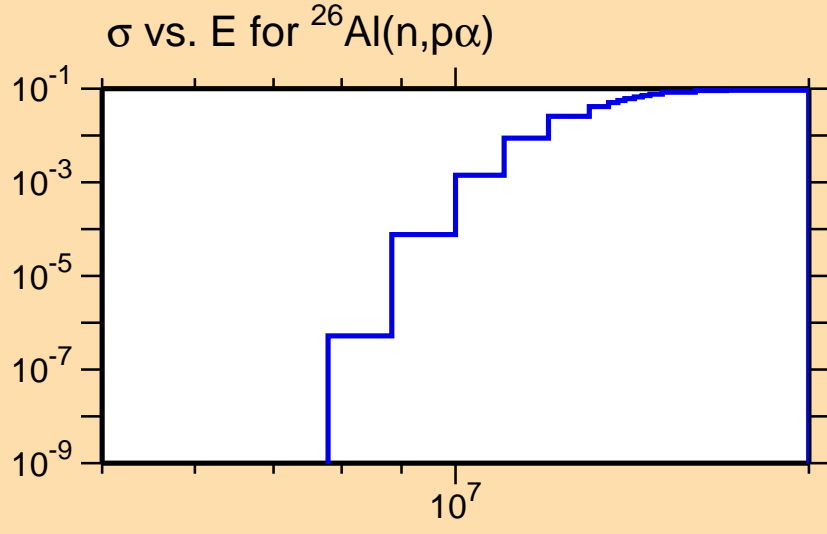

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{pd})$

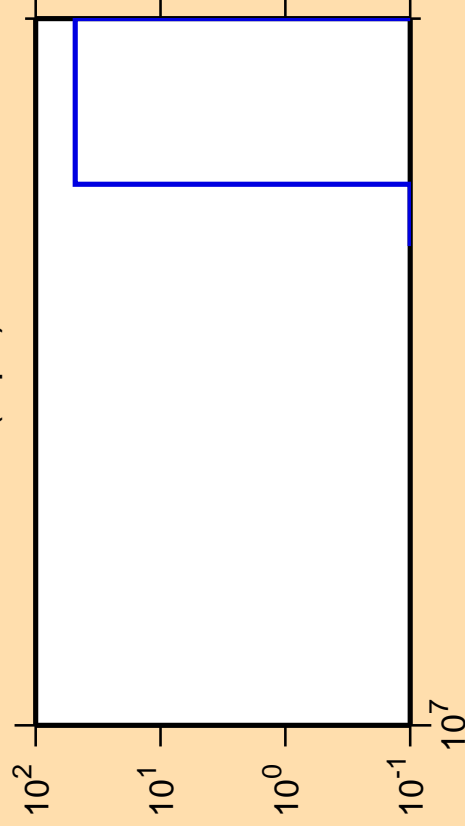


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,\text{pd})$

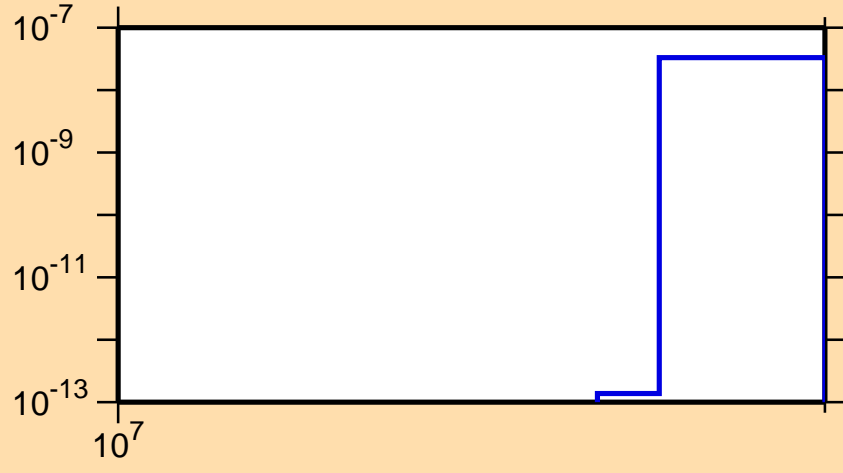

10^7

10^{-13}

10^{-11}

10^{-9}

10^{-7}

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(n,\text{pt})$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(n,\text{pt})$

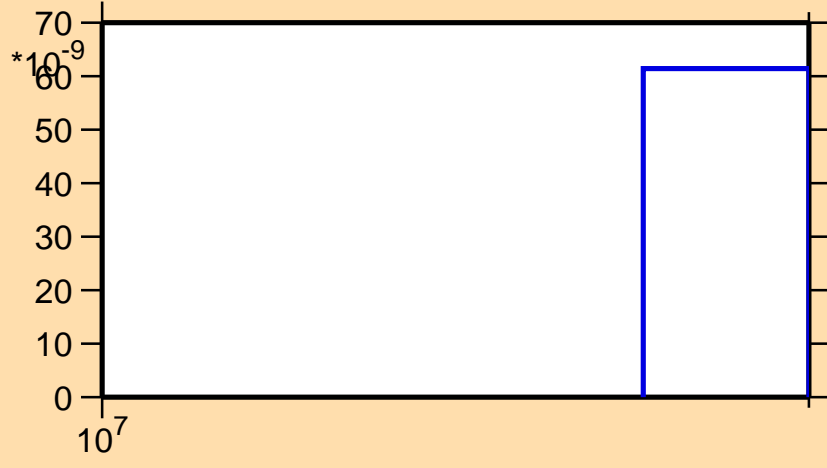


10^7

$\times 10^{-9}$

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{26}\text{Al}(\text{mt117})$

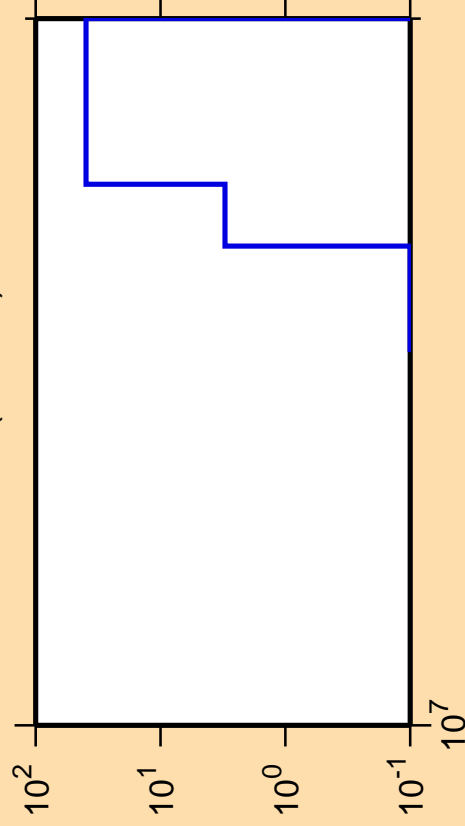


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{26}\text{Al}(\text{mt117})$

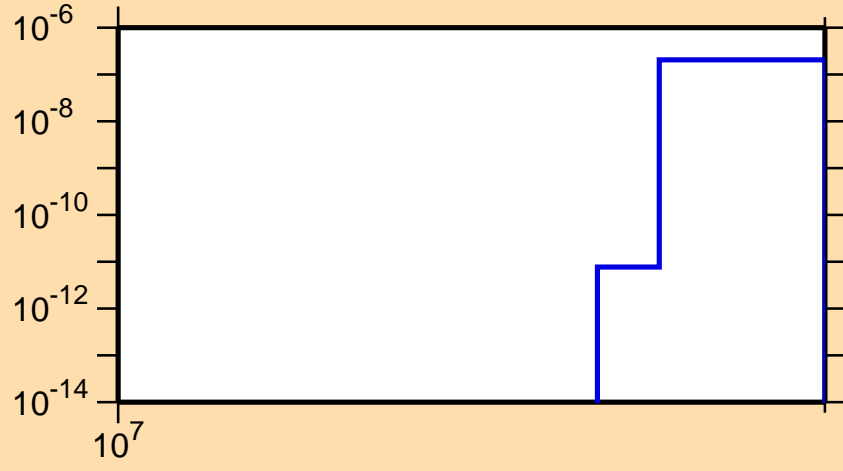

10^7

10^{-6}

10^{-8}

10^{-10}

10^{-12}

10^{-14}

Correlation Matrix



1.0

0.8

0.6

0.4

0.2

0.0

-1.0

-0.8

-0.6

-0.4

-0.2

0.0