




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{tot.})$

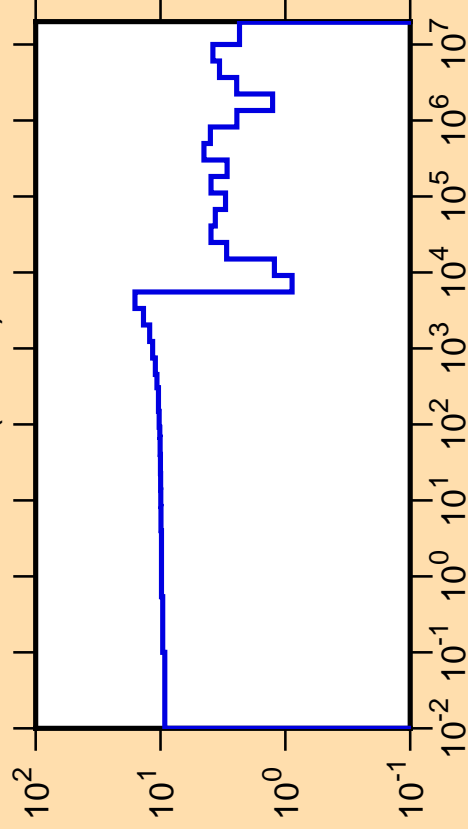

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,\text{tot.})$

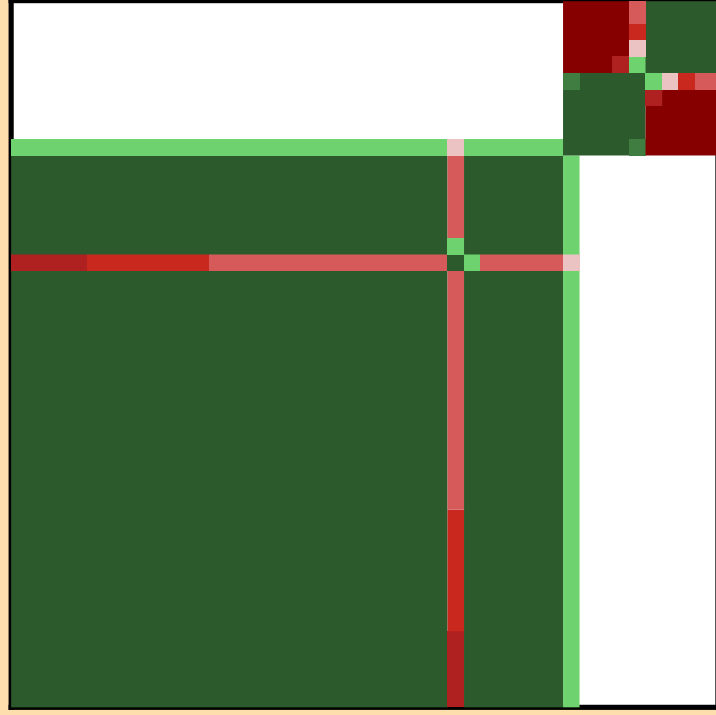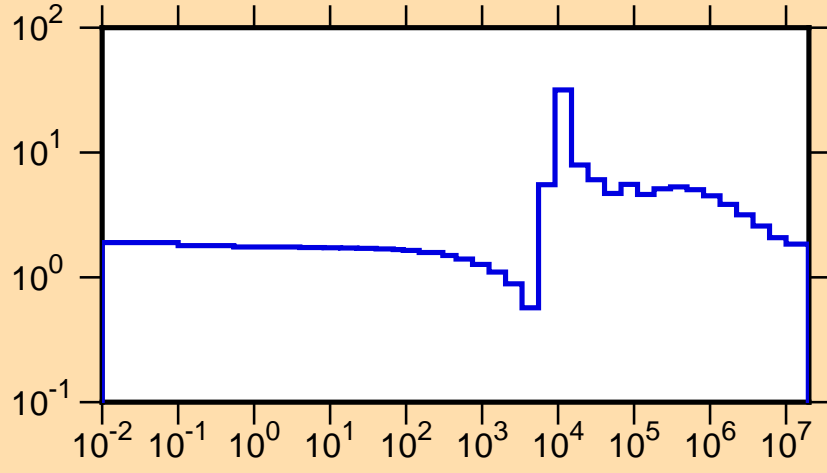

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

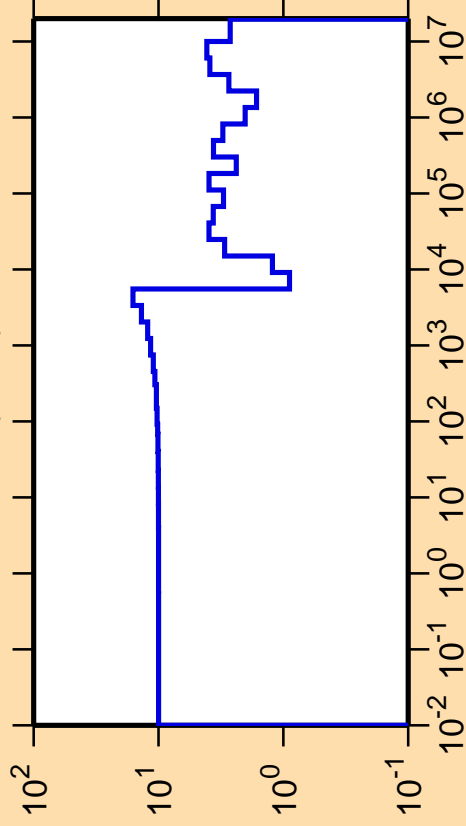

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{tot.})$

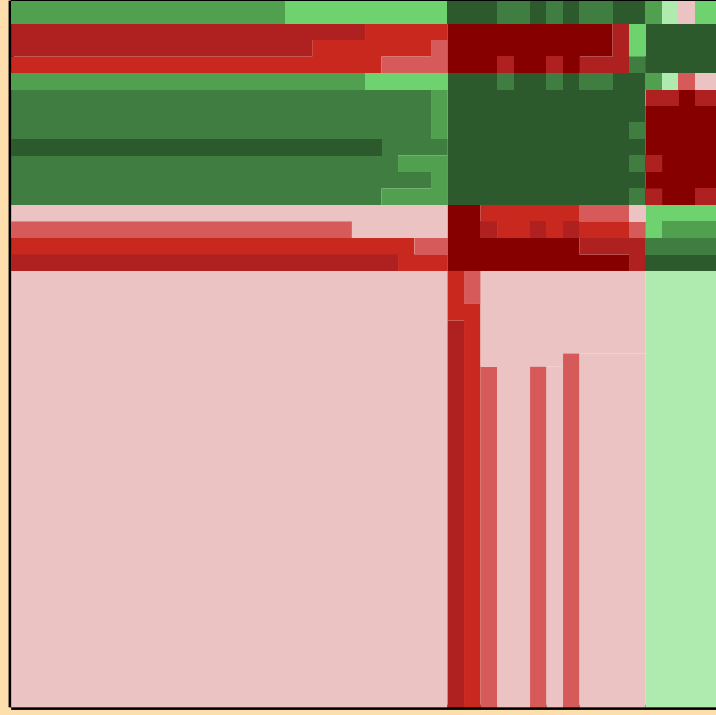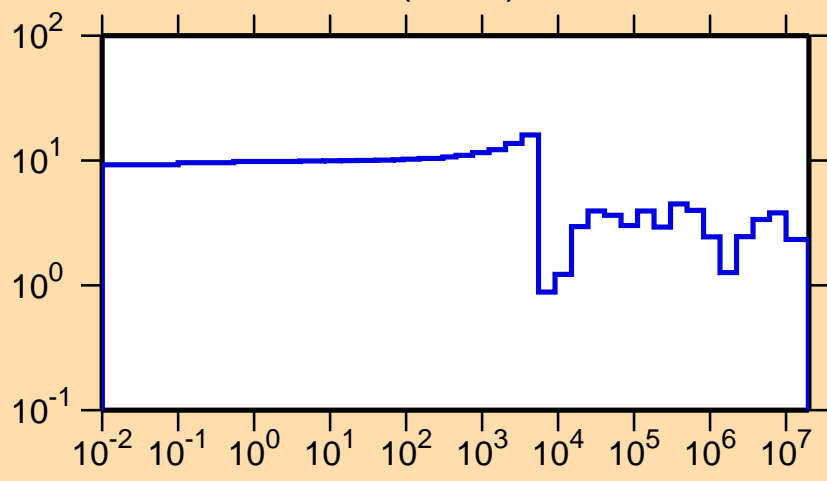

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

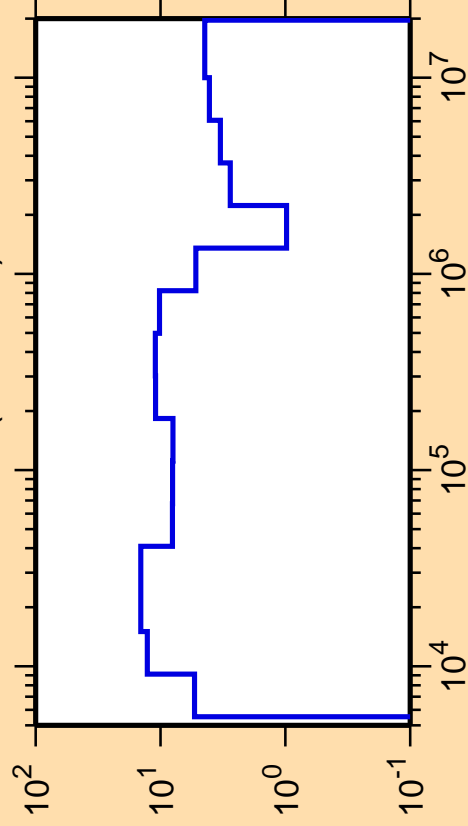

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{tot.})$

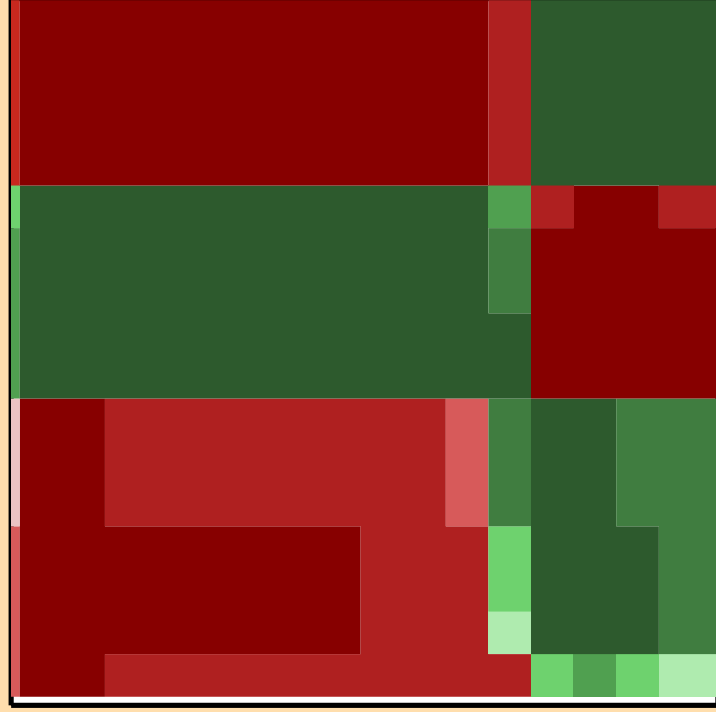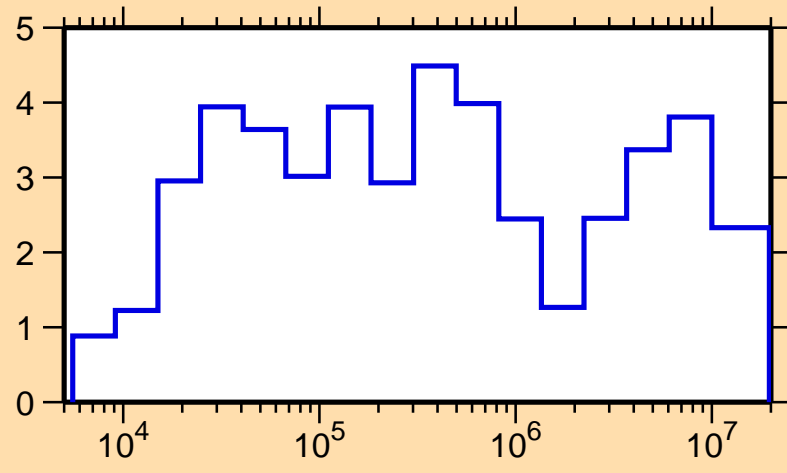

Correlation Matrix




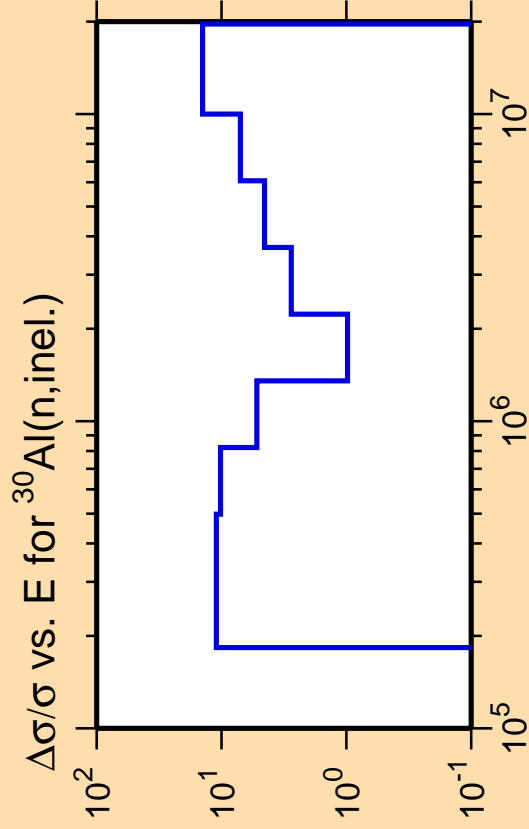

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{tot.})$

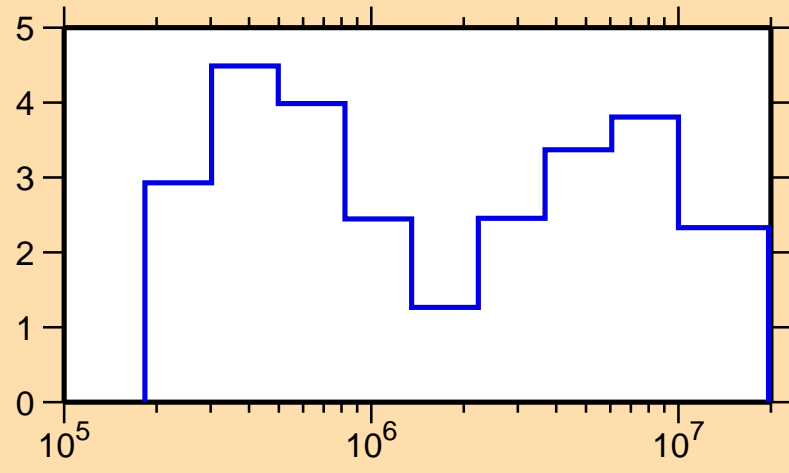

Correlation Matrix





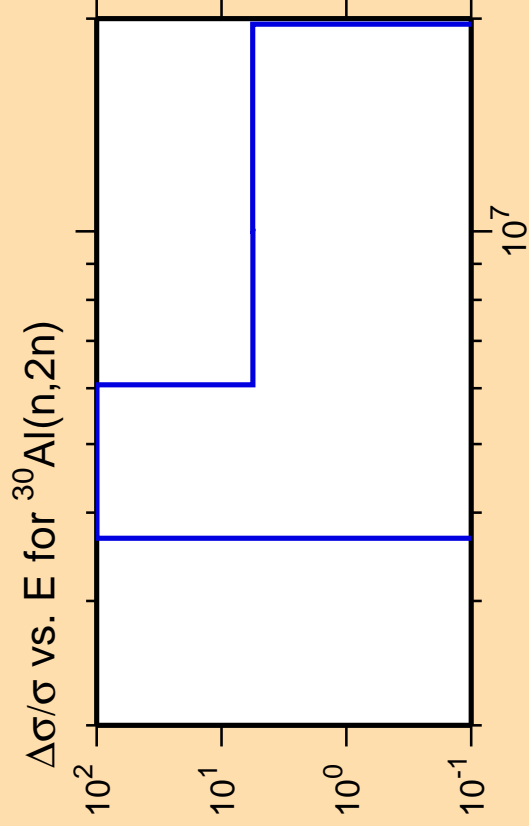

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

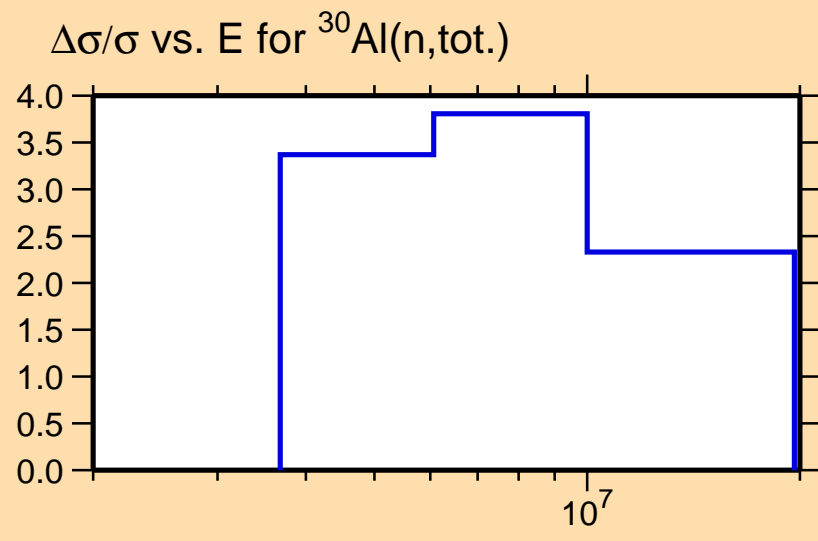

Correlation Matrix





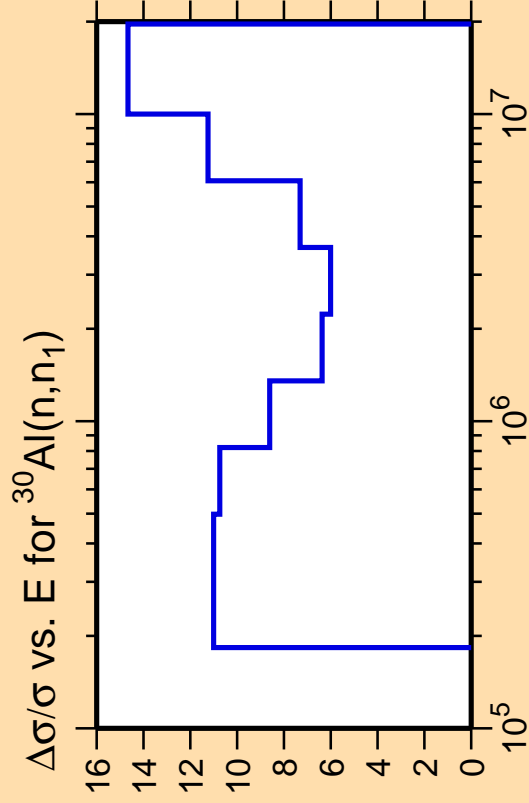

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{tot.})$

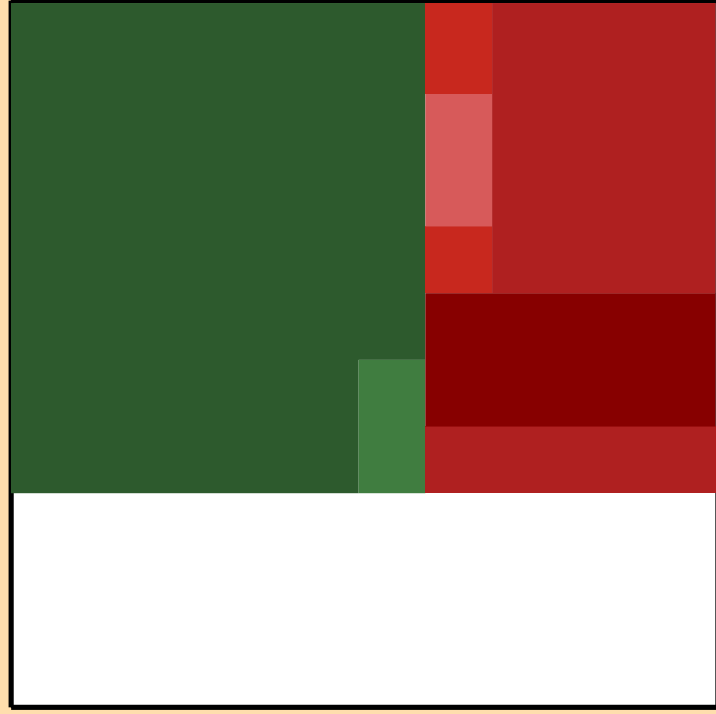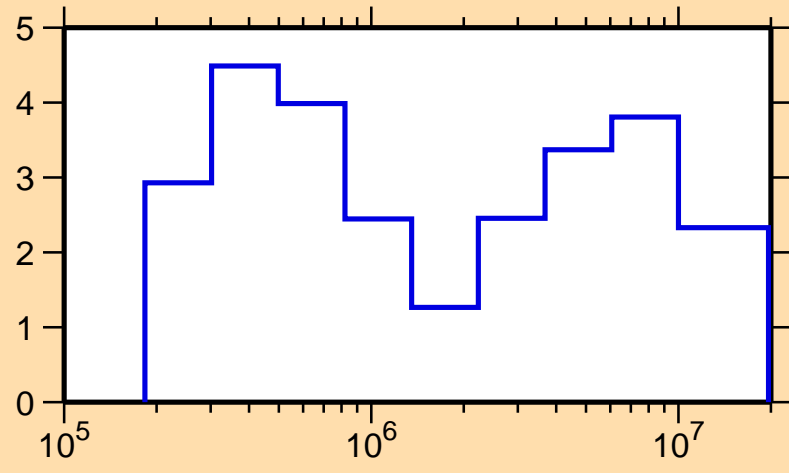

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n\text{cont.})$


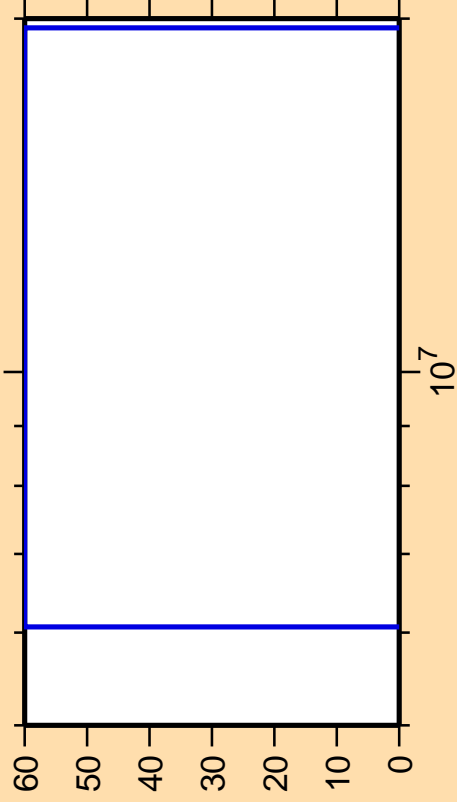


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{tot.})$

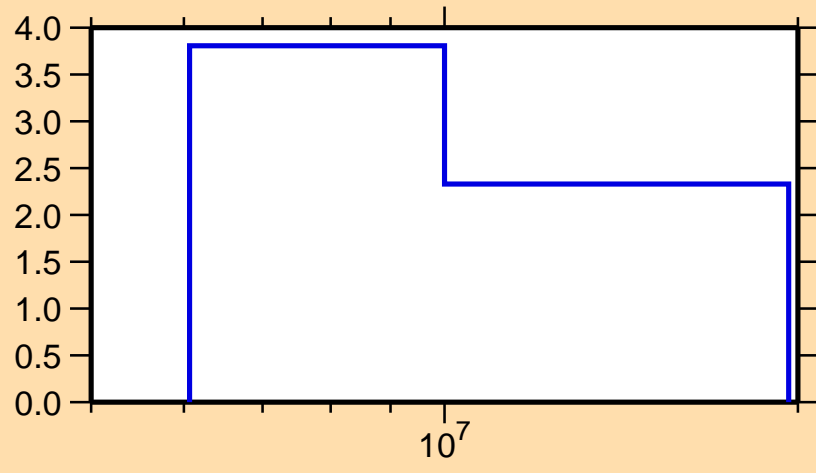


Correlation Matrix



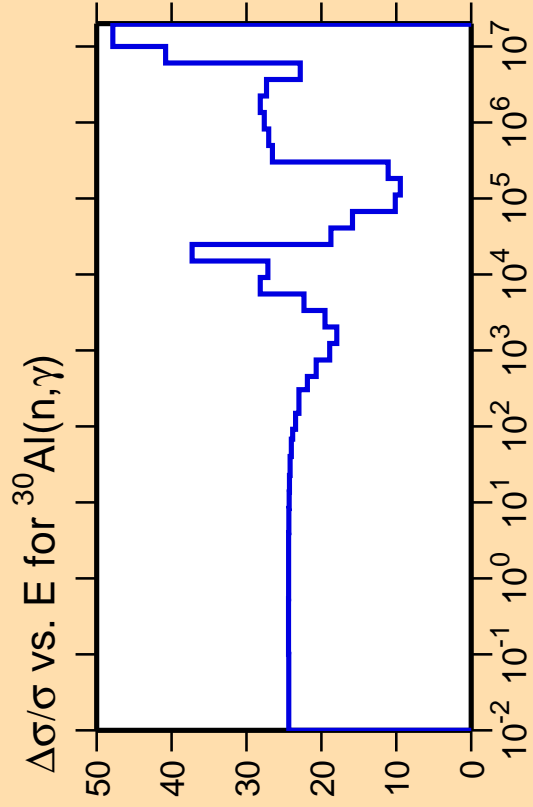


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

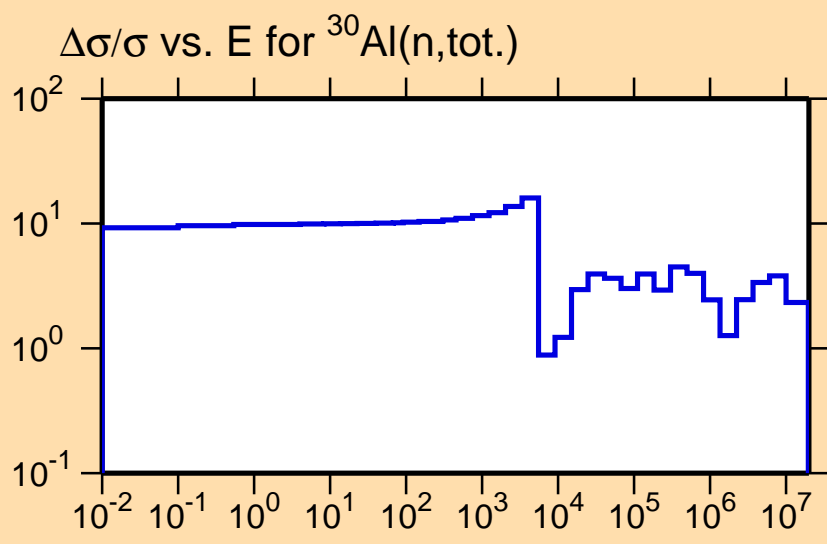



Correlation Matrix



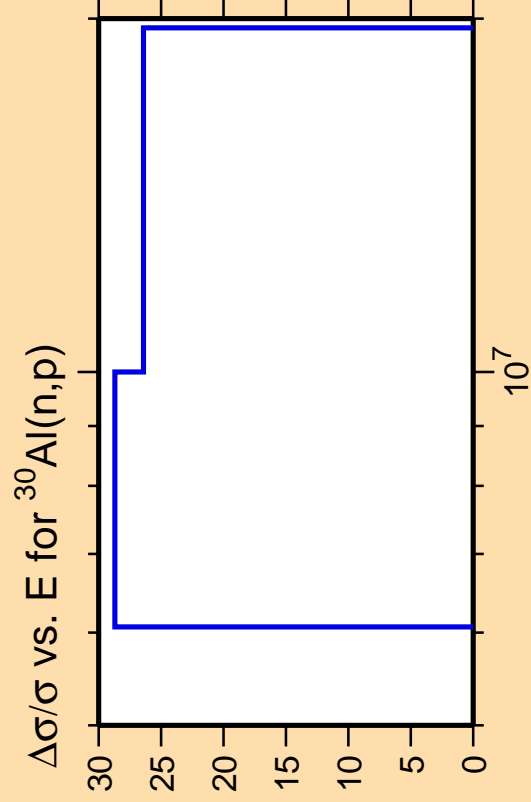

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

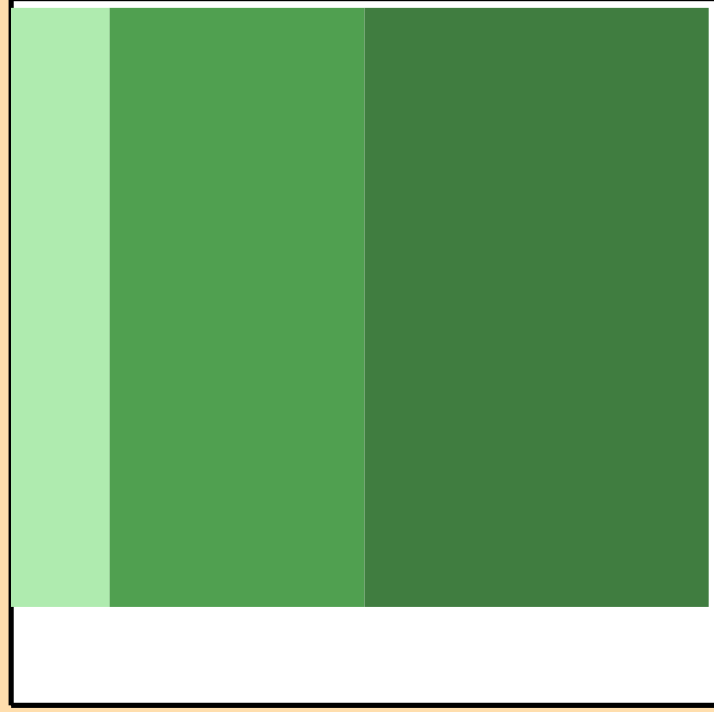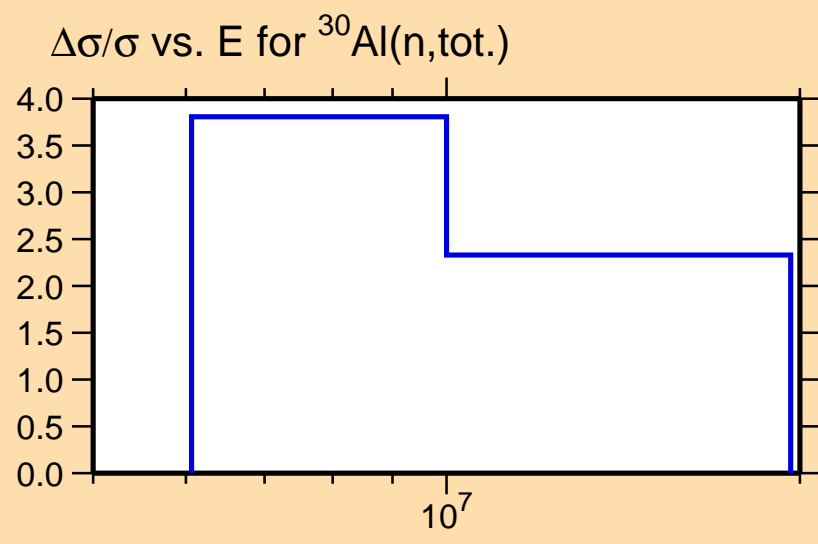

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\alpha)$

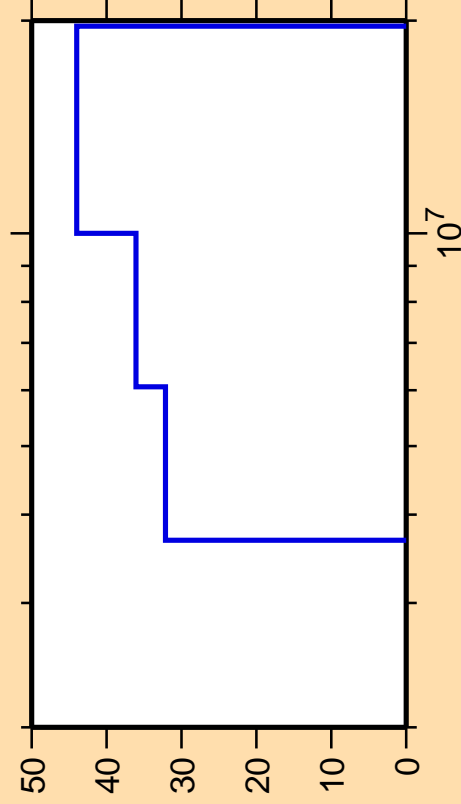

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{tot.})$

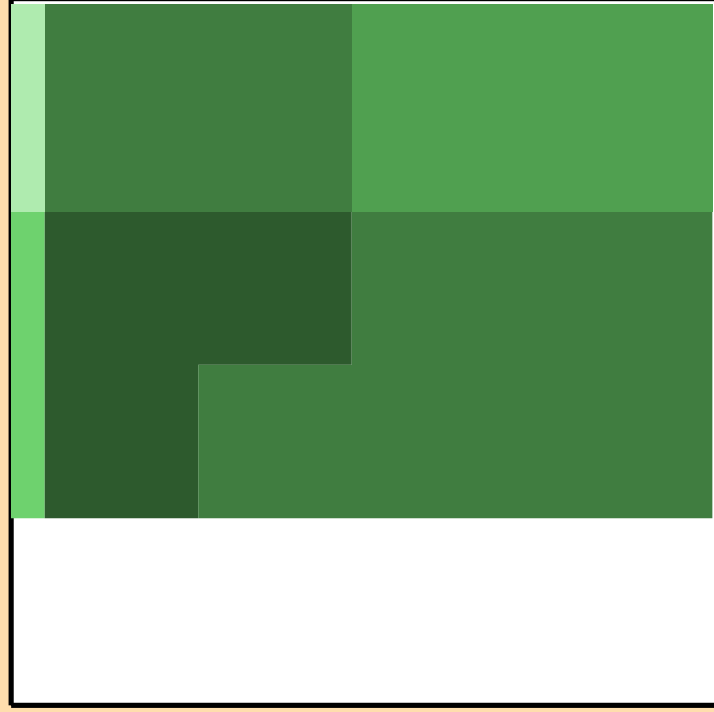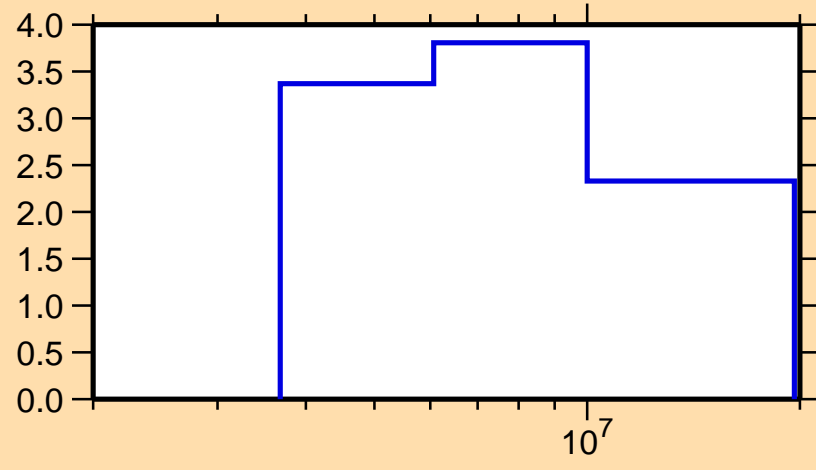

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

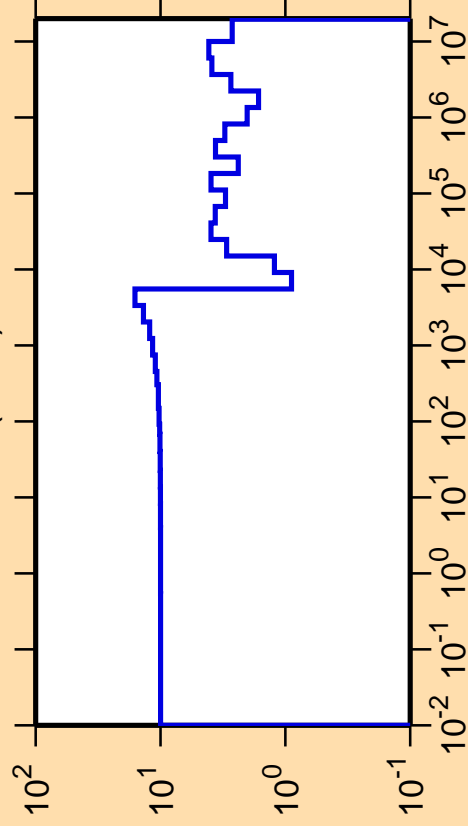

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,\text{el.})$

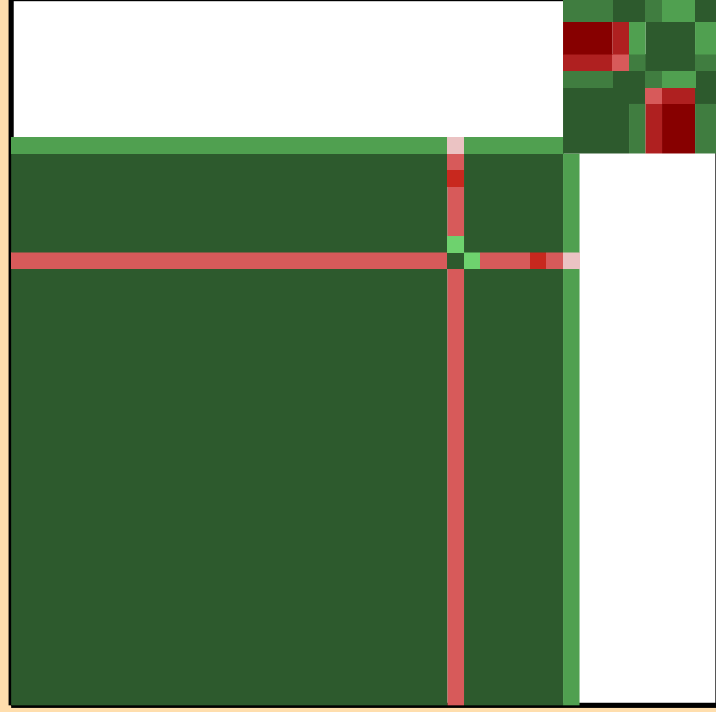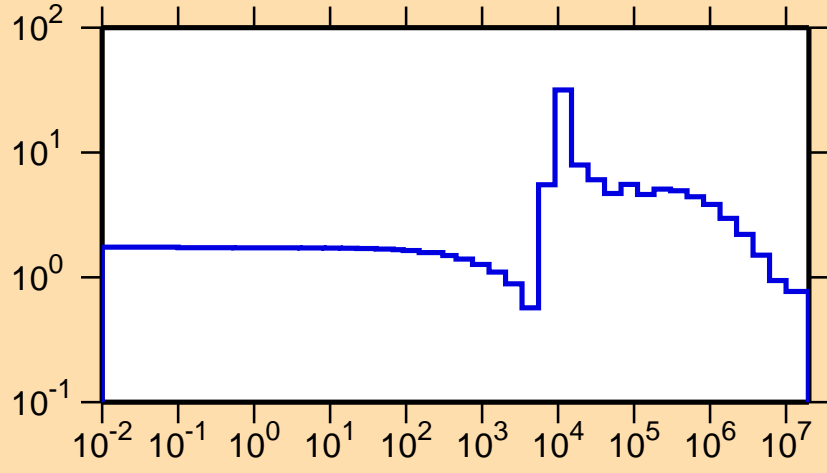

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

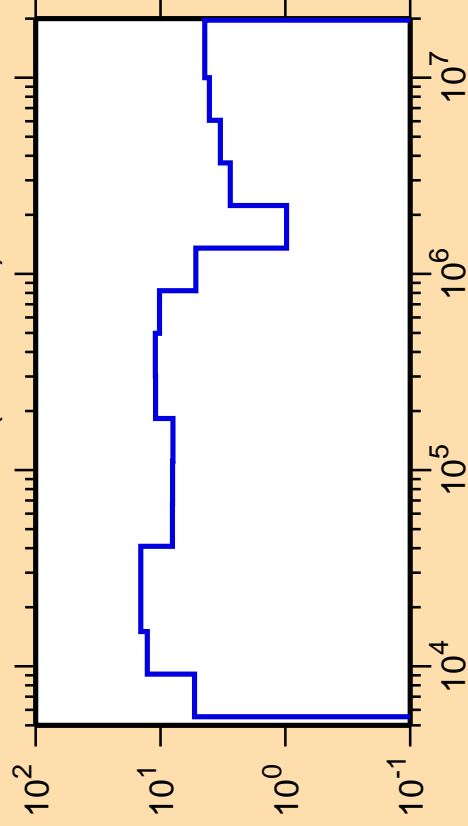

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

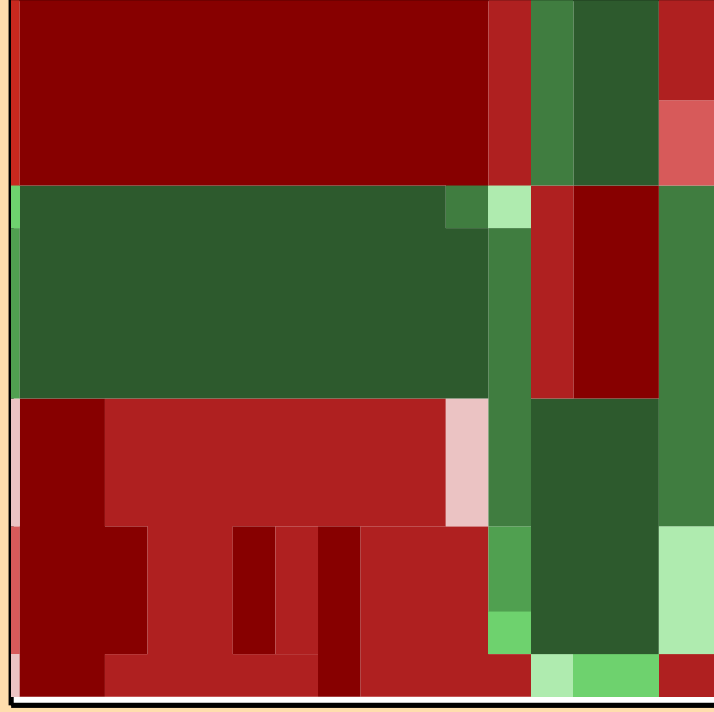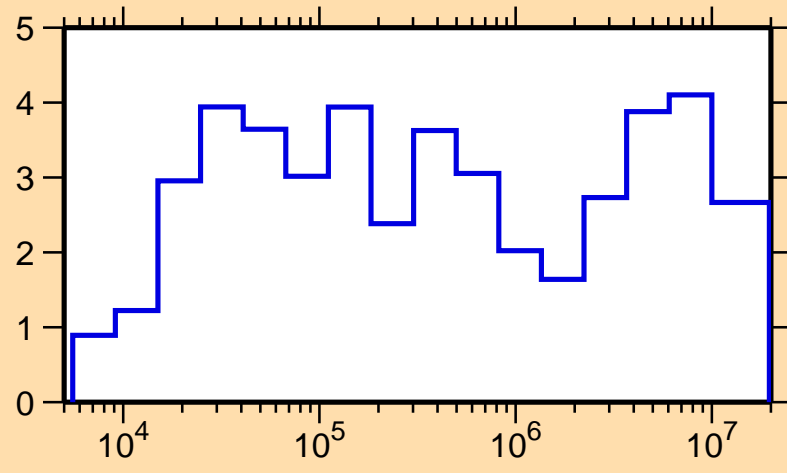

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{inel.})$

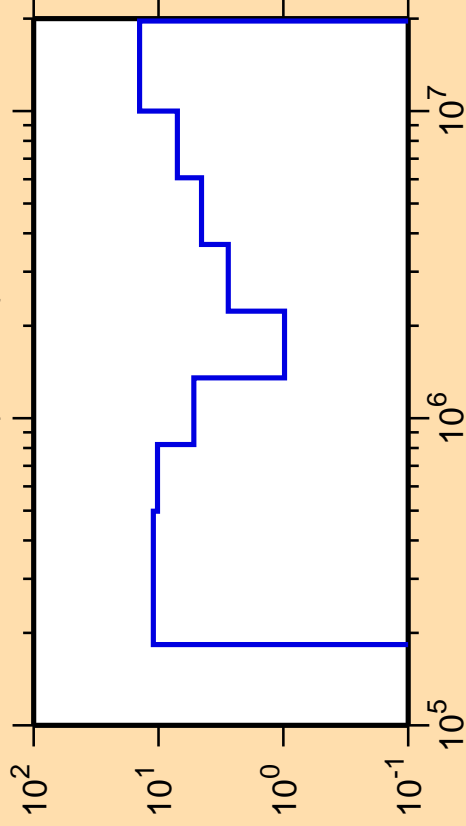

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

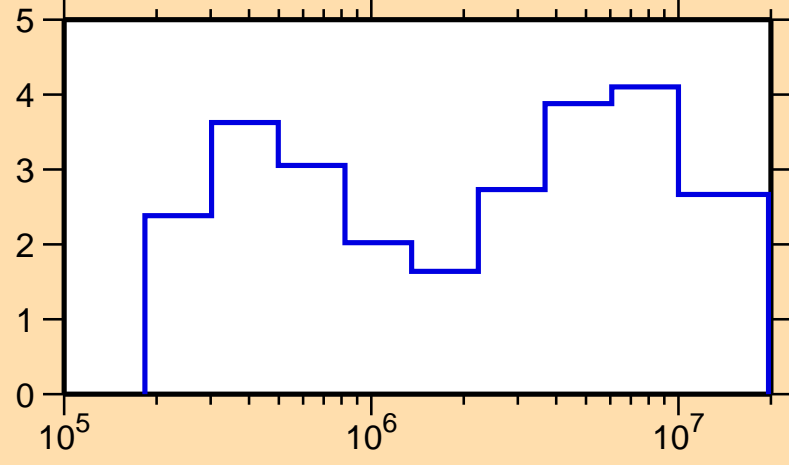

Correlation Matrix





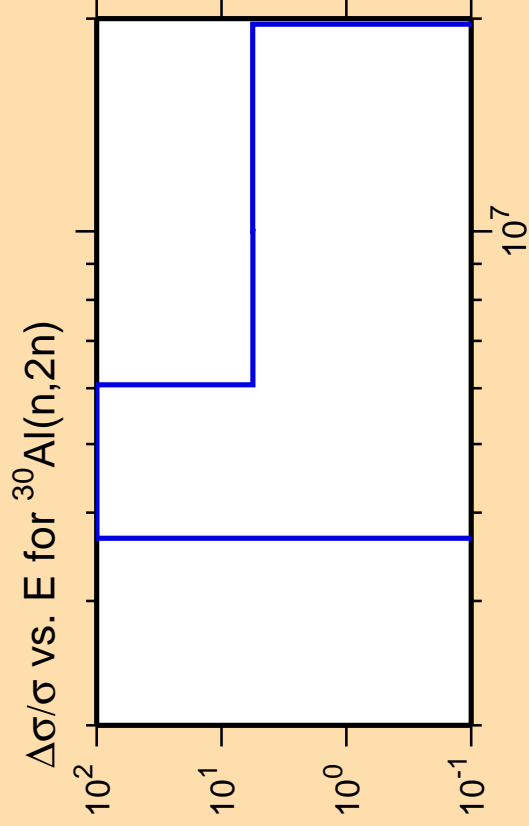

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

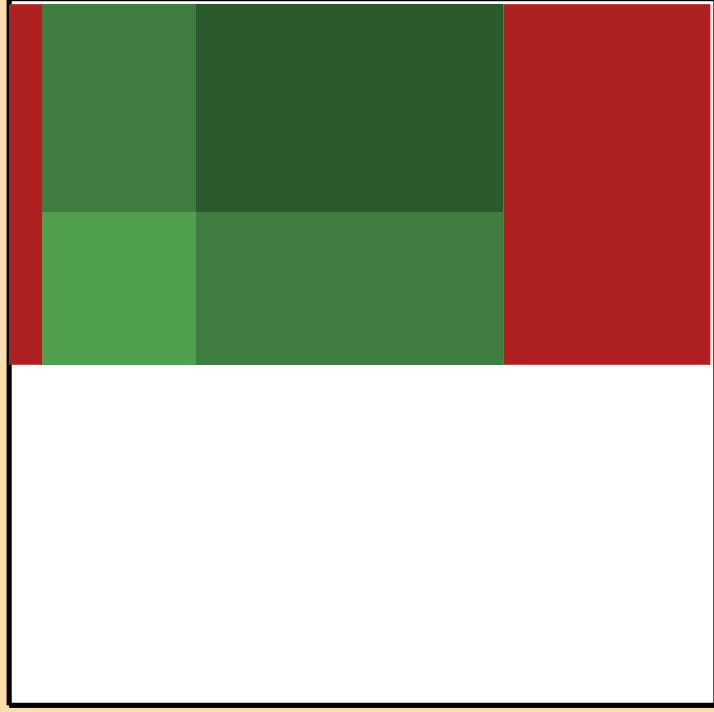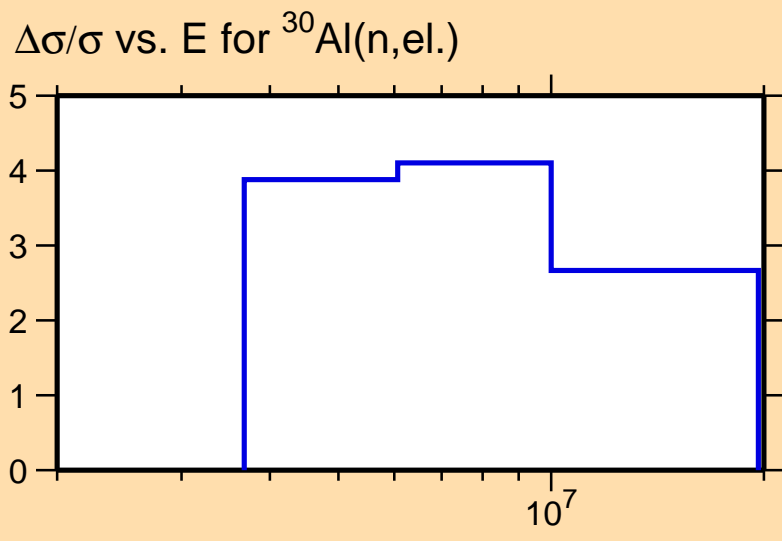

Correlation Matrix





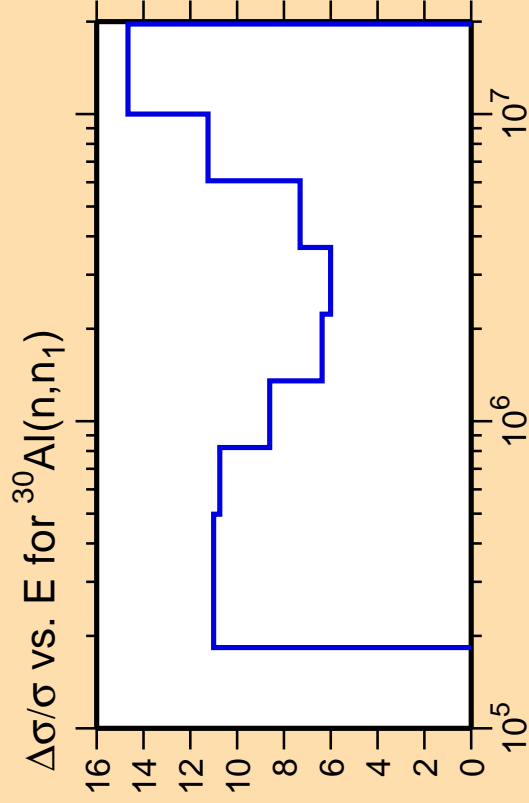

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

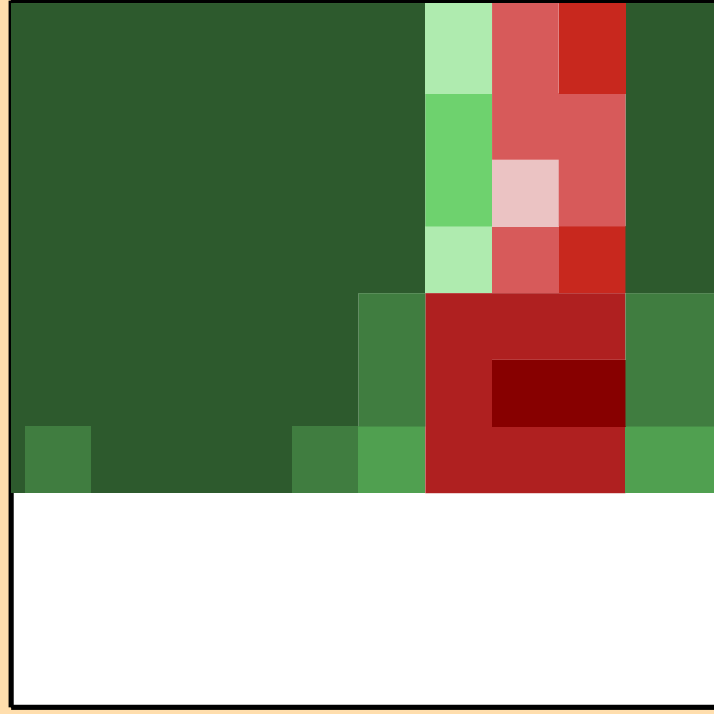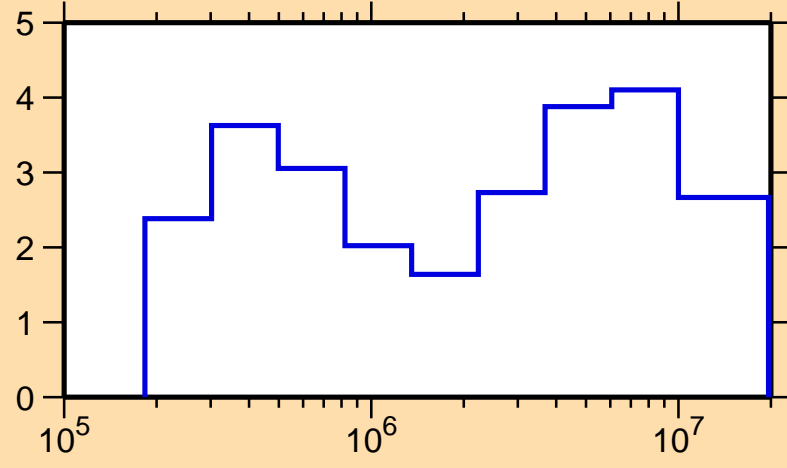

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n\text{cont.})$





Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

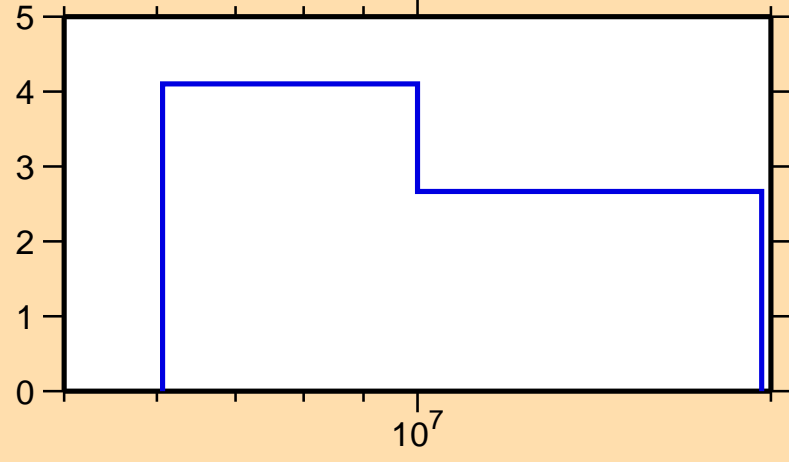


Correlation Matrix



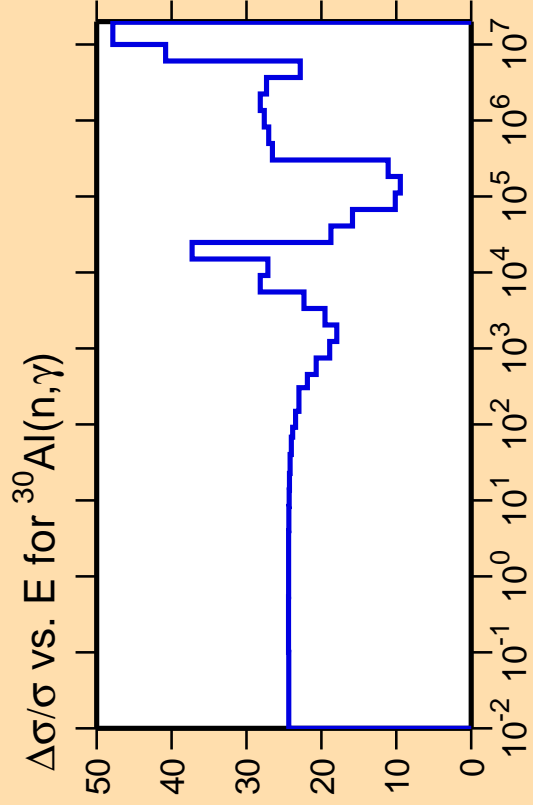

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

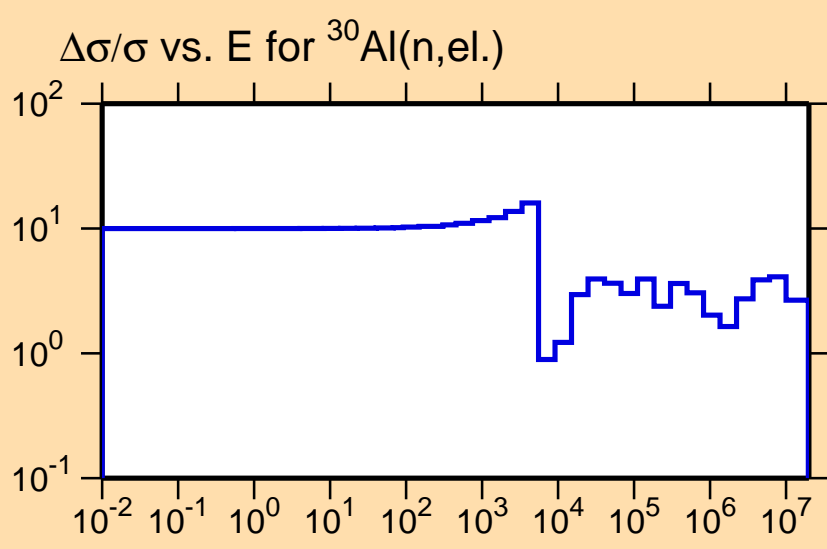

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

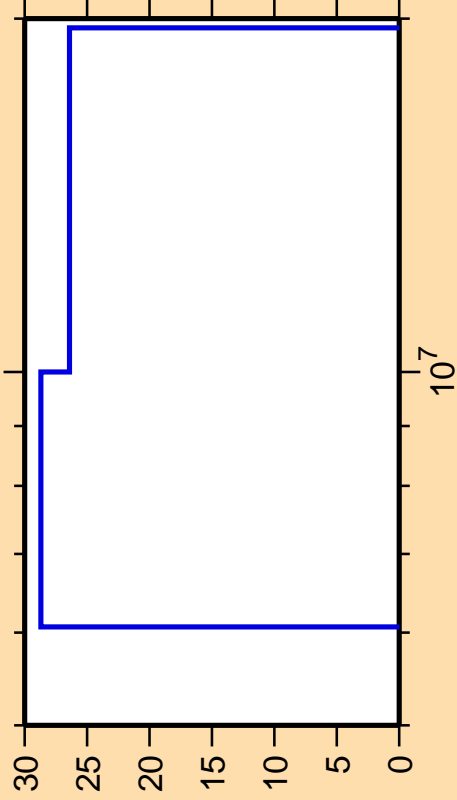

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

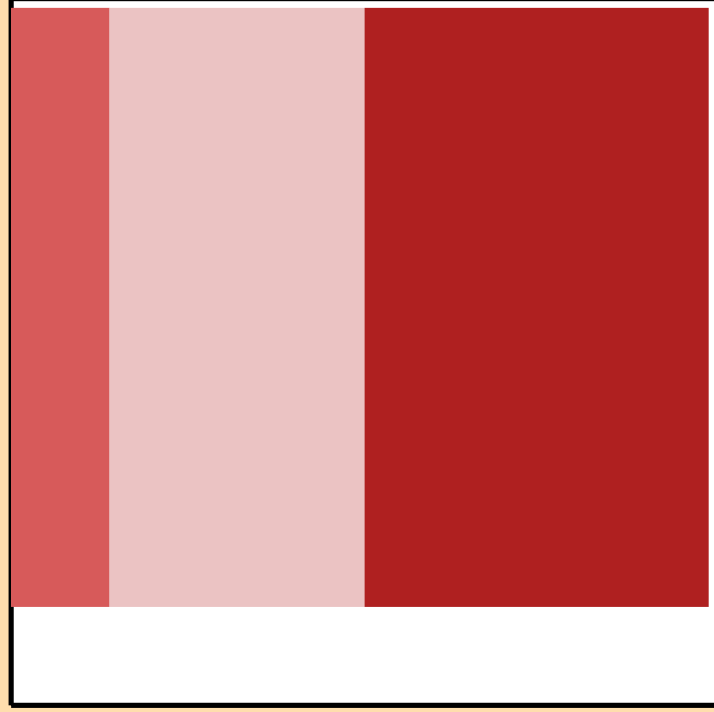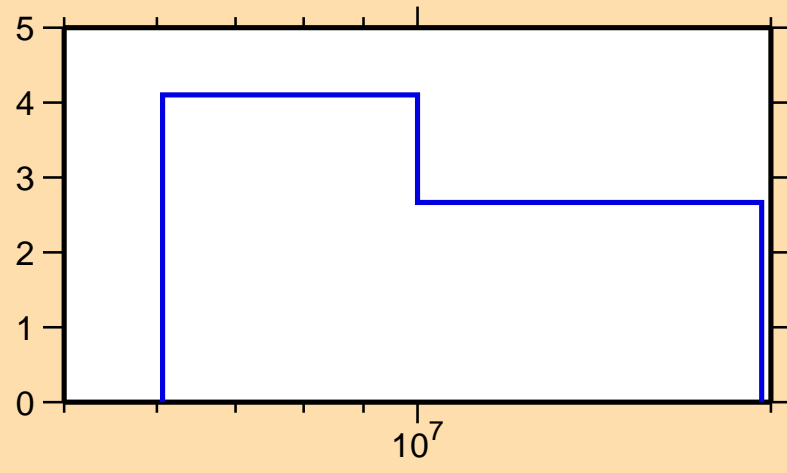

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\alpha)$

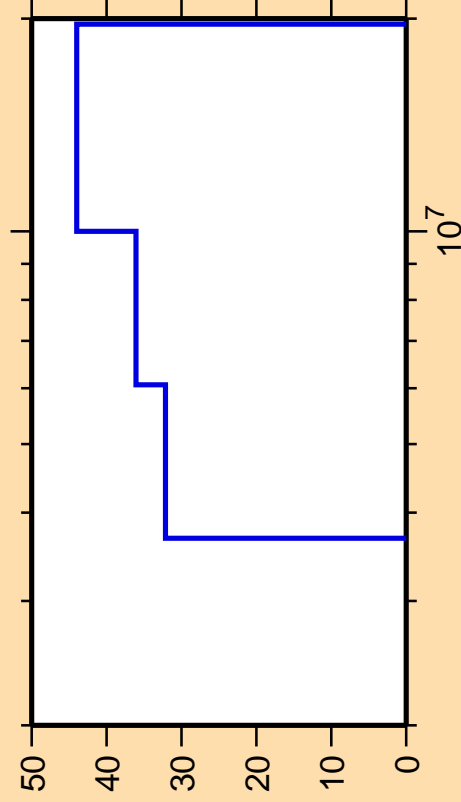

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{el.})$

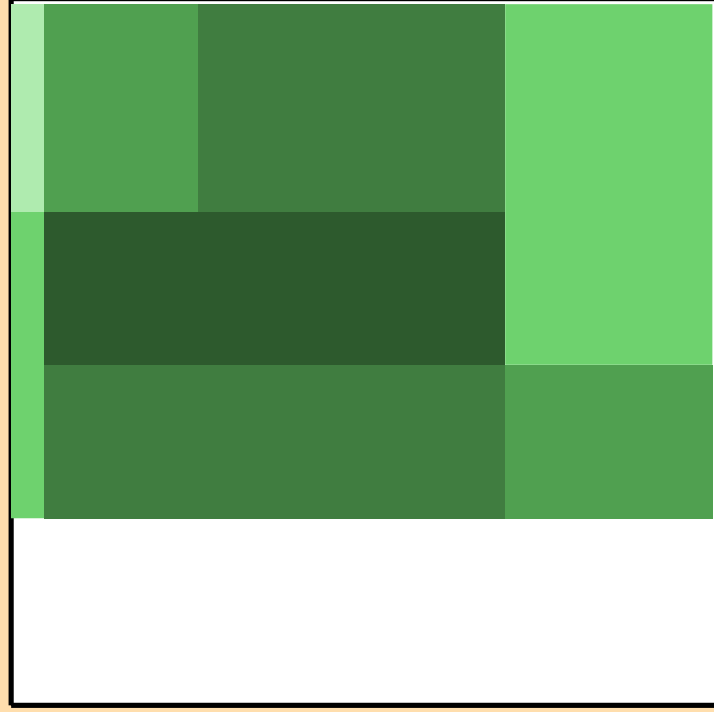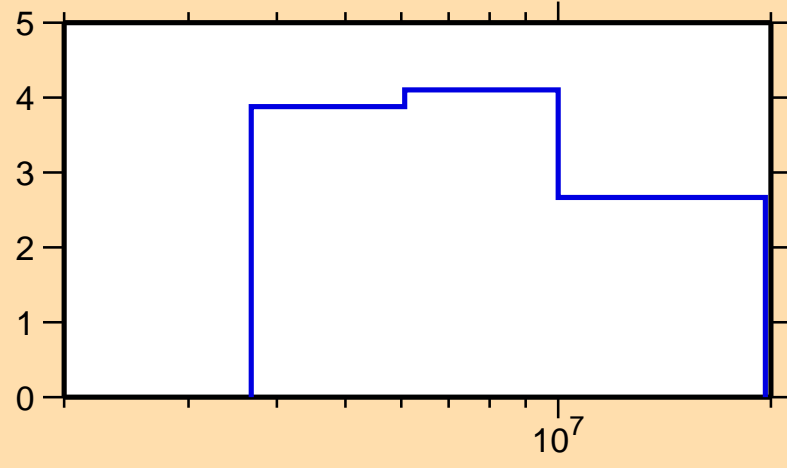

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

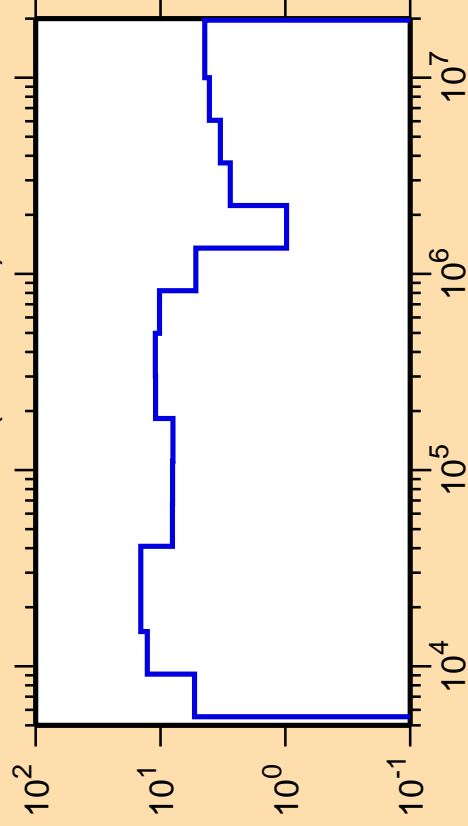

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

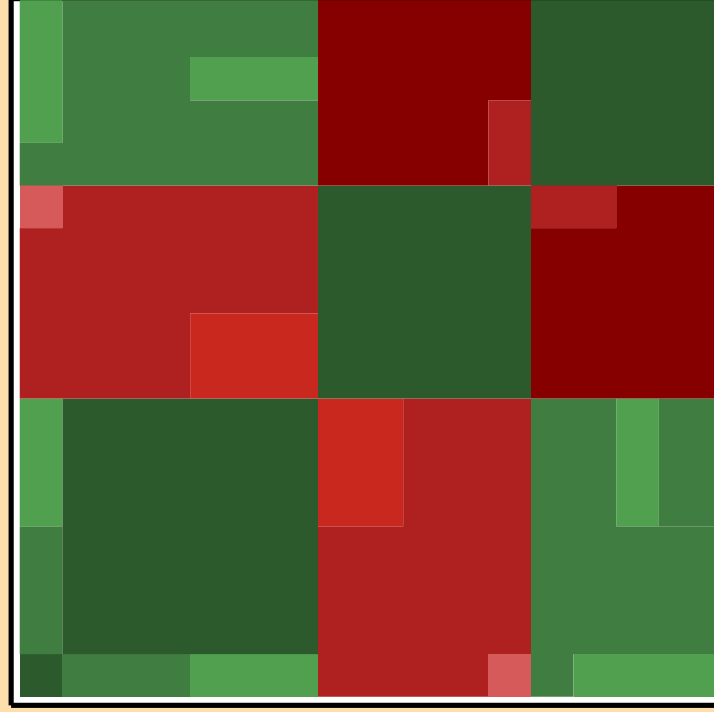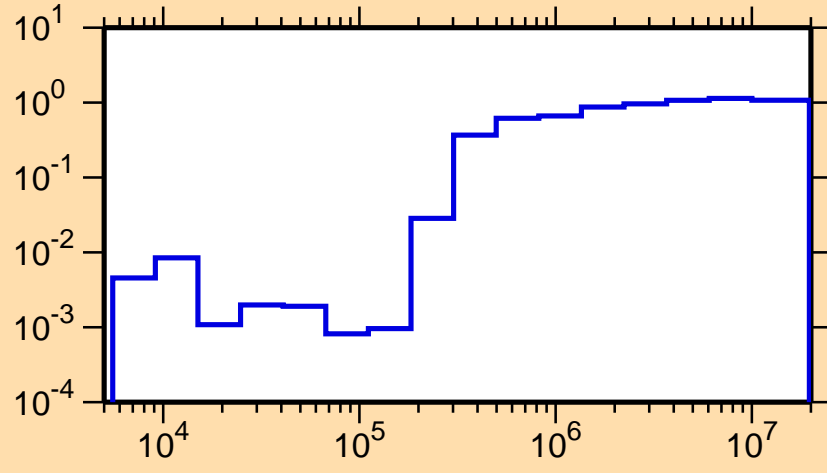

Correlation Matrix




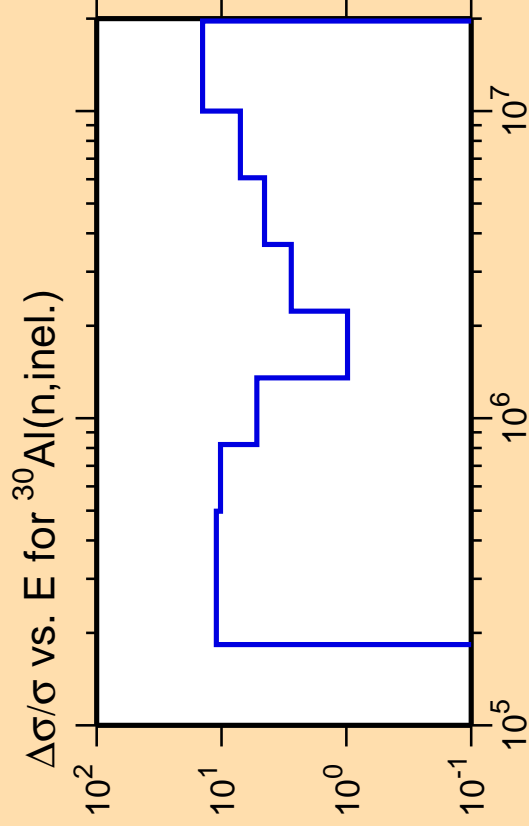

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

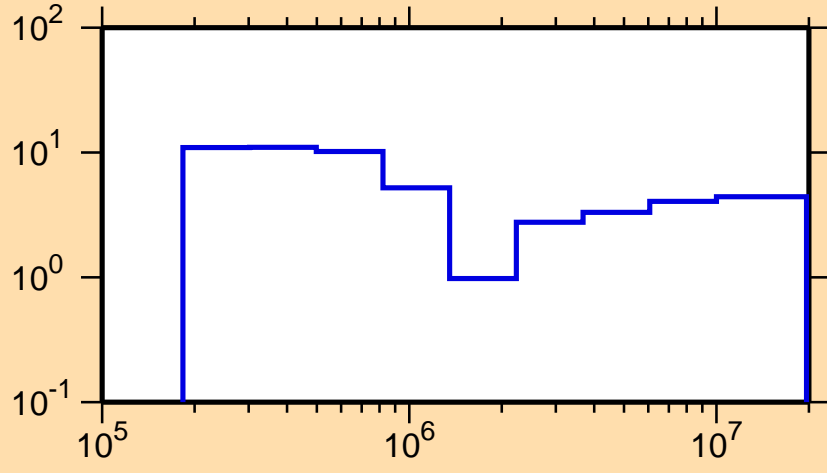

Correlation Matrix




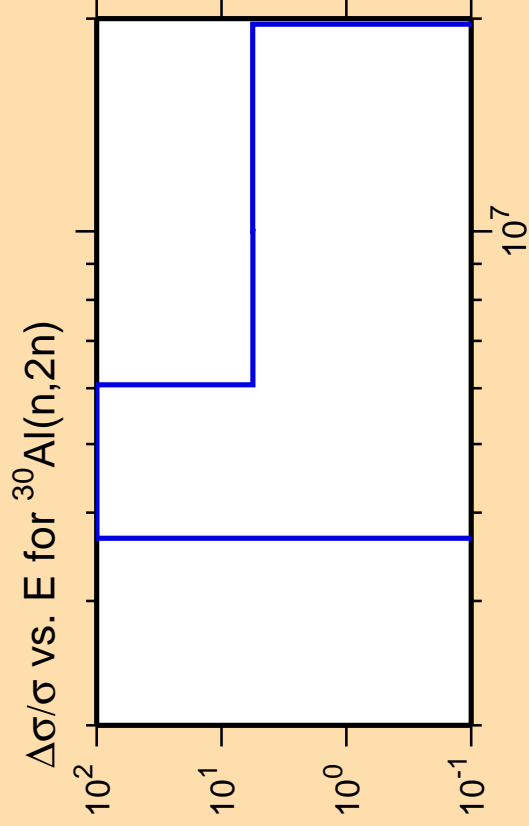


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

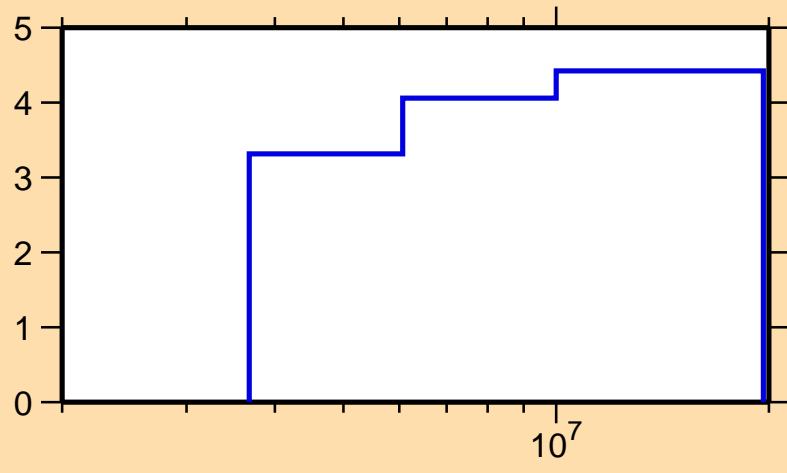

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_1)$

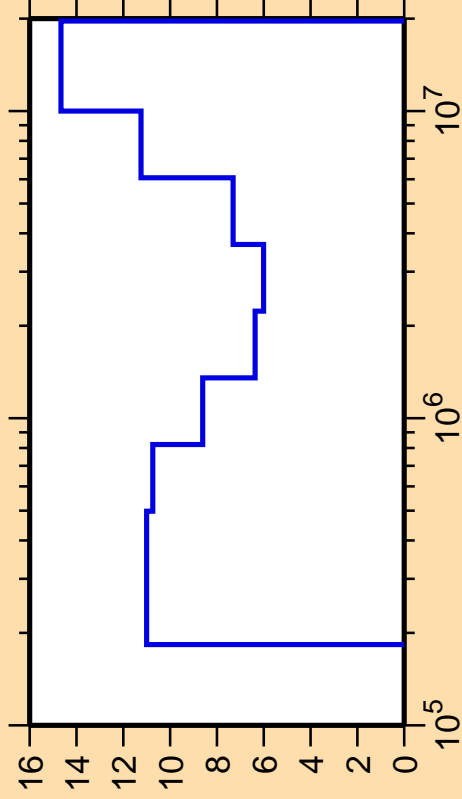

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

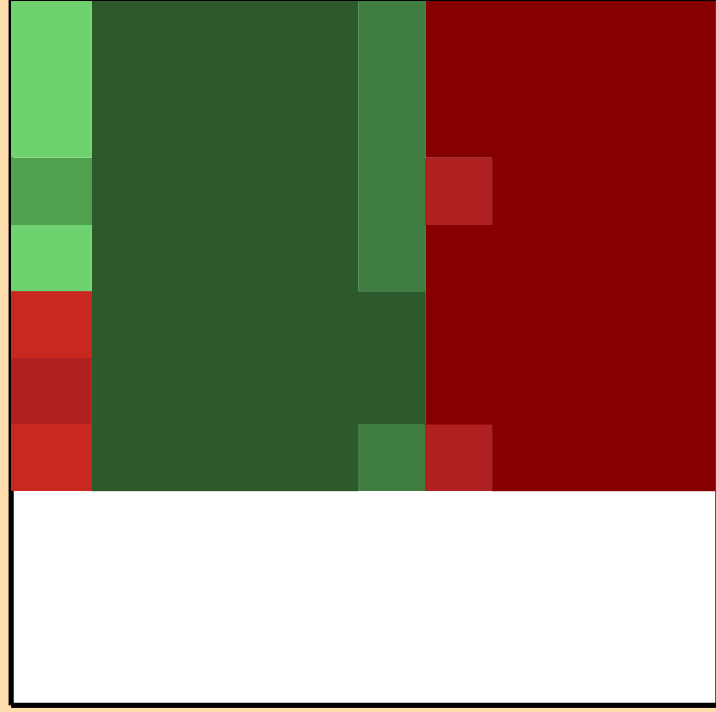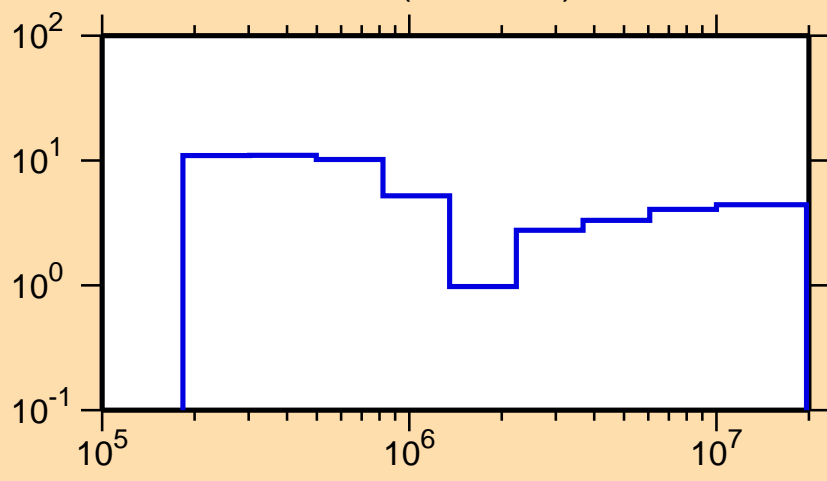

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n\text{cont.})$





Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

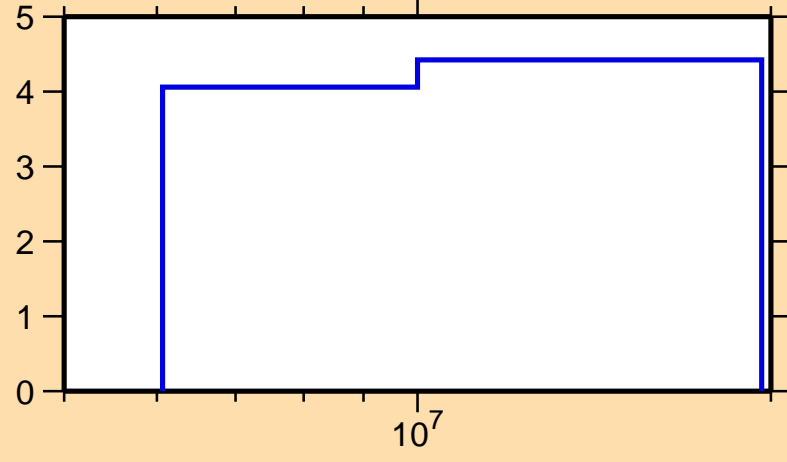



Correlation Matrix



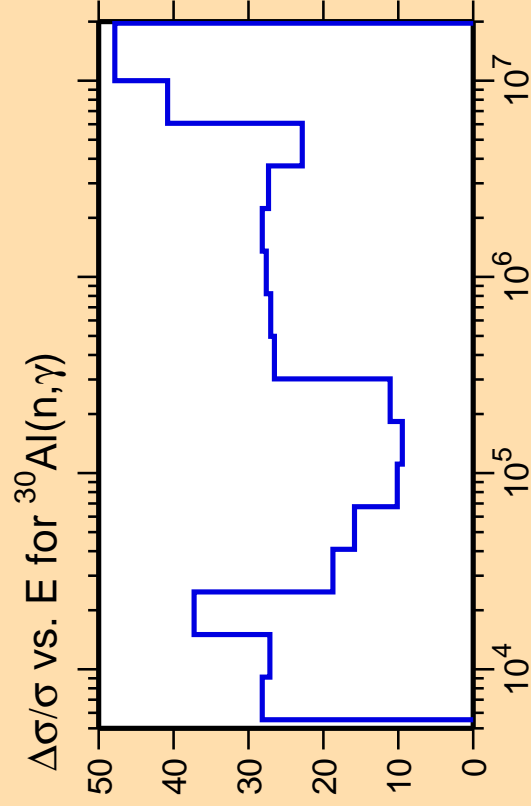

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

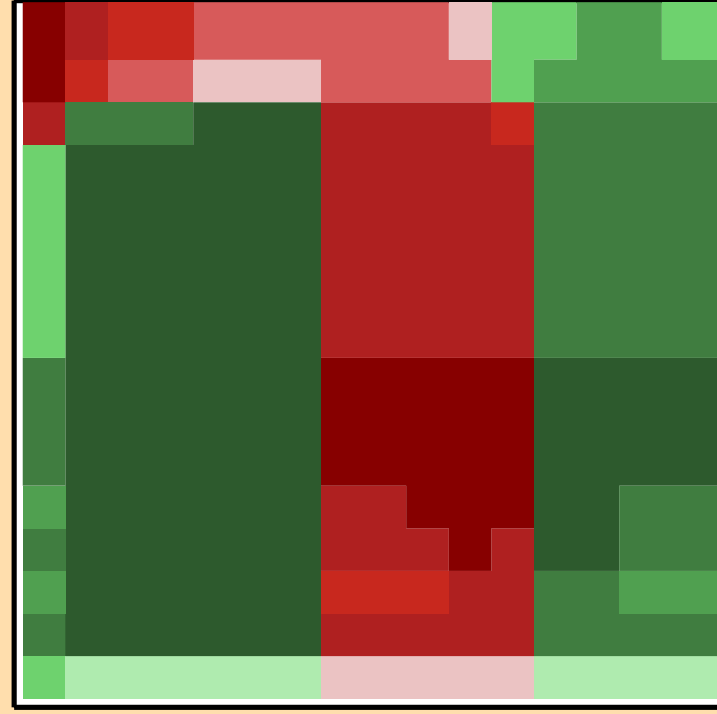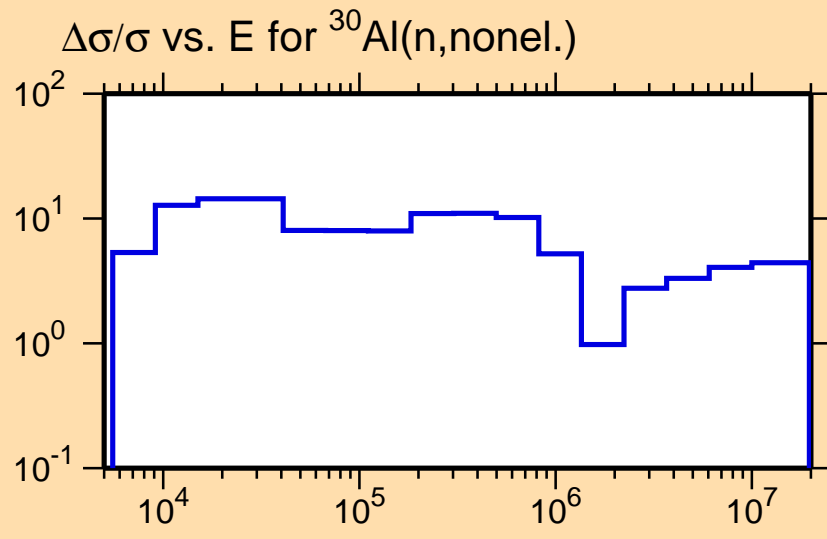

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

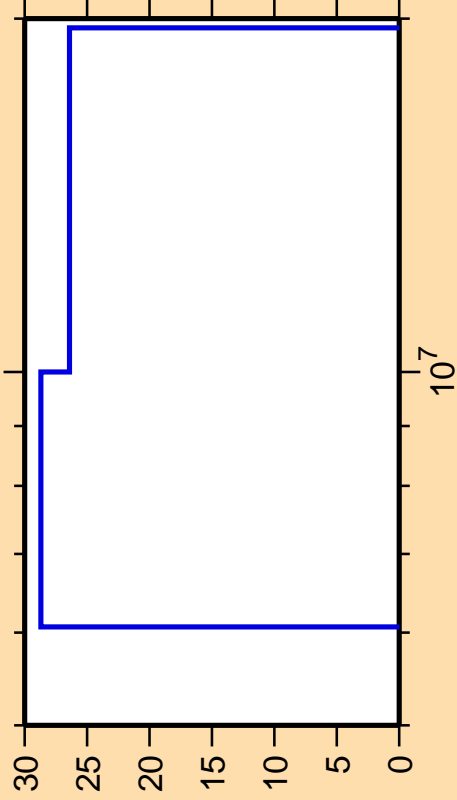

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

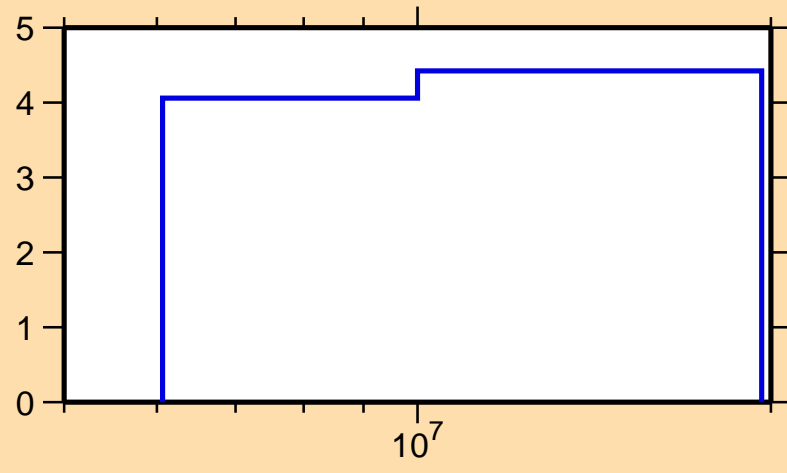

Correlation Matrix





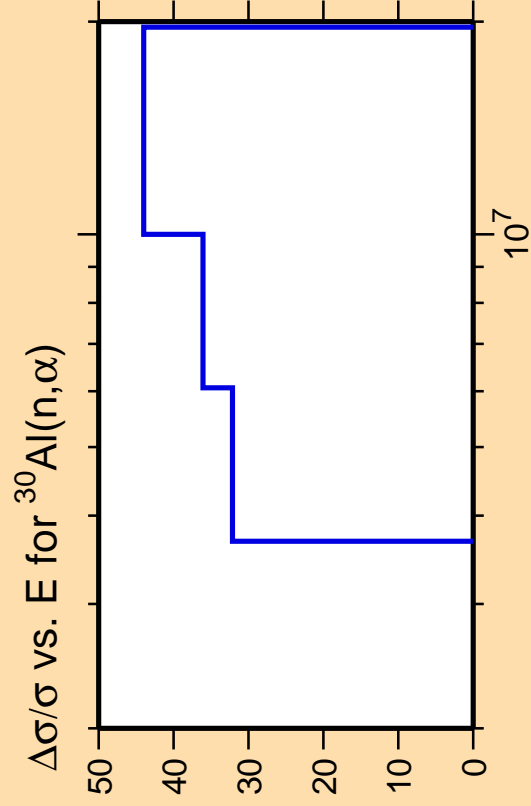

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nonel.})$

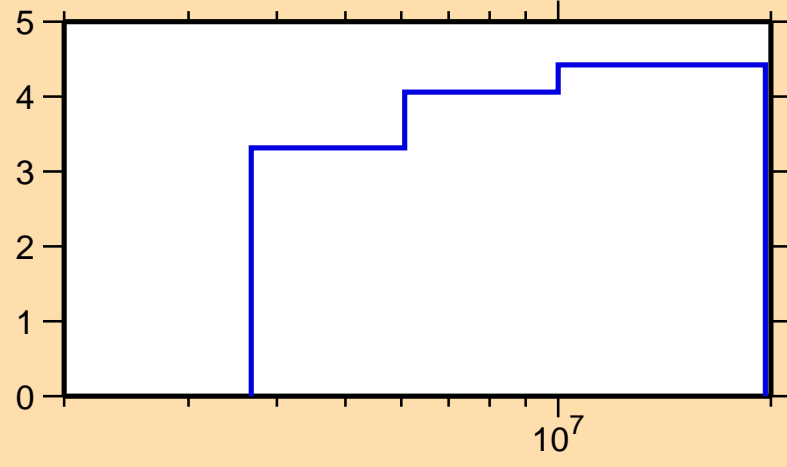

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{inel.})$

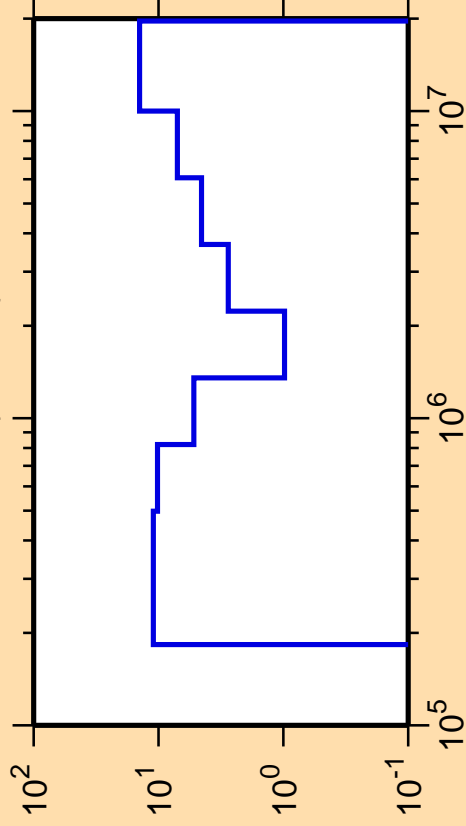


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Al}(n,\text{inel.})$

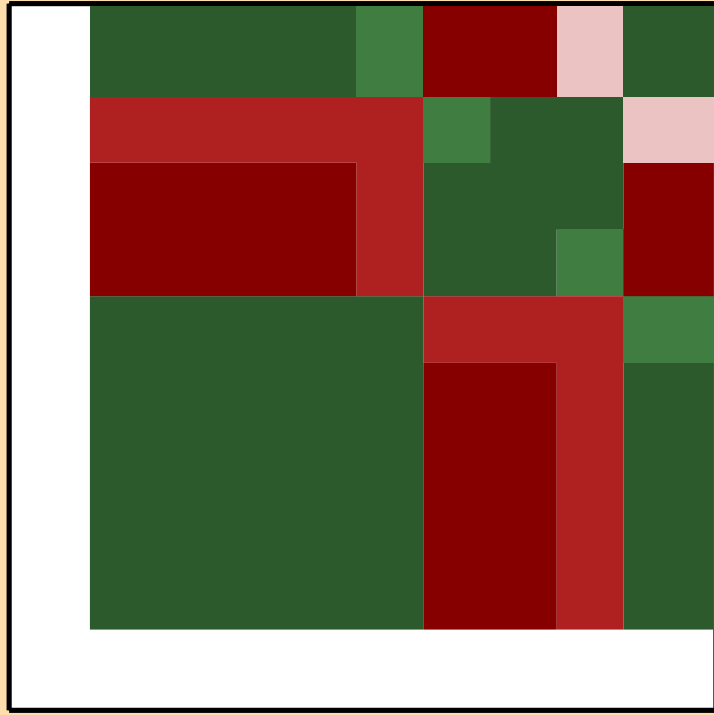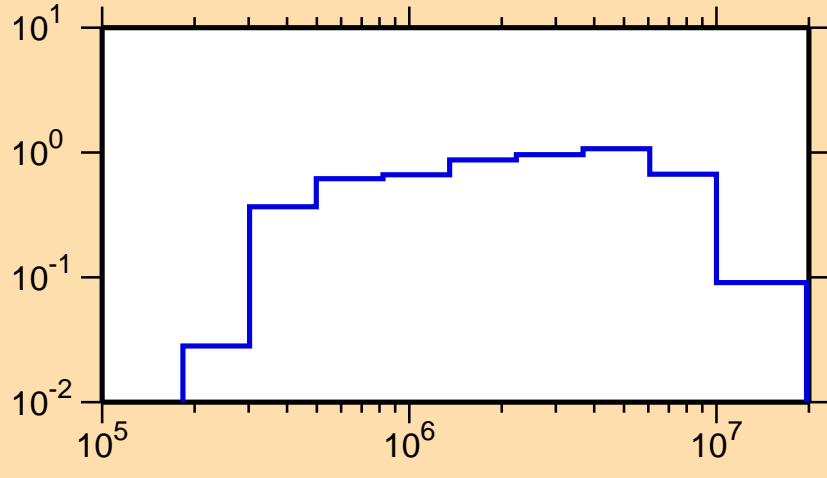

Correlation Matrix


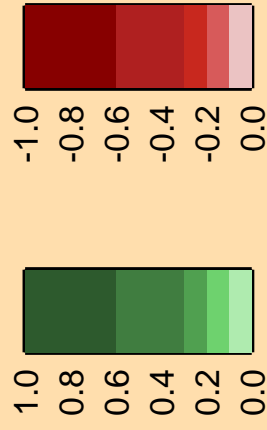


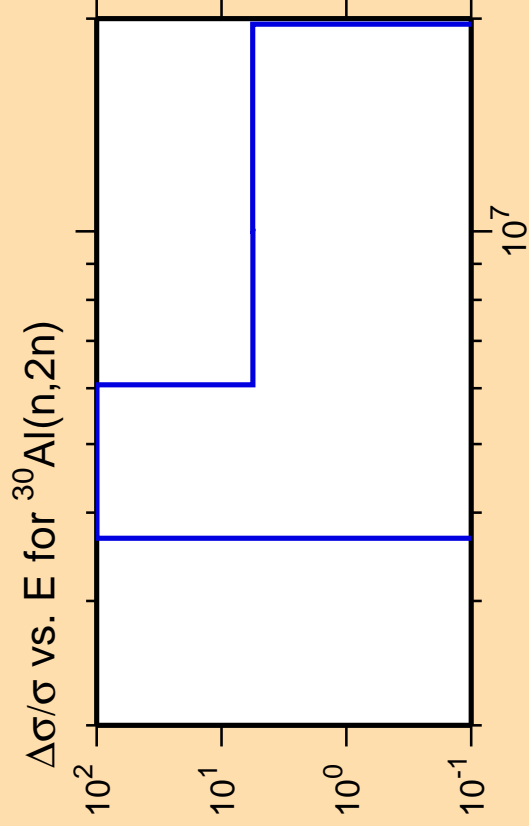

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

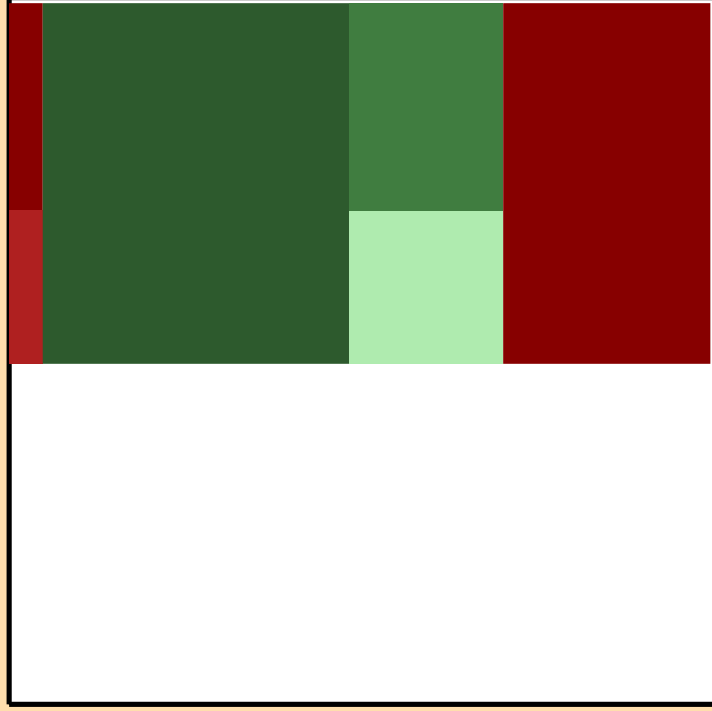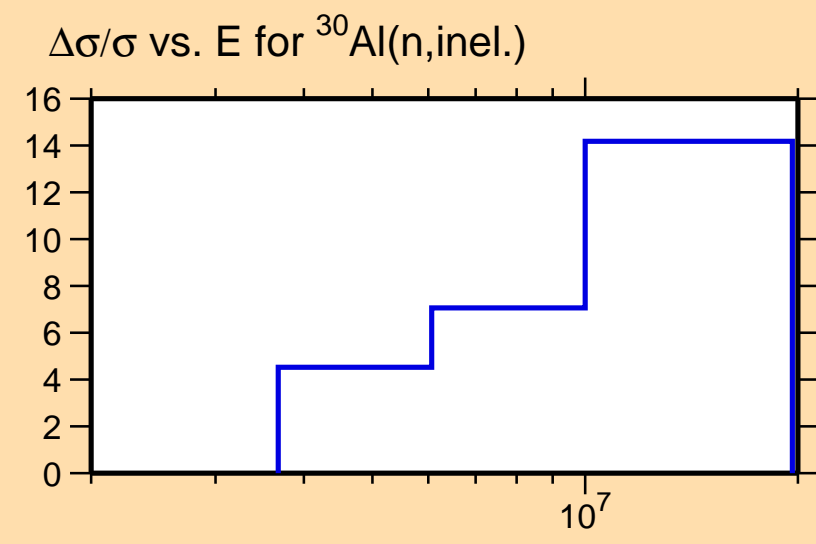



Correlation Matrix



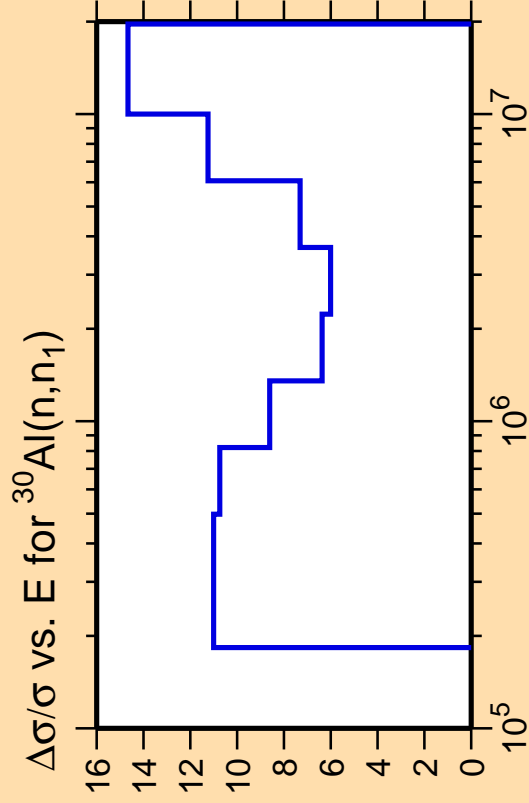

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

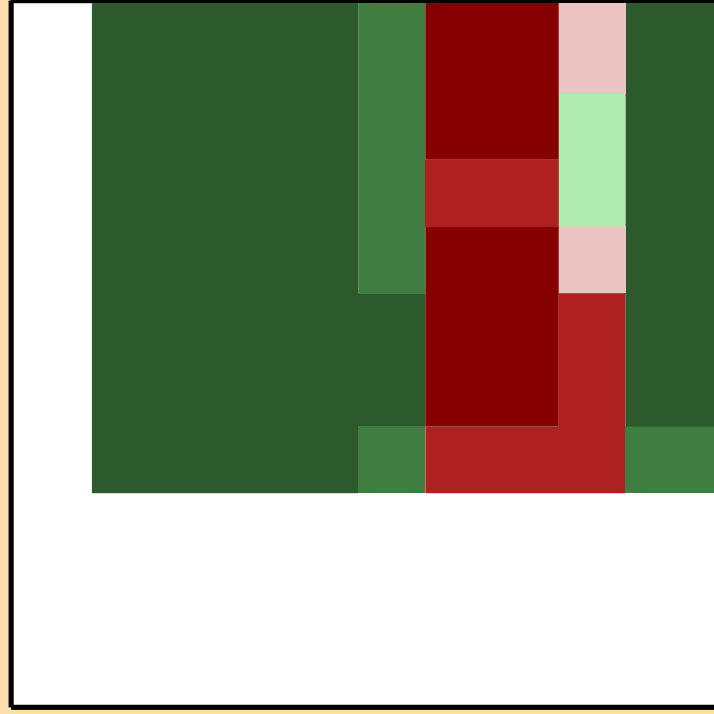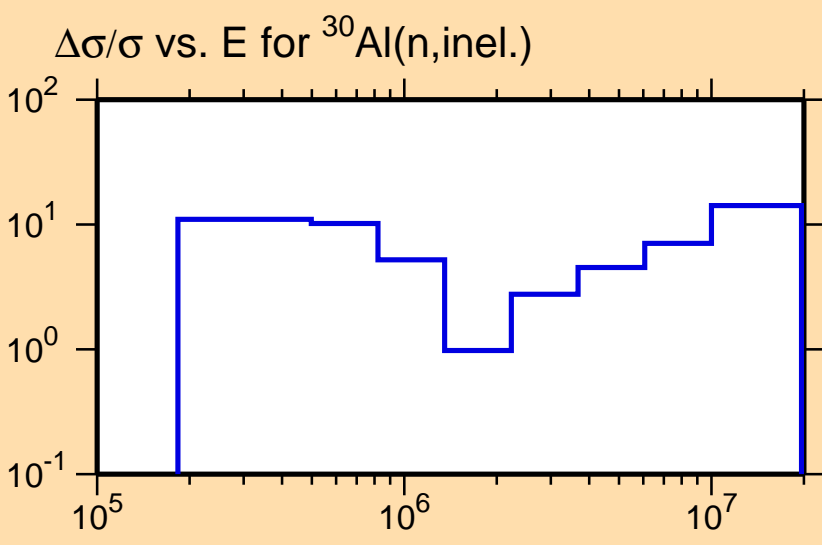

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n\text{cont.})$


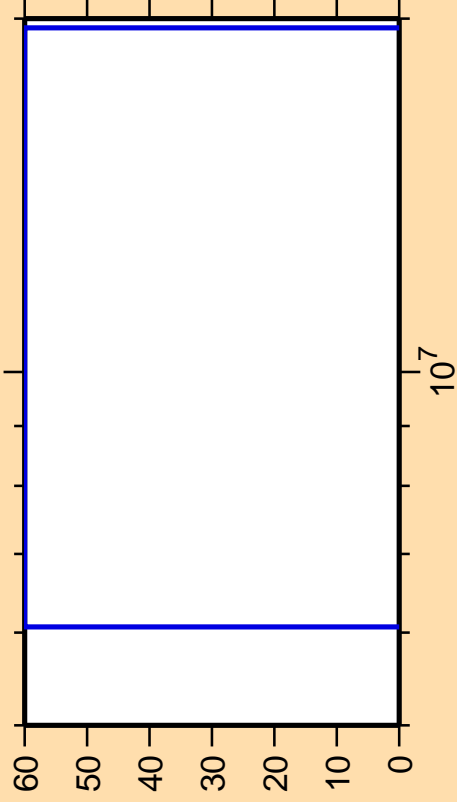


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{inel.})$

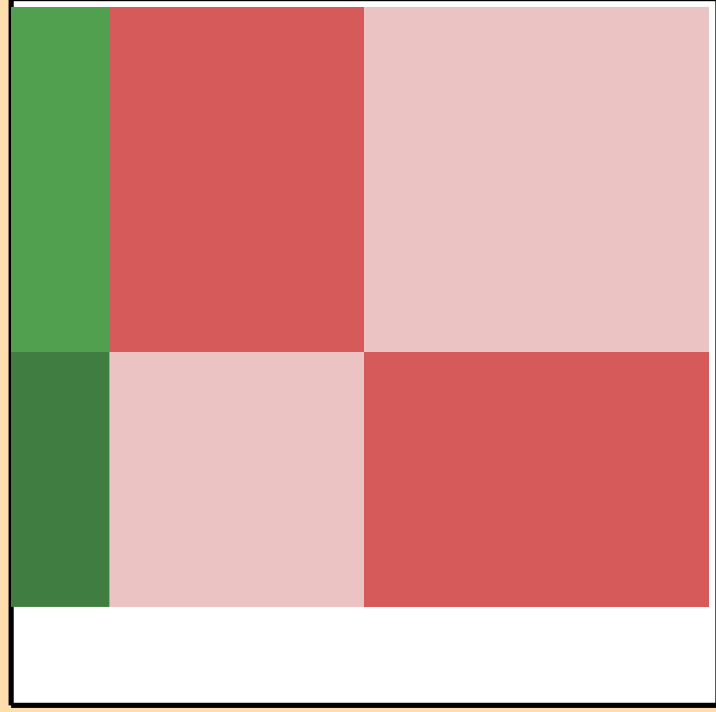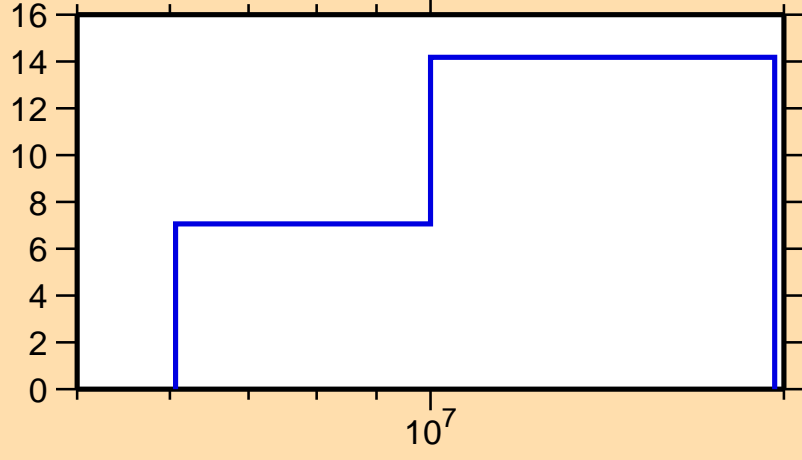

Correlation Matrix





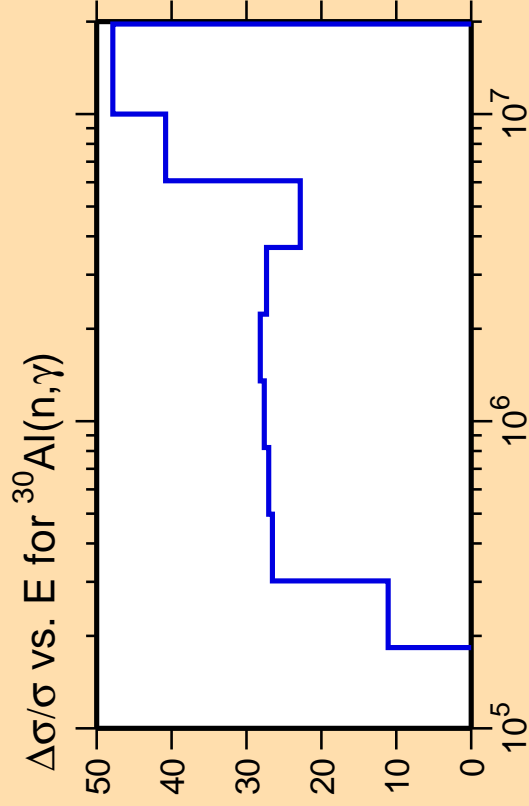

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{inel.})$

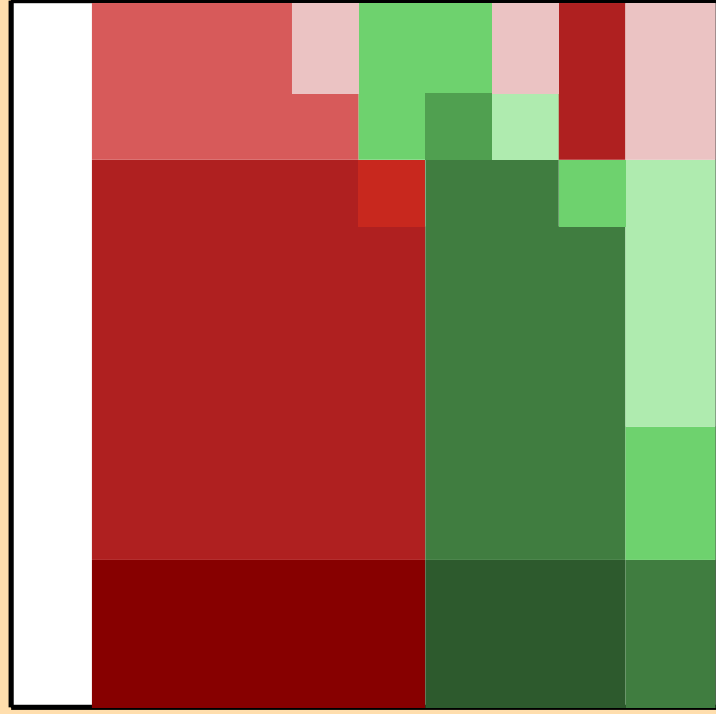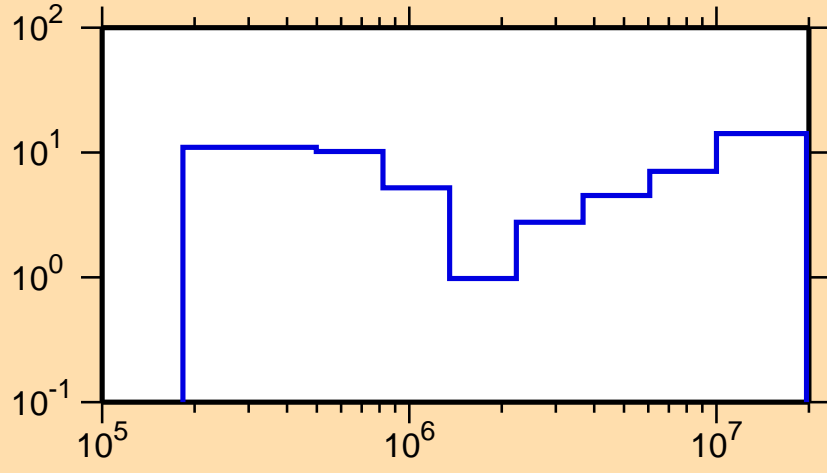

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

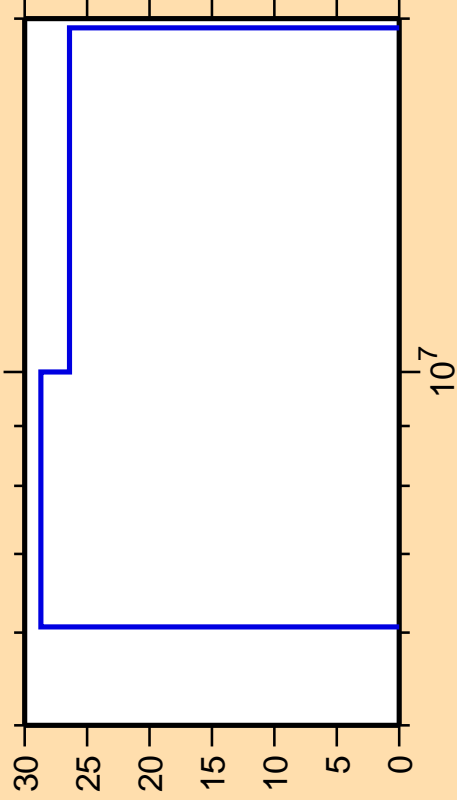

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{inel.})$

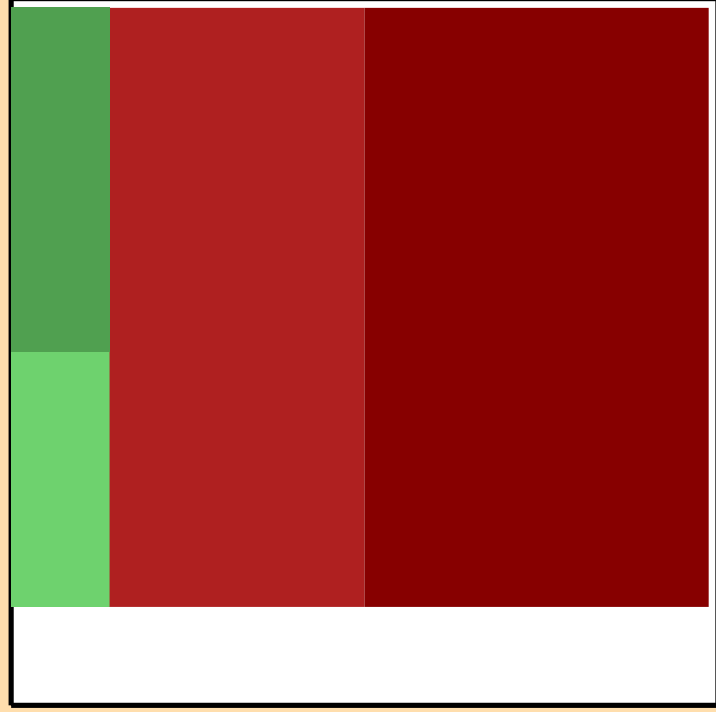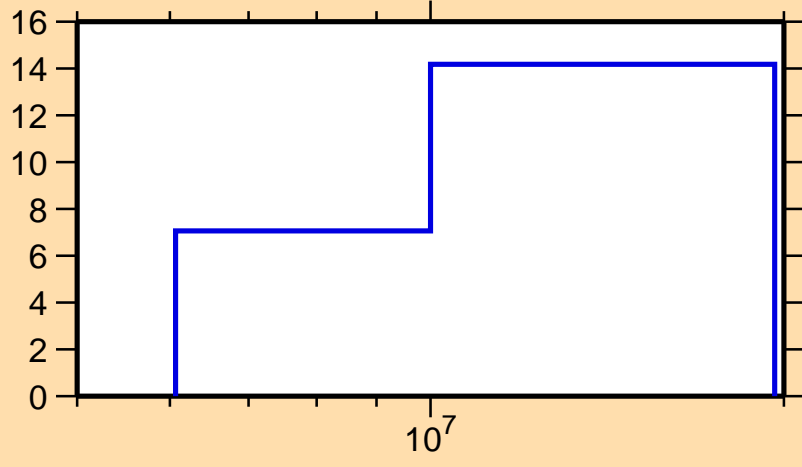

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\alpha)$

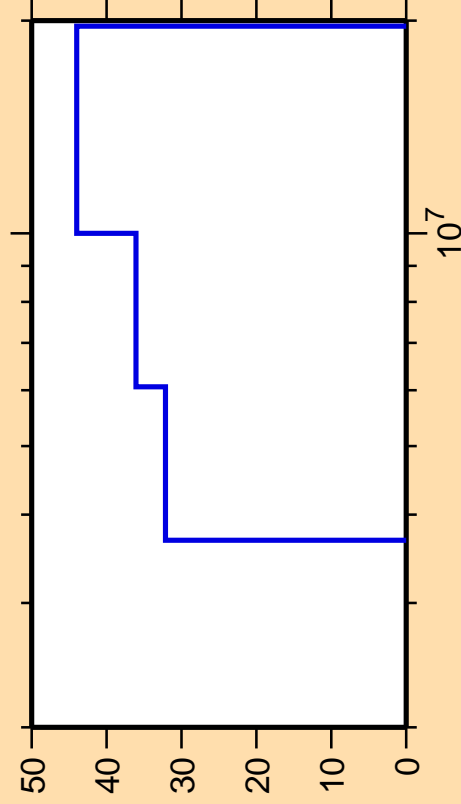

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{inel.})$

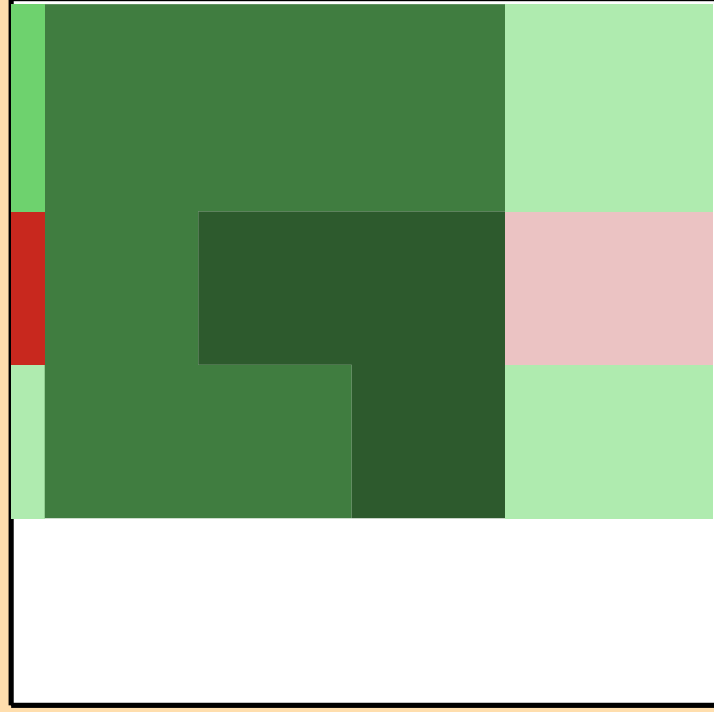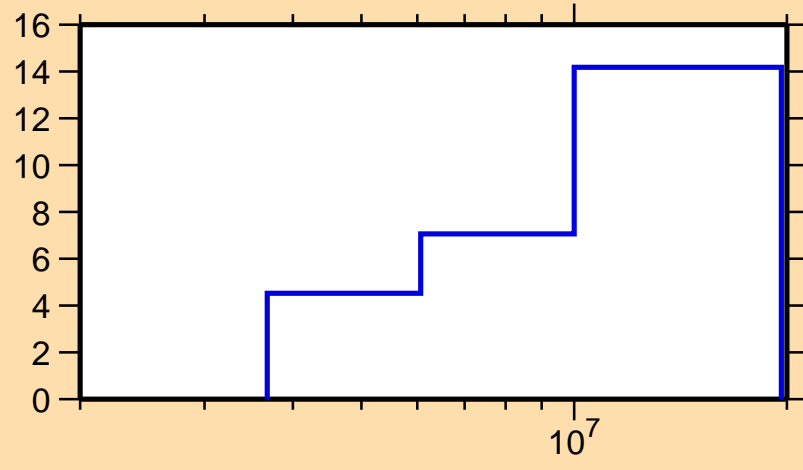

Correlation Matrix





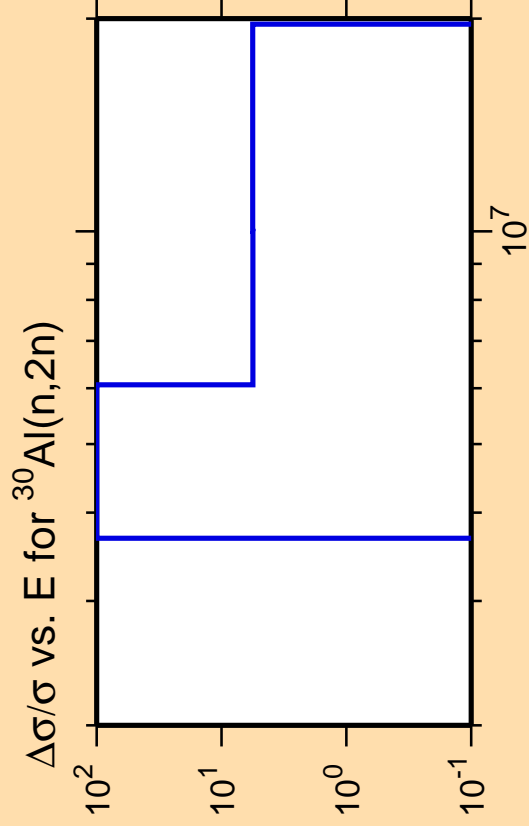

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

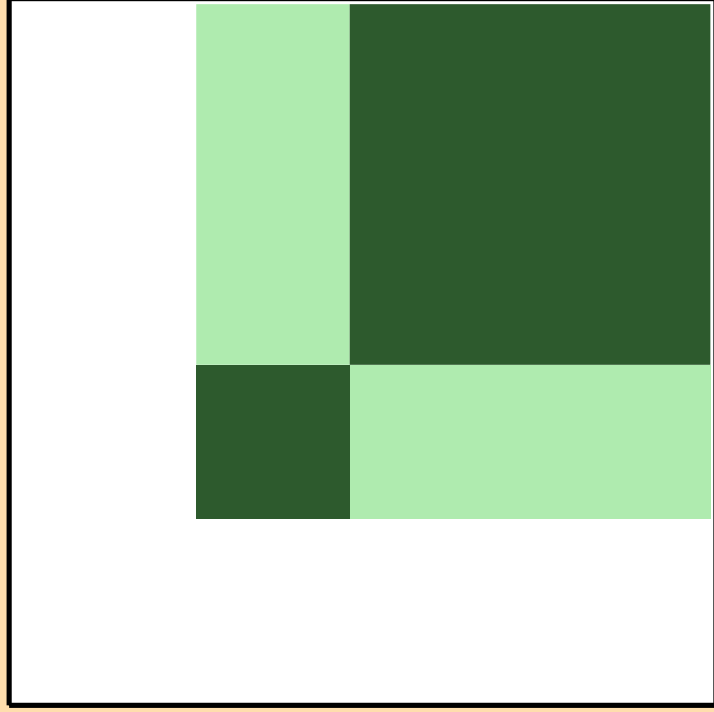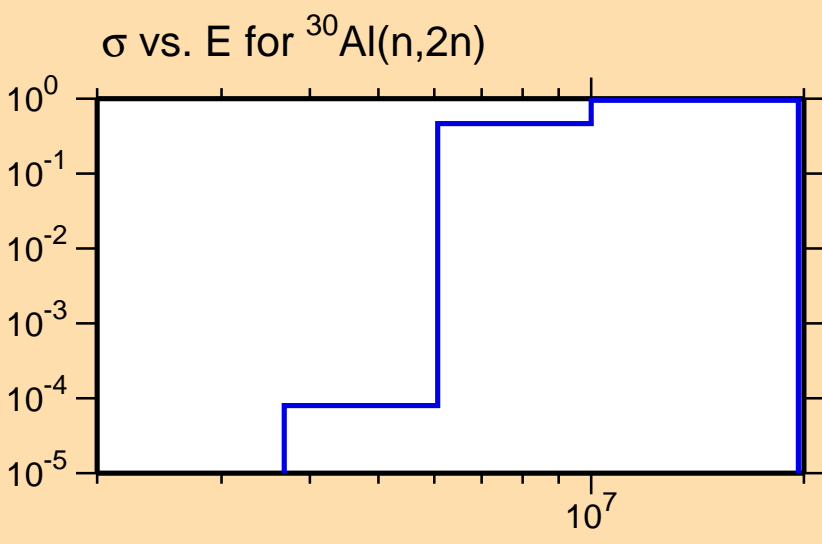

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_1)$


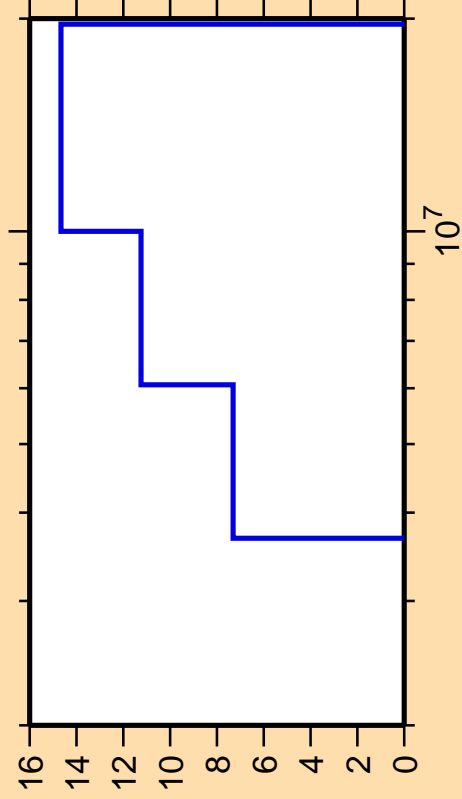


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,2n)$

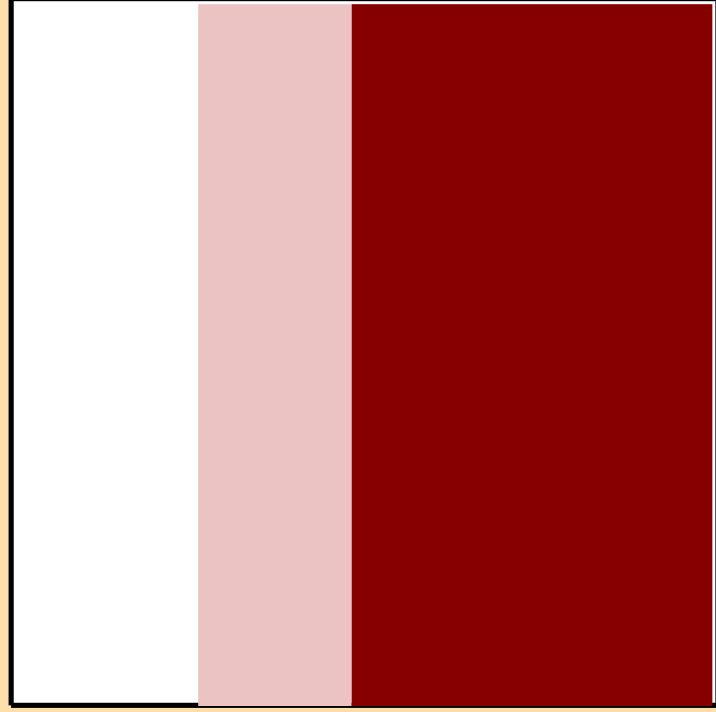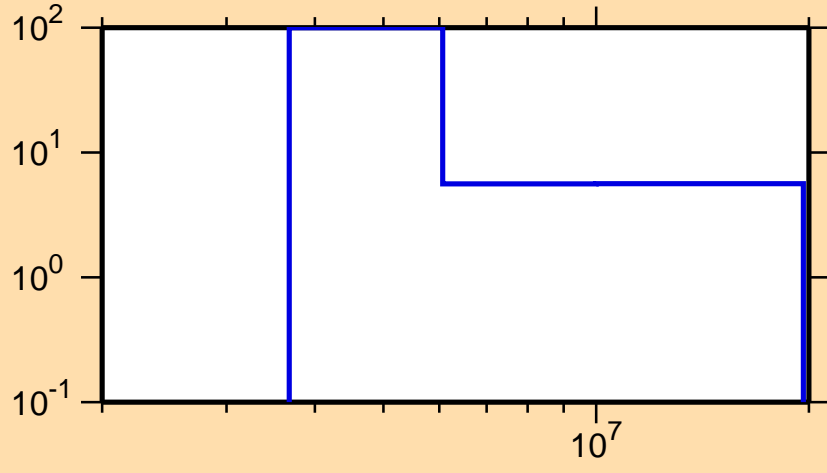

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n\text{cont.})$





Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,2n)$

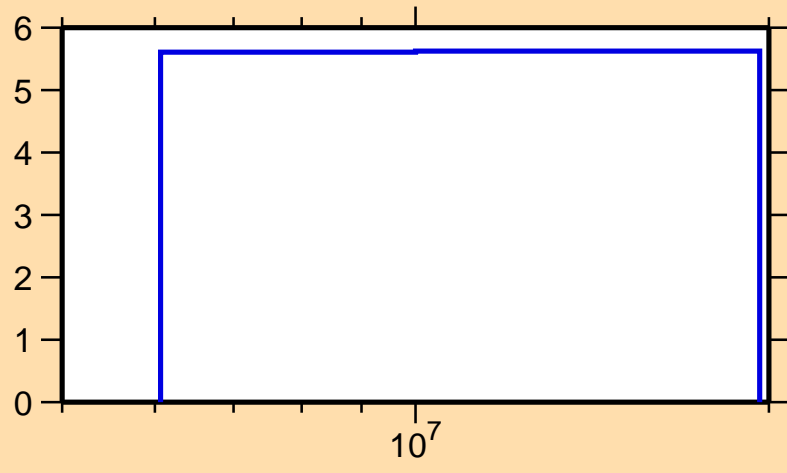

Correlation Matrix





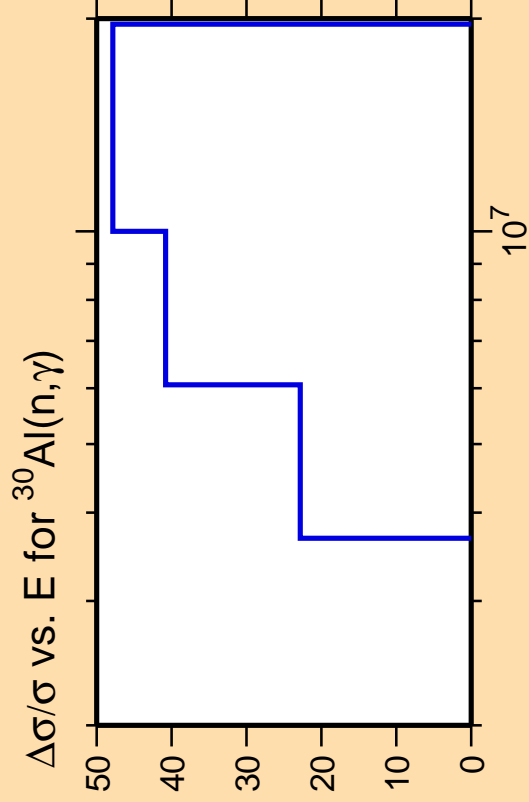

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

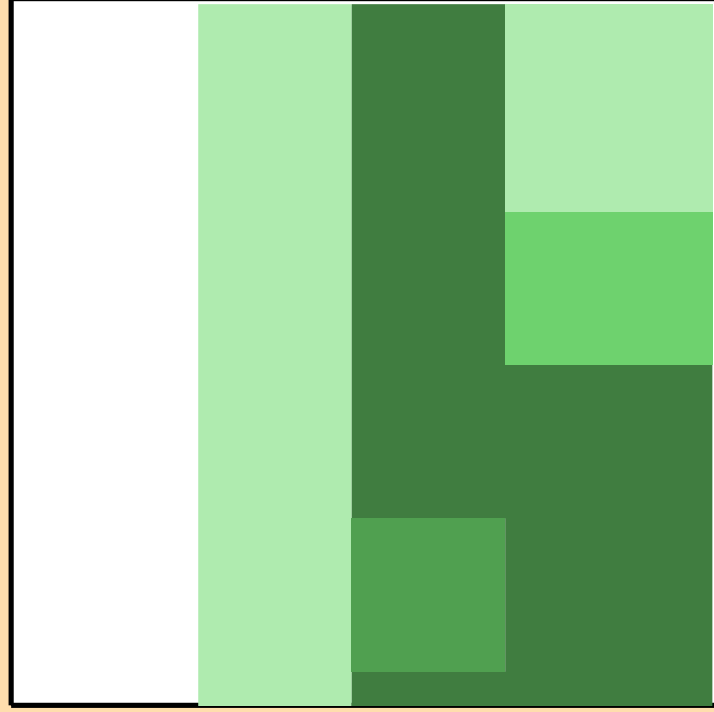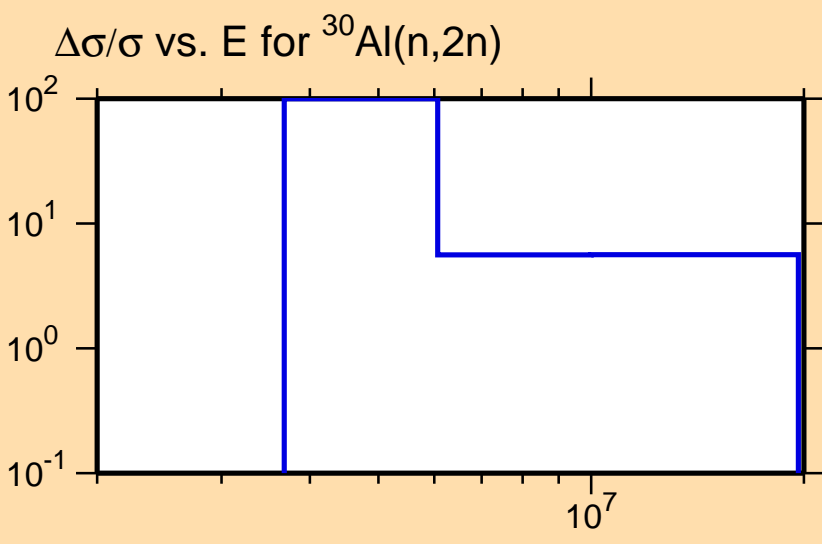

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

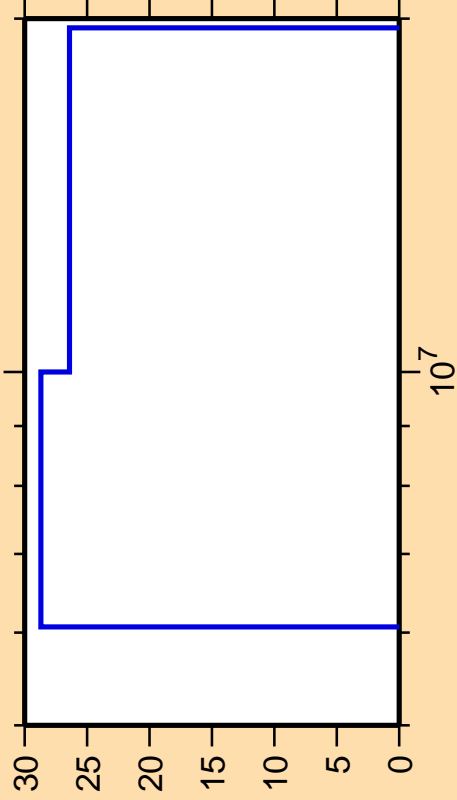

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,2n)$

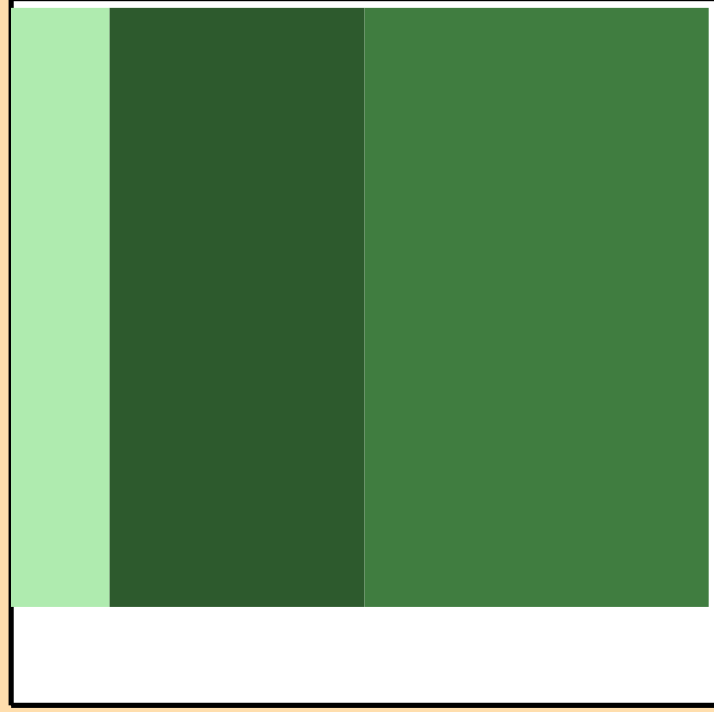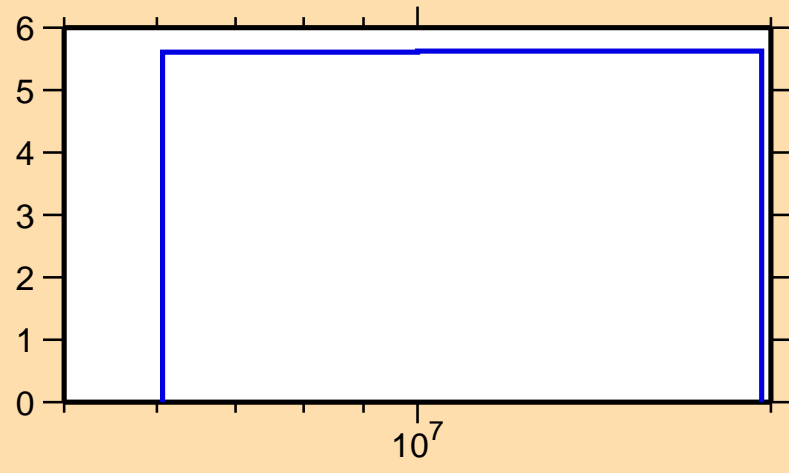

Correlation Matrix





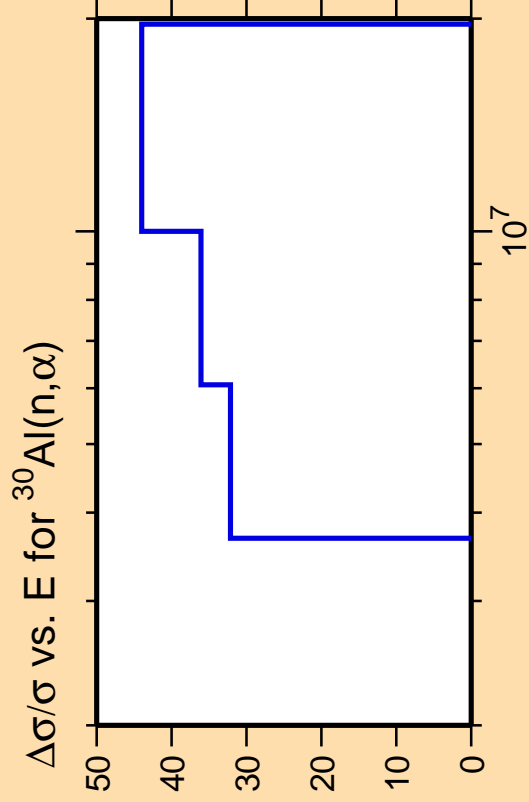


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

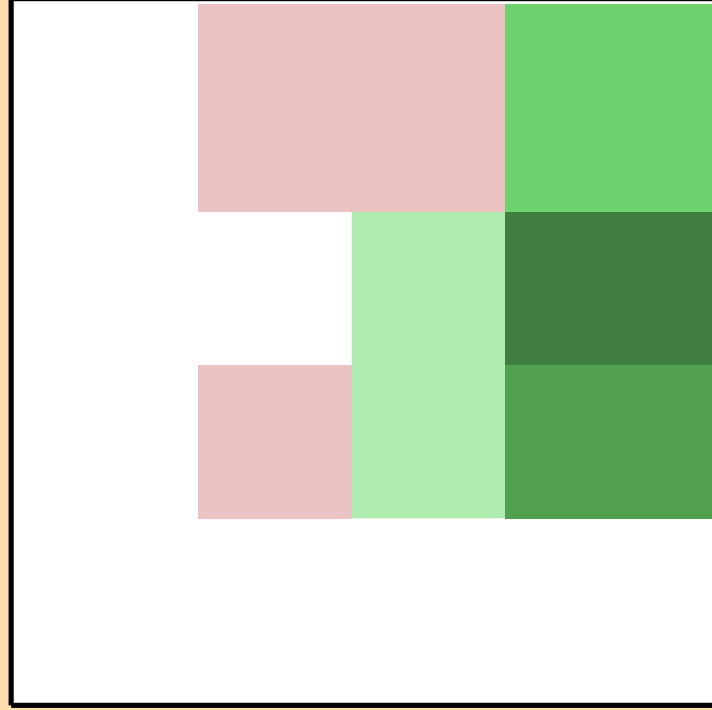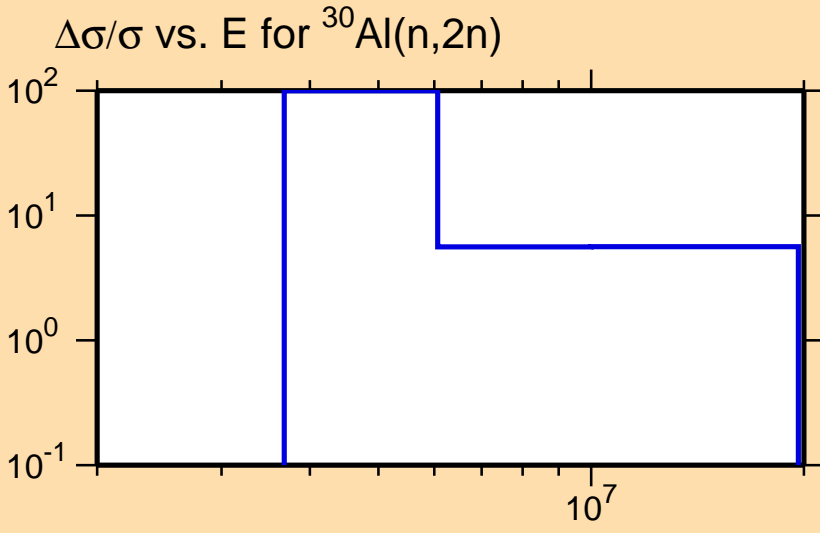

Correlation Matrix

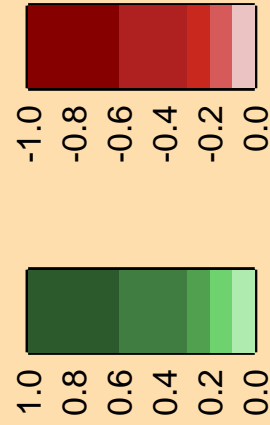


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,3n)$

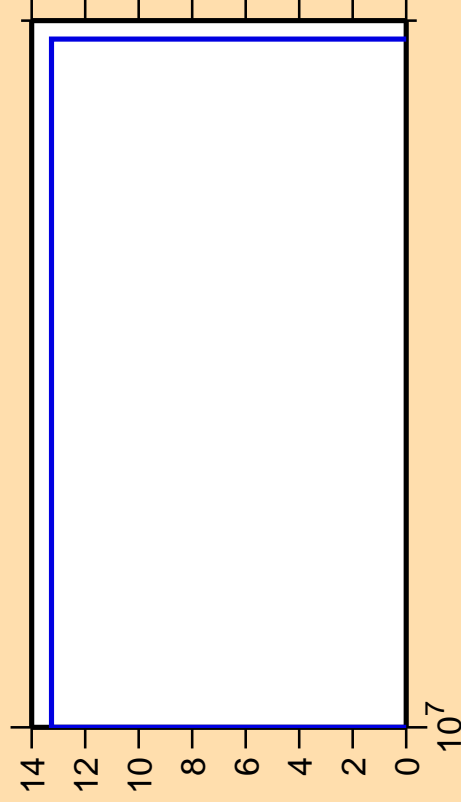

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,3n)$

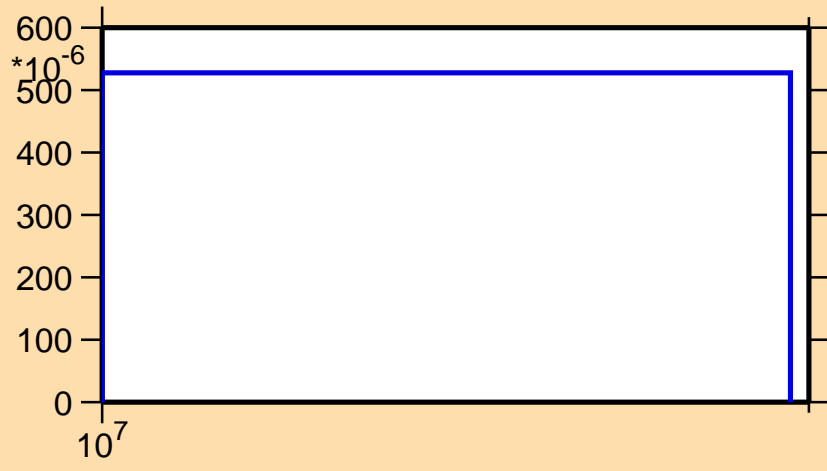

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n\alpha)$

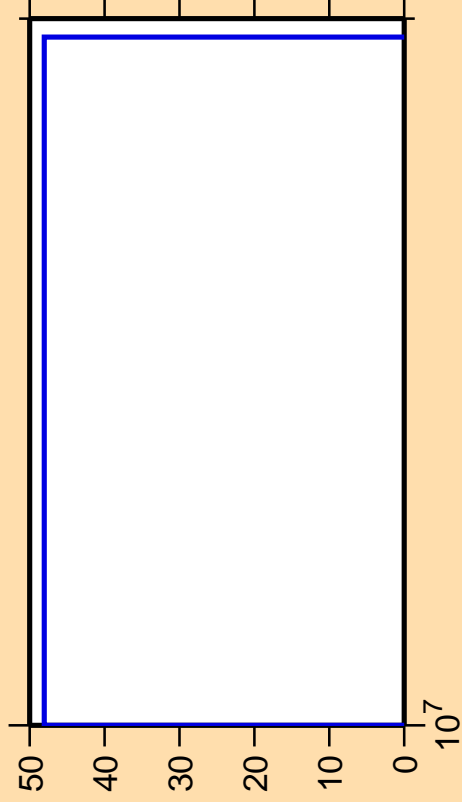

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,n\alpha)$

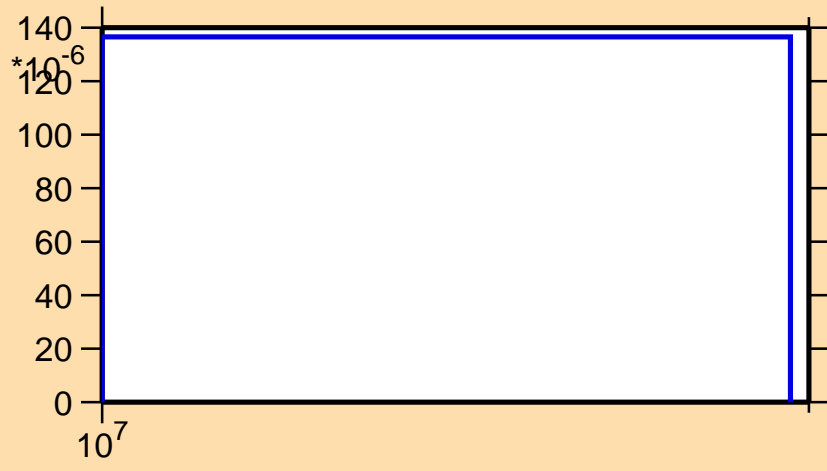

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,2n\alpha)$

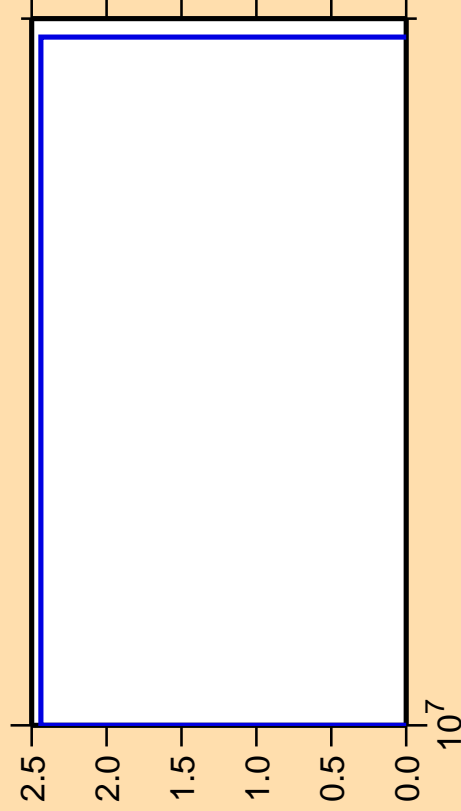

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,2n\alpha)$

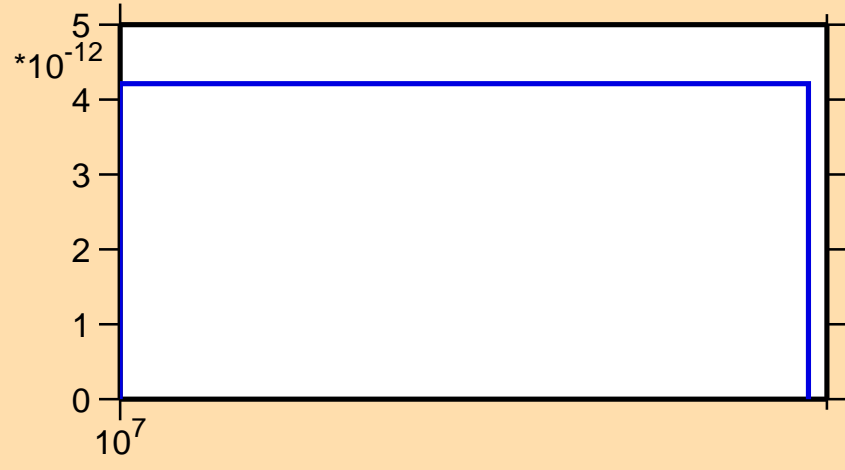

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,np)$

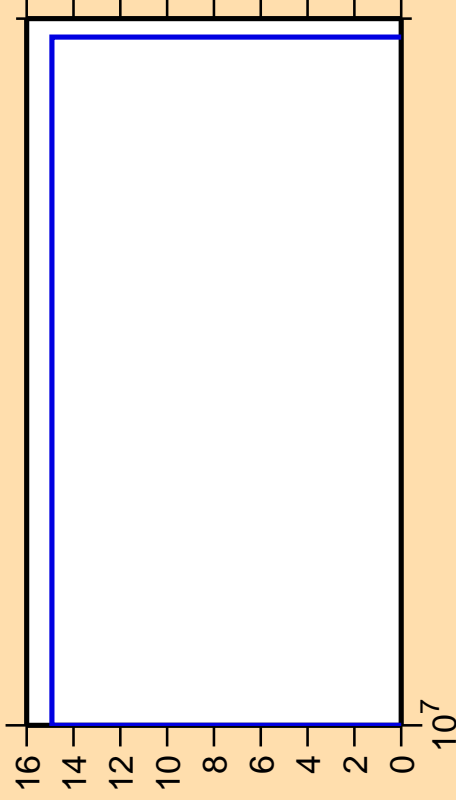

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Al}(n,np)$

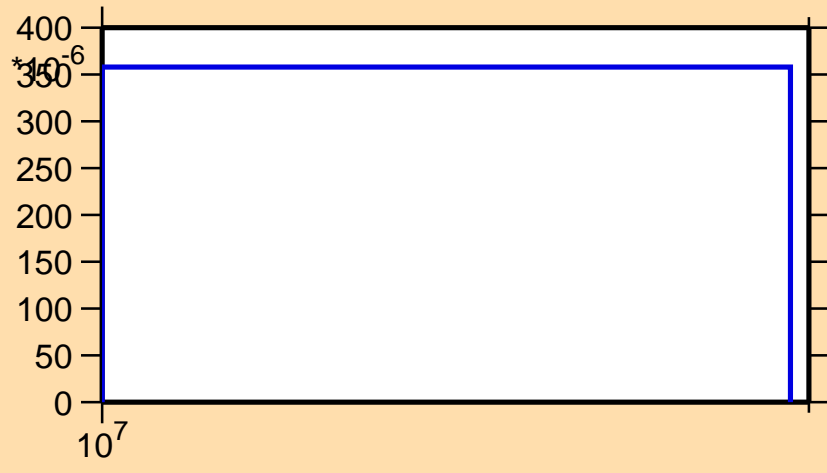


10^7



Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\text{nd})$

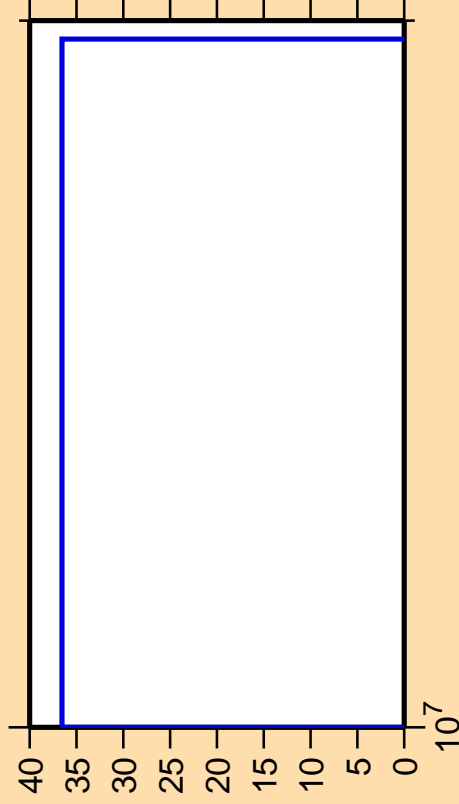

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Al}(n,\text{nd})$

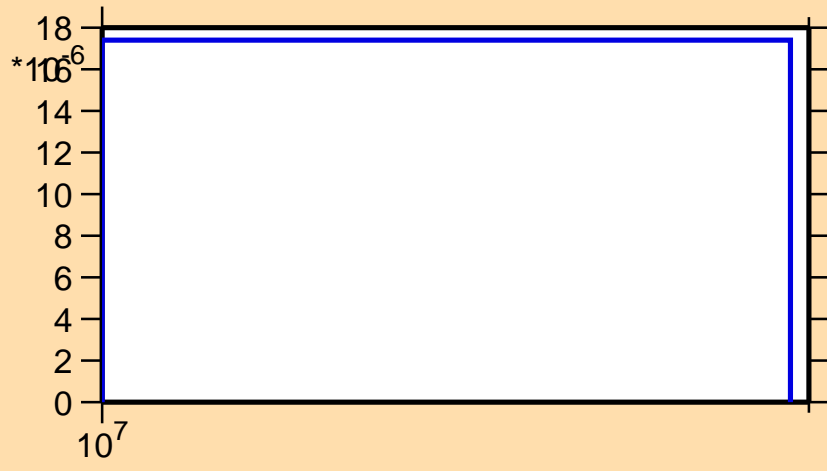

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,nt)$




Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{30}\text{Al}(n,nt)$

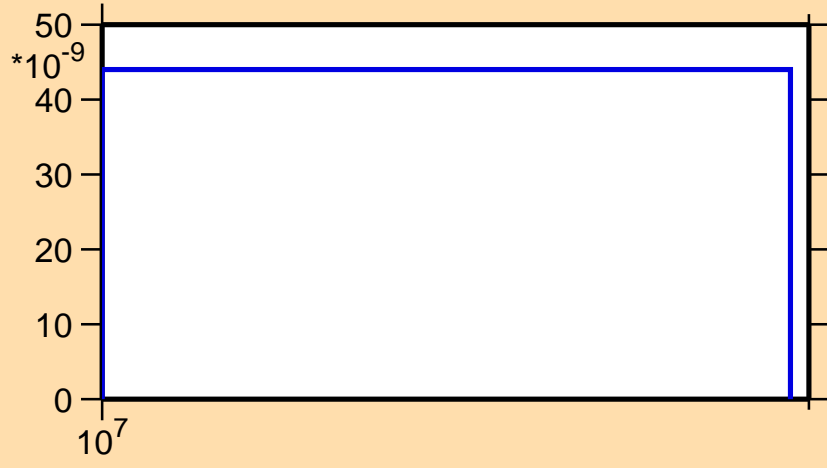

10^7




Correlation Matrix

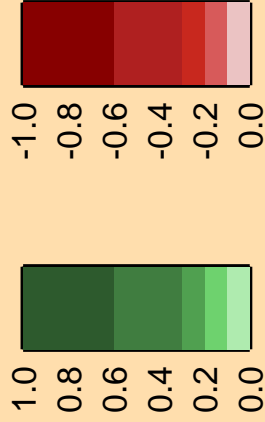

-1.0
-0.8
-0.6
-0.4
-0.2
0.0

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,2np)$

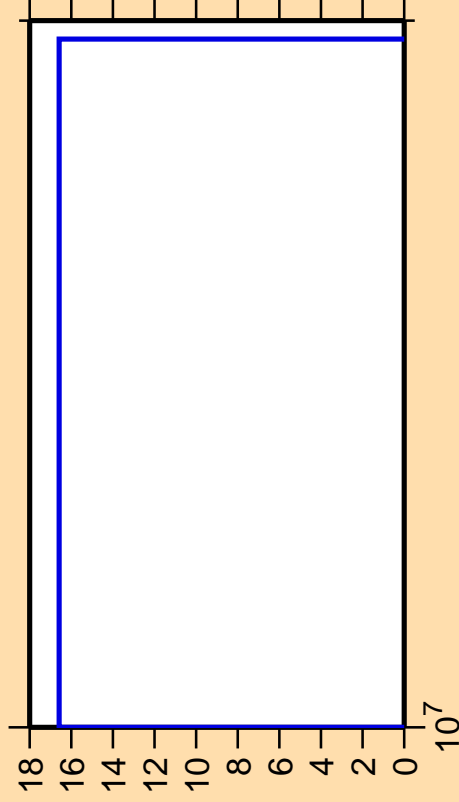

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,2np)$



Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_1)$

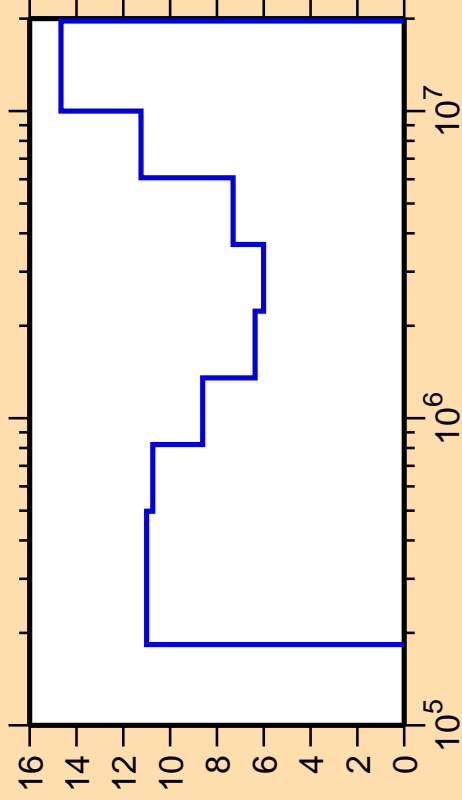

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,n_1)$

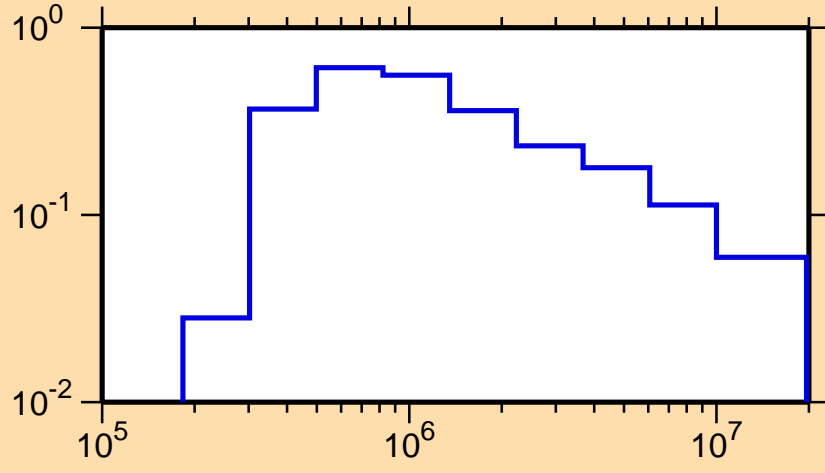

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_{\text{cont}})$


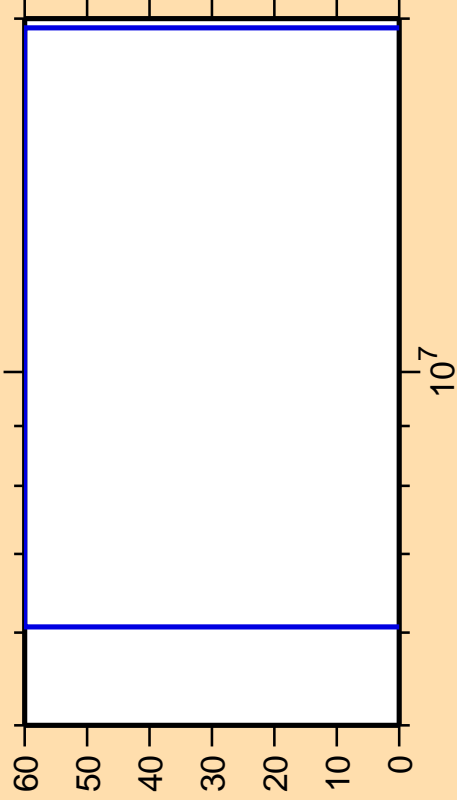


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_1)$

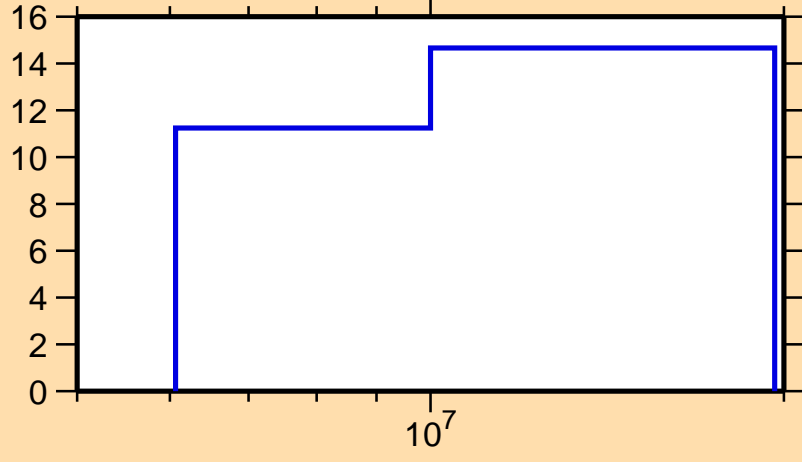

Correlation Matrix





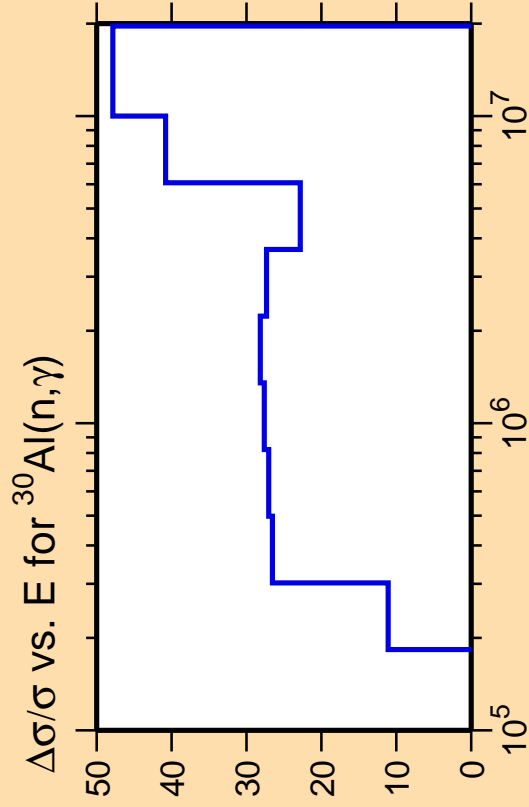

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_1)$

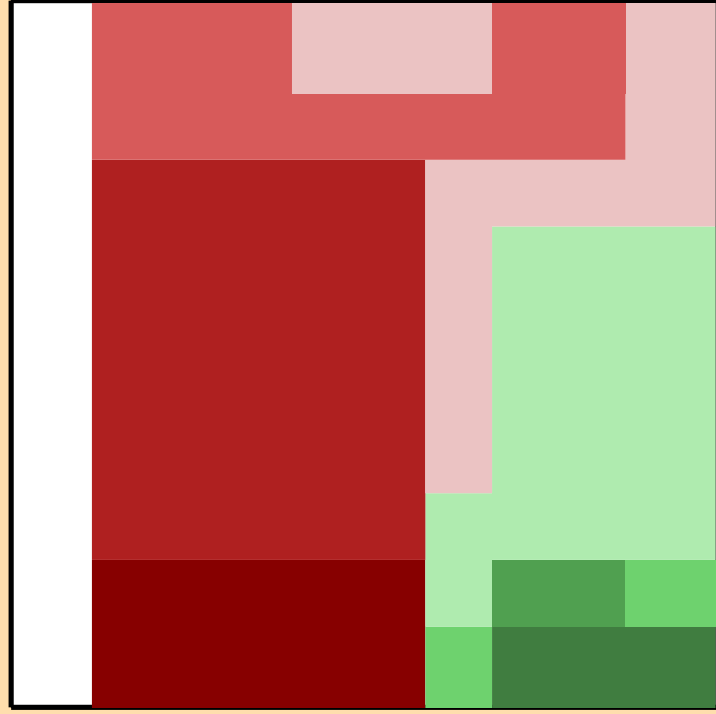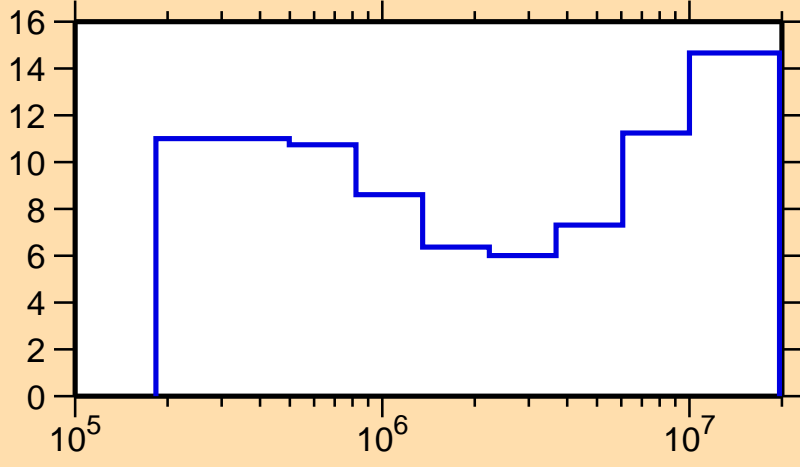

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

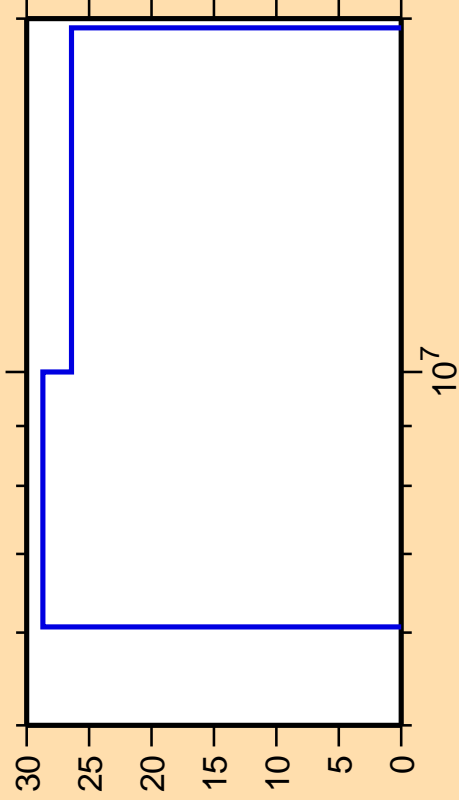

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_1)$

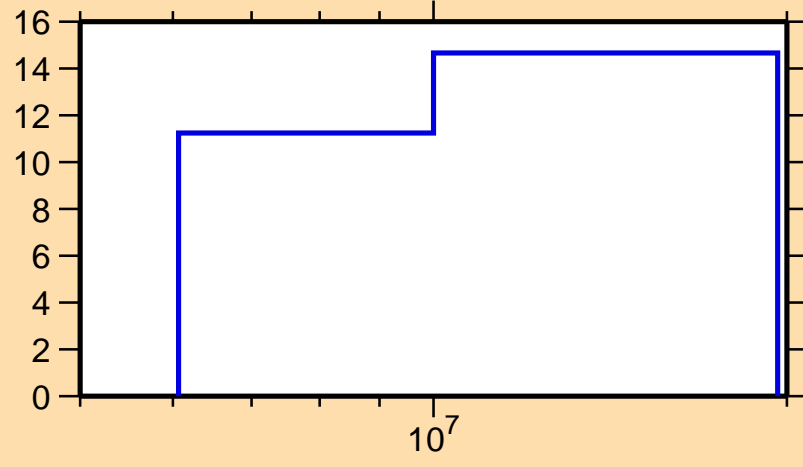

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\alpha)$

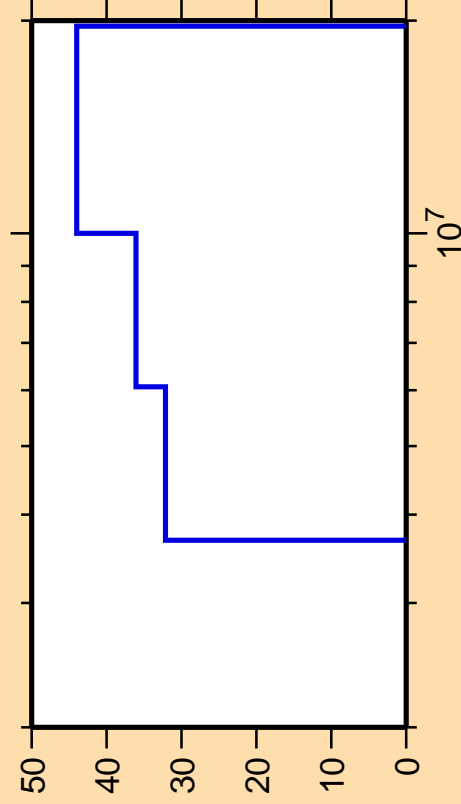

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_1)$

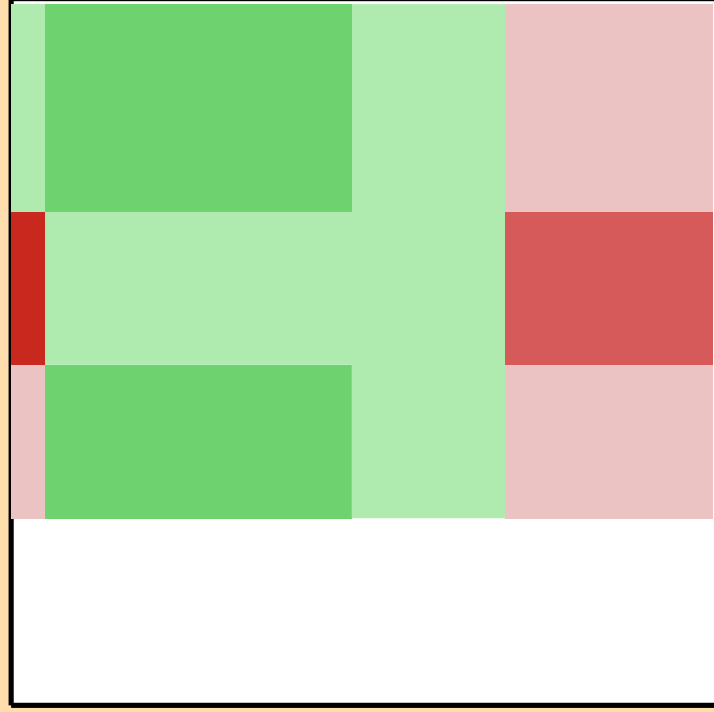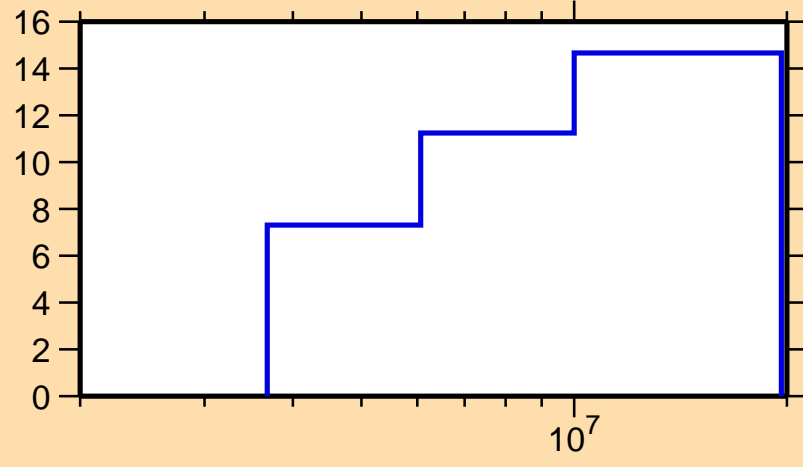

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_2)$

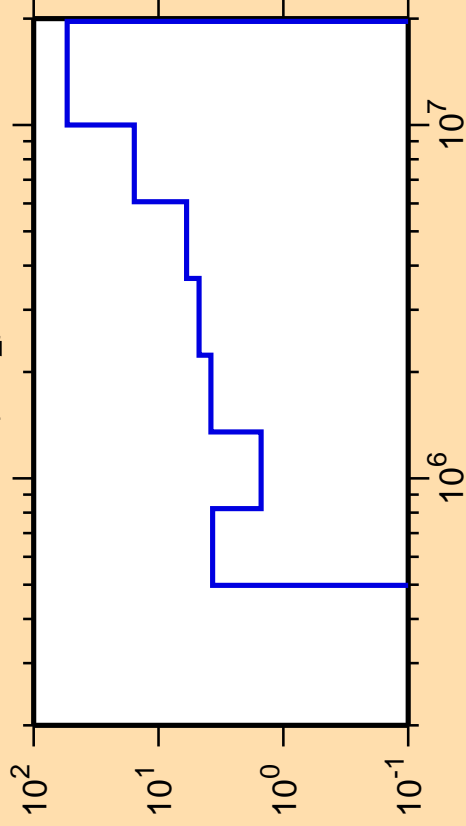

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,n_2)$

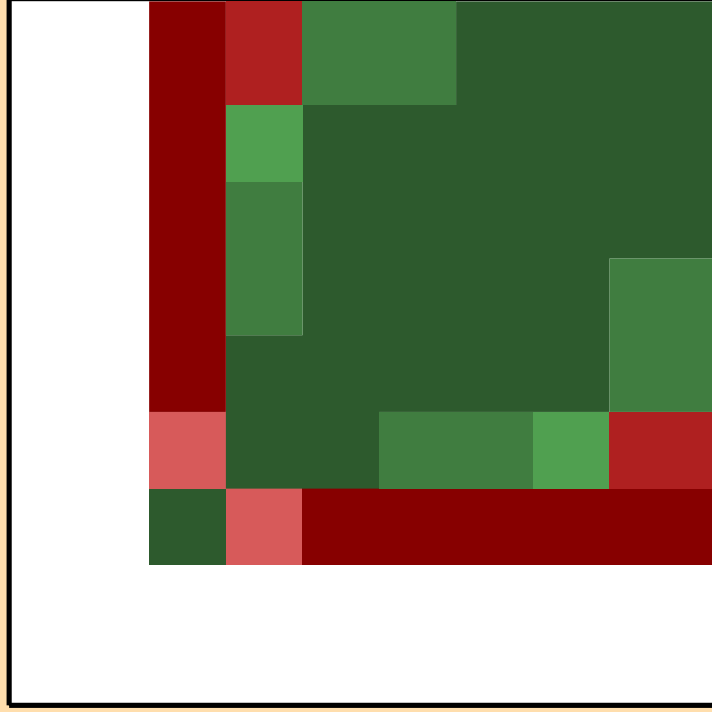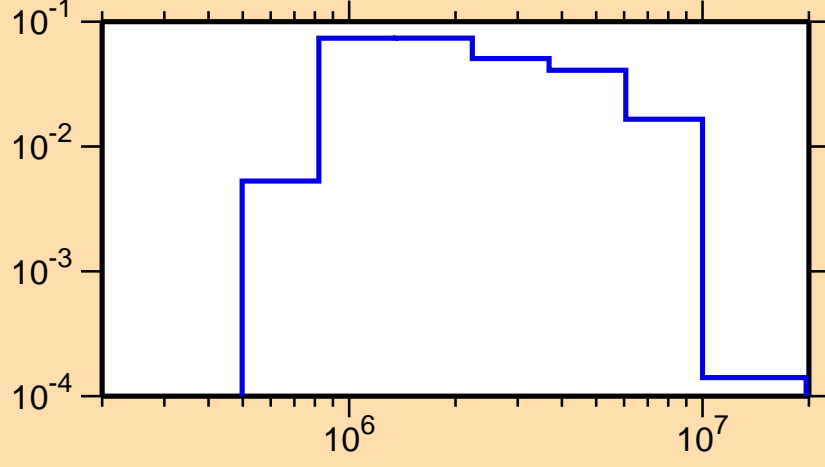

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_3)$

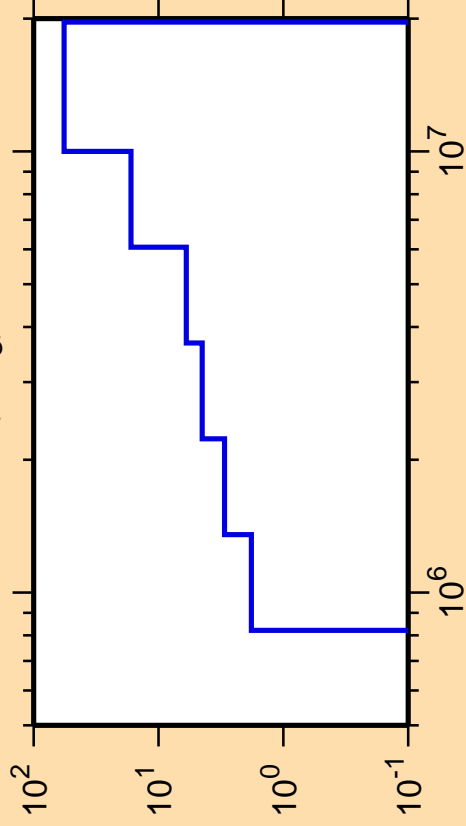

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,n_3)$

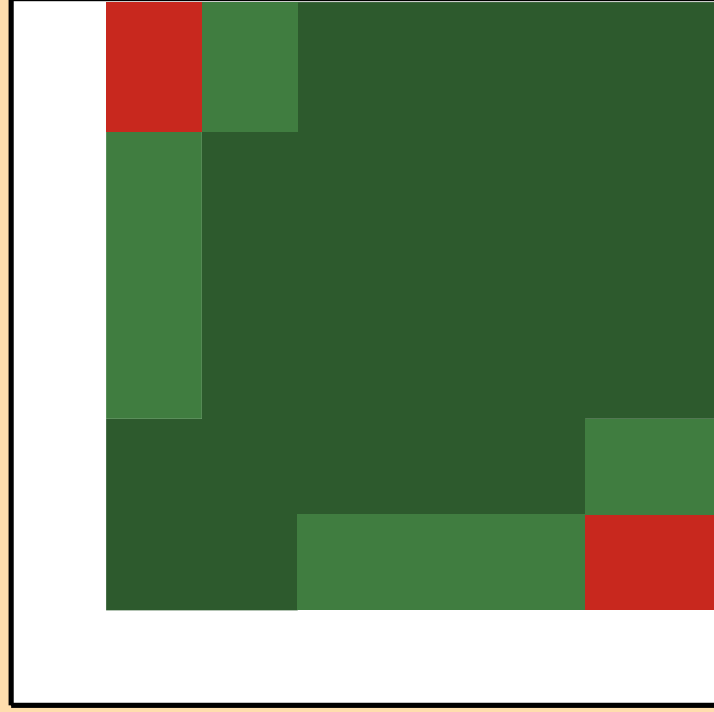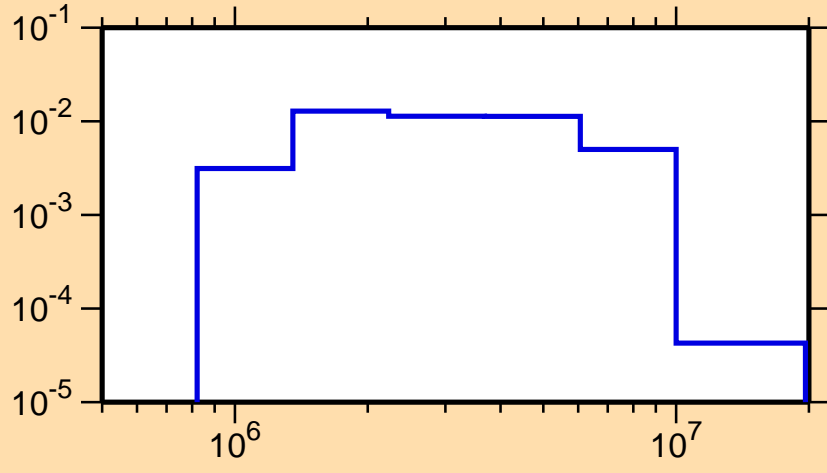

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n_4)$

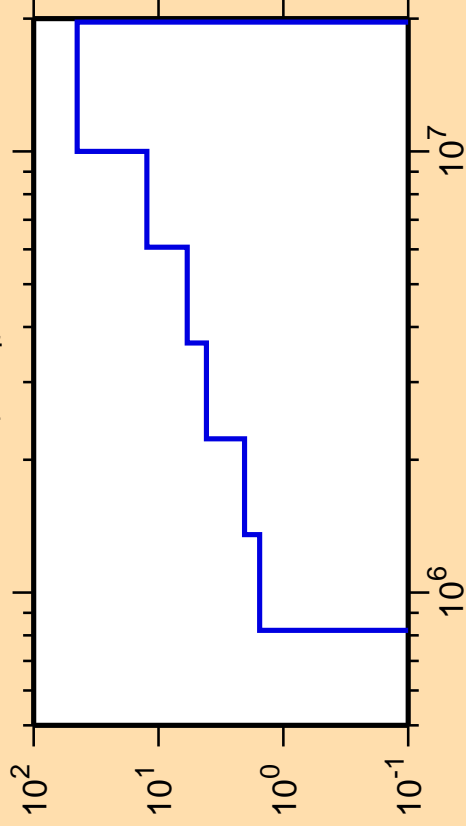

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Al}(n,n_4)$

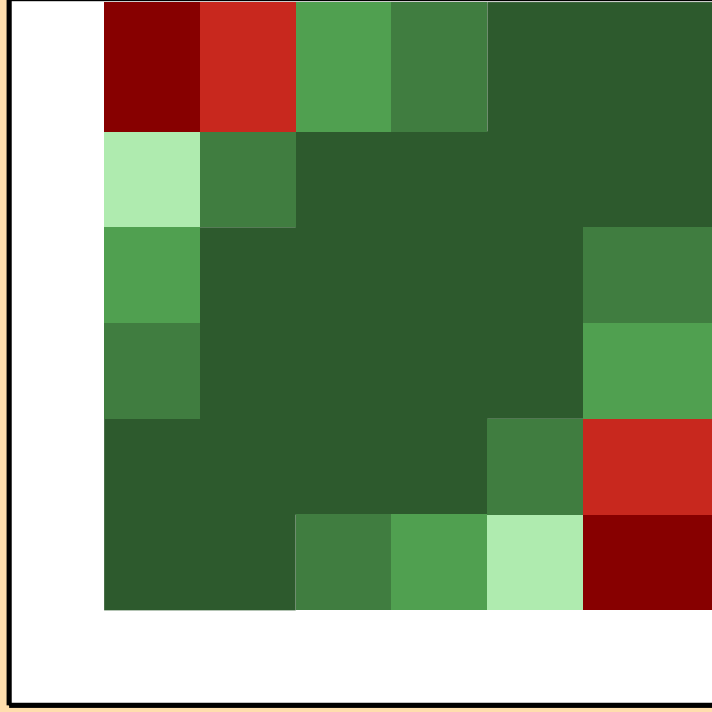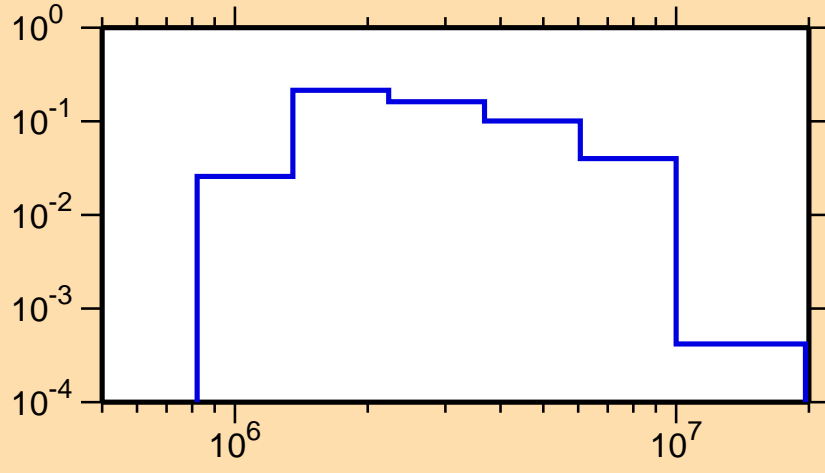

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,n\text{cont.})$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{30}\text{Al}(n,n\text{cont.})$

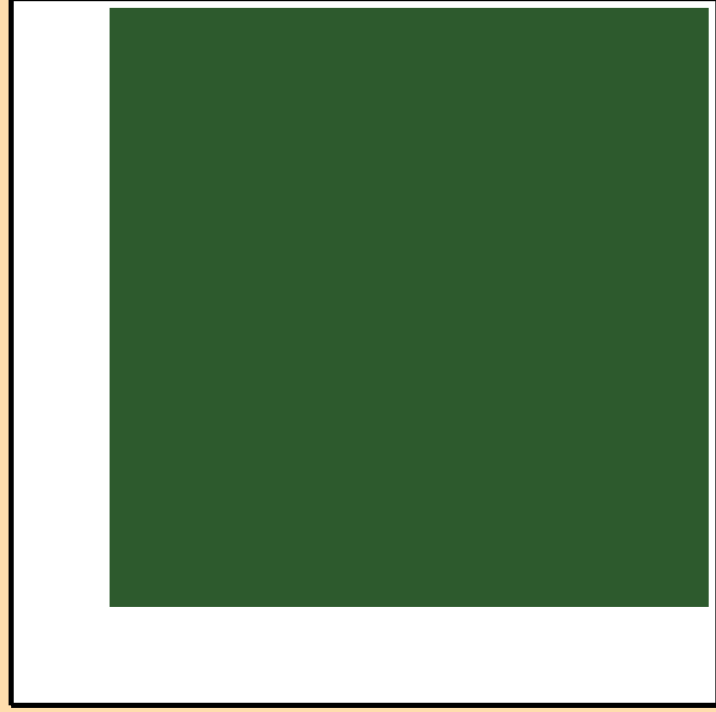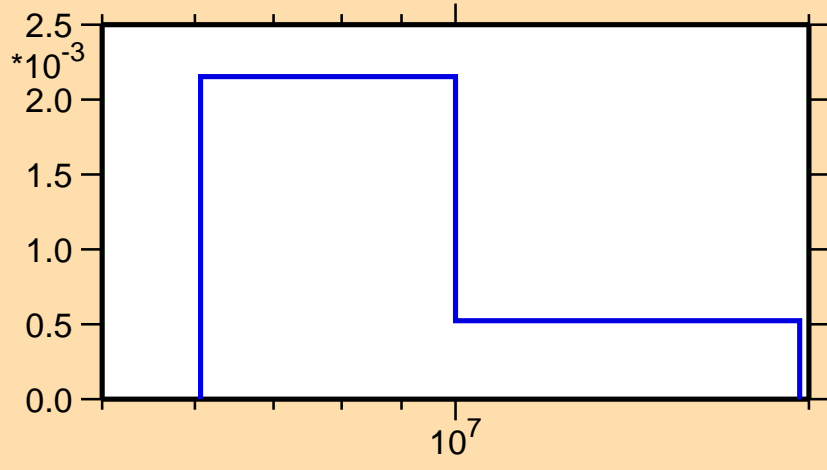

Correlation Matrix





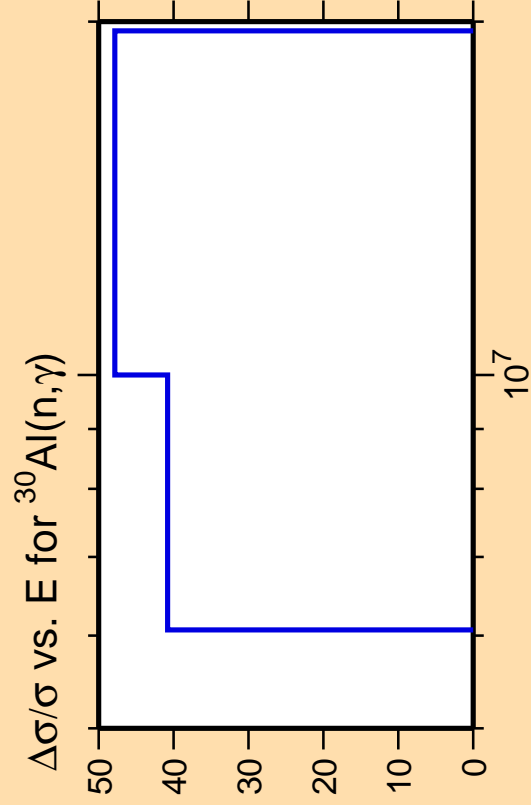

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

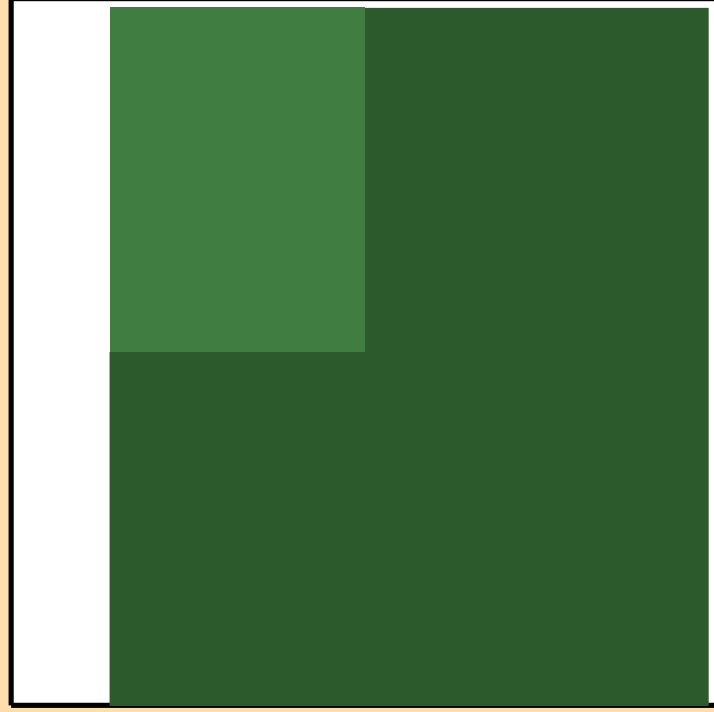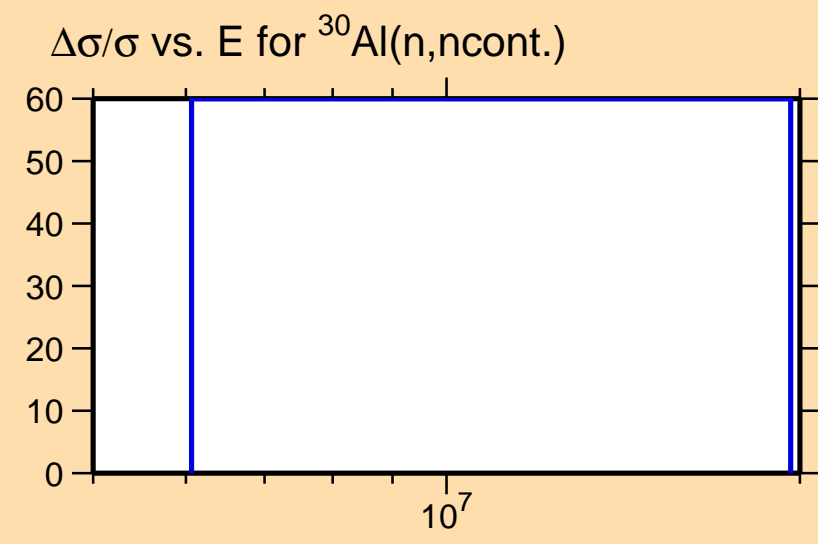

Correlation Matrix





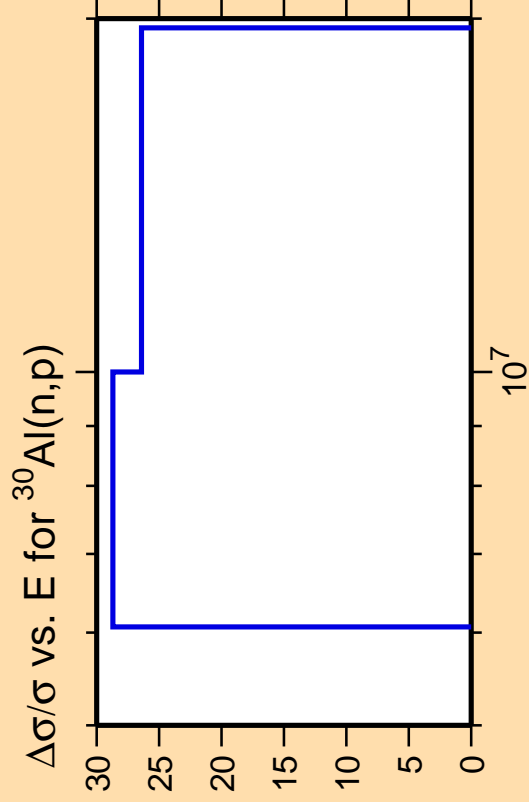

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

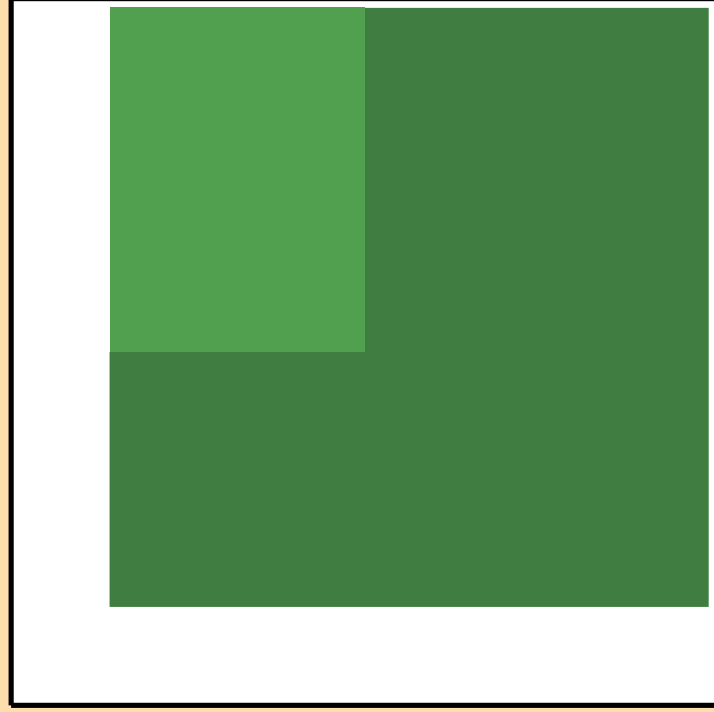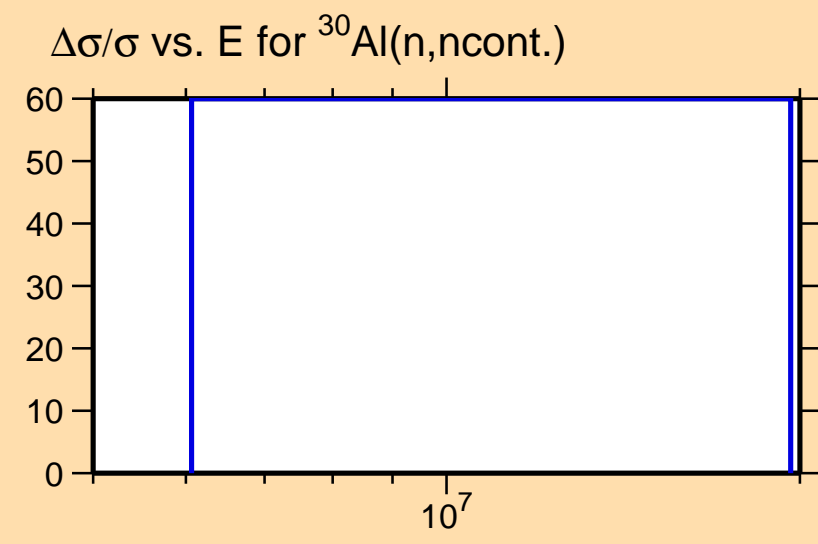

Correlation Matrix





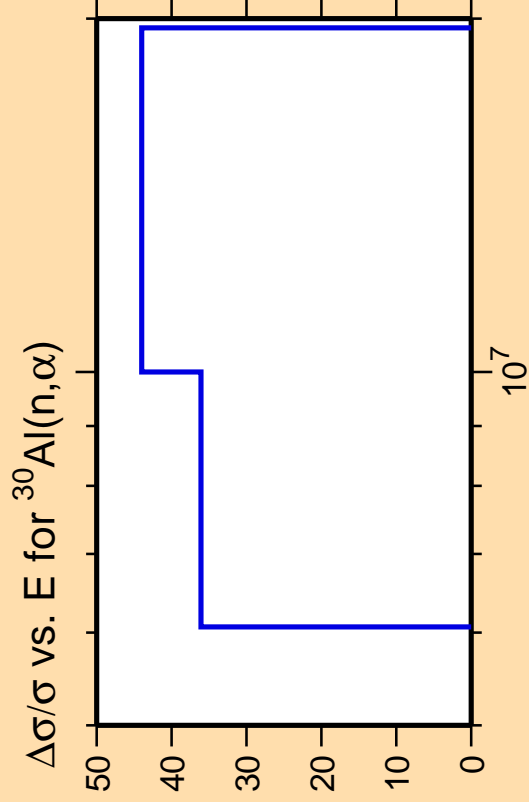

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

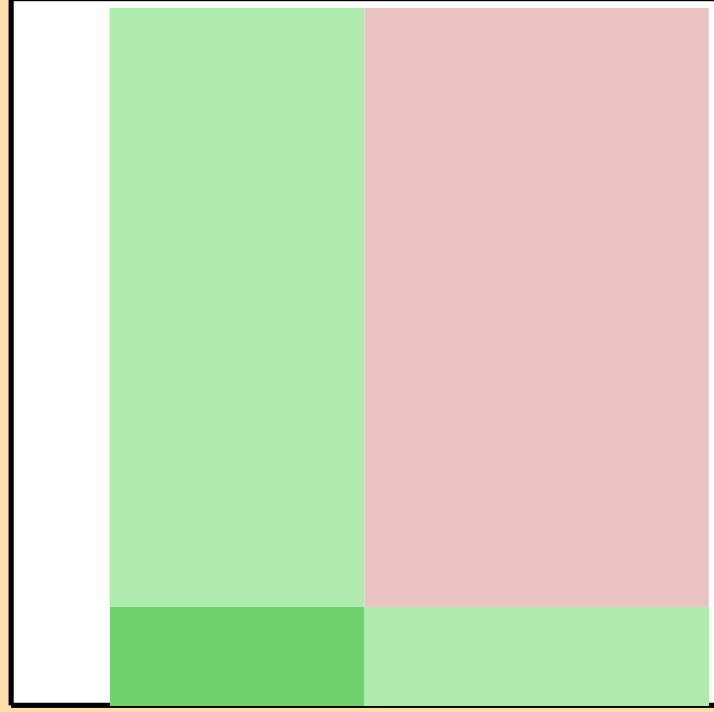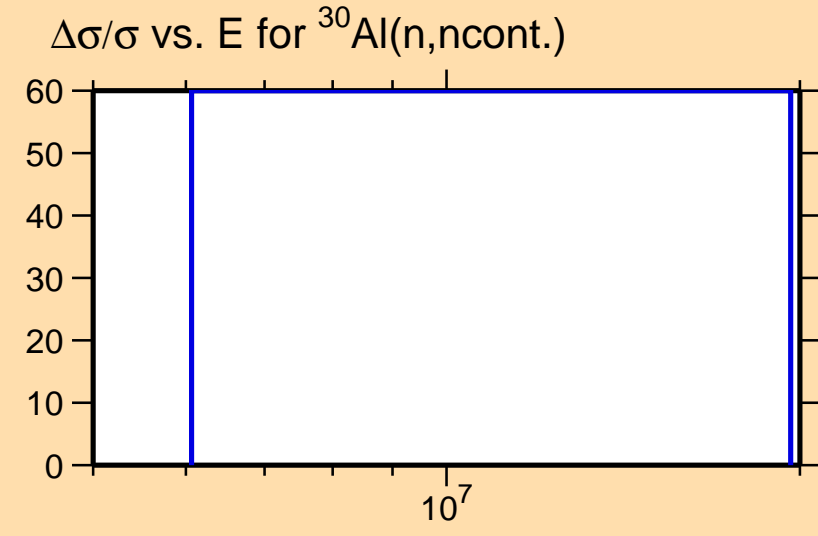



Correlation Matrix



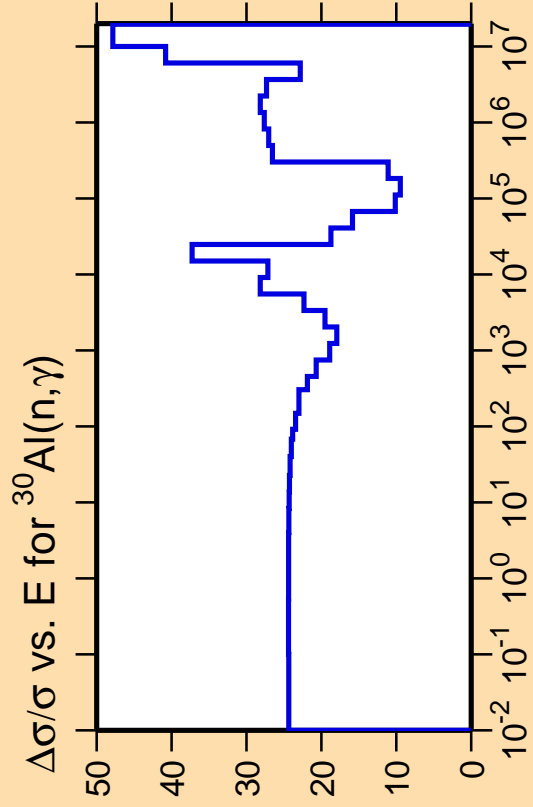

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

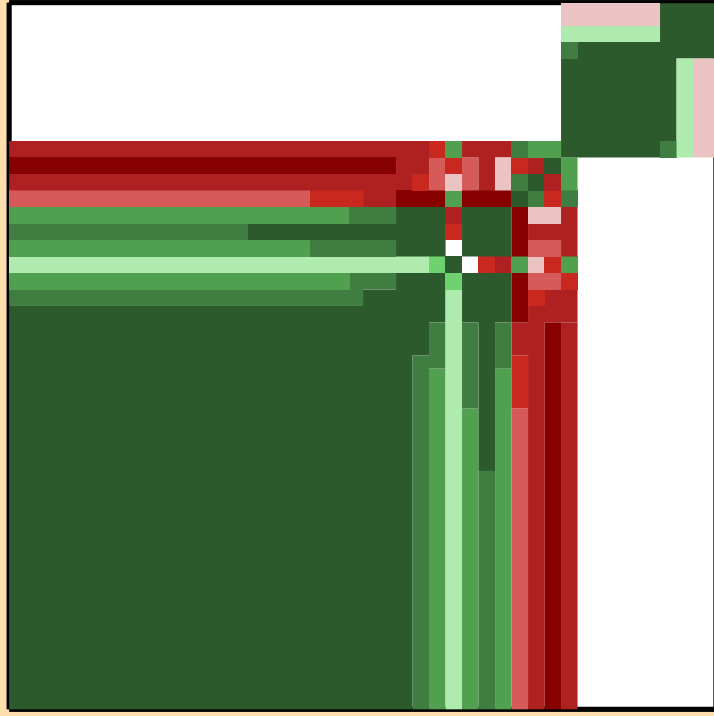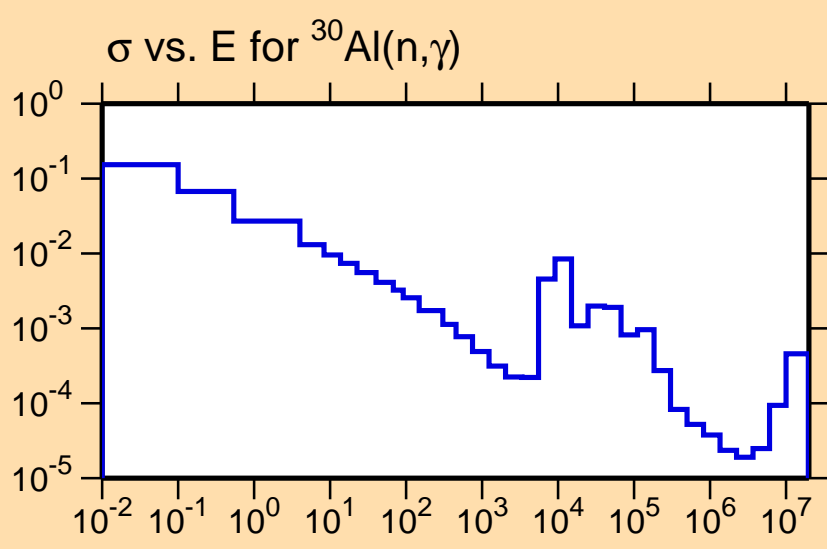

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

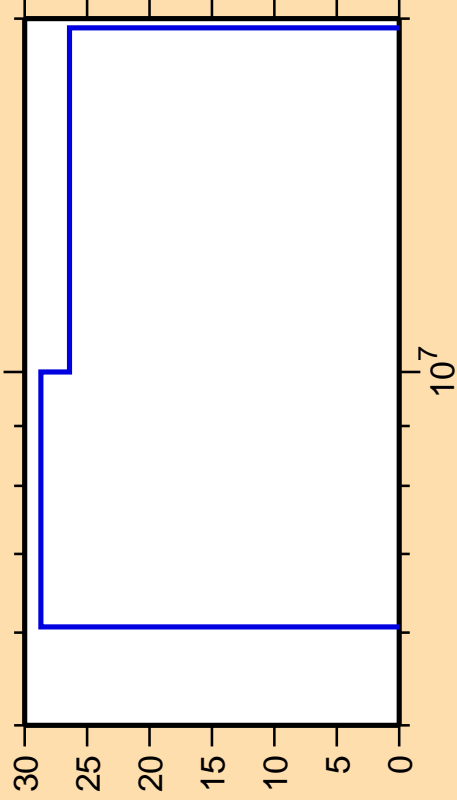

Ordinate scale is %
relative standard deviation.





Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\gamma)$

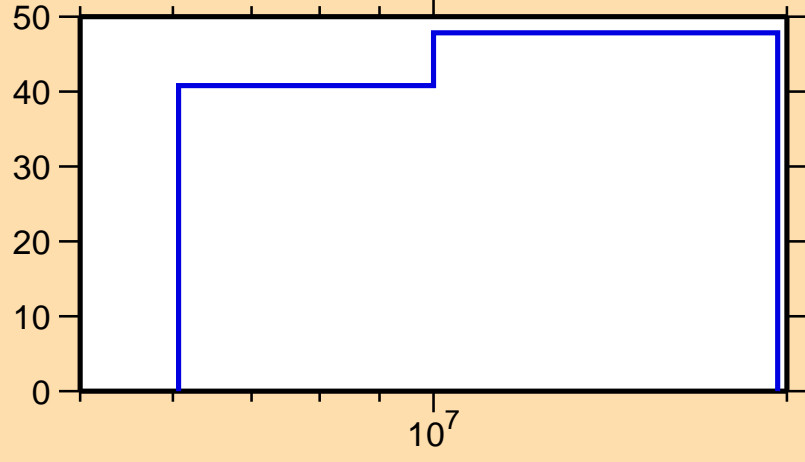


Correlation Matrix



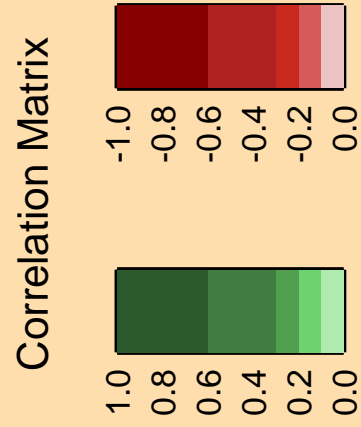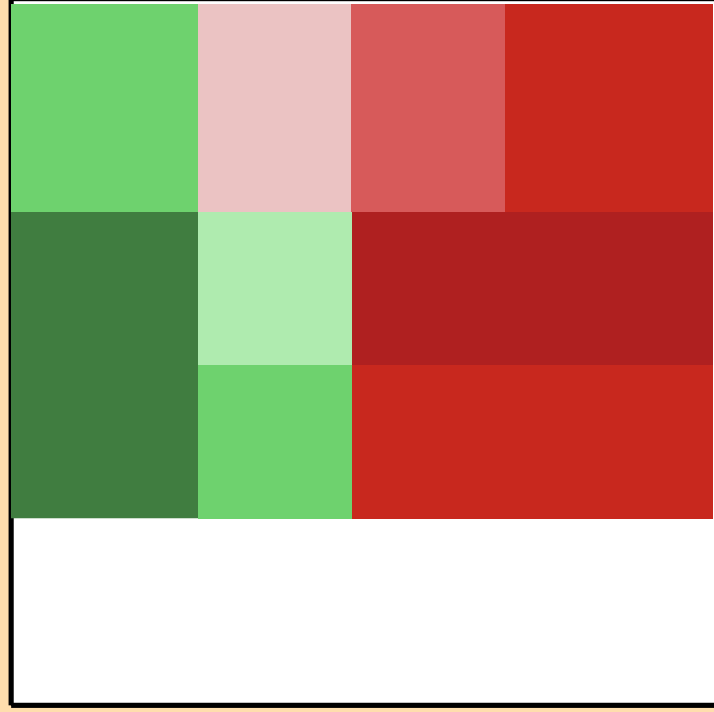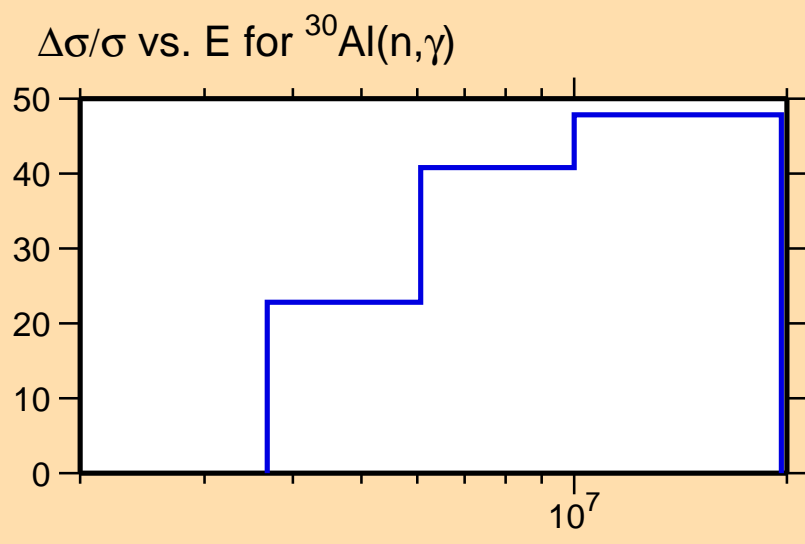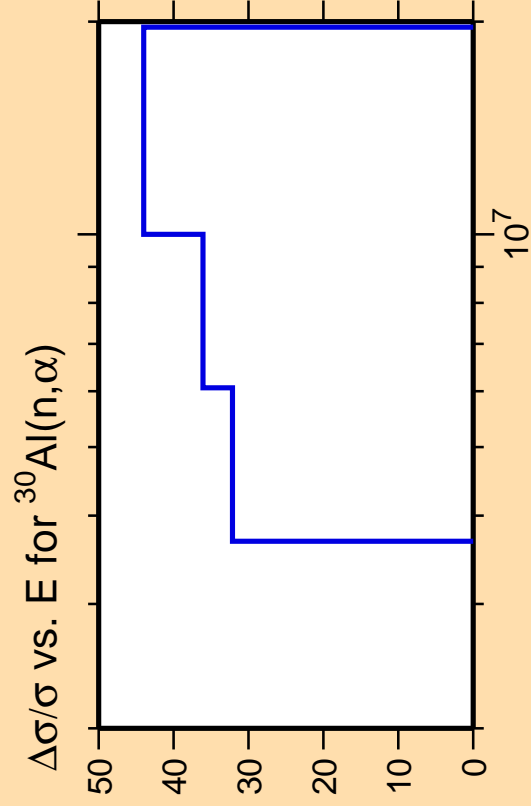


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

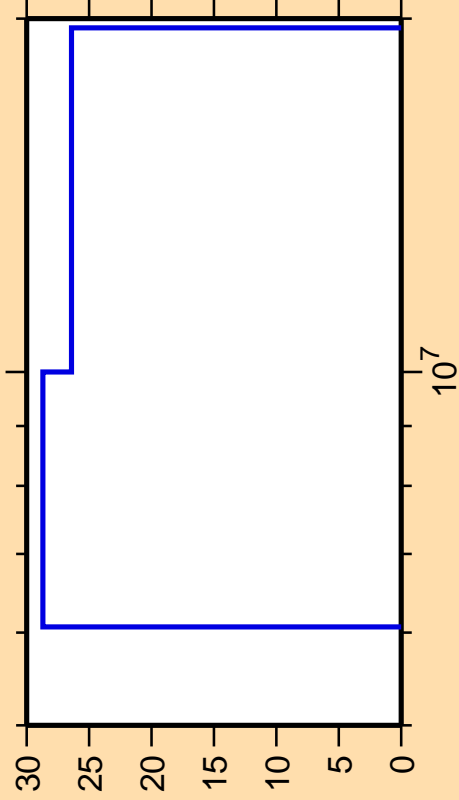

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,p)$

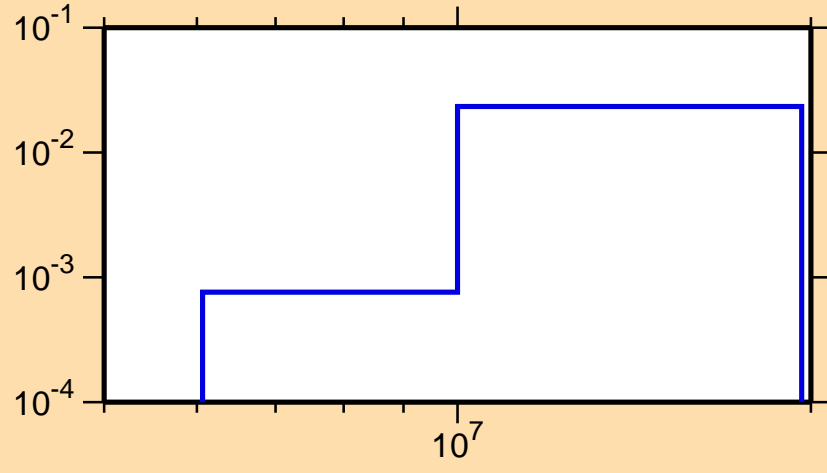

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\alpha)$

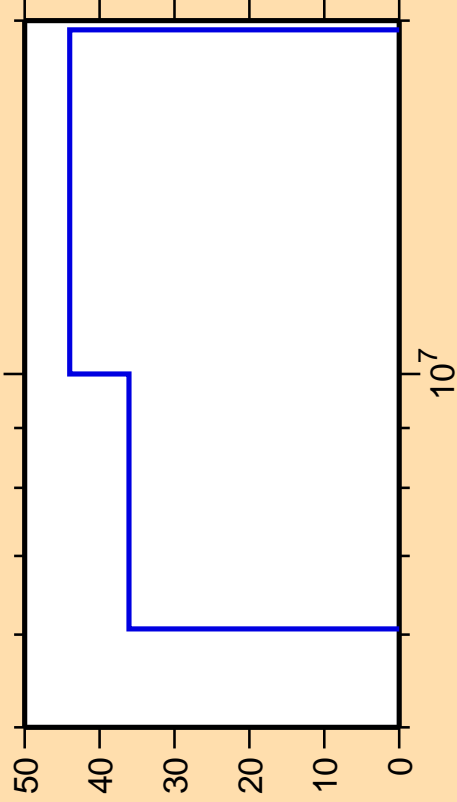

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p)$

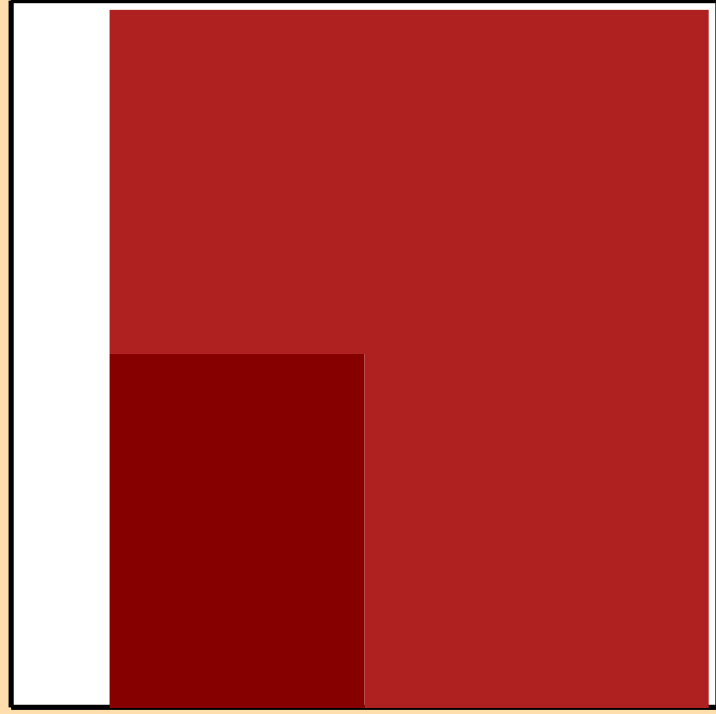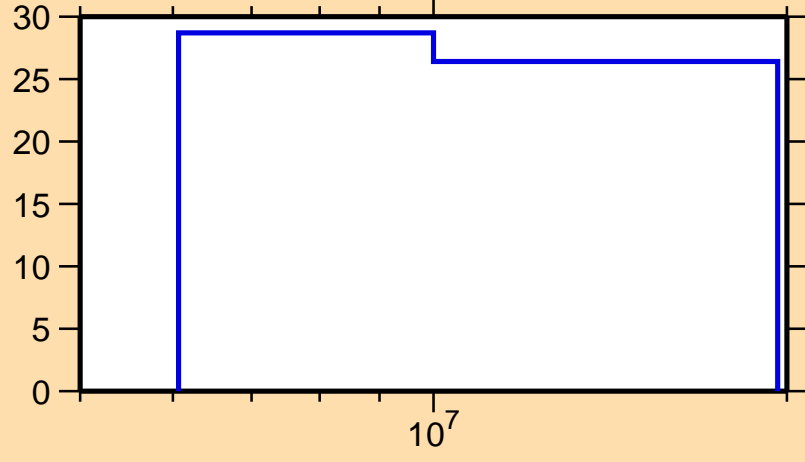

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,d)$

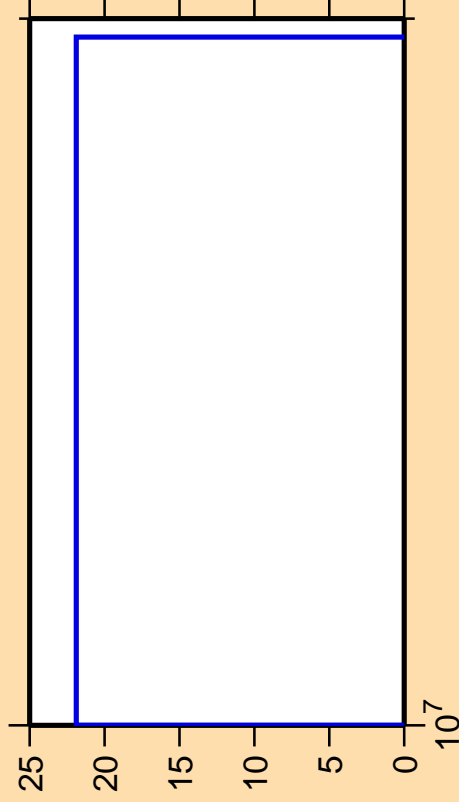


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,d)$

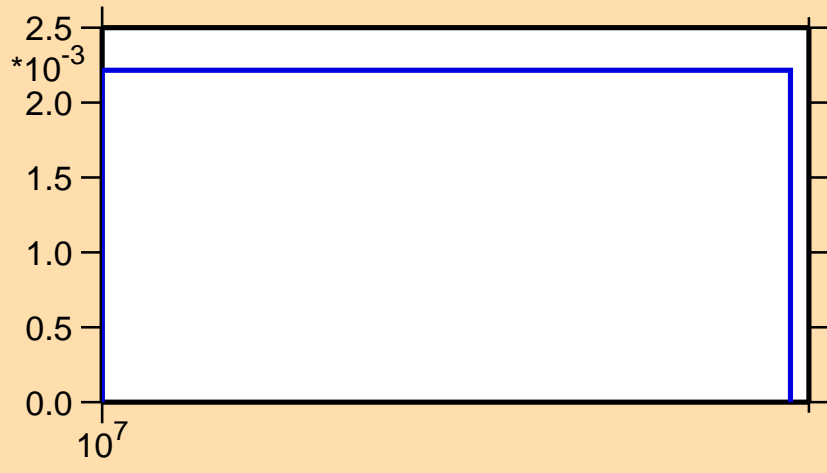

Correlation Matrix

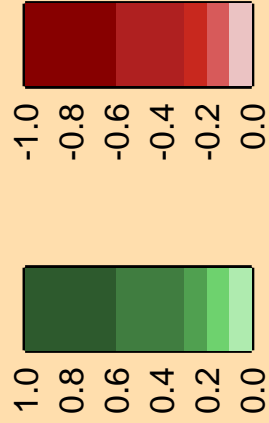



$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,t)$

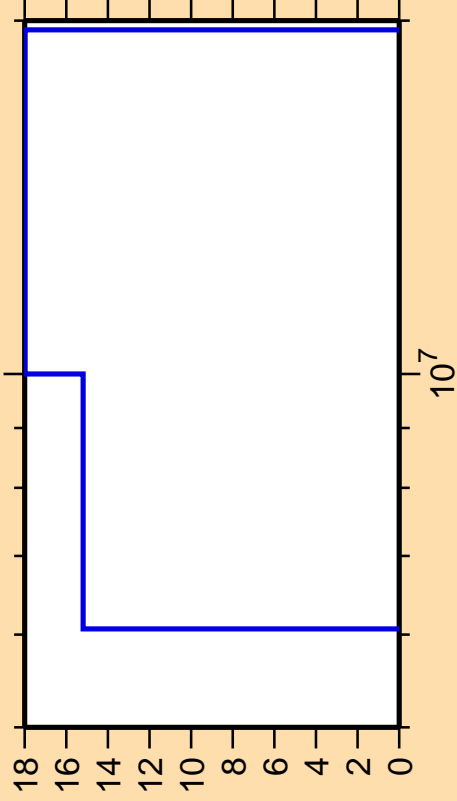

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,t)$

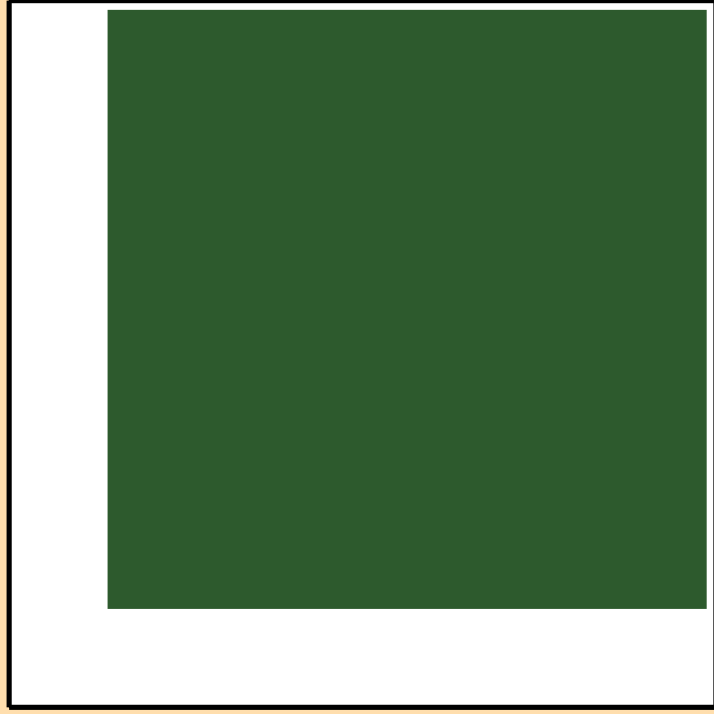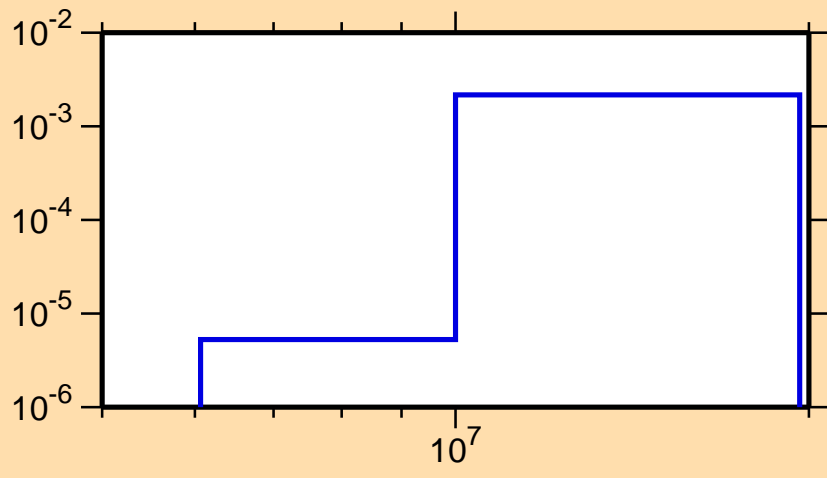

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,\alpha)$

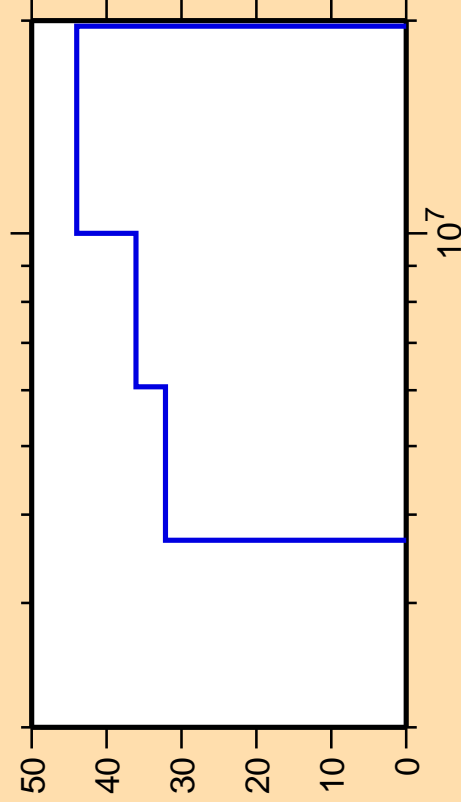

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{30}\text{Al}(n,\alpha)$

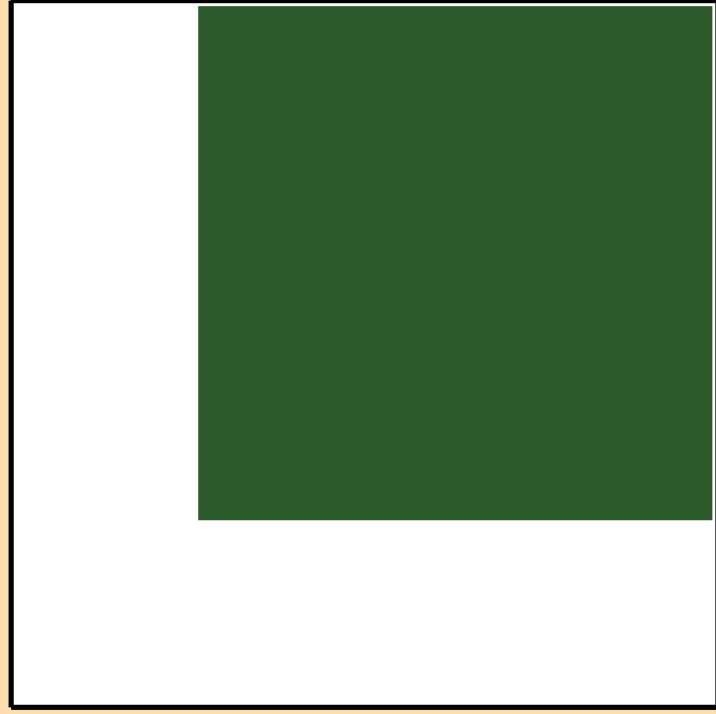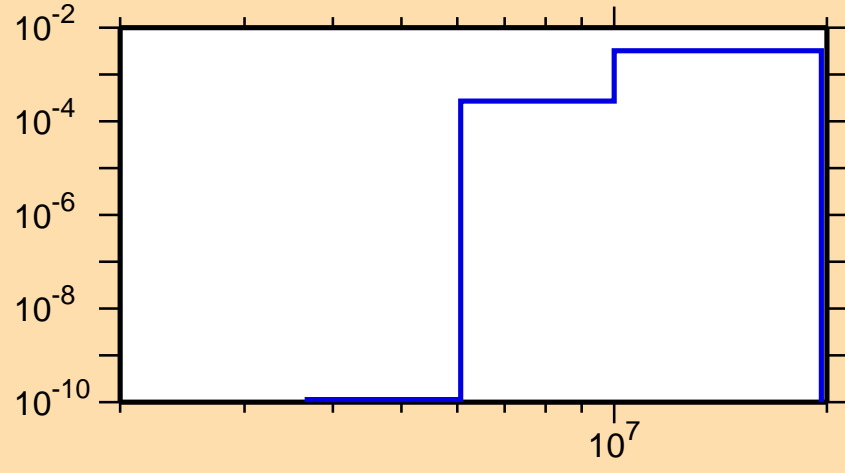

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{30}\text{Al}(n,p\alpha)$

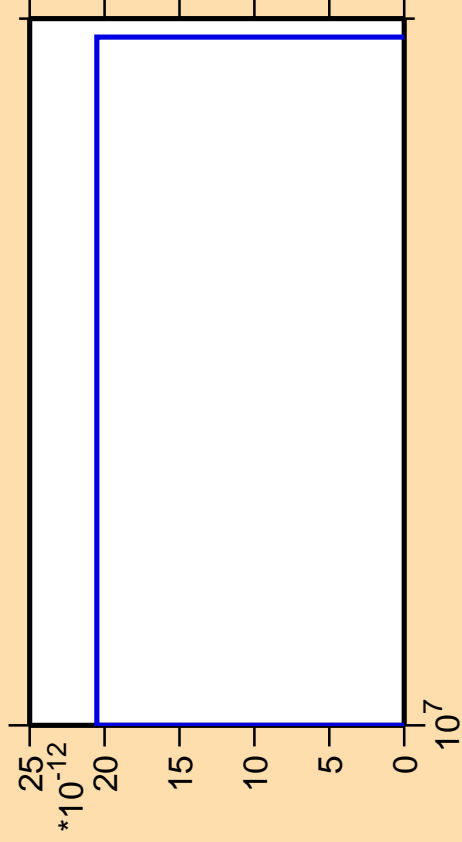

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{30}\text{Al}(n,p\alpha)$

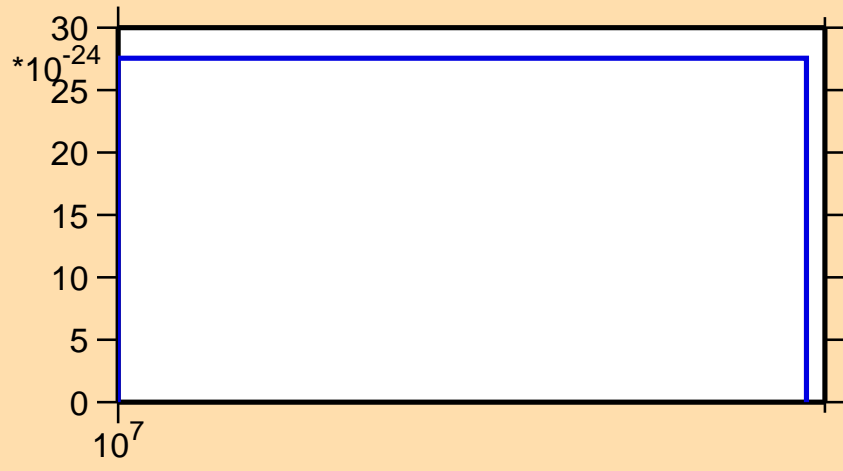

Correlation Matrix

