


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).



Correlation Matrix

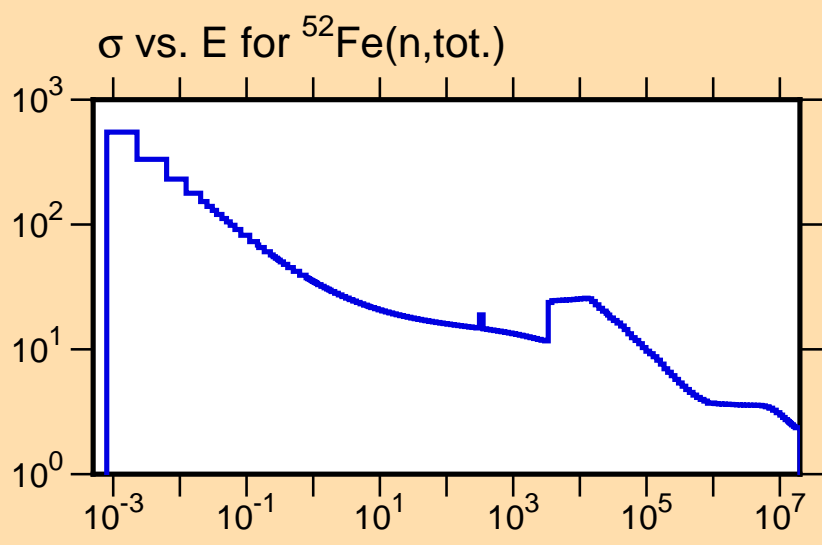



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

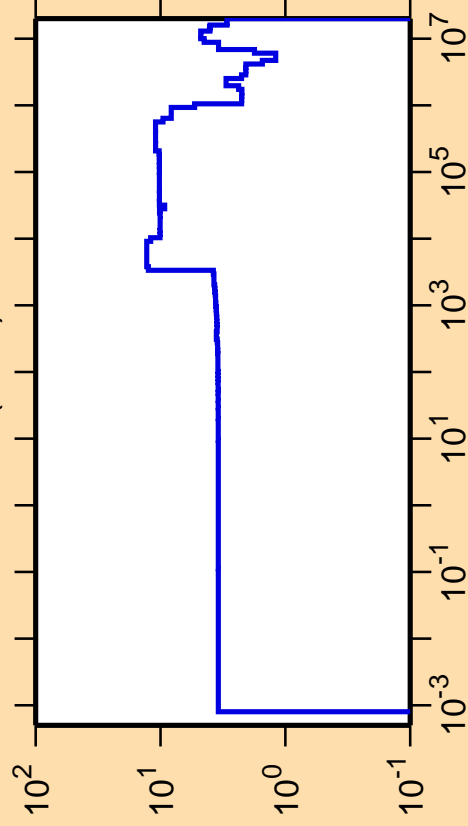

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{tot.})$

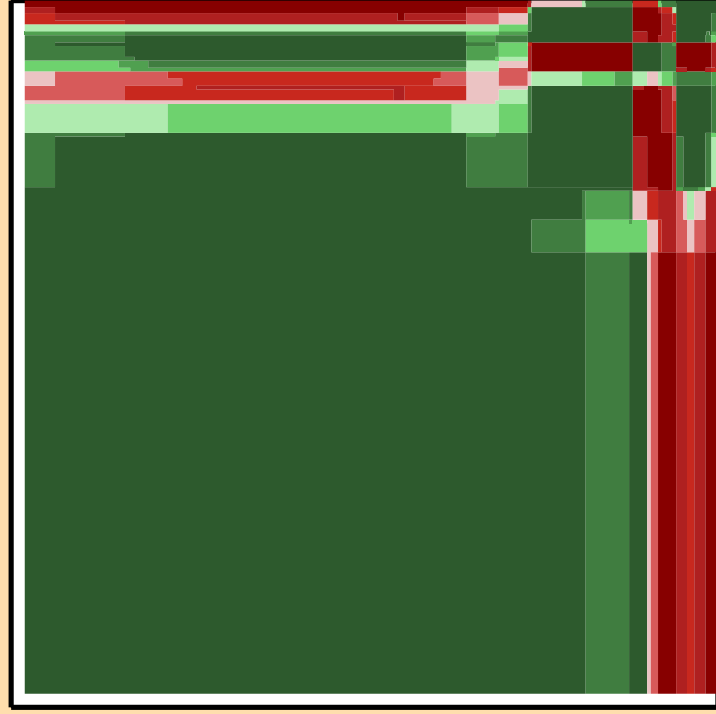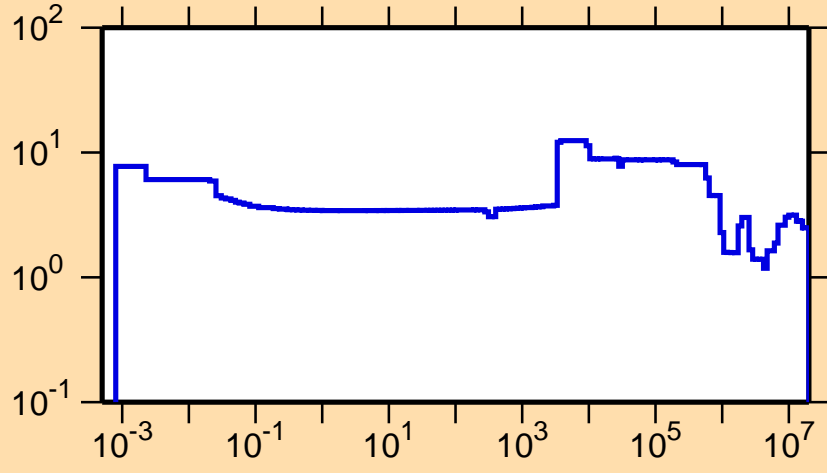

Correlation Matrix



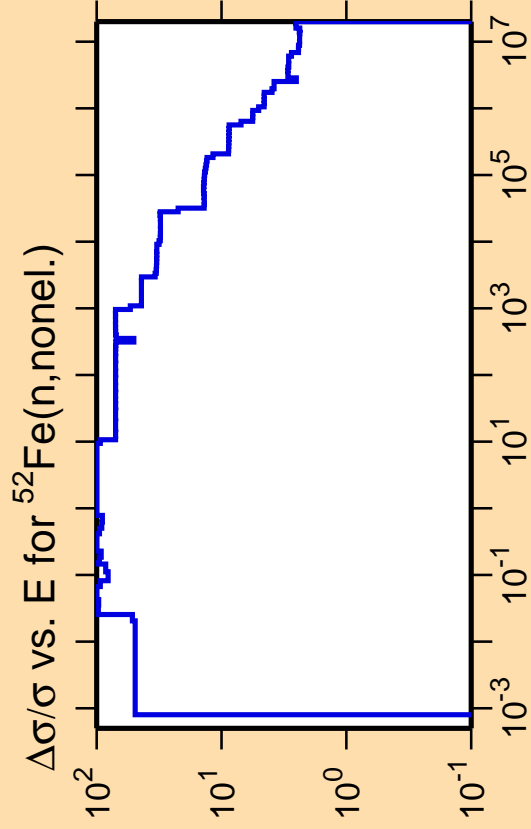


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{tot.})$

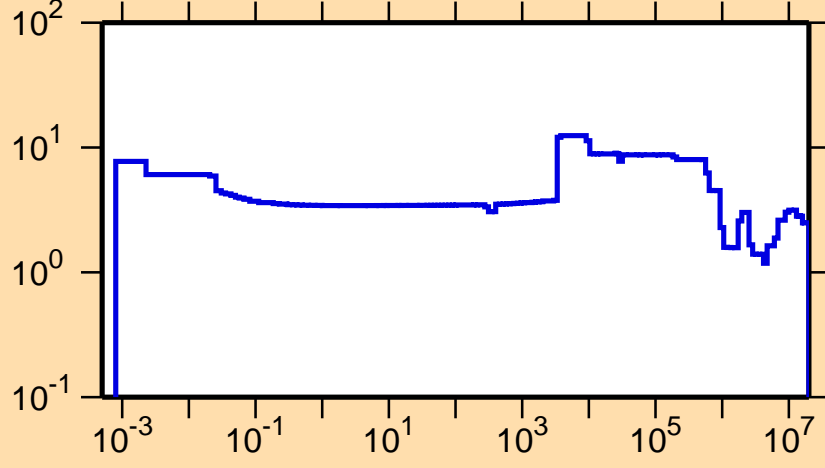



Correlation Matrix



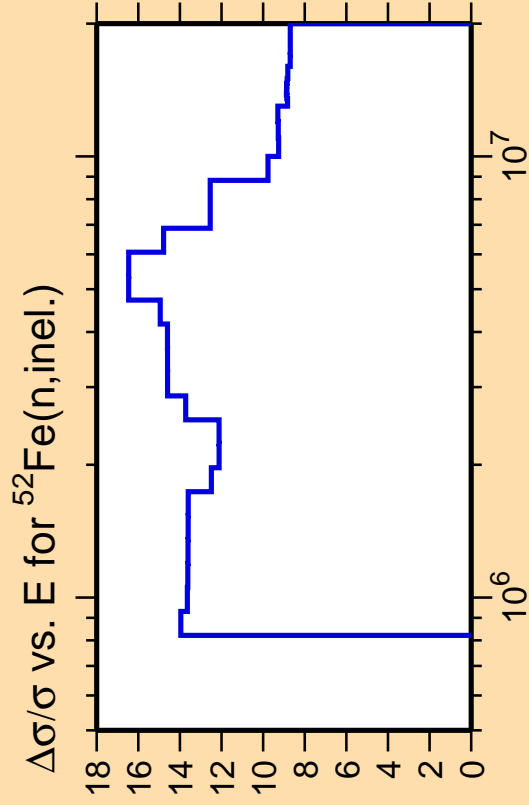

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

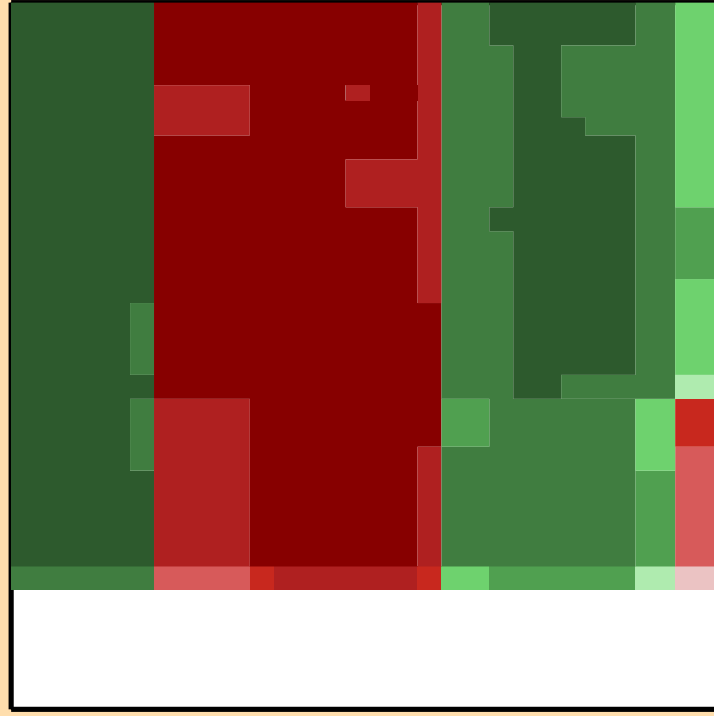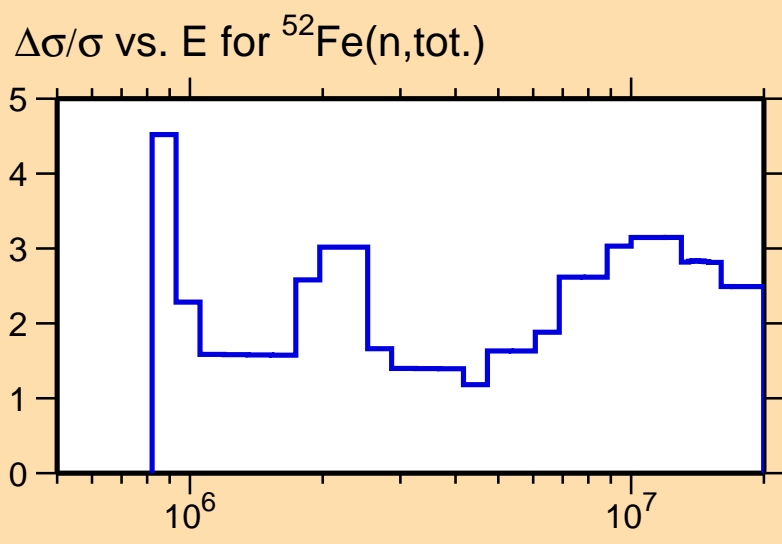

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$


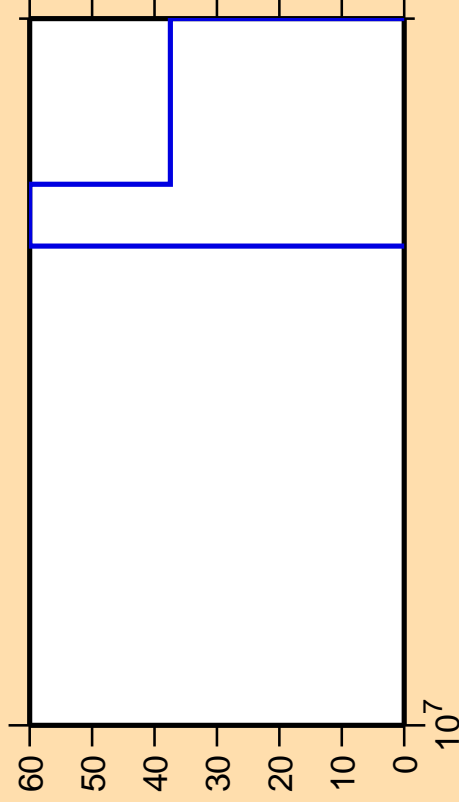


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{tot.})$

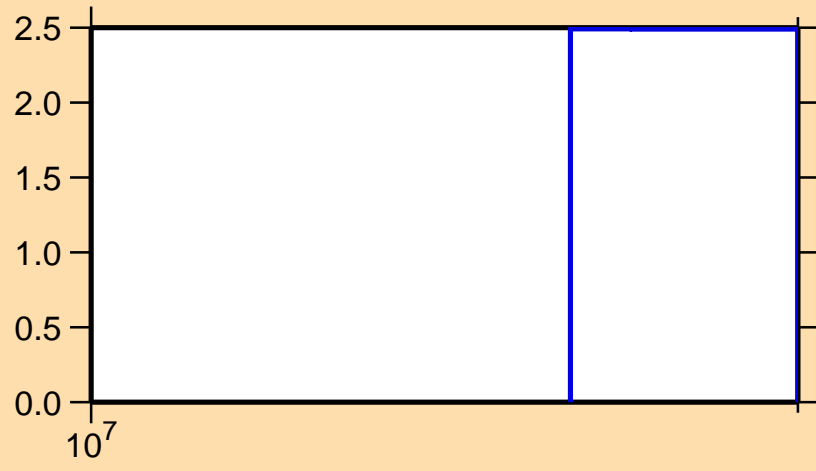



Correlation Matrix



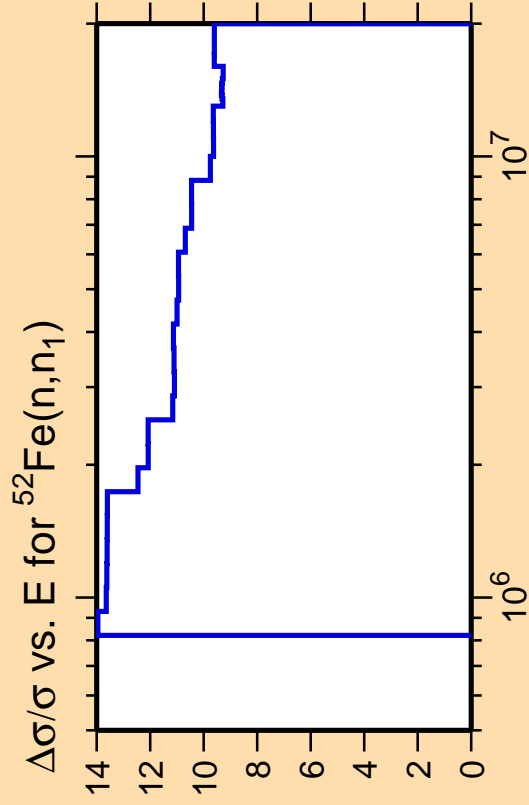


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

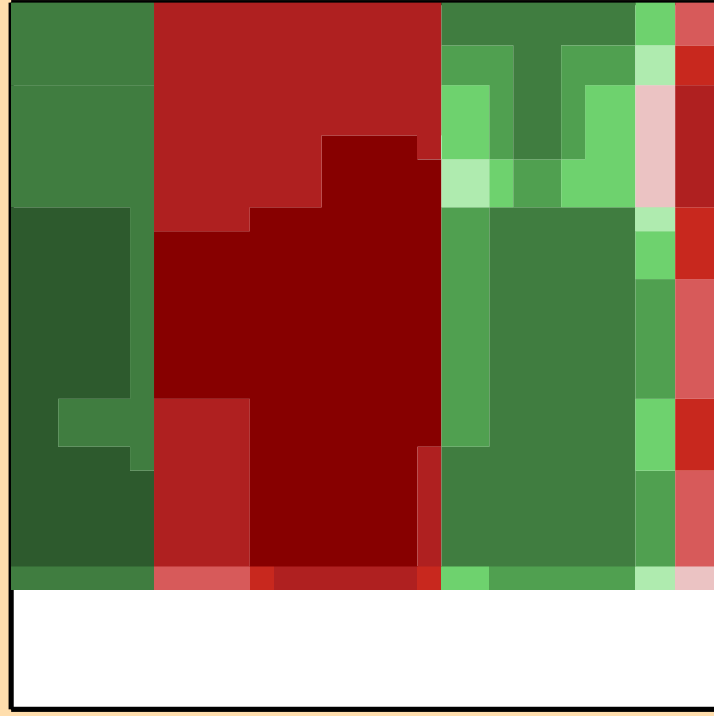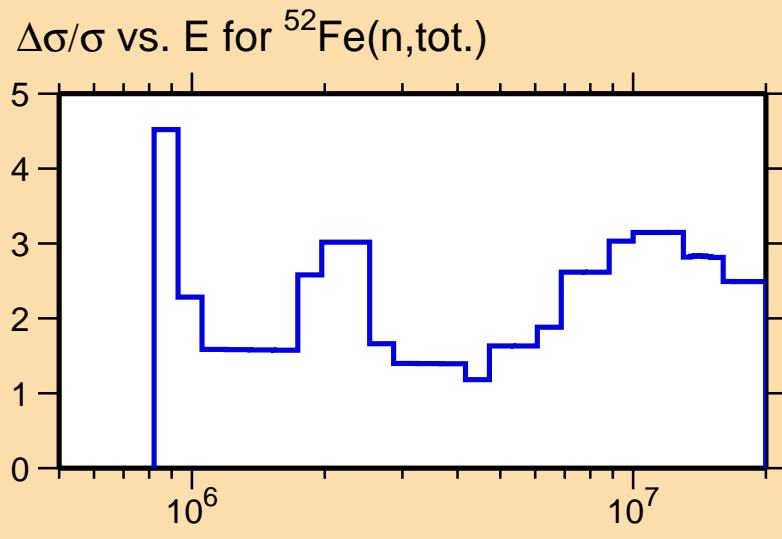



Correlation Matrix



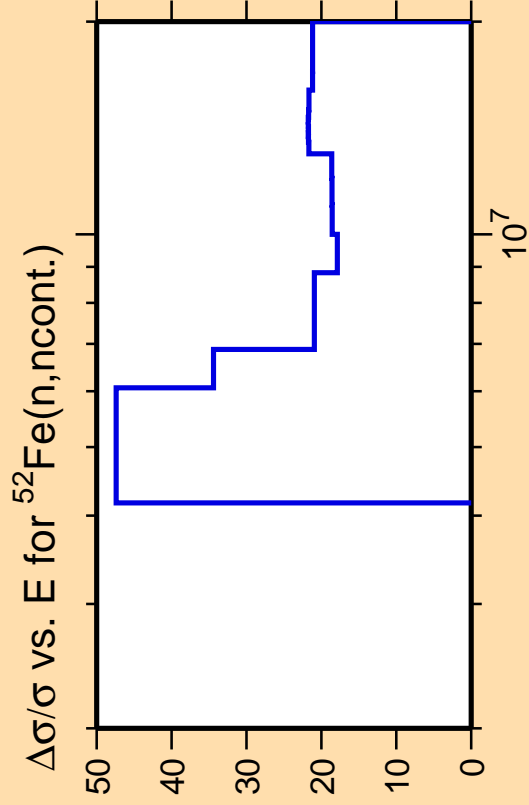


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

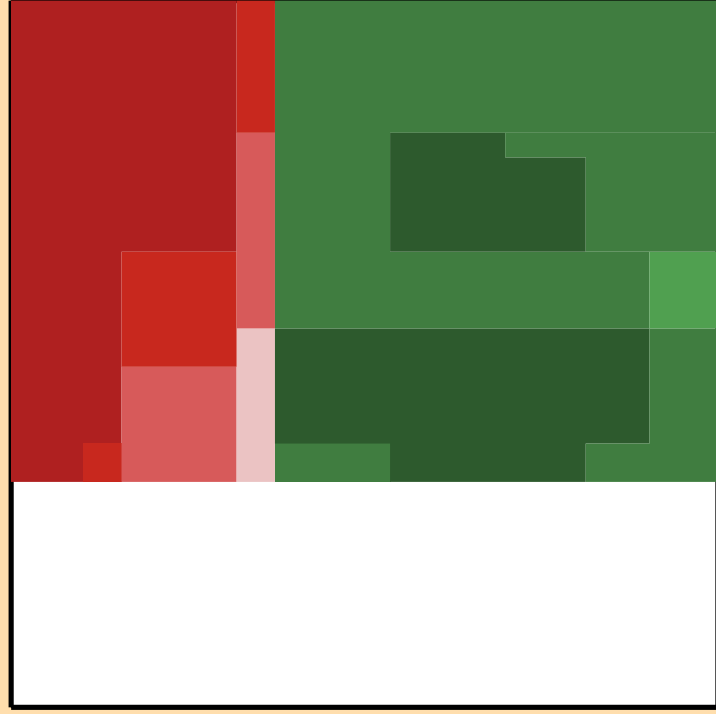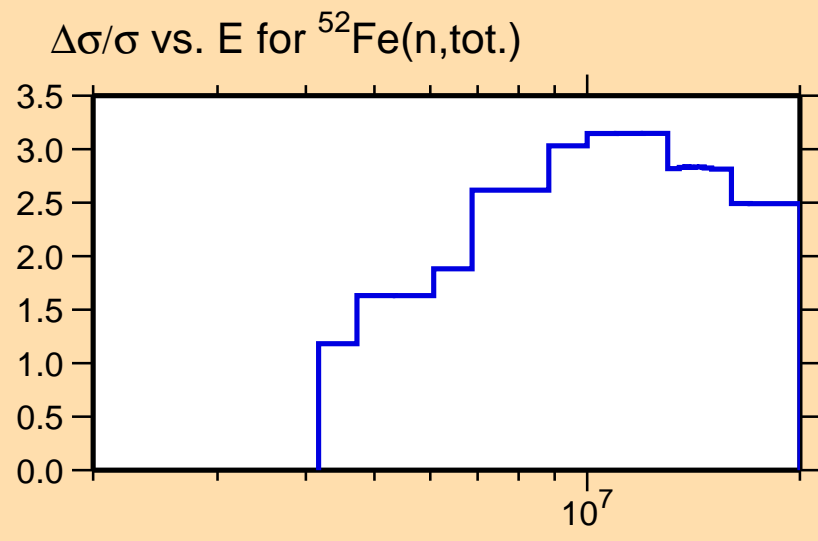

Correlation Matrix





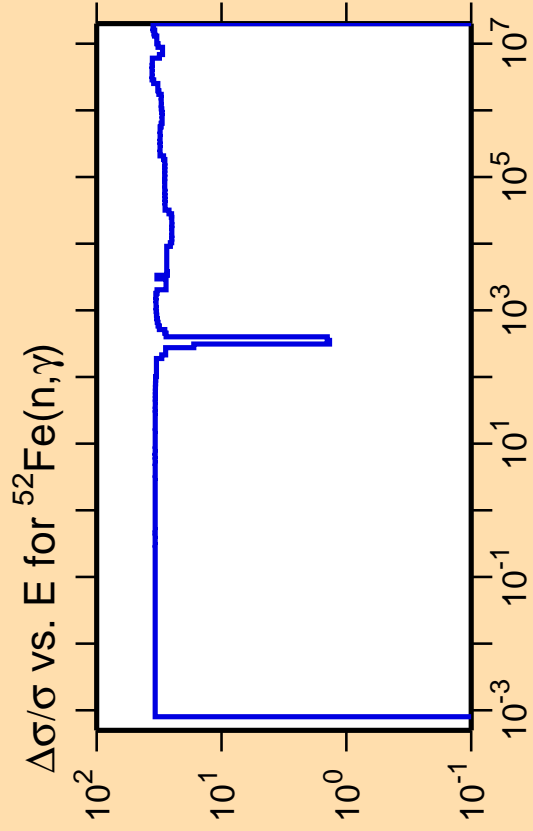

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{tot.})$

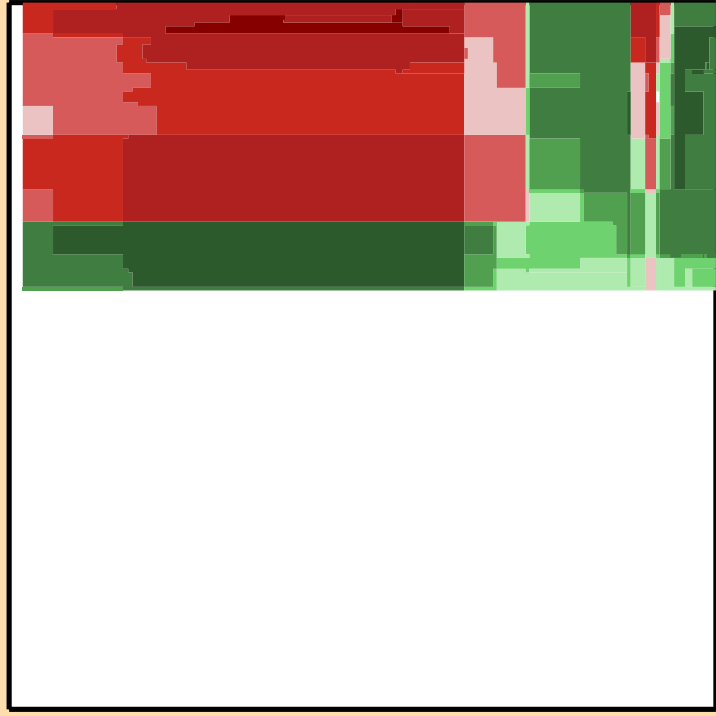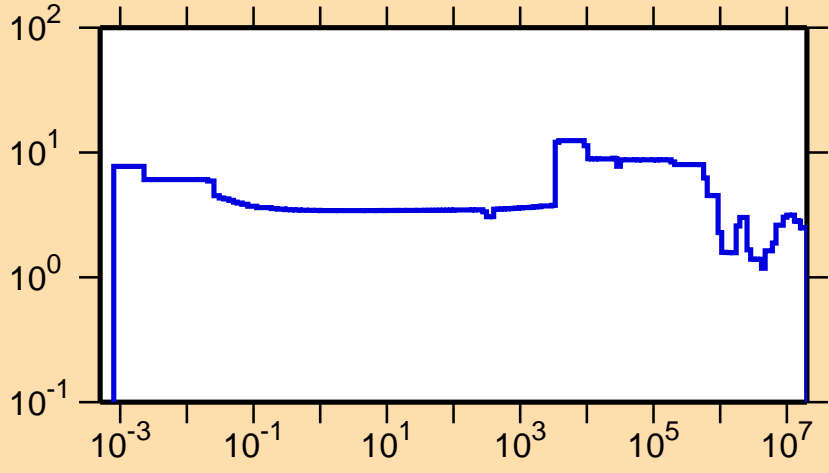

Correlation Matrix






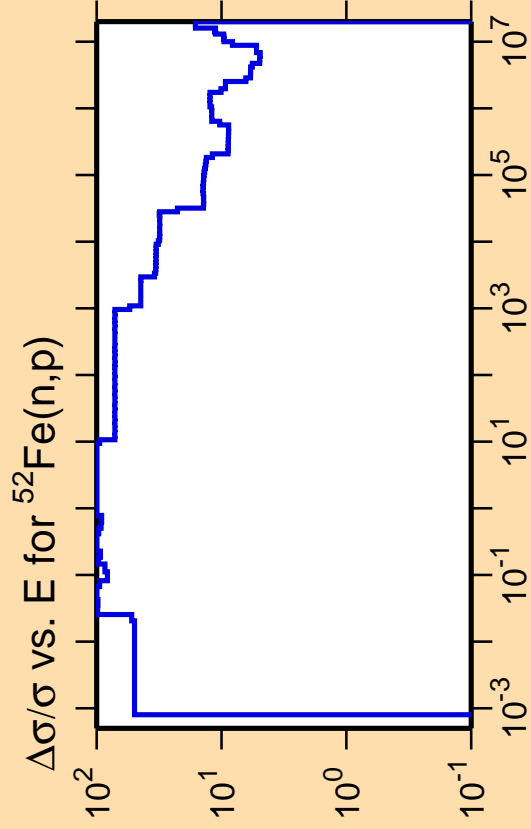


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{tot.})$

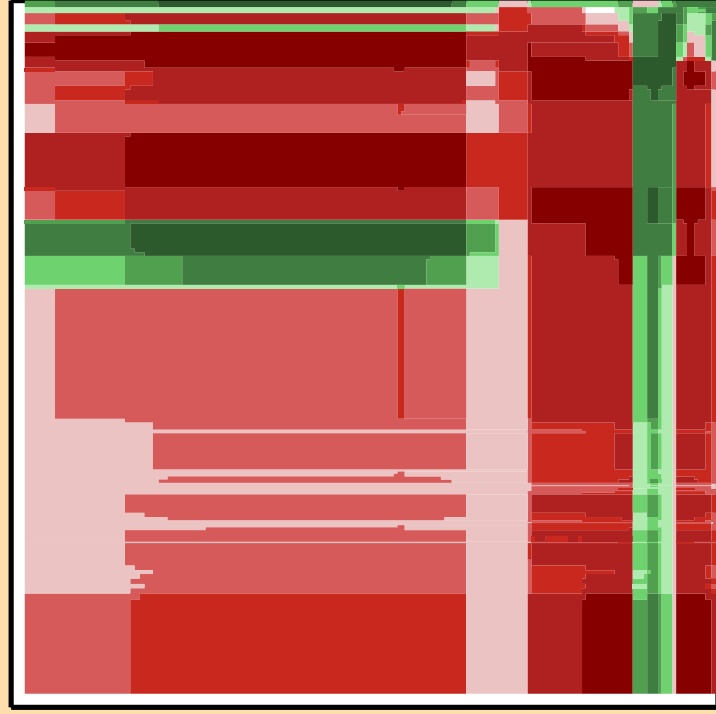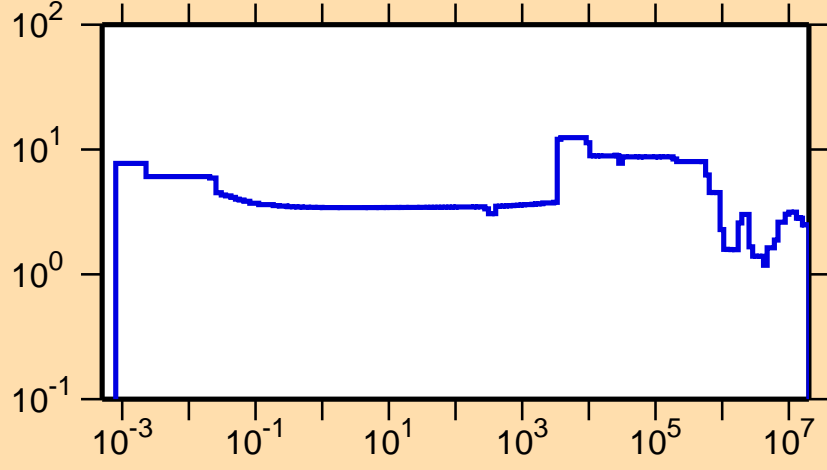

Correlation Matrix




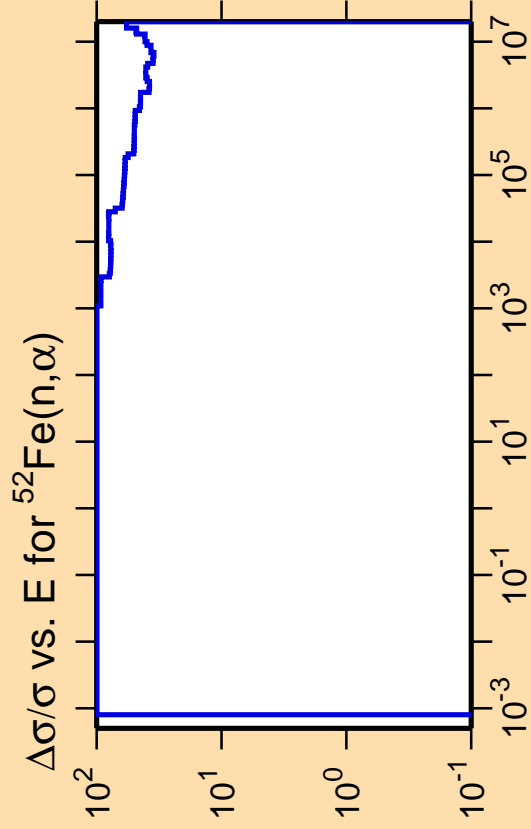


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{tot.})$

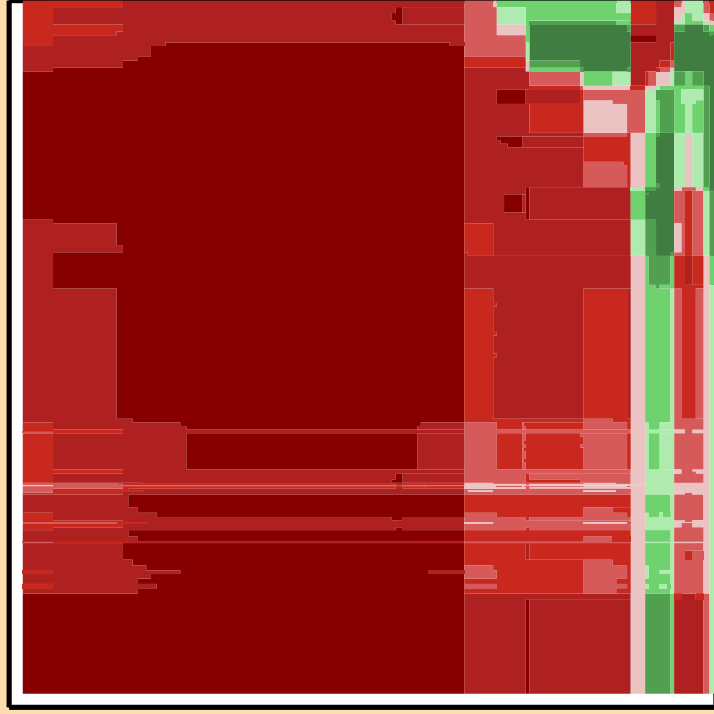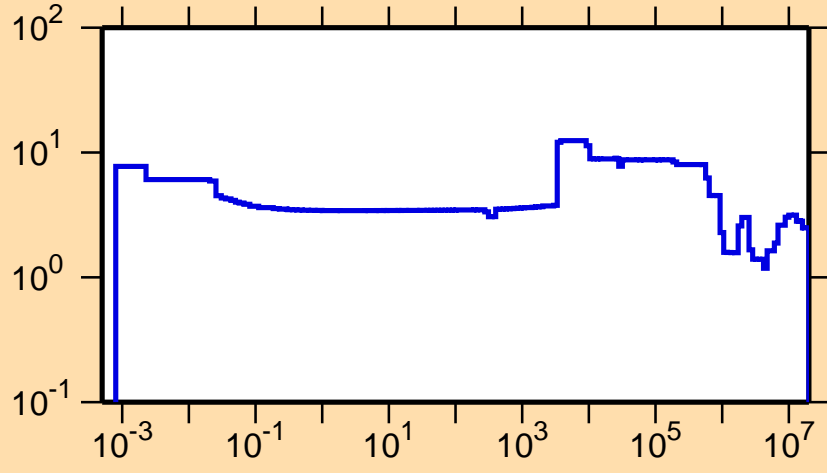

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

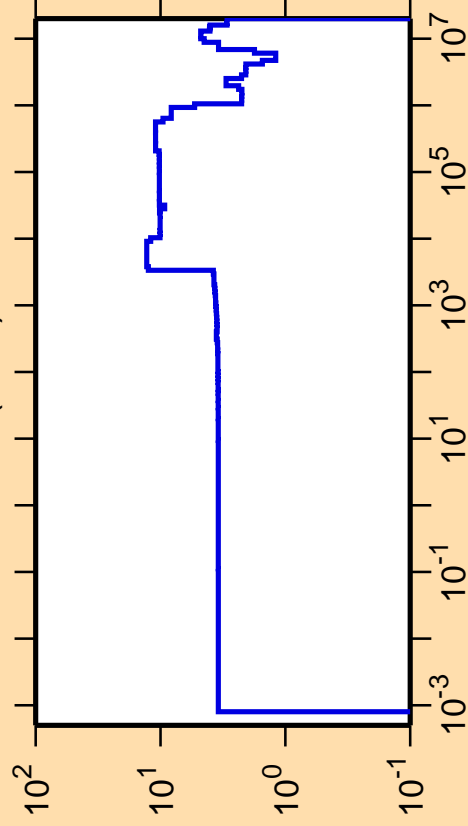

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

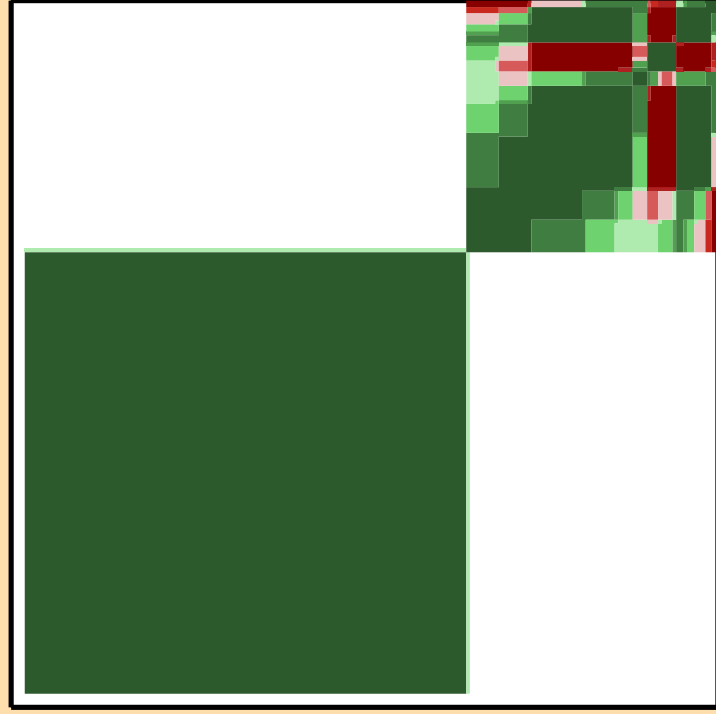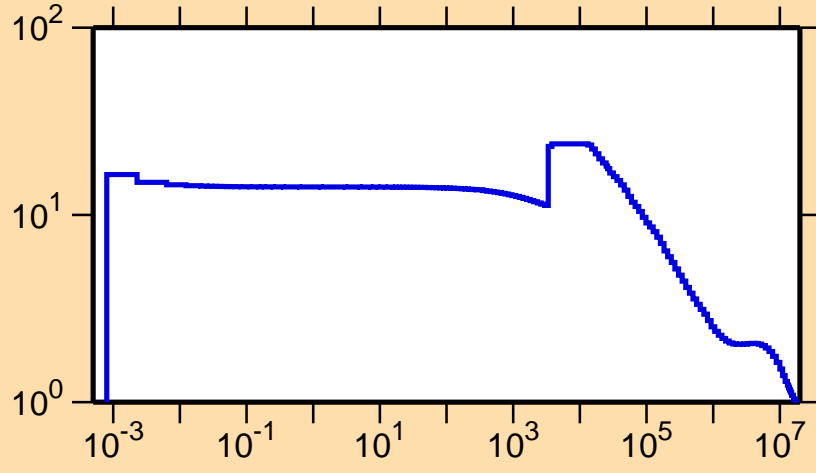

Correlation Matrix




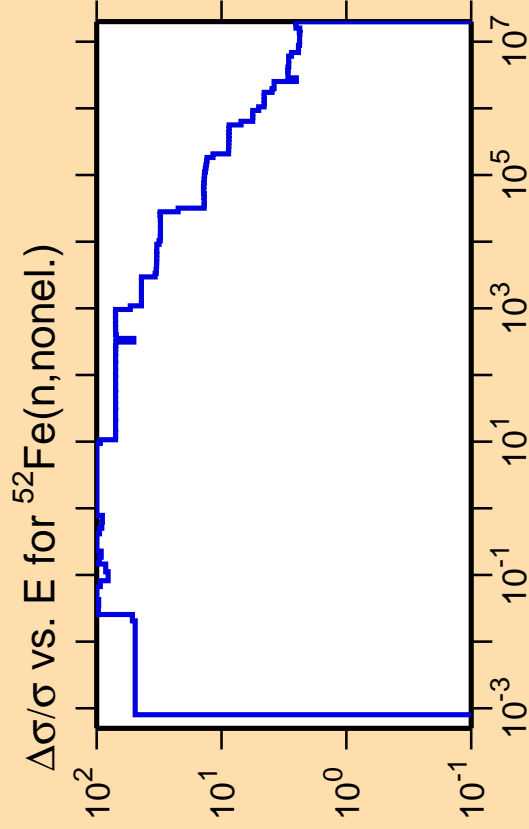


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

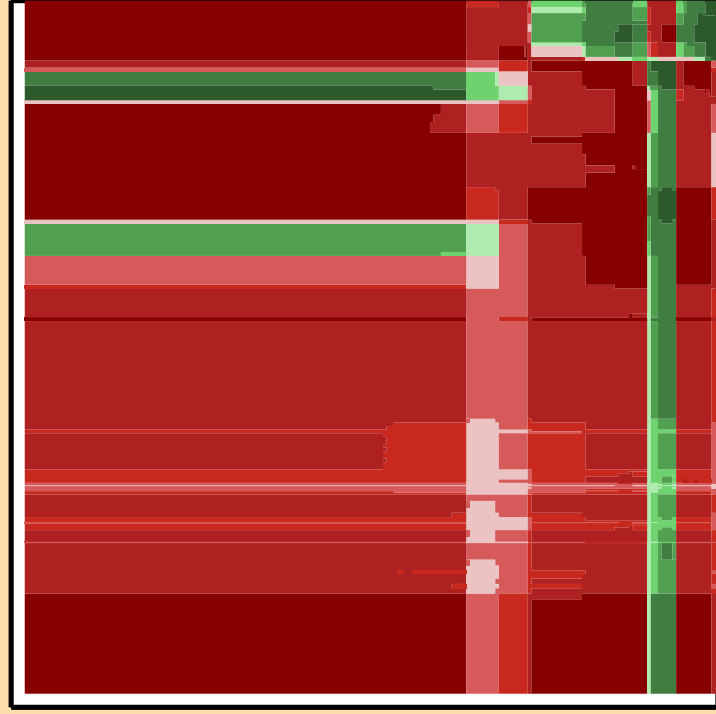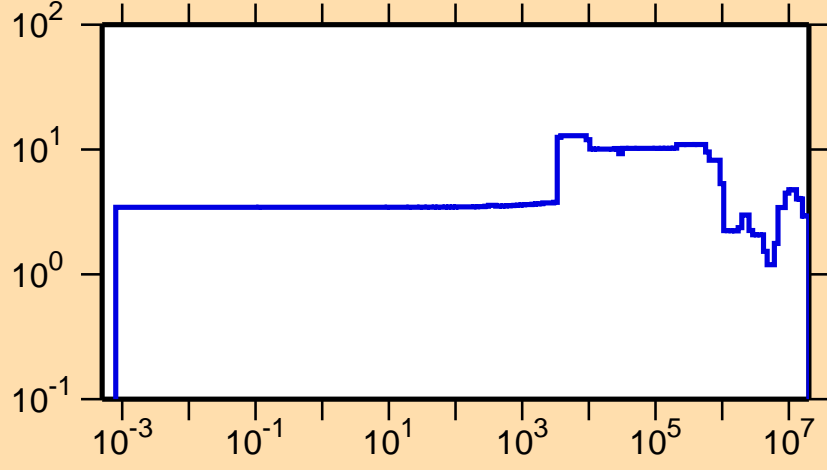

Correlation Matrix





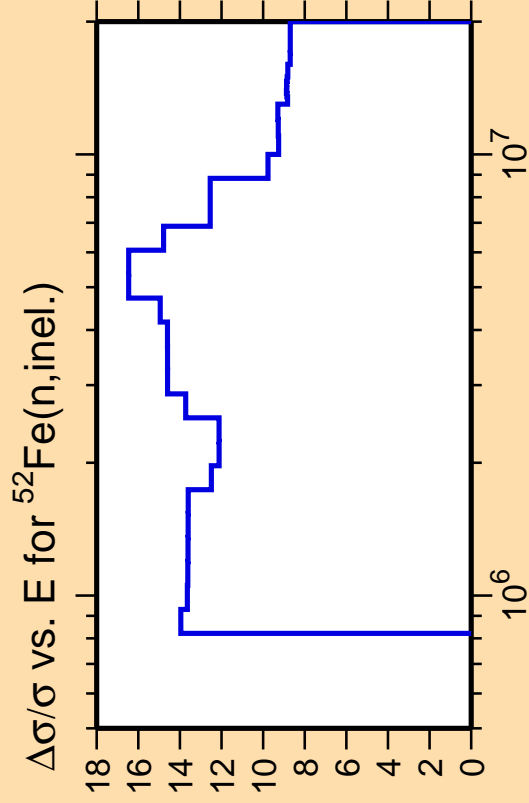

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

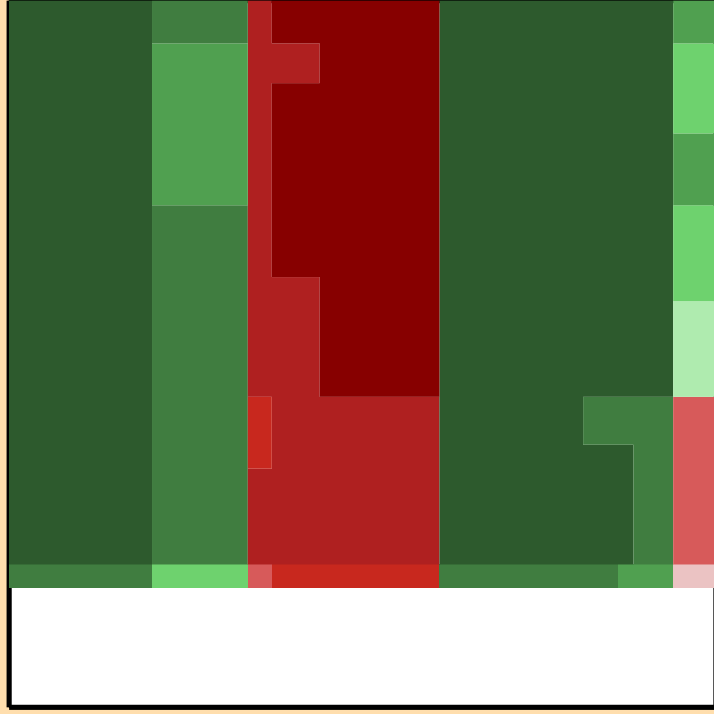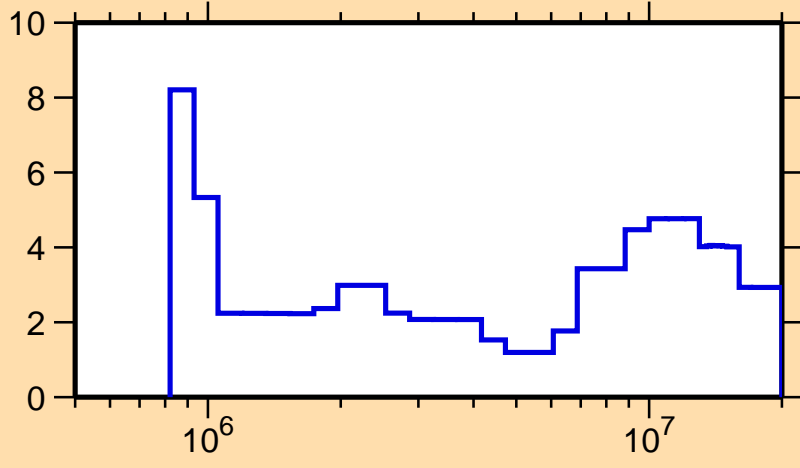

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$


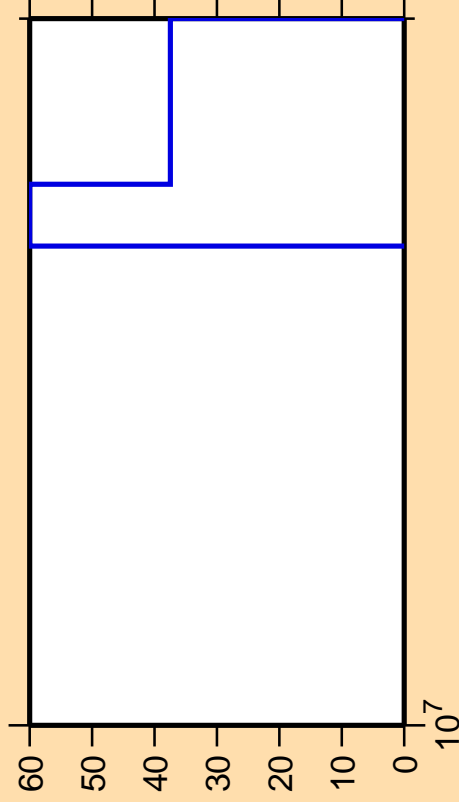


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

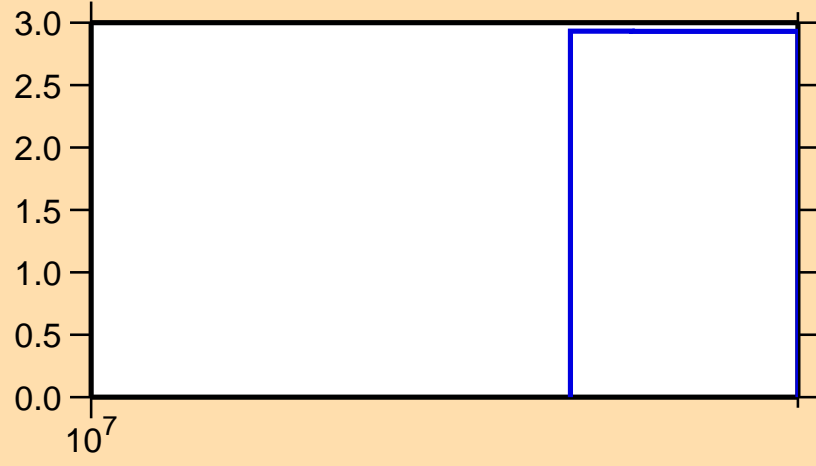

Correlation Matrix





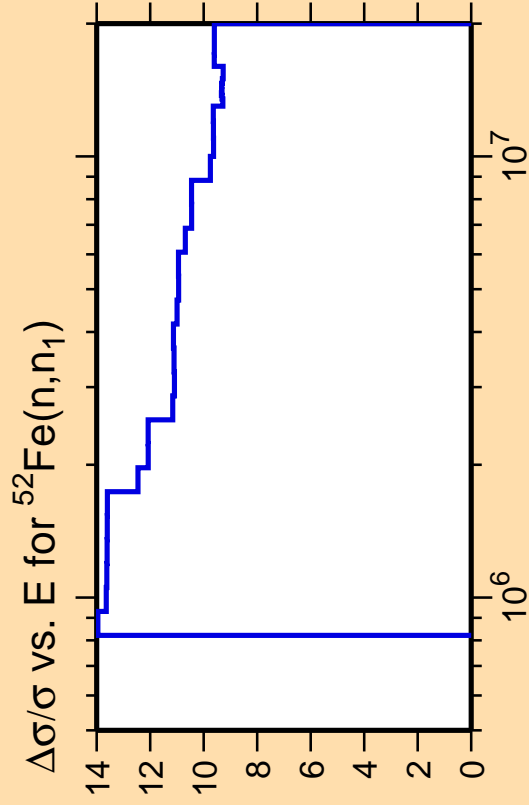

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

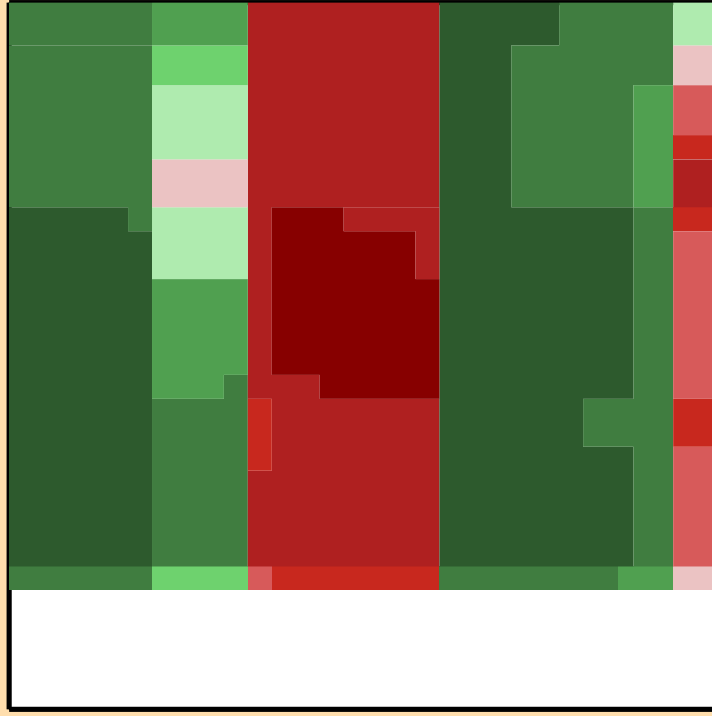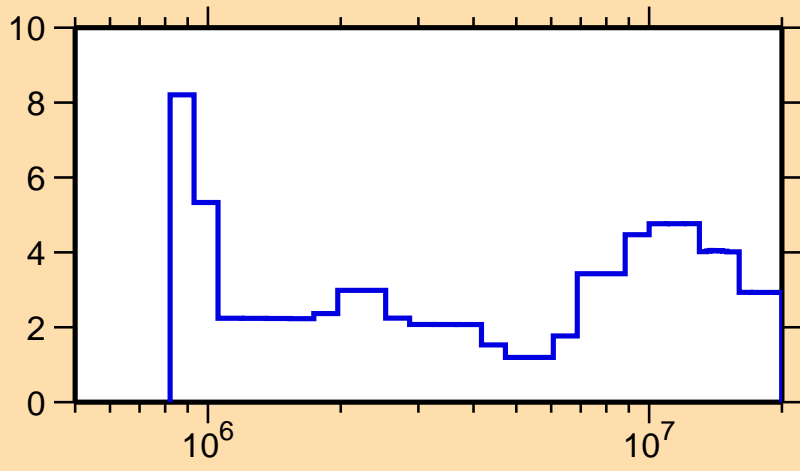

Correlation Matrix





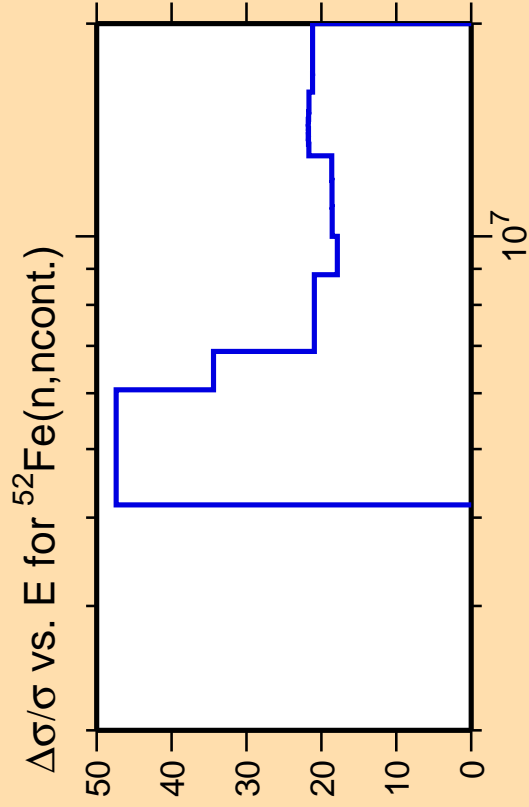

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

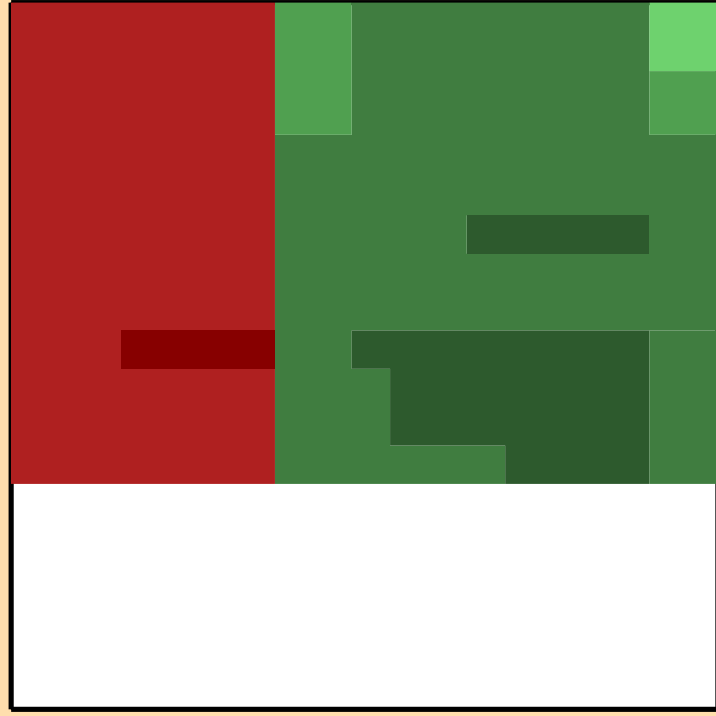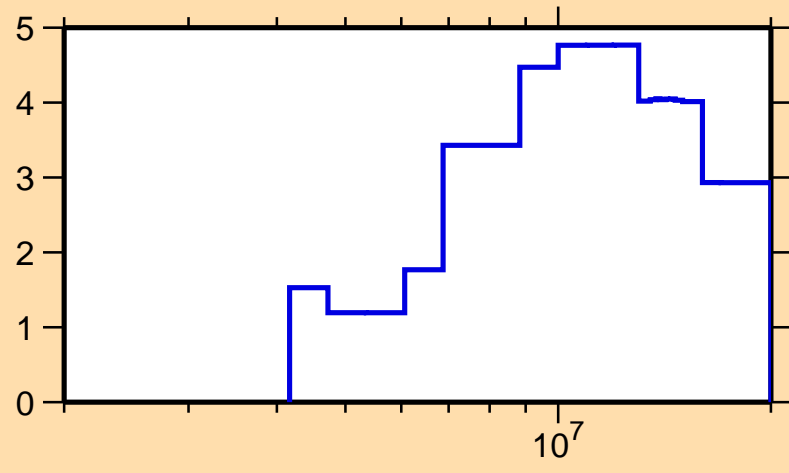

Correlation Matrix







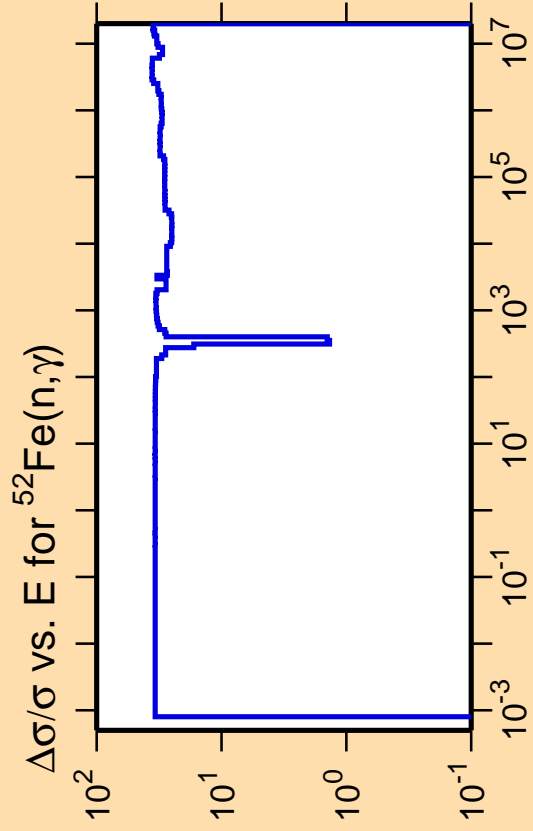

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

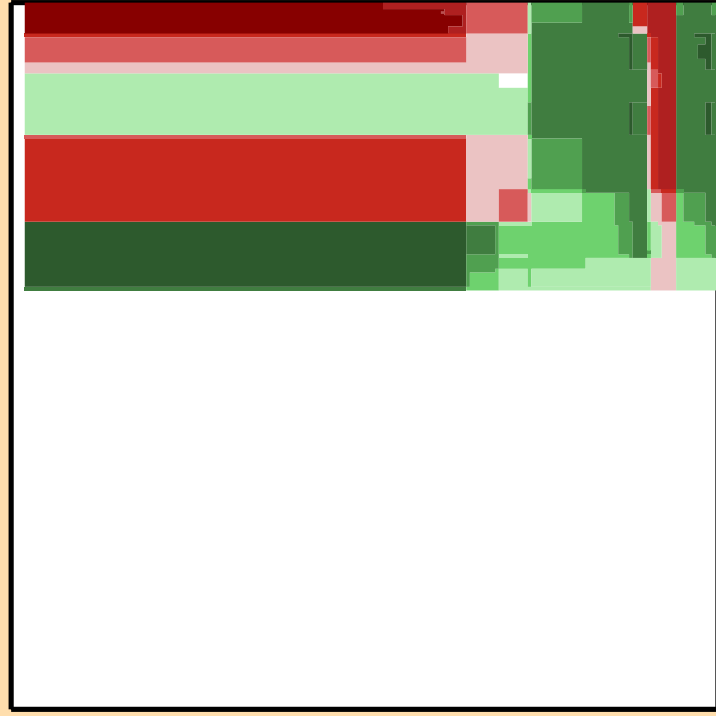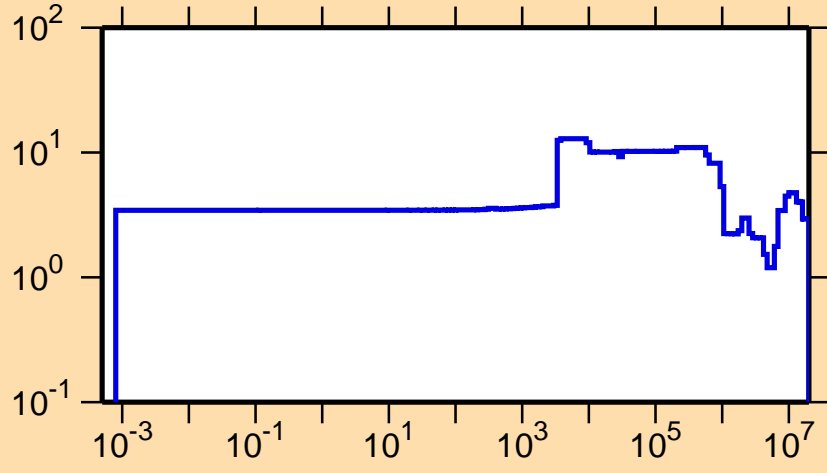

Correlation Matrix




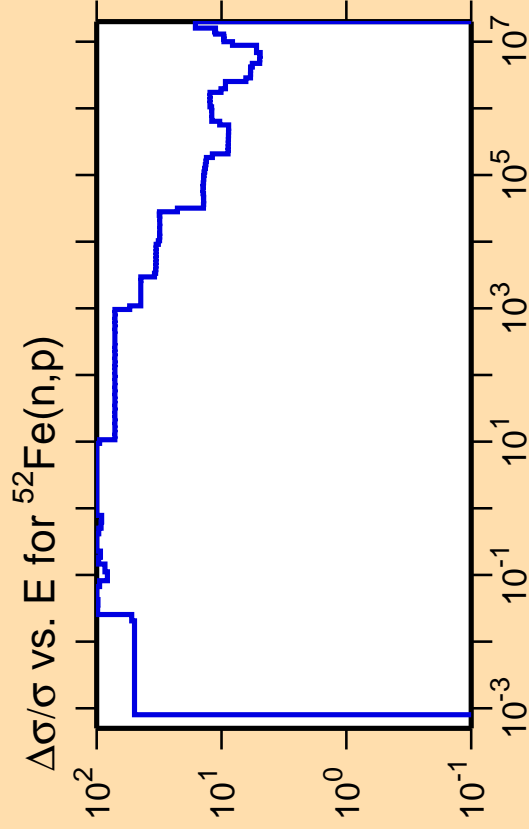


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,el.)$

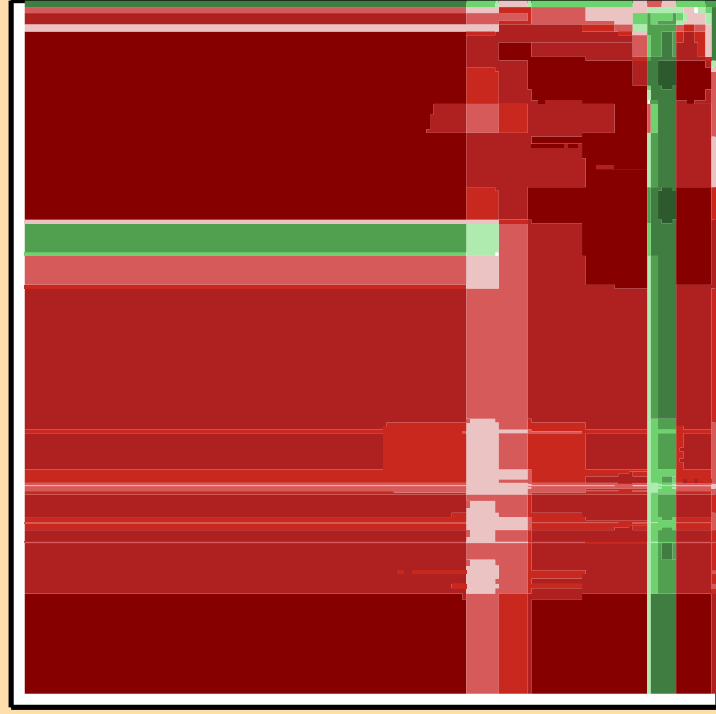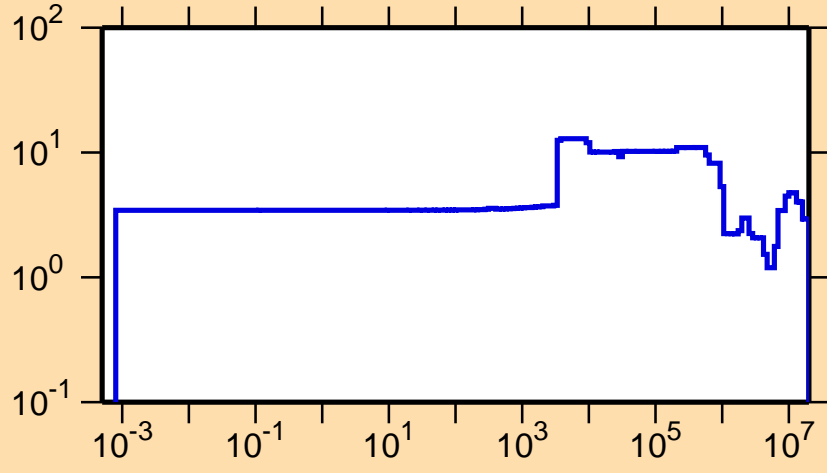

Correlation Matrix




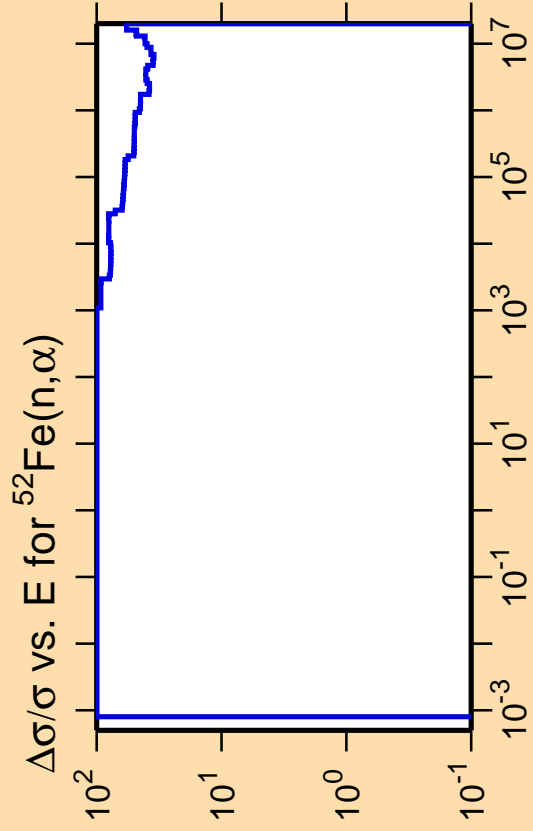


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{el.})$

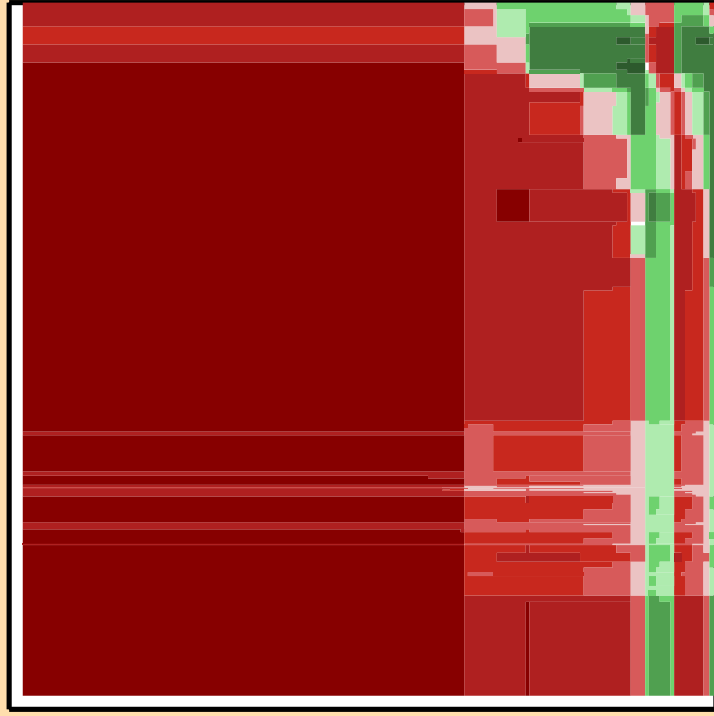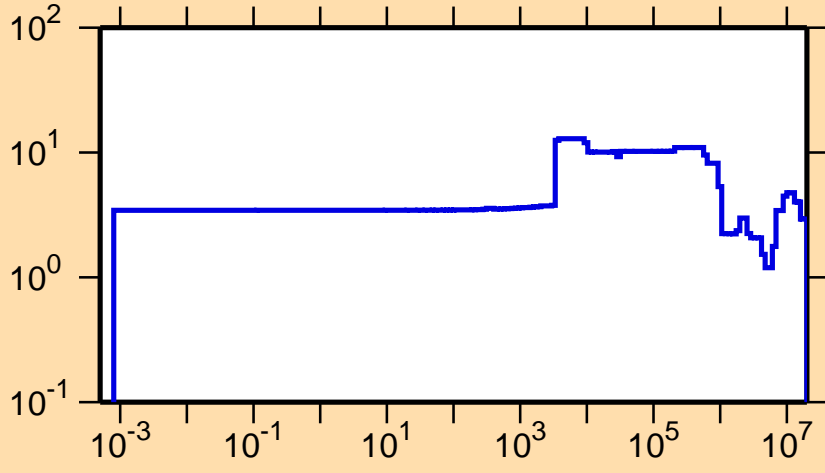

Correlation Matrix




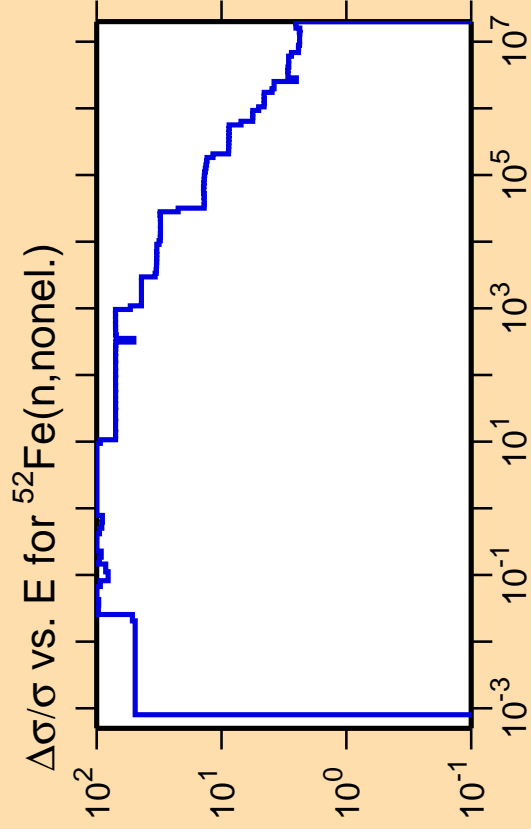


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nonel.})$

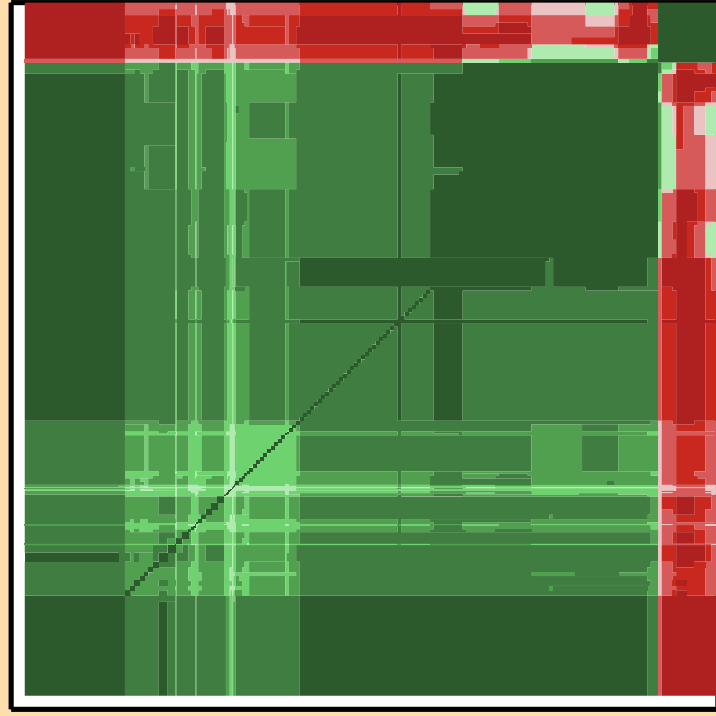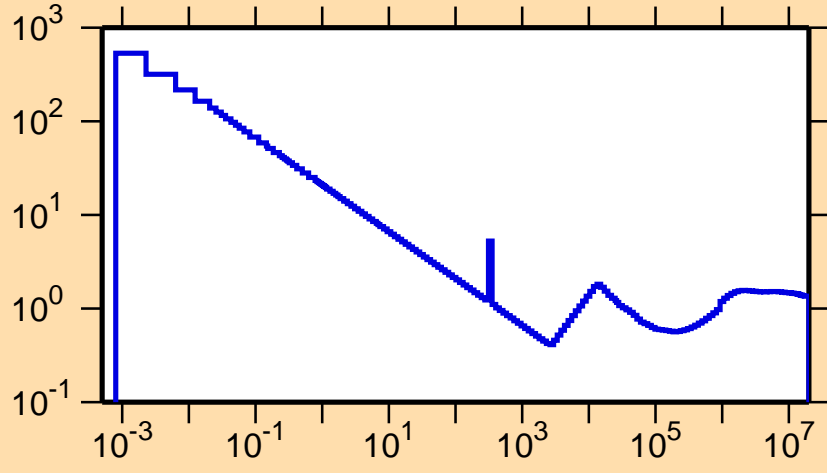

Correlation Matrix





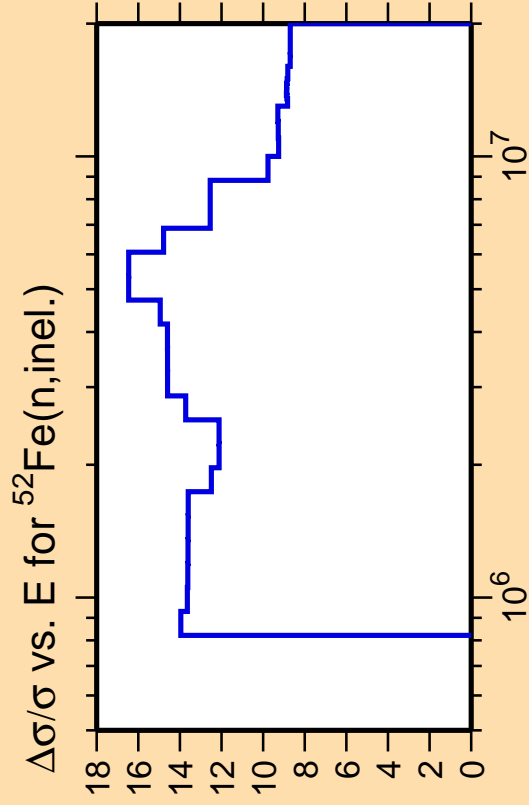

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nonel.})$

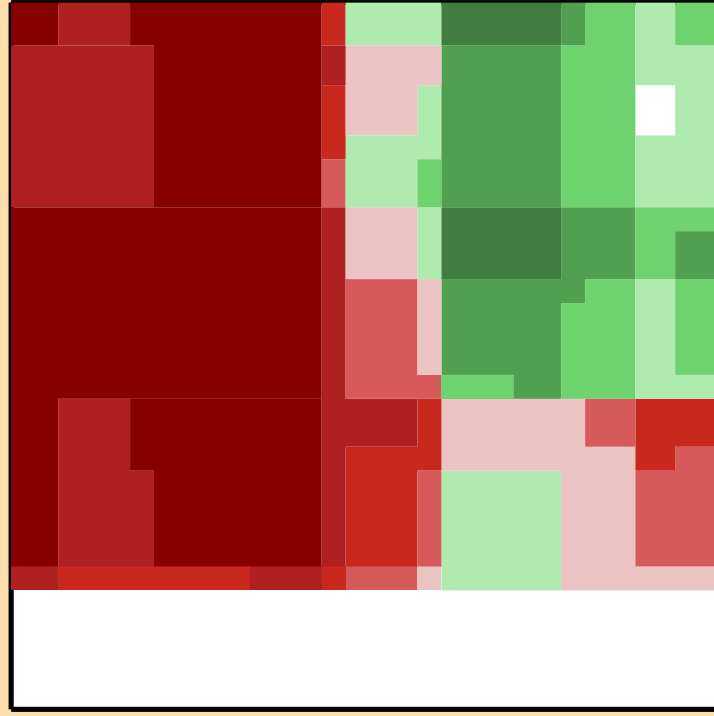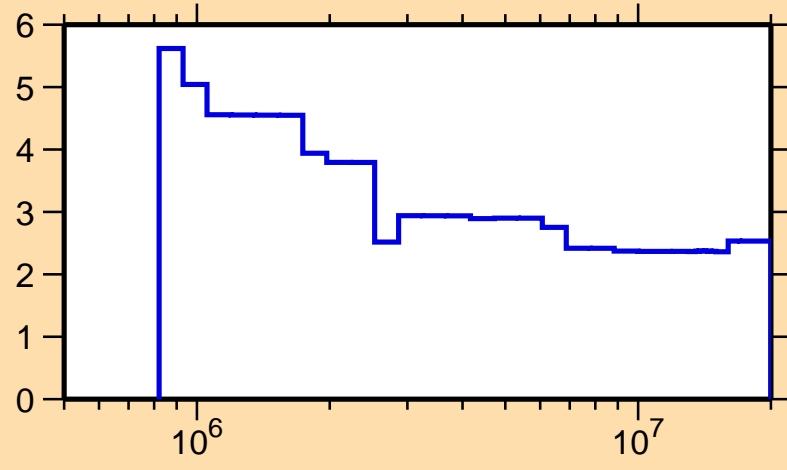

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$


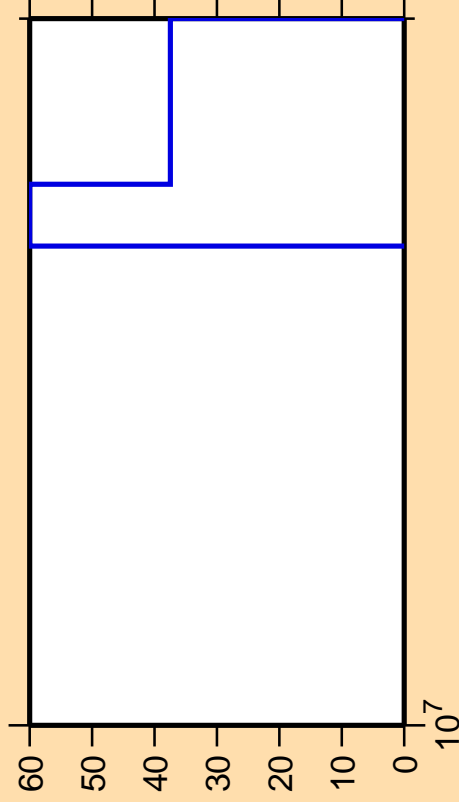


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nonel.})$

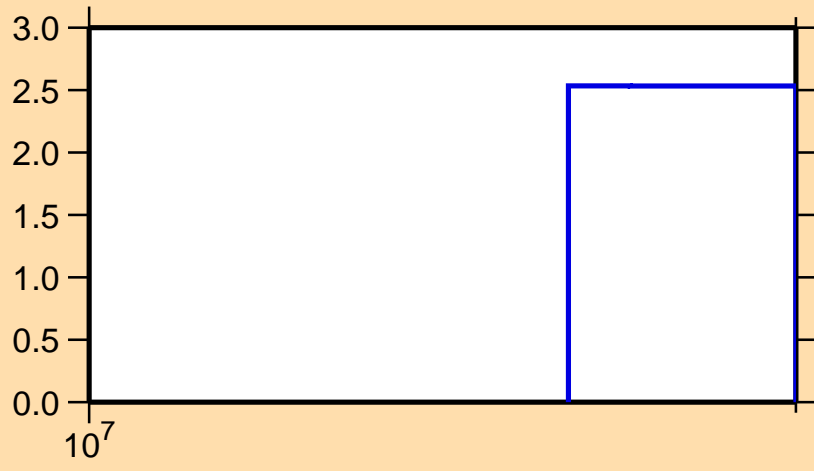

Correlation Matrix





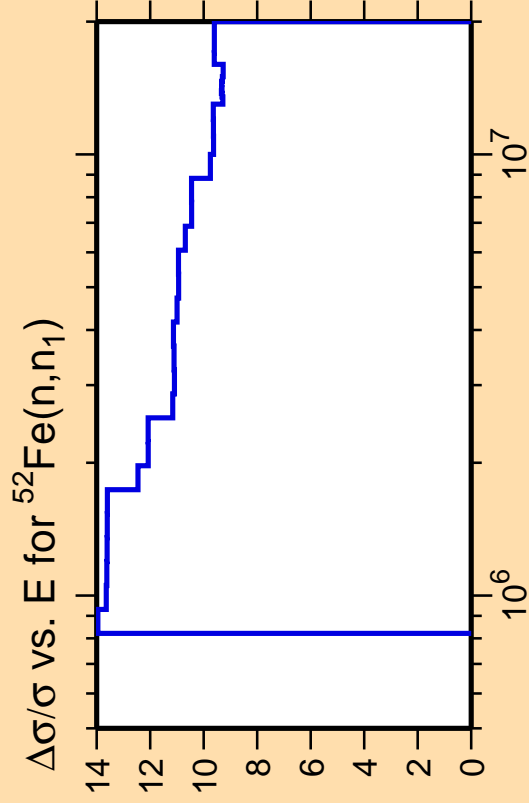

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nonel.})$

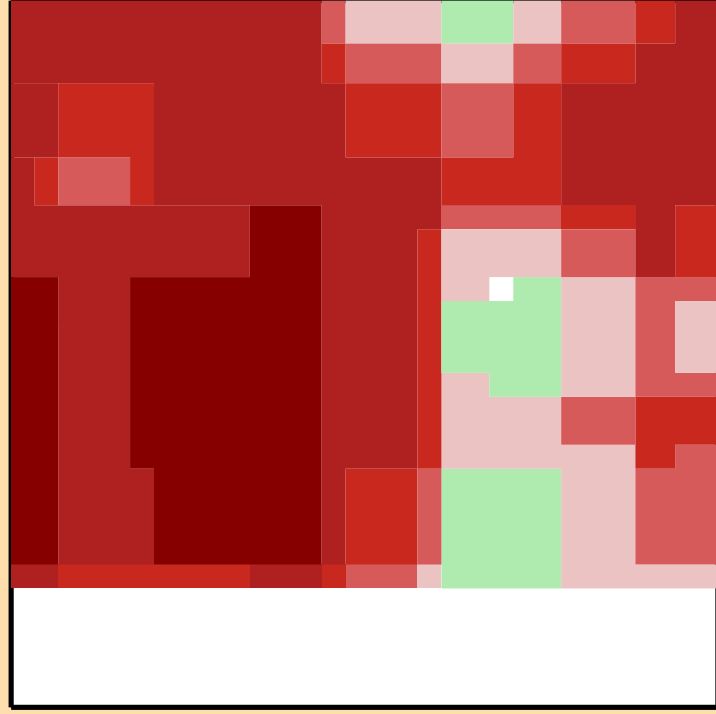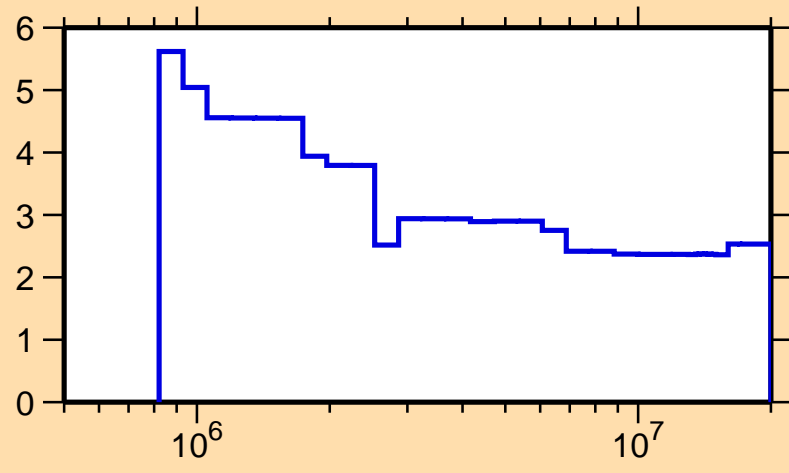



Correlation Matrix



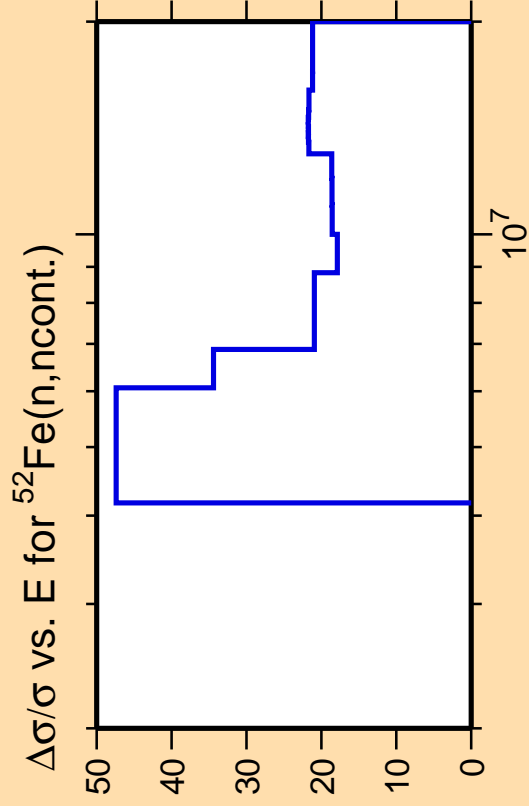

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

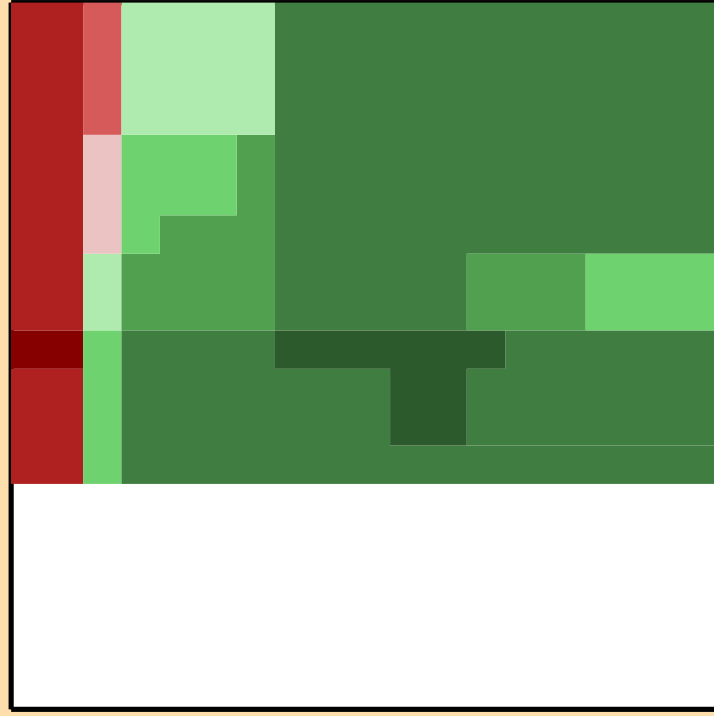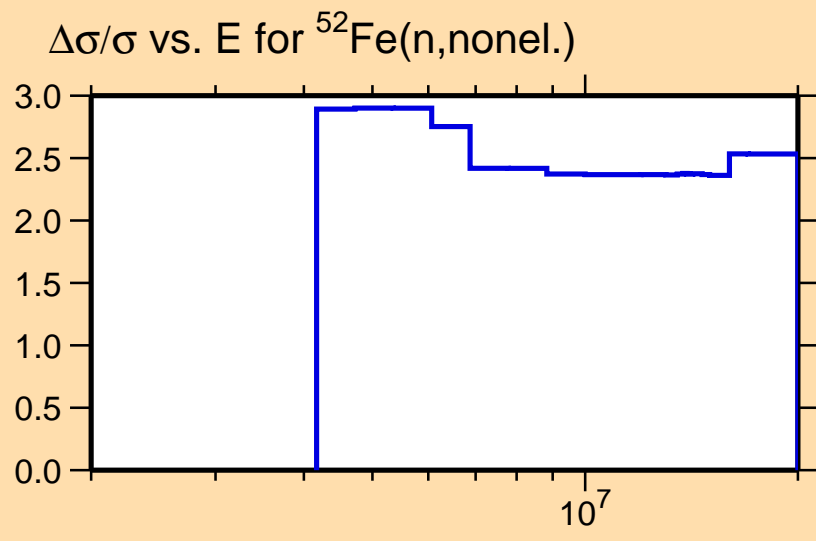

Correlation Matrix






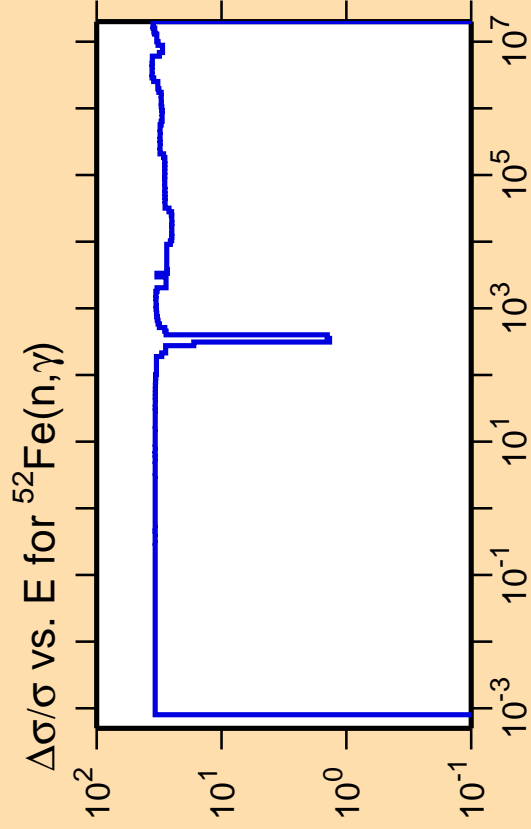


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nonel.})$

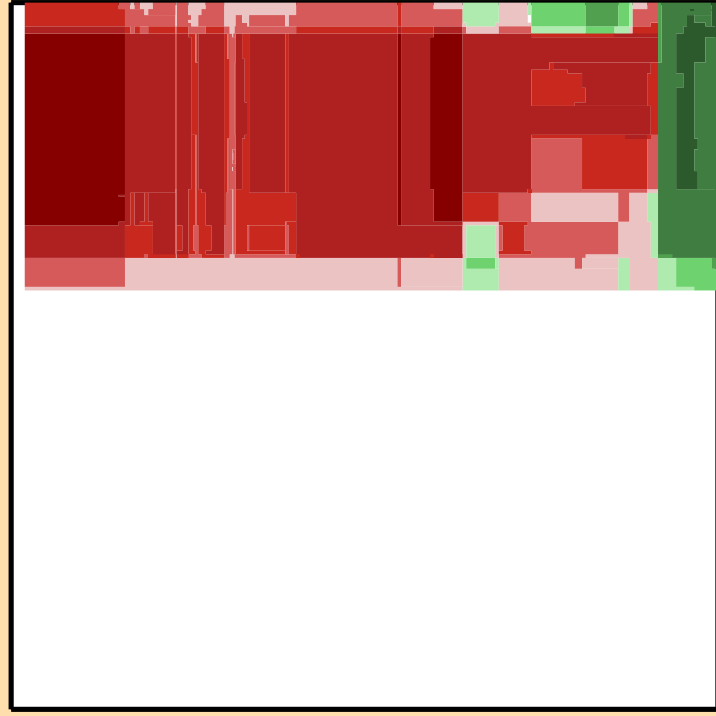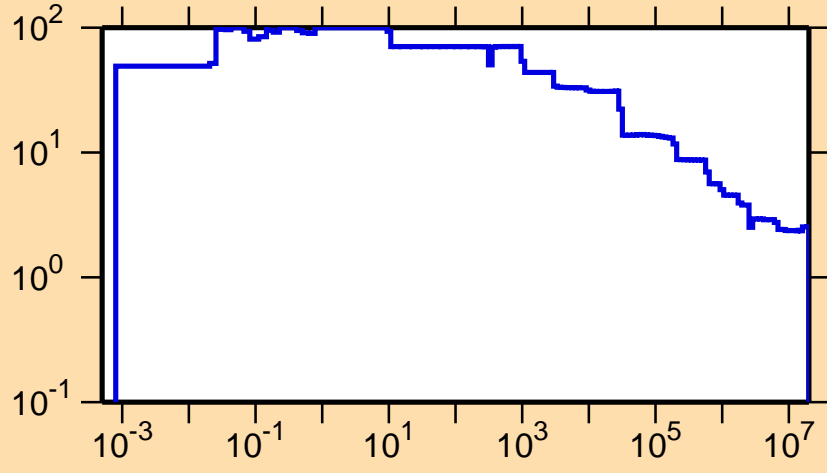

Correlation Matrix




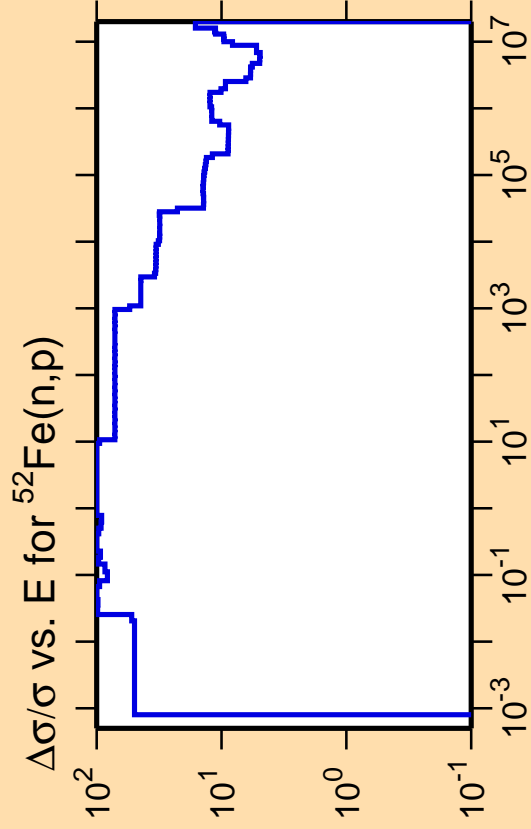


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nonel.})$

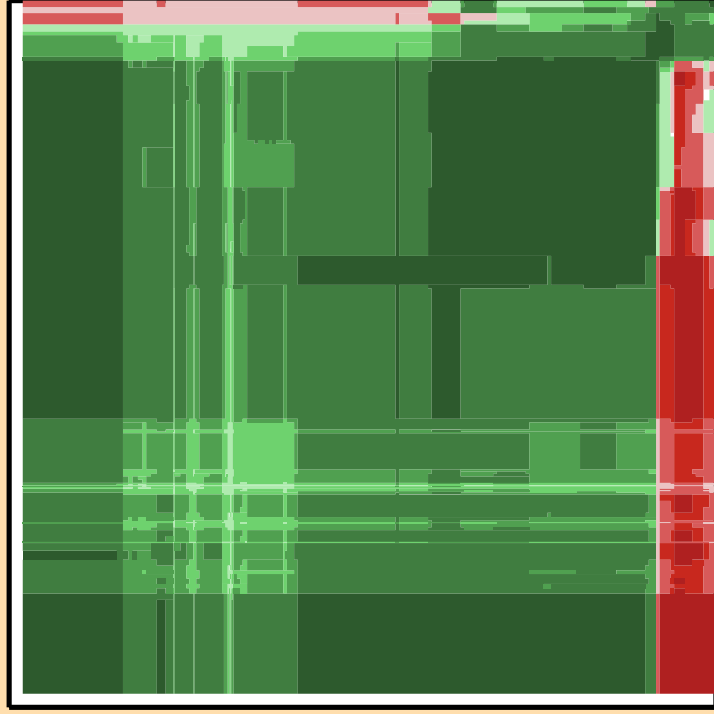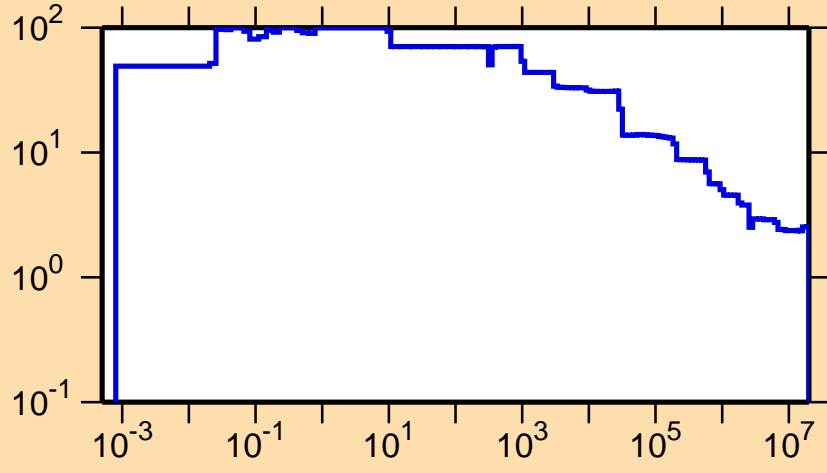

Correlation Matrix




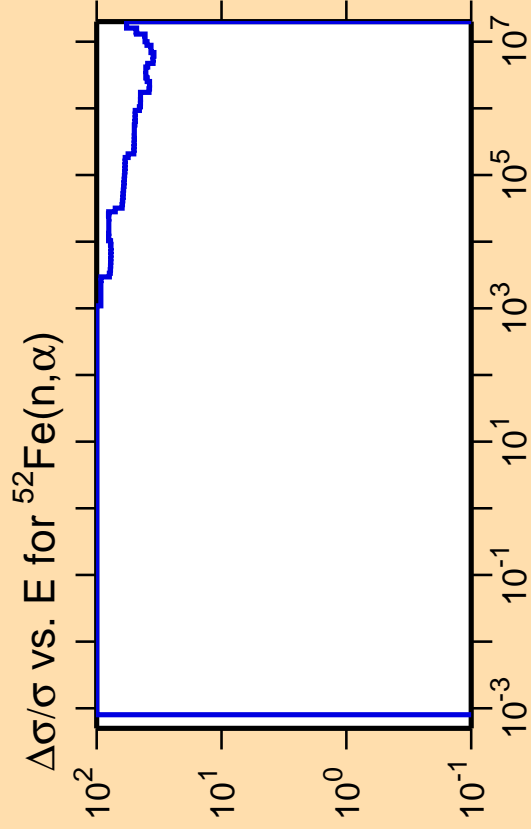


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nonel.})$

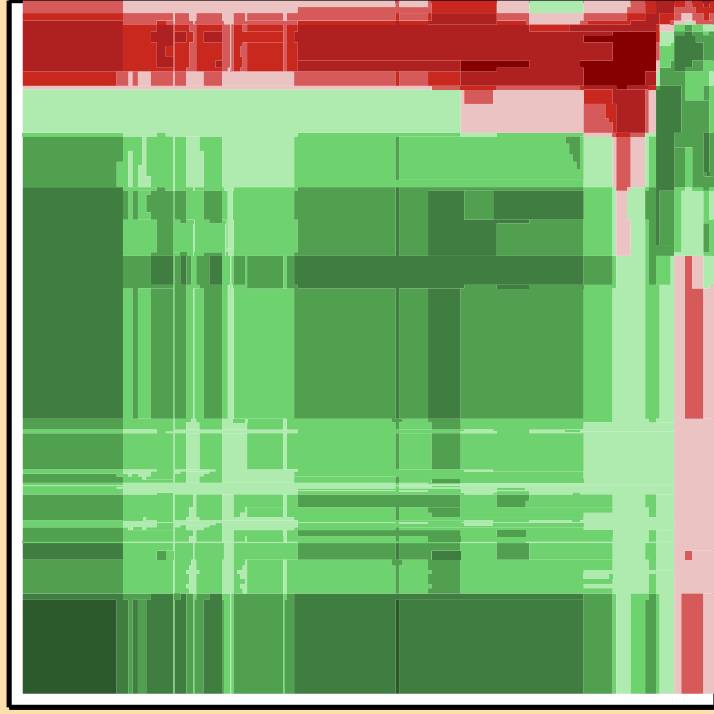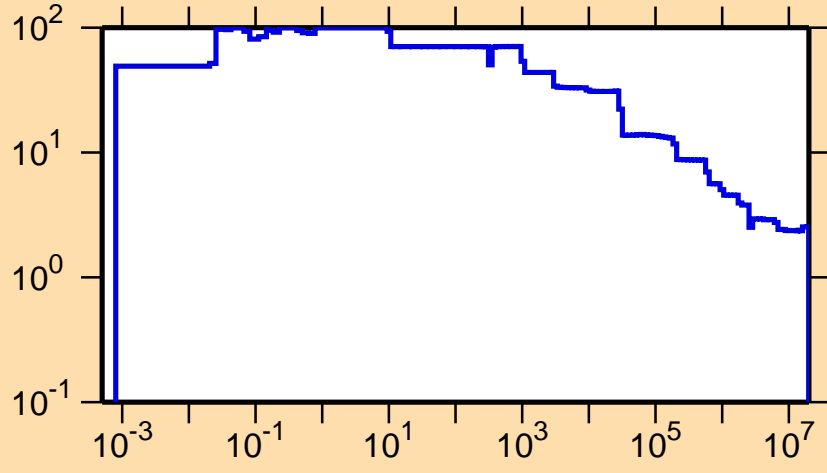

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{inel.})$

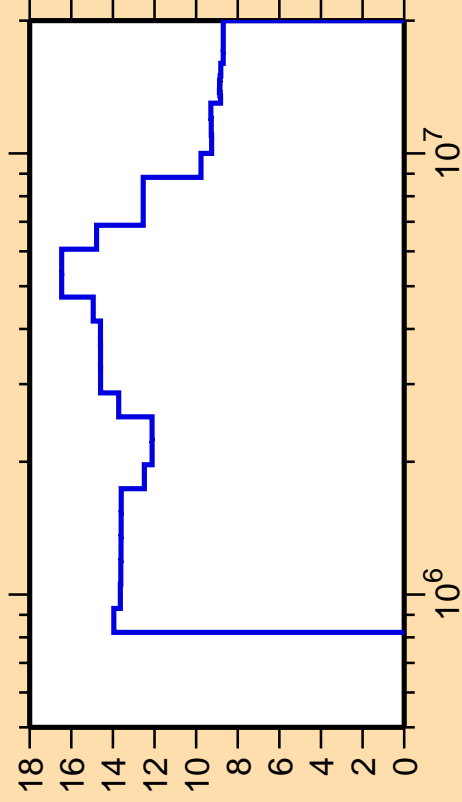

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{inel.})$

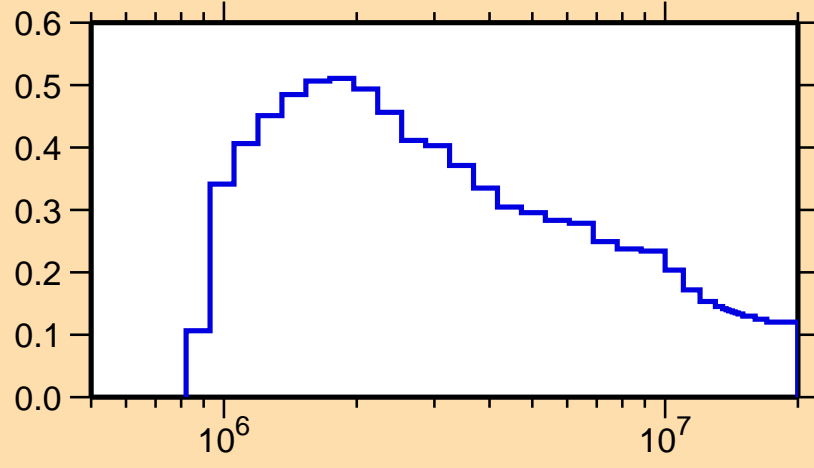

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$

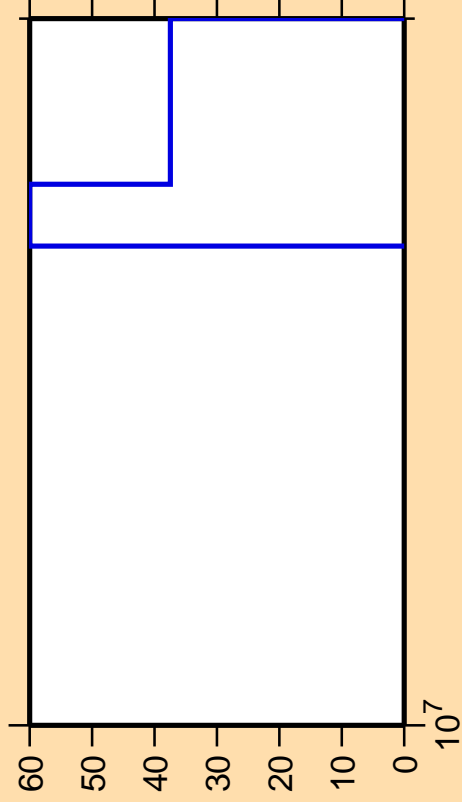


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$

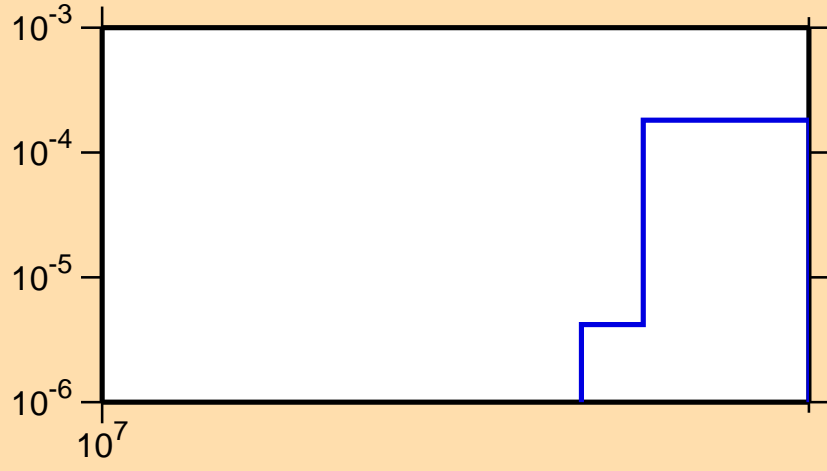

$10^7$

$10^{-3}$

$10^{-4}$


$10^{-5}$

$10^{-6}$

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n_1)$


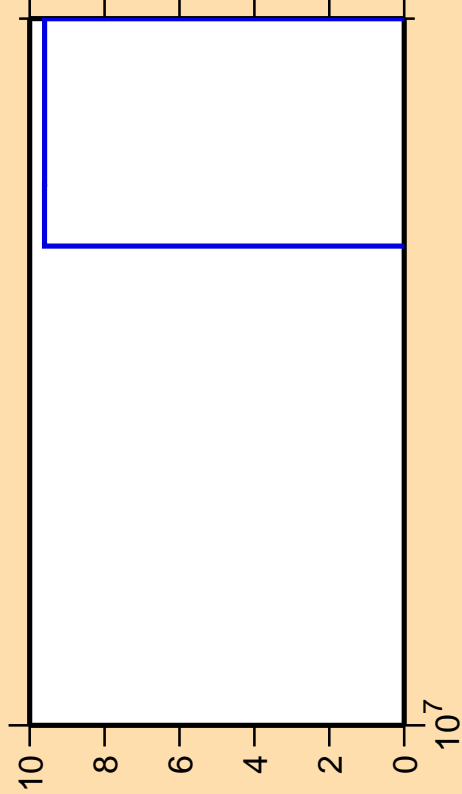


Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$

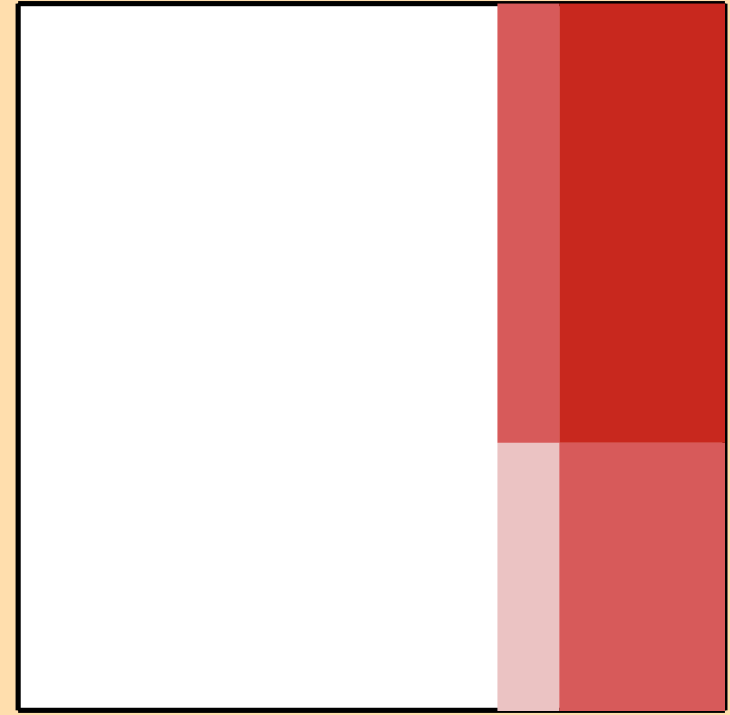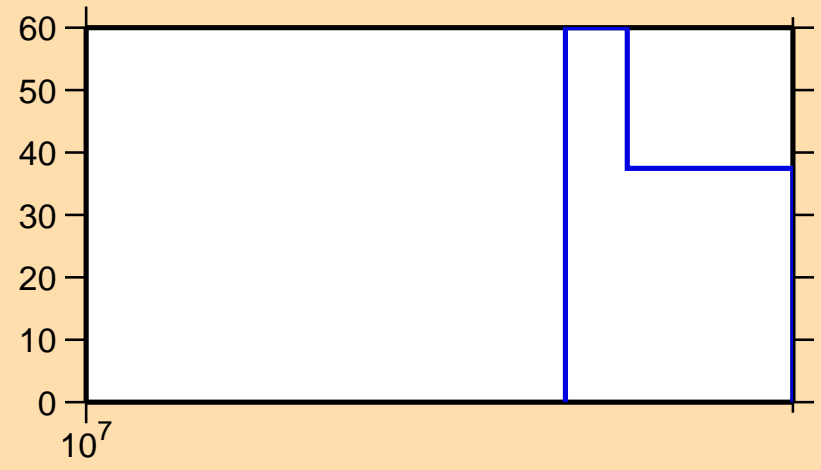

Correlation Matrix

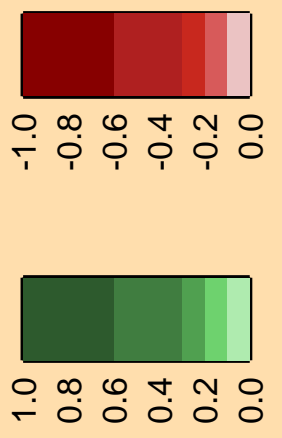

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n\text{cont.})$


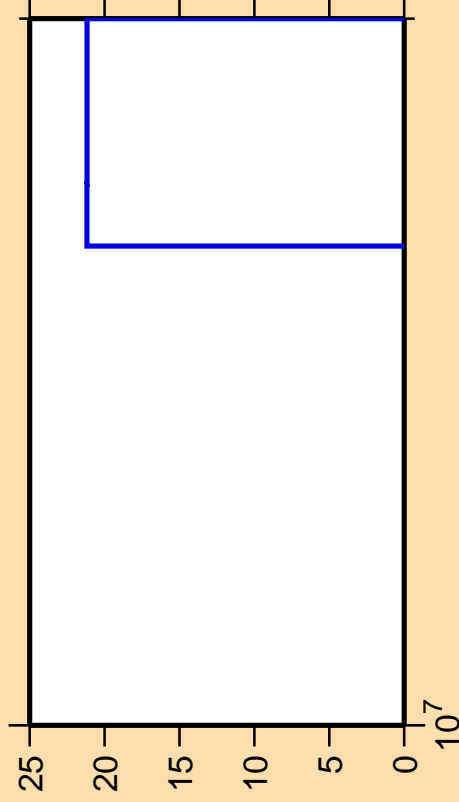


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$

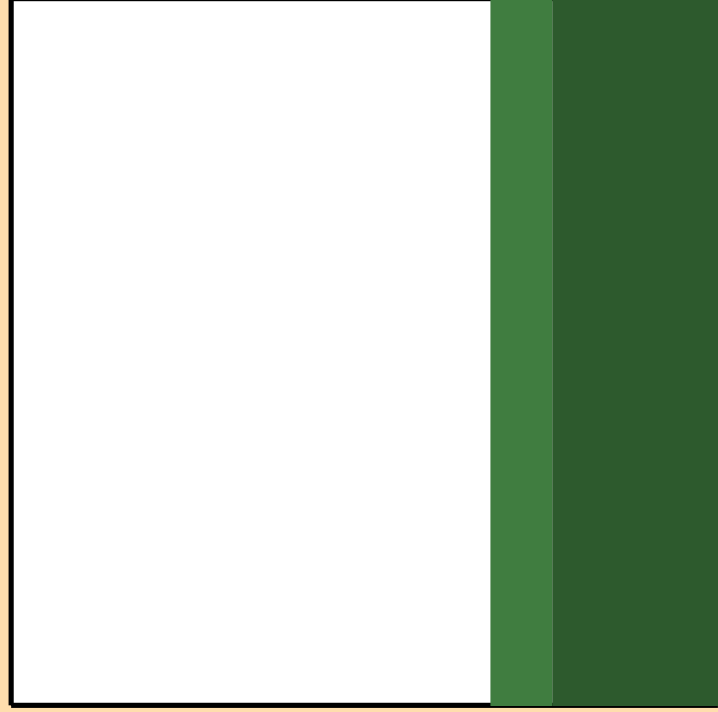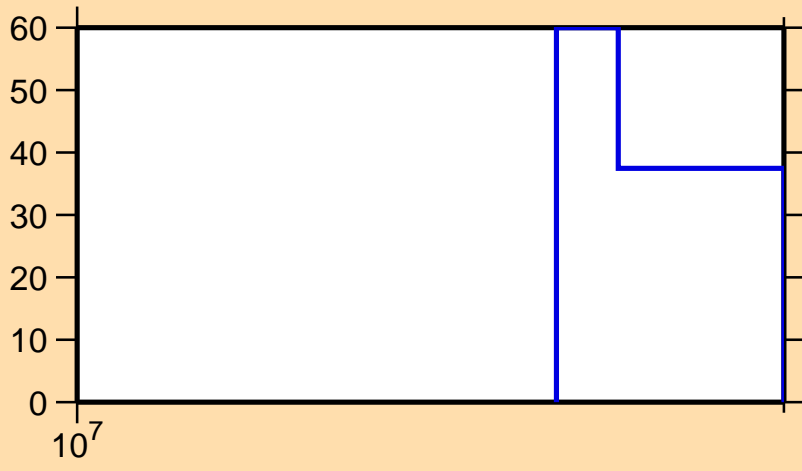

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\gamma)$


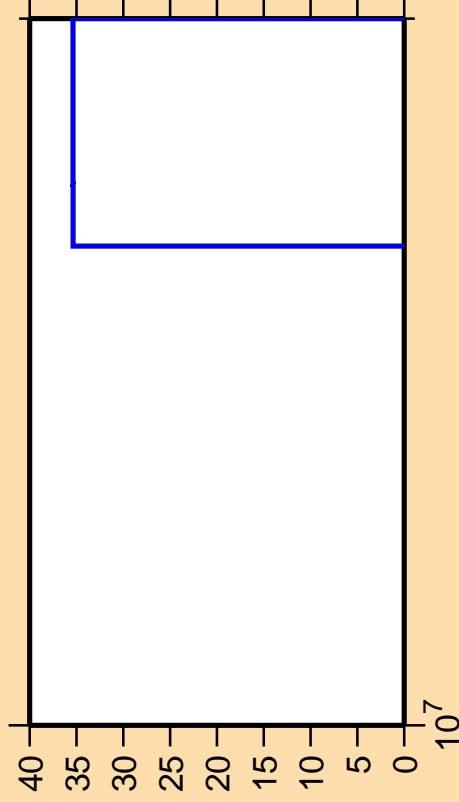


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$

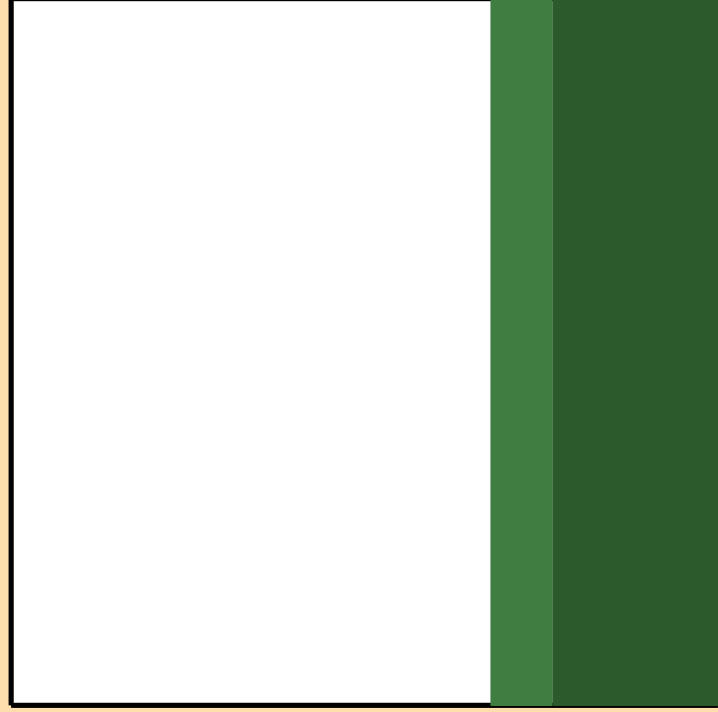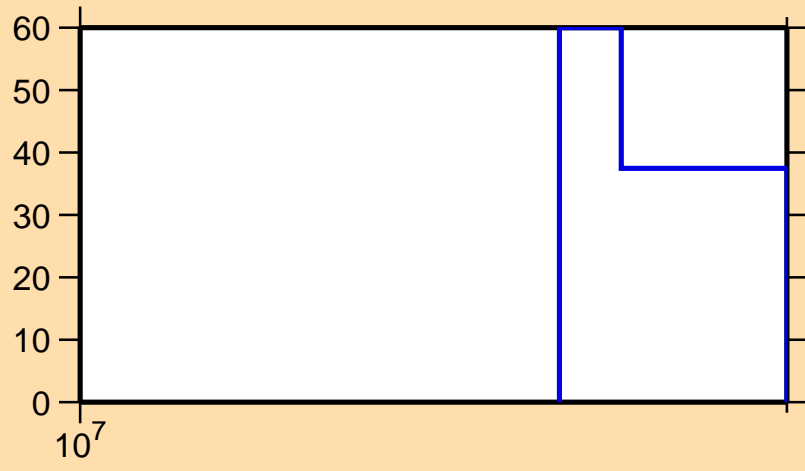


Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,p)$


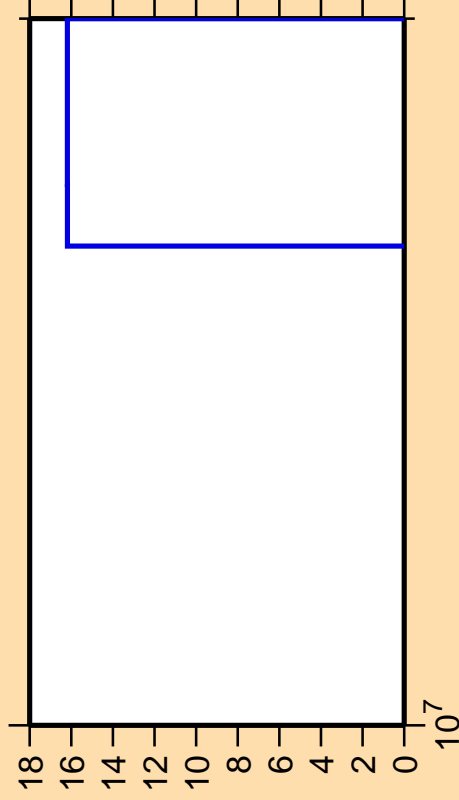


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$

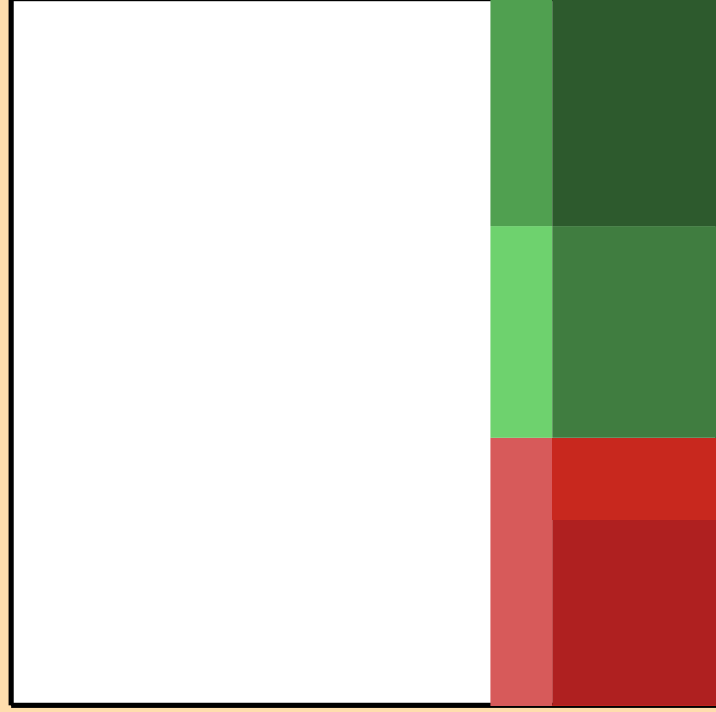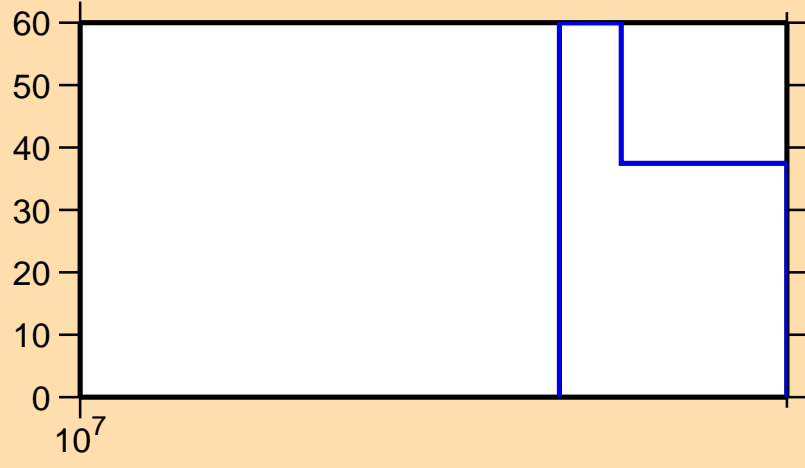

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\alpha)$


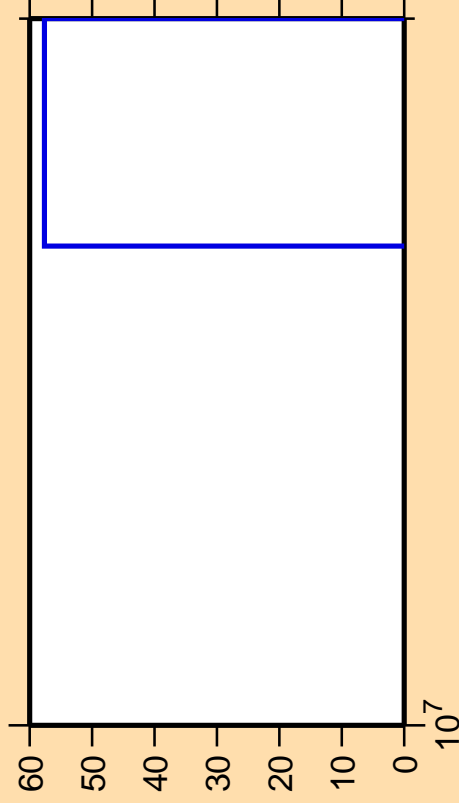


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,2n)$

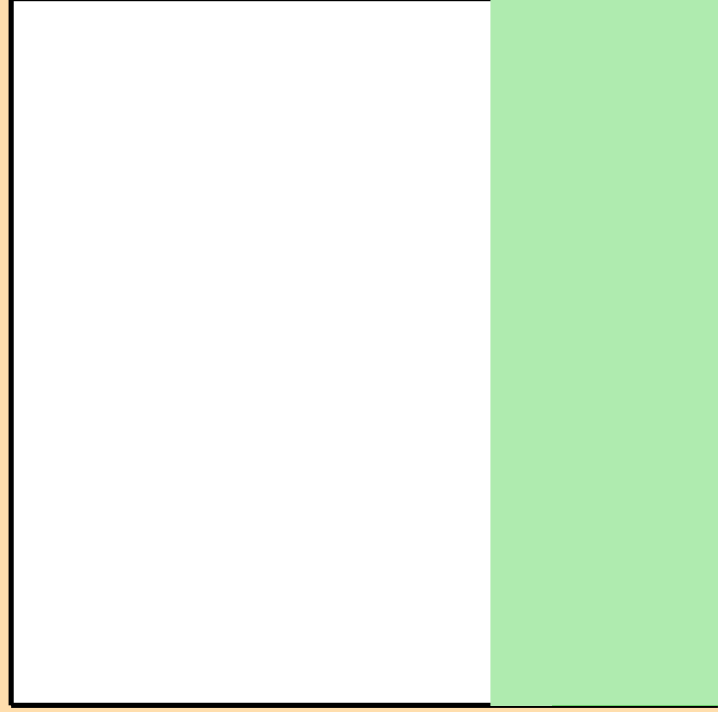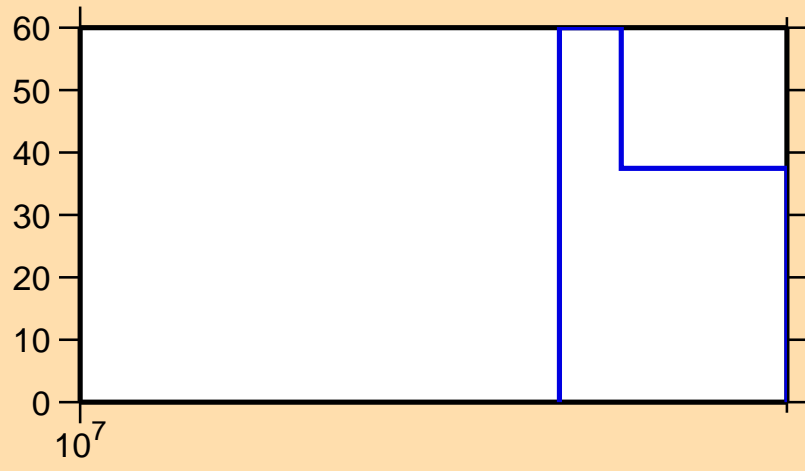

Correlation Matrix





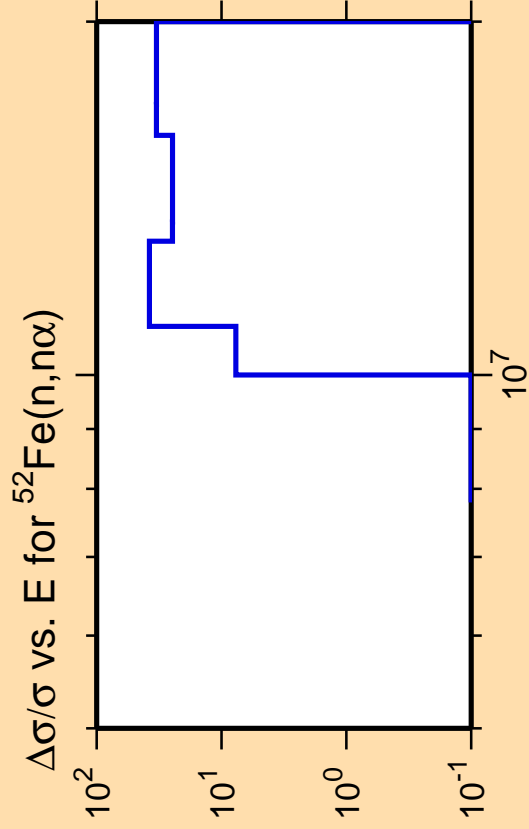

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

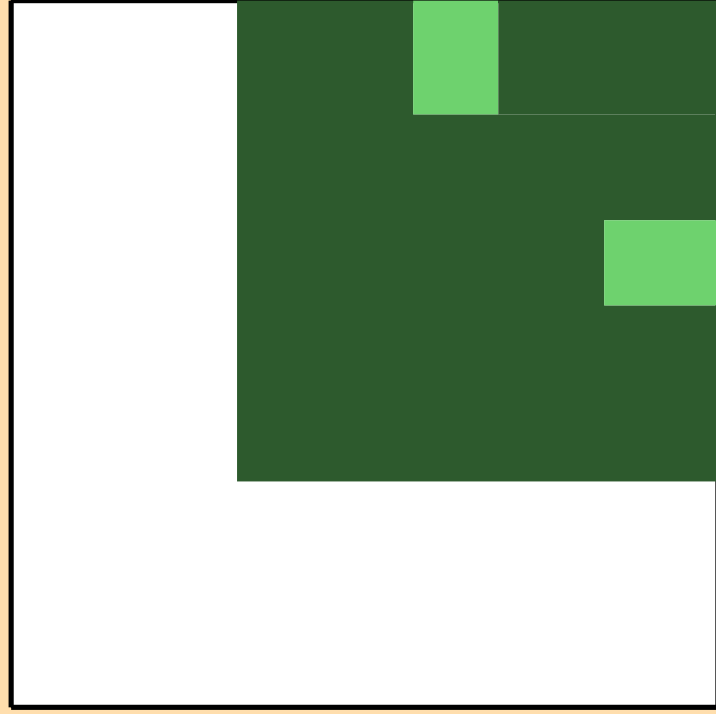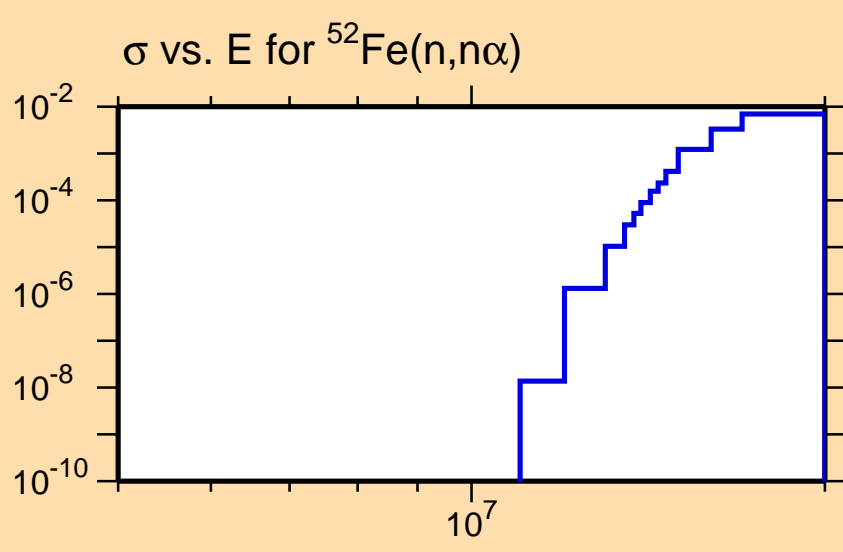

Correlation Matrix





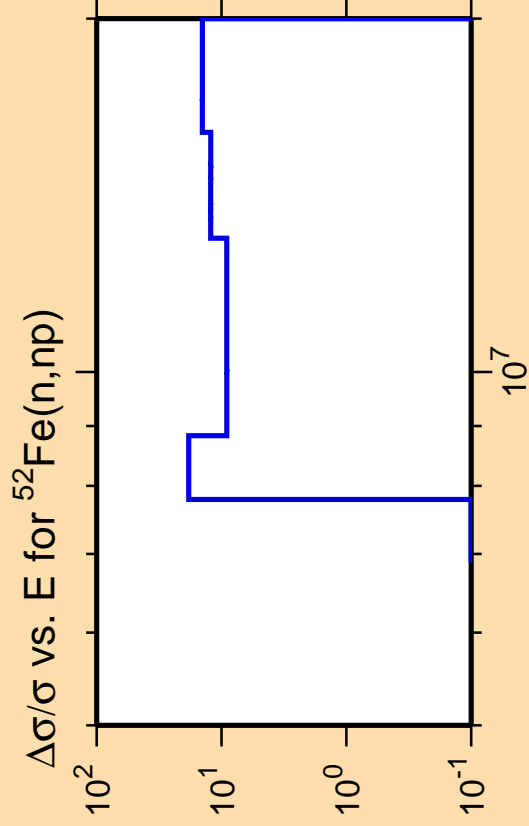


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

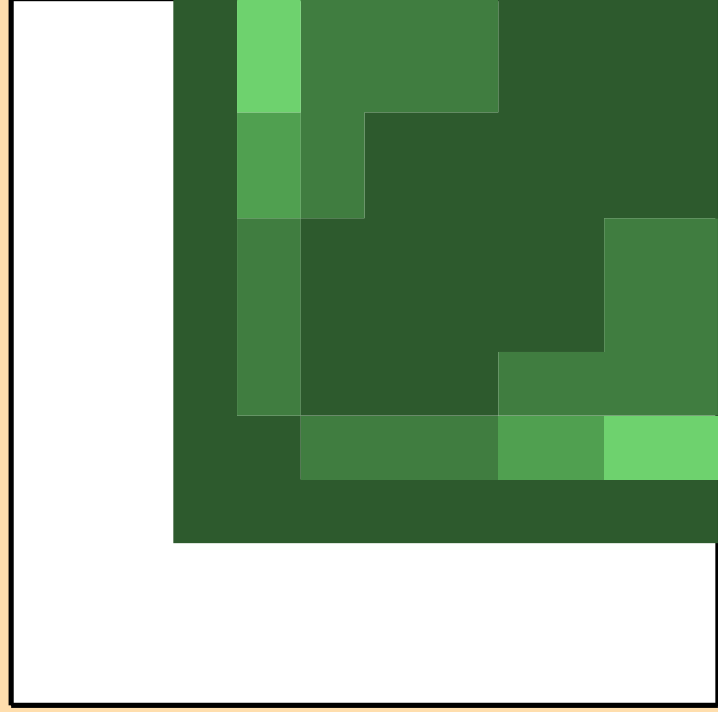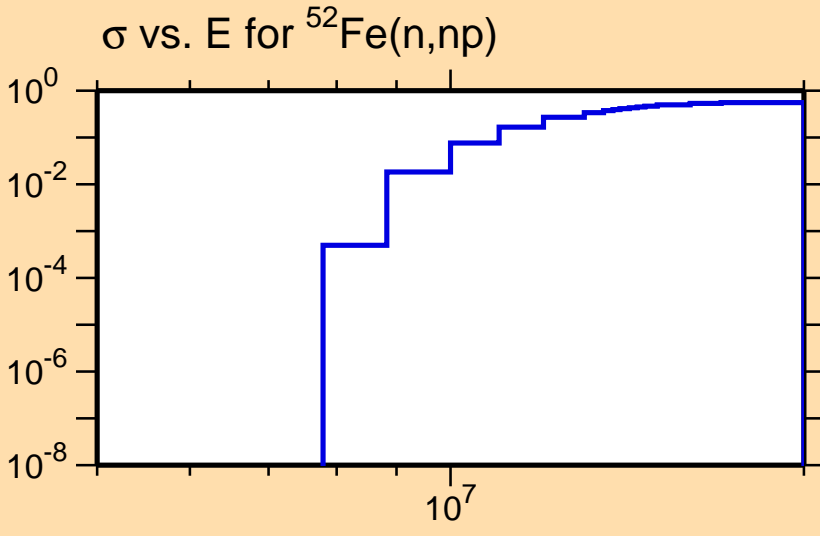

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nd})$

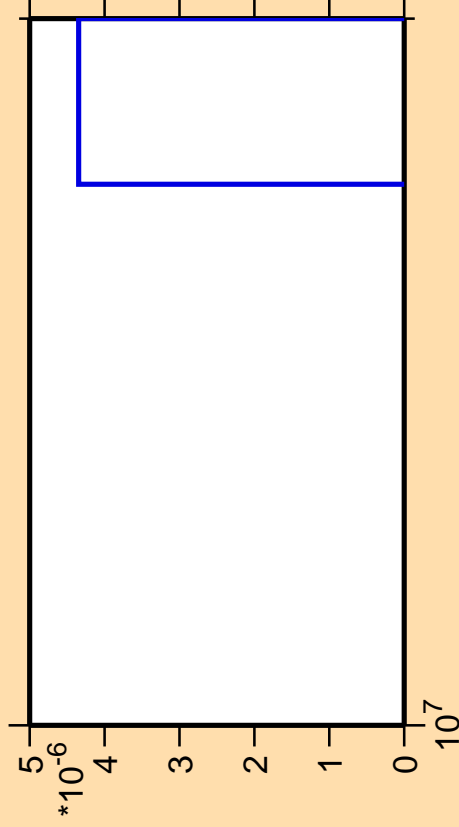

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{nd})$



Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}$ (mt 34)

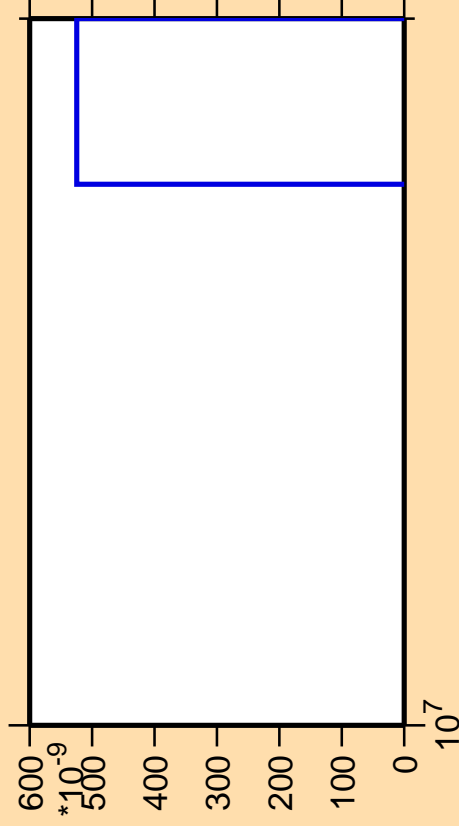

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{52}\text{Fe}$ (mt 34)

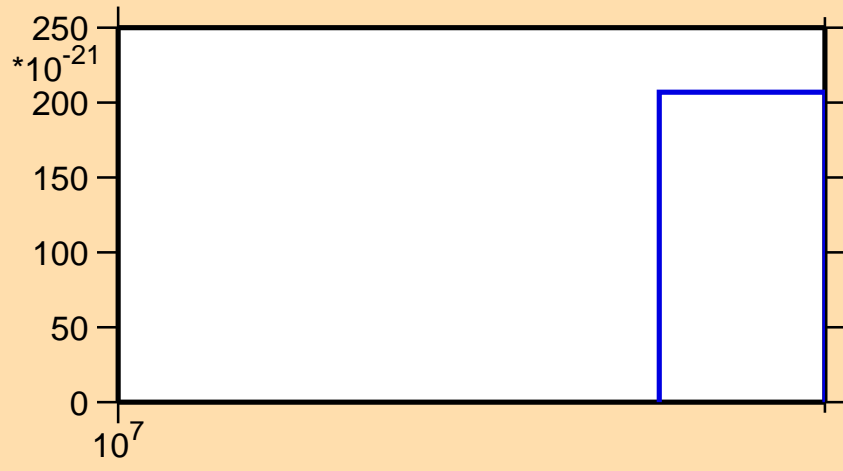


$10^7$

$10^7$





Correlation Matrix



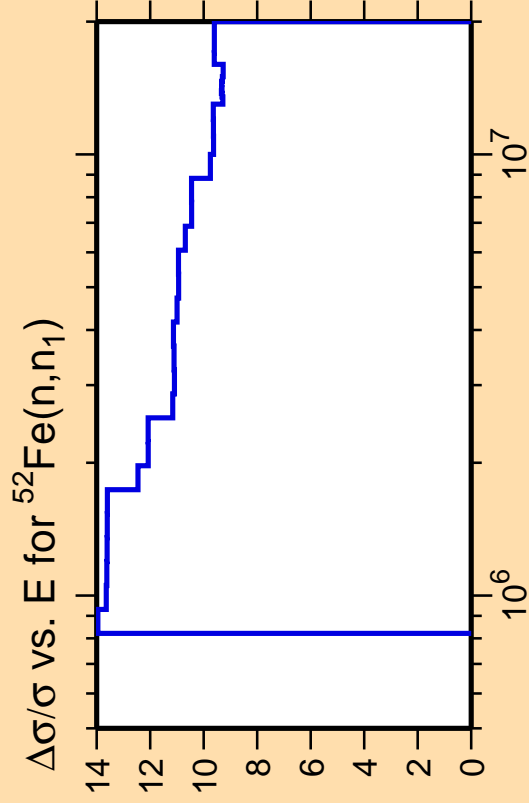


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

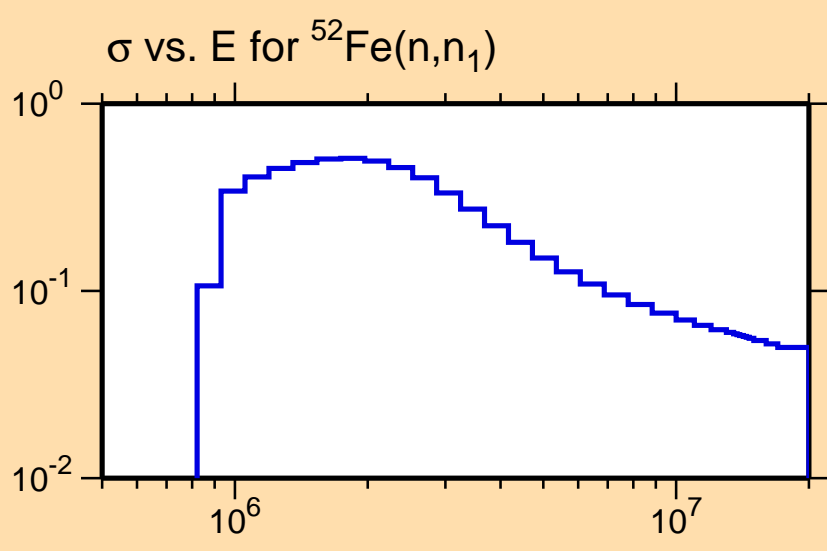

Correlation Matrix




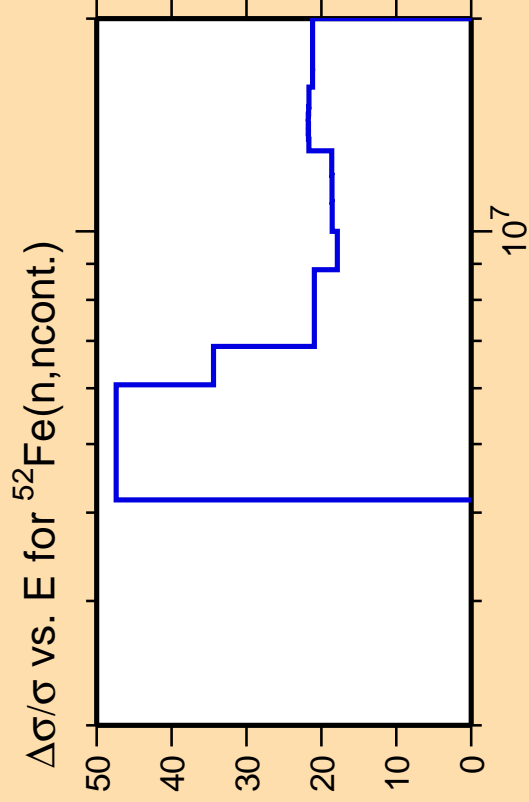

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n_1)$

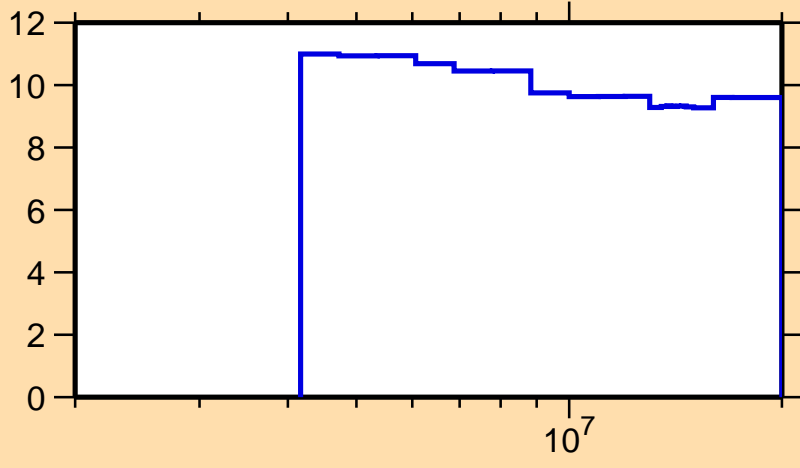

Correlation Matrix







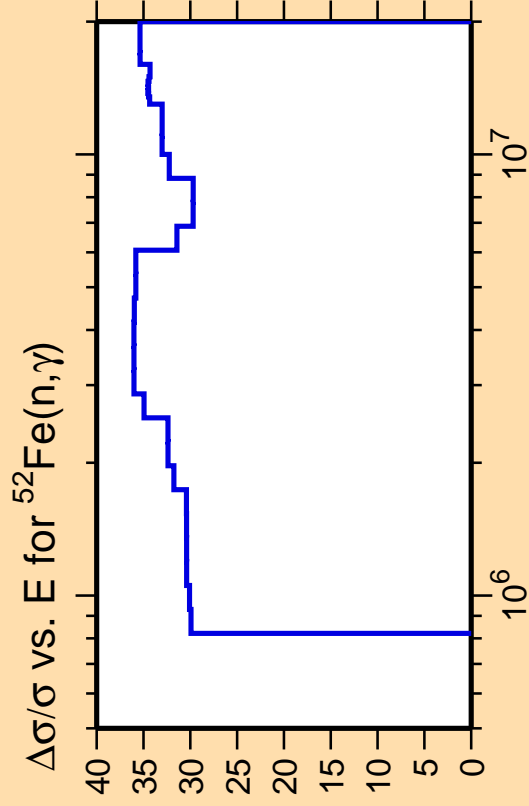

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n_1)$

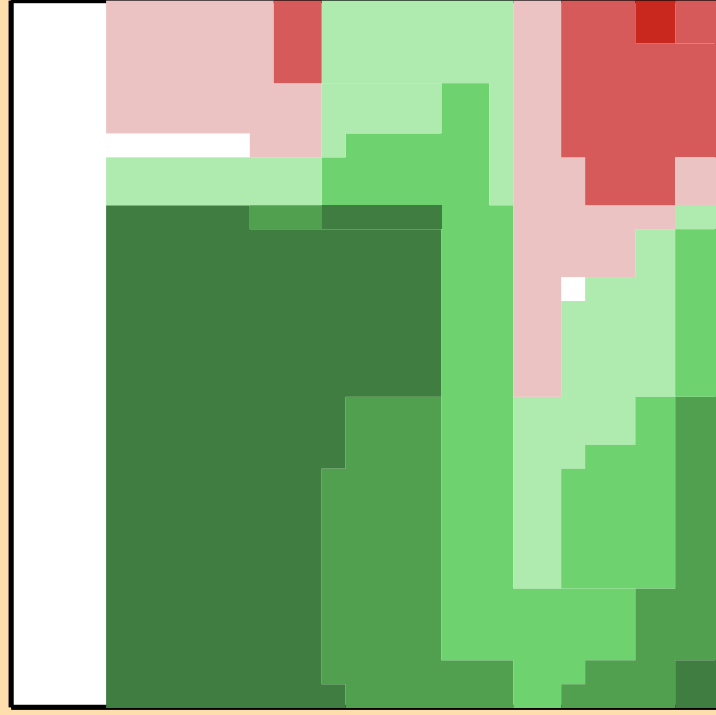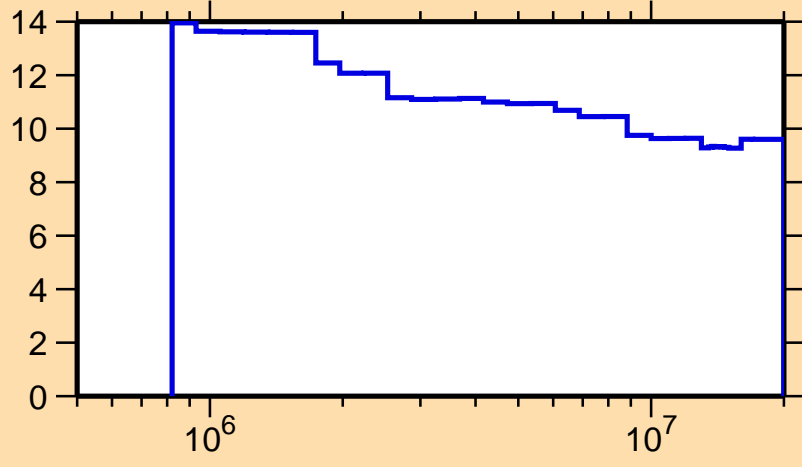

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,p)$

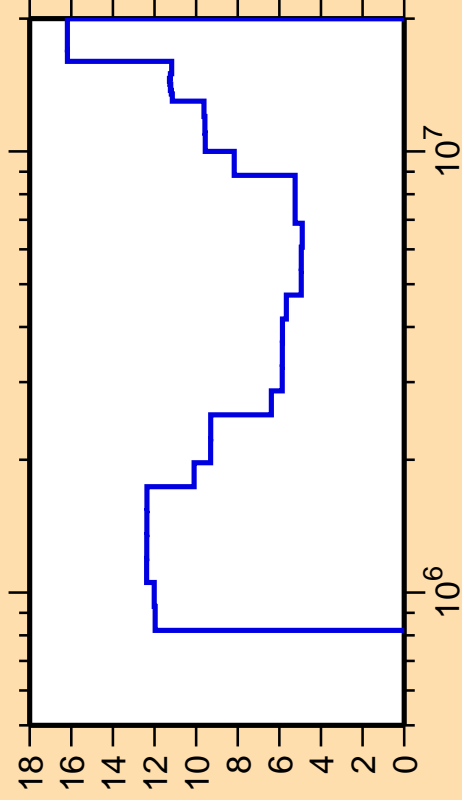

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n_1)$

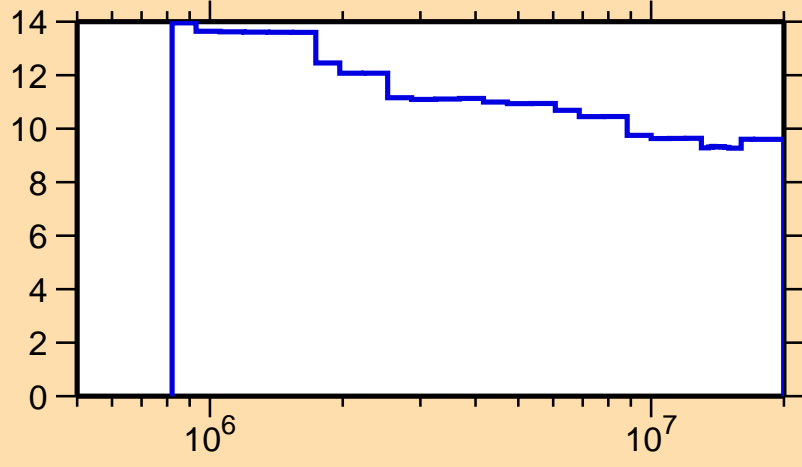

Correlation Matrix





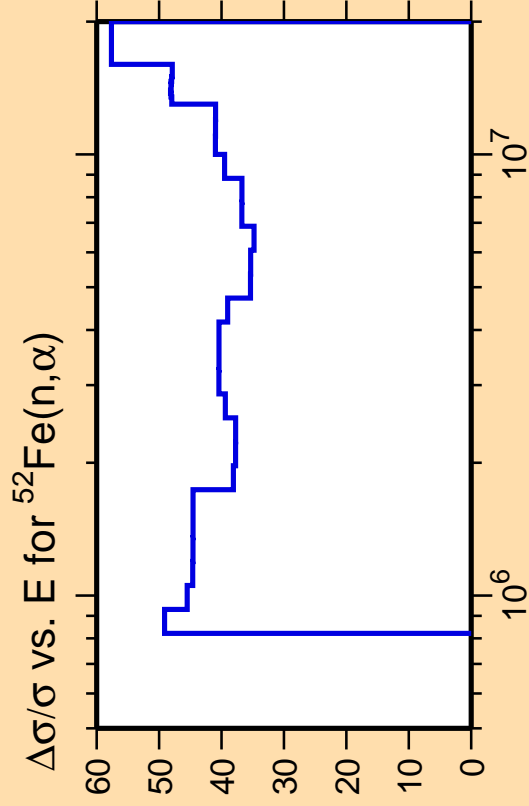

Ordinate scale is %  
relative standard deviation.


Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n_1)$

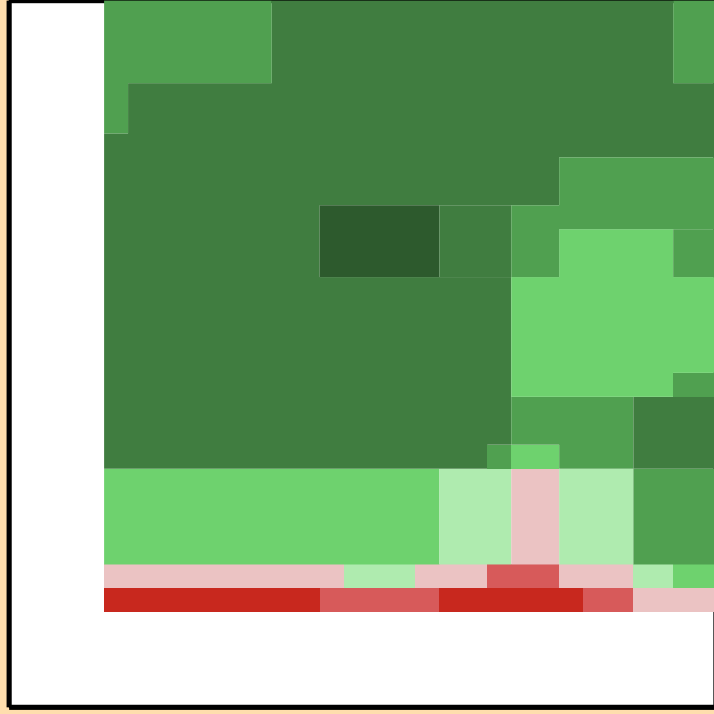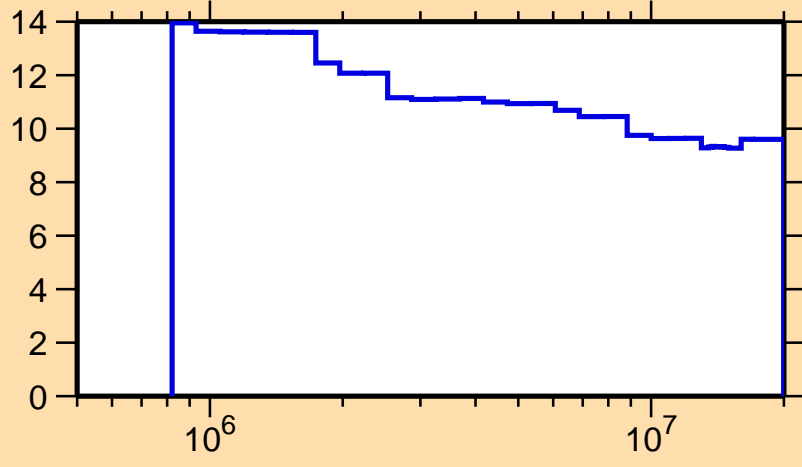



Correlation Matrix



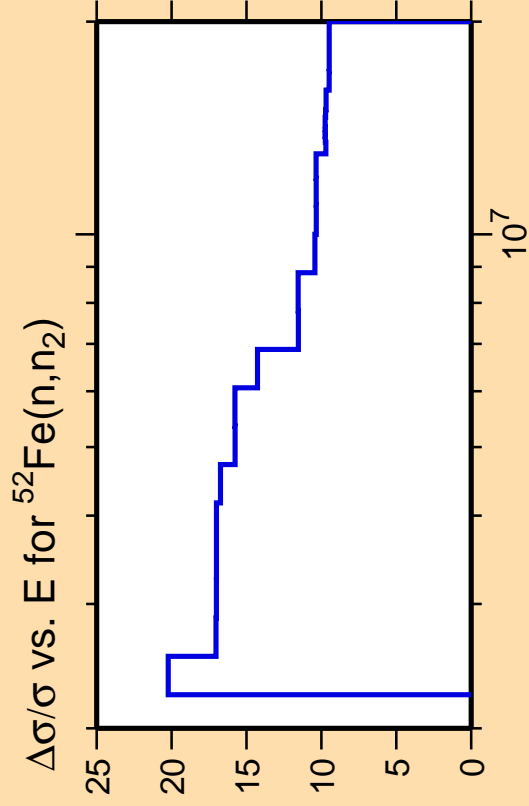

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

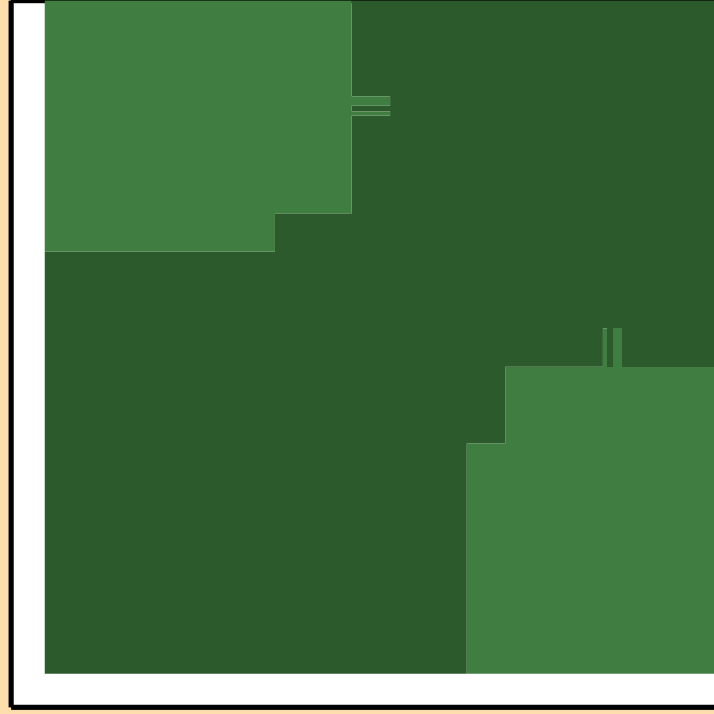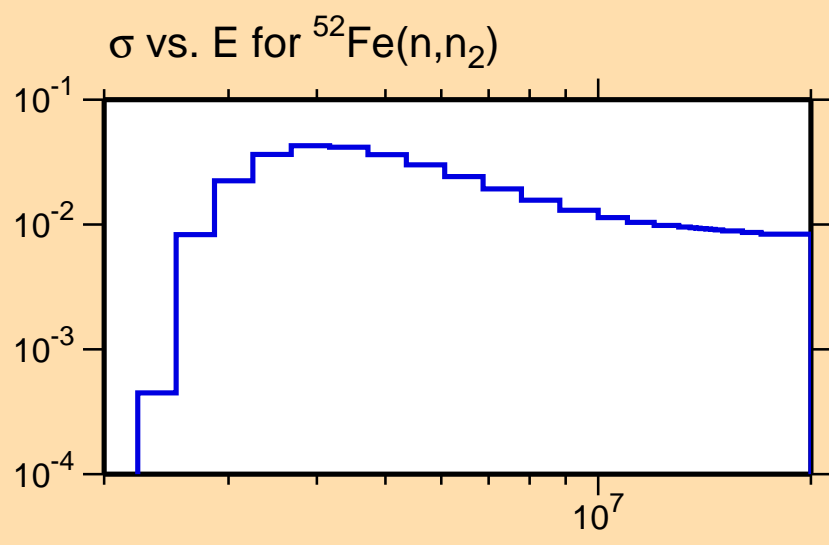

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n_3)$

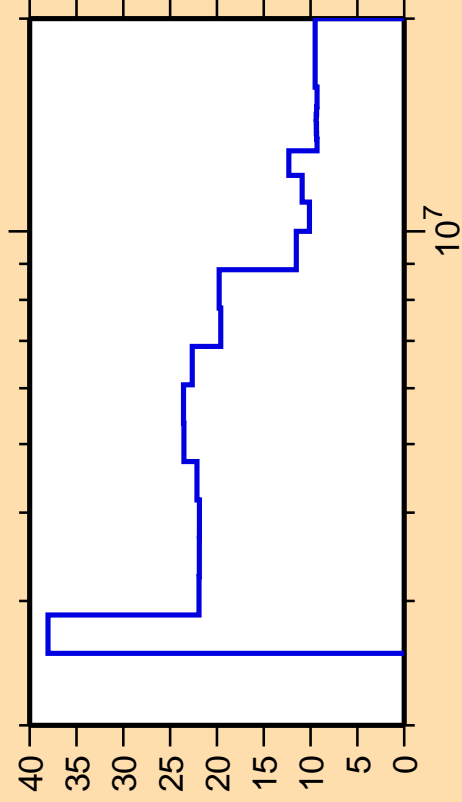

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{52}\text{Fe}(n,n_3)$

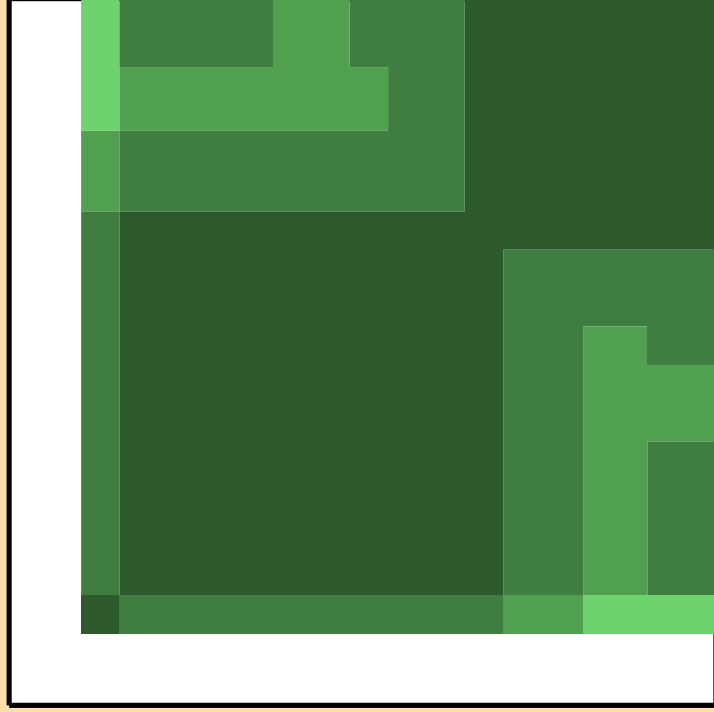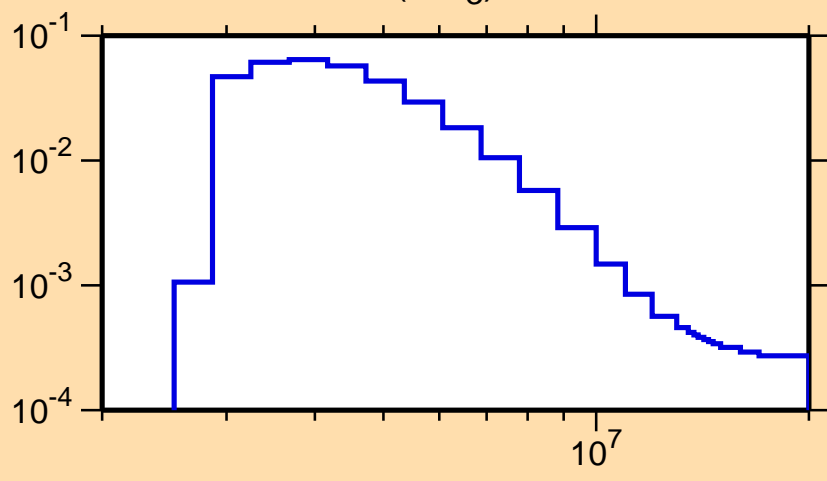

Correlation Matrix





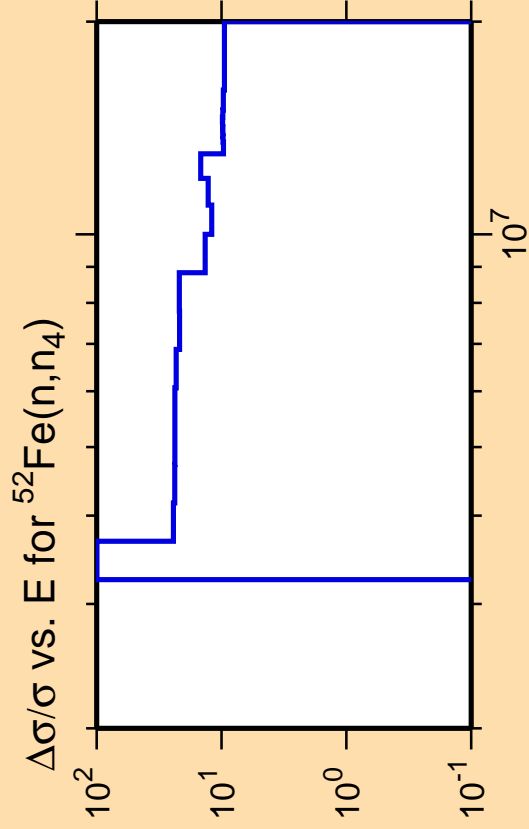

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

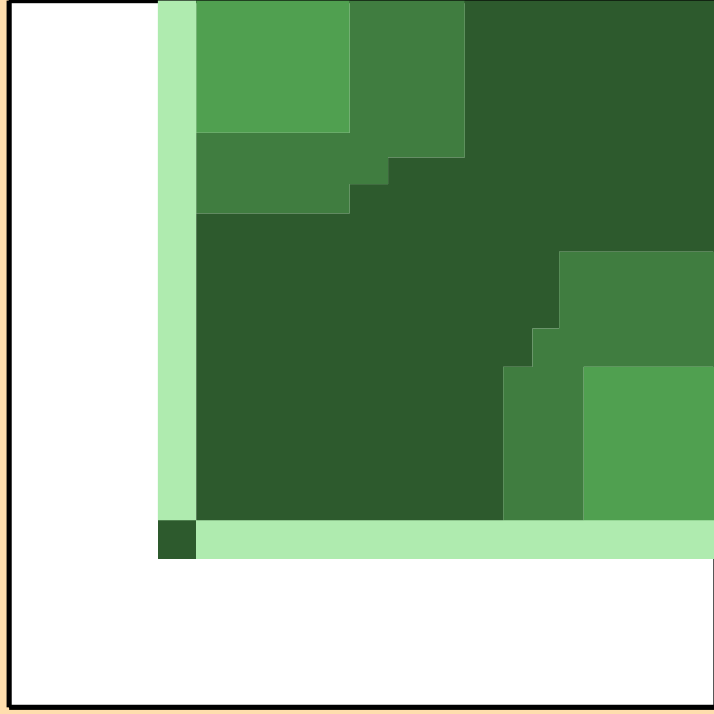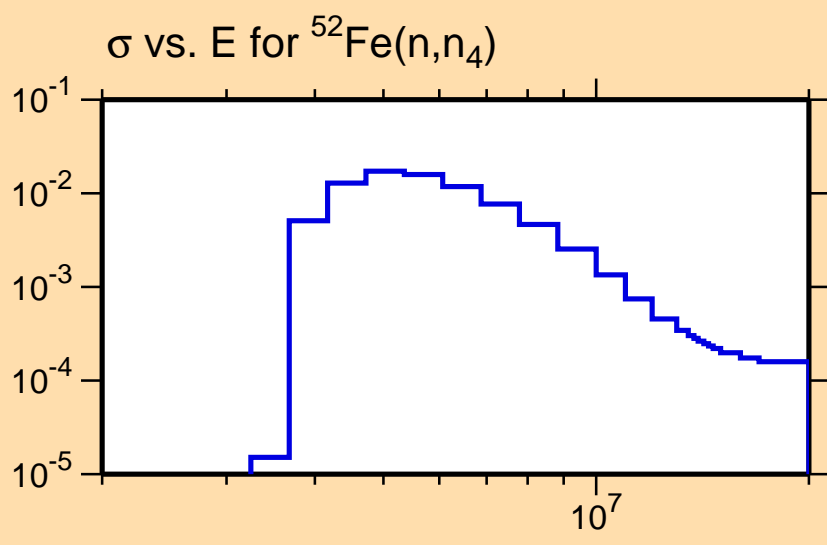



Correlation Matrix



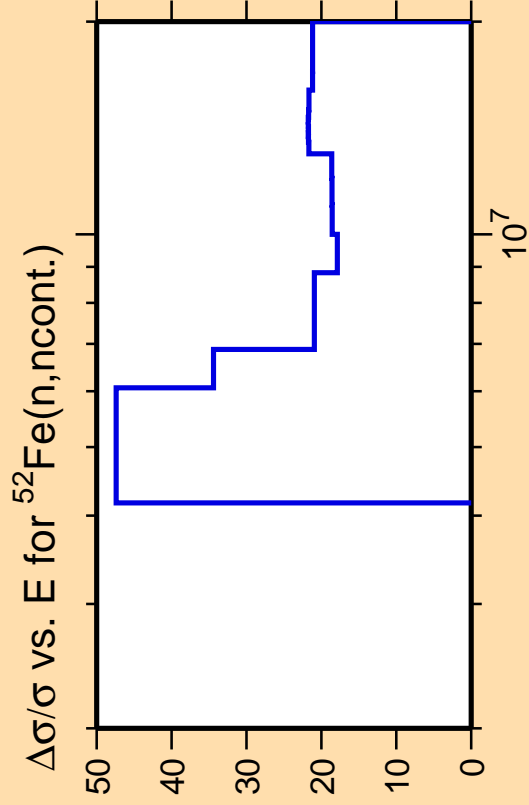


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

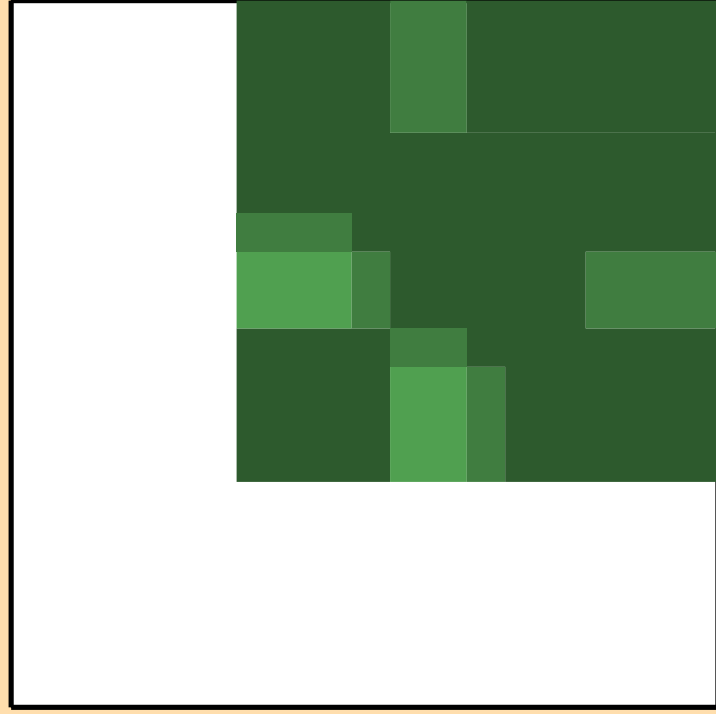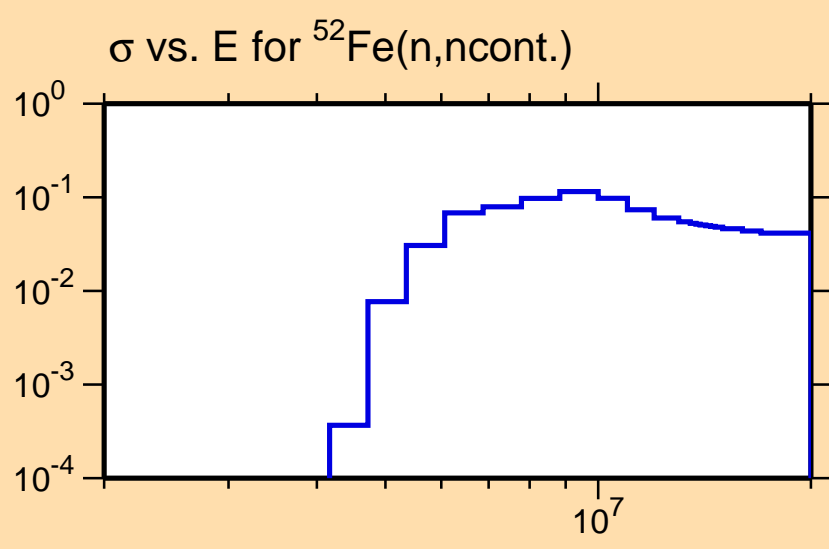

Correlation Matrix





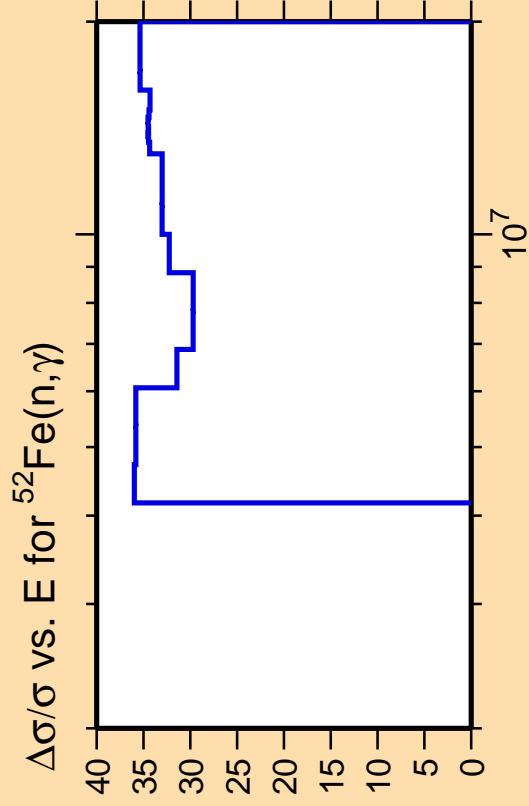

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n\text{cont.})$

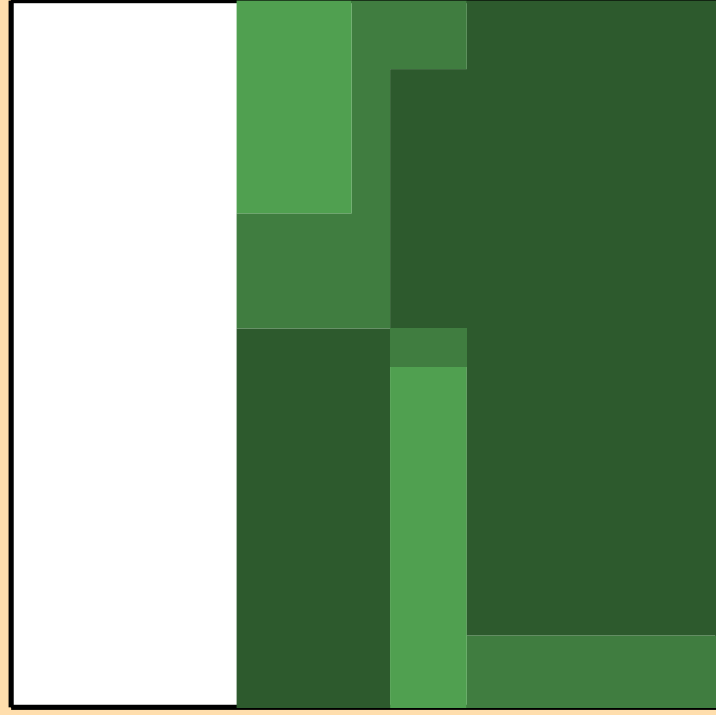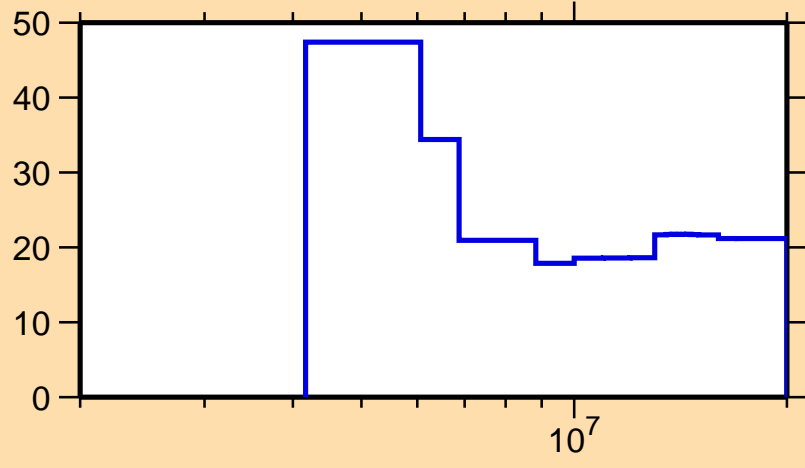

Correlation Matrix







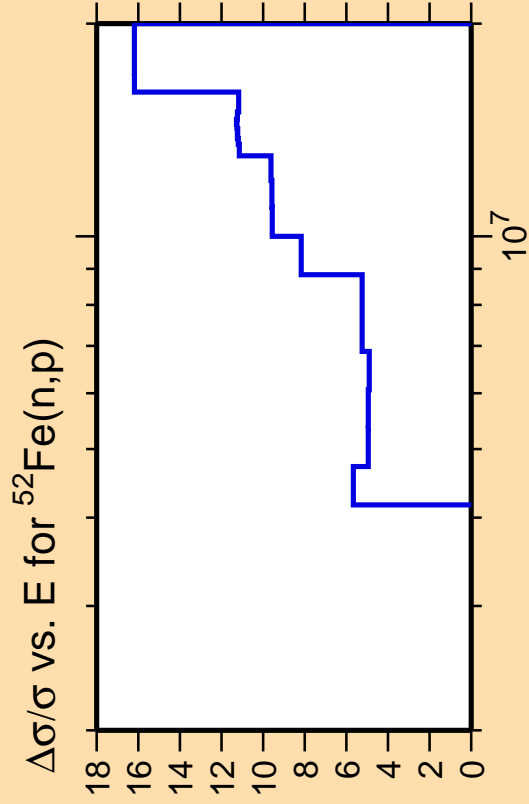

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

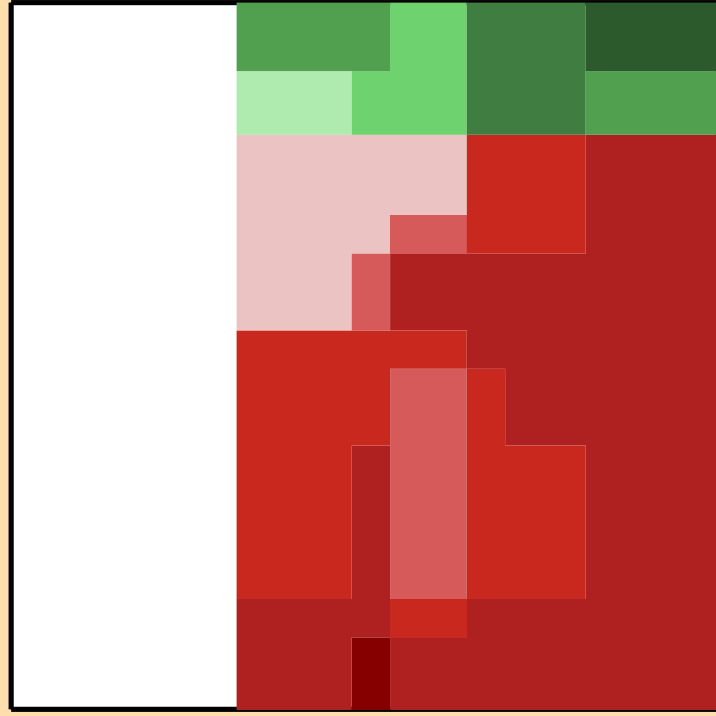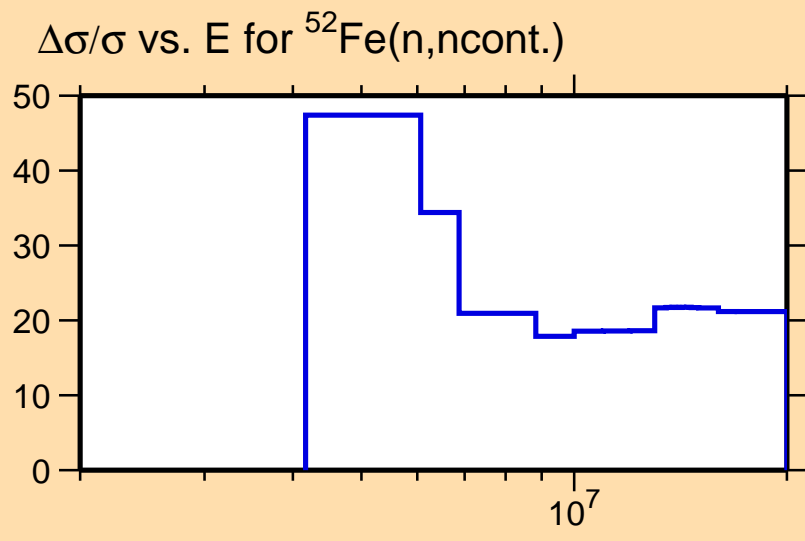

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\alpha)$

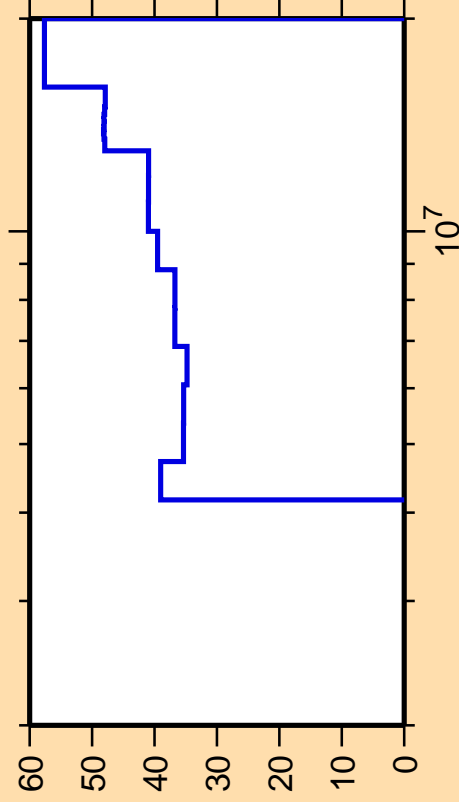

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,n\text{cont.})$

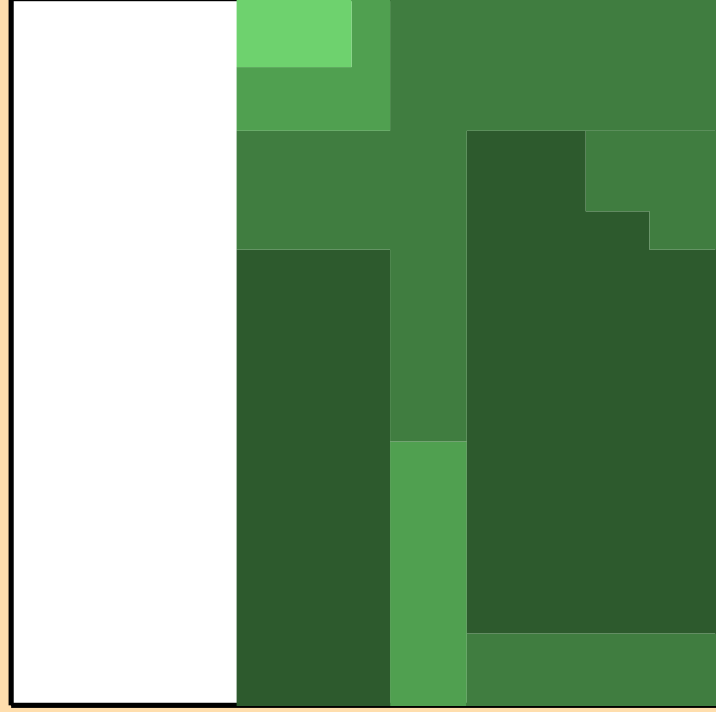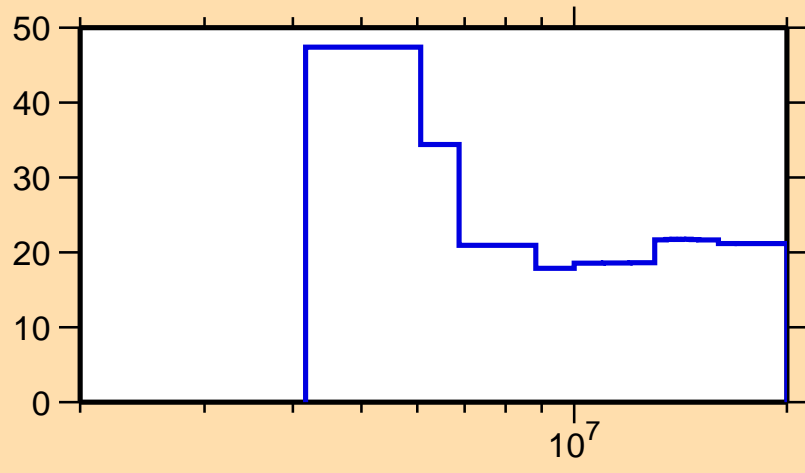



Correlation Matrix



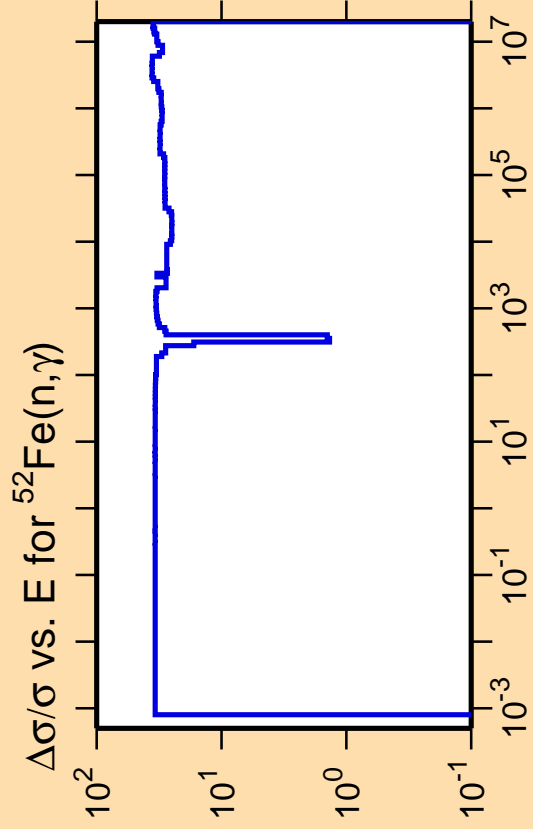


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

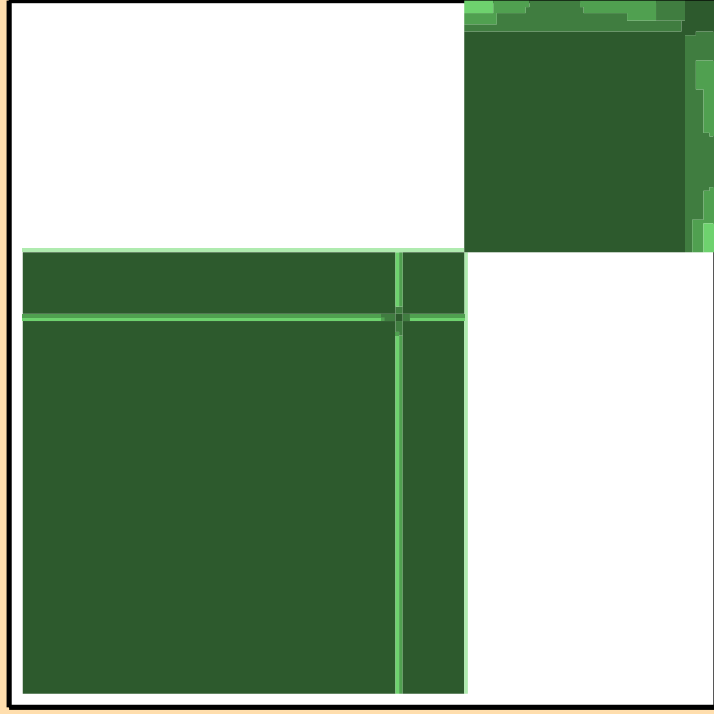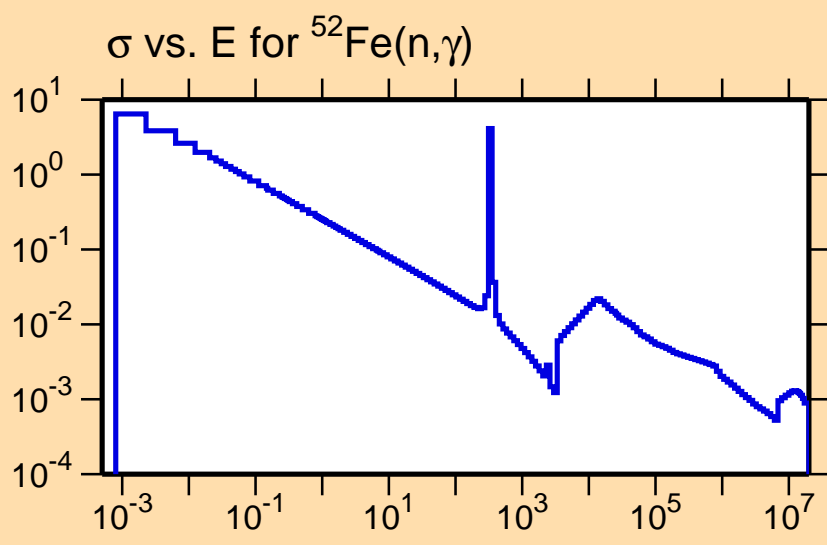

Correlation Matrix





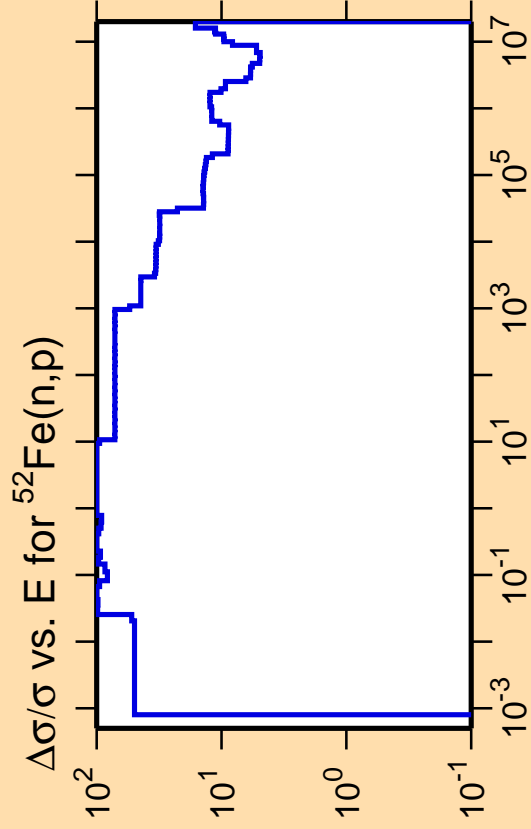

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

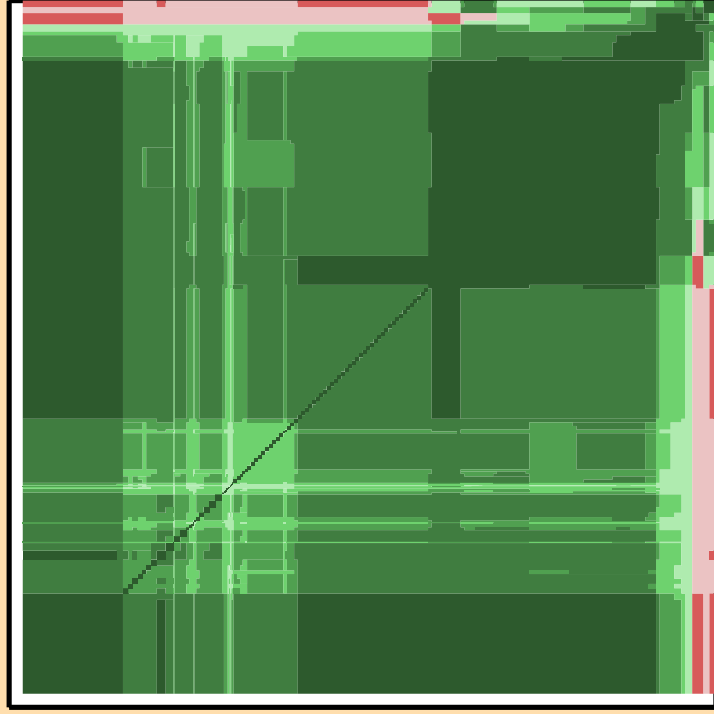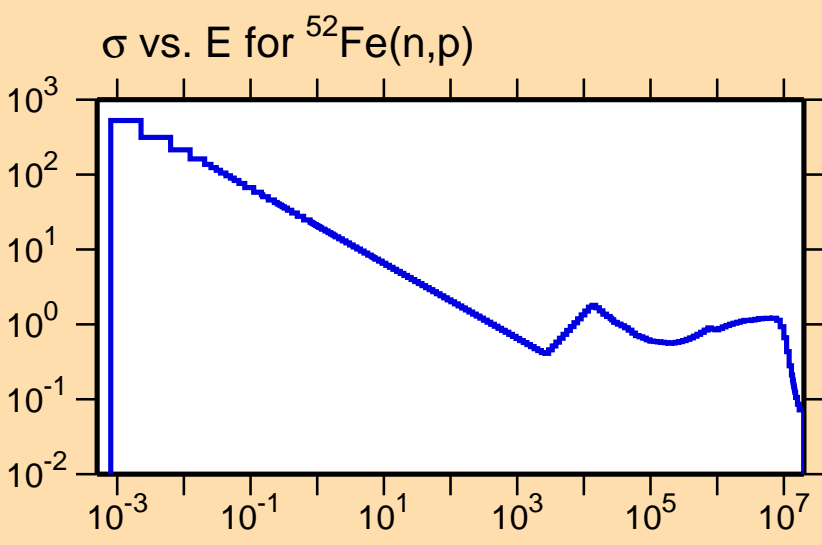

Correlation Matrix



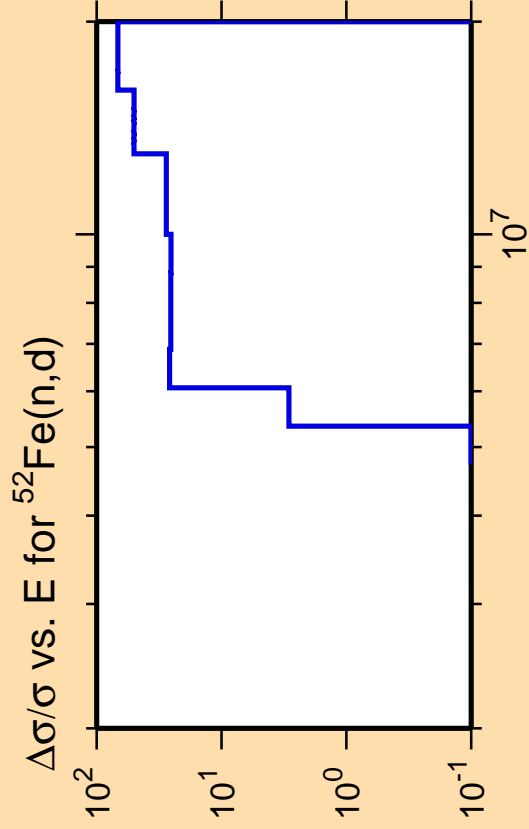


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


$\sigma$  vs.  $E$  for  $^{52}\text{Fe}(n,d)$

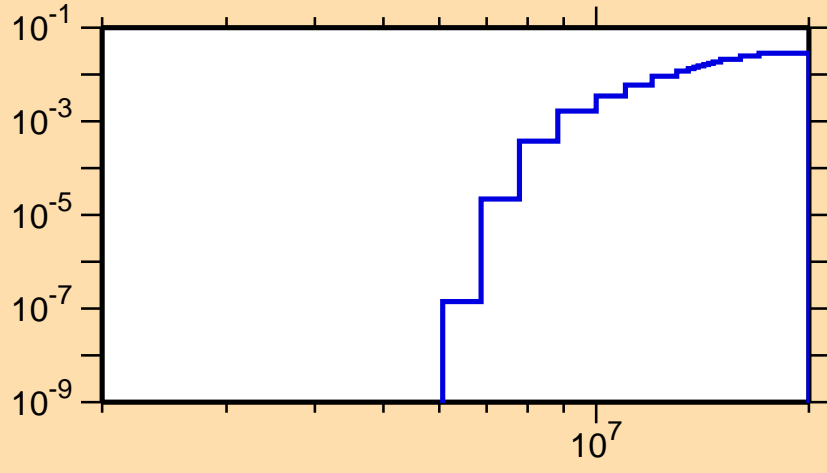

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,t)$

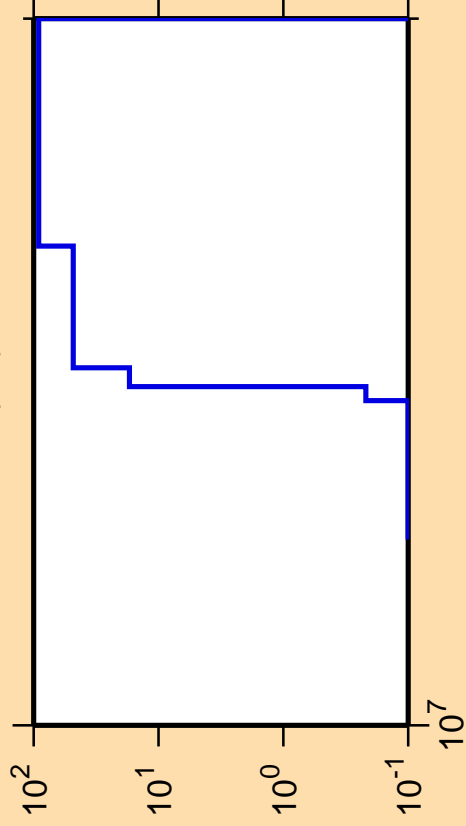


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{52}\text{Fe}(n,t)$

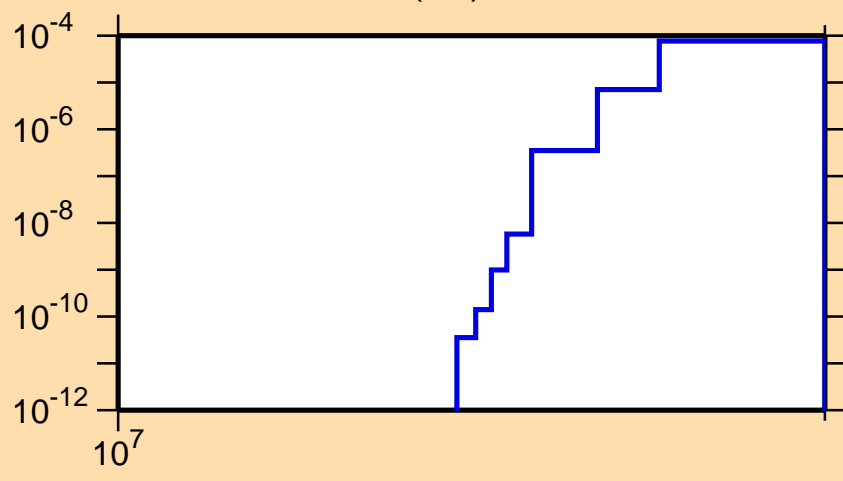

$10^7$

$10^{-12}$

$10^{-10}$

$10^{-8}$

$10^{-6}$

$10^{-4}$

Correlation Matrix



1.0

0.8

0.6

0.4

0.2

0.0

-1.0


-0.8

-0.6

-0.4

-0.2


0.0

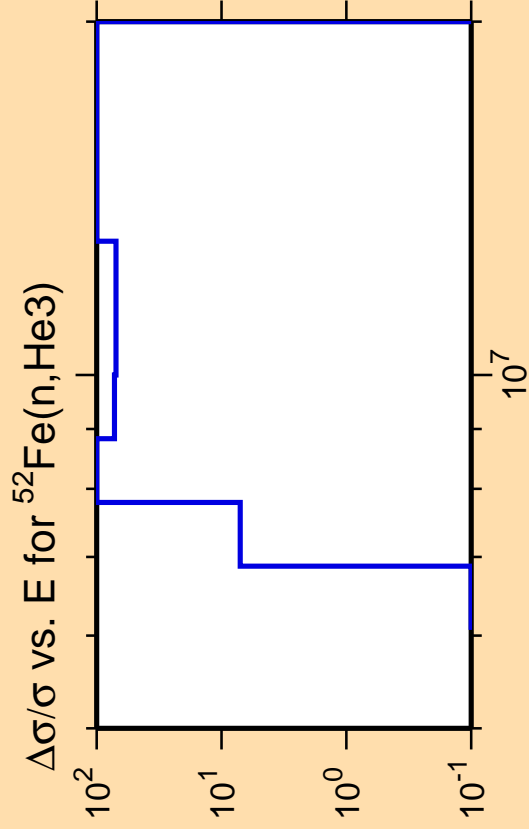

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

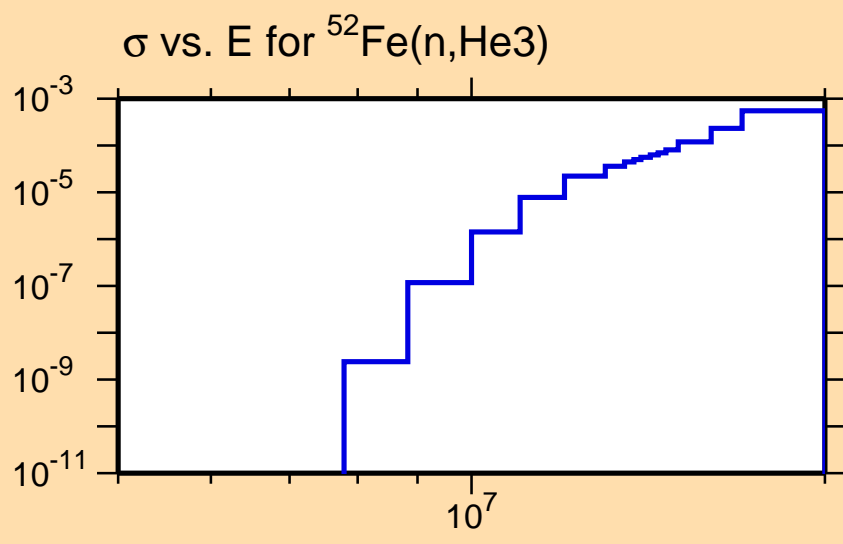



Correlation Matrix



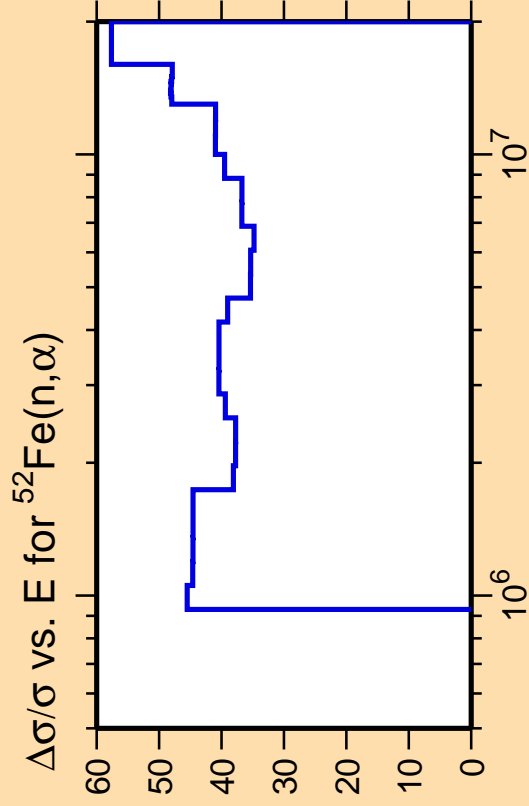

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

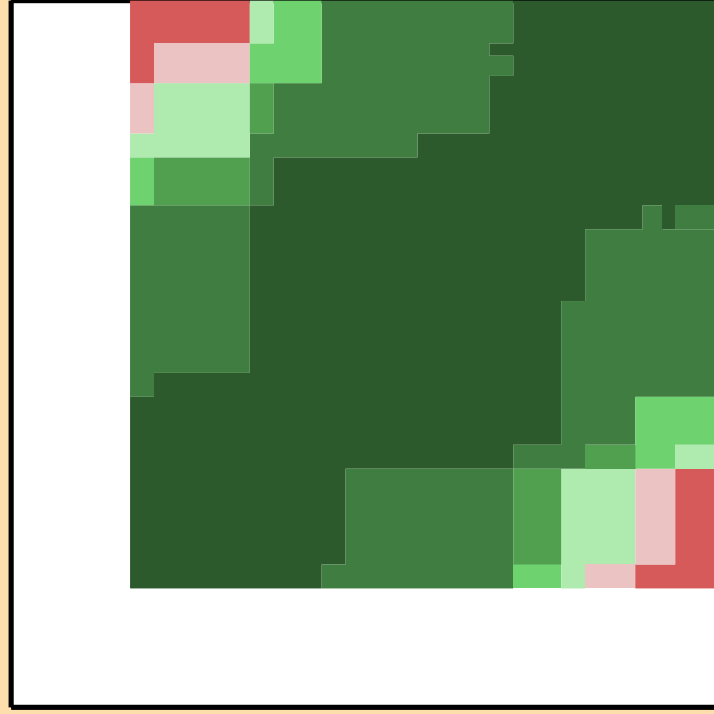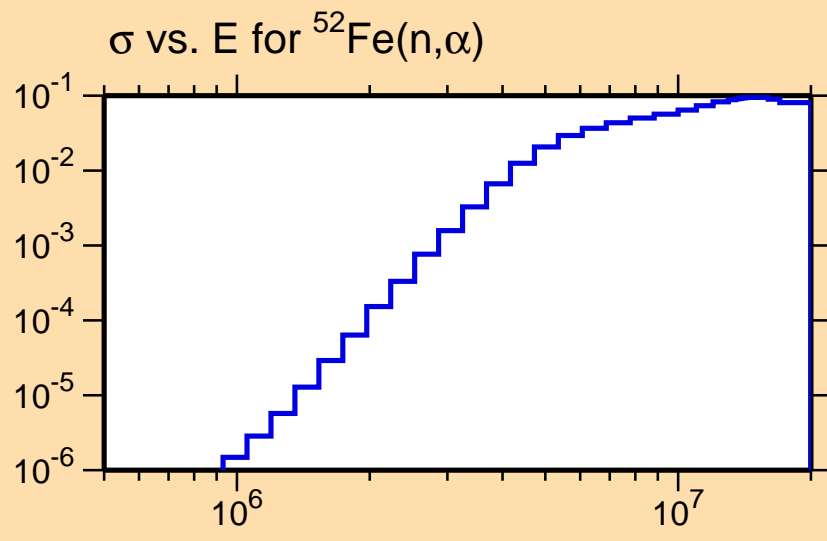


Correlation Matrix







$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,p\alpha)$

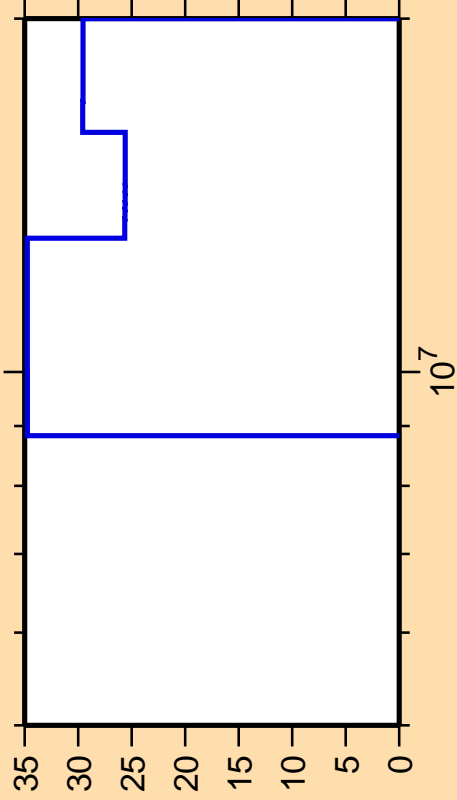

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{52}\text{Fe}(n,p\alpha)$

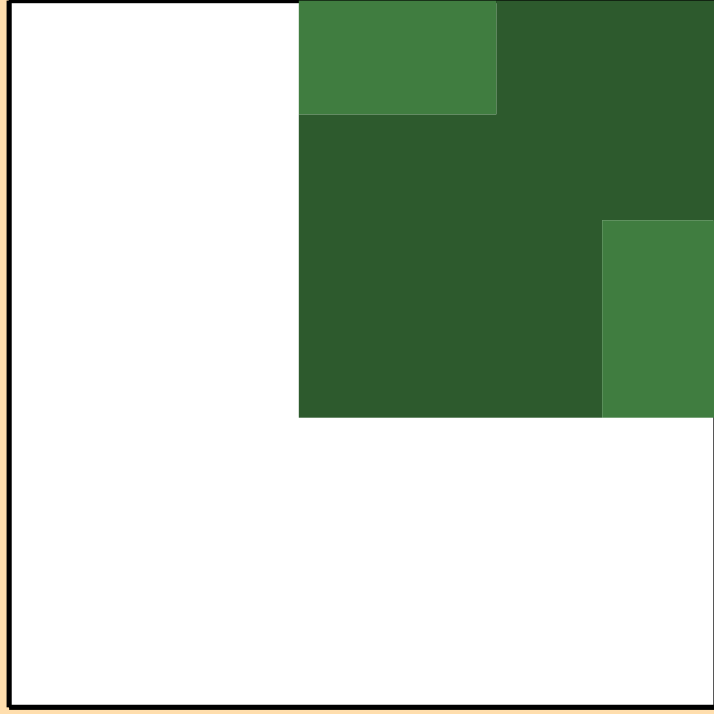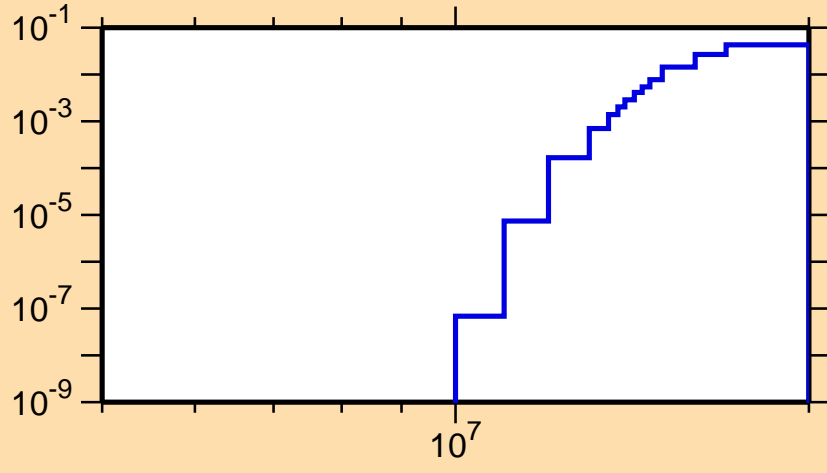

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,pd)$


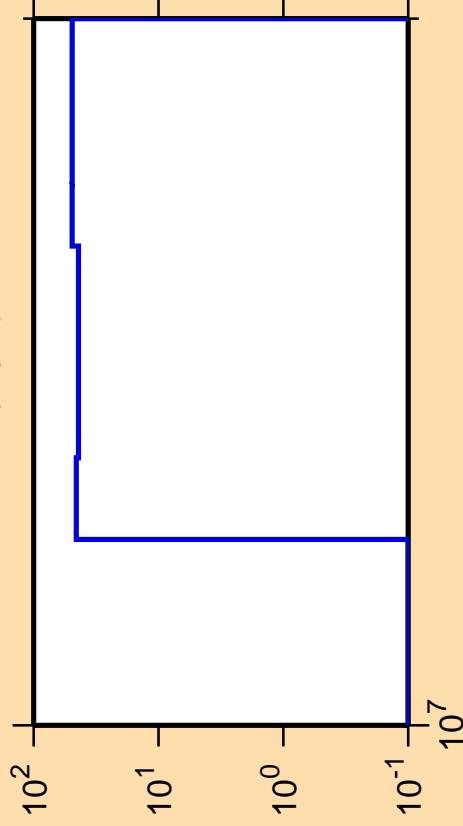


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


$\sigma$  vs. E for  $^{52}\text{Fe}(n,pd)$

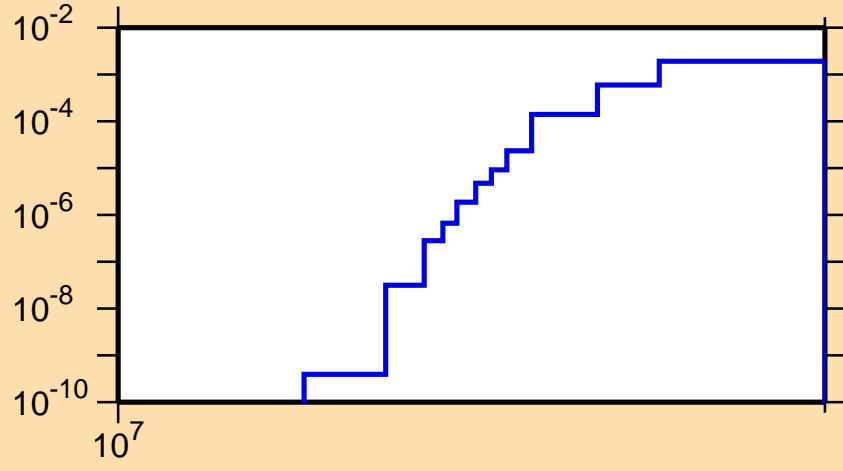

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{pt})$

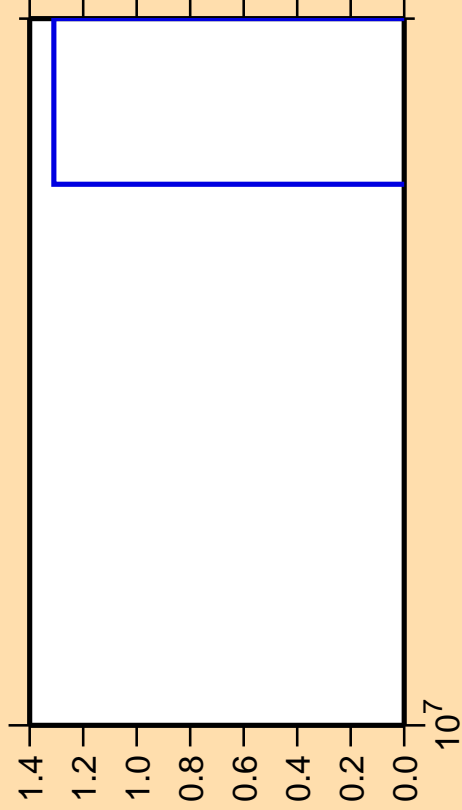

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{52}\text{Fe}(n,\text{pt})$



Correlation Matrix

