



Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

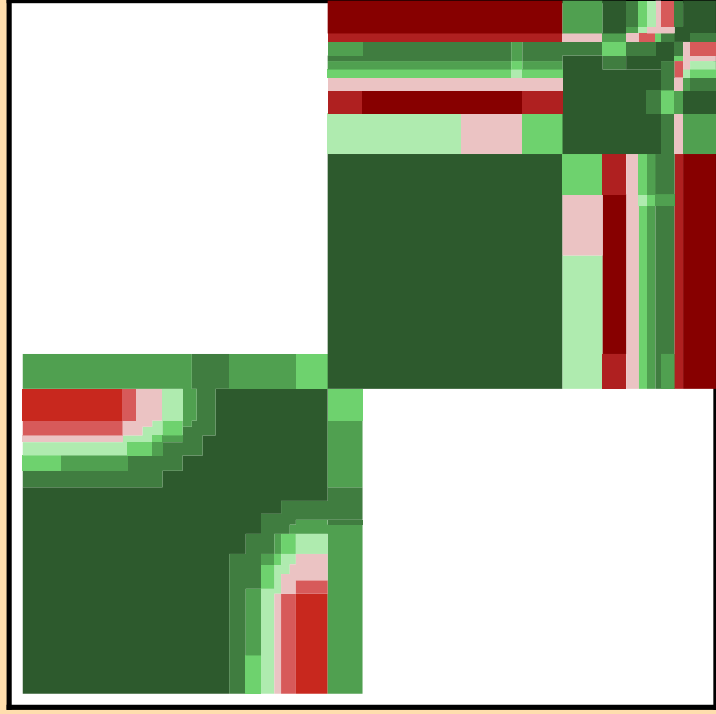

Correlation Matrix

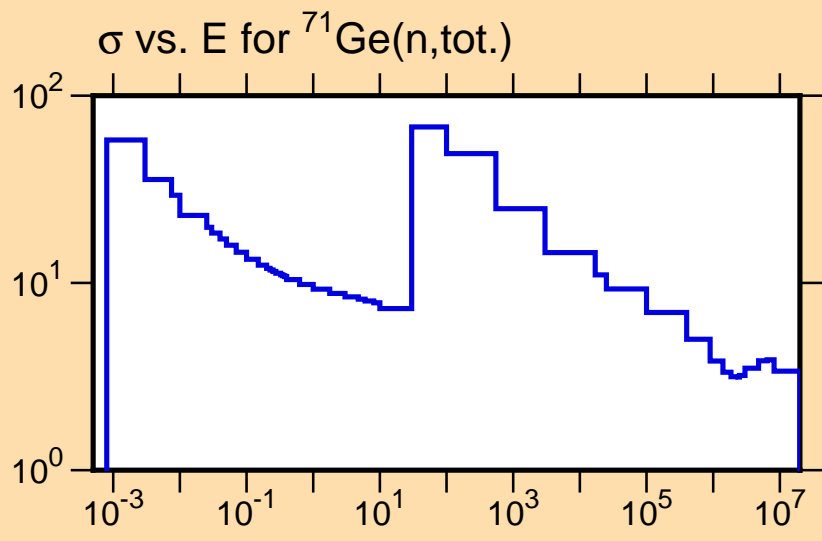


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

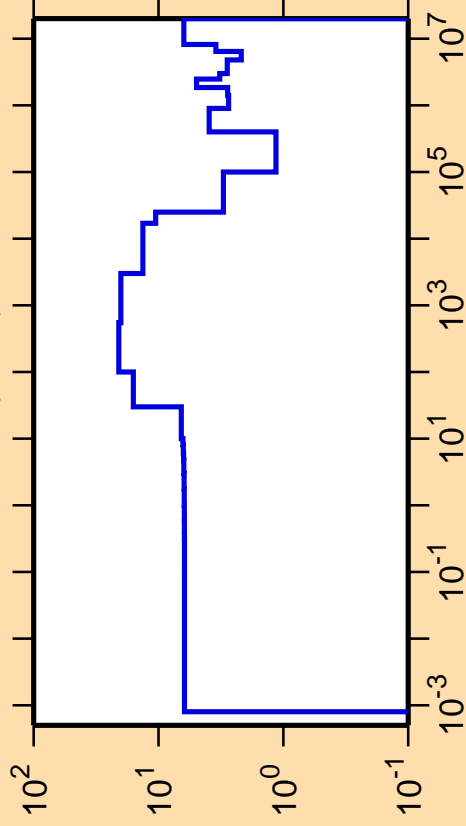

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{tot.})$

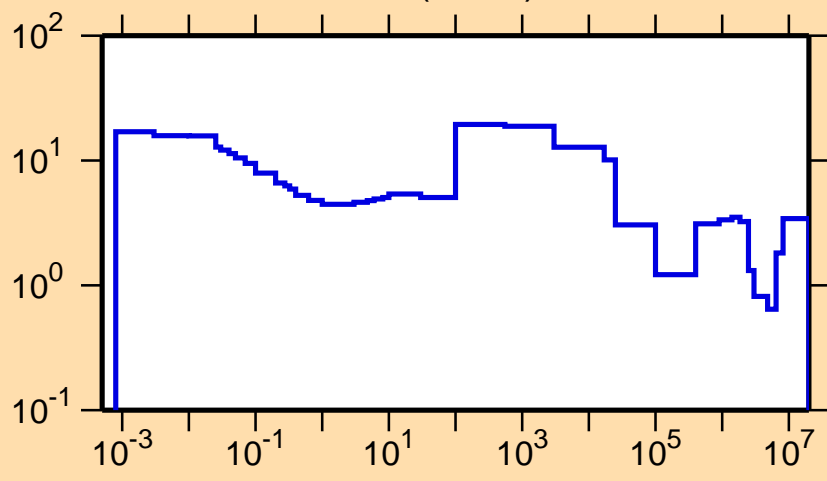

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

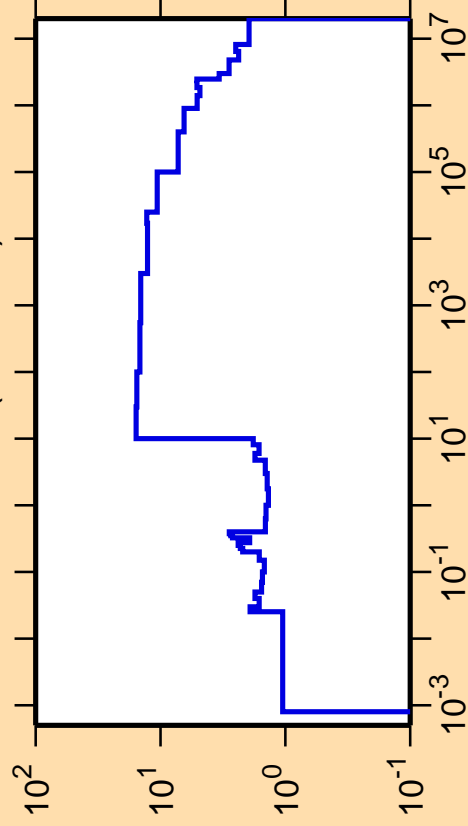

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{tot.})$

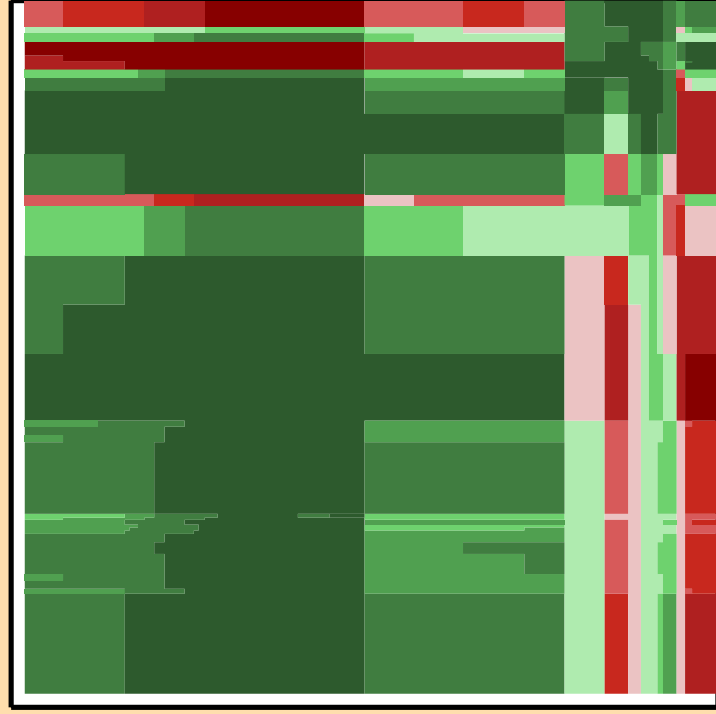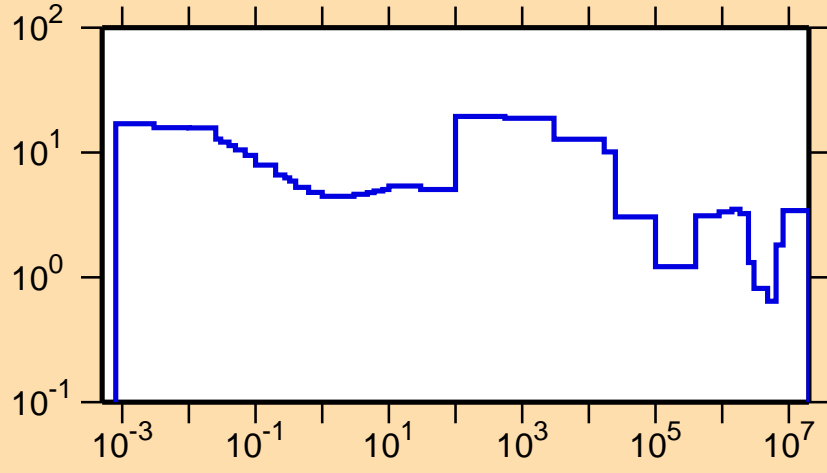

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

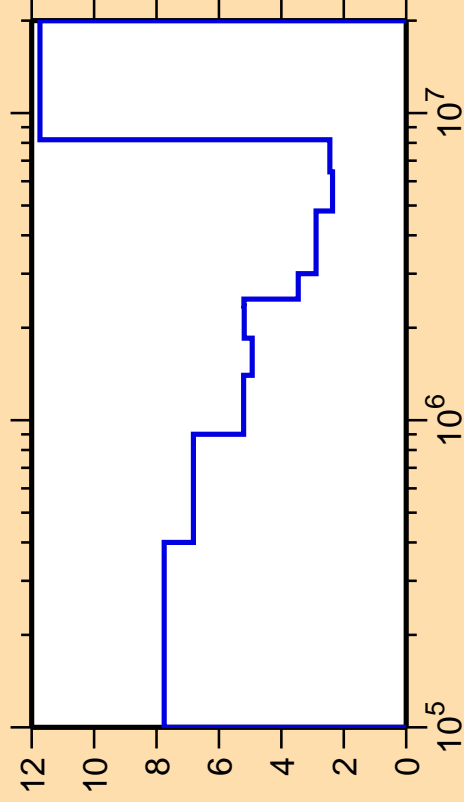

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{tot.})$

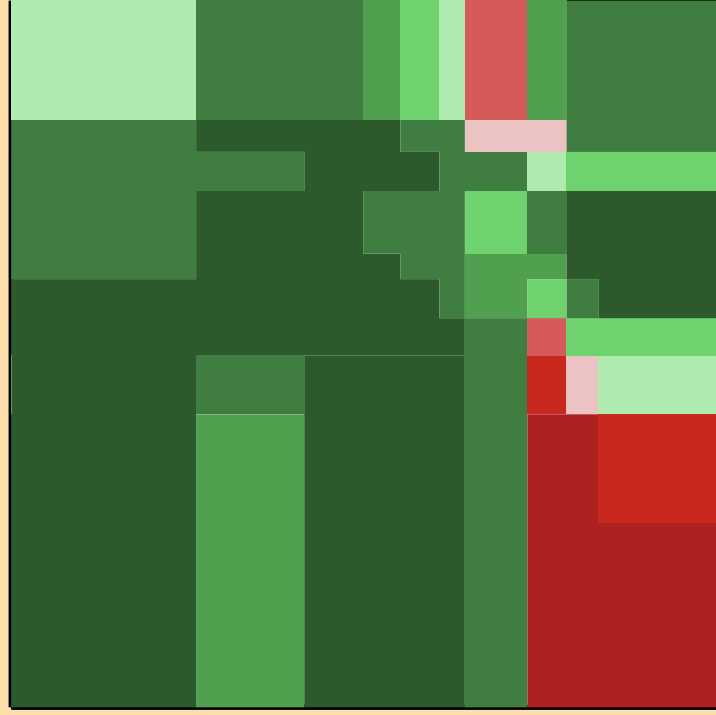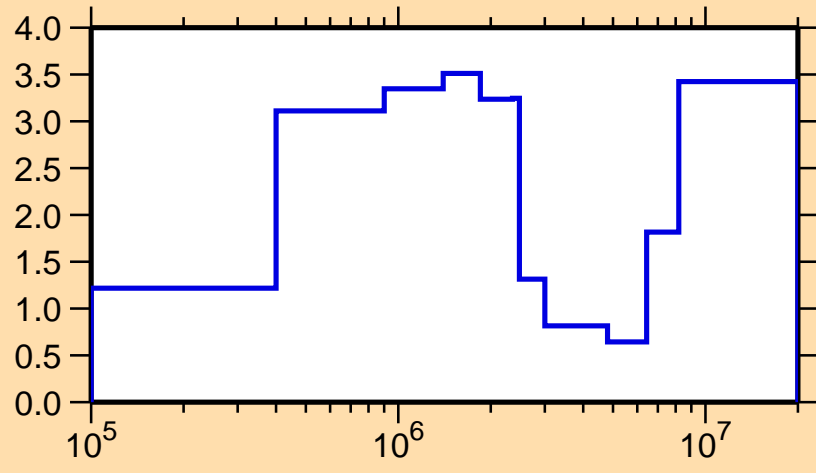

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

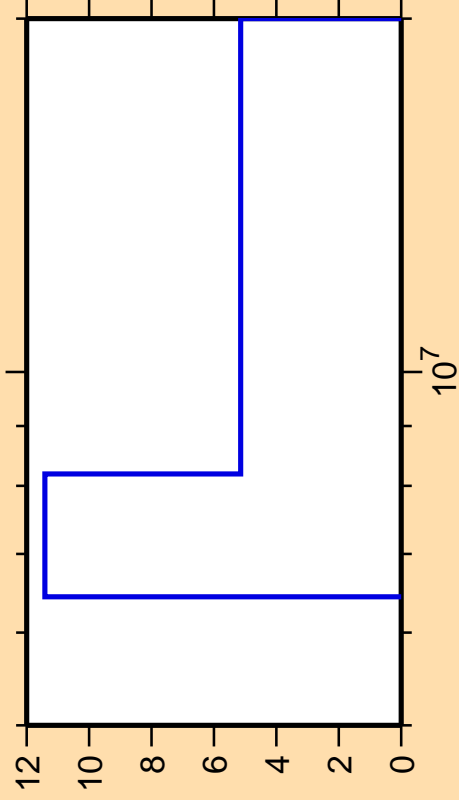

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{tot.})$

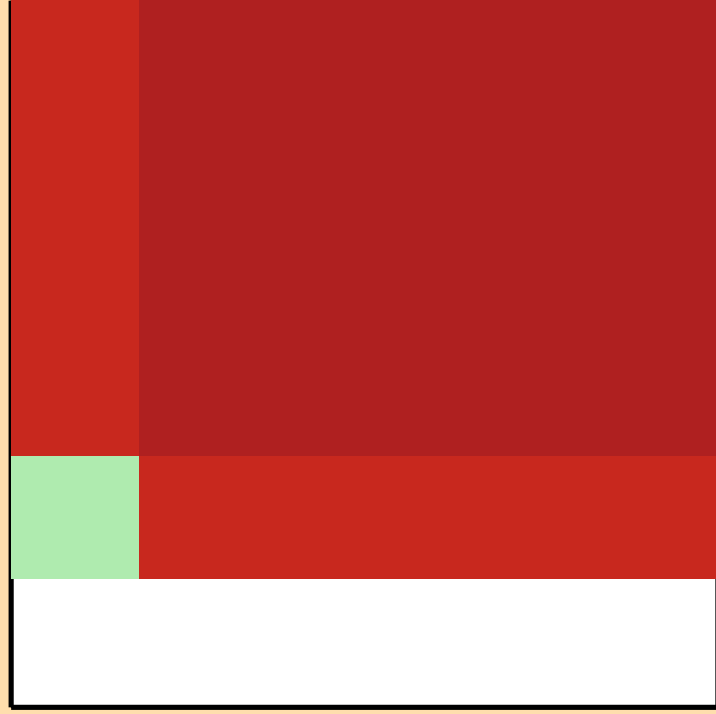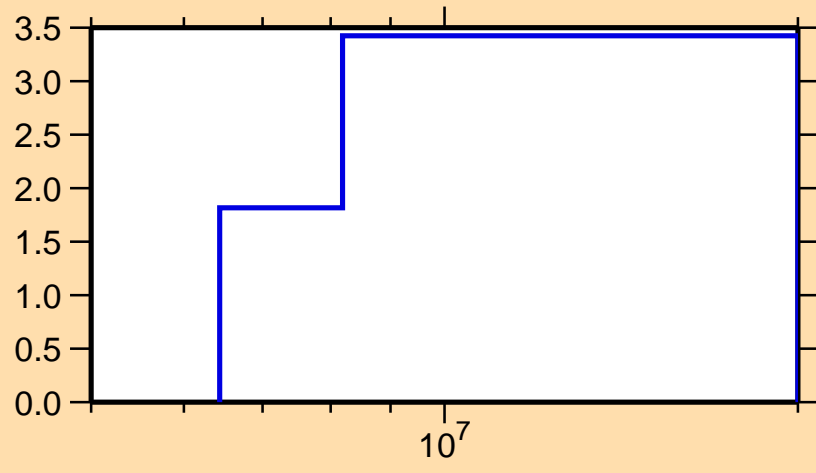


Correlation Matrix



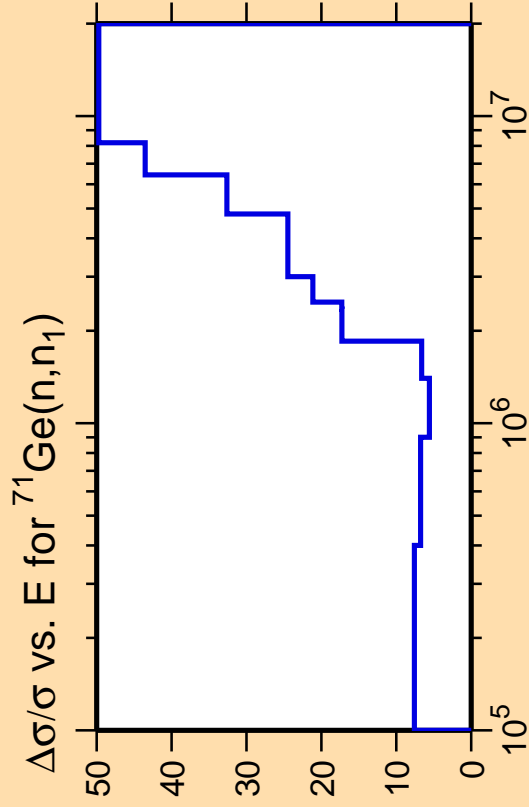


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

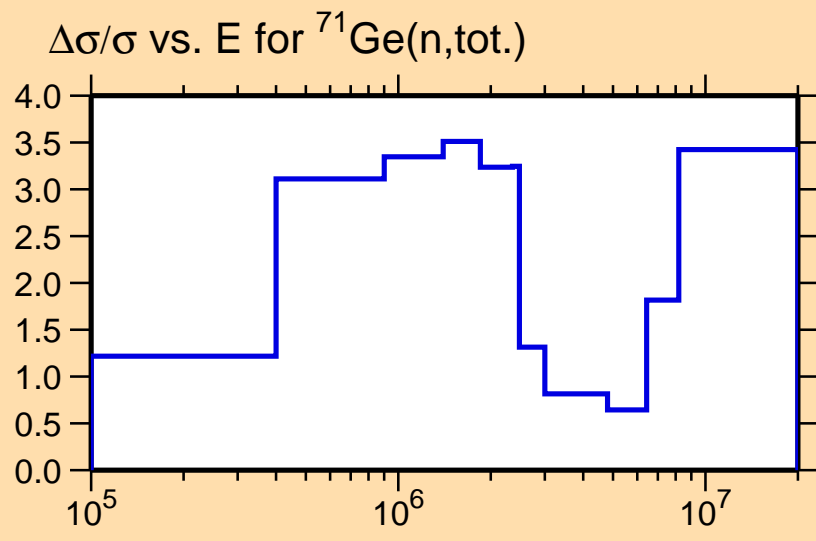



Correlation Matrix



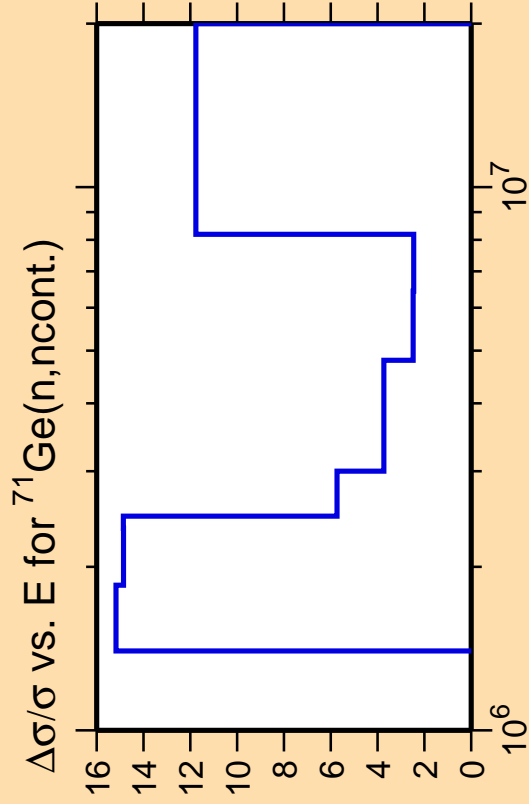


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

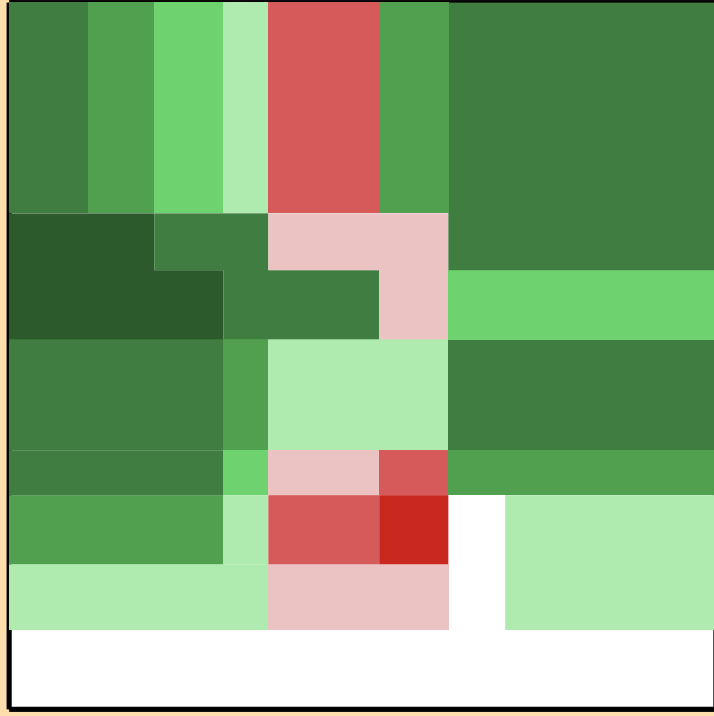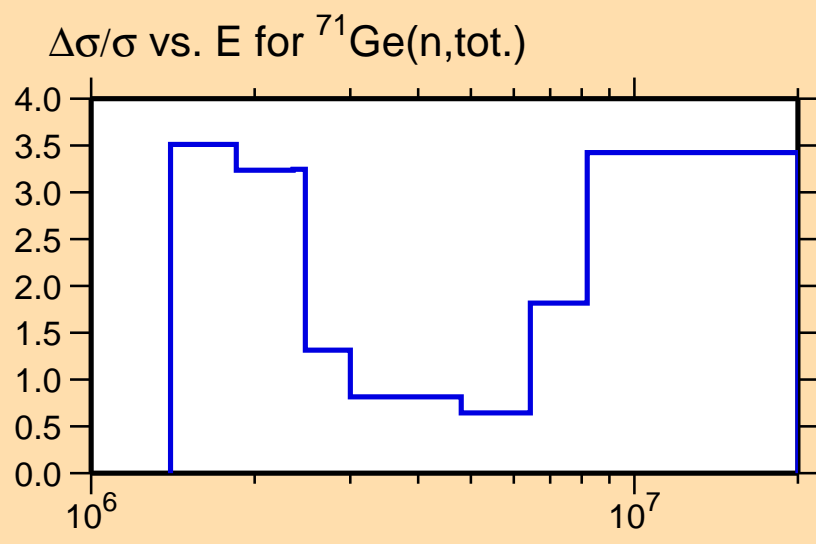

Correlation Matrix





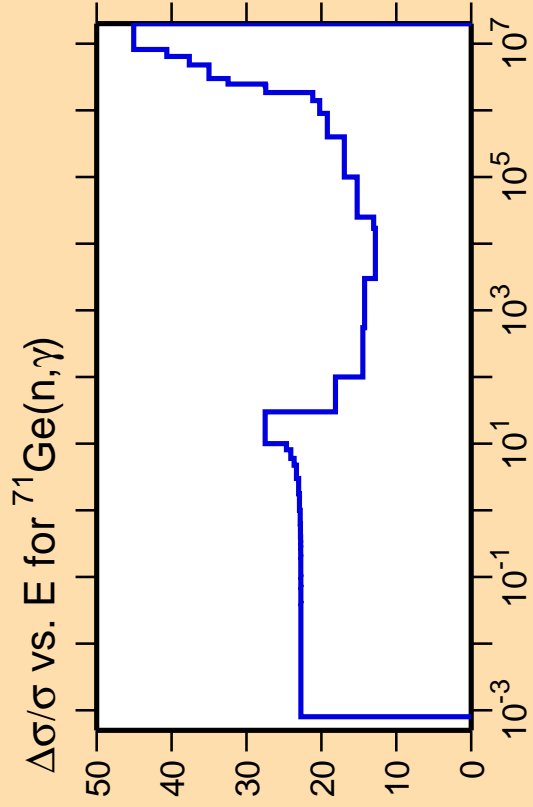

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{tot.})$

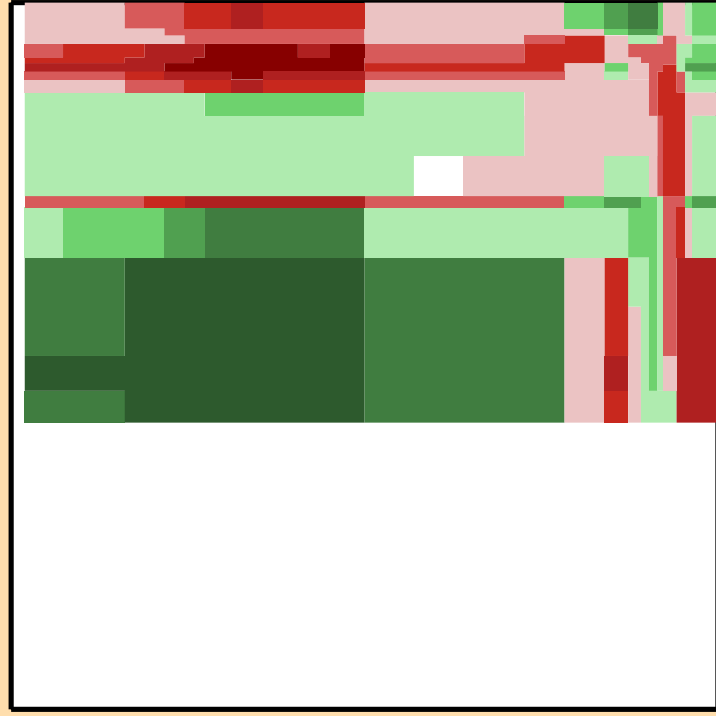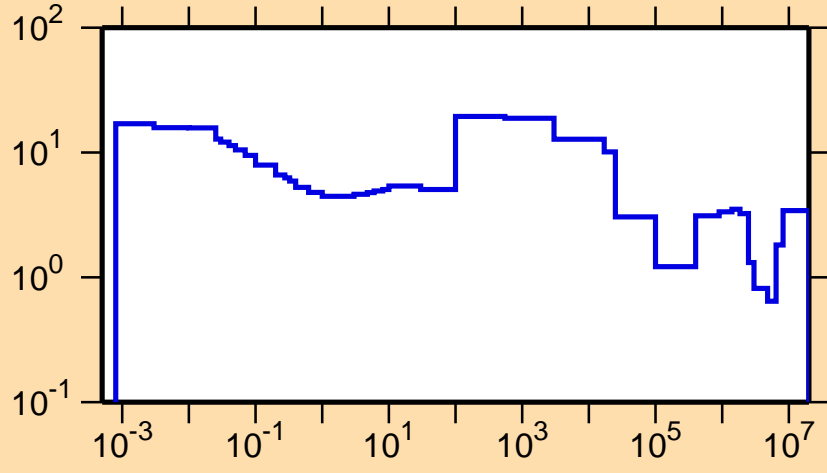

Correlation Matrix






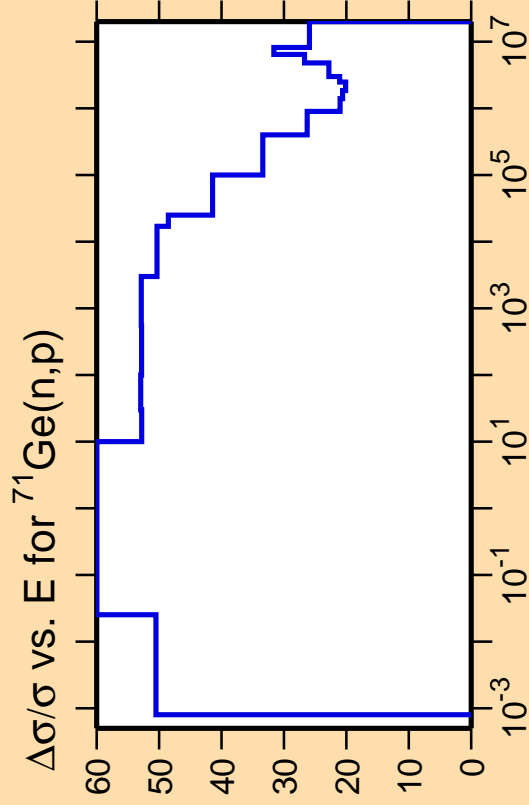


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{tot.})$

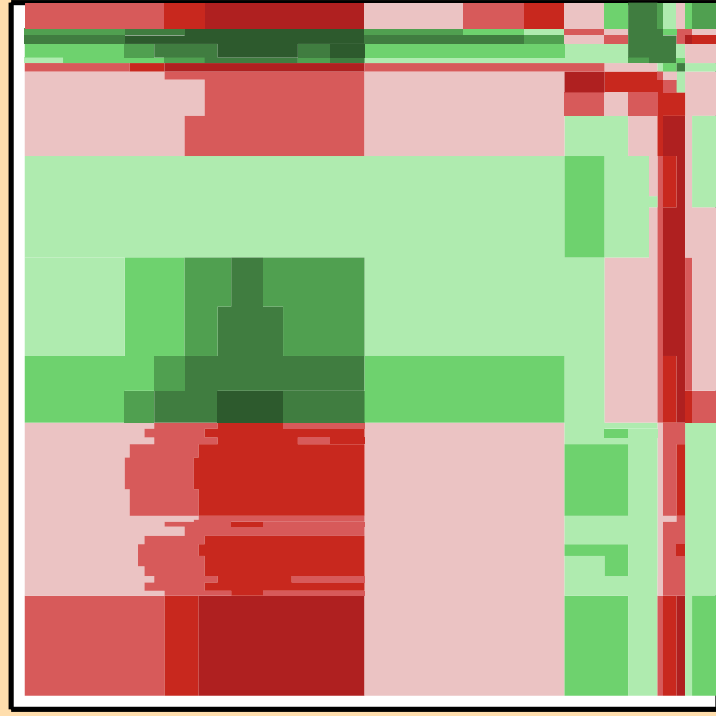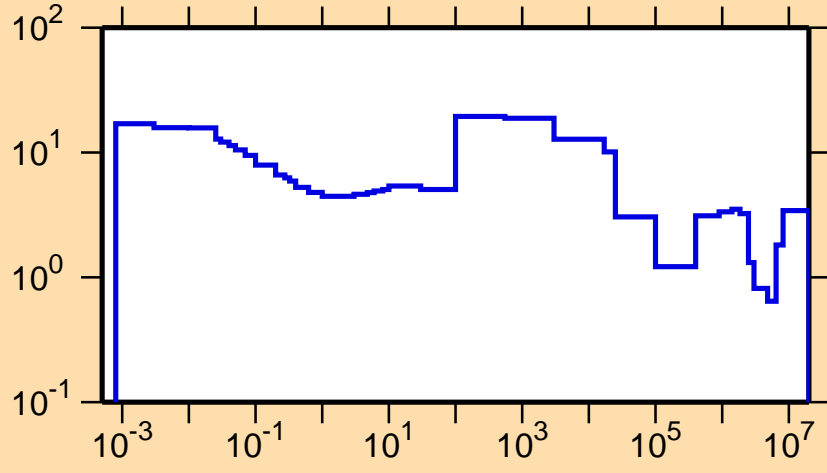

Correlation Matrix




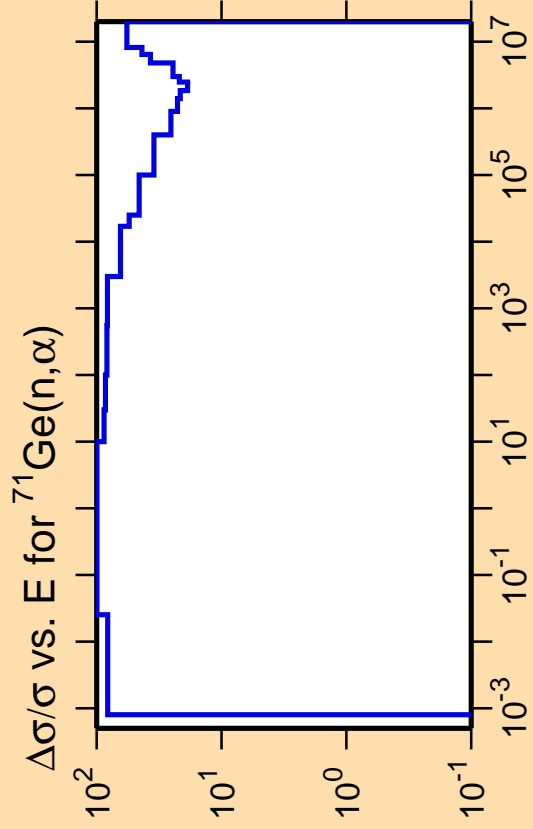


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{tot.})$

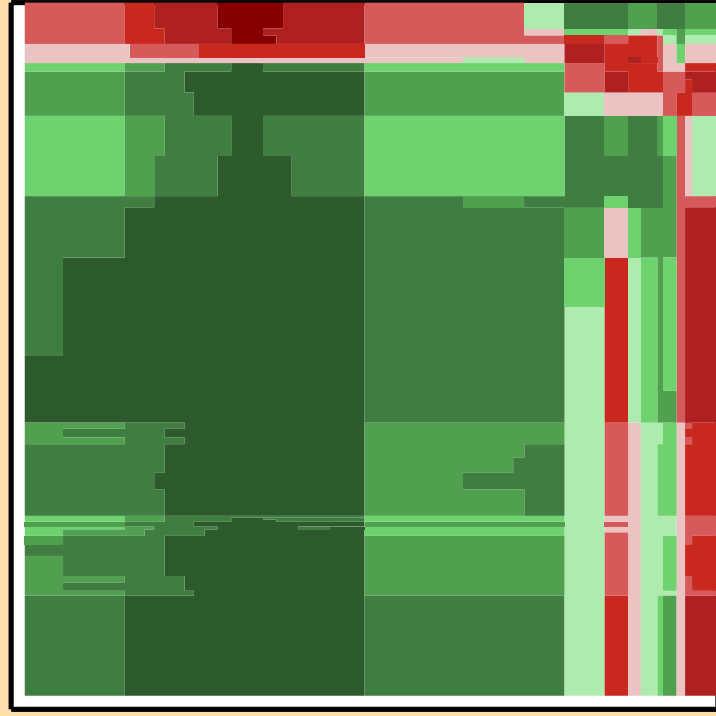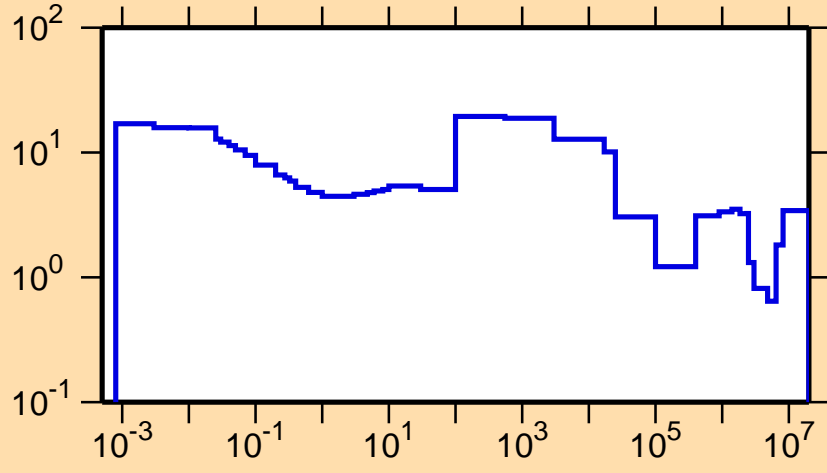



Correlation Matrix



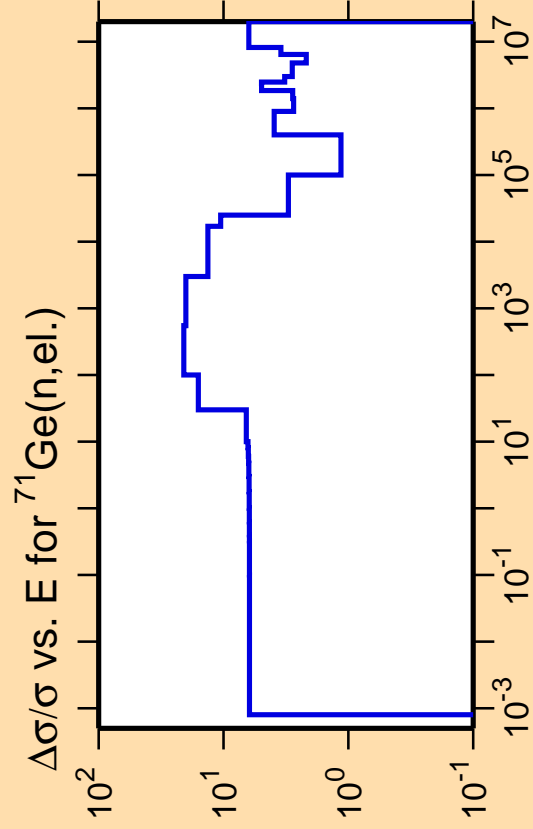

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

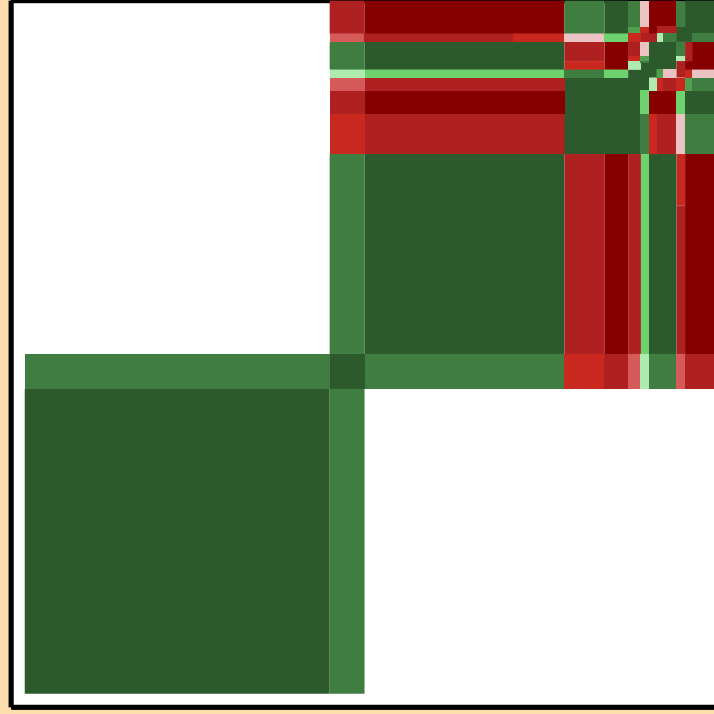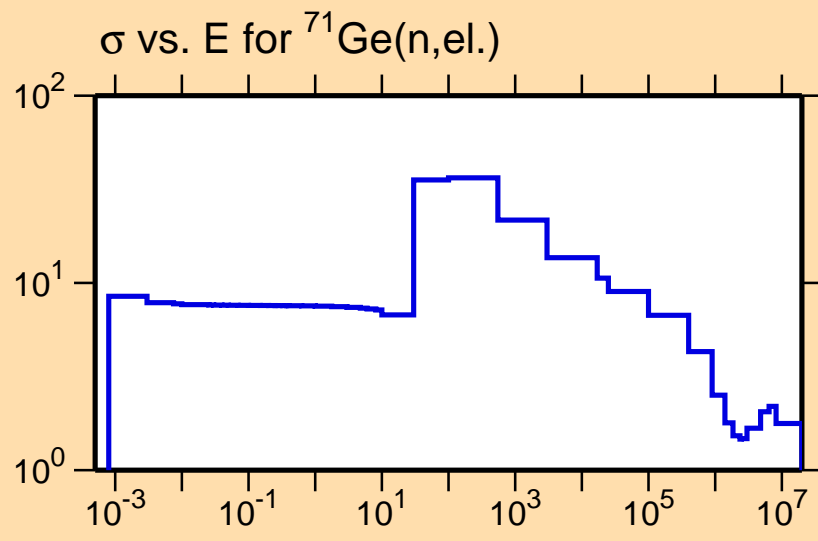

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

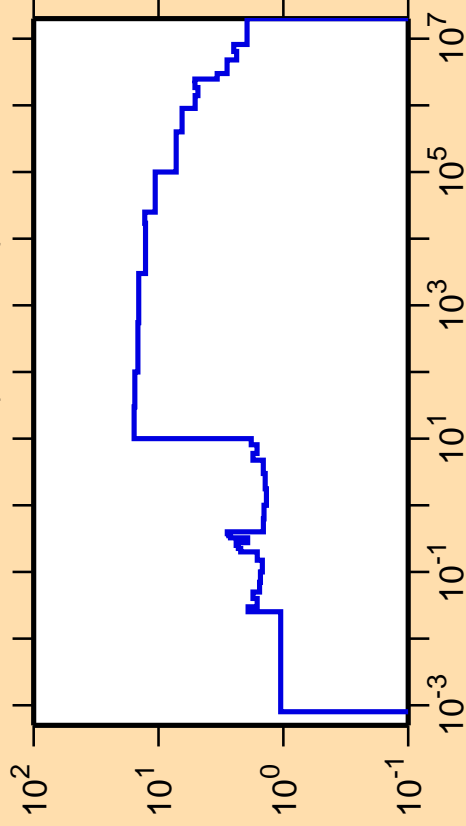

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

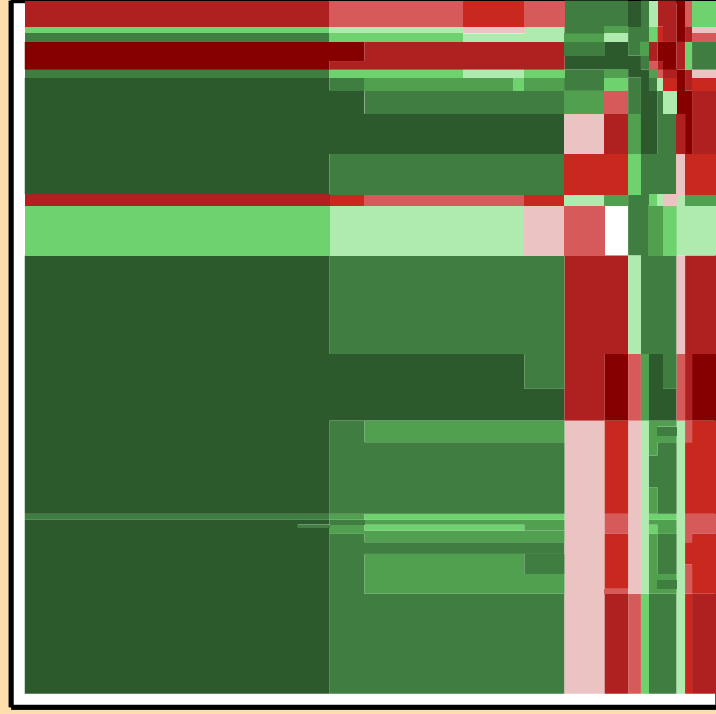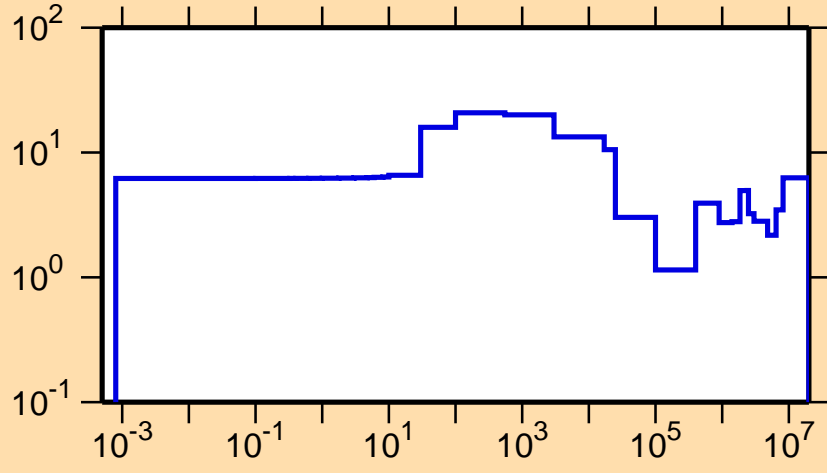

Correlation Matrix





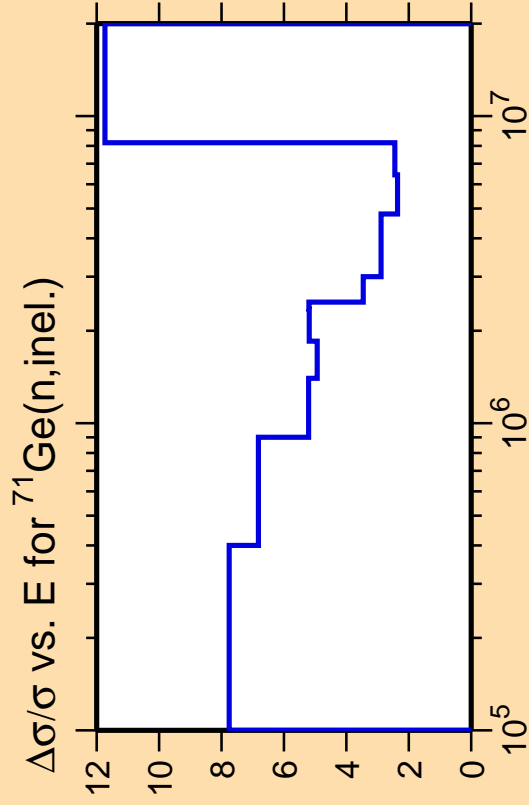

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

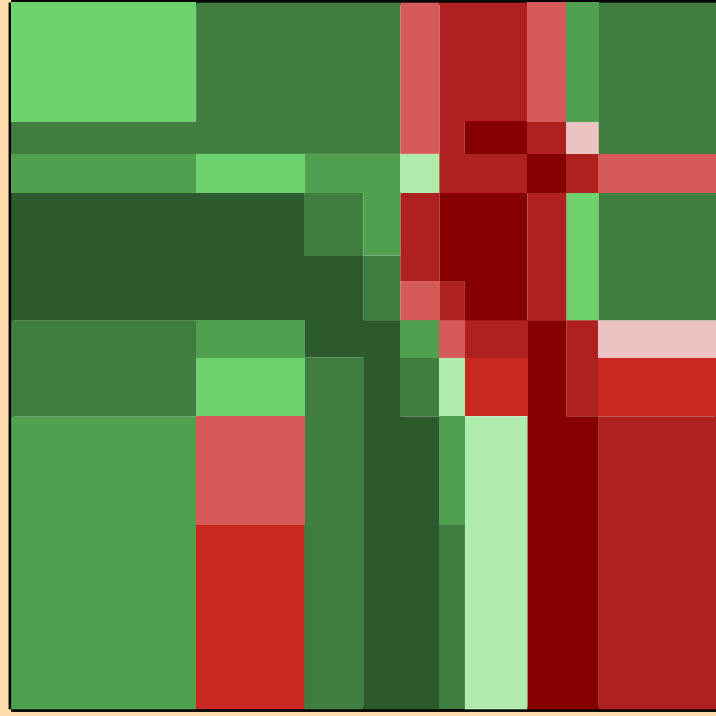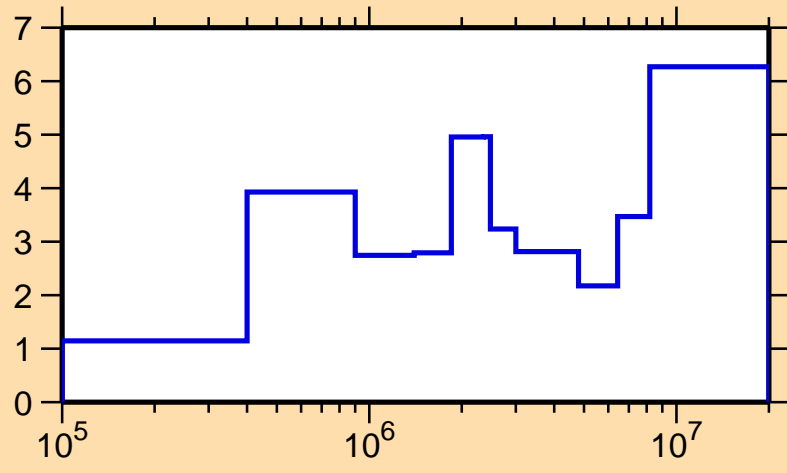

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

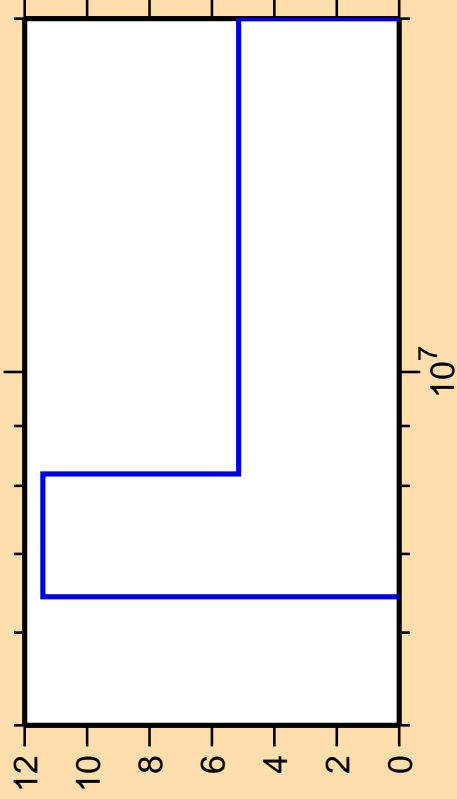

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

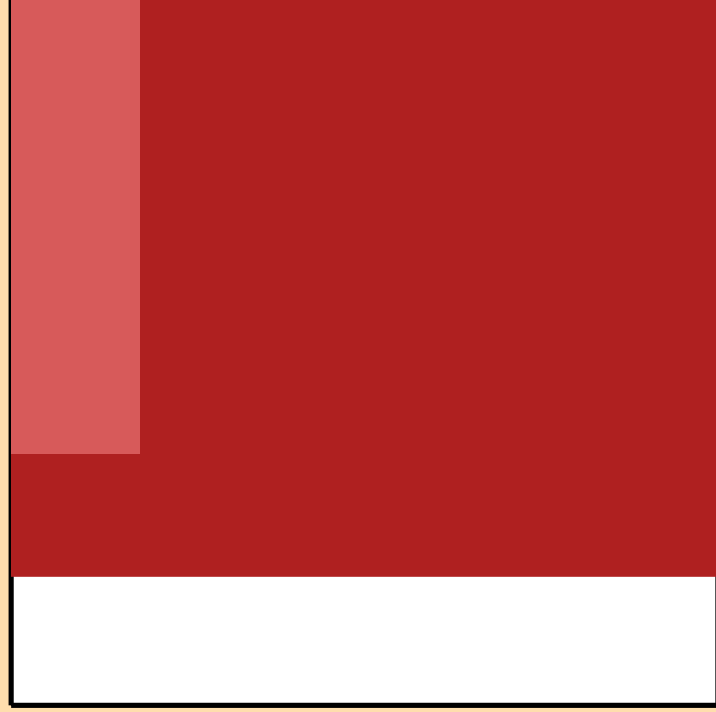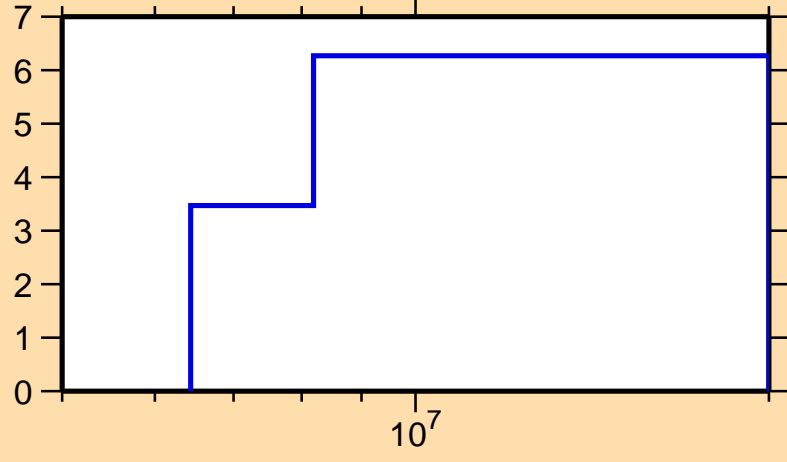

Correlation Matrix





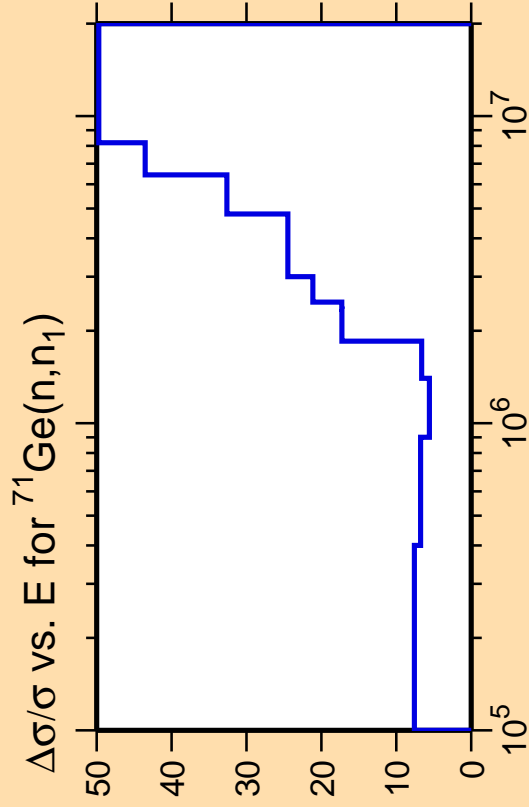

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

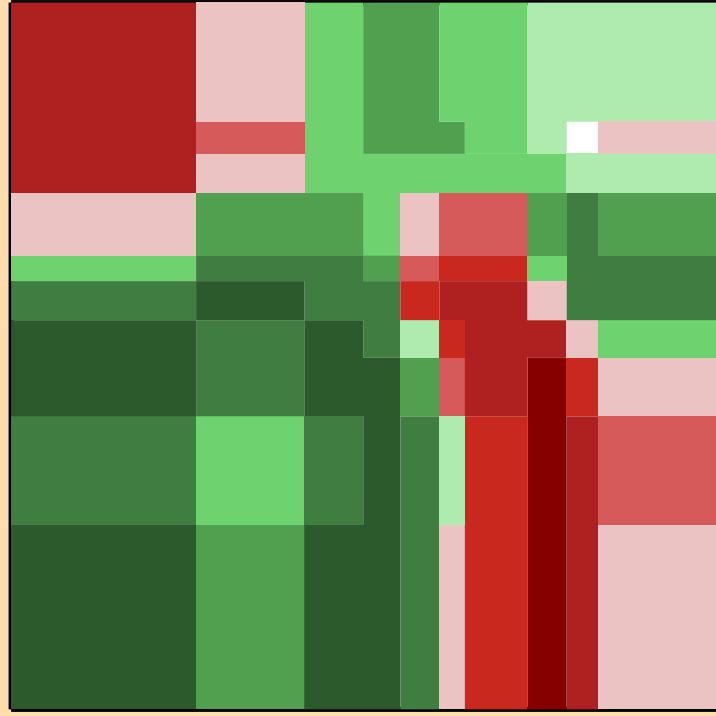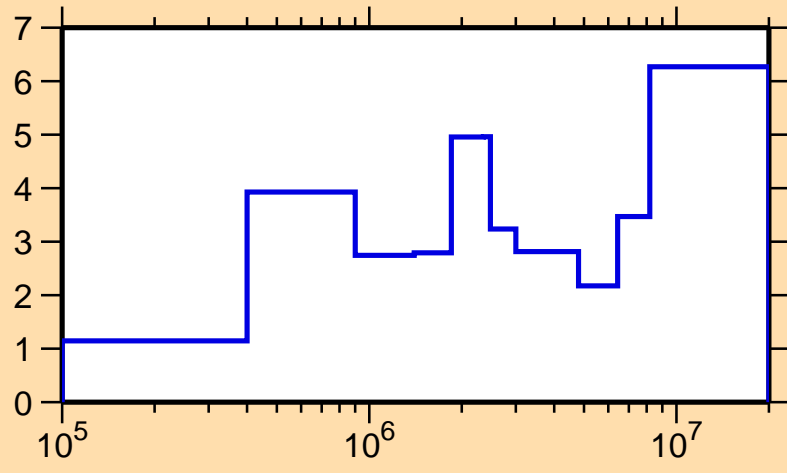

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

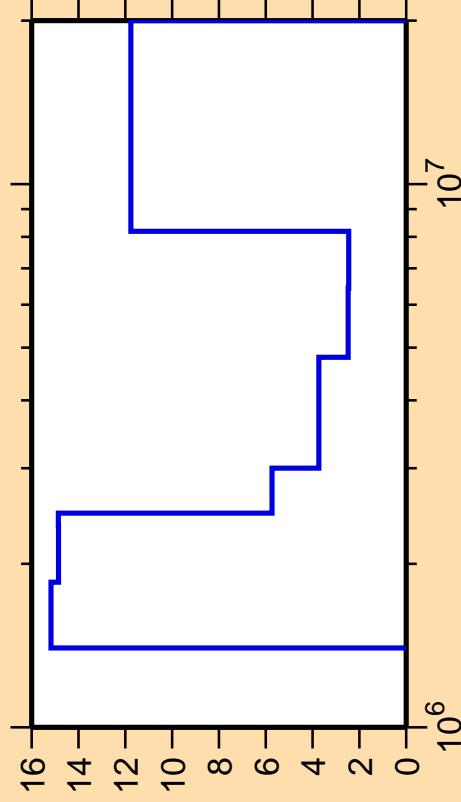

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

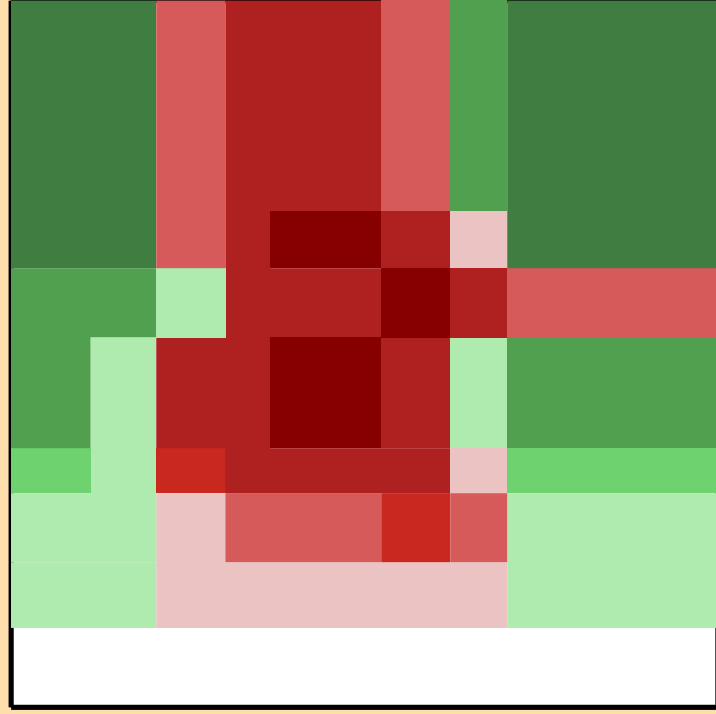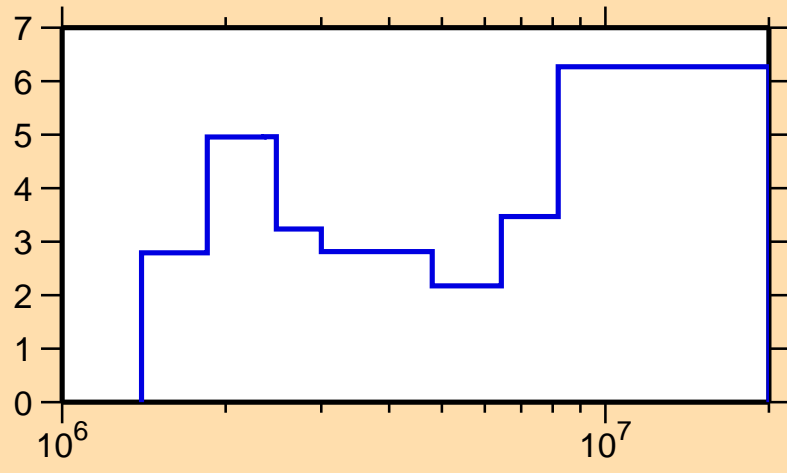

Correlation Matrix







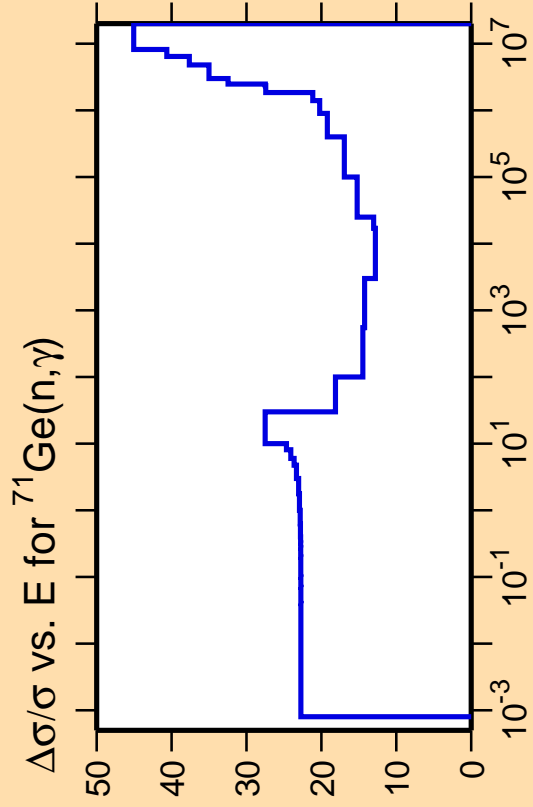

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

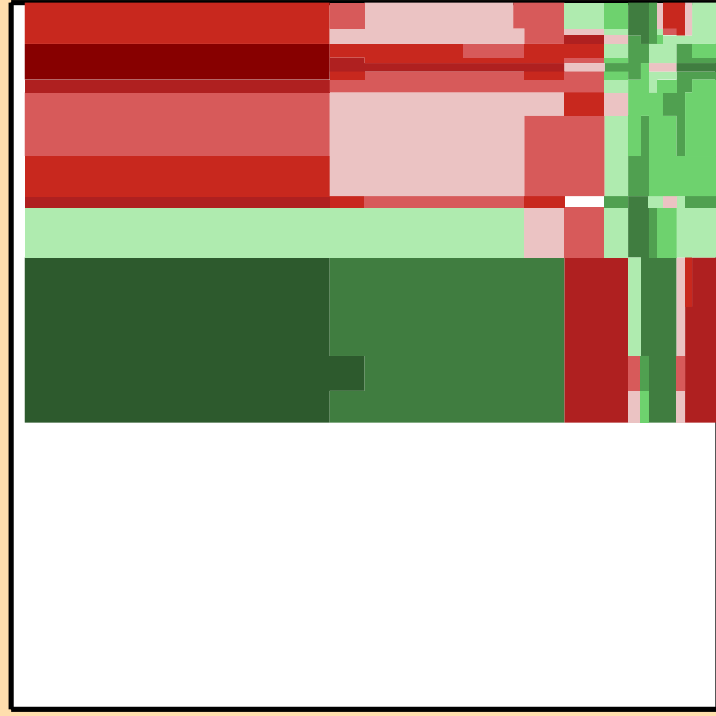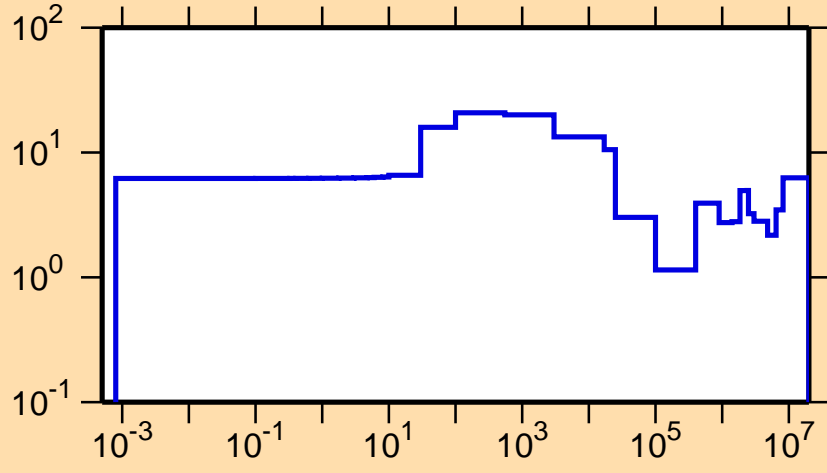

Correlation Matrix




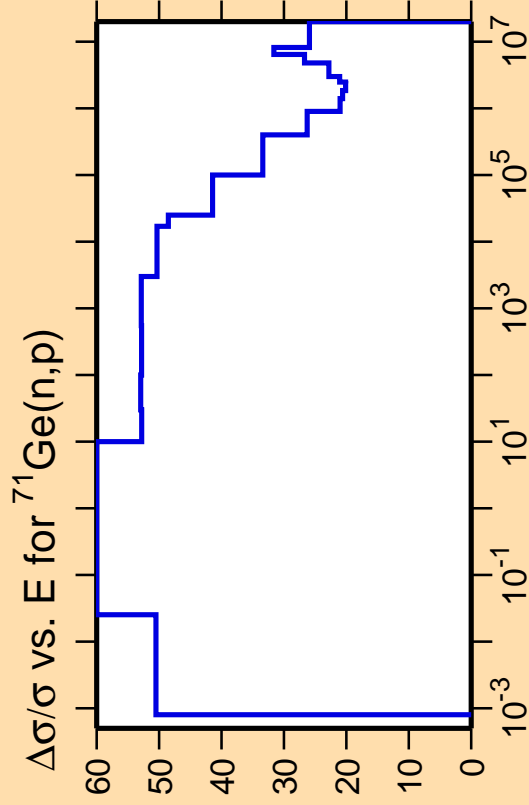


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{el.})$

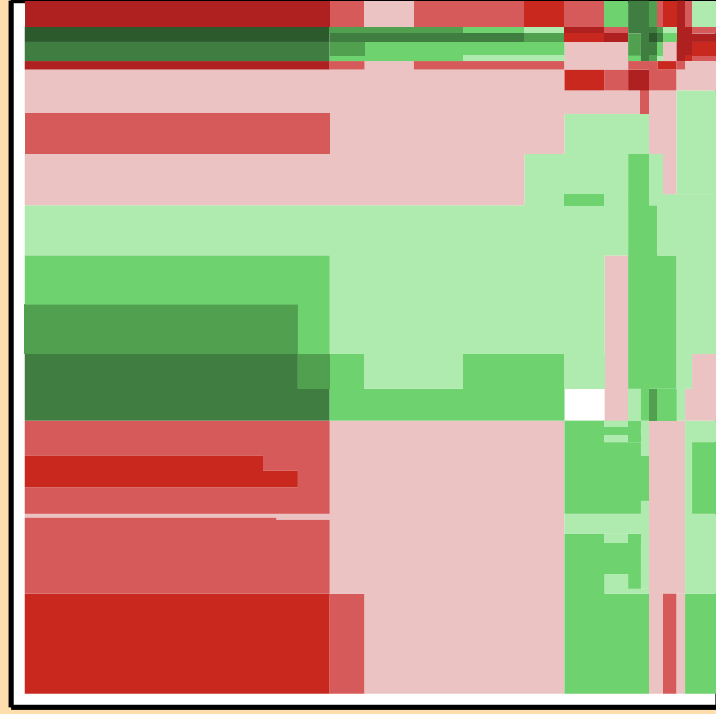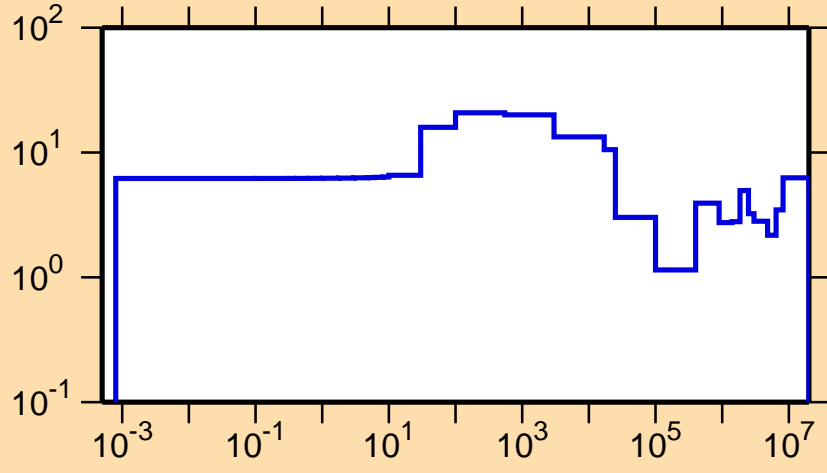

Correlation Matrix





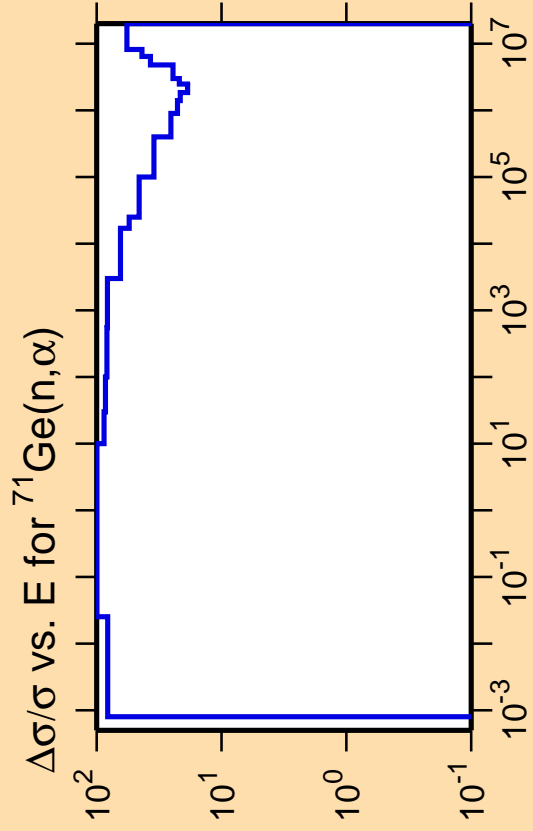

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.

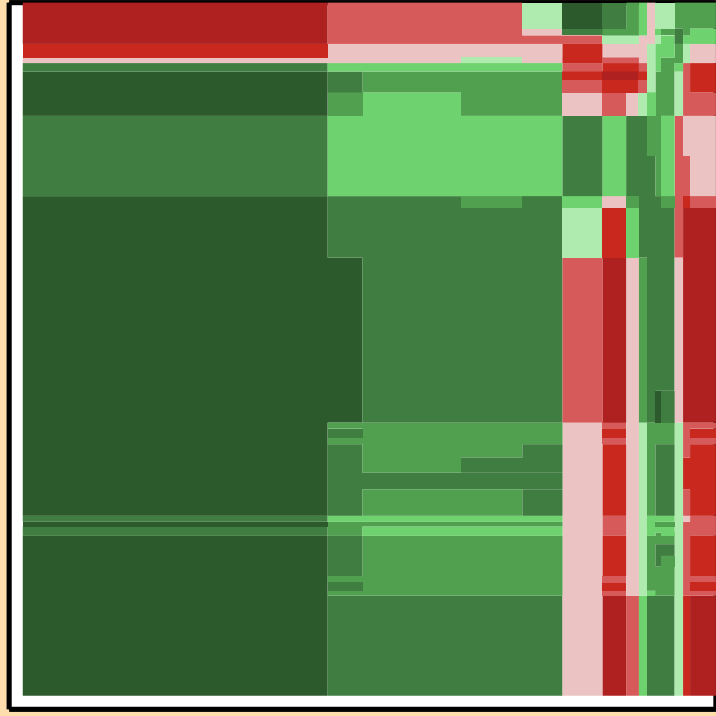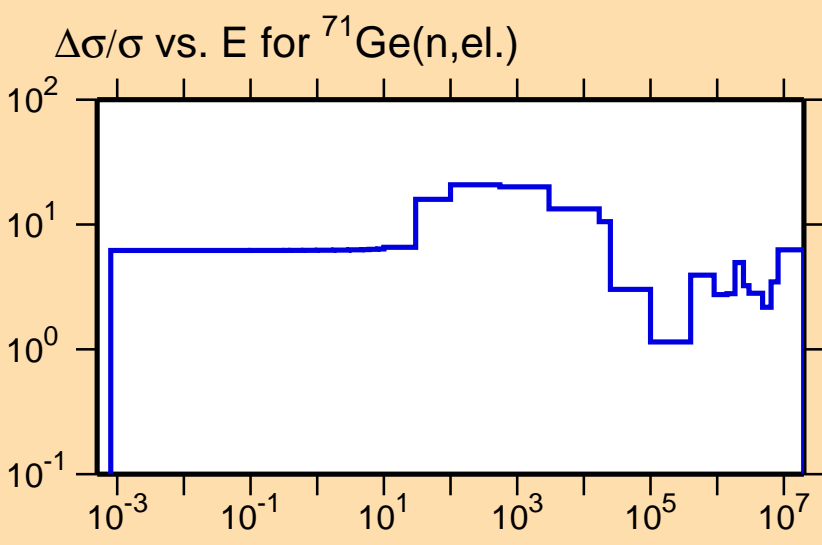



Correlation Matrix



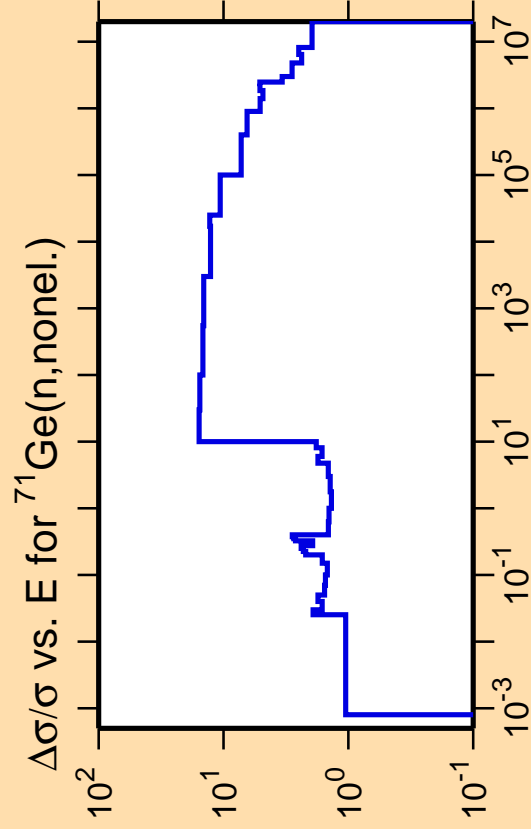


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

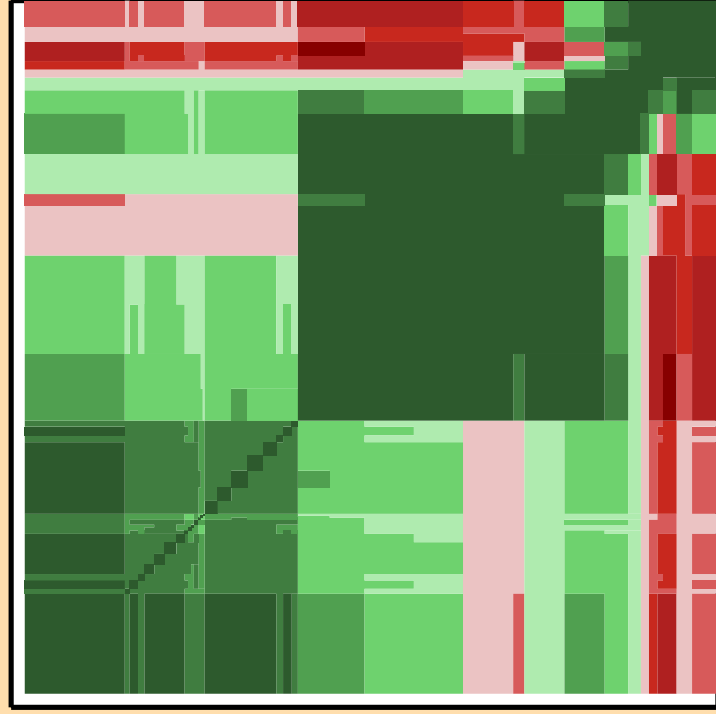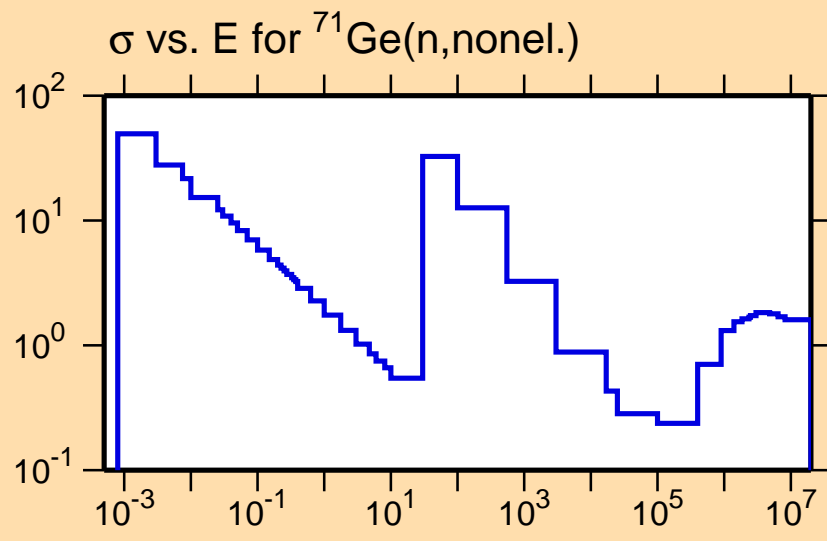

Correlation Matrix




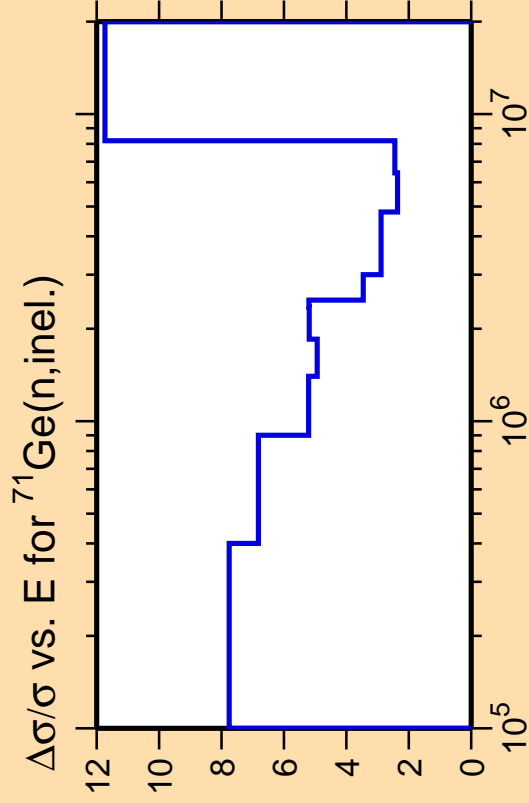

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

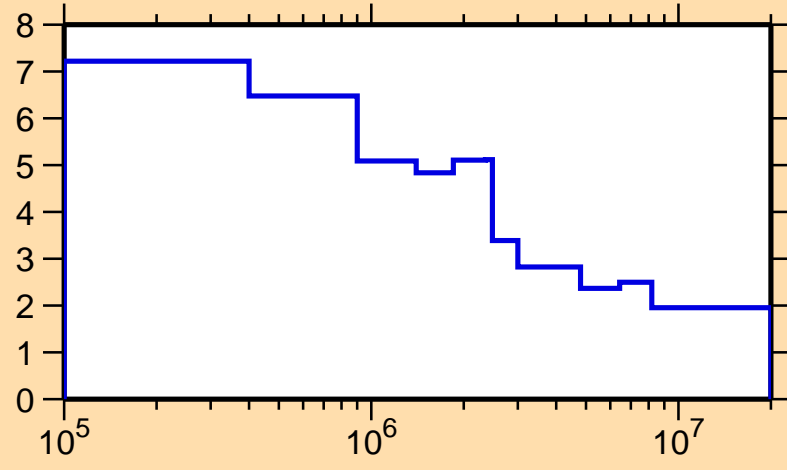

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

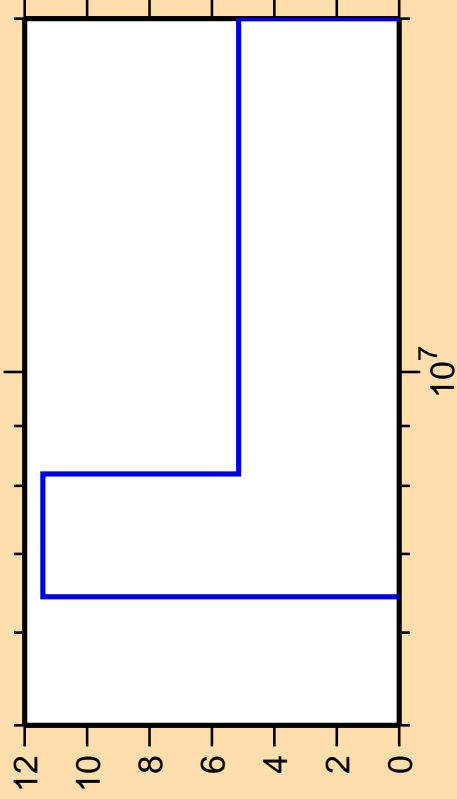

Ordinate scale is %  
relative standard deviation.


Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

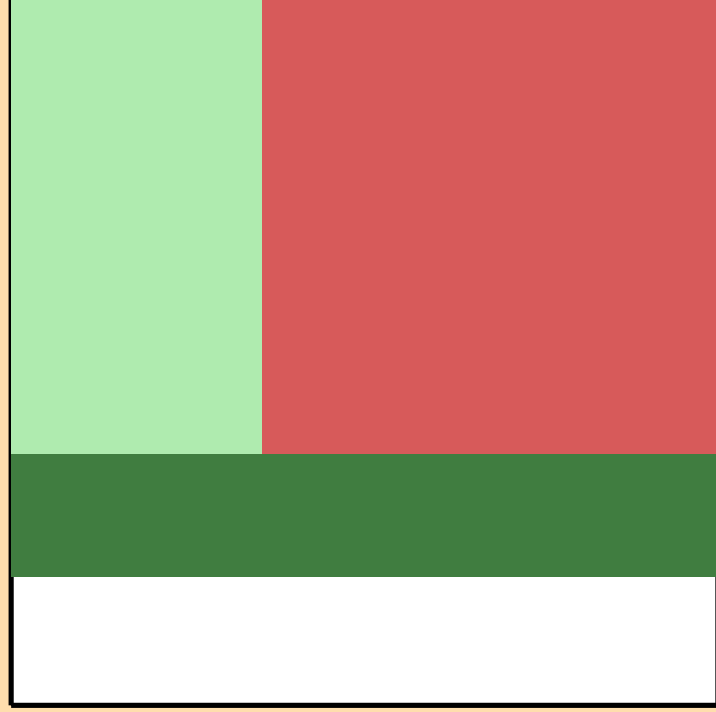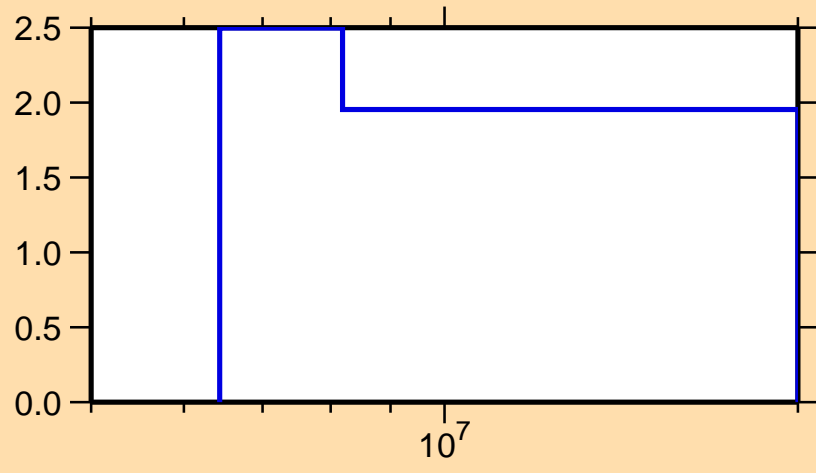

Correlation Matrix





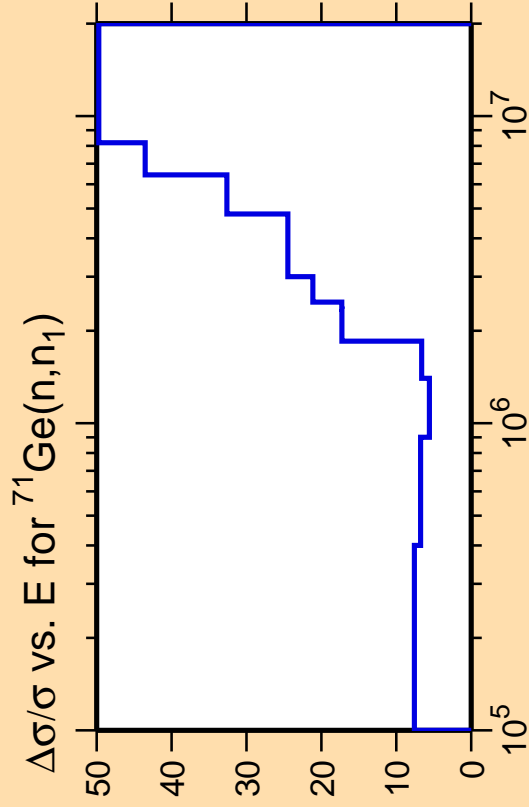

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

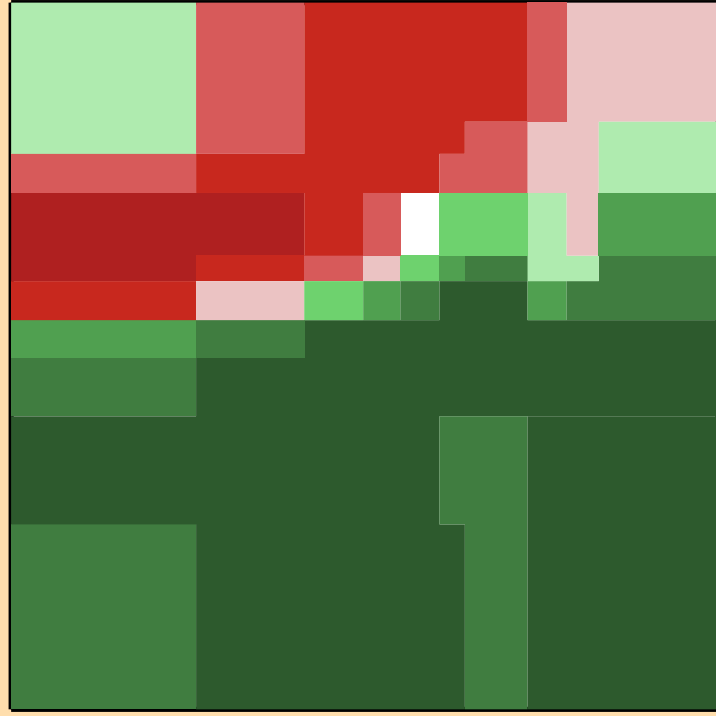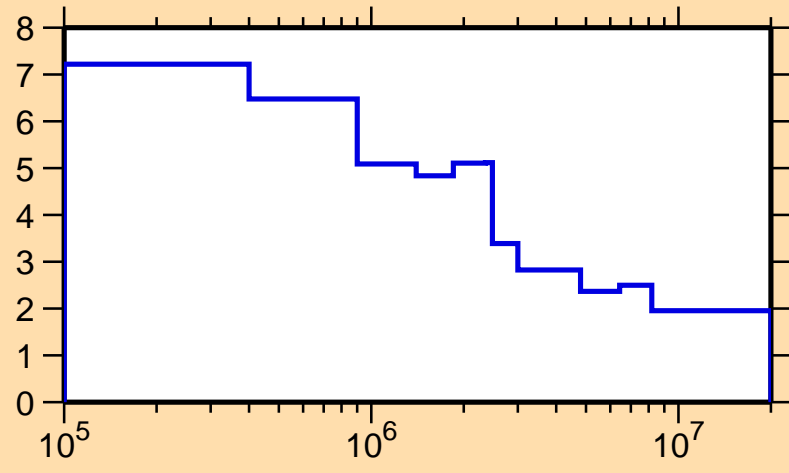

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

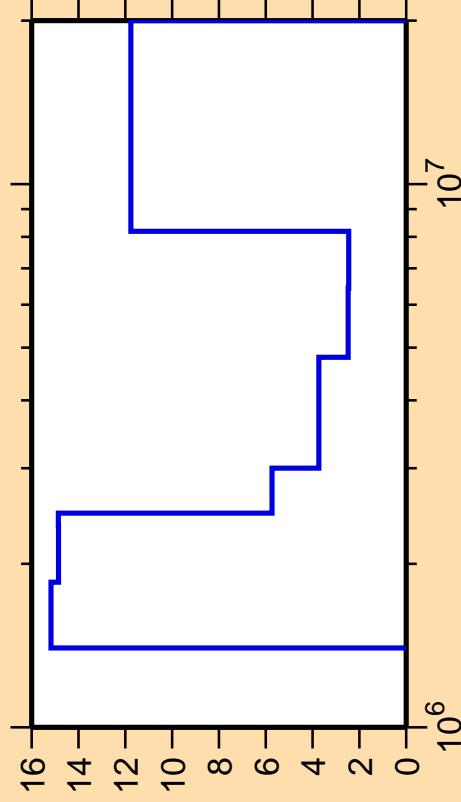

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

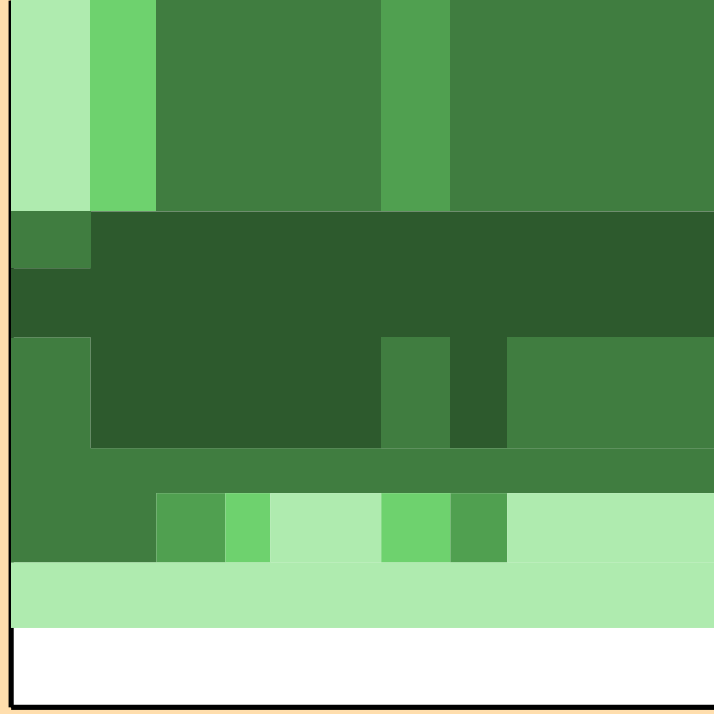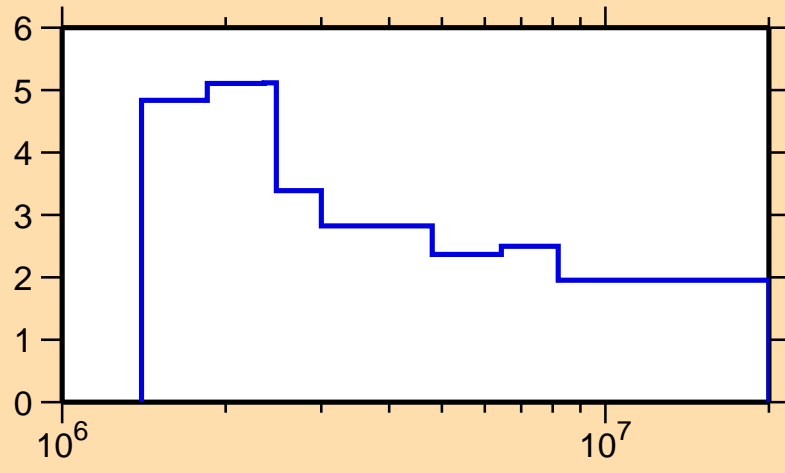

Correlation Matrix







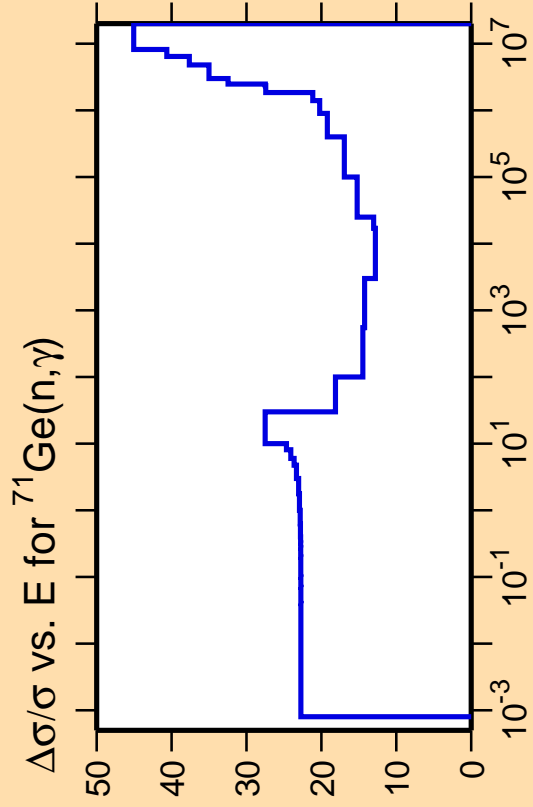



Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

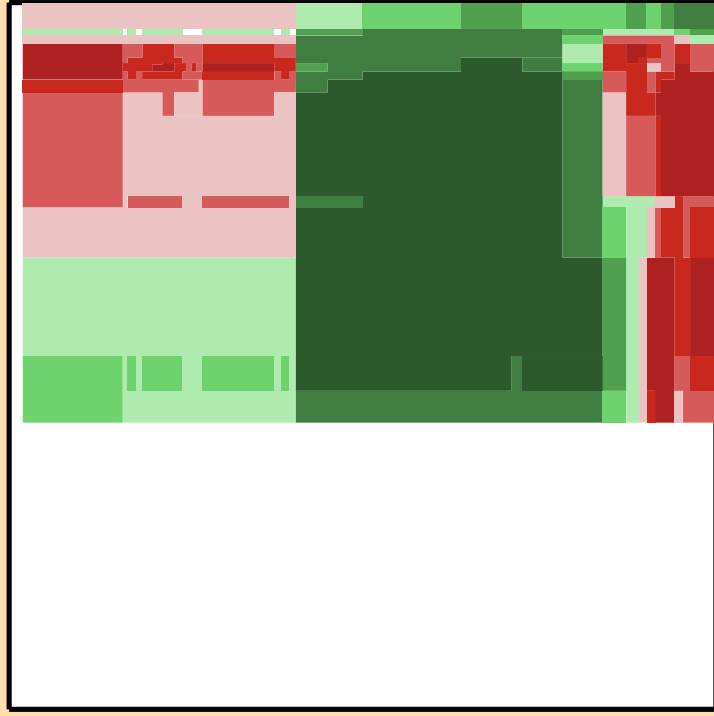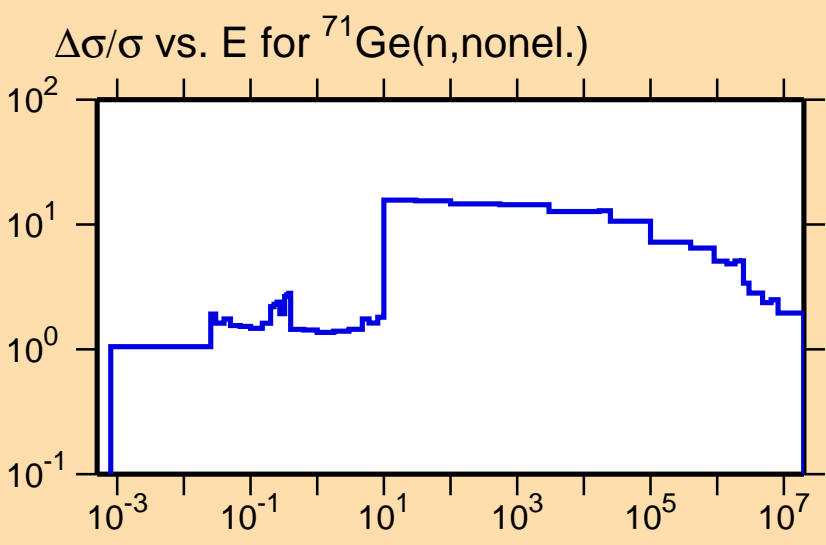

Correlation Matrix

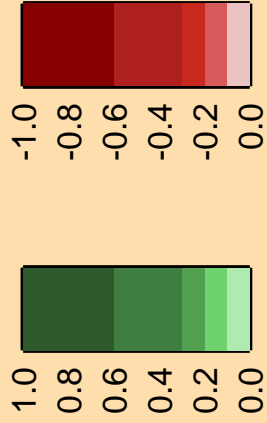

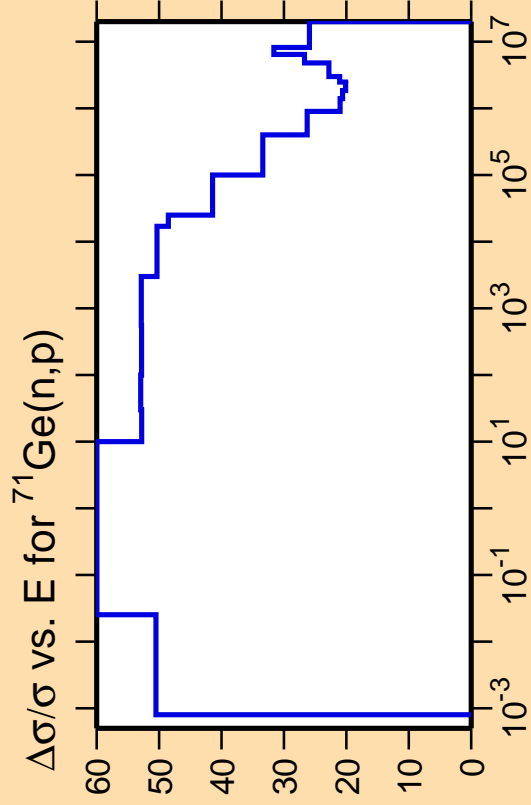


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

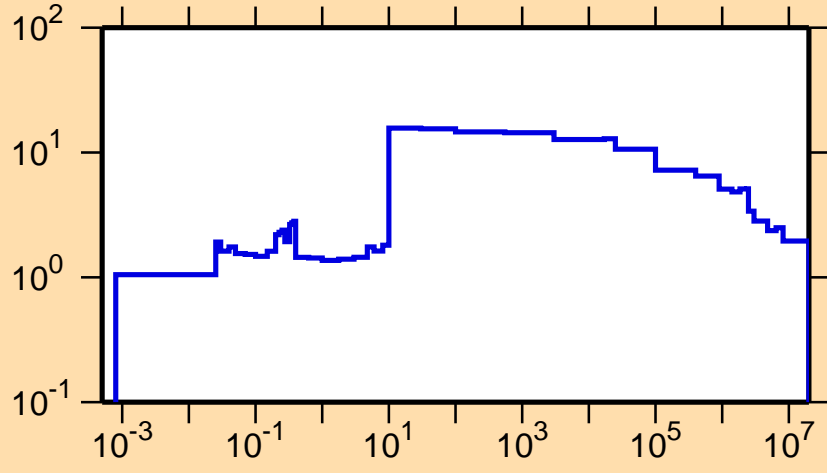

Correlation Matrix




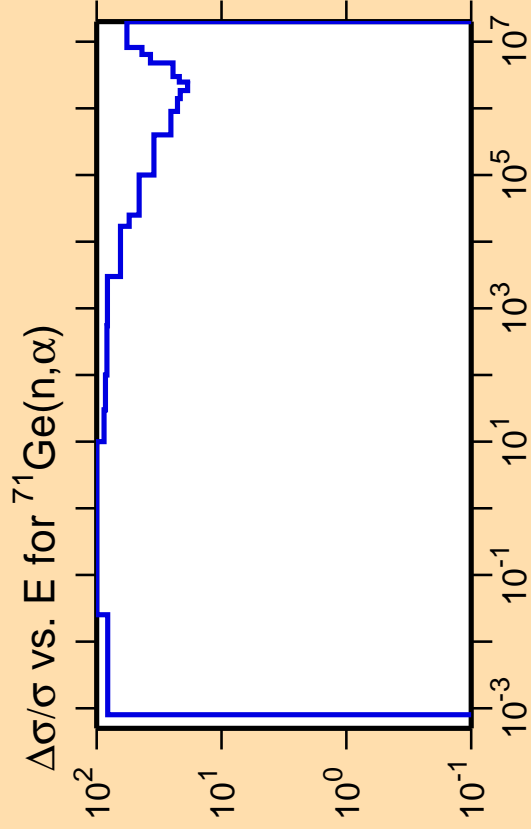


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty  
data were suppressed.


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nonel.})$

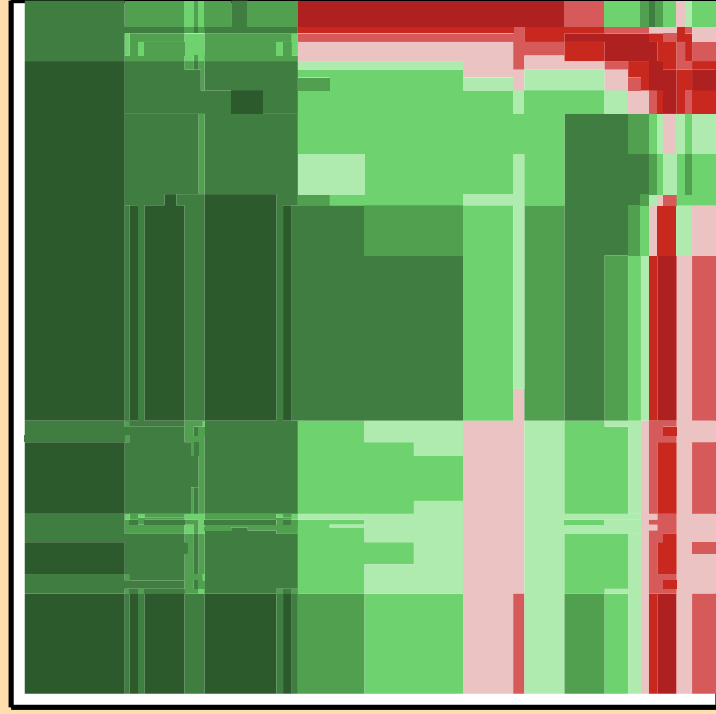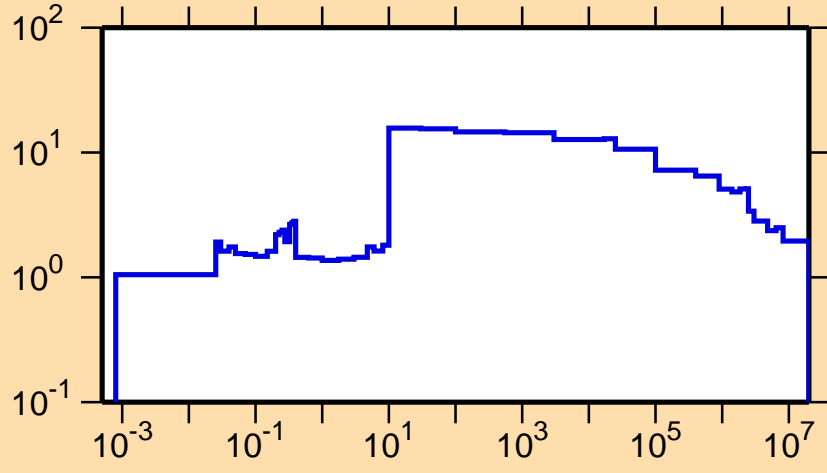

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

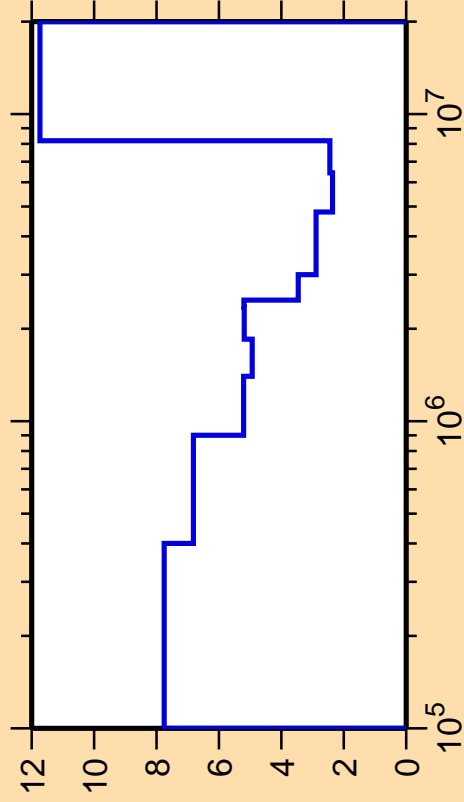

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

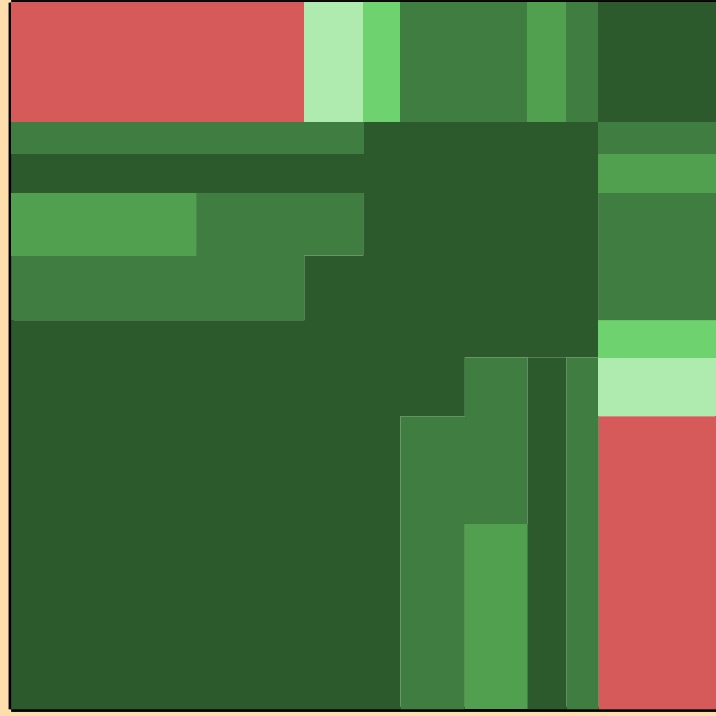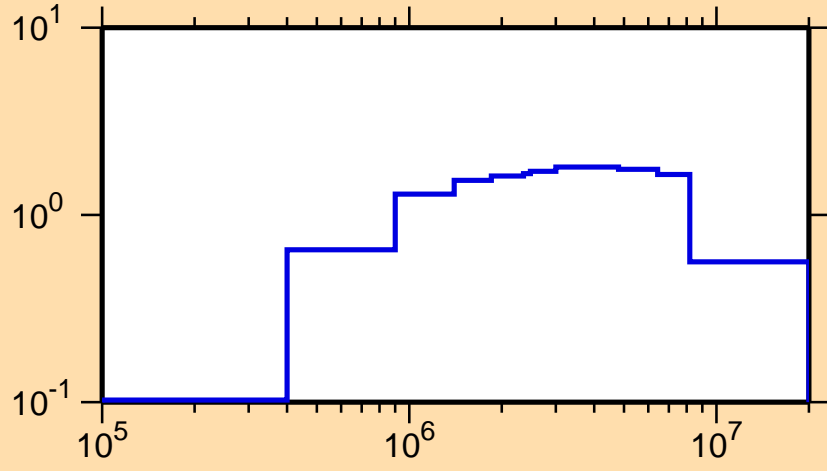

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

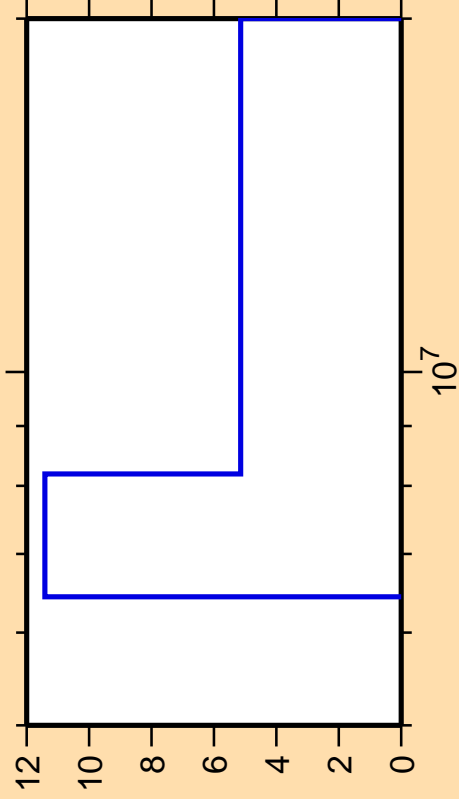

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

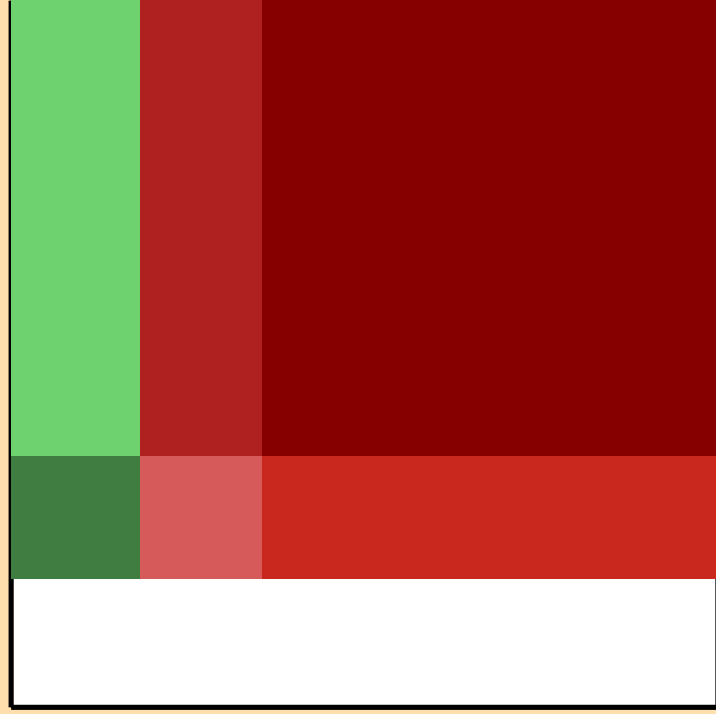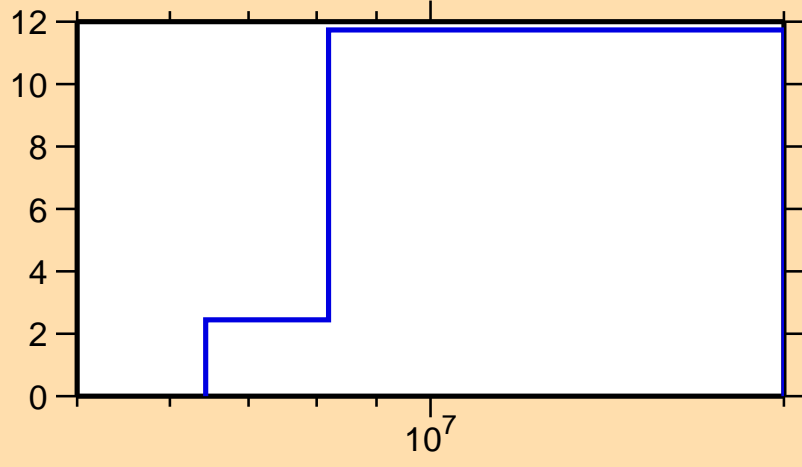

Correlation Matrix





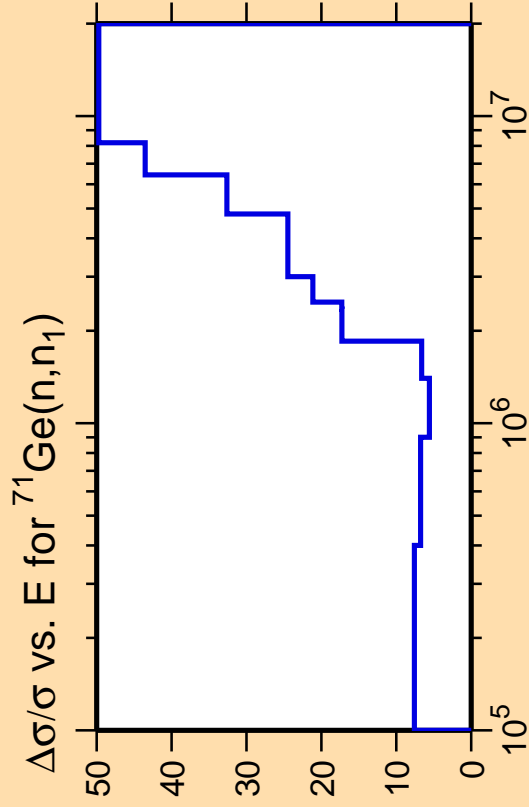

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

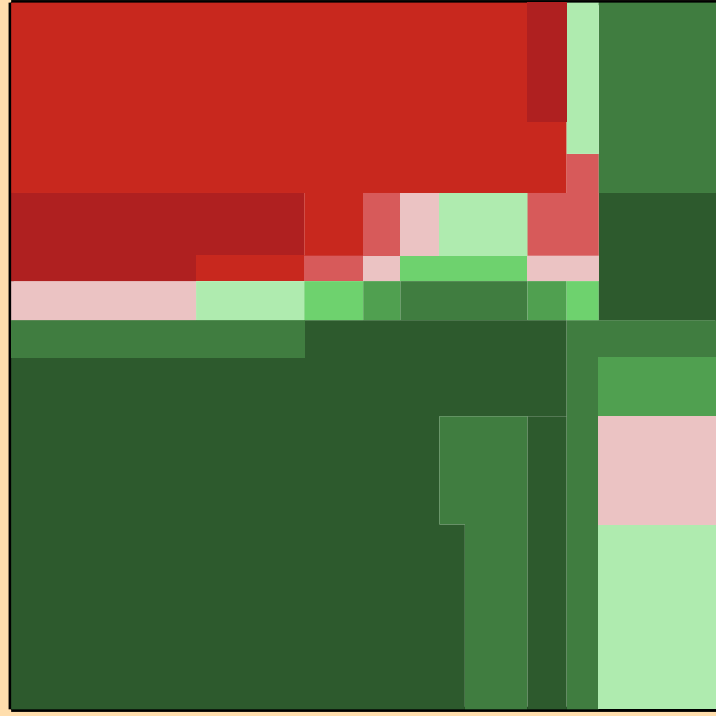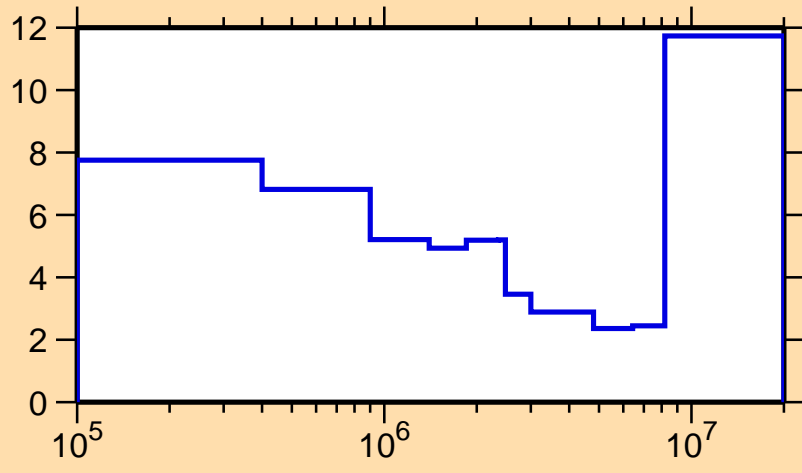

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

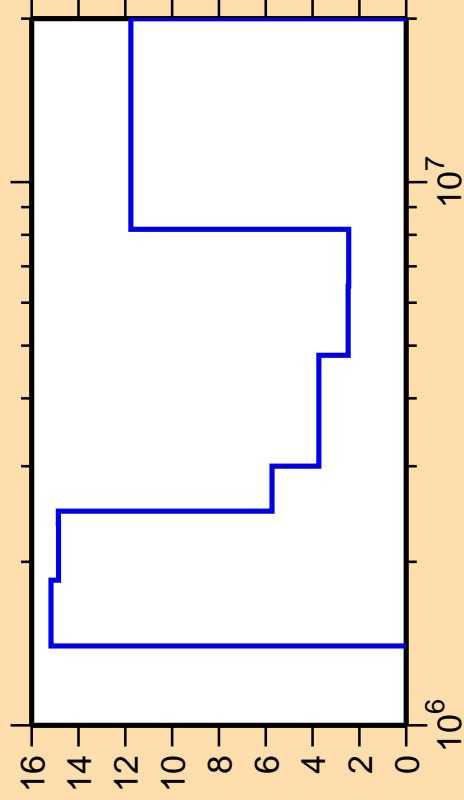

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

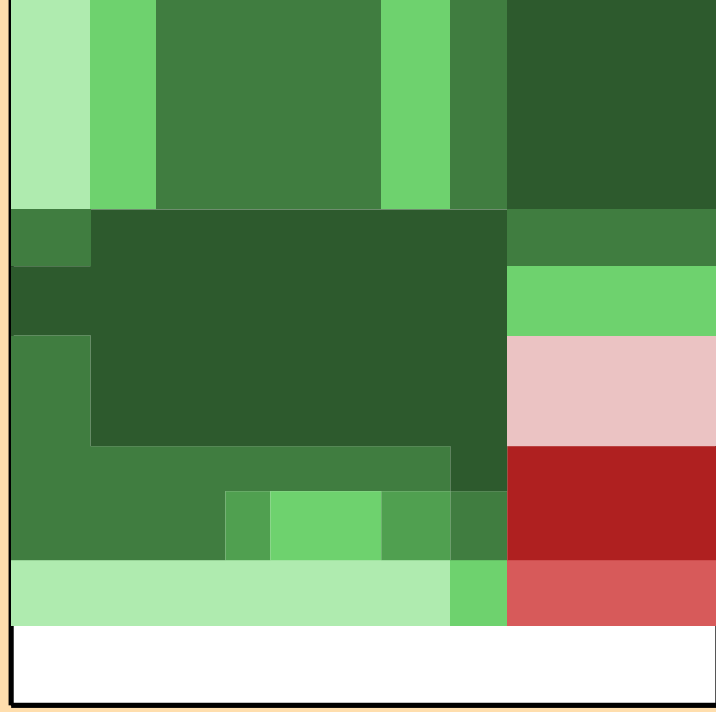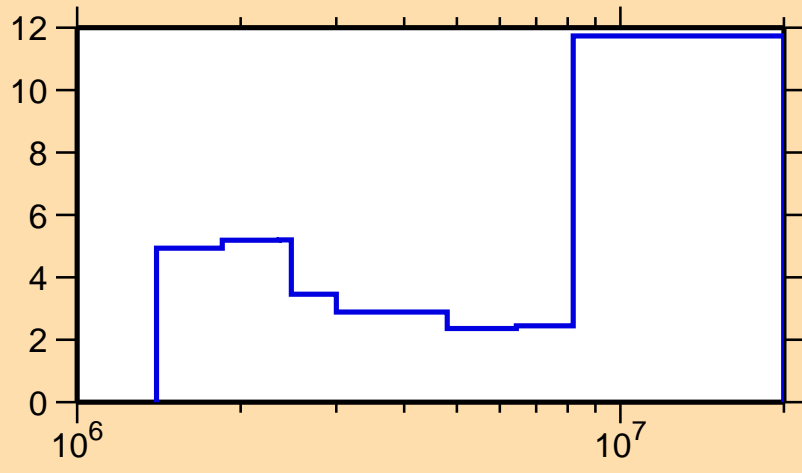

Correlation Matrix





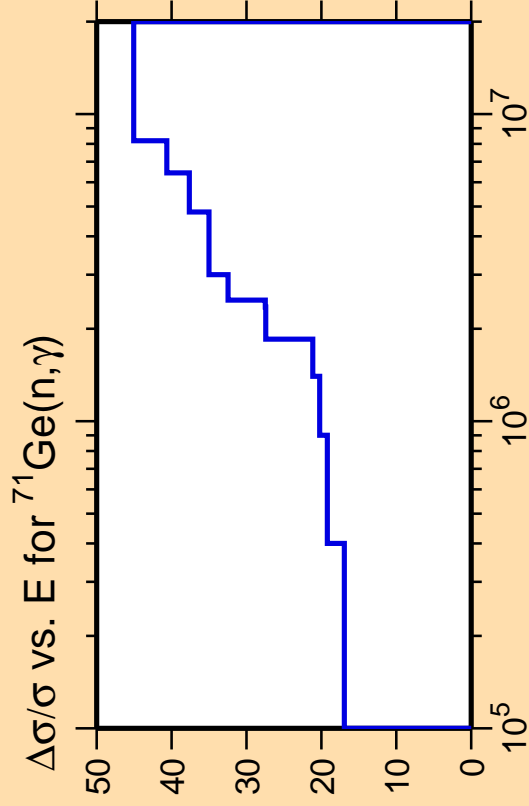

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

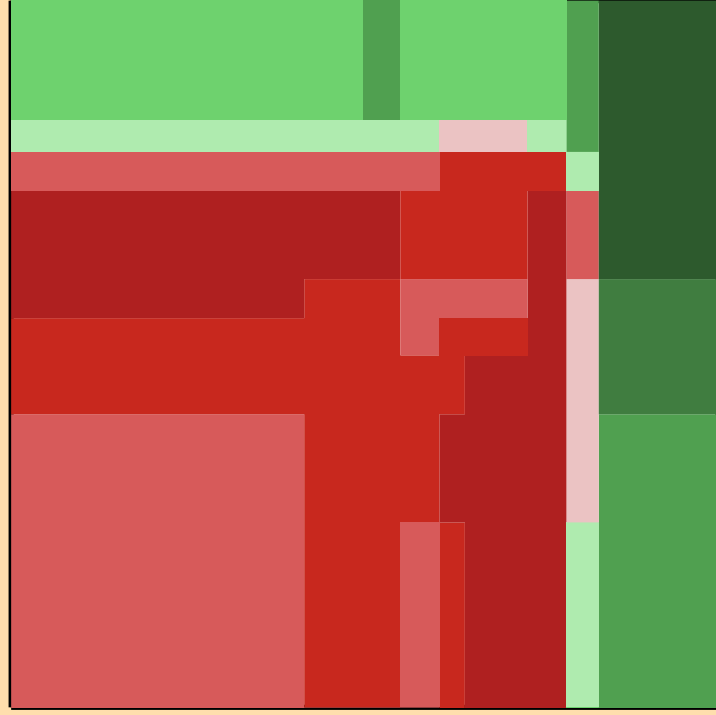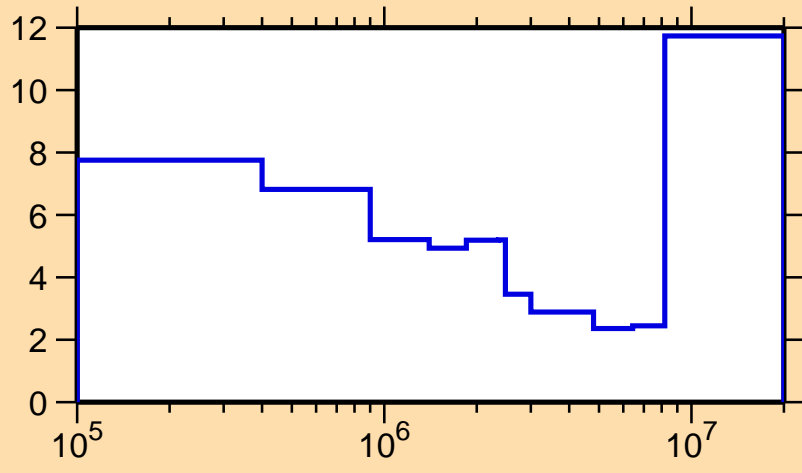

Correlation Matrix







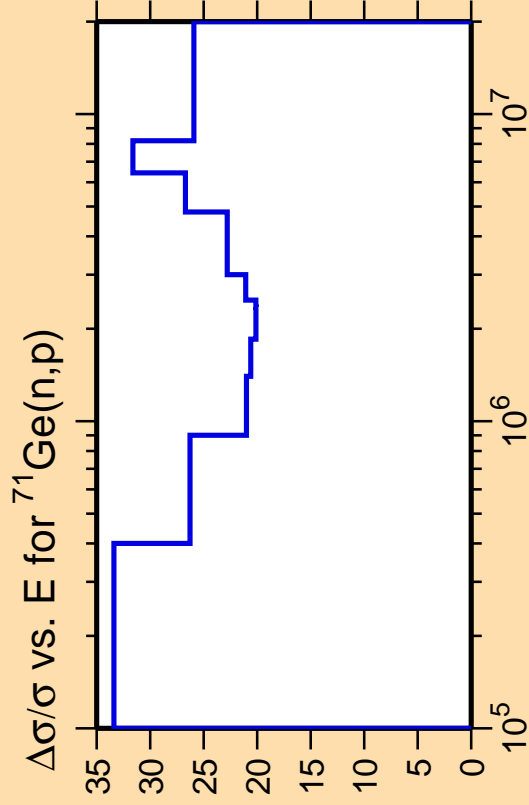

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

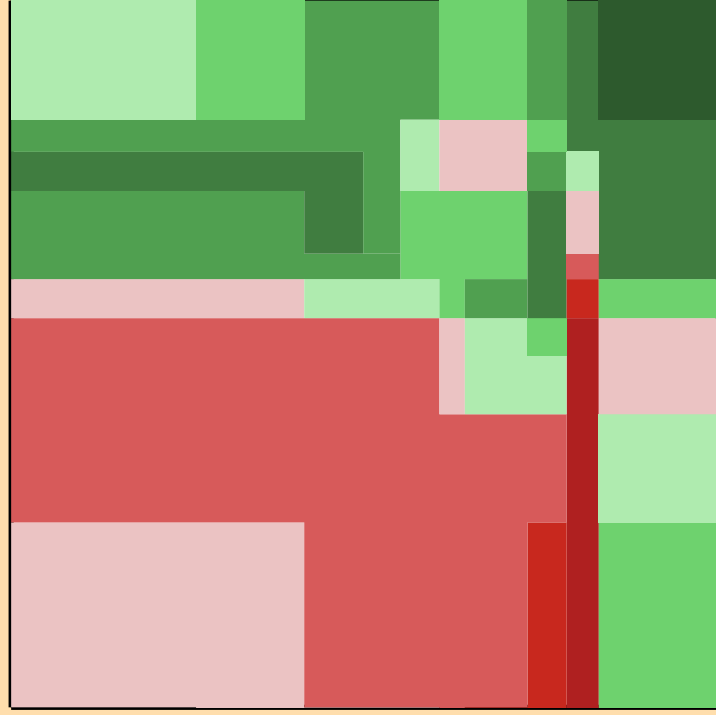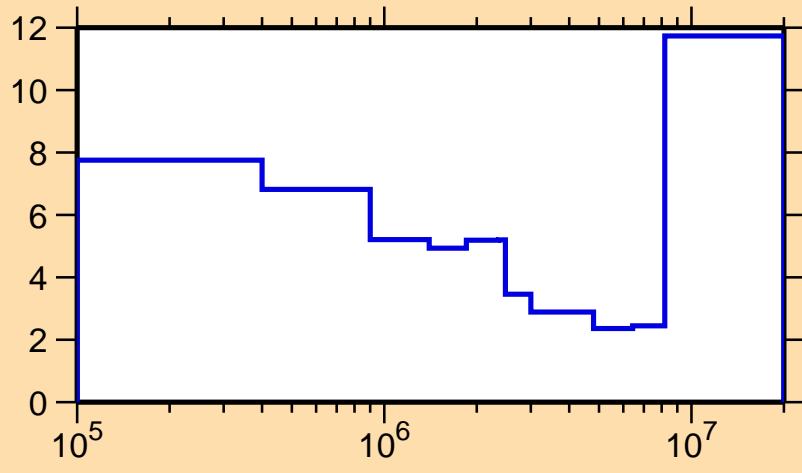

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\alpha)$

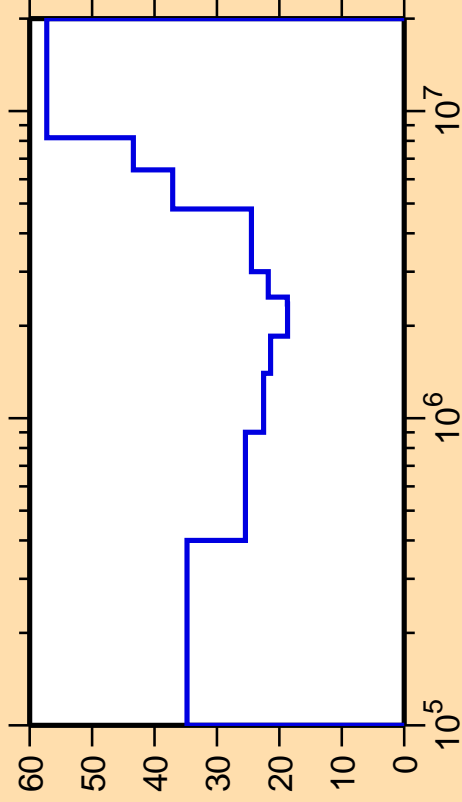

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{inel.})$

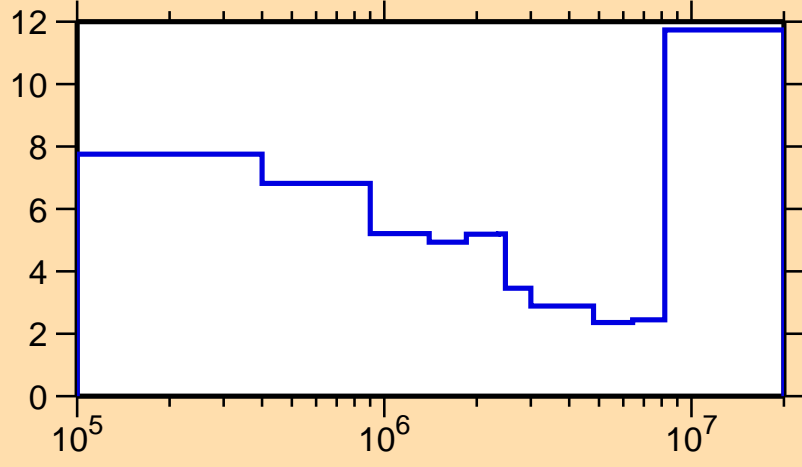

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

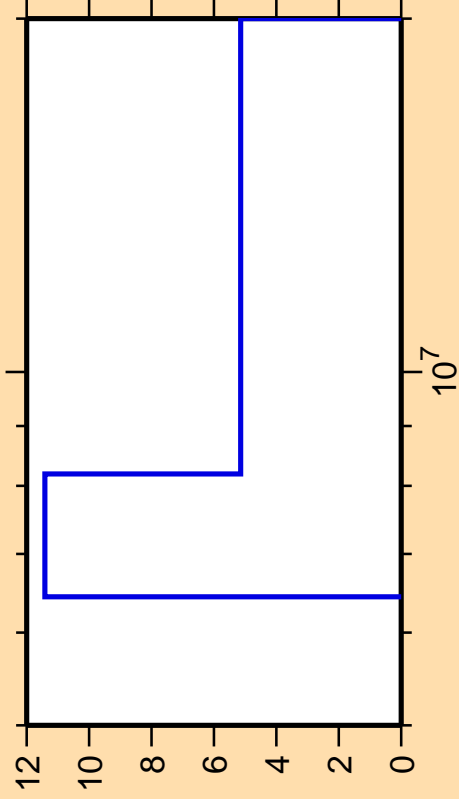

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

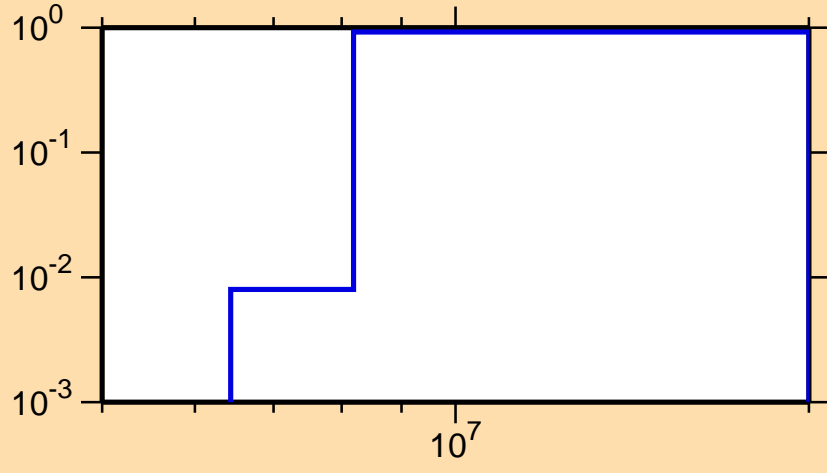

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n_1)$

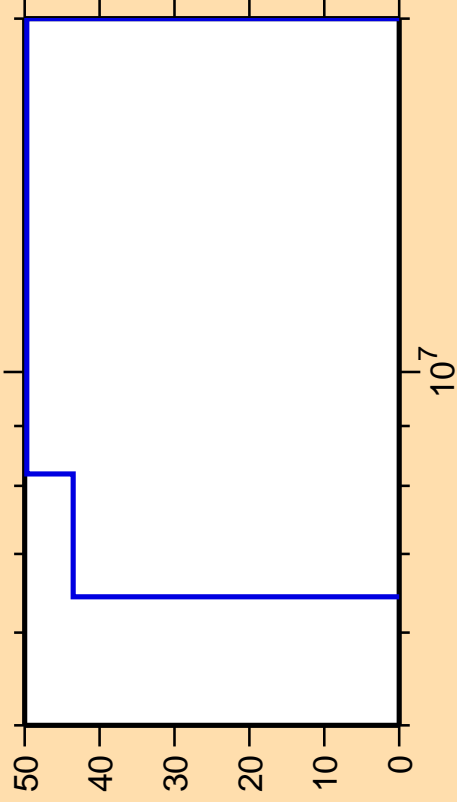

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

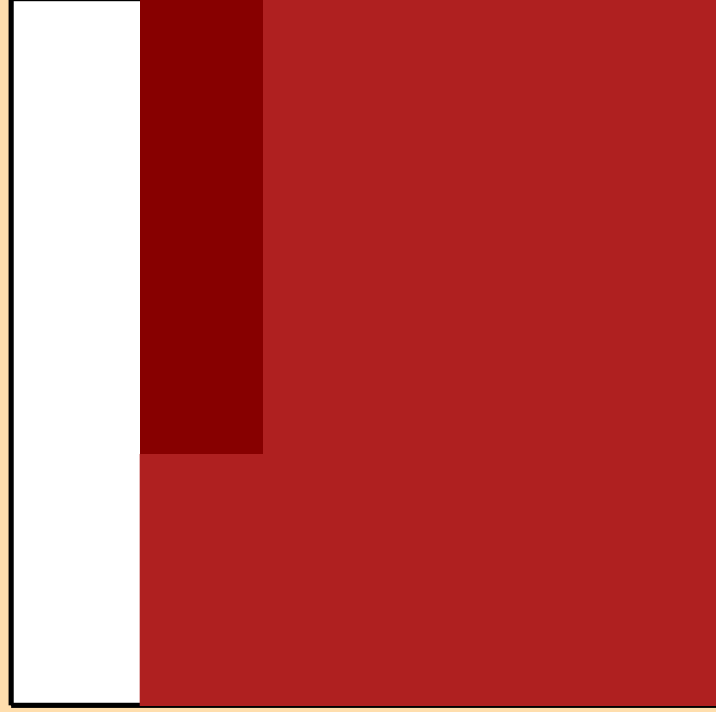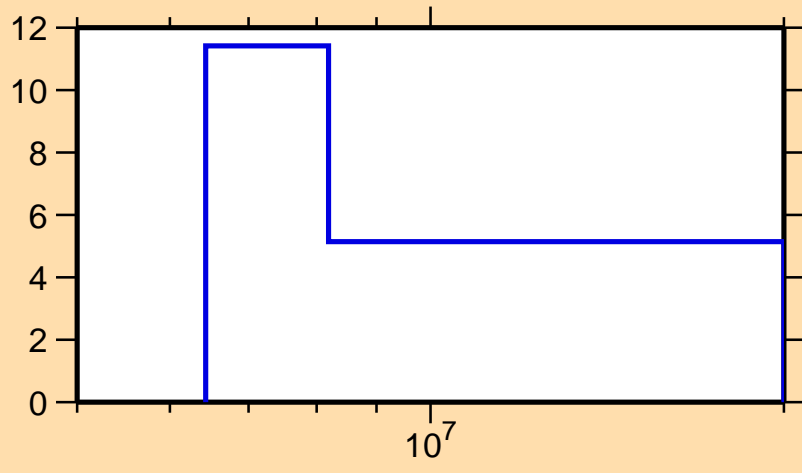

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

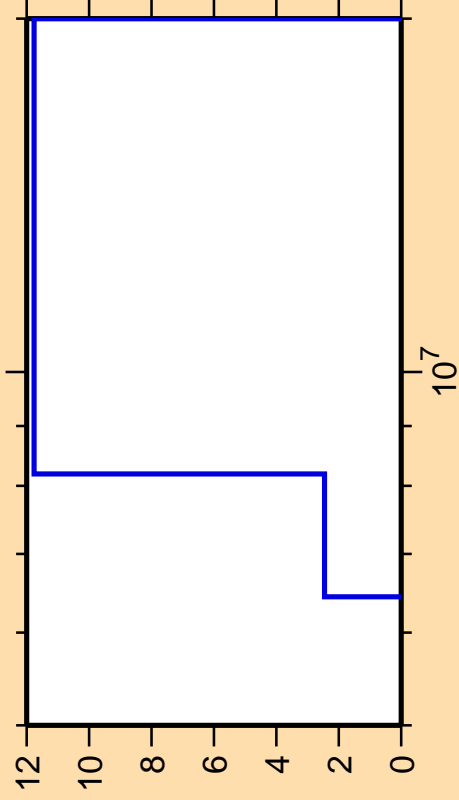

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

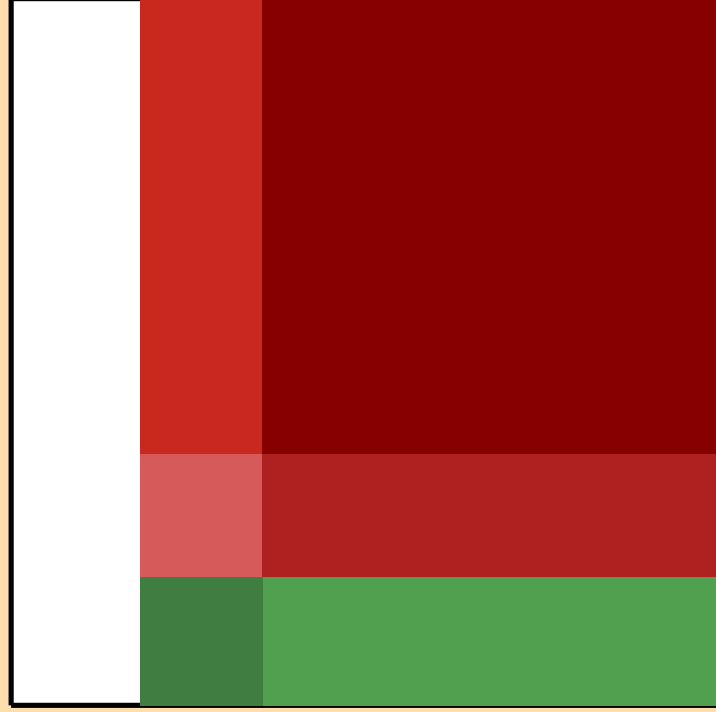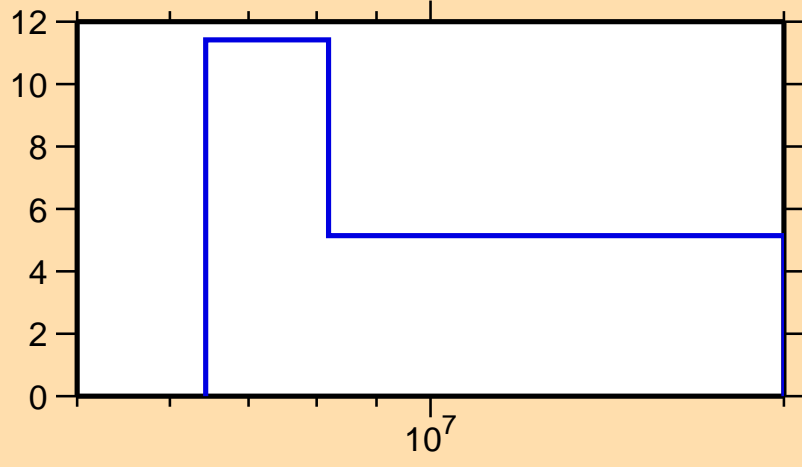

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\gamma)$

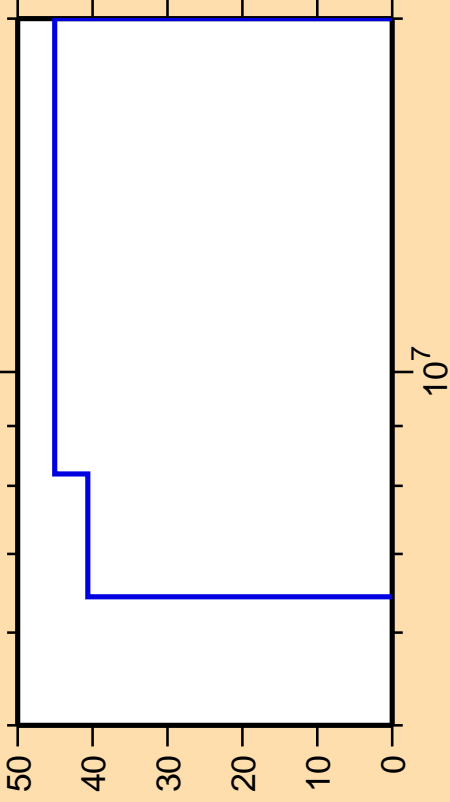

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

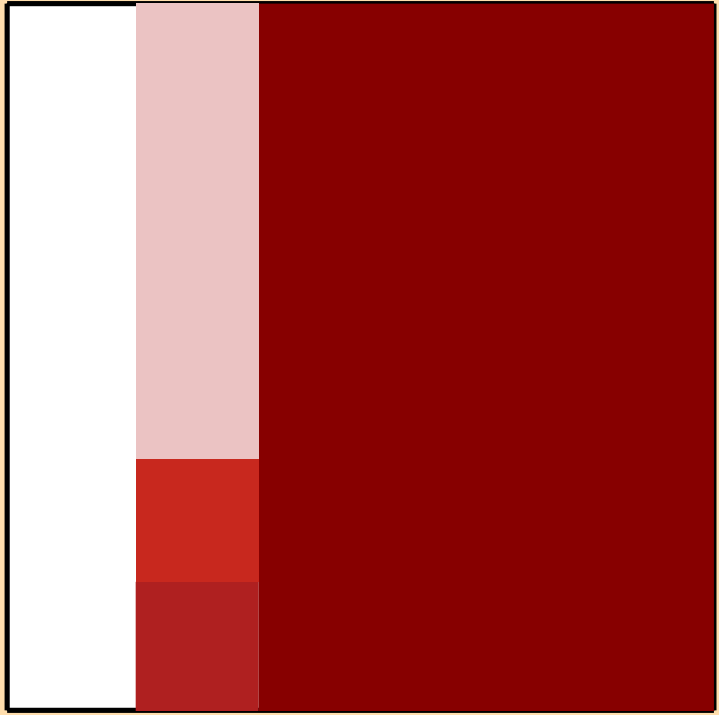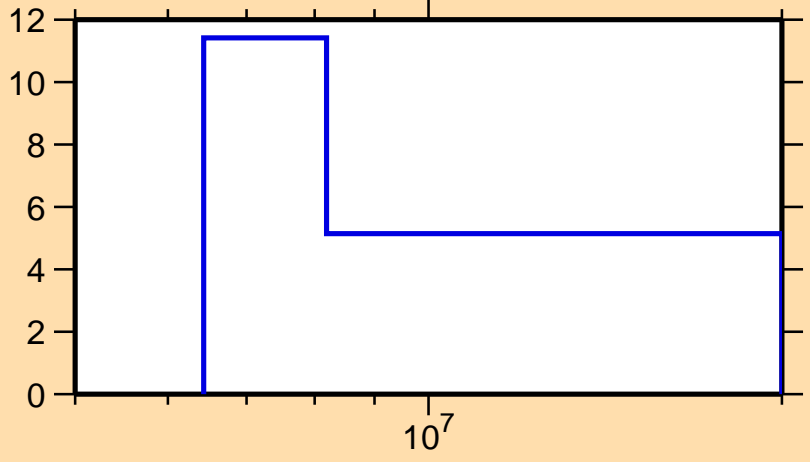

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,p)$

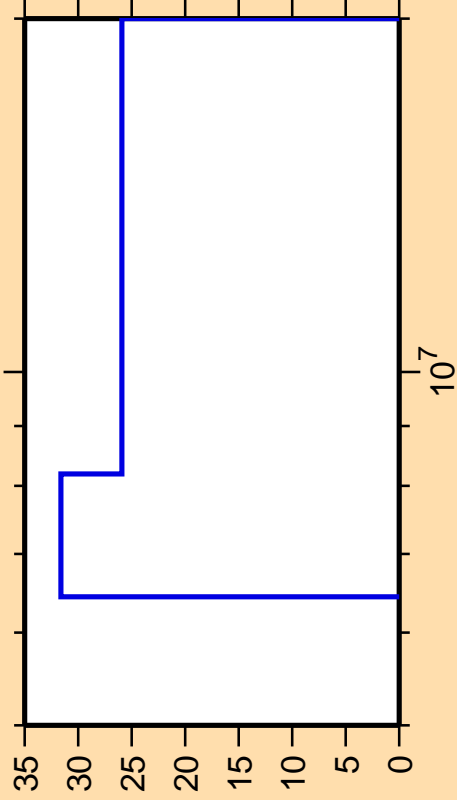

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

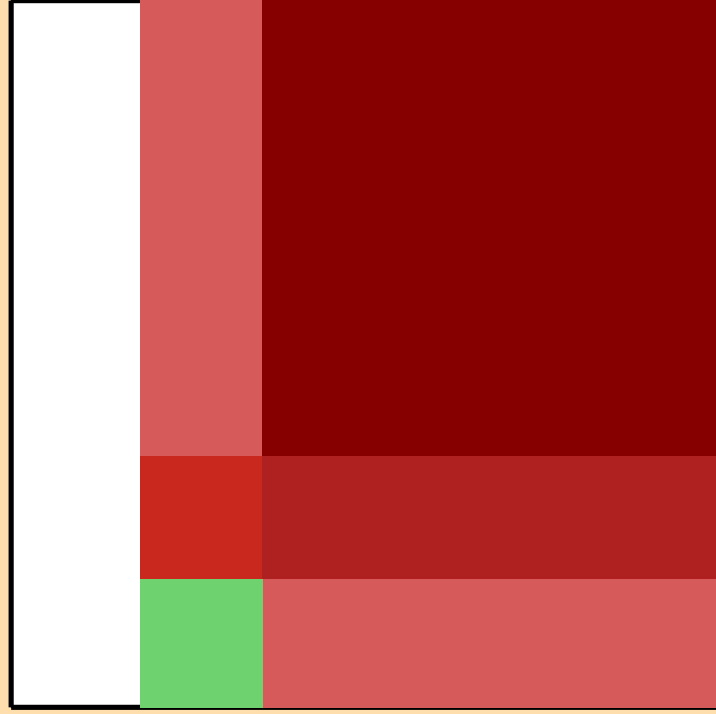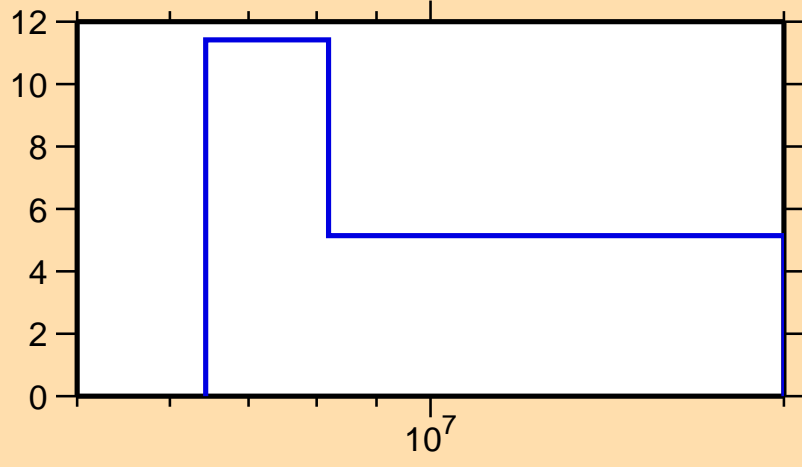

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\alpha)$

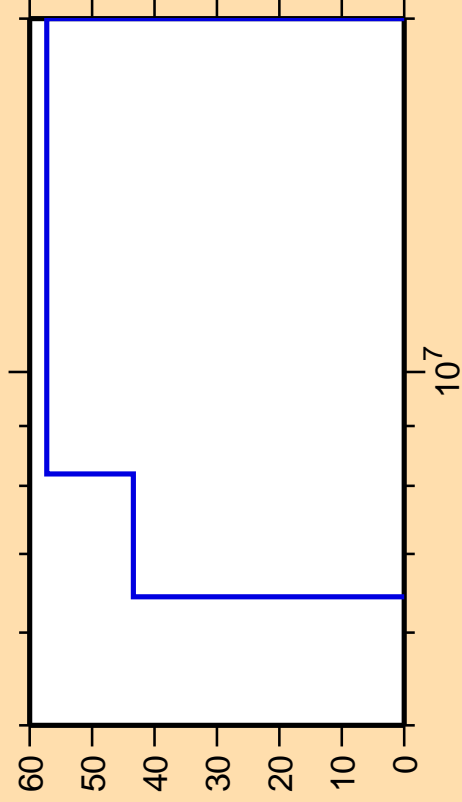

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n)$

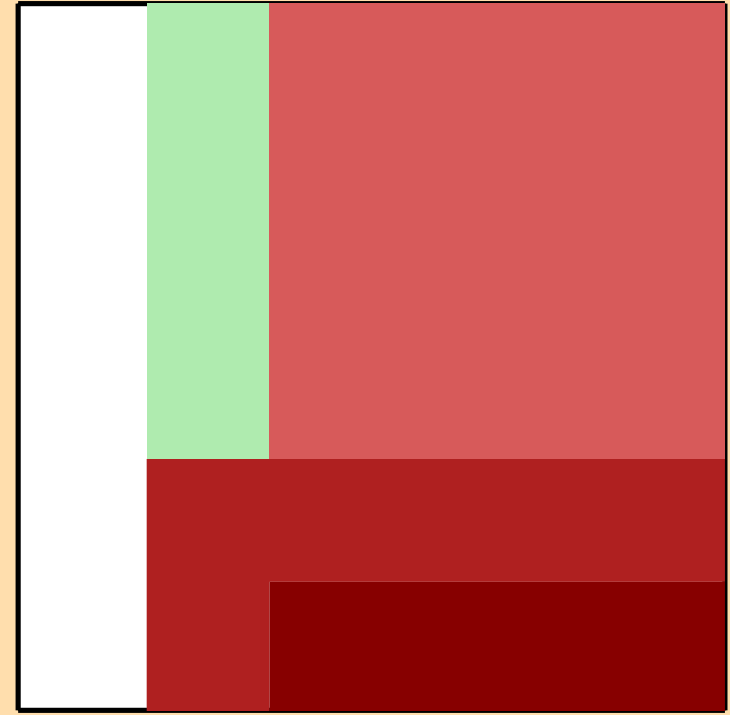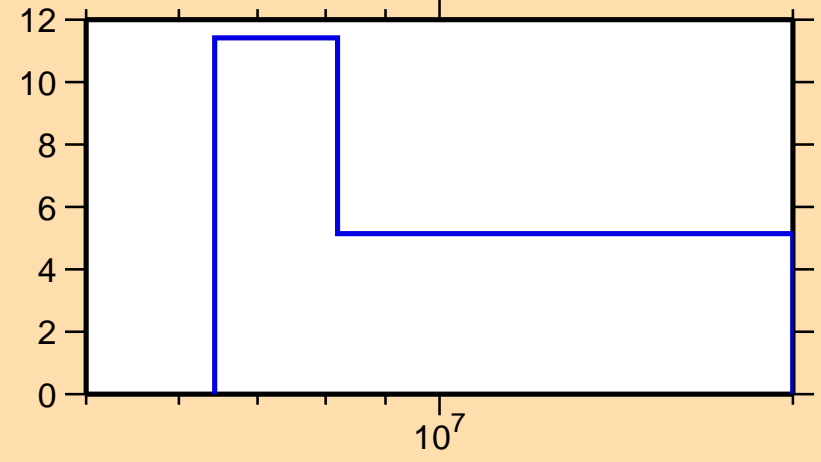


Correlation Matrix






$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,3n)$

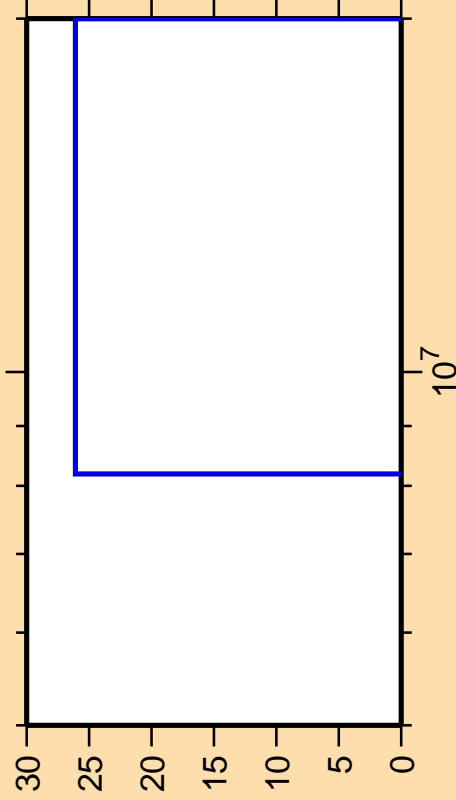

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,3n)$

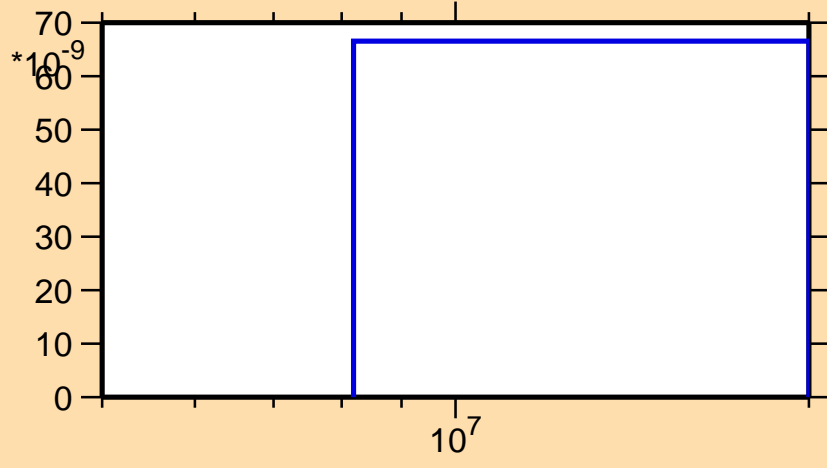

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\alpha)$

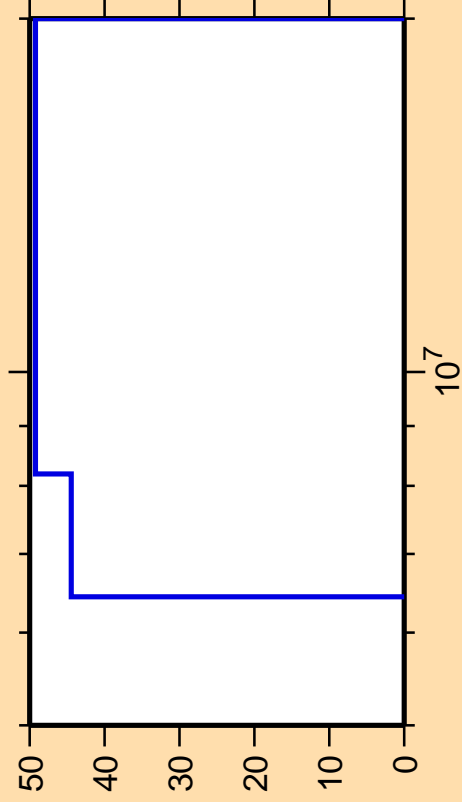

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,n\alpha)$

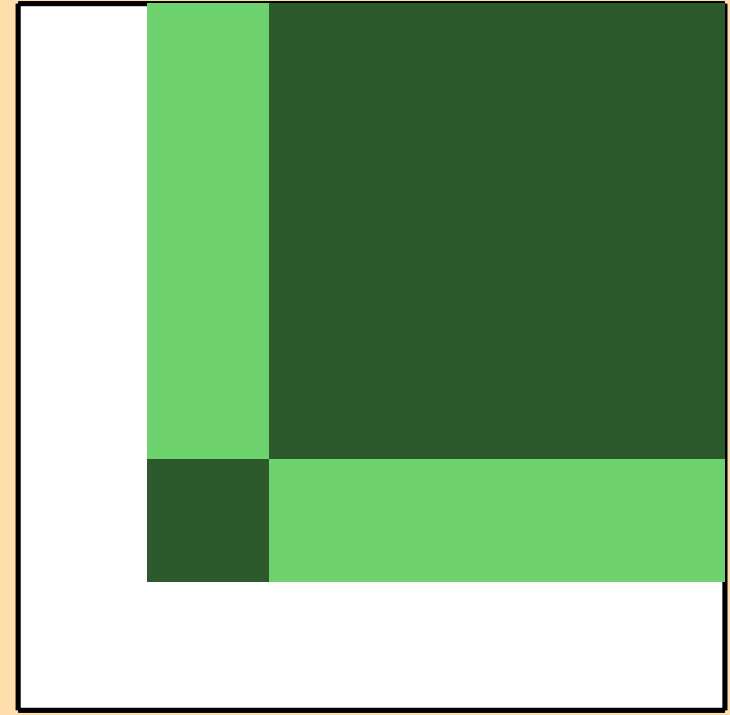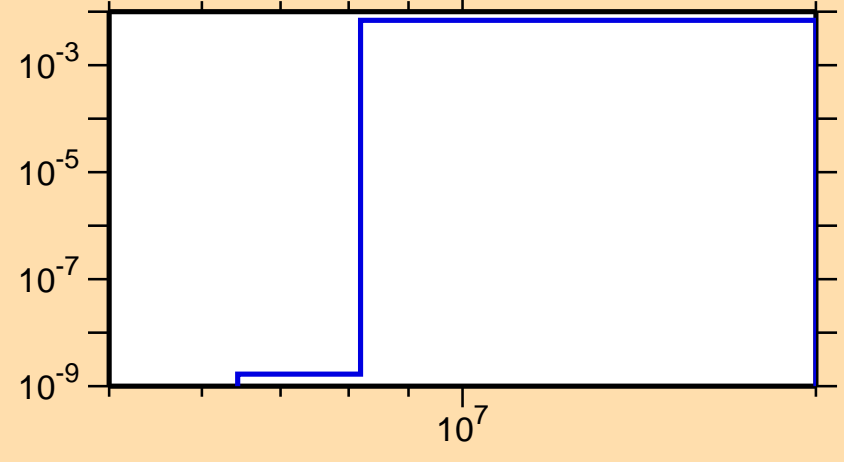

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2n\alpha)$

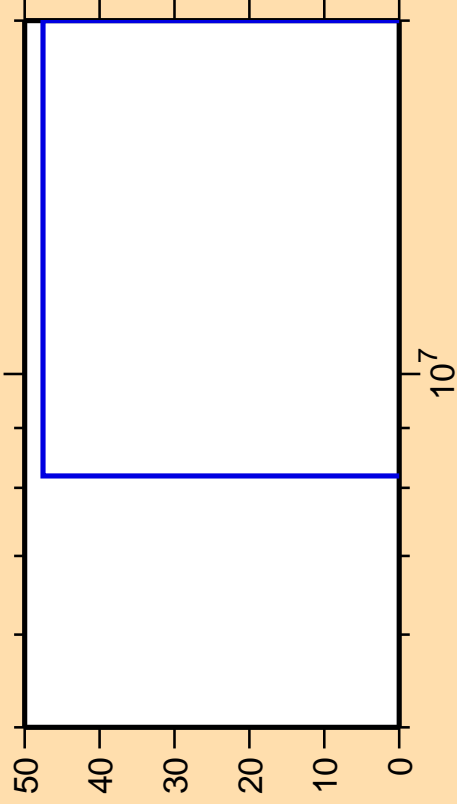

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{71}\text{Ge}(n,2n\alpha)$

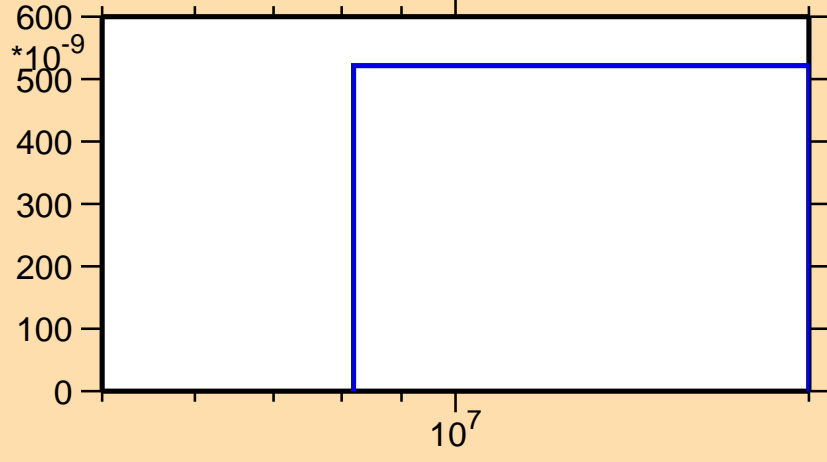

600  
500  
400  
300  
200  
100  
0


$10^7$



Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,np)$

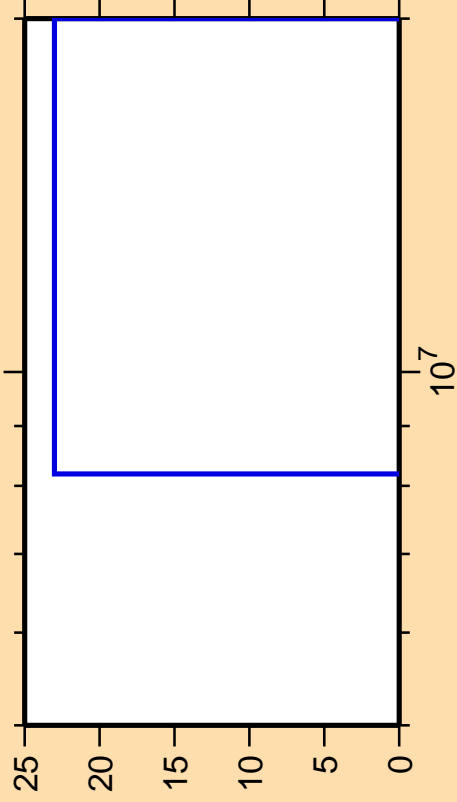

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,np)$

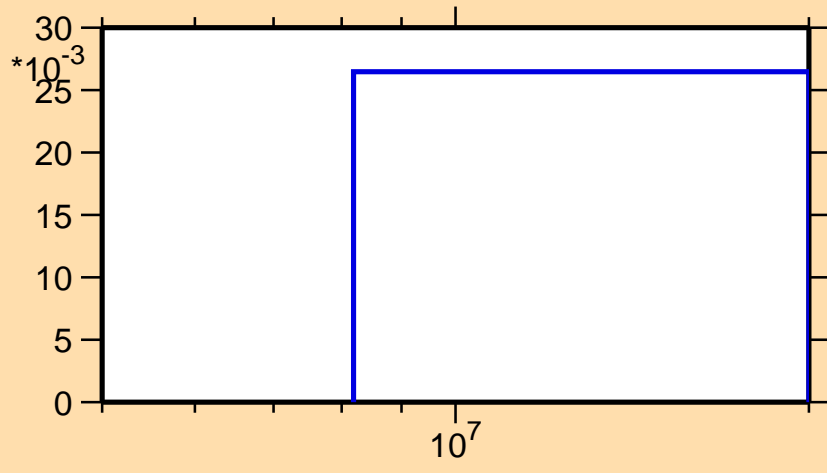

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nd})$

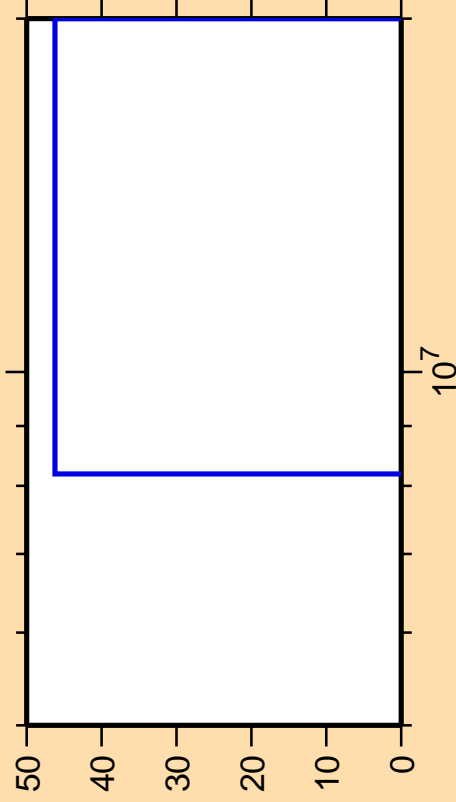

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{nd})$

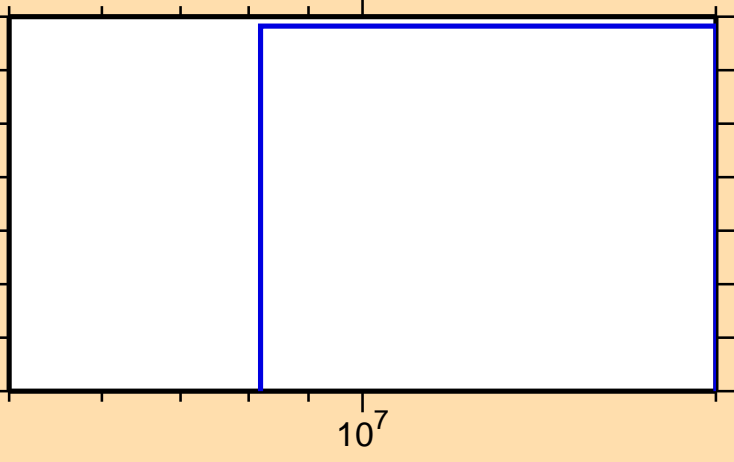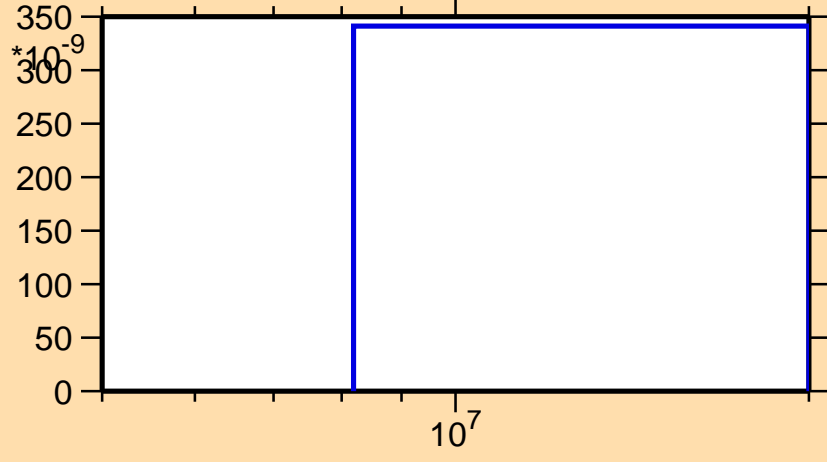

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,nt)$

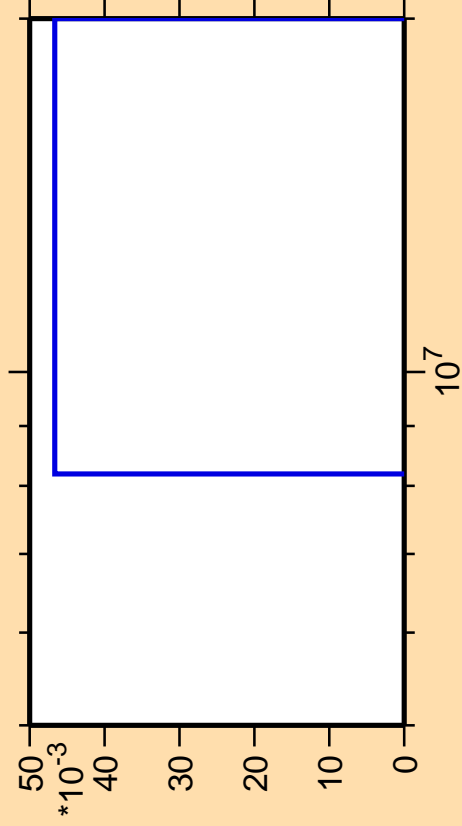

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,nt)$

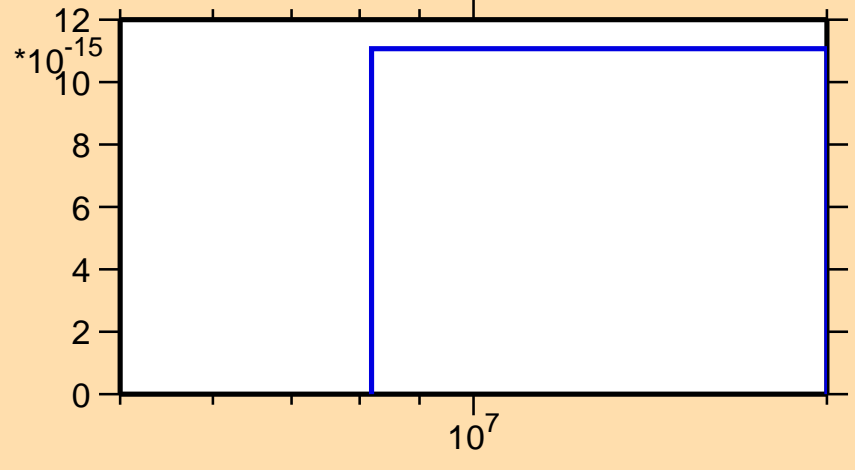

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}$ (mt 34)

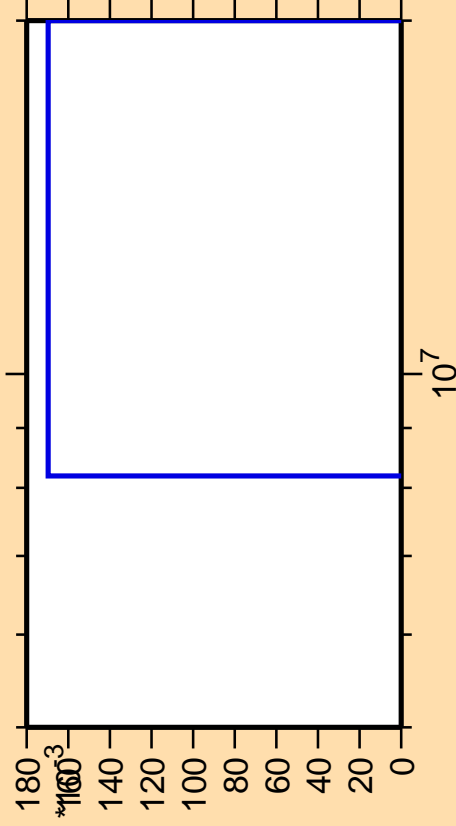

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}$ (mt 34)

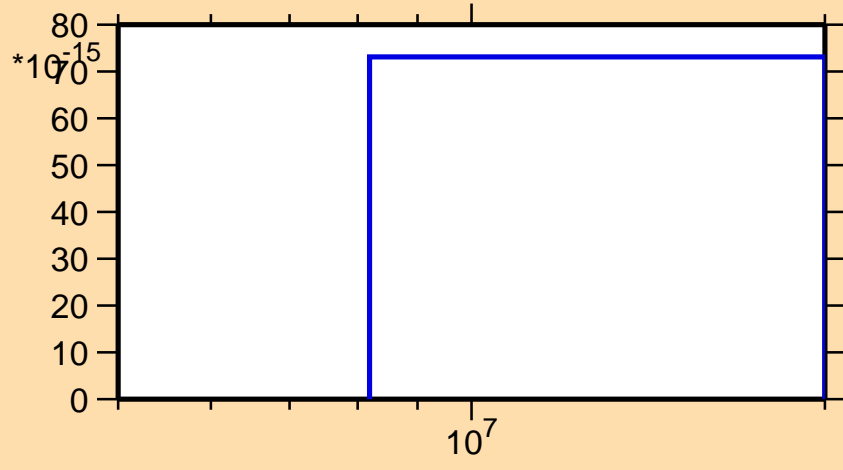

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,2np)$

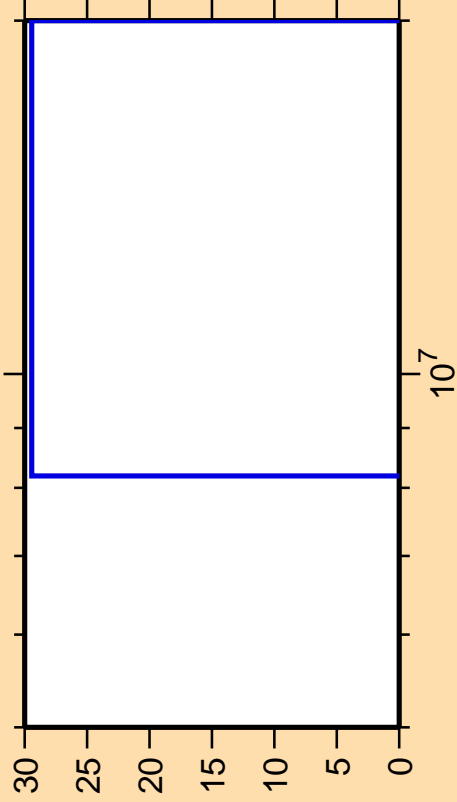

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{71}\text{Ge}(n,2np)$

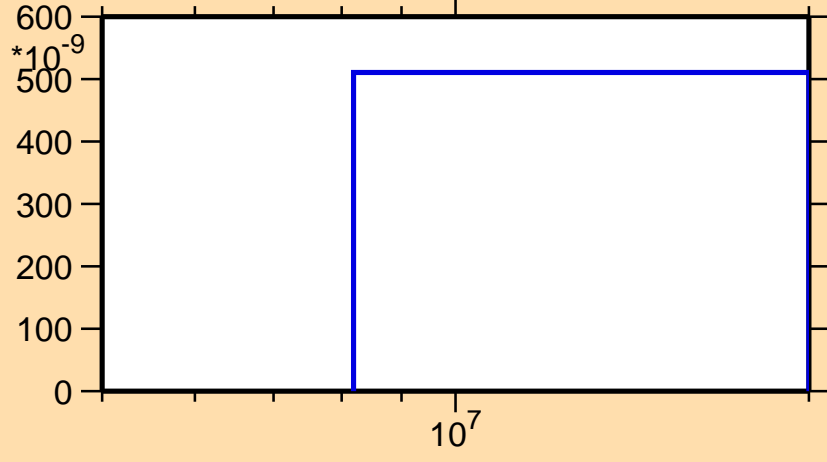

600  
500  
400  
300  
200  
100  
0


$10^7$



Correlation Matrix







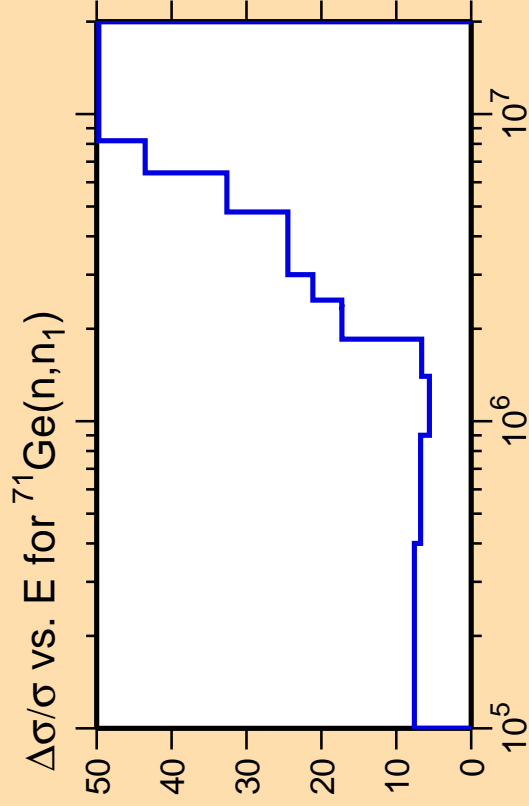


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

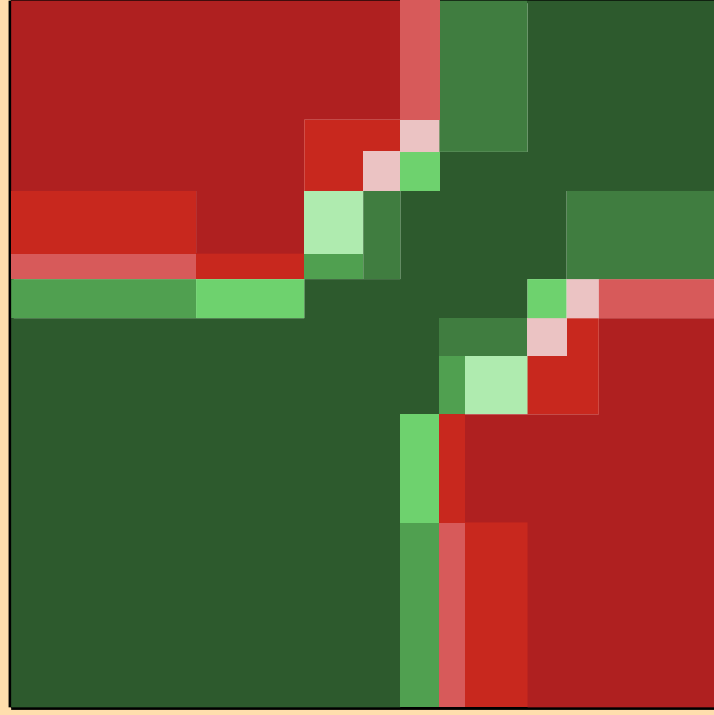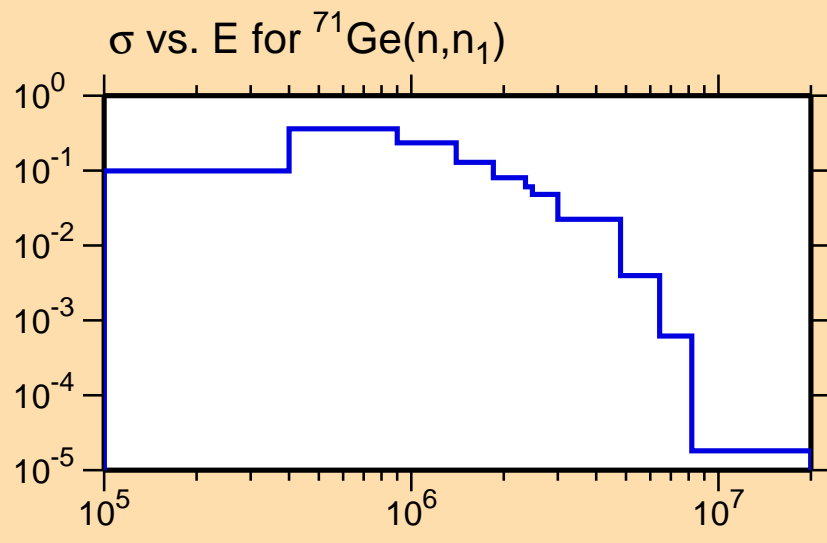



Correlation Matrix



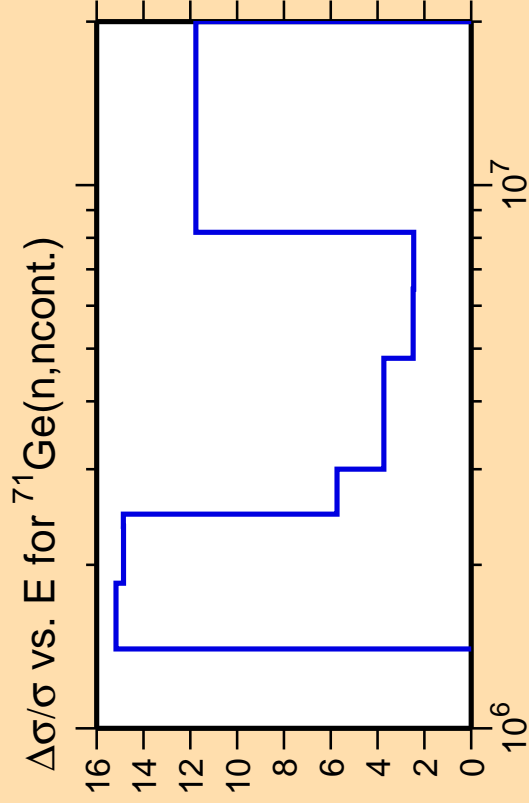


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

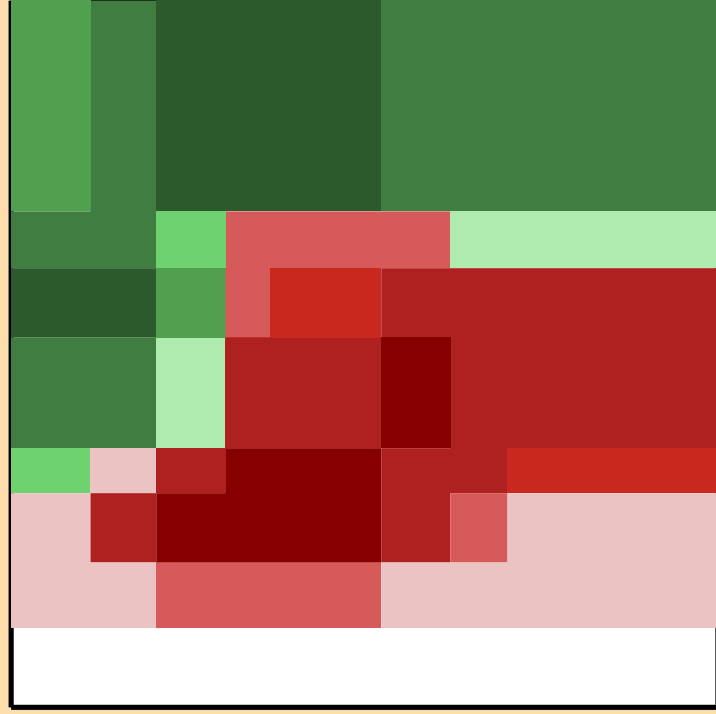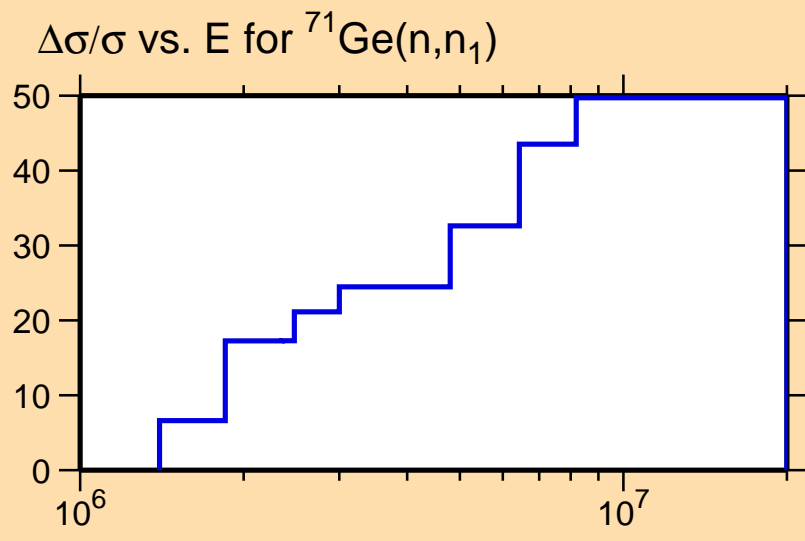

Correlation Matrix




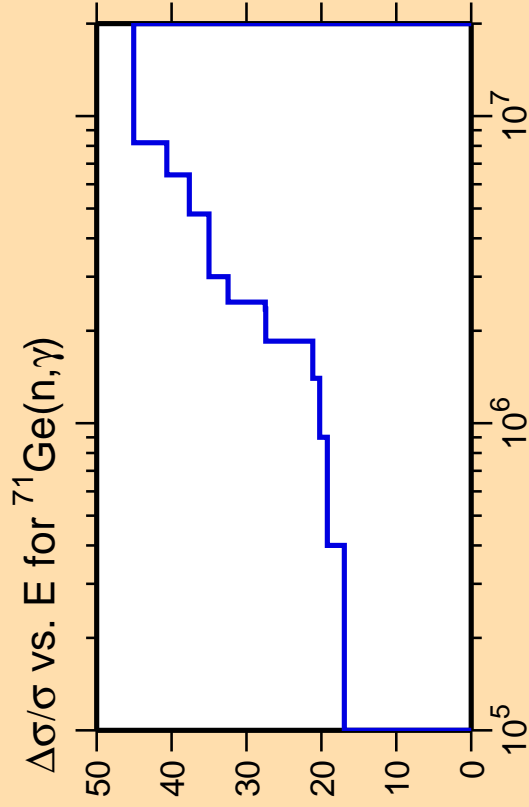

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n_1)$

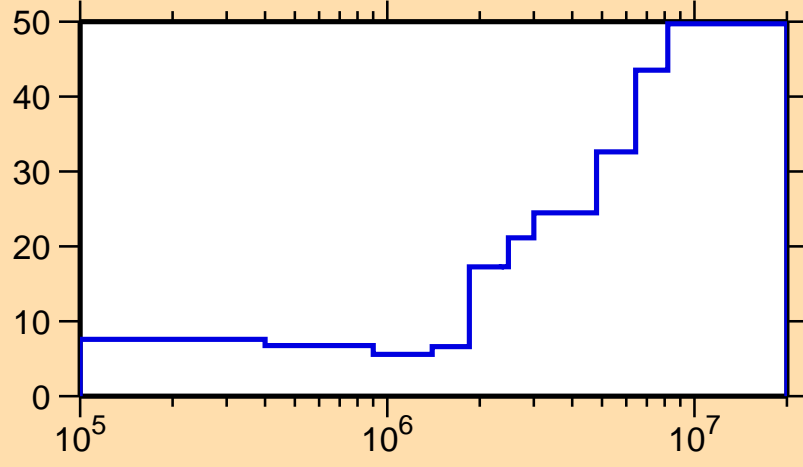



Correlation Matrix



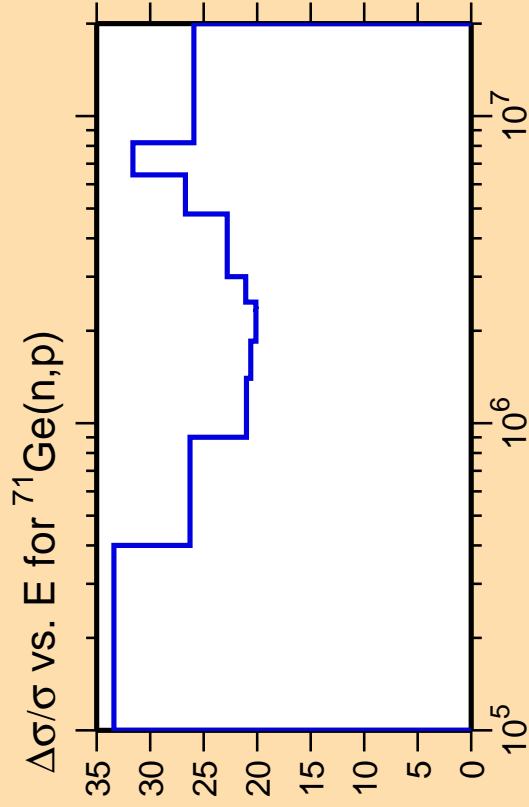


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).

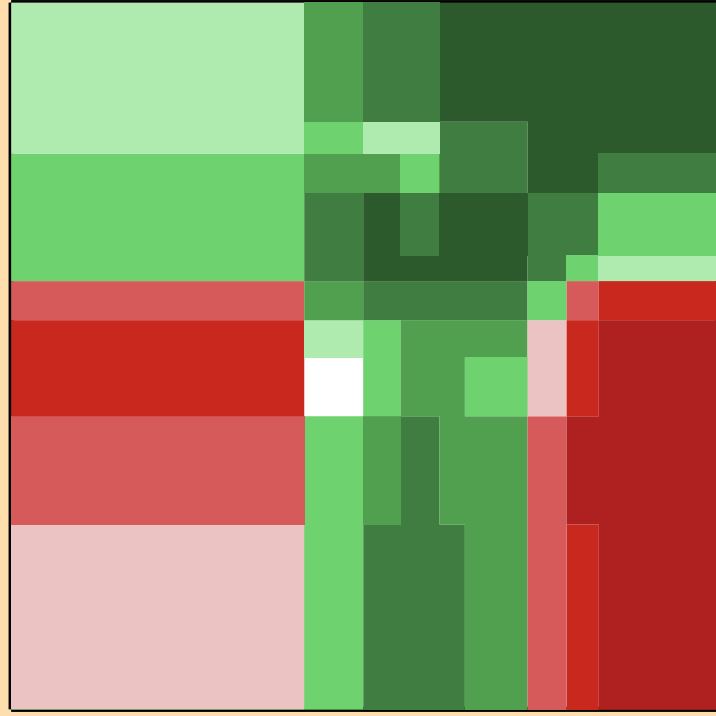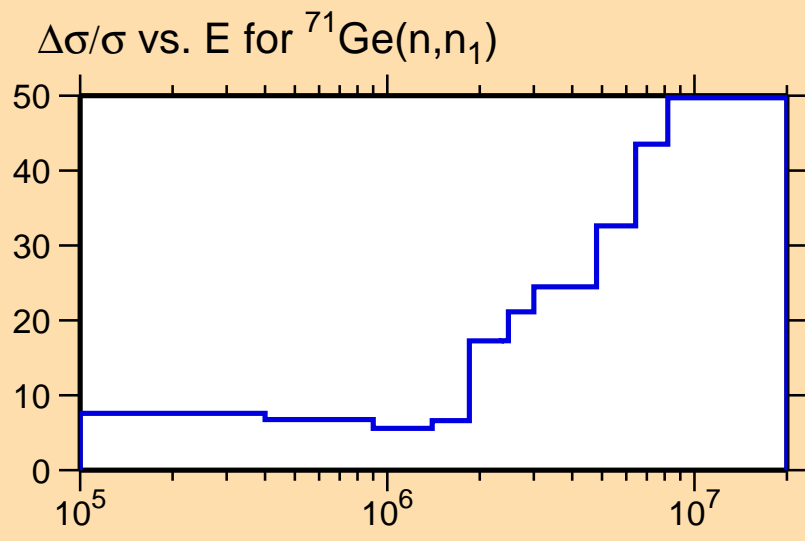

Correlation Matrix





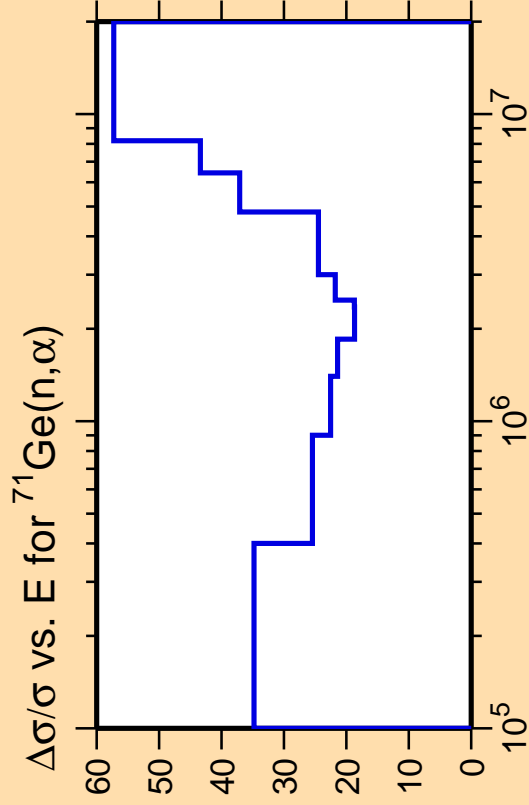

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n_1)$

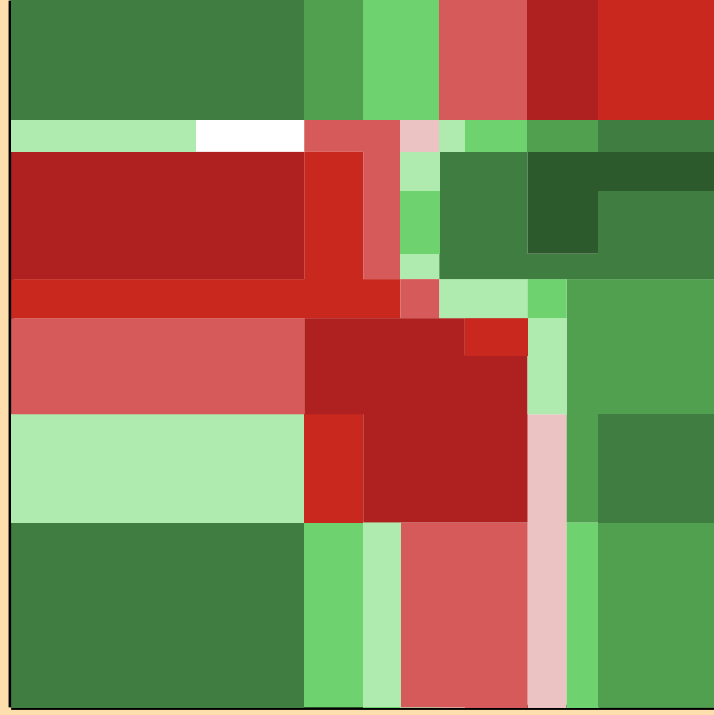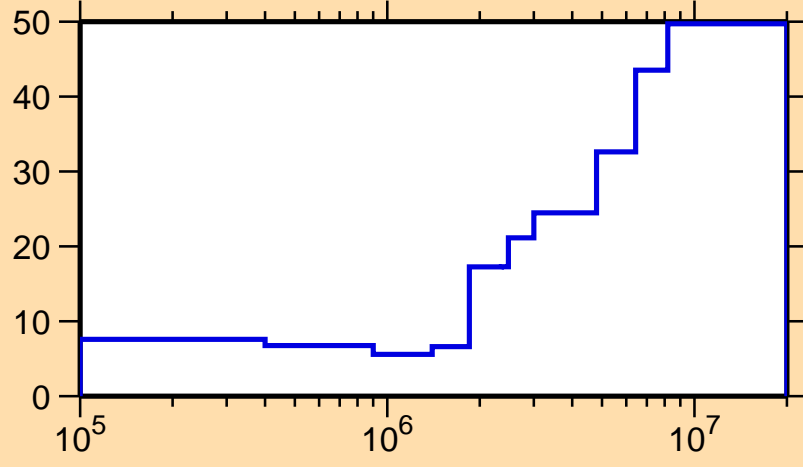

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n_2)$

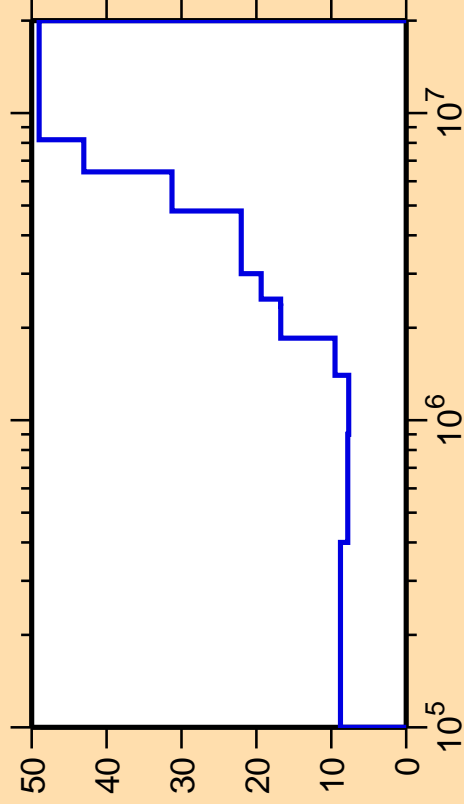

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,n_2)$

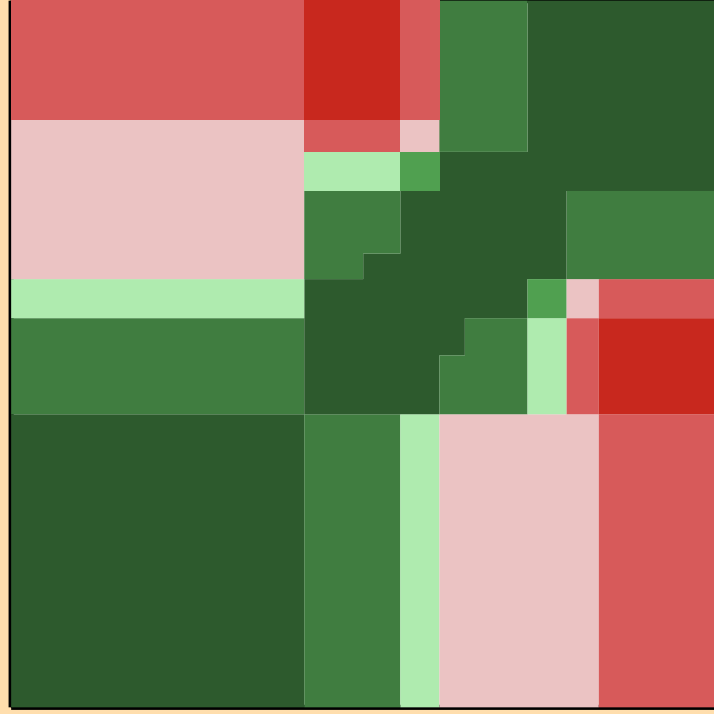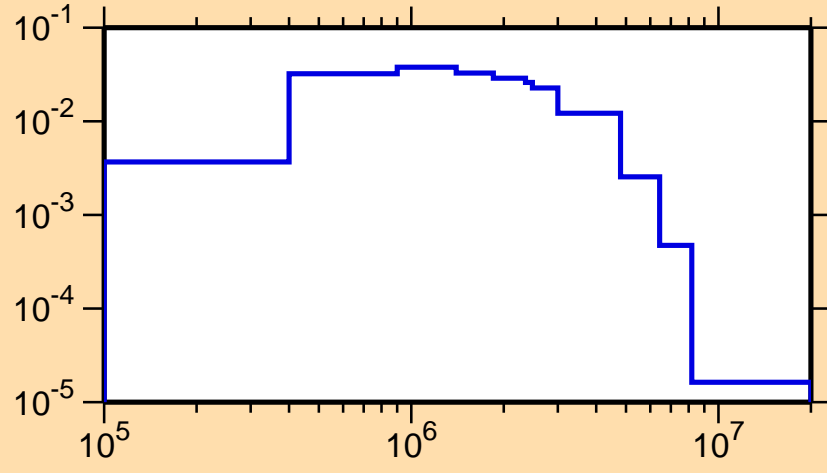

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n_3)$

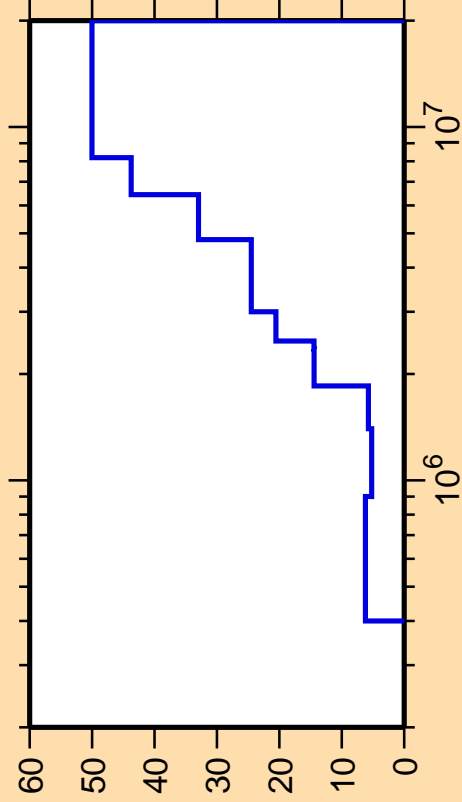

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


$\sigma$  vs. E for  $^{71}\text{Ge}(n,n_3)$

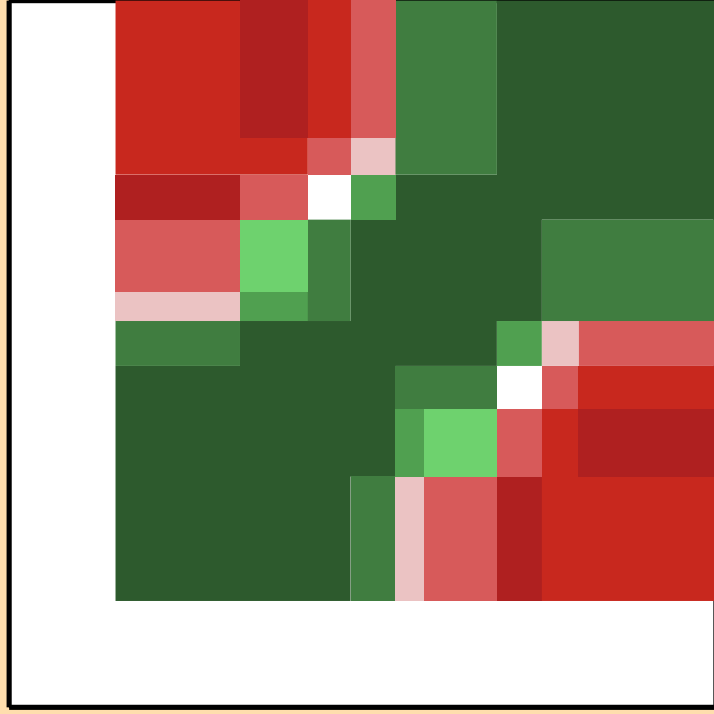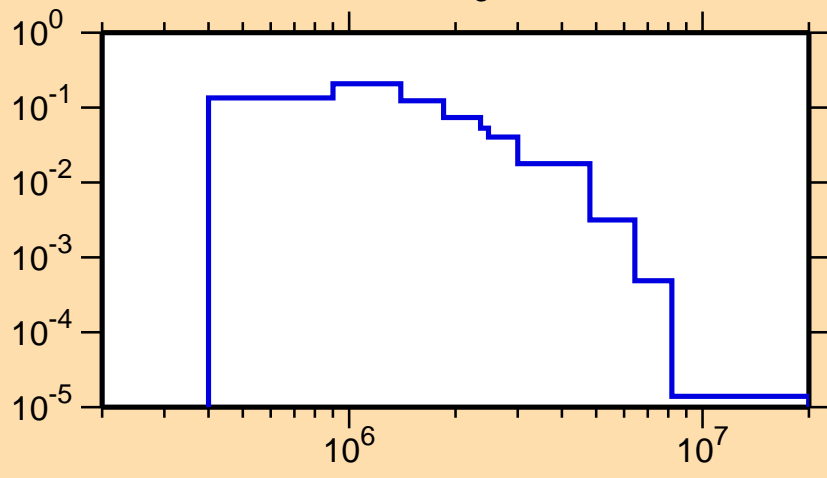

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n_4)$

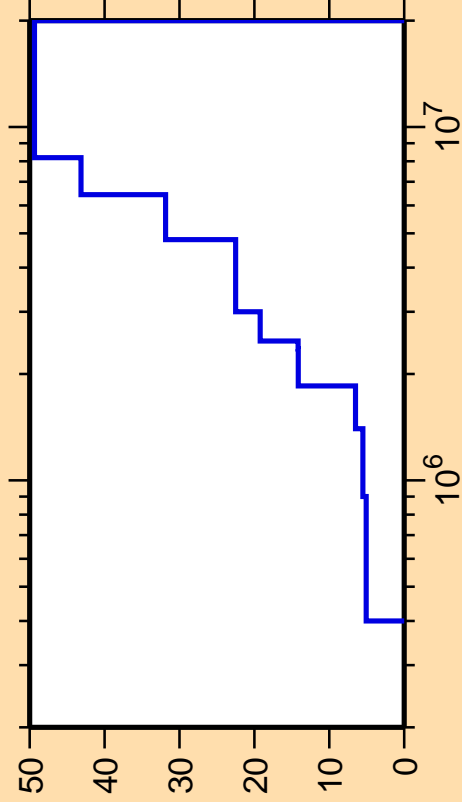

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{71}\text{Ge}(n,n_4)$

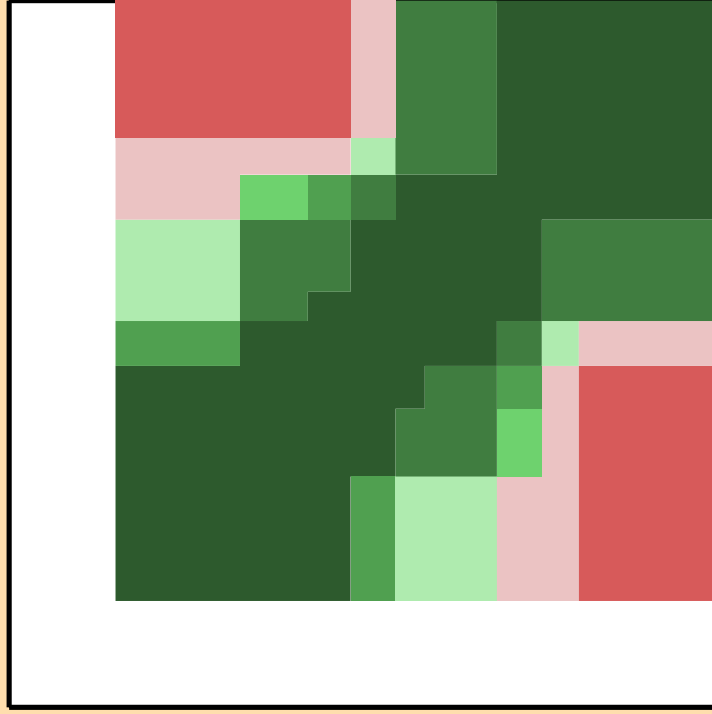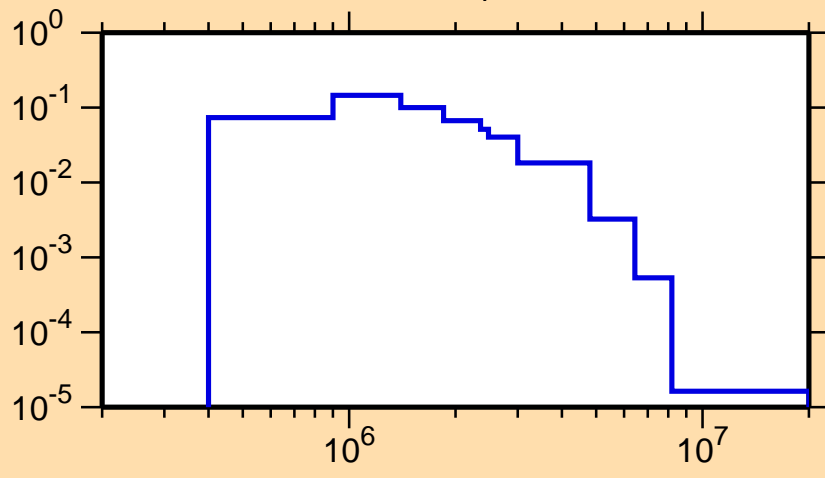


Correlation Matrix







$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

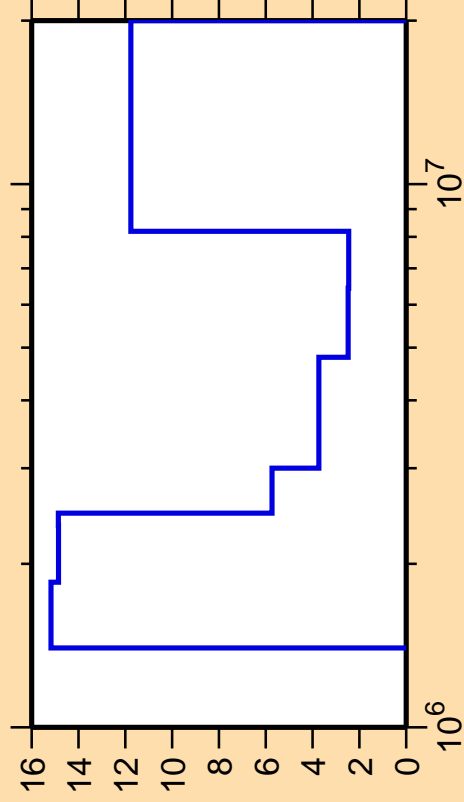

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

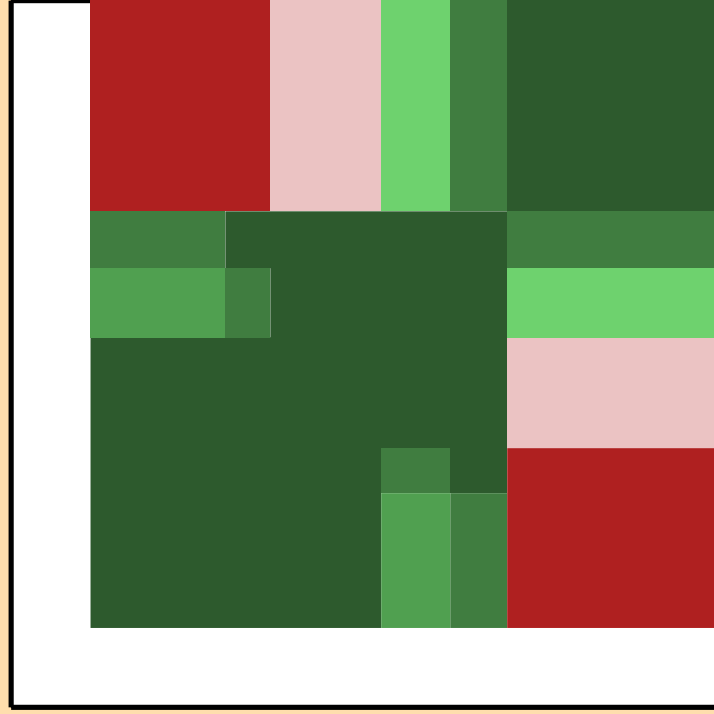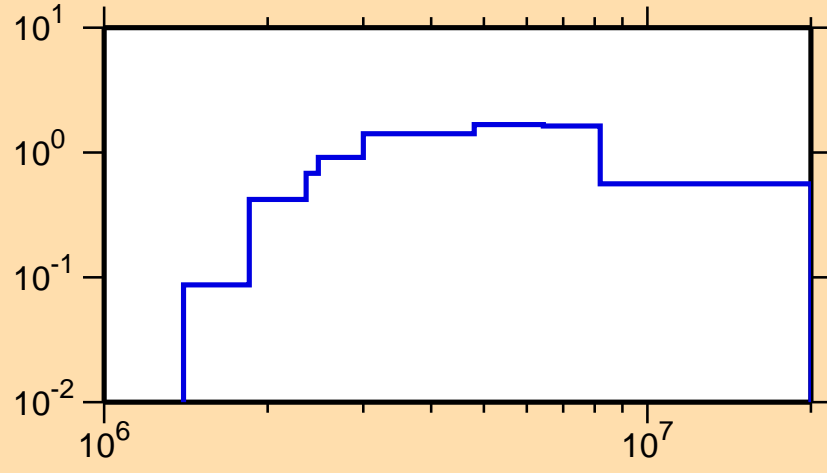

Correlation Matrix





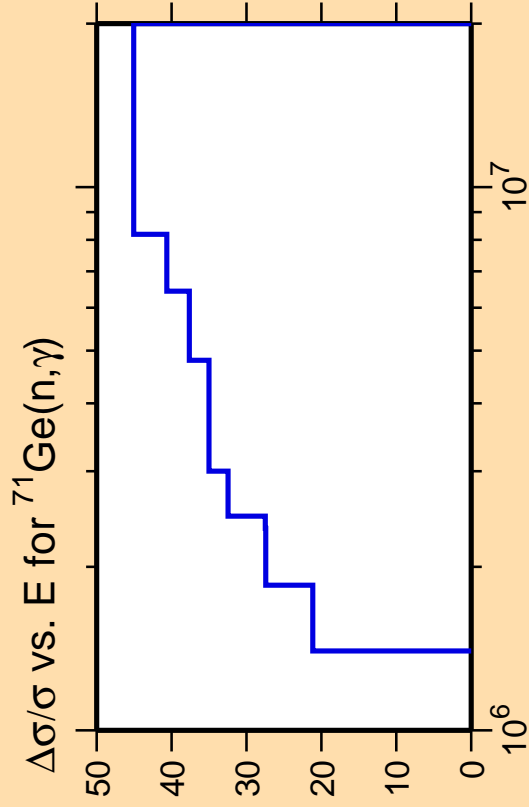

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

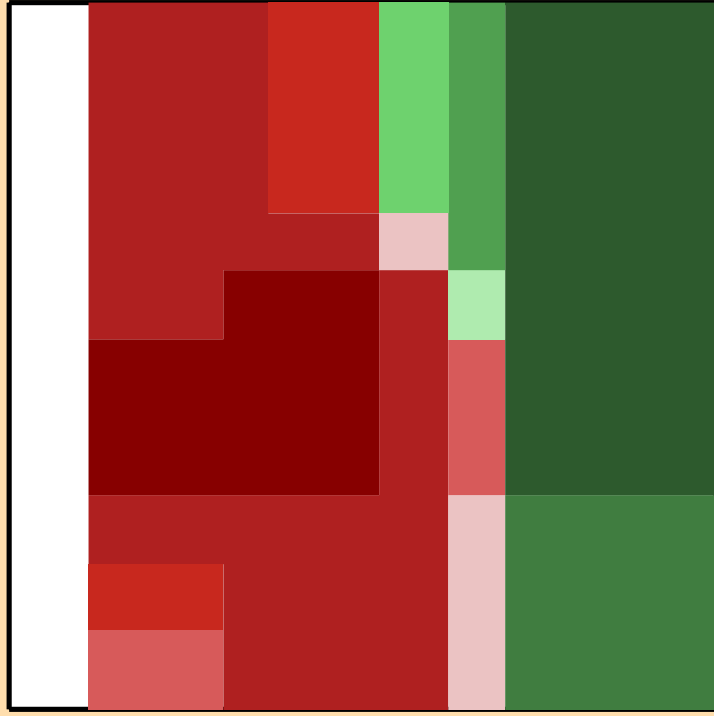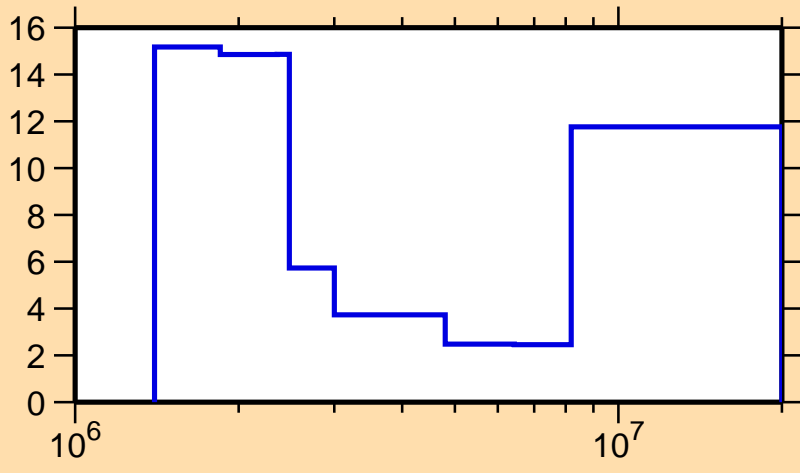

Correlation Matrix





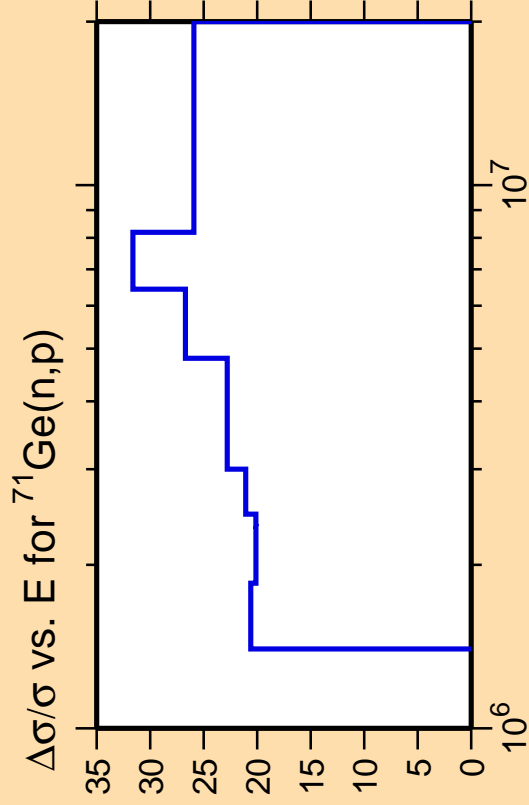

Ordinate scale is %  
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

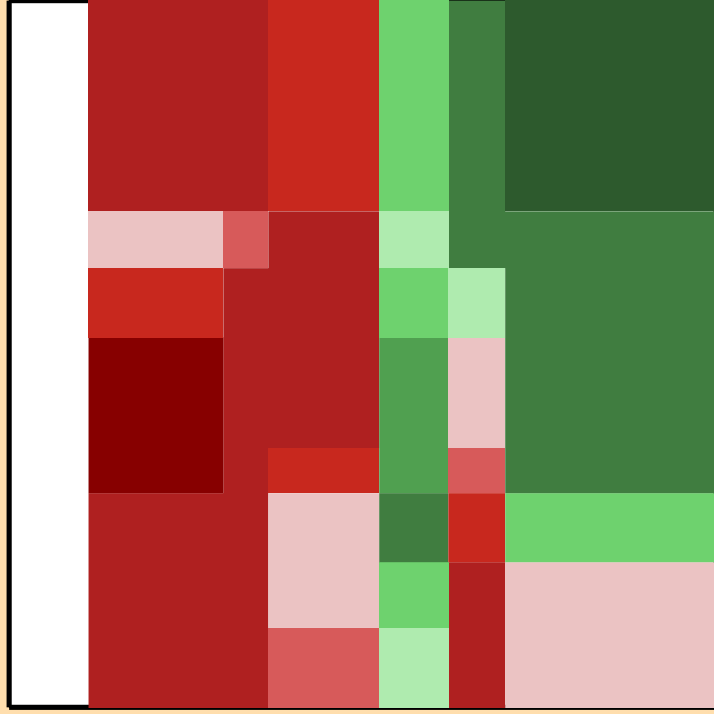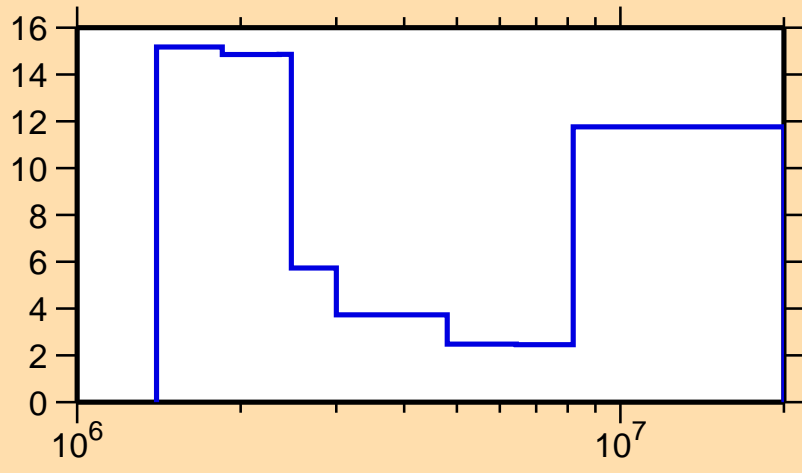

Correlation Matrix





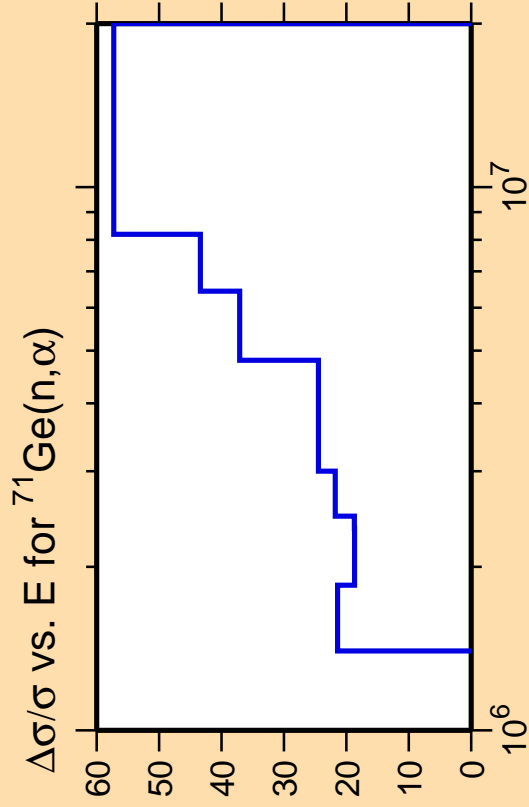

Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,n\text{cont.})$

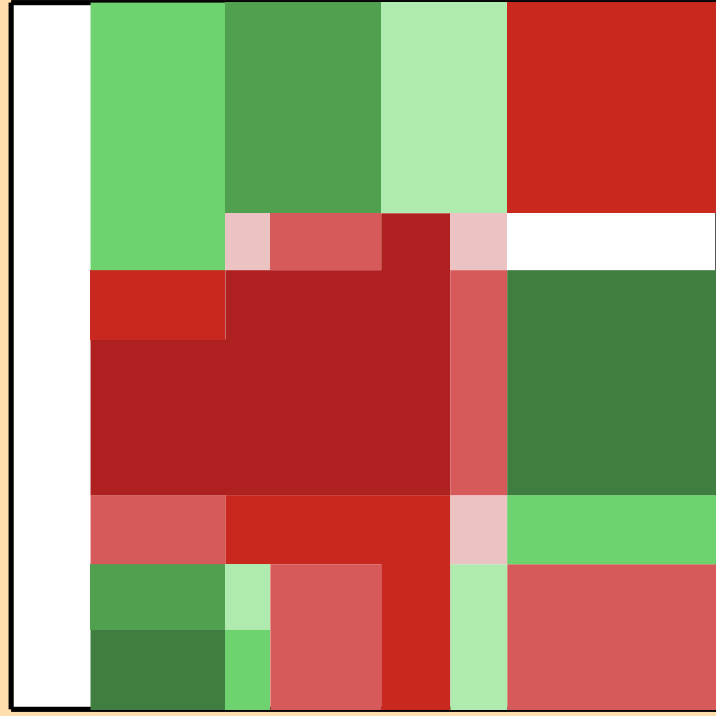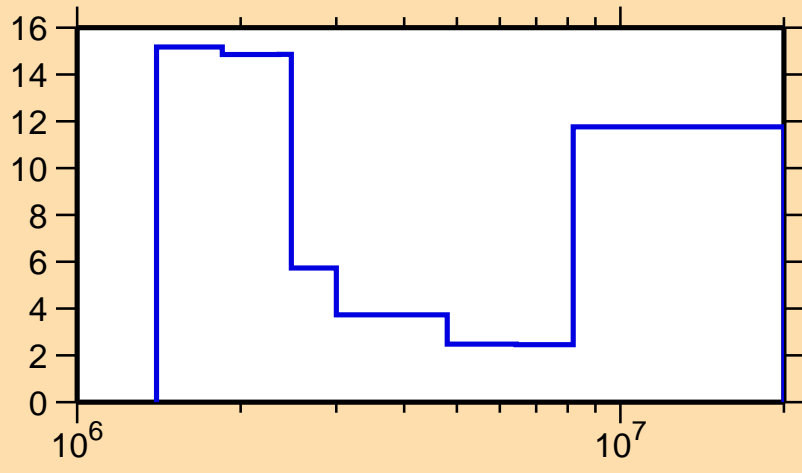

Correlation Matrix





$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\gamma)$

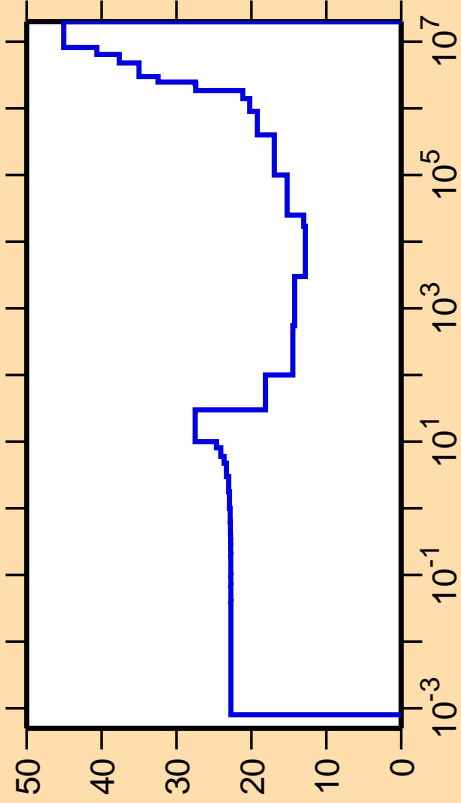

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{71}\text{Ge}(n,\gamma)$

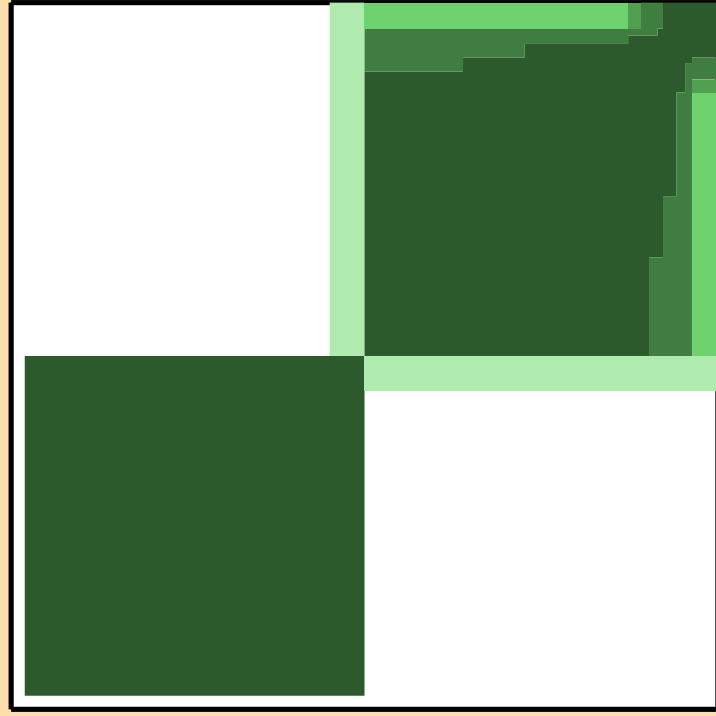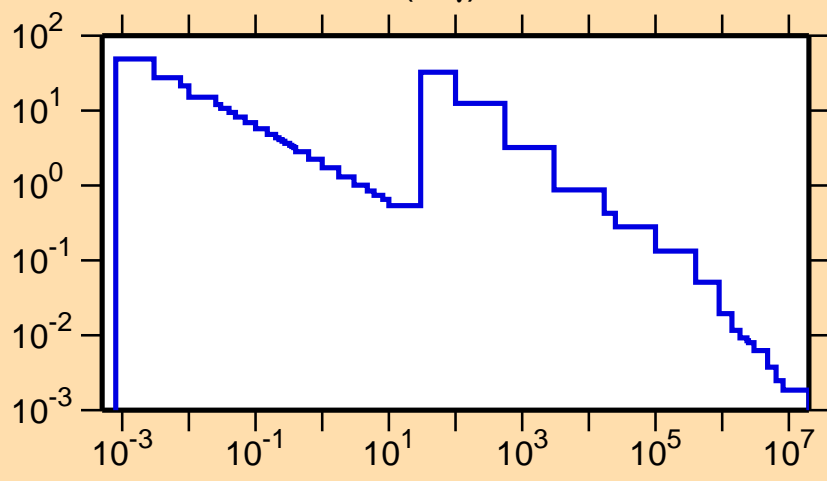

Correlation Matrix




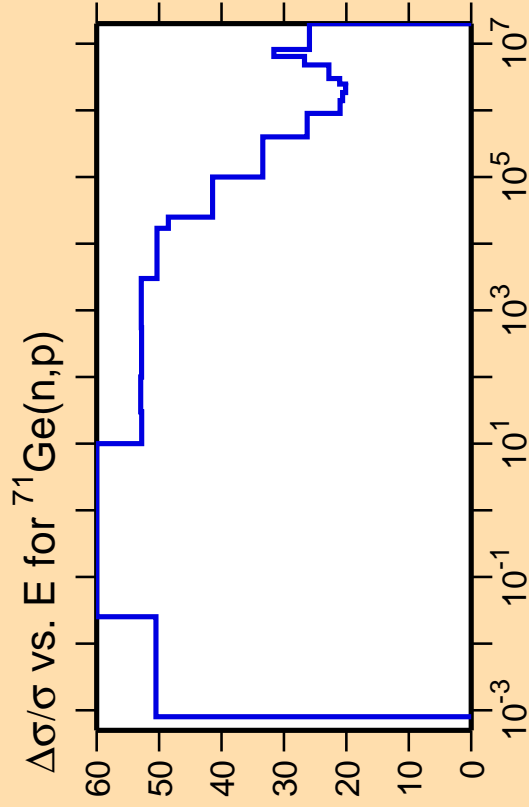


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\gamma)$

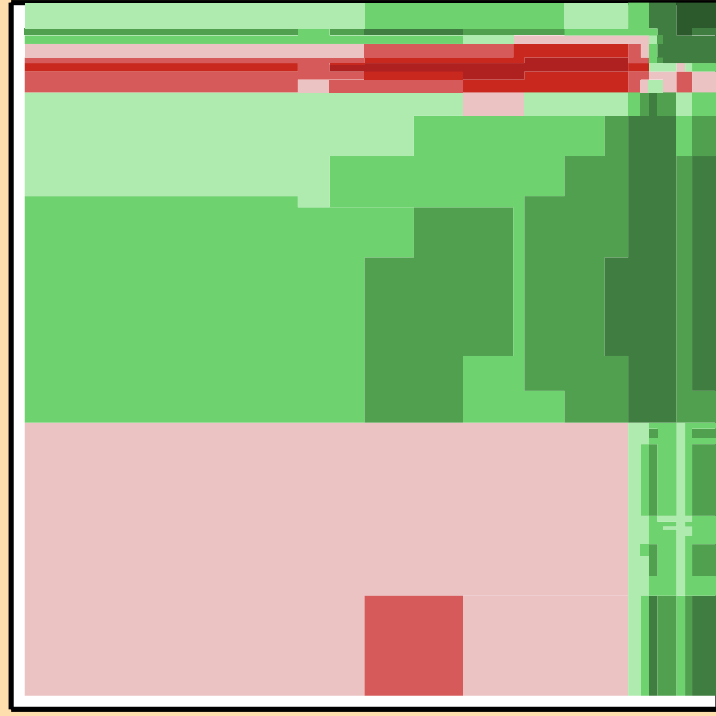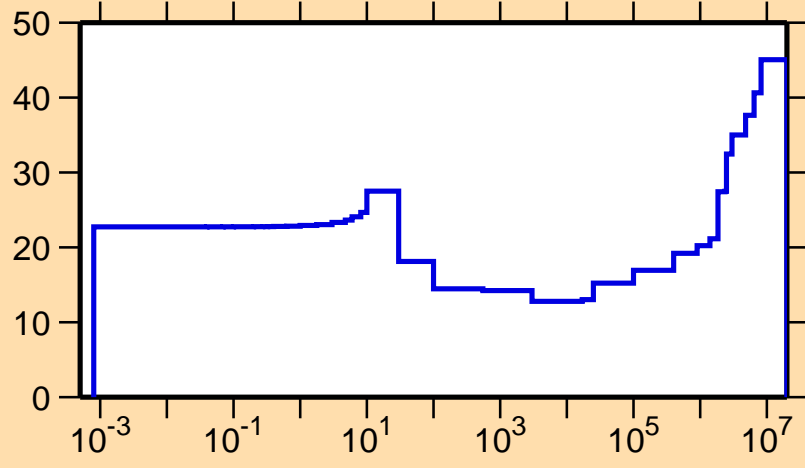

Correlation Matrix




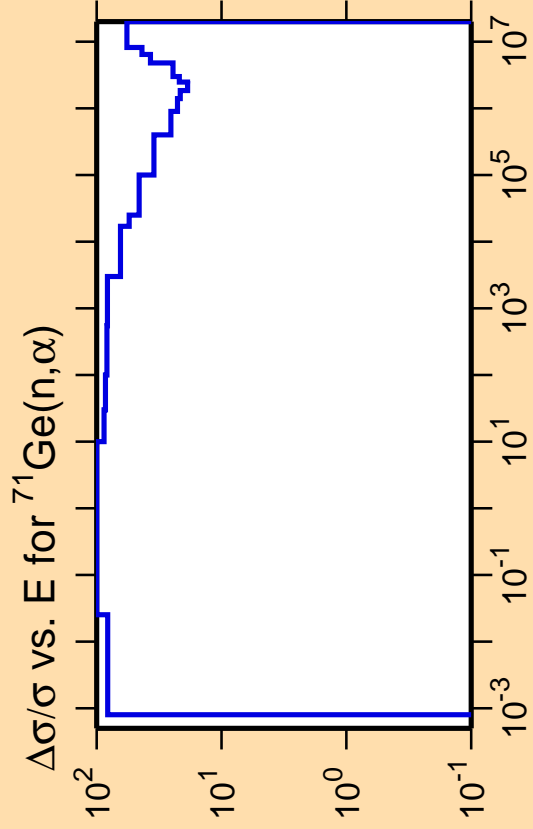


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\gamma)$

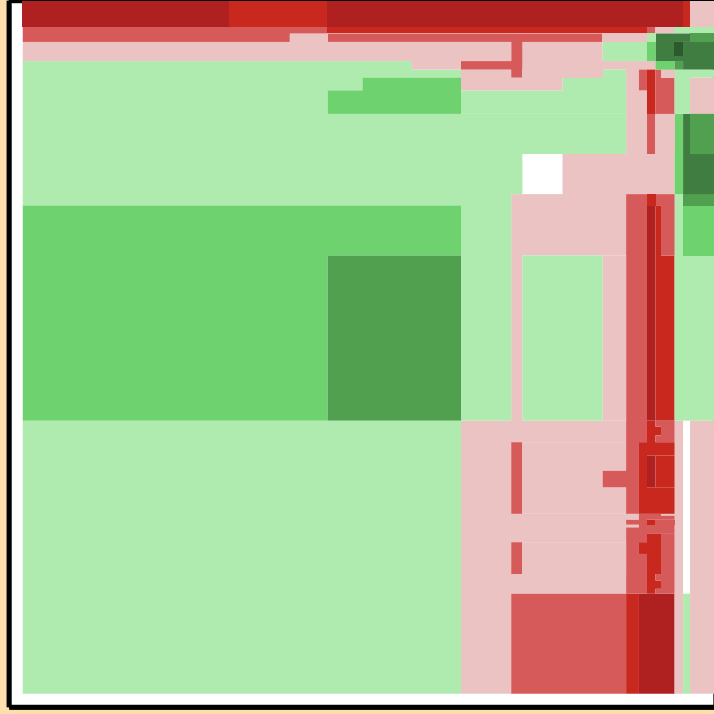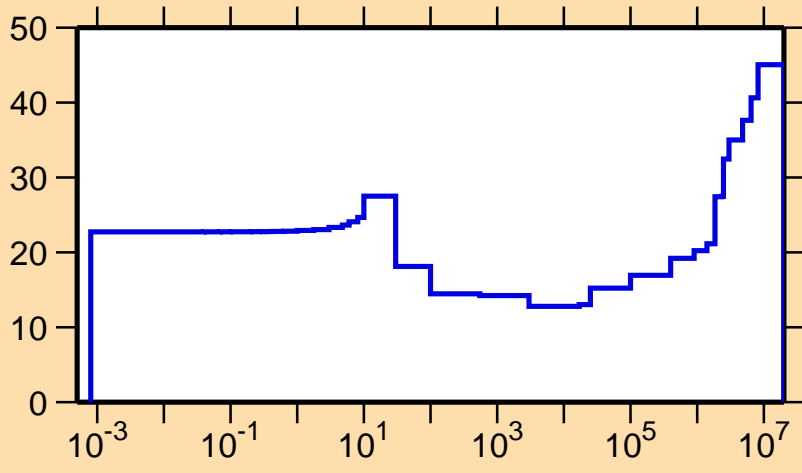

Correlation Matrix




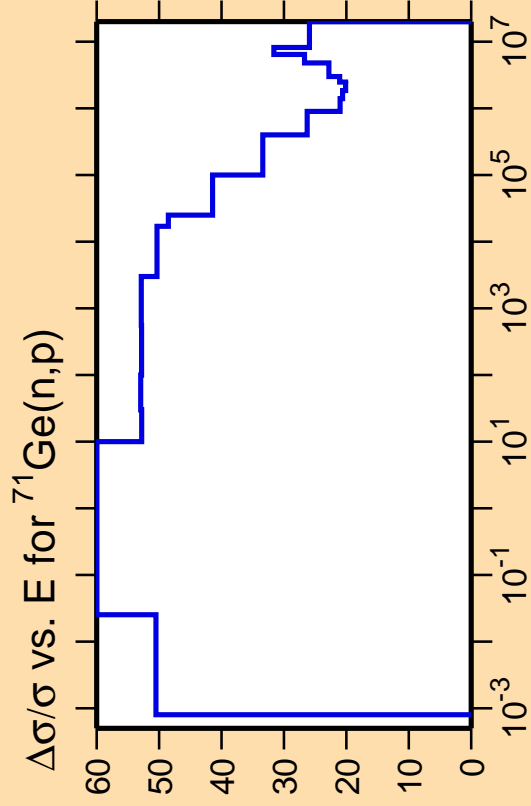


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


$\sigma$  vs. E for  $^{71}\text{Ge}(n,p)$

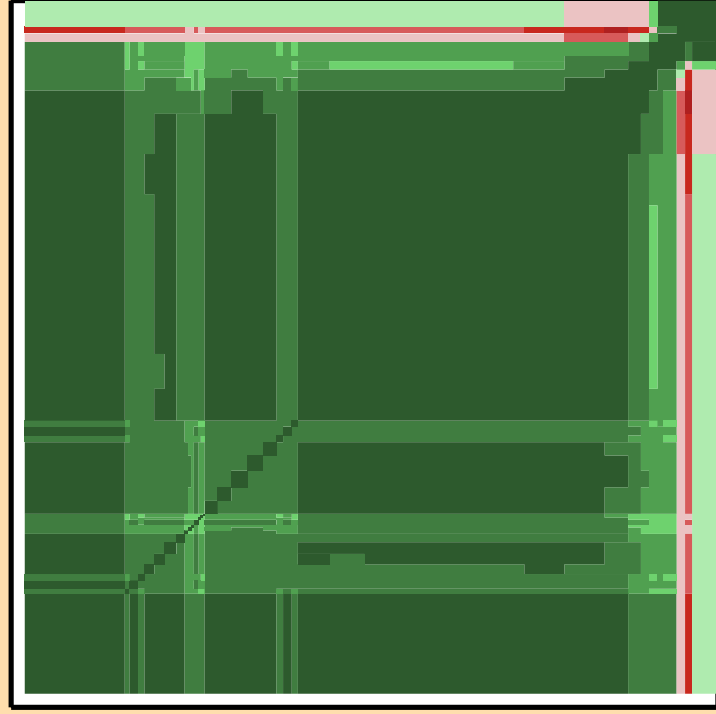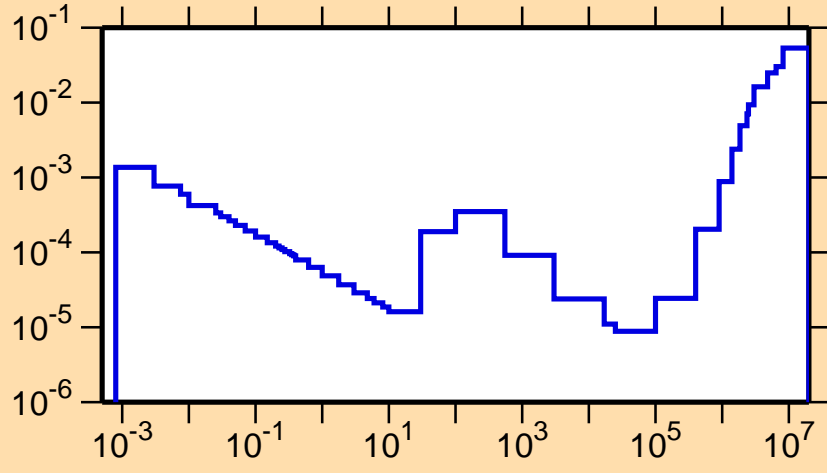

Correlation Matrix






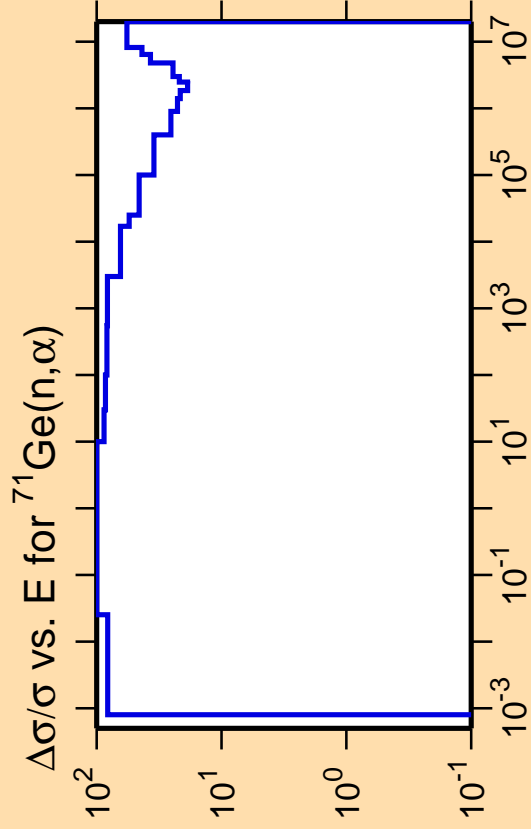


Ordinate scale is %  
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty  
data were suppressed.

$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,p)$

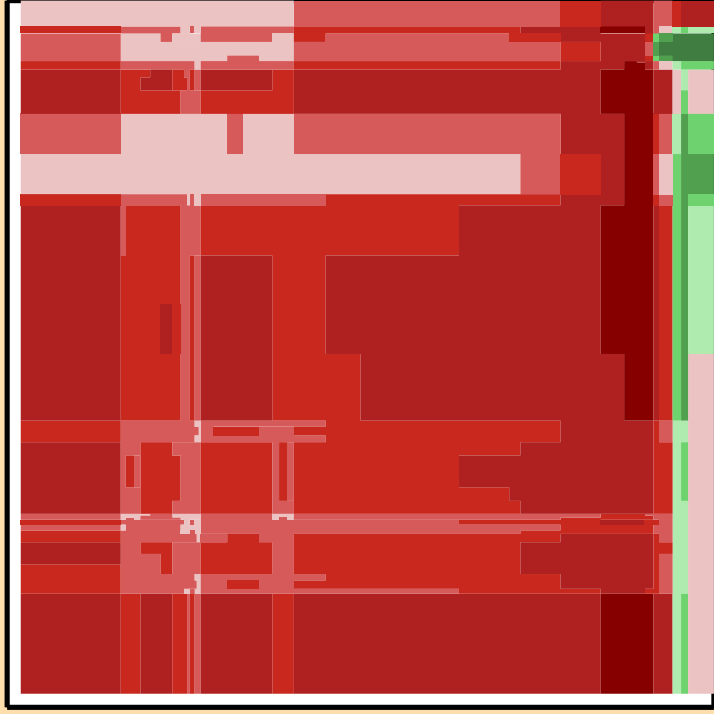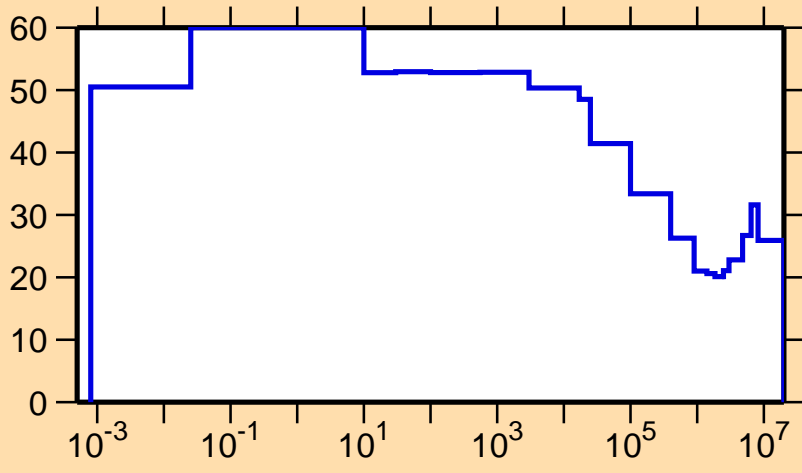

Correlation Matrix




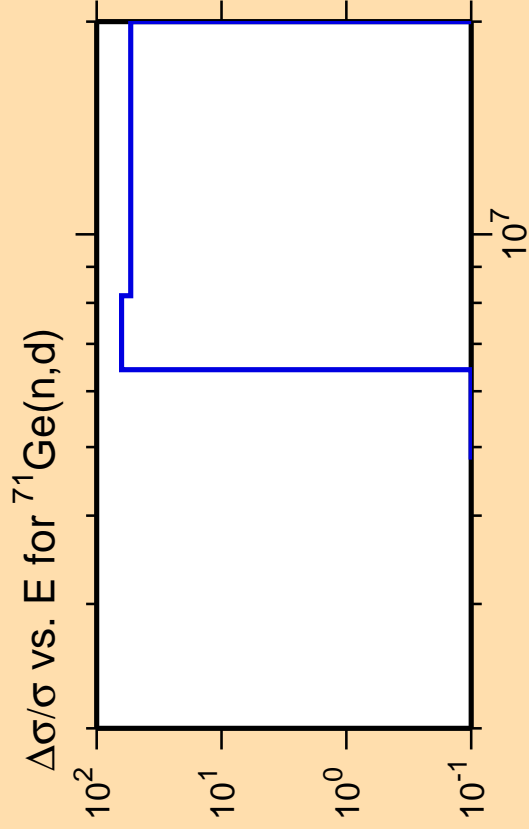


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

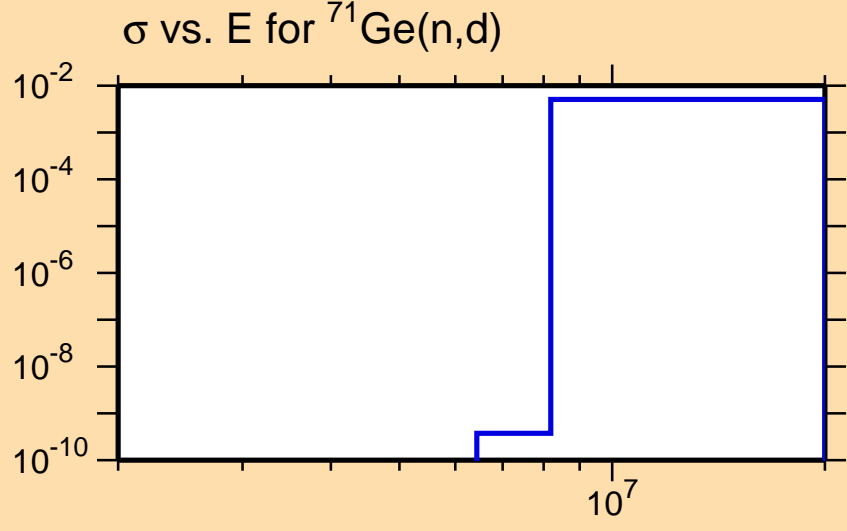

$\sigma$  vs.  $E$  for  $^{71}\text{Ge}(n,d)$



Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,t)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{71}\text{Ge}(n,t)$

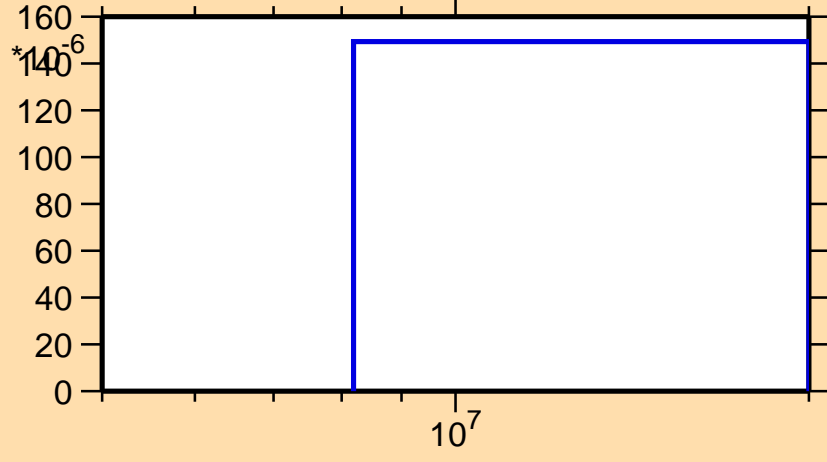

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{He3})$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{He3})$

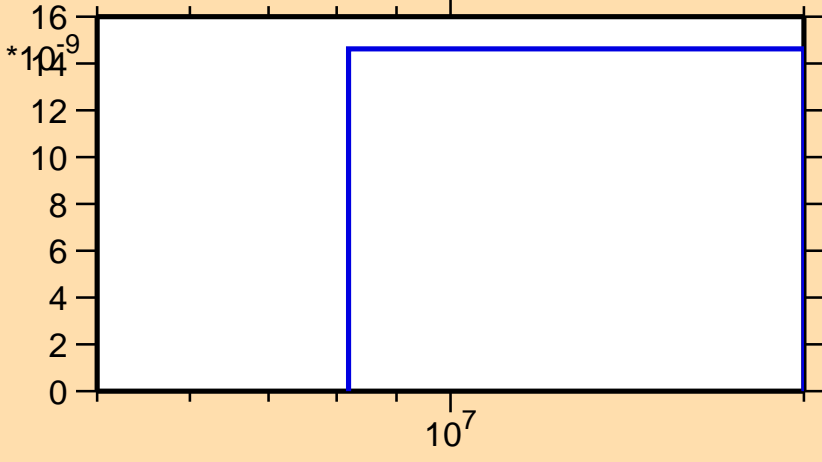


$\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{He3})$



Correlation Matrix




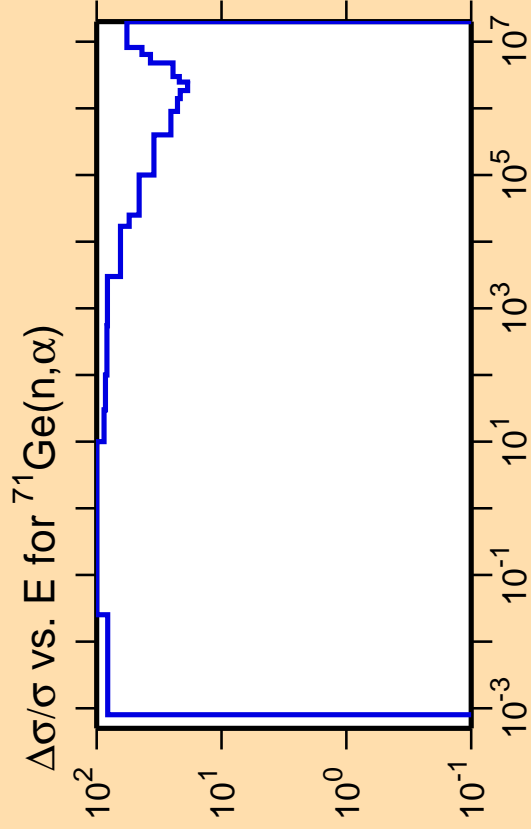


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{71}\text{Ge}(n,\alpha)$

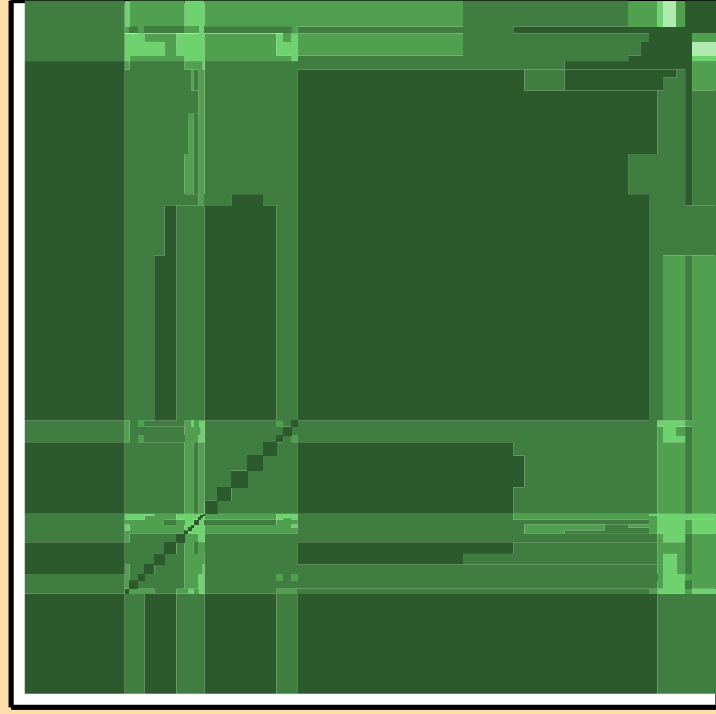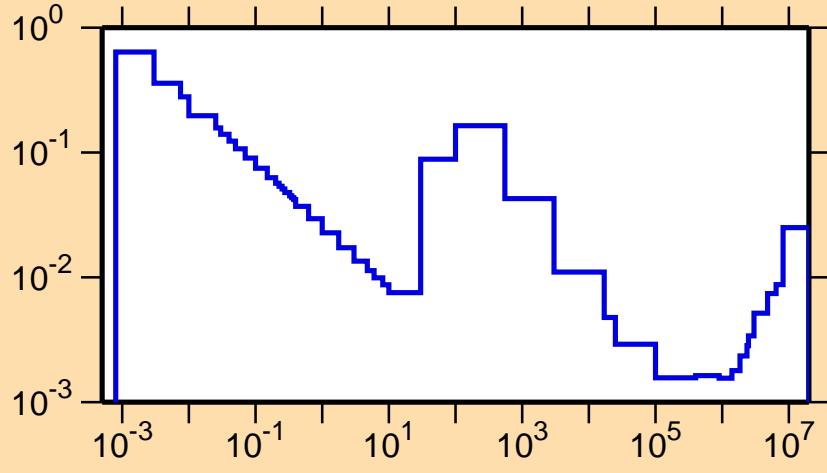

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,p\alpha)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


$\sigma$  vs. E for  $^{71}\text{Ge}(n,p\alpha)$

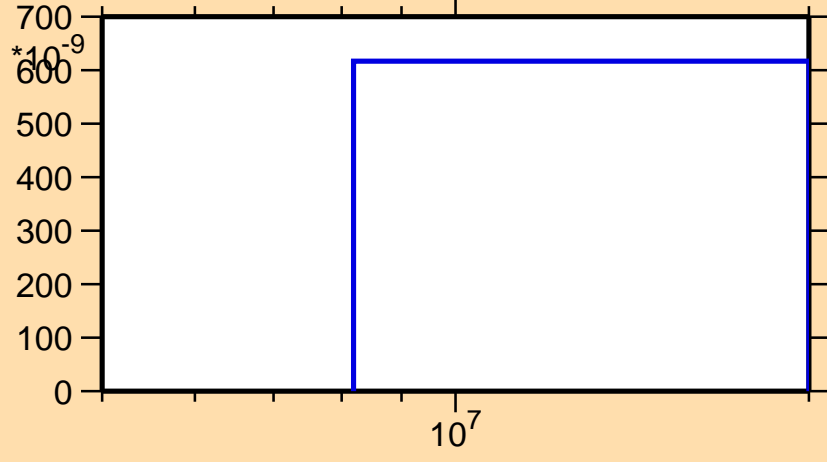

Correlation Matrix




$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{pd})$

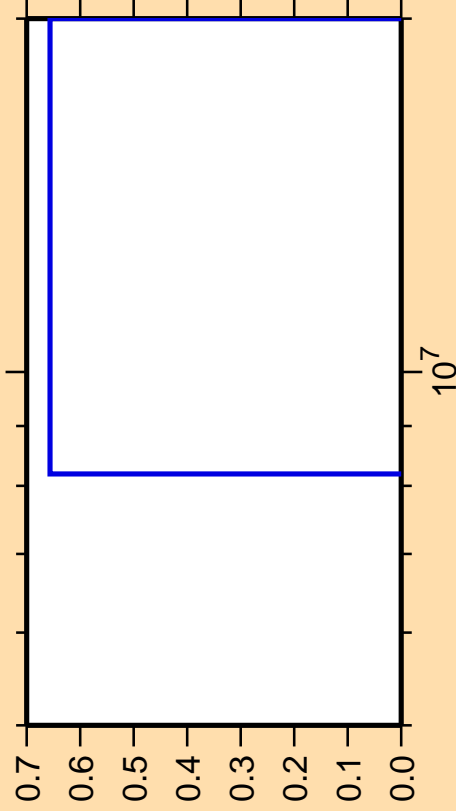

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{pd})$

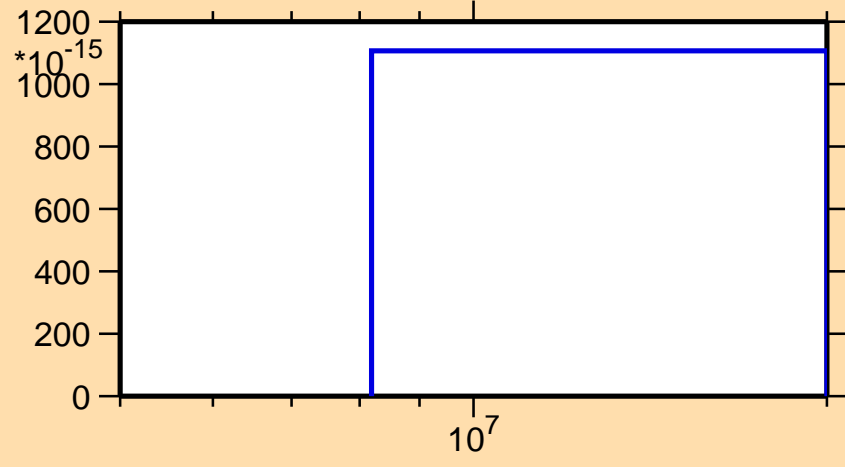

Correlation Matrix



$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{pt})$





Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

$\sigma$  vs. E for  $^{71}\text{Ge}(n,\text{pt})$

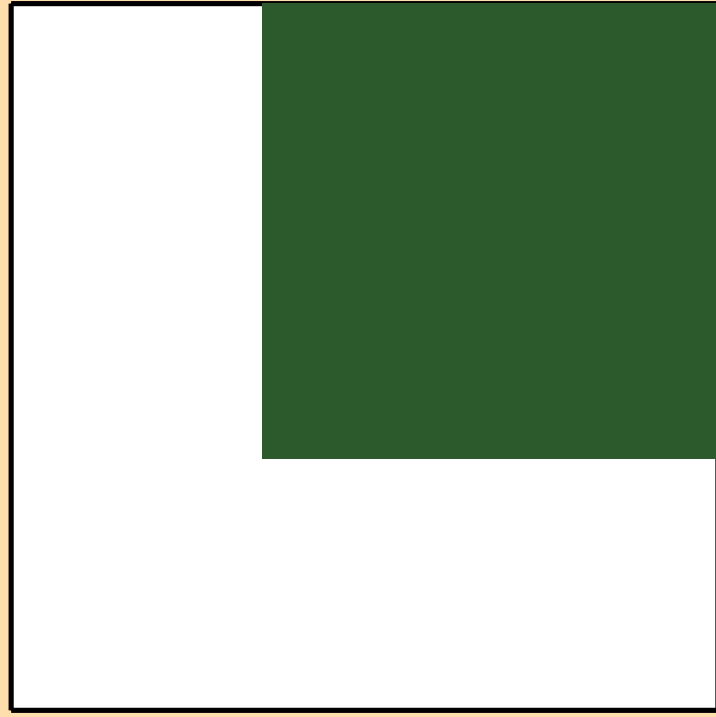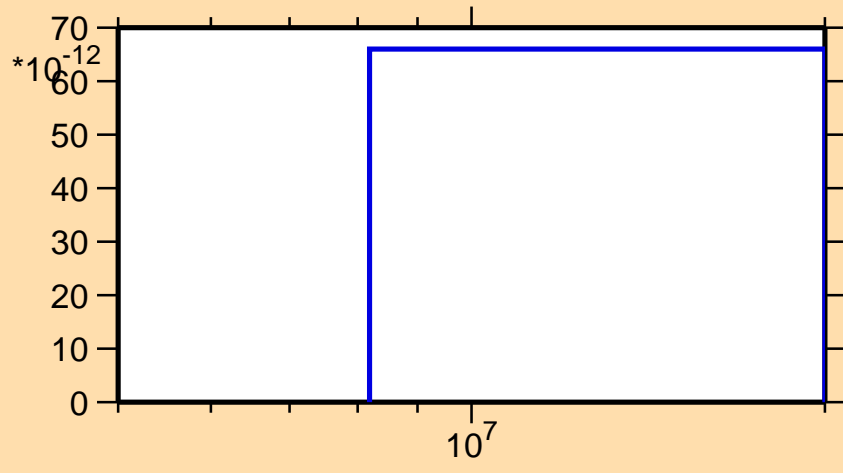


Correlation Matrix







$\Delta\sigma/\sigma$  vs. E for  $^{71}\text{Ge}(\text{mt117})$

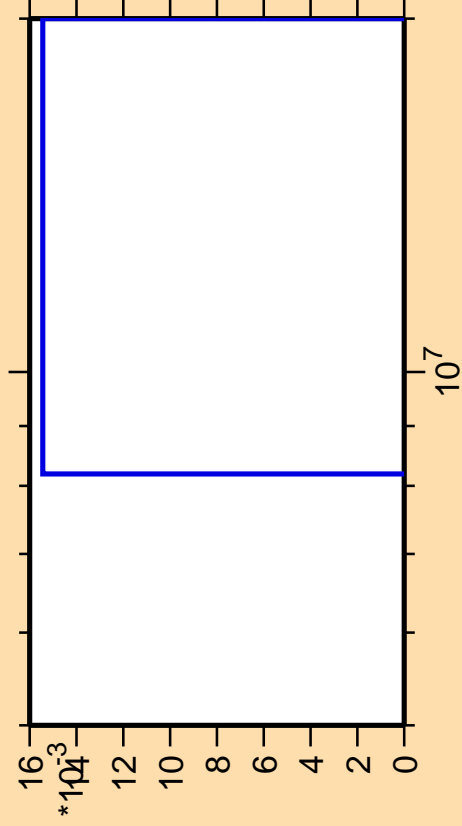

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

$\sigma$  vs. E for  $^{71}\text{Ge}(\text{mt117})$

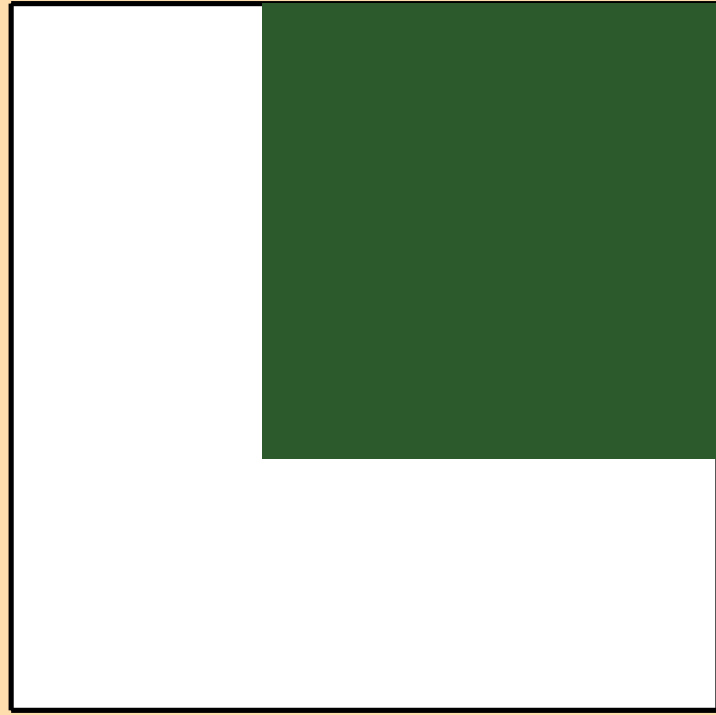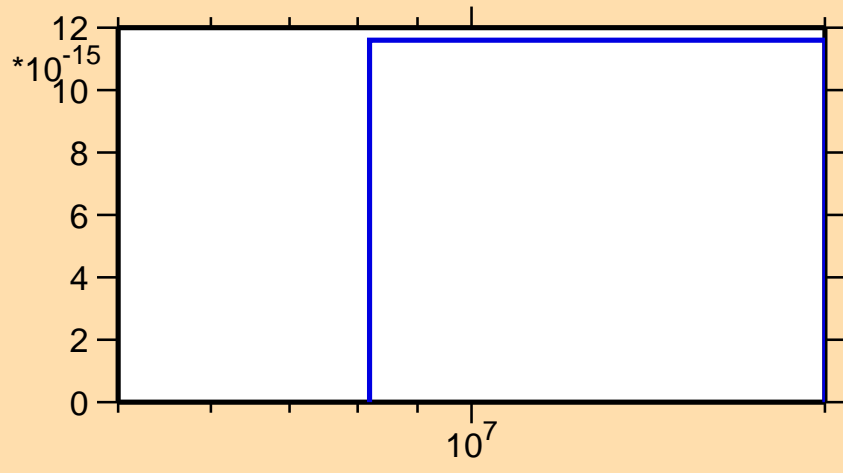

Correlation Matrix

