




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

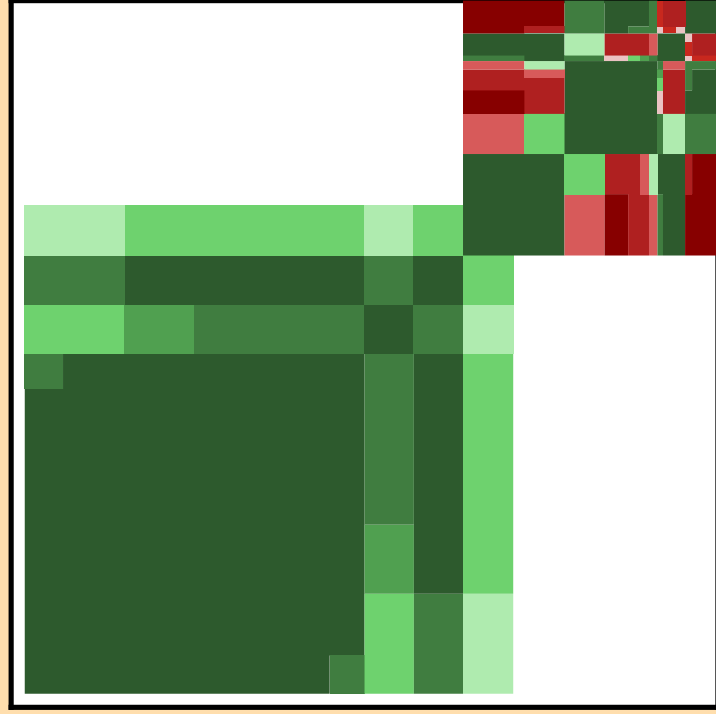

Correlation Matrix


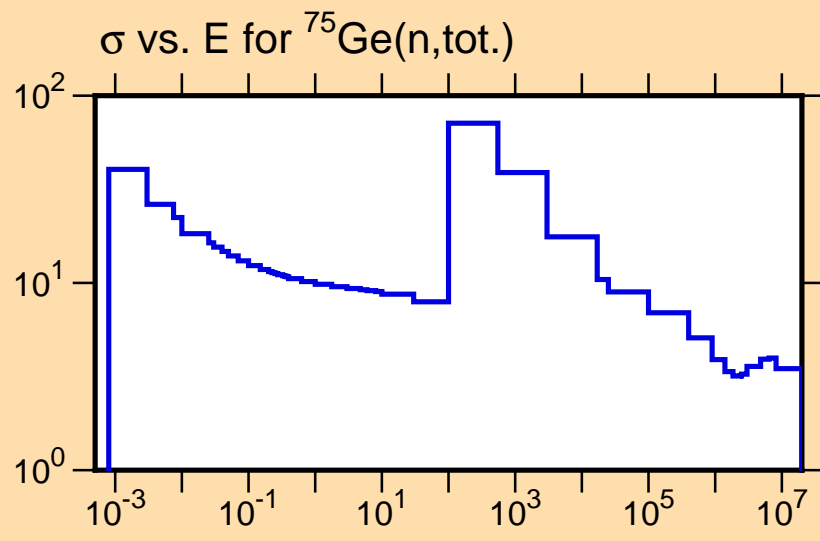


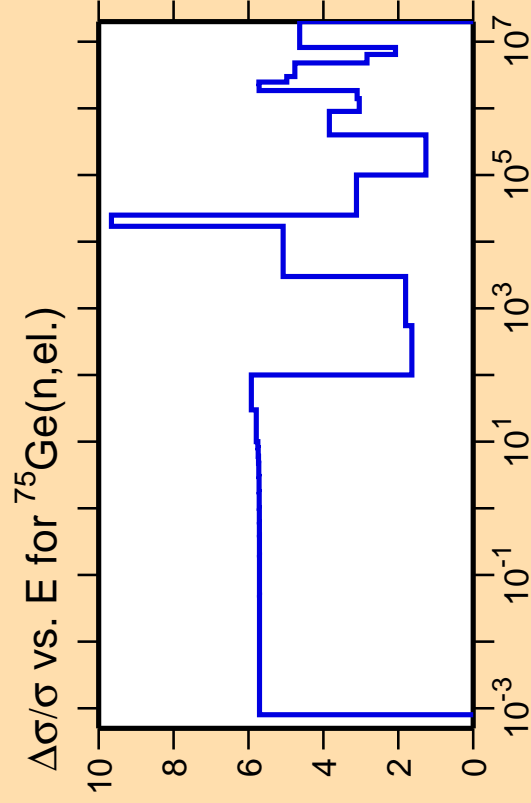

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{tot.})$

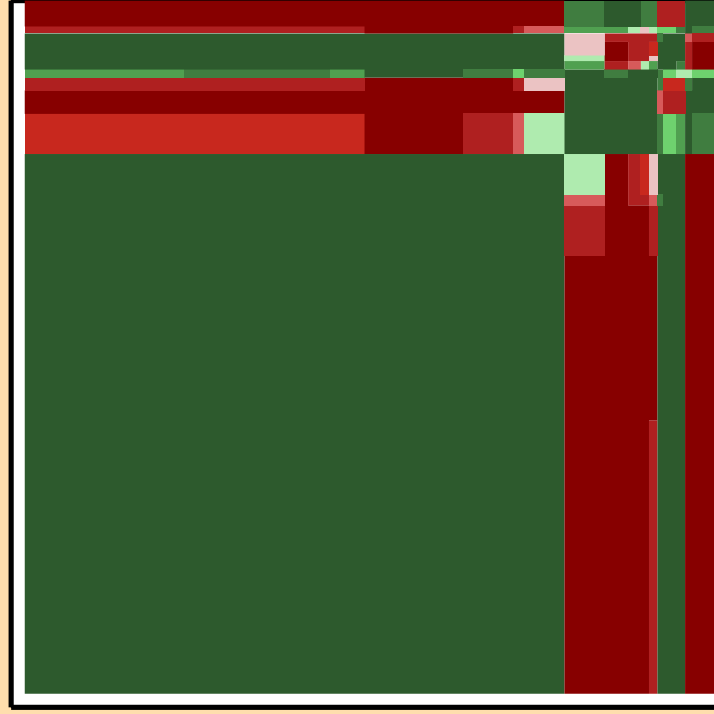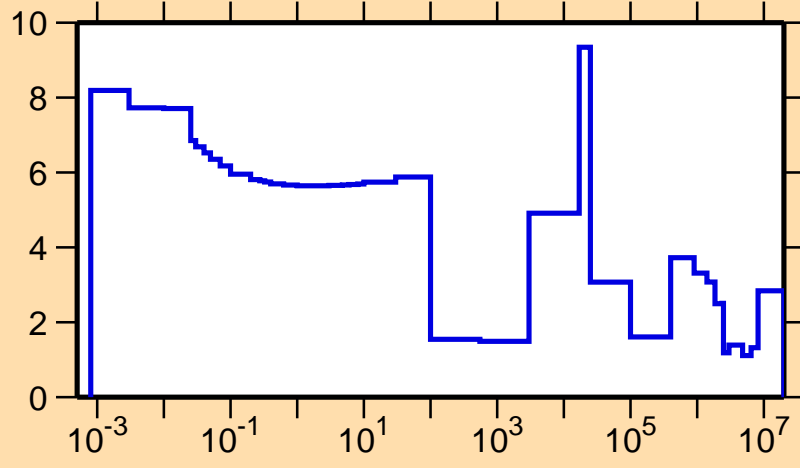

Correlation Matrix




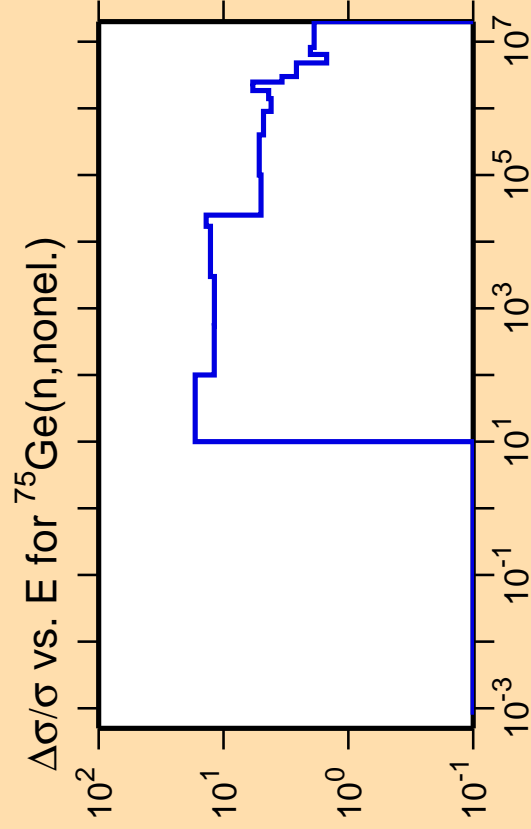


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{tot.})$

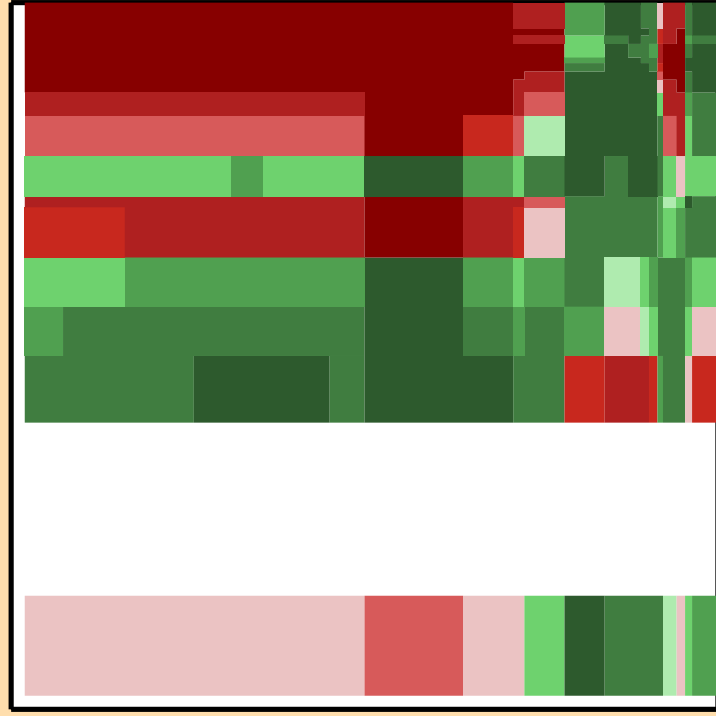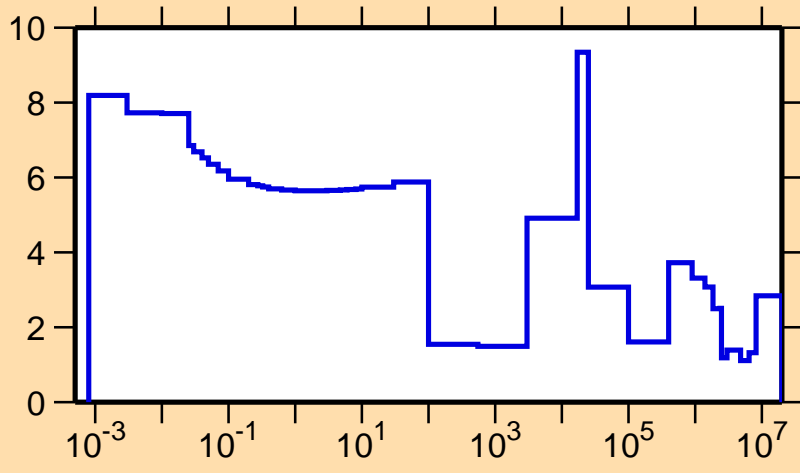

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{inel.})$

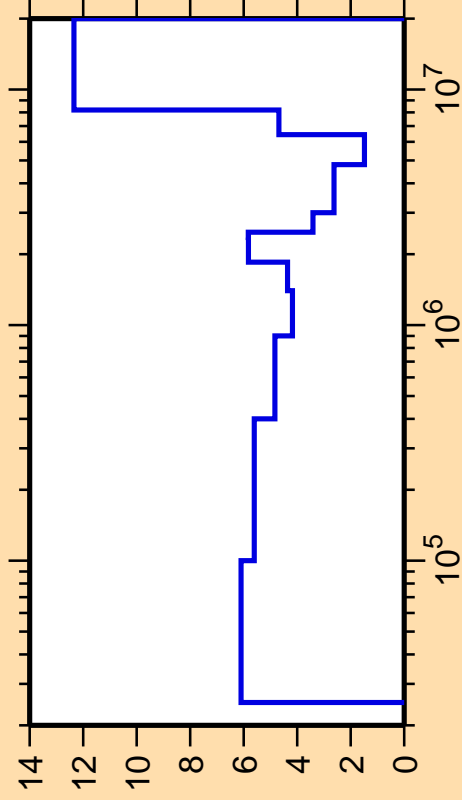

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{tot.})$

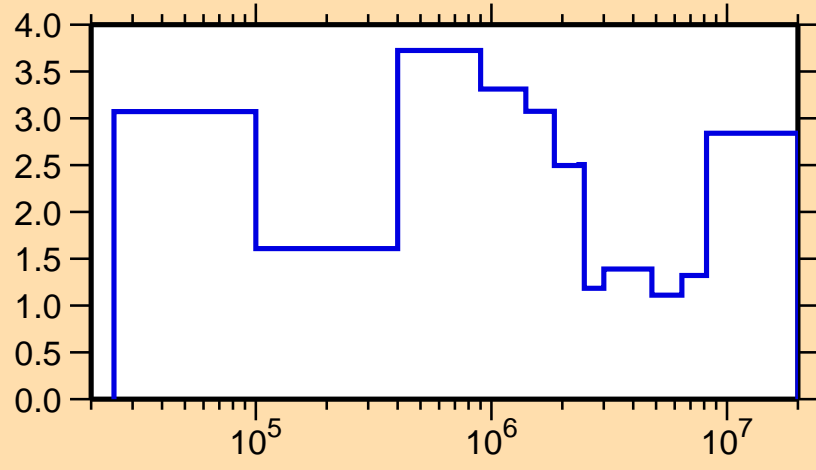

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

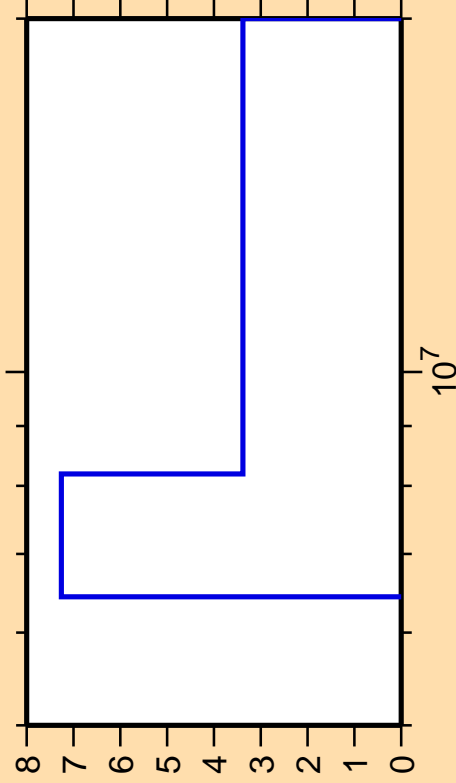

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{tot.})$

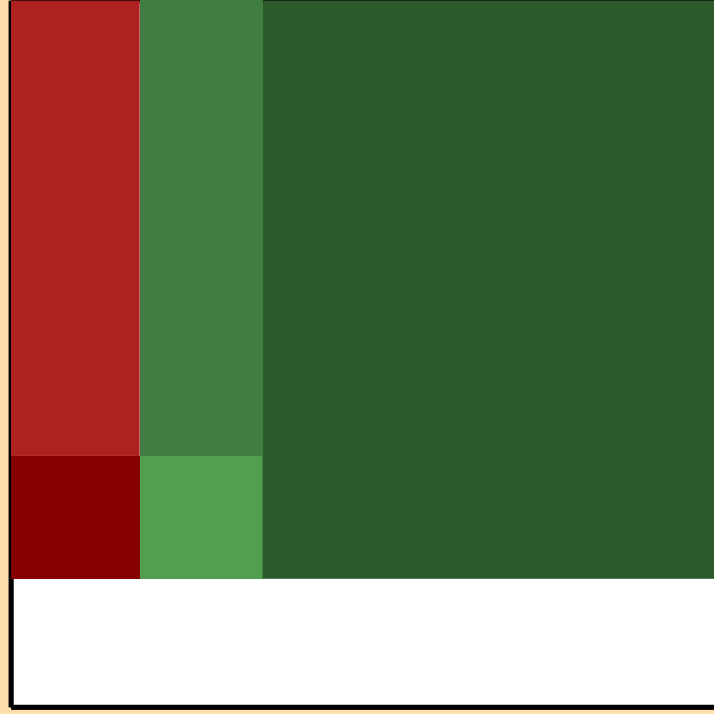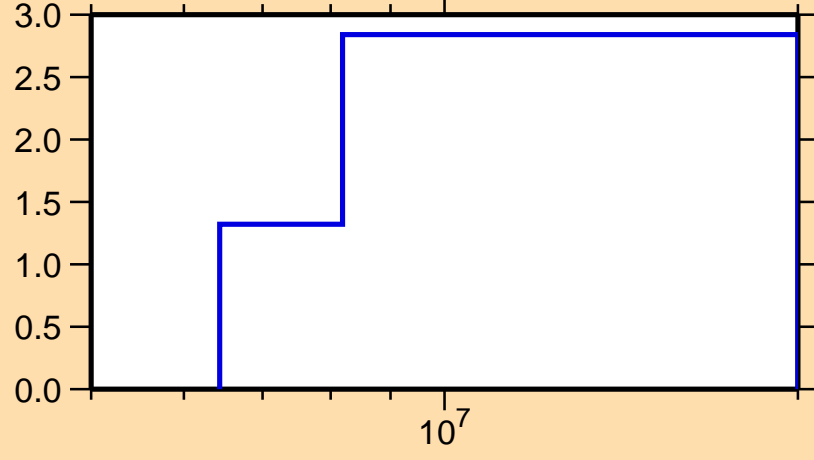



Correlation Matrix



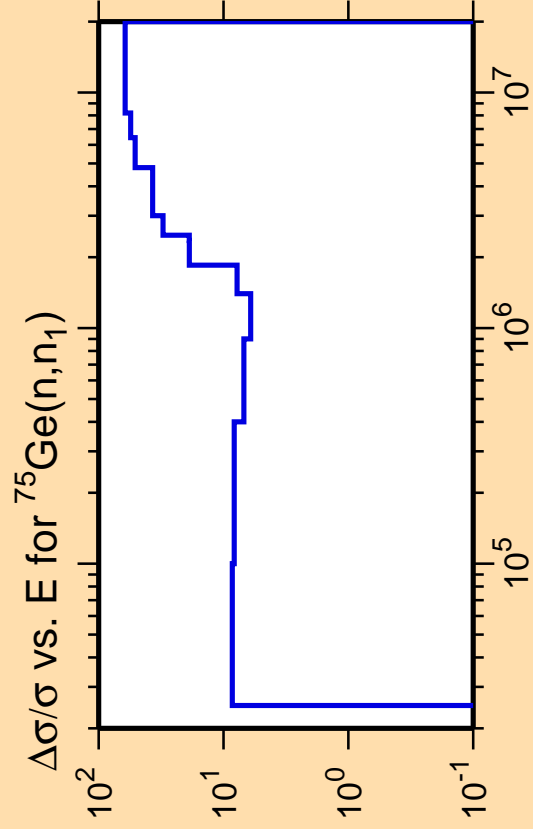

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

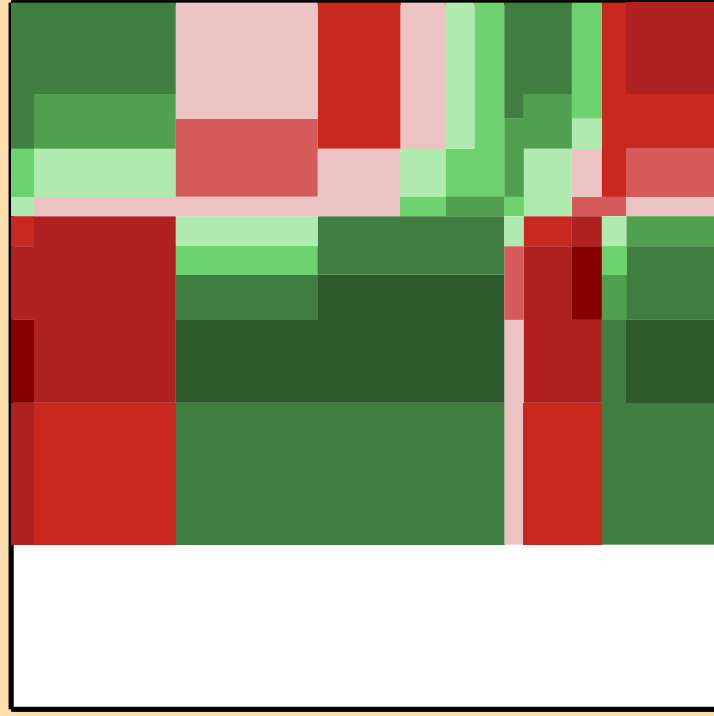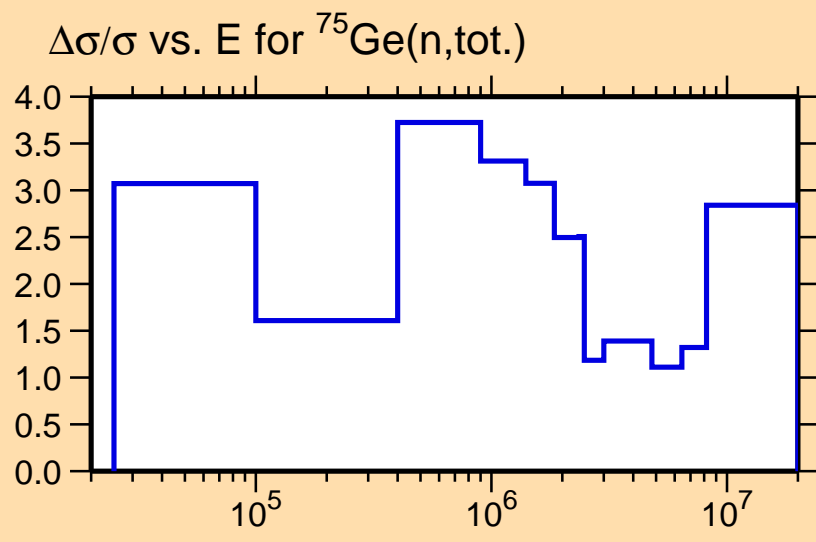

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n\text{cont.})$

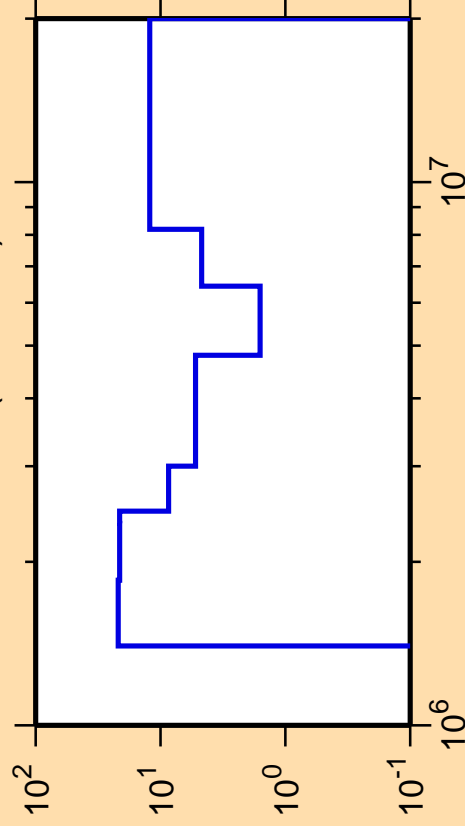

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{tot.})$

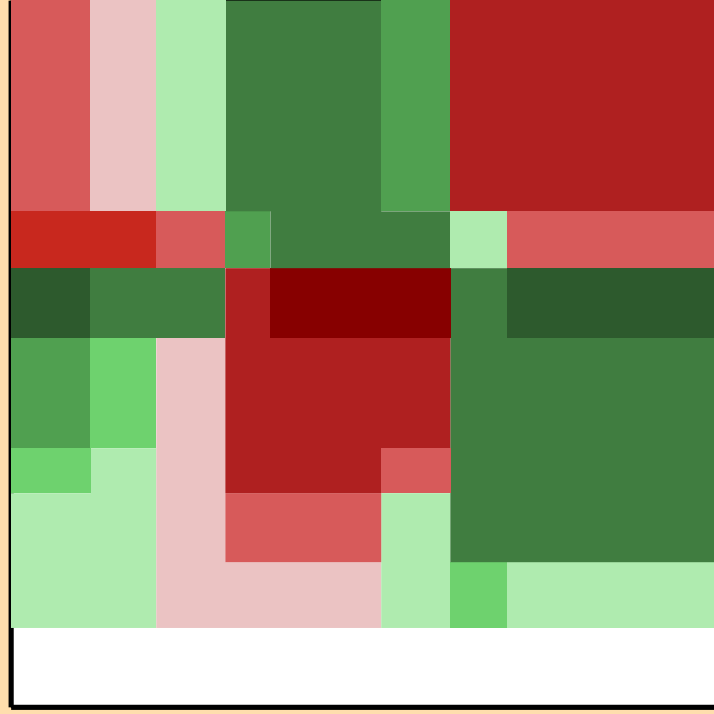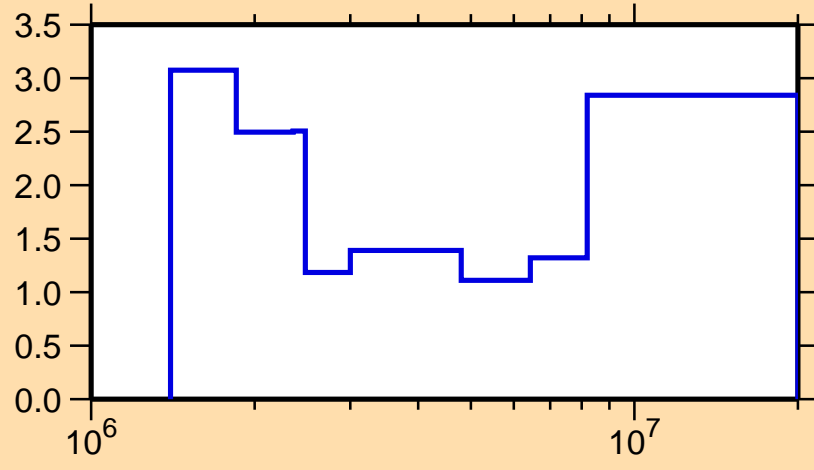

Correlation Matrix





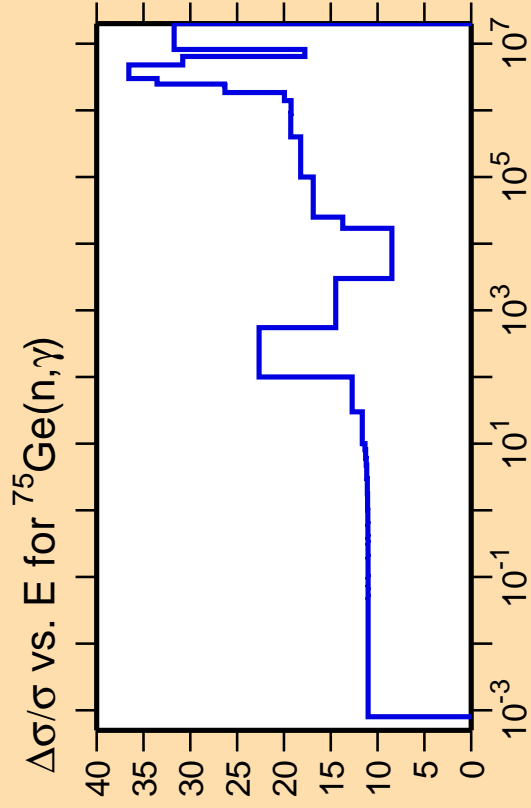

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{tot.})$

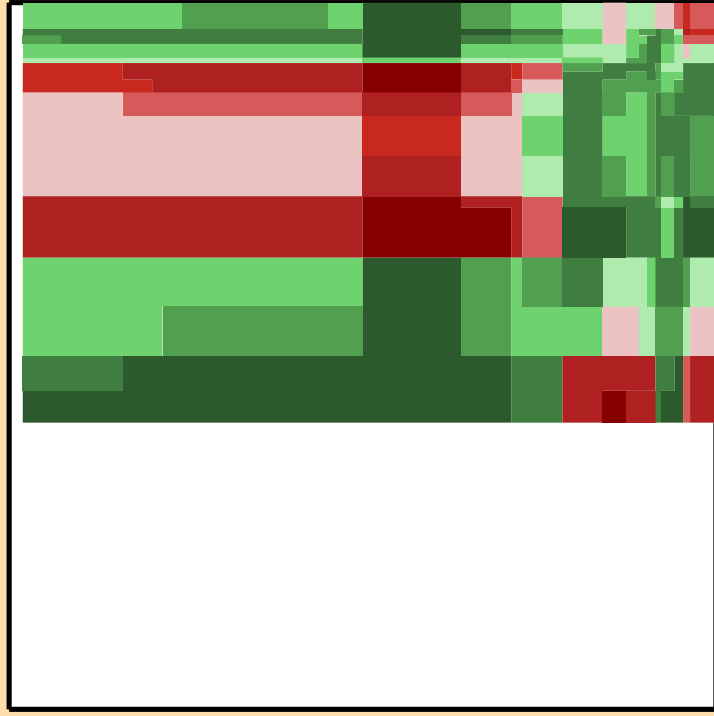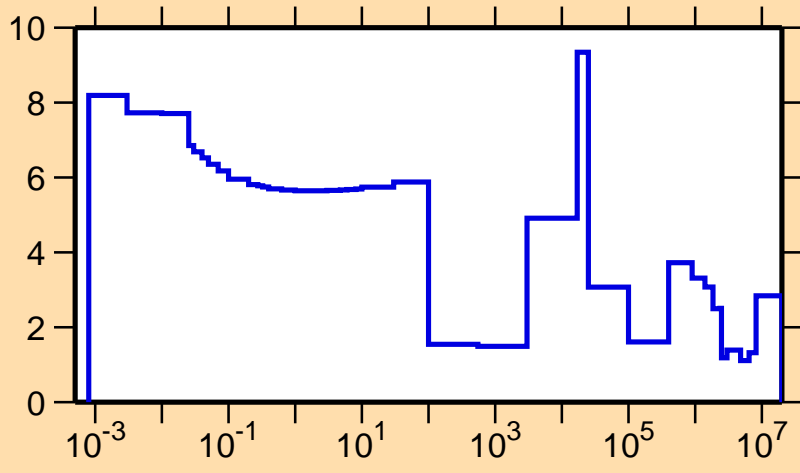



Correlation Matrix



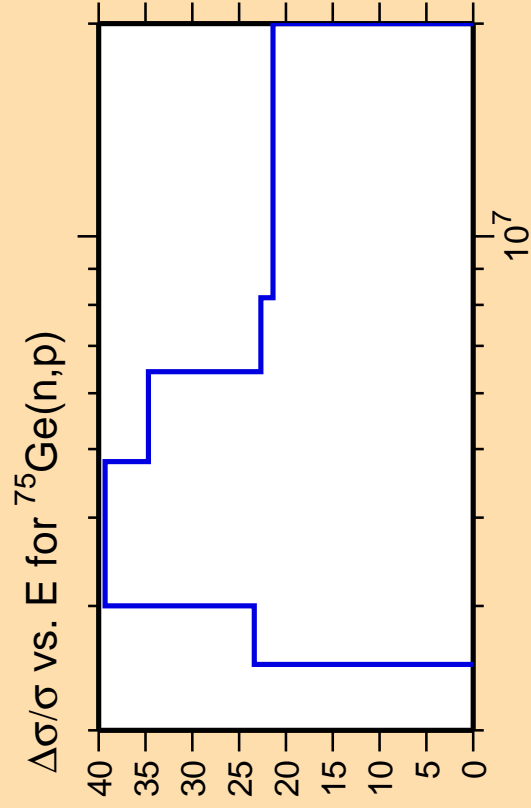


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

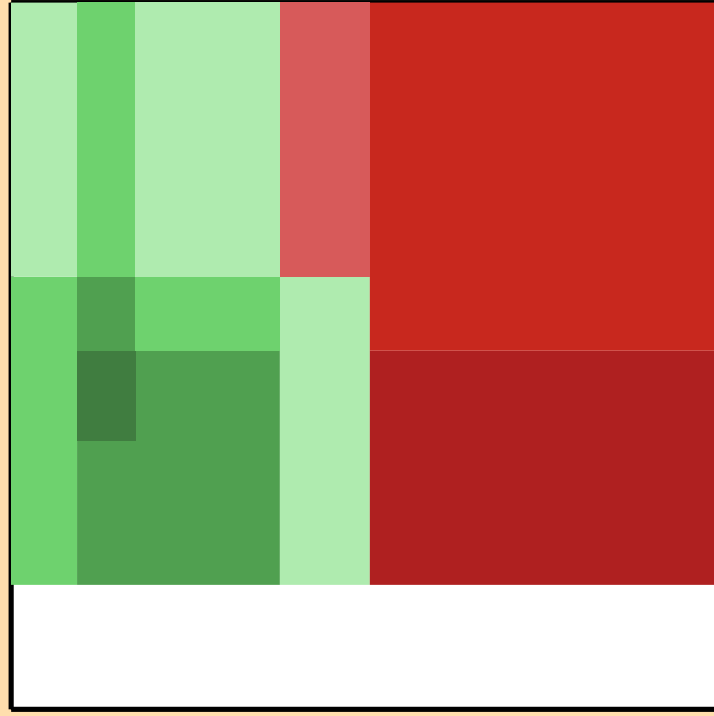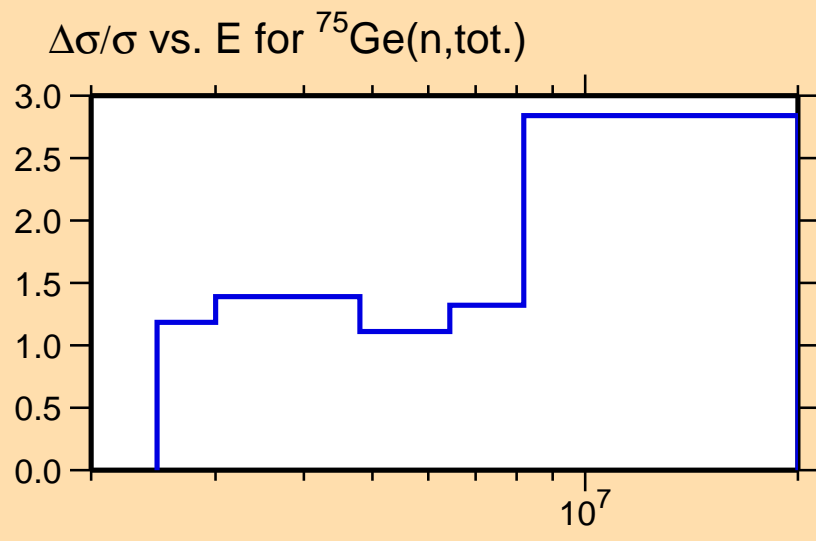



Correlation Matrix



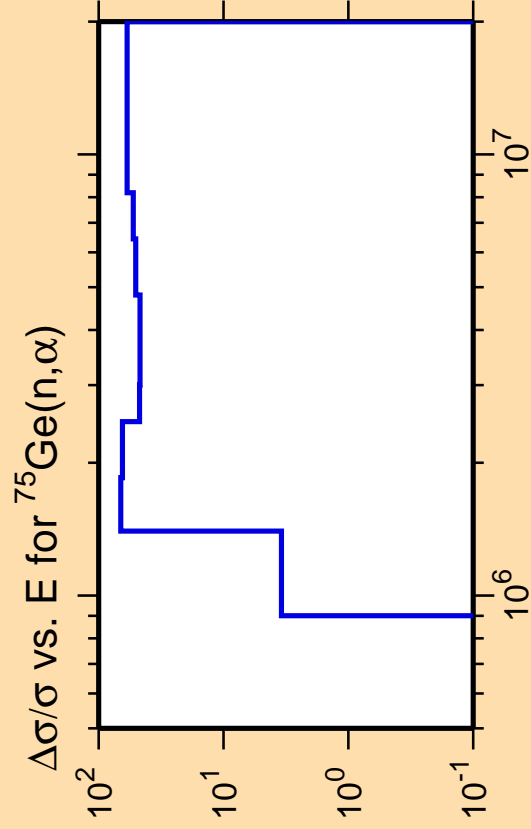

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

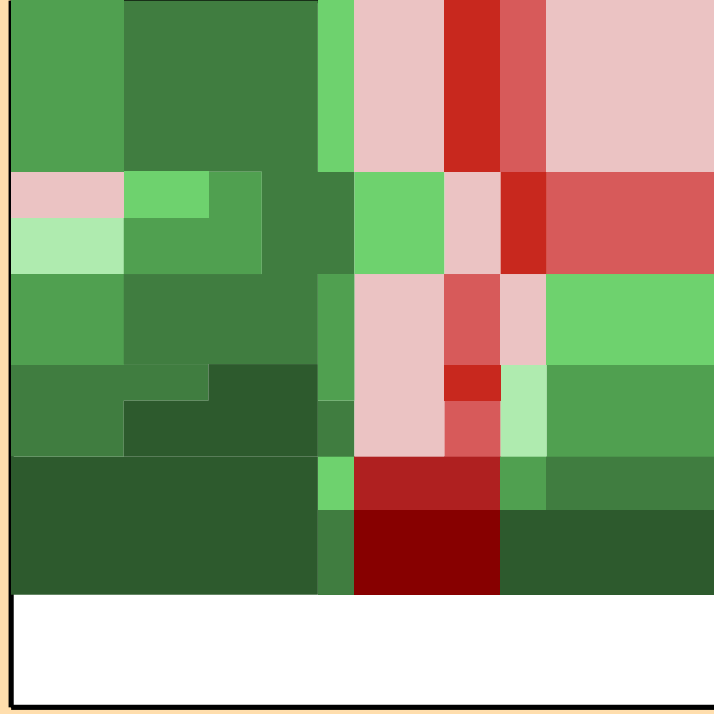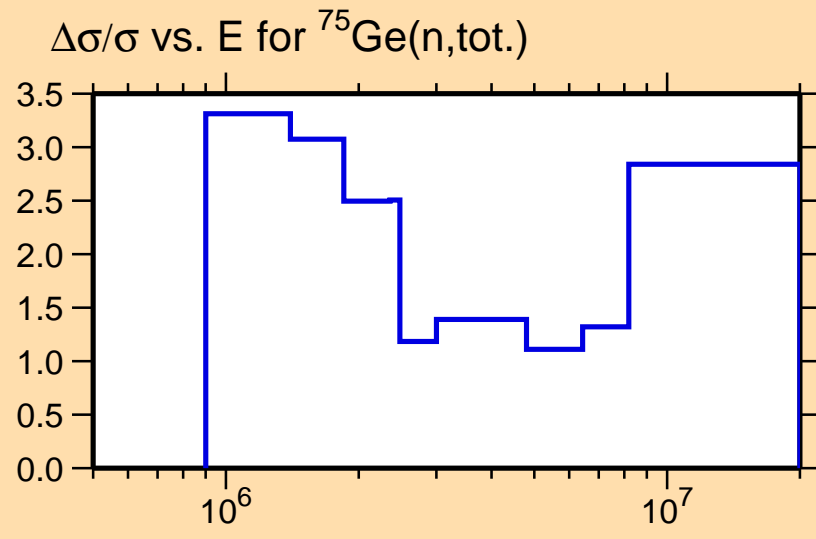

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

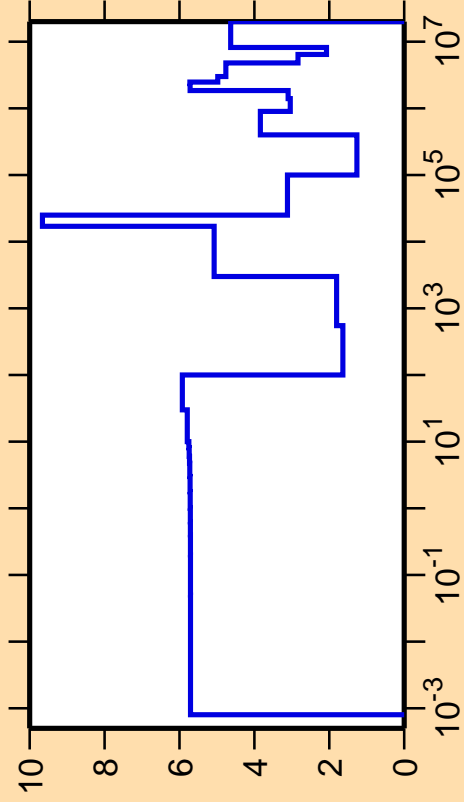

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{75}\text{Ge}(n,\text{el.})$

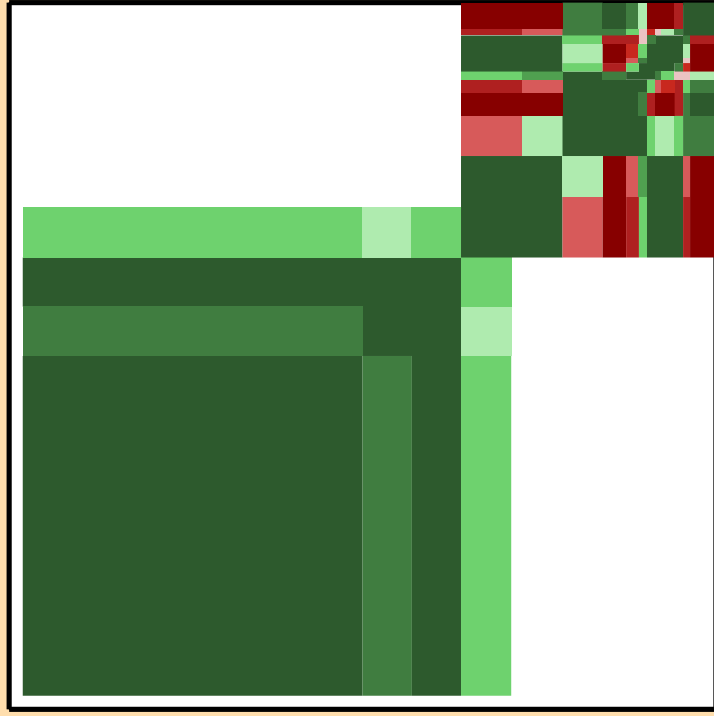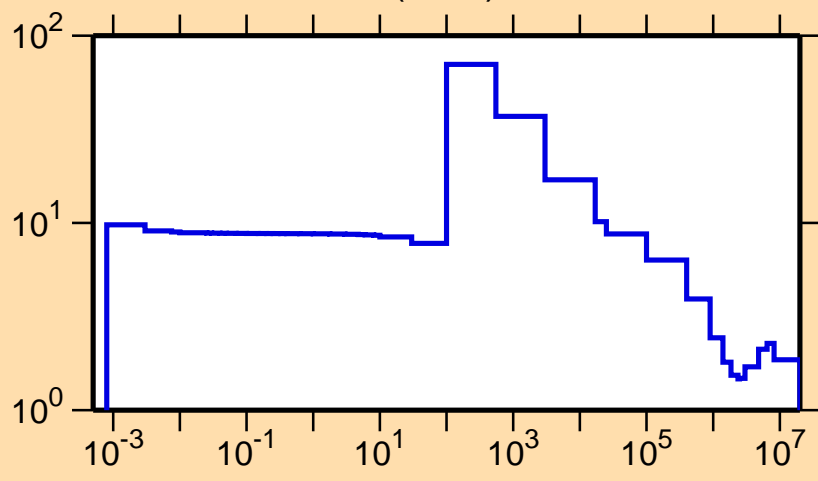

Correlation Matrix




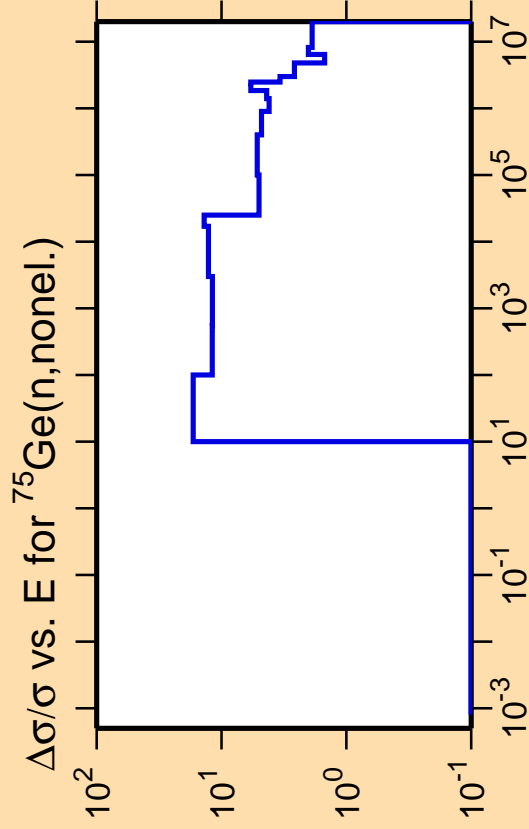


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

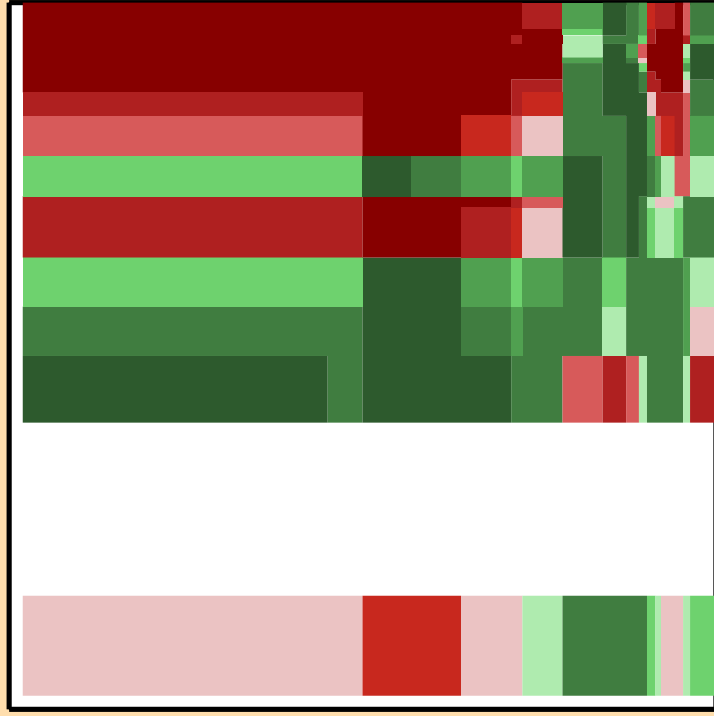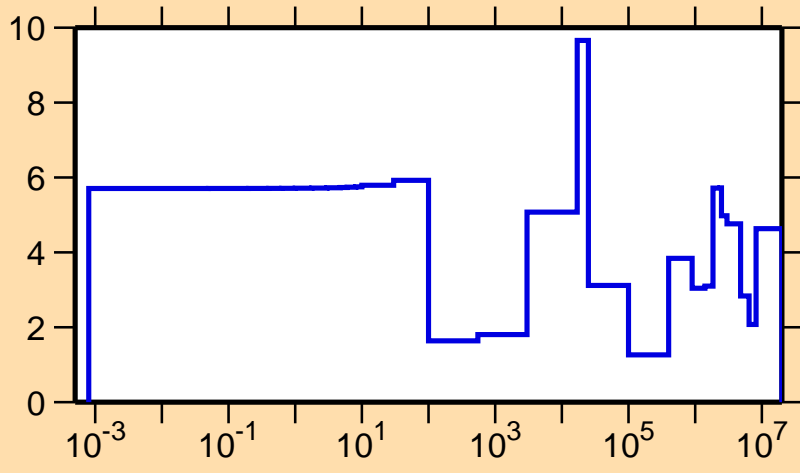

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{inel.})$

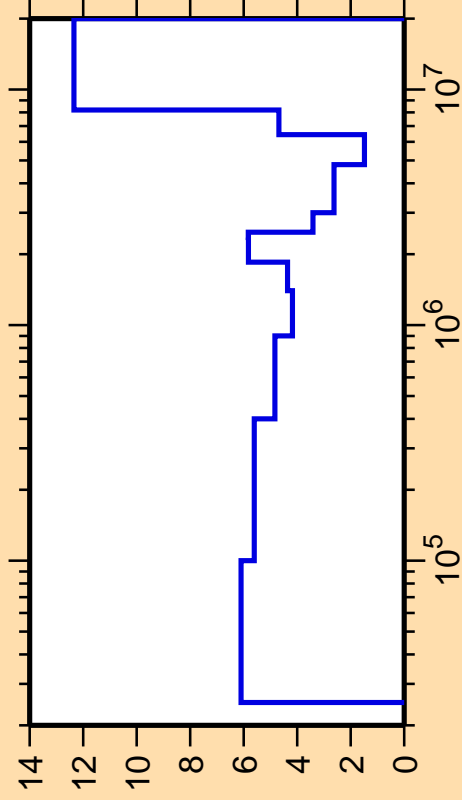

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

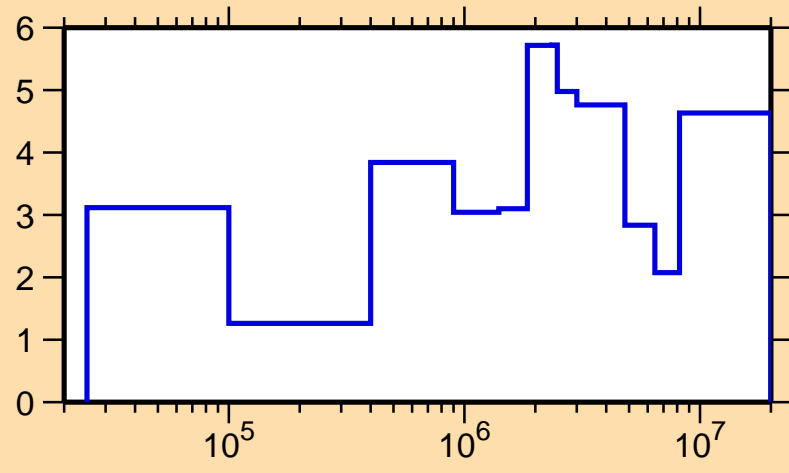

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

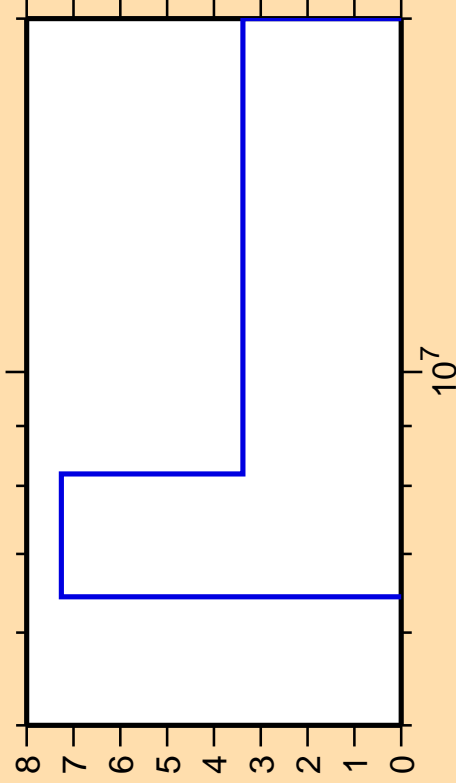

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

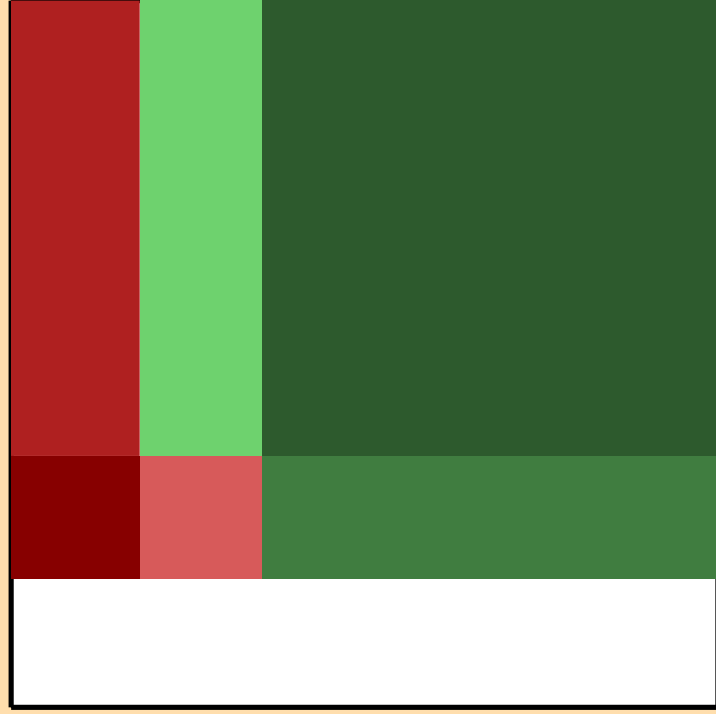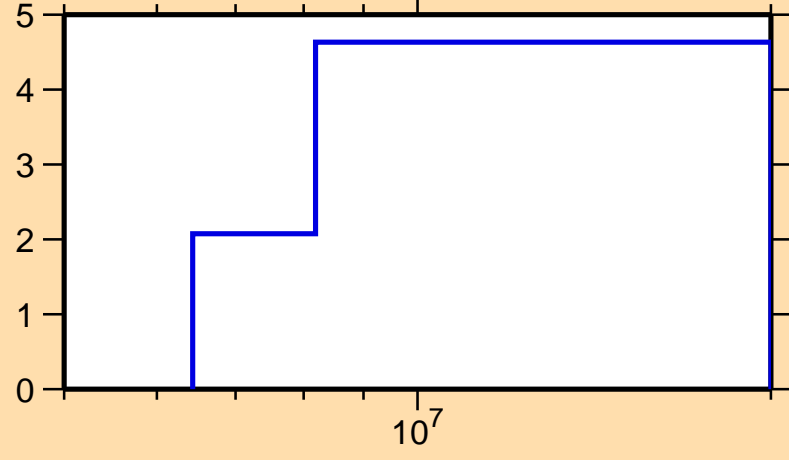



Correlation Matrix



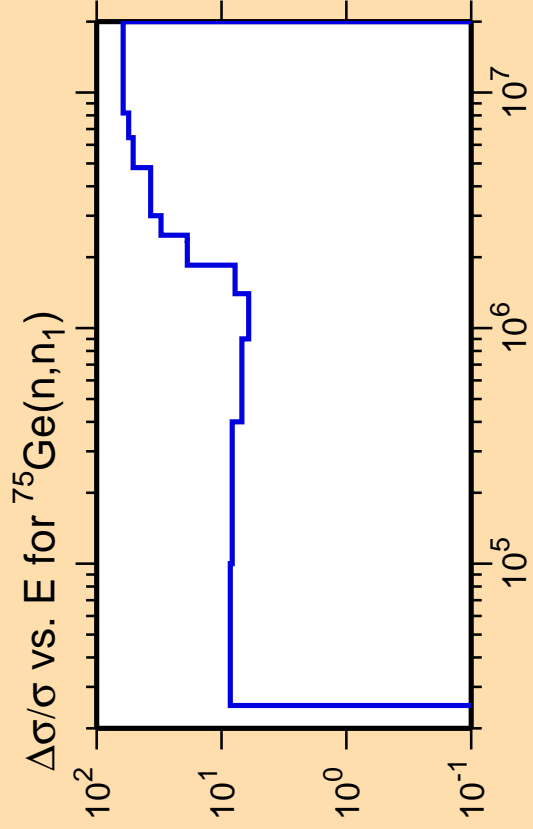



Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

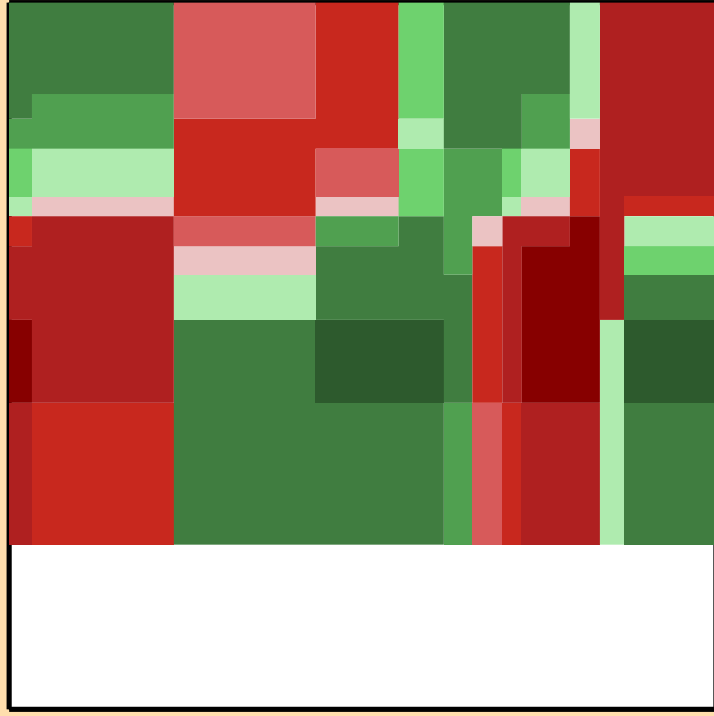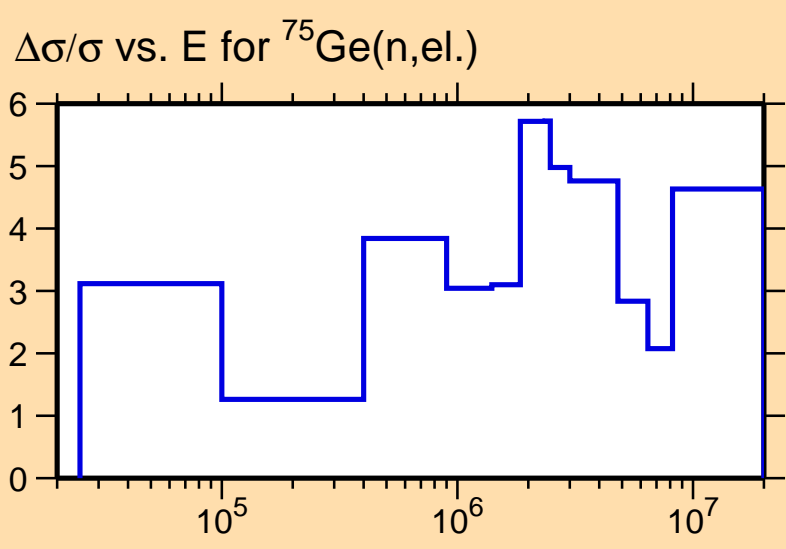

Correlation Matrix


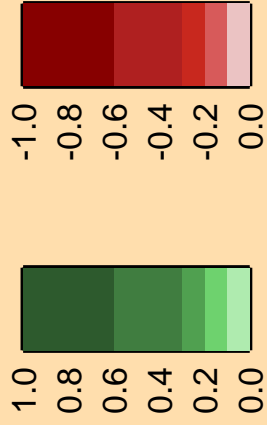


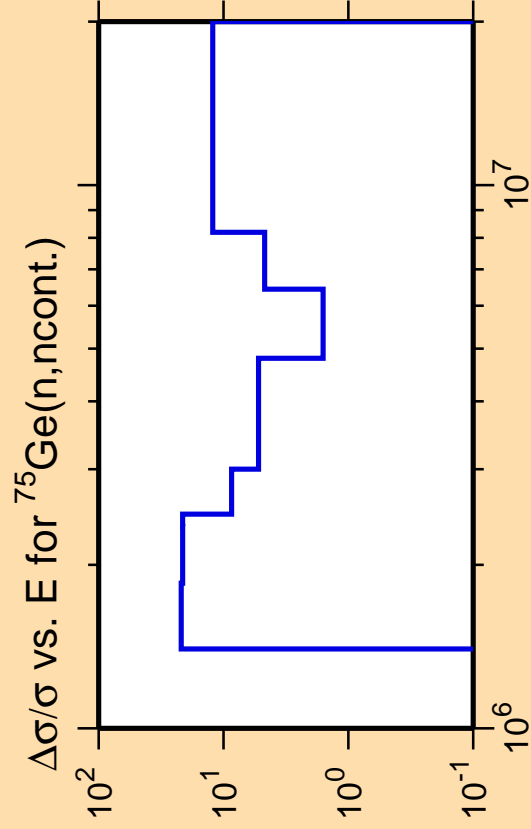

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

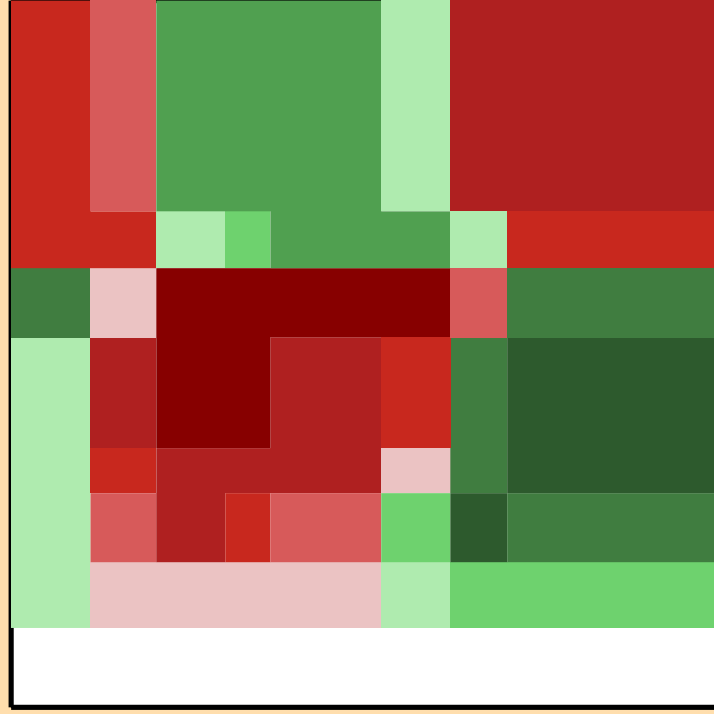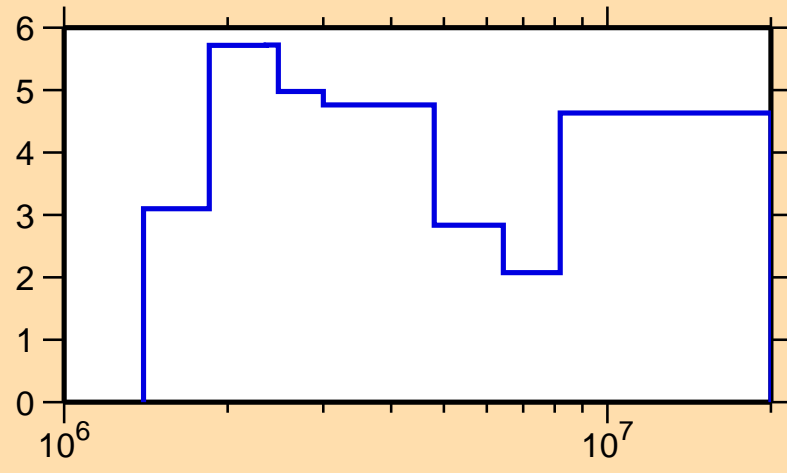

Correlation Matrix





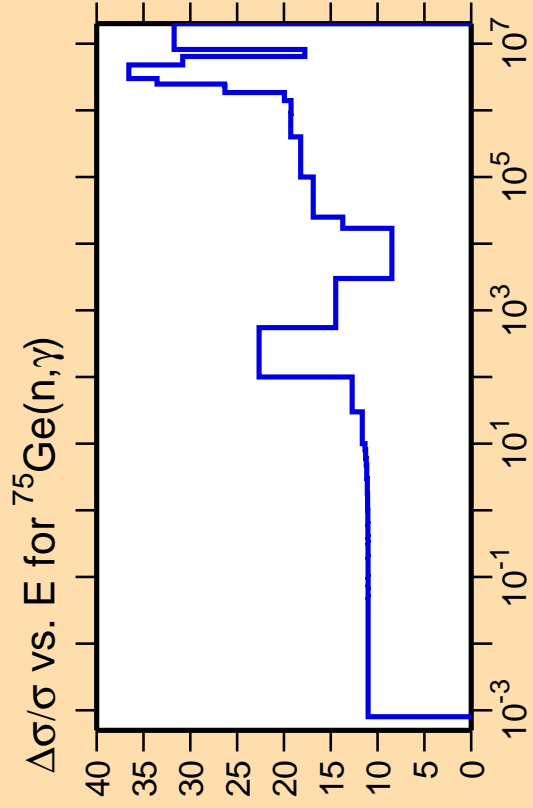

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

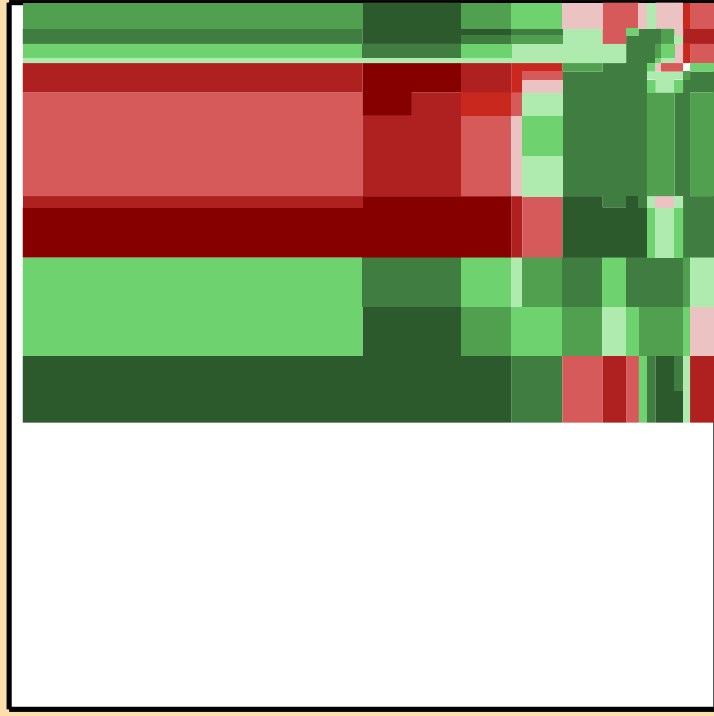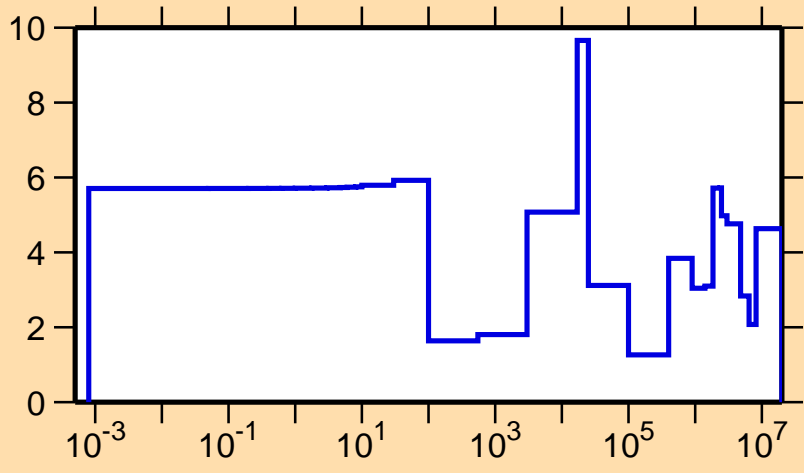

Correlation Matrix





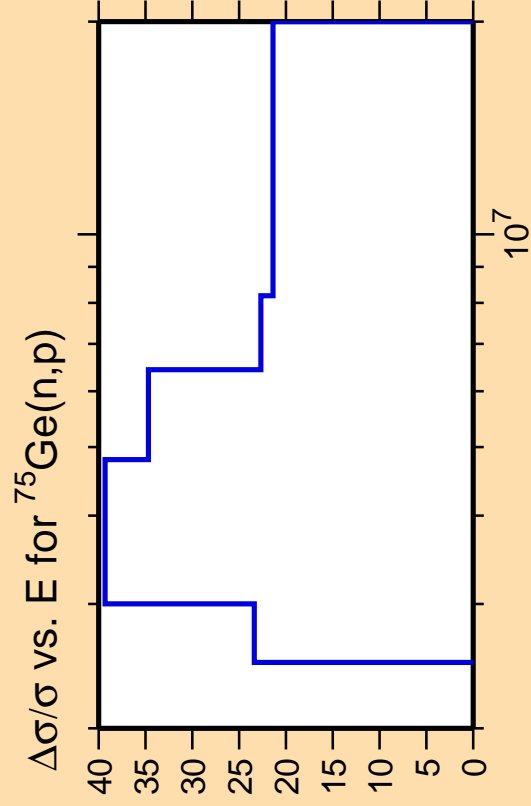

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

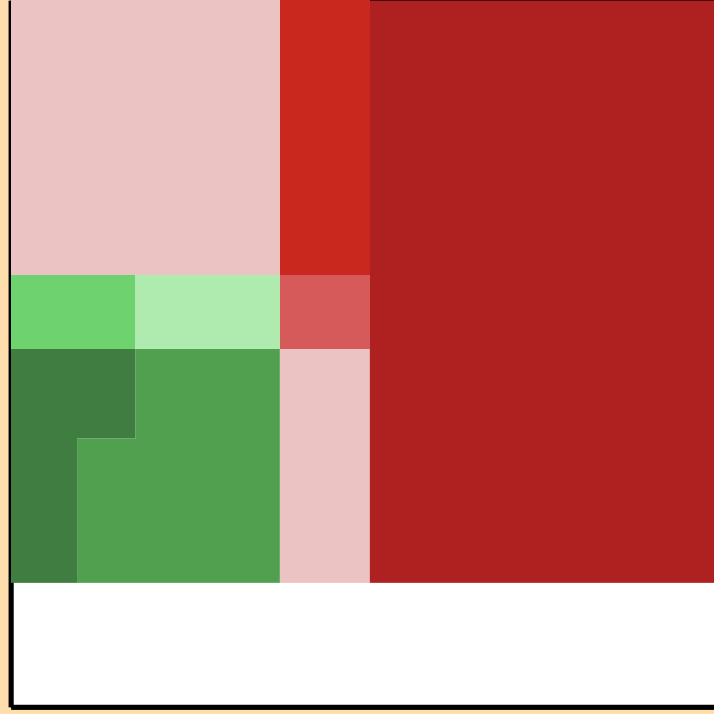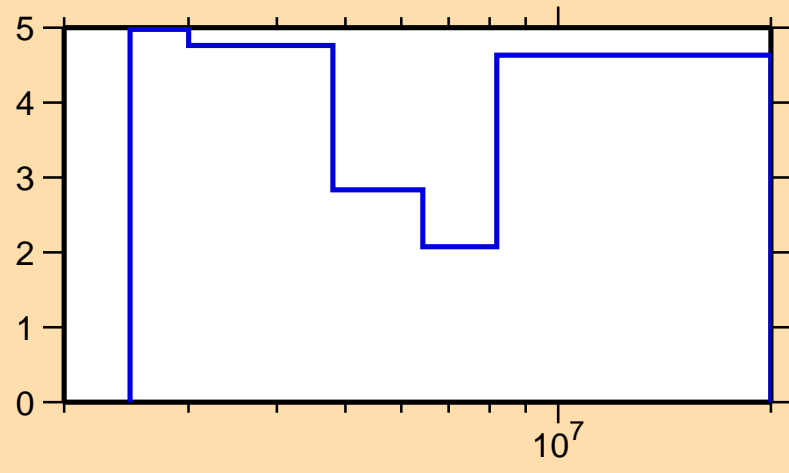

Correlation Matrix





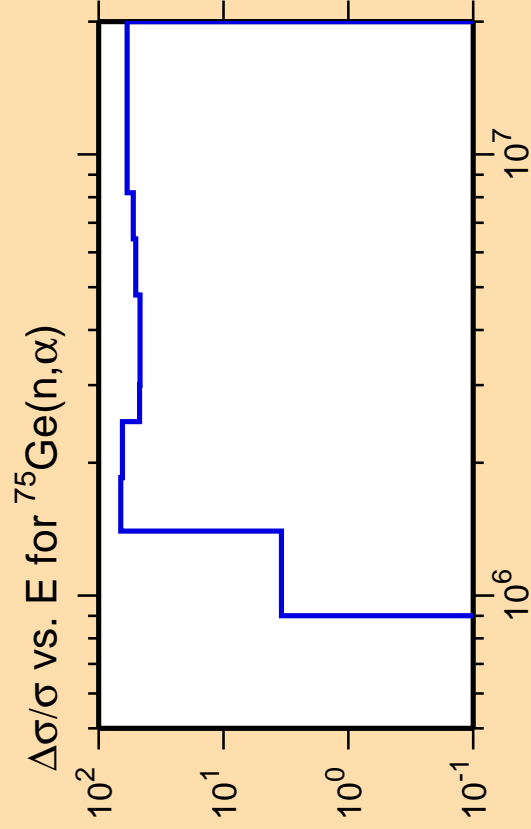

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{el.})$

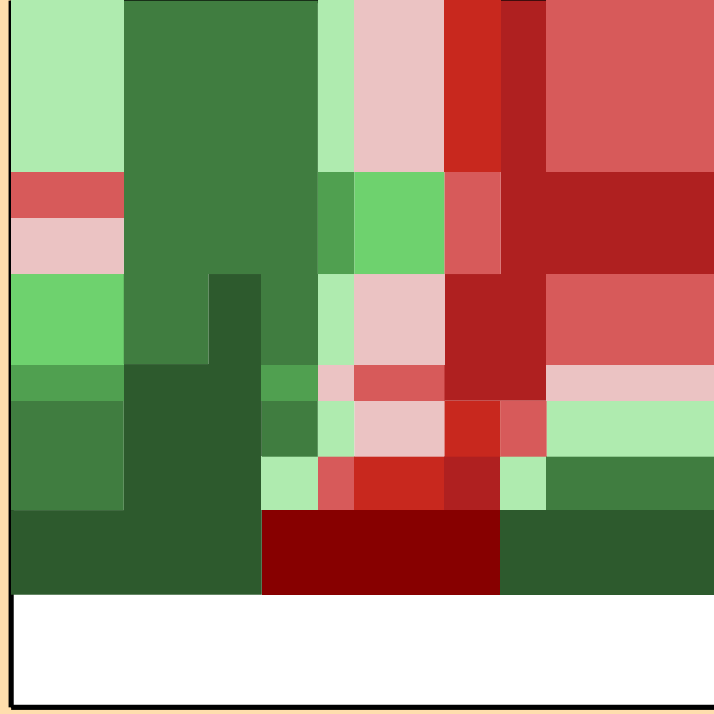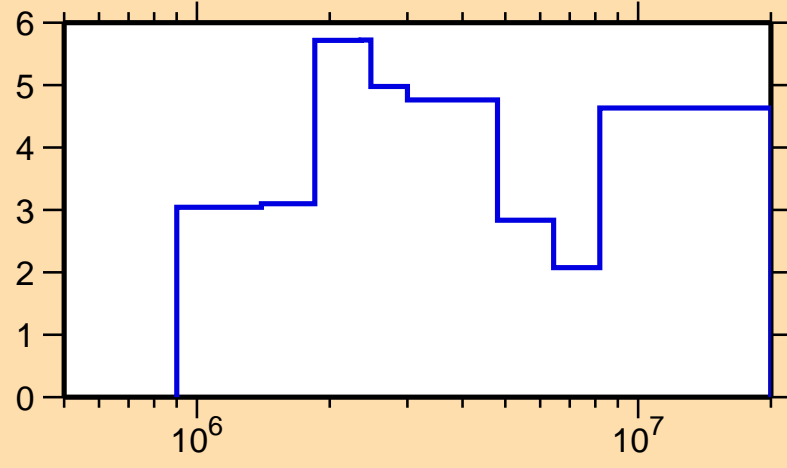

Correlation Matrix





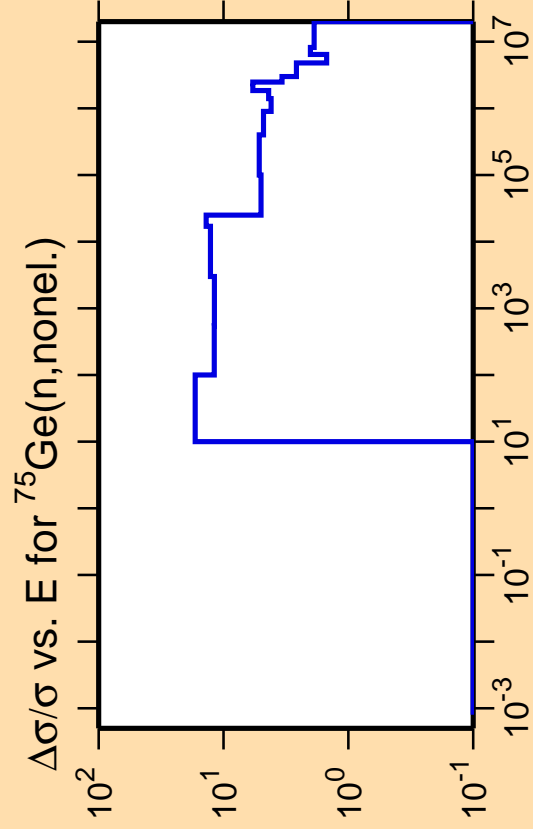

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

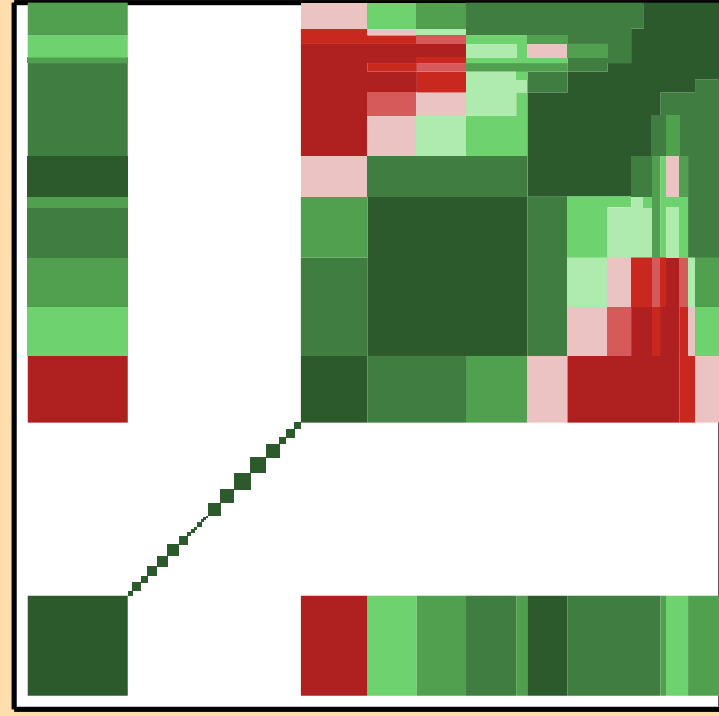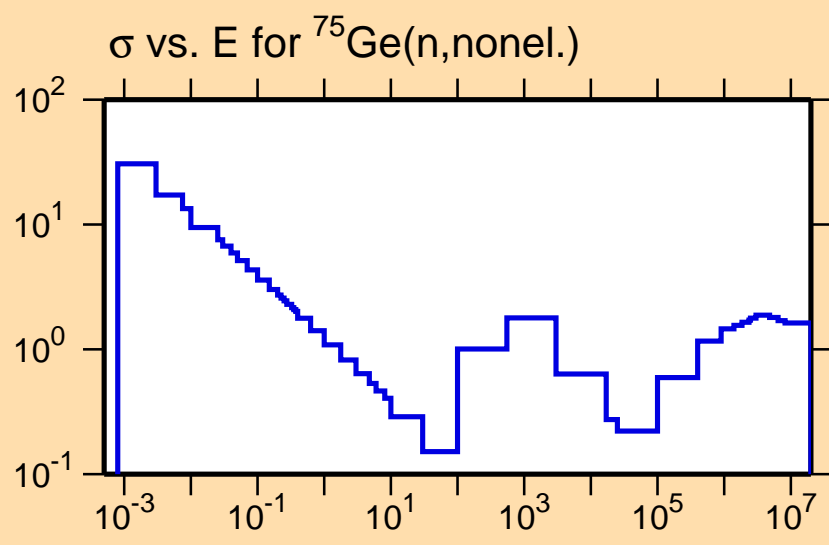

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{inel.})$

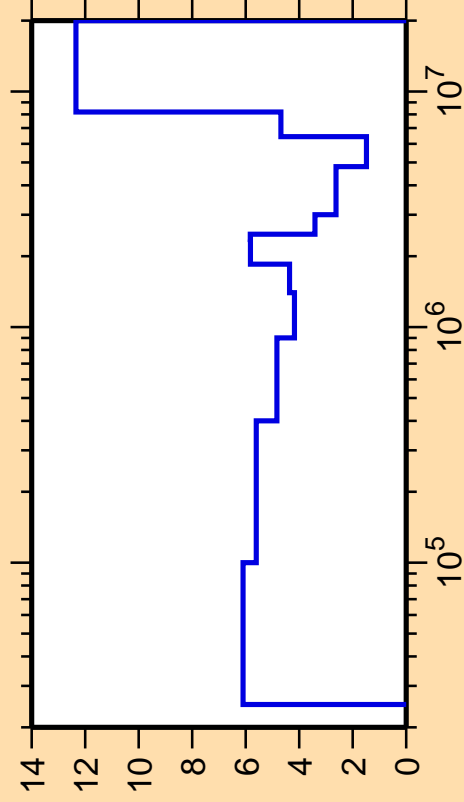

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{nonel.})$

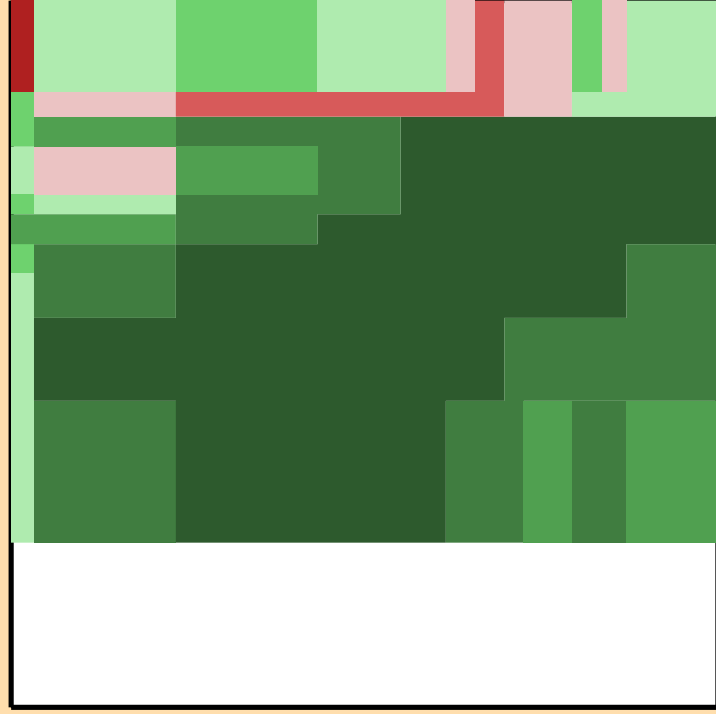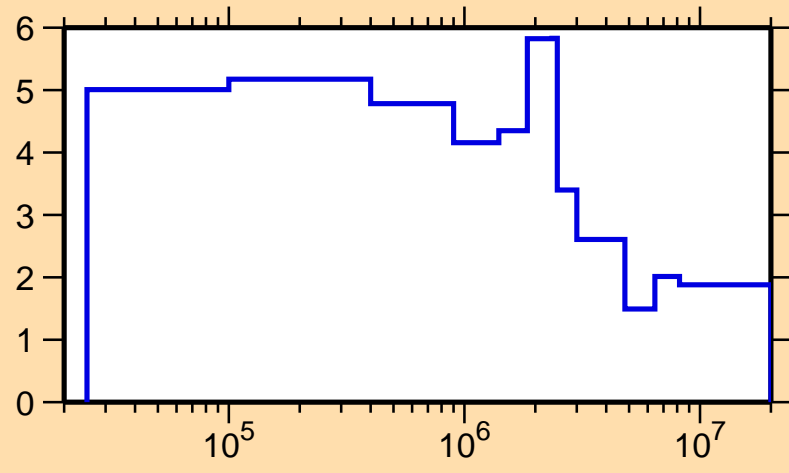

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

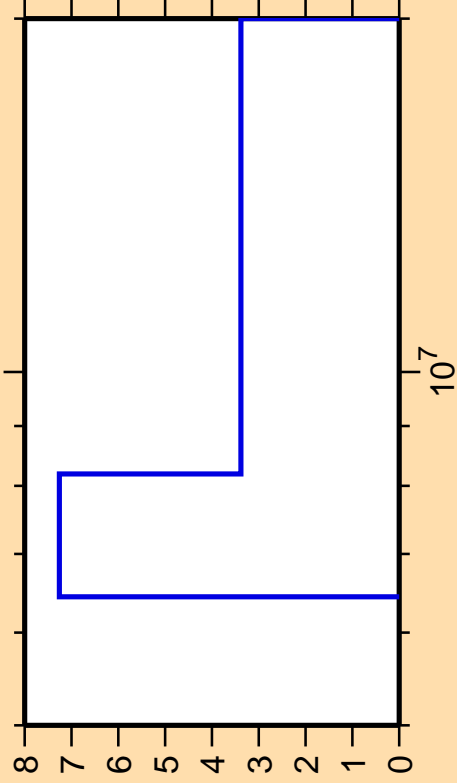

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{nonel.})$

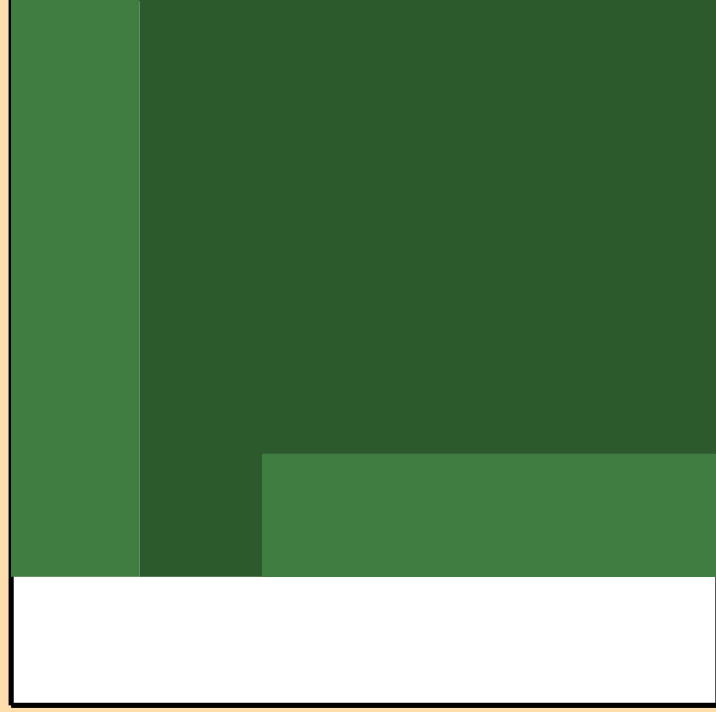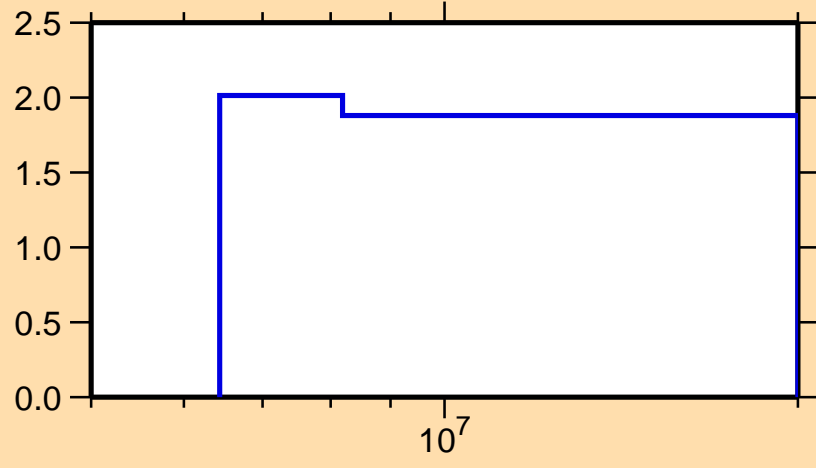

Correlation Matrix





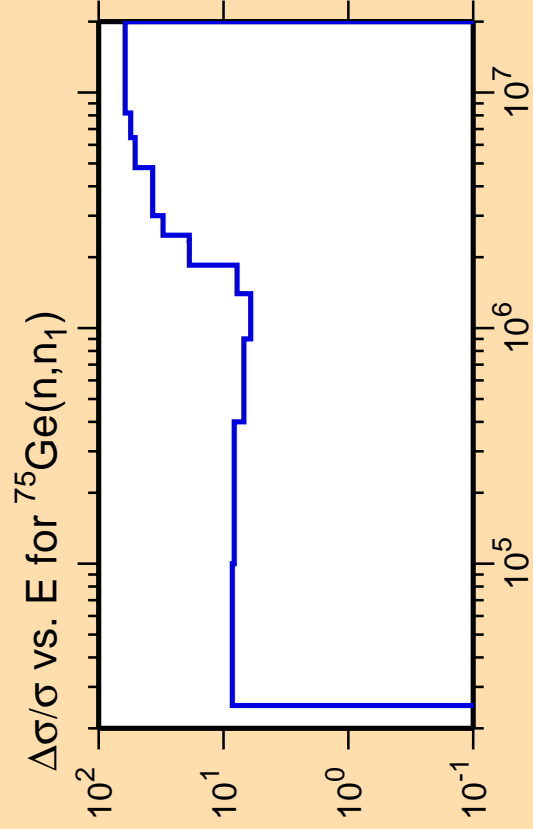

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{nonel.})$

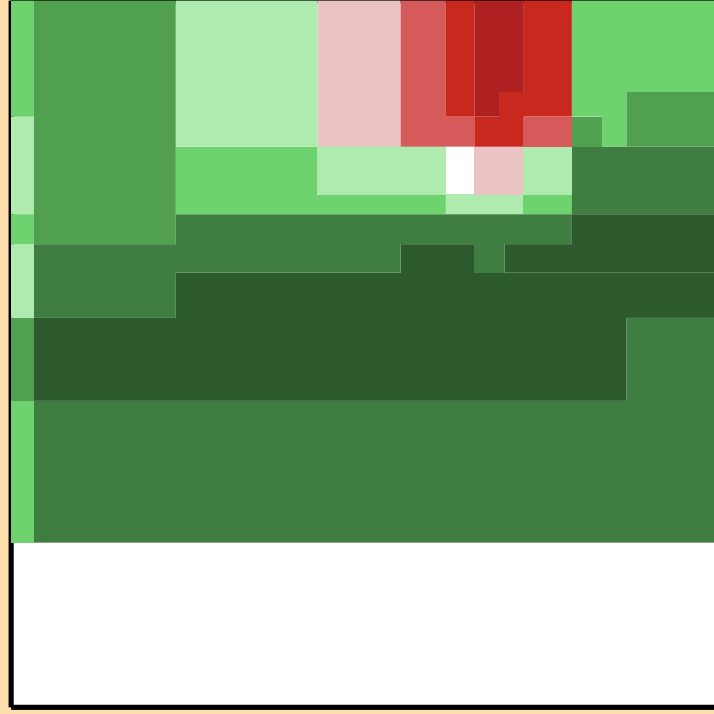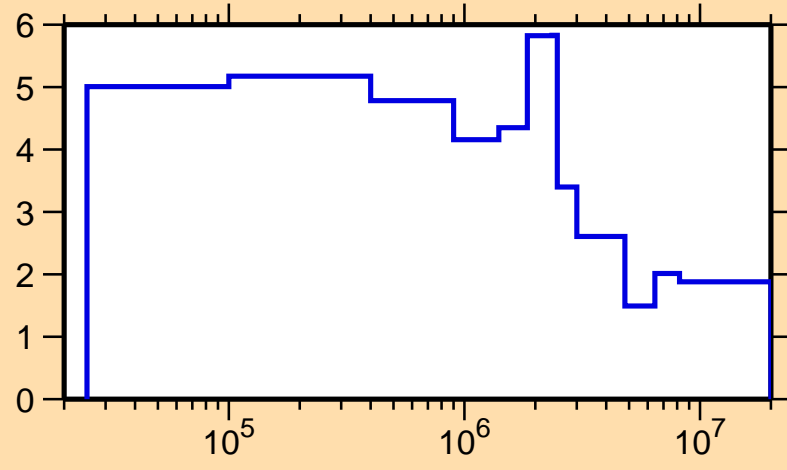

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n\text{cont.})$

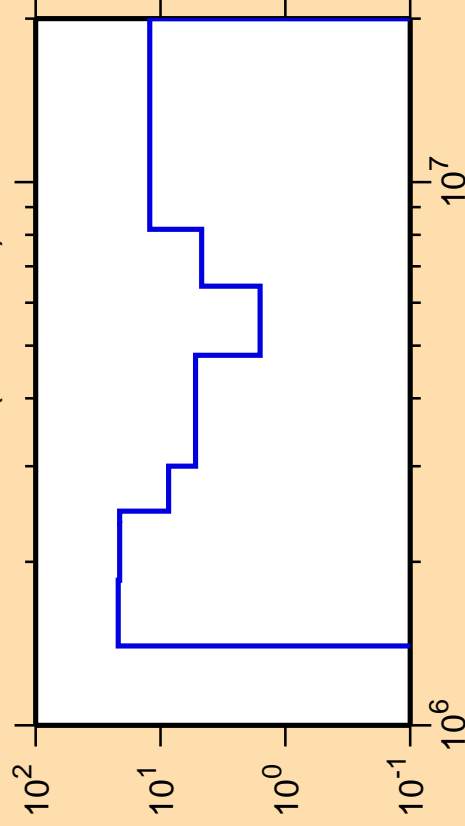

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n\text{onel.})$

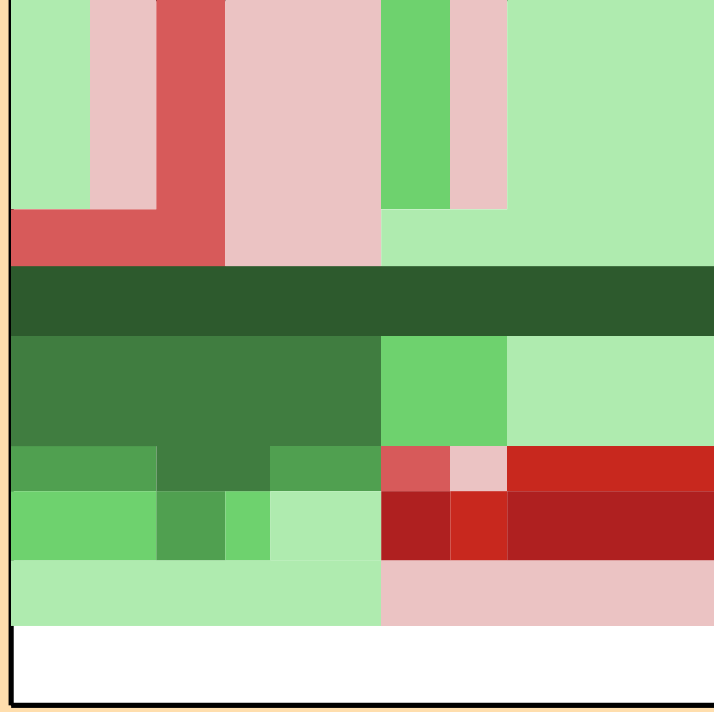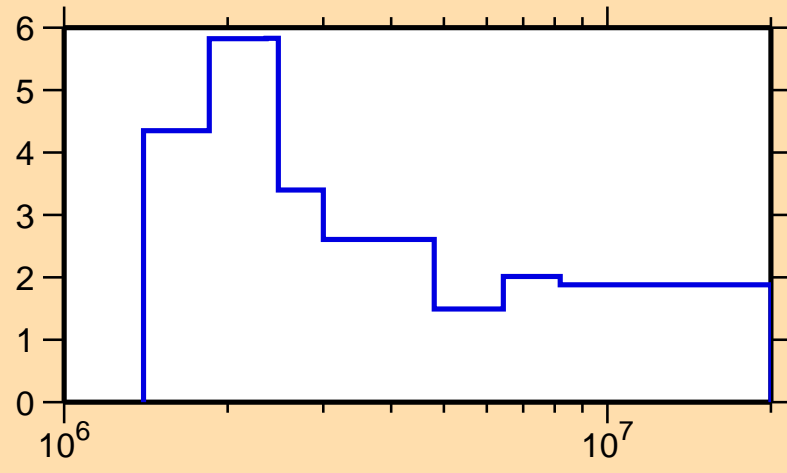

Correlation Matrix




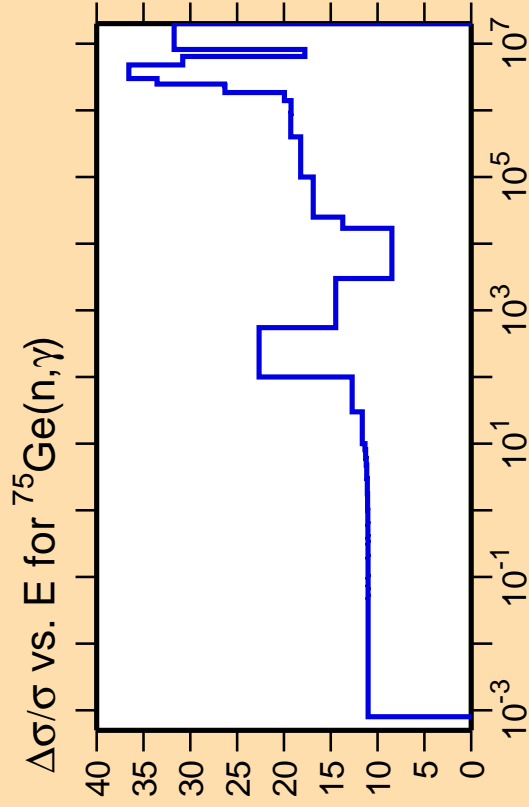


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{nonel.})$

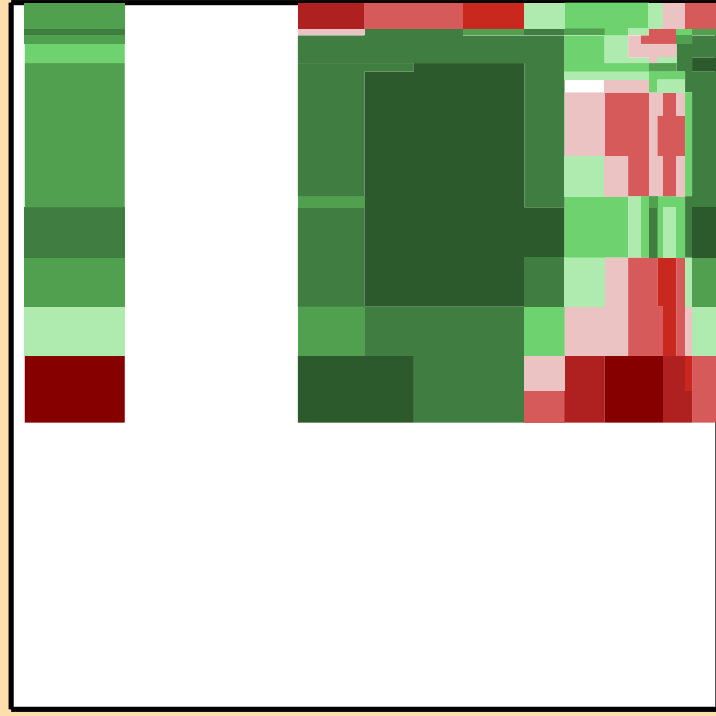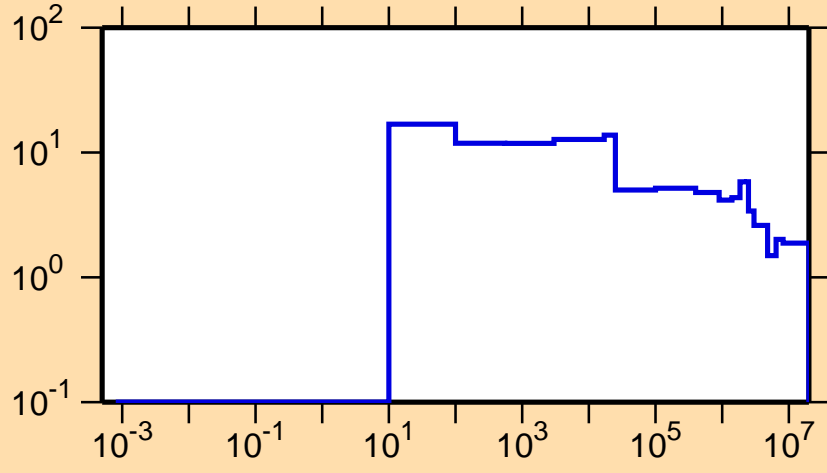



Correlation Matrix



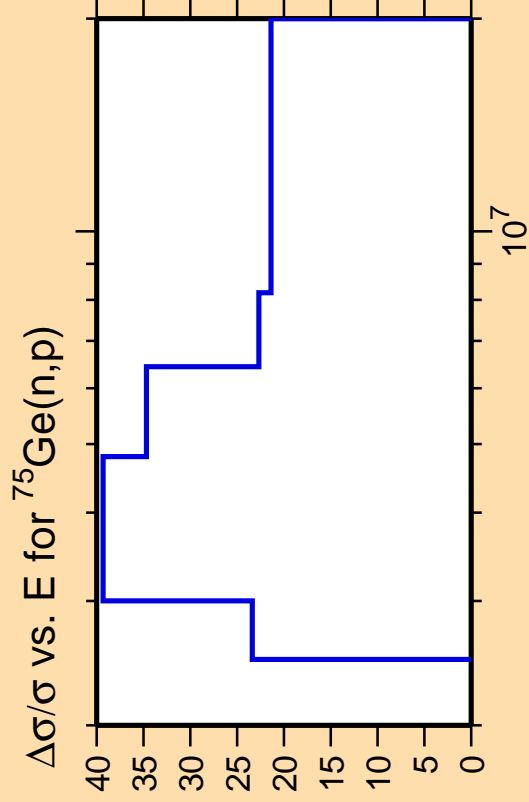


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

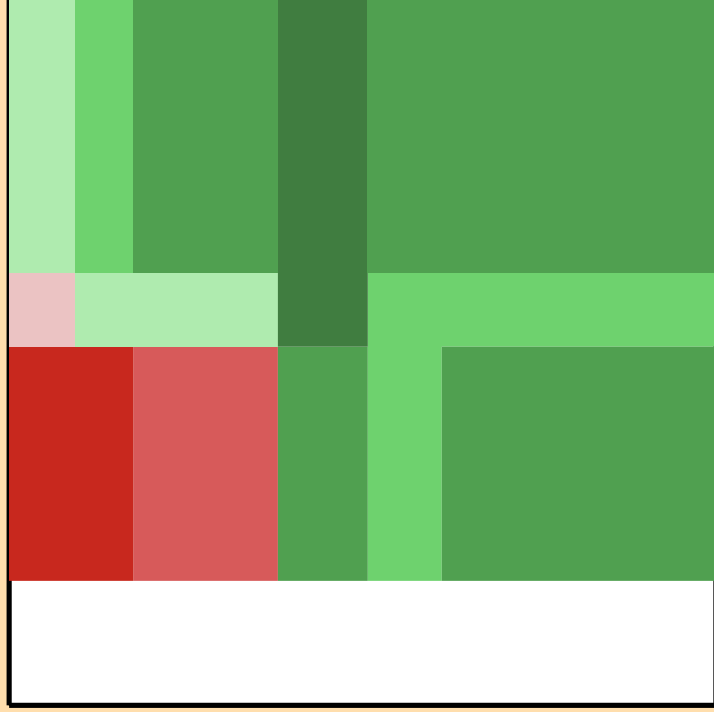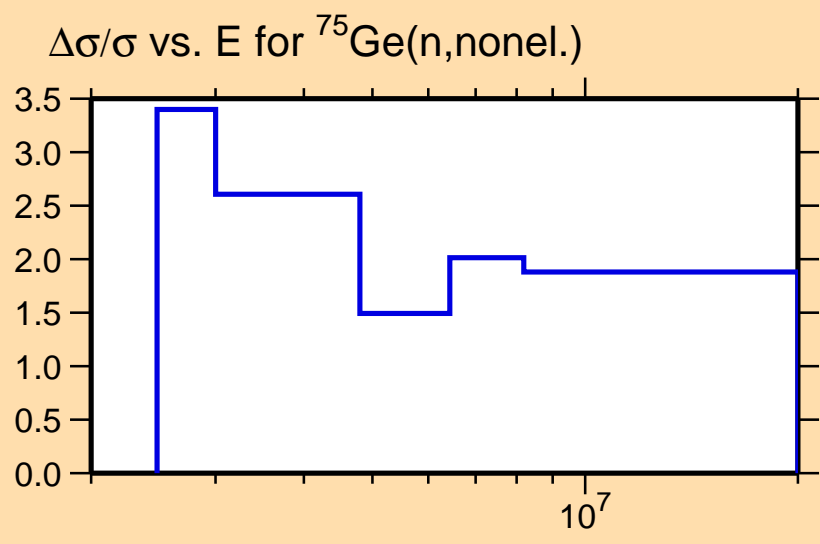


Correlation Matrix



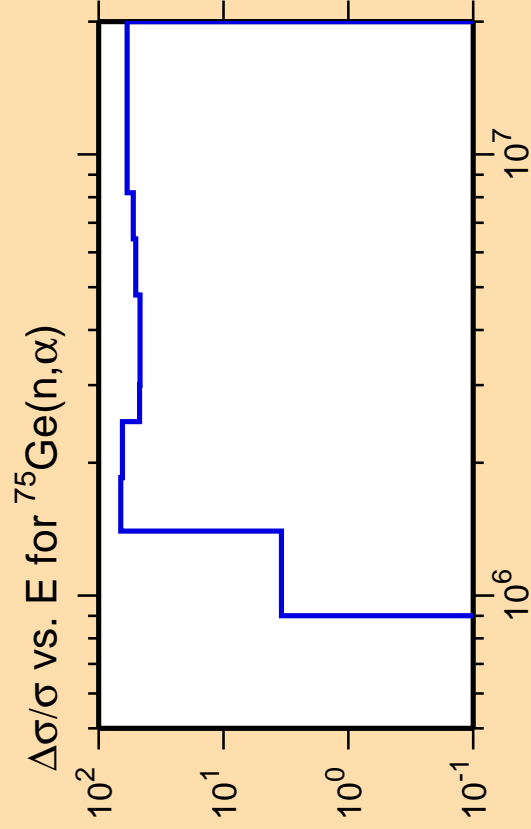

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

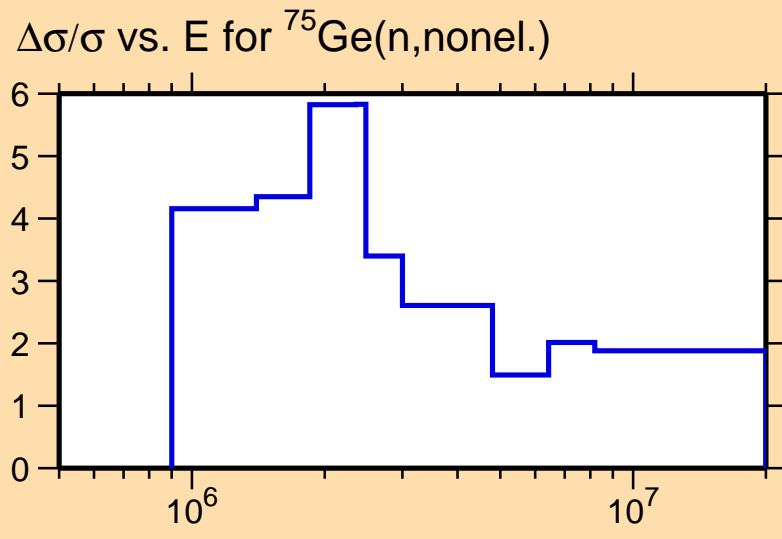

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{inel.})$

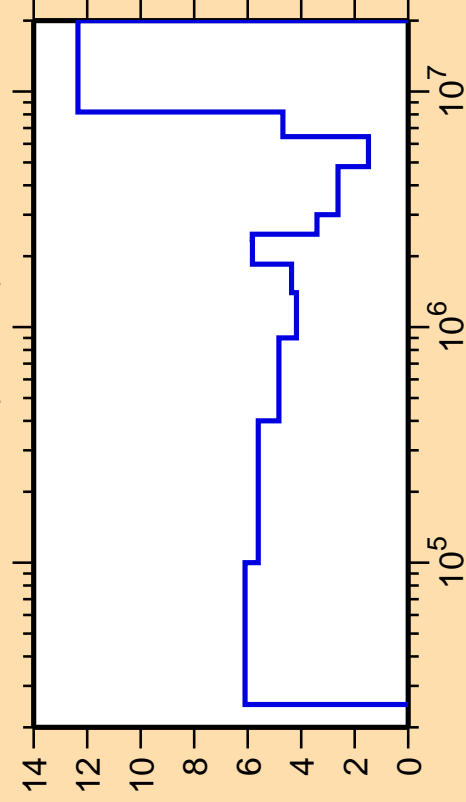

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{75}\text{Ge}(n,\text{inel.})$

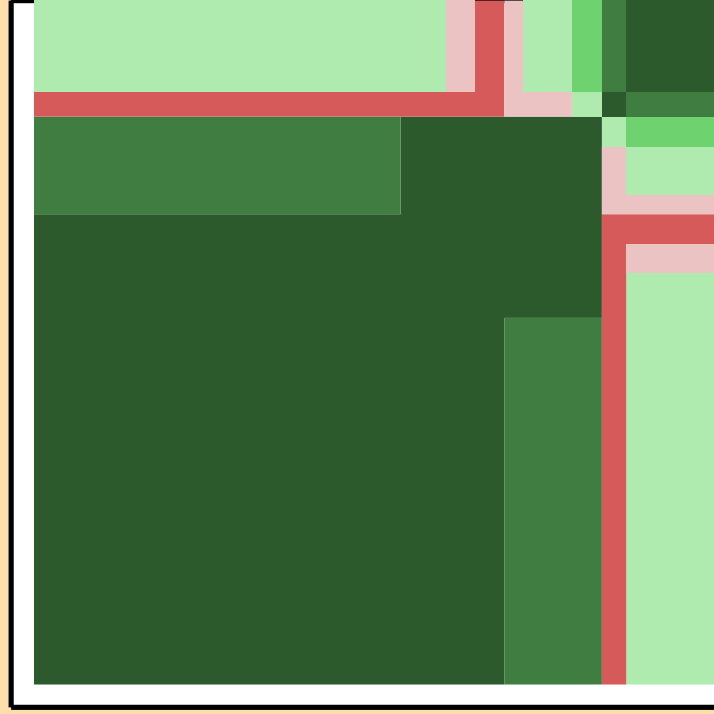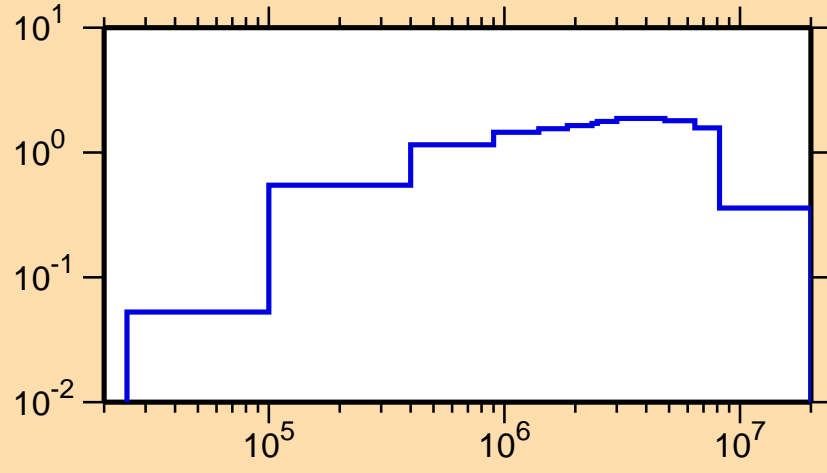

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

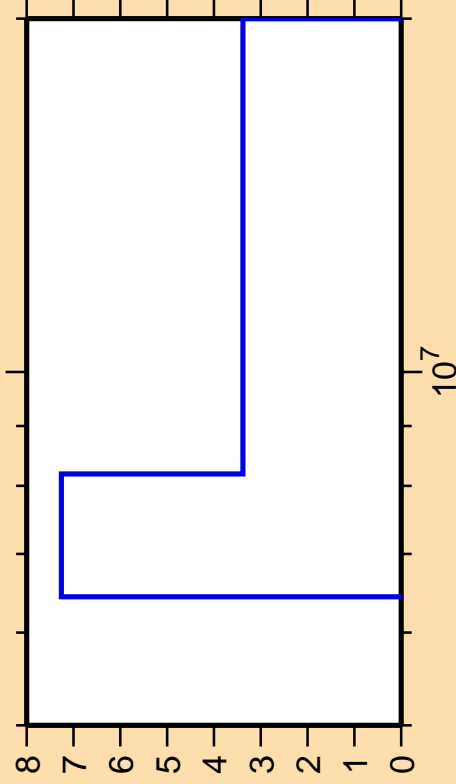

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

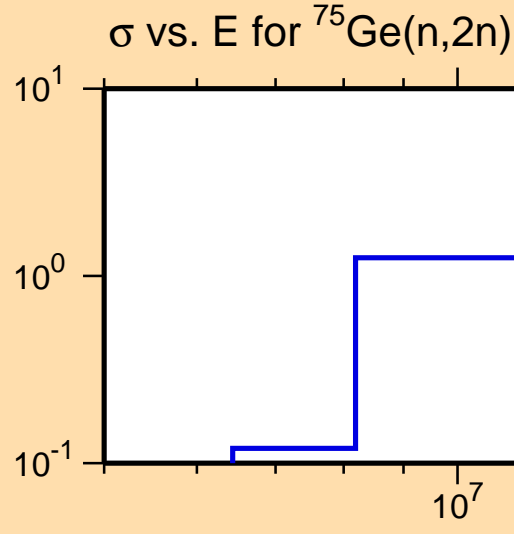

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n_1)$


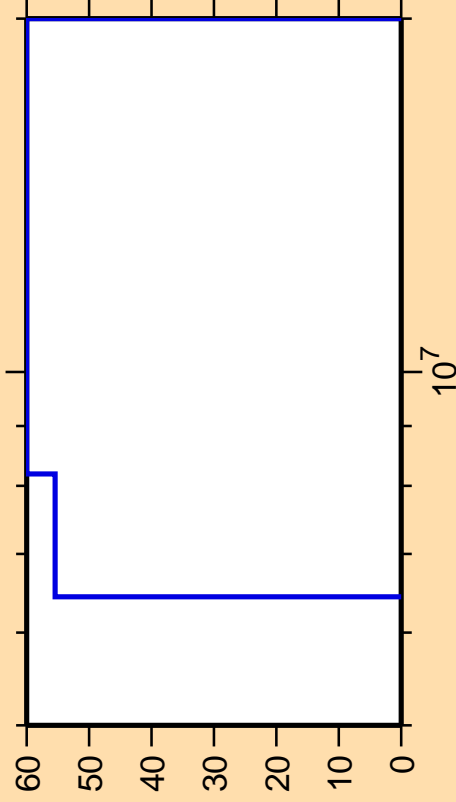


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

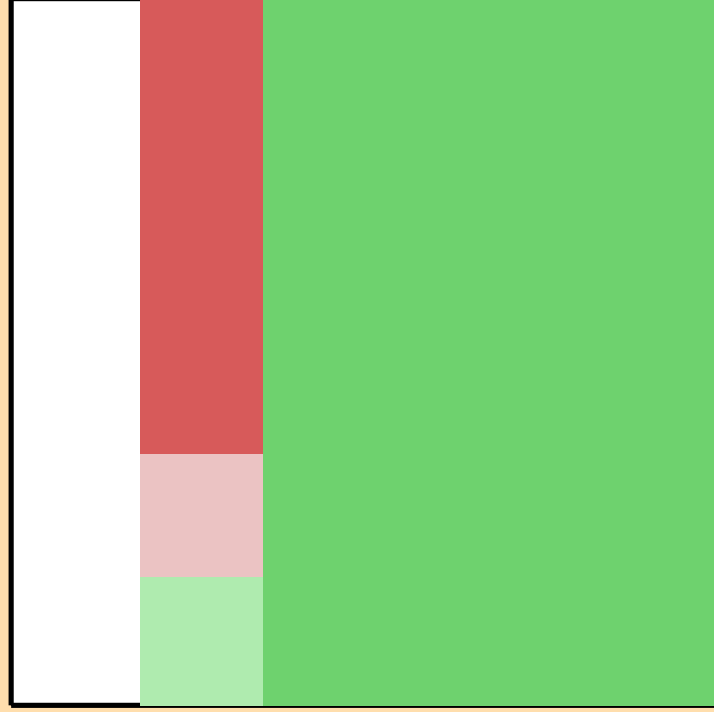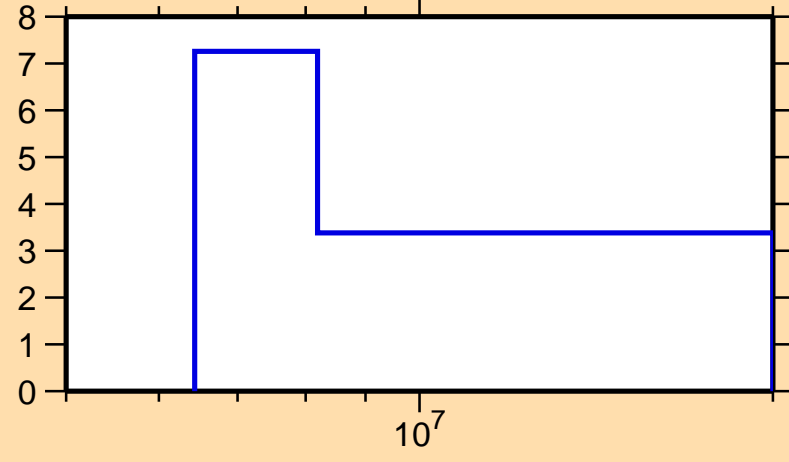

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n\text{cont.})$

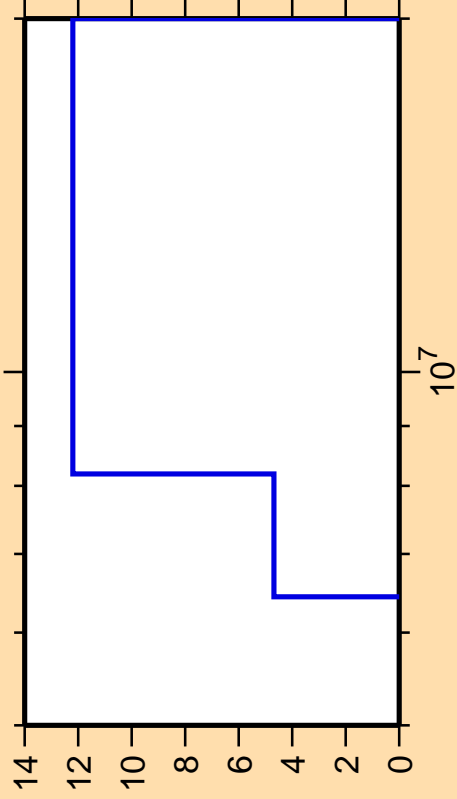

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

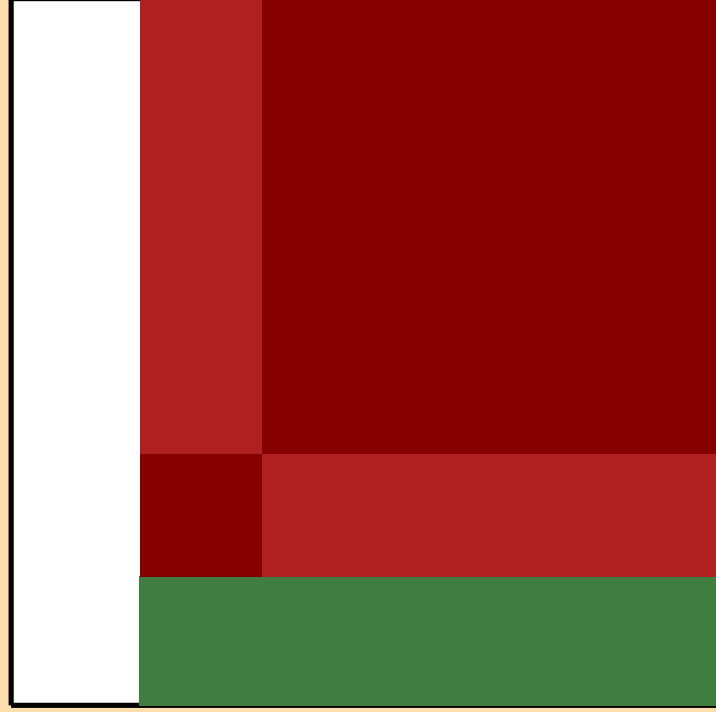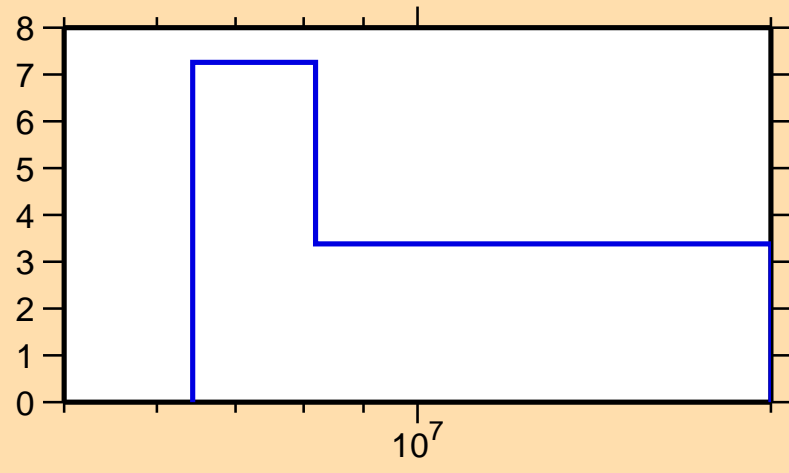

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\gamma)$

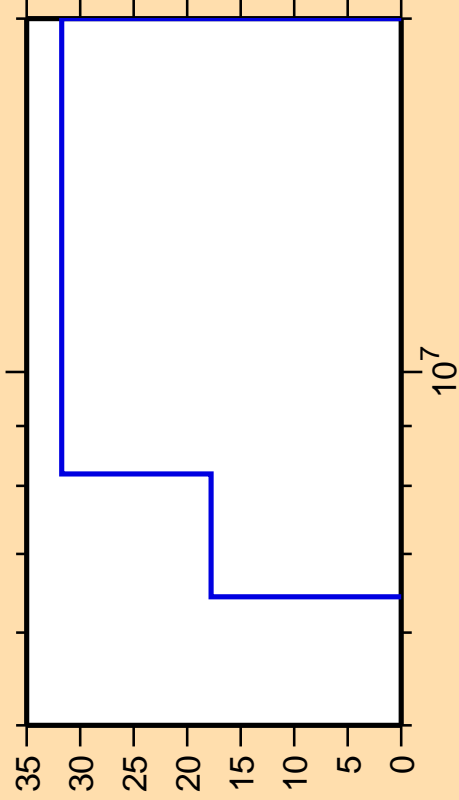

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

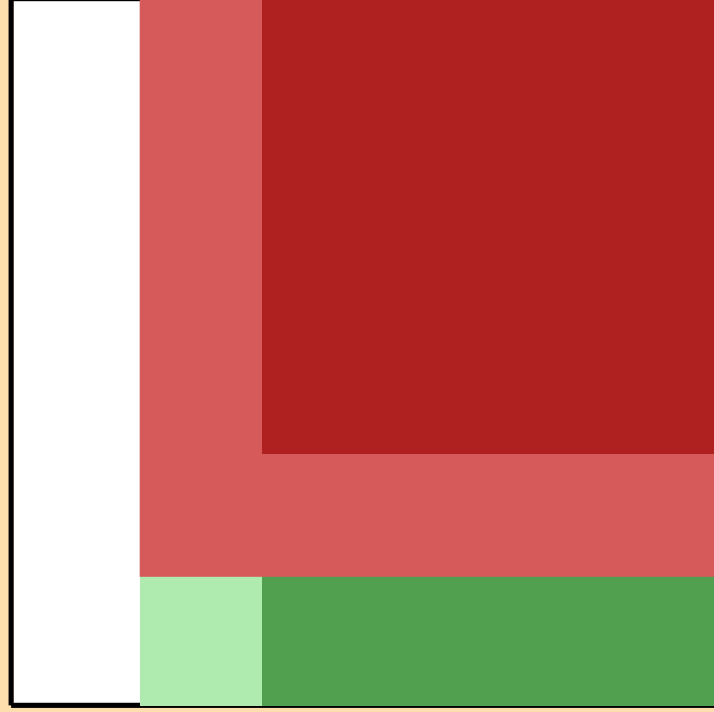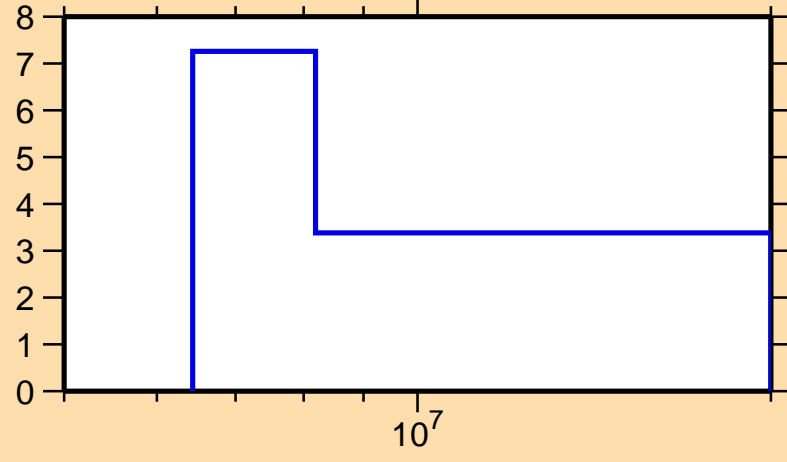

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,p)$

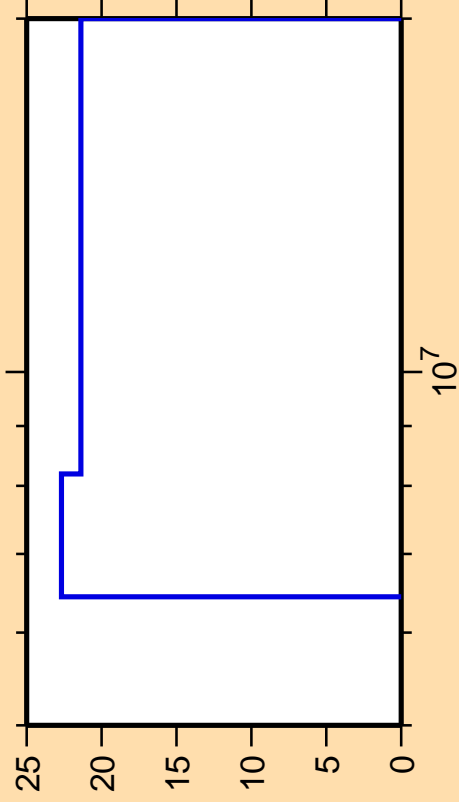

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

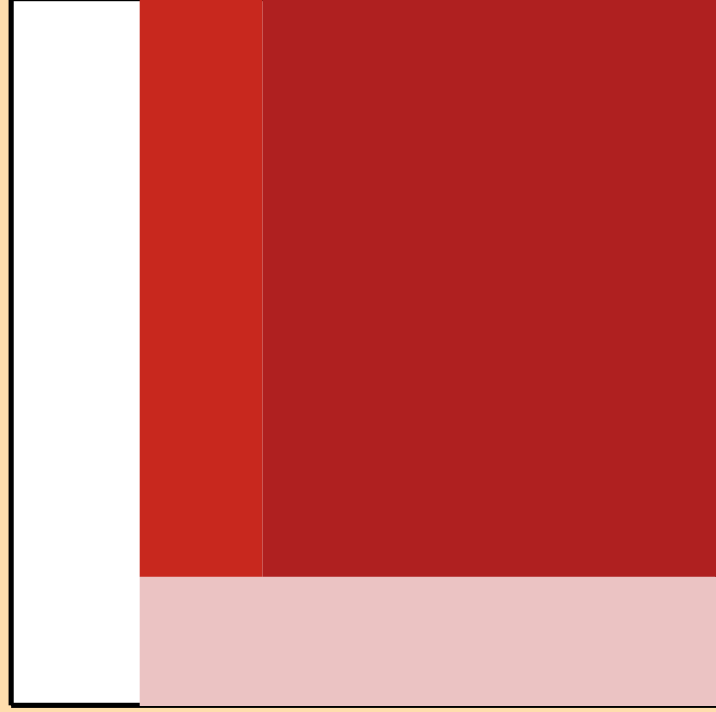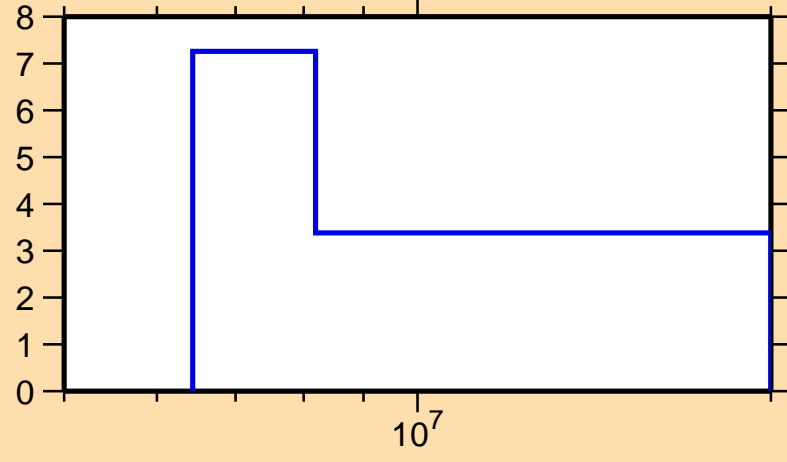

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\alpha)$

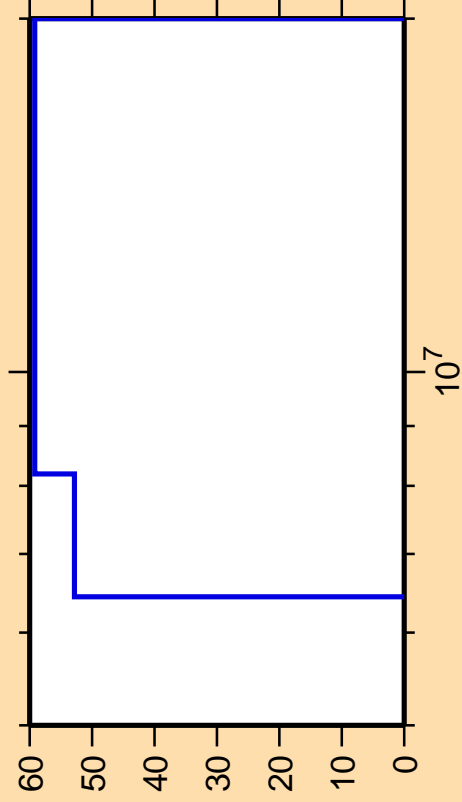

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n)$

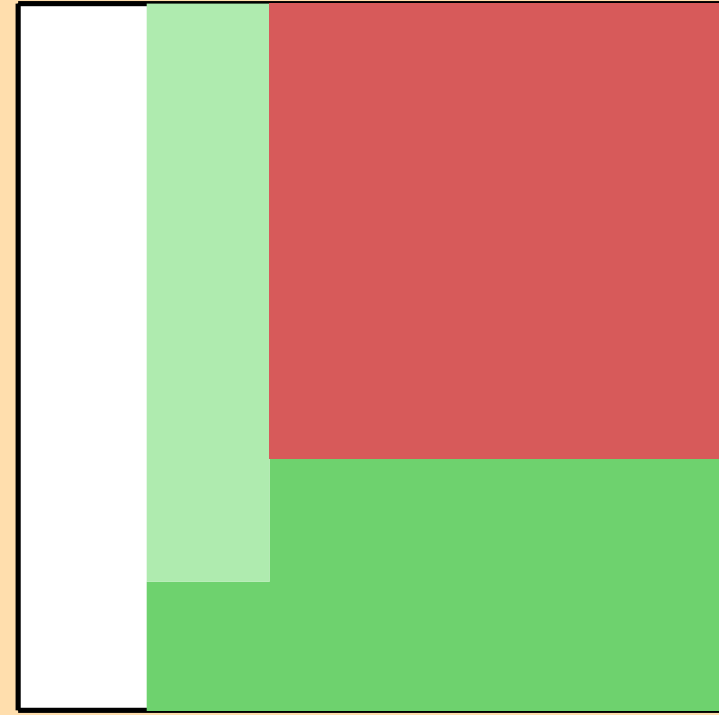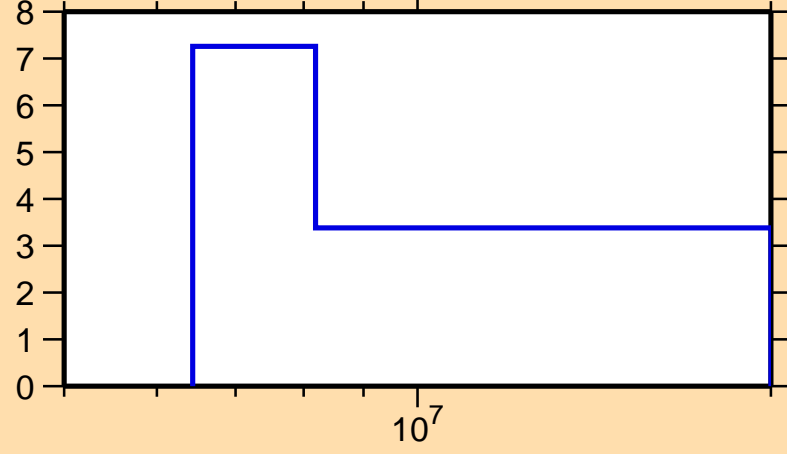

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,3n)$

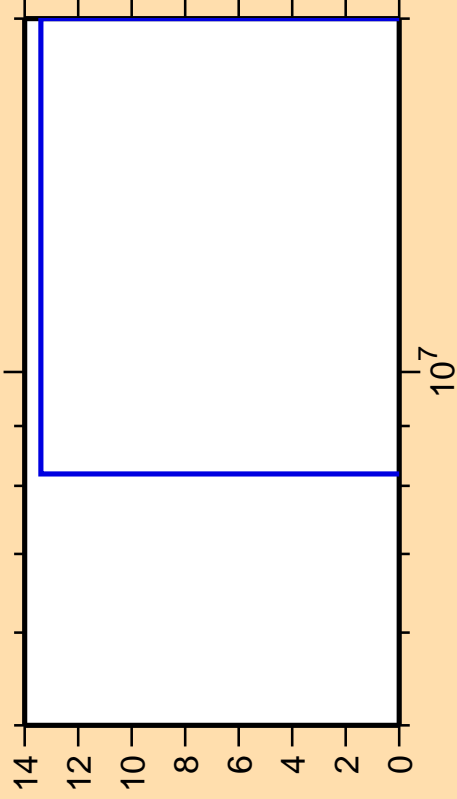

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{75}\text{Ge}(n,3n)$

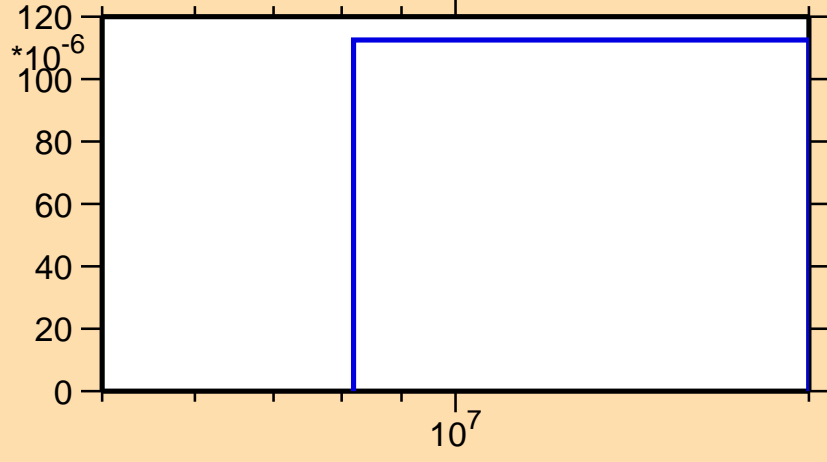

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n\alpha)$

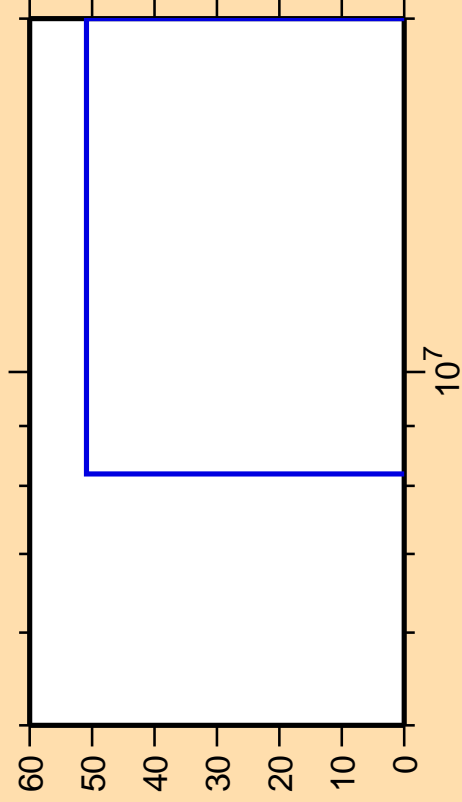

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{75}\text{Ge}(n,n\alpha)$

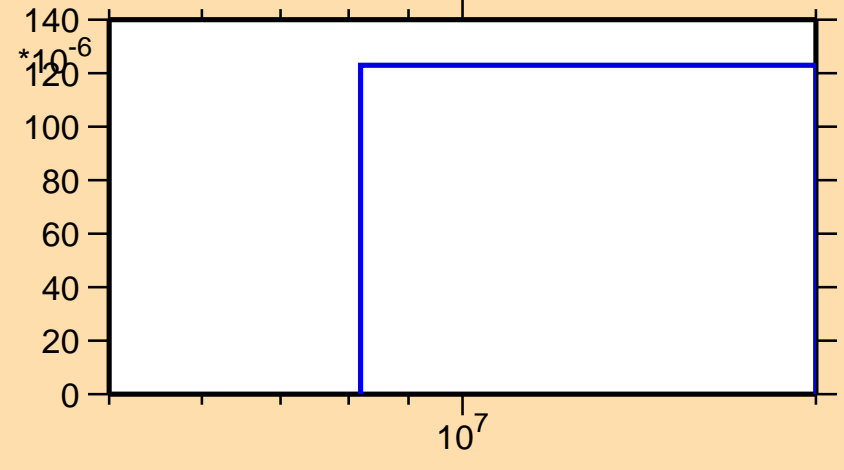

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2n\alpha)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{75}\text{Ge}(n,2n\alpha)$

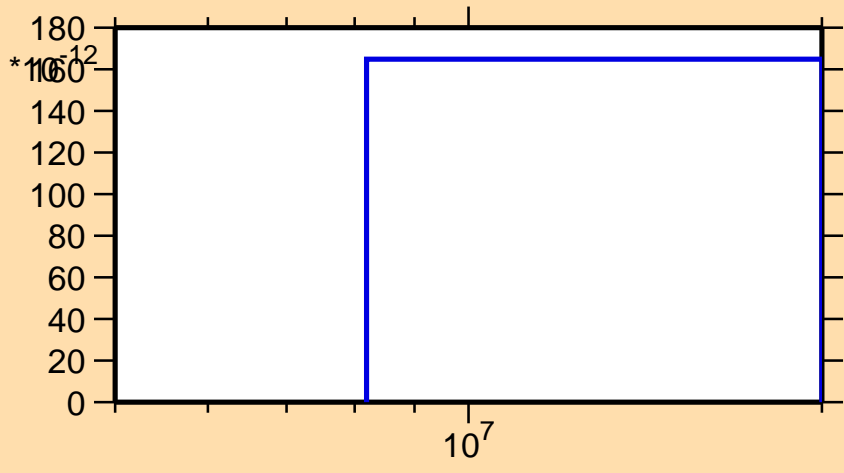

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,np)$

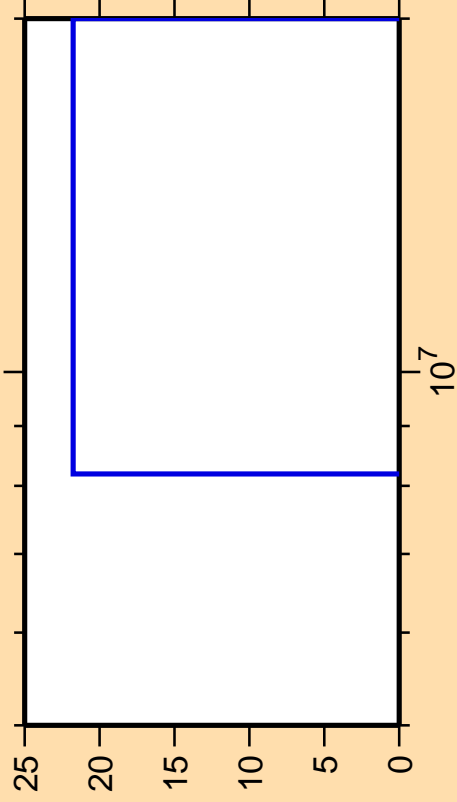

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{75}\text{Ge}(n,np)$

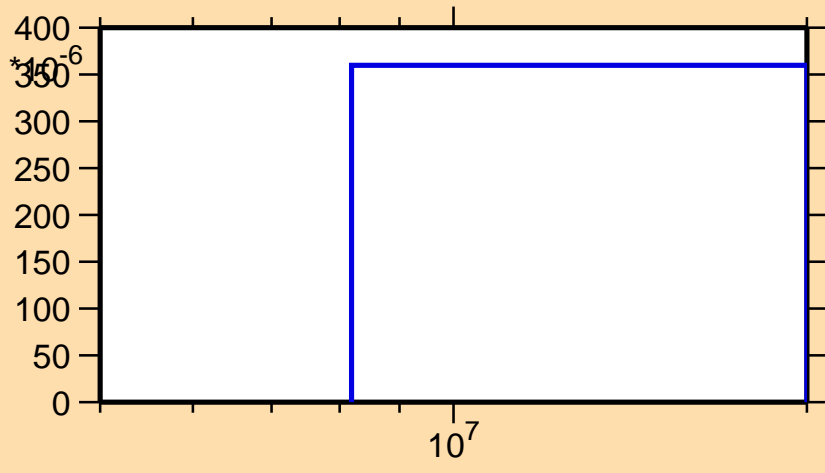

$\times 10^{-6}$

10^7



Correlation Matrix



1.0

0.8

0.6

0.4

0.2

0.0

-1.0

-0.8


-0.6

-0.4

-0.2

0.0


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{nd})$

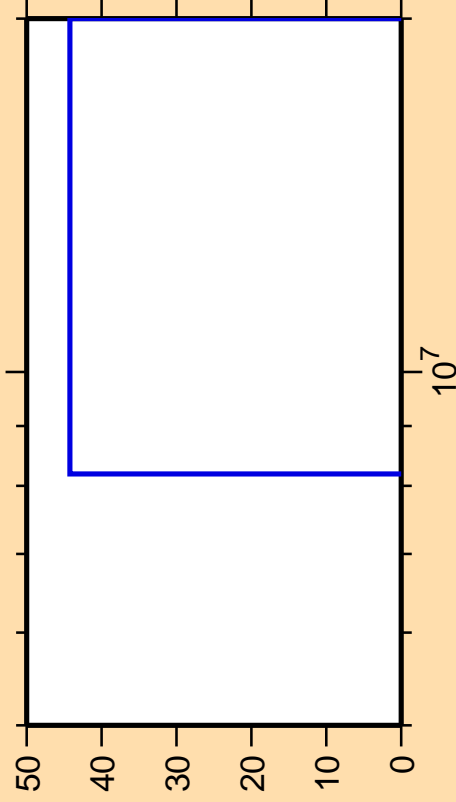

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{75}\text{Ge}(n,\text{nd})$

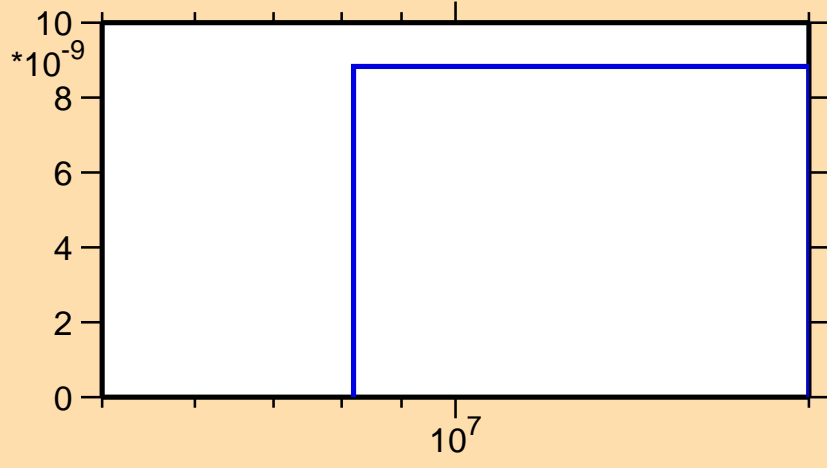

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,nt)$

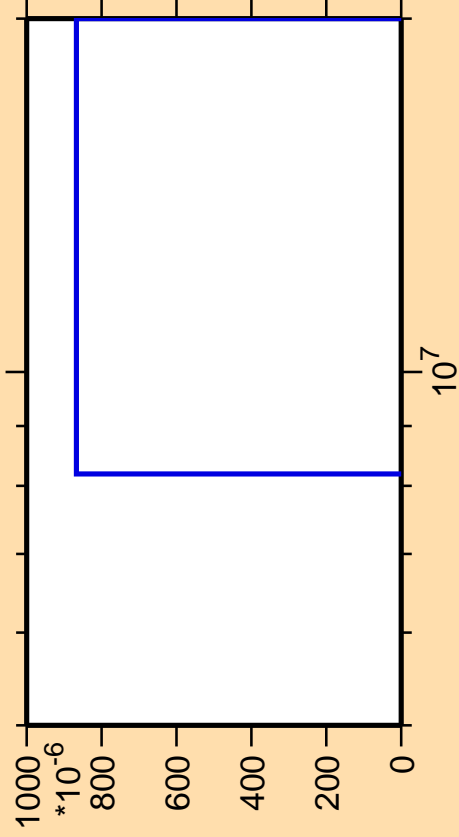

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{75}\text{Ge}(n,nt)$

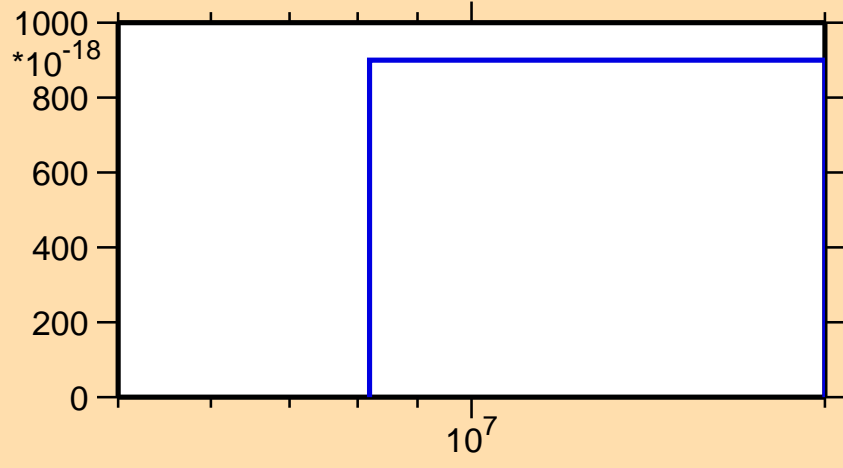

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for ^{75}Ge (mt 34)

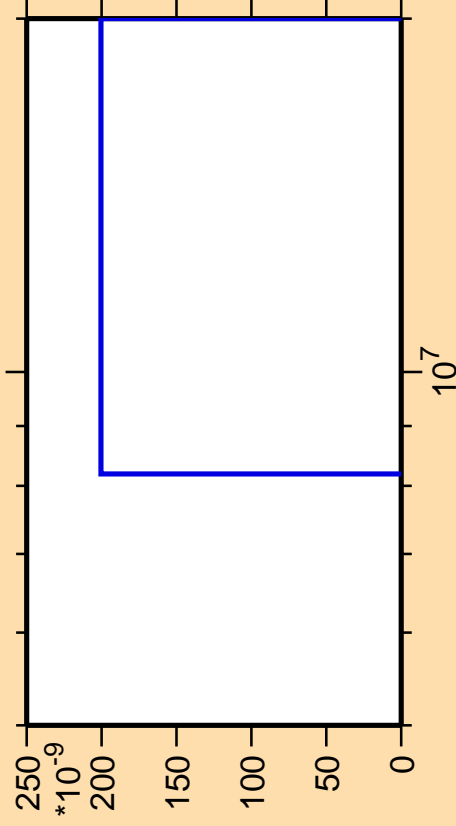

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for ^{75}Ge (mt 34)

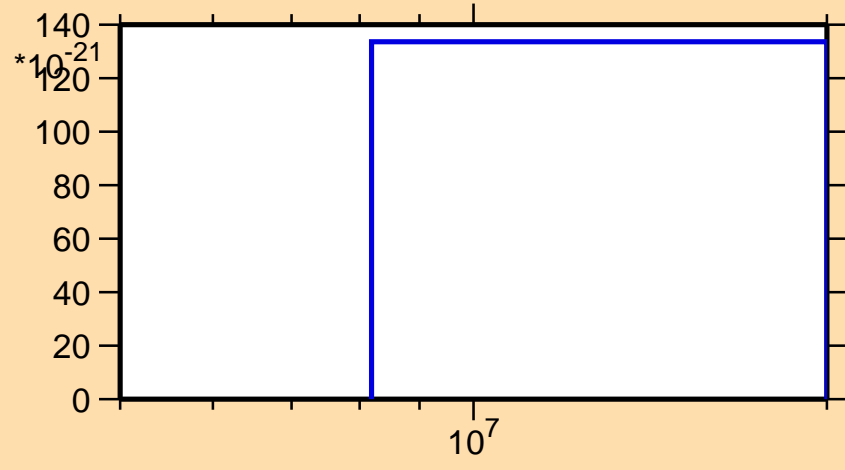

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,2np)$

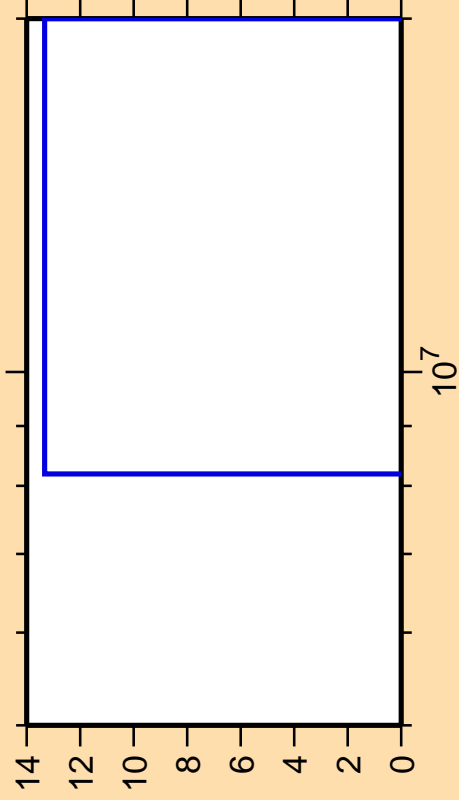

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{75}\text{Ge}(n,2np)$

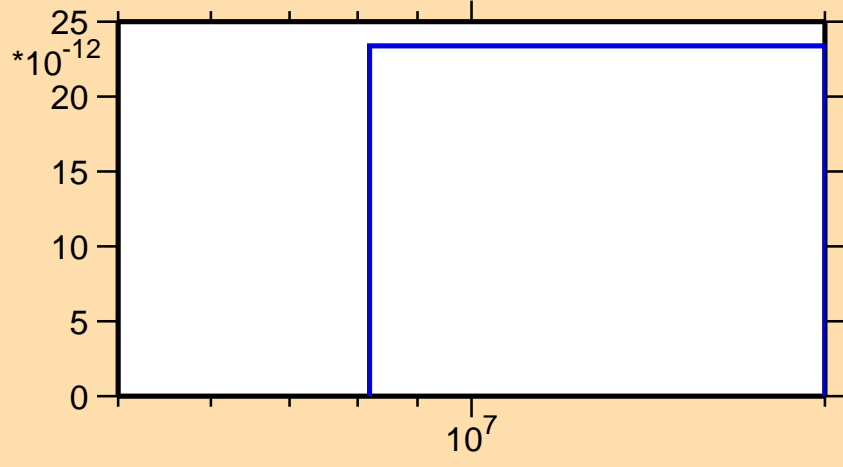



Correlation Matrix



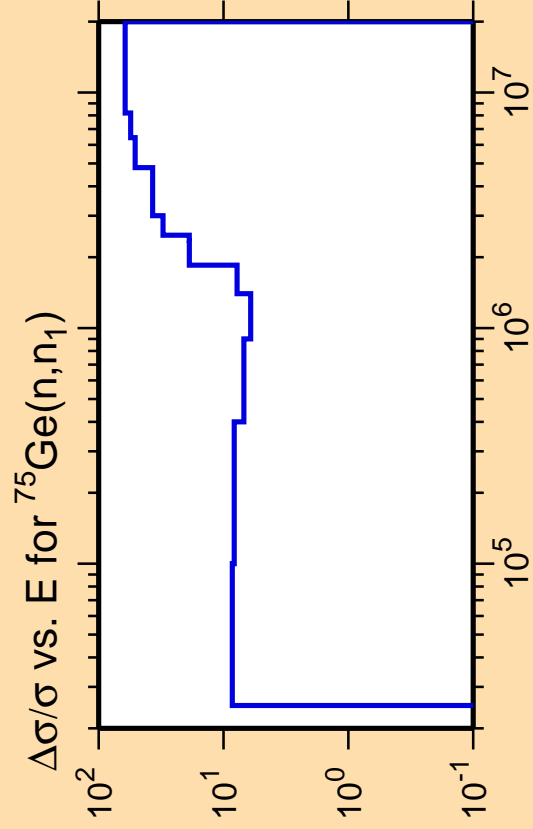


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

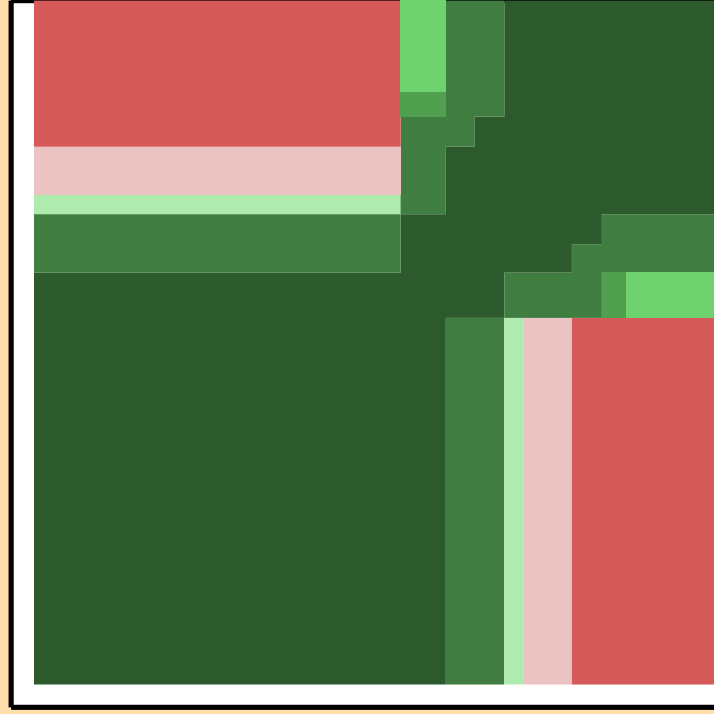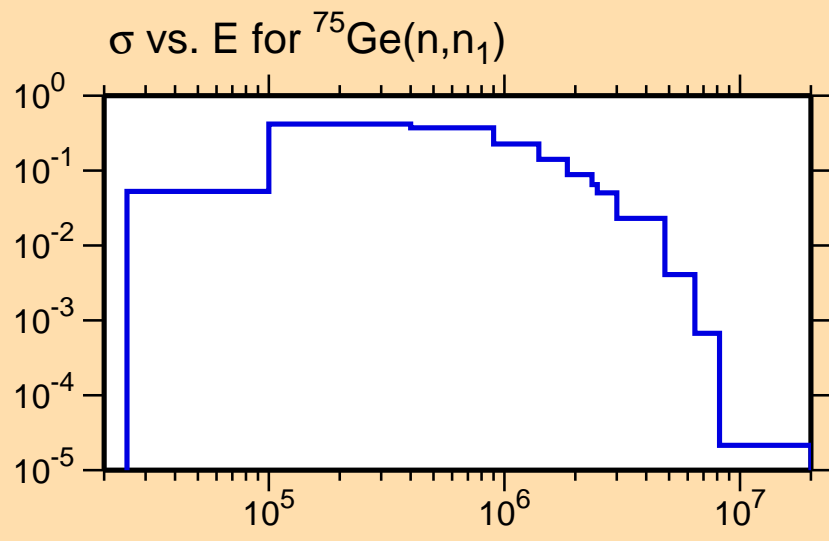

Correlation Matrix





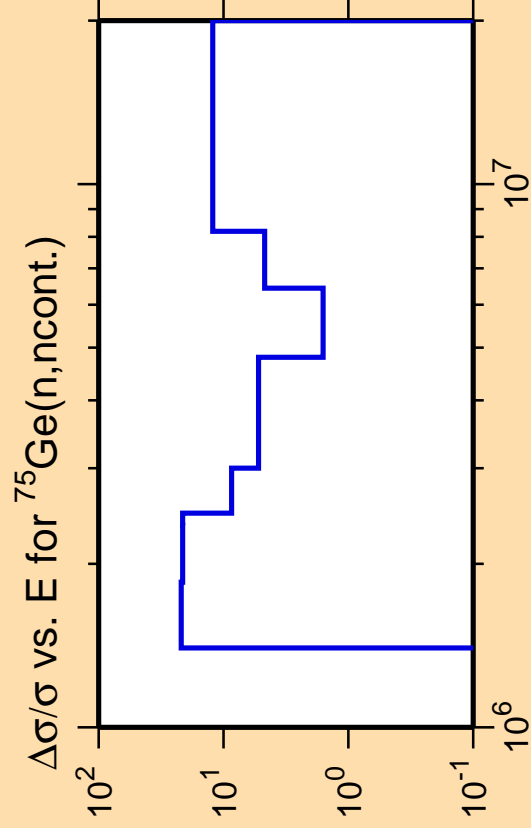

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

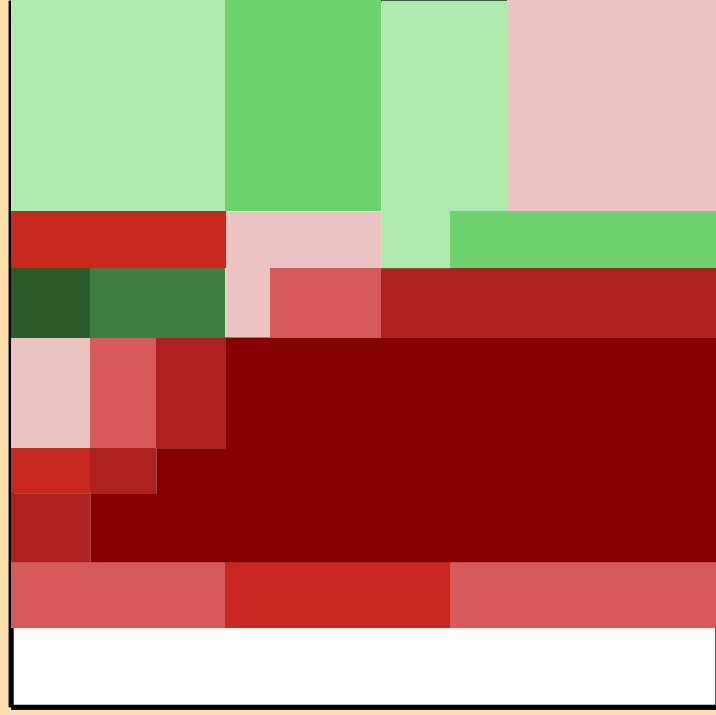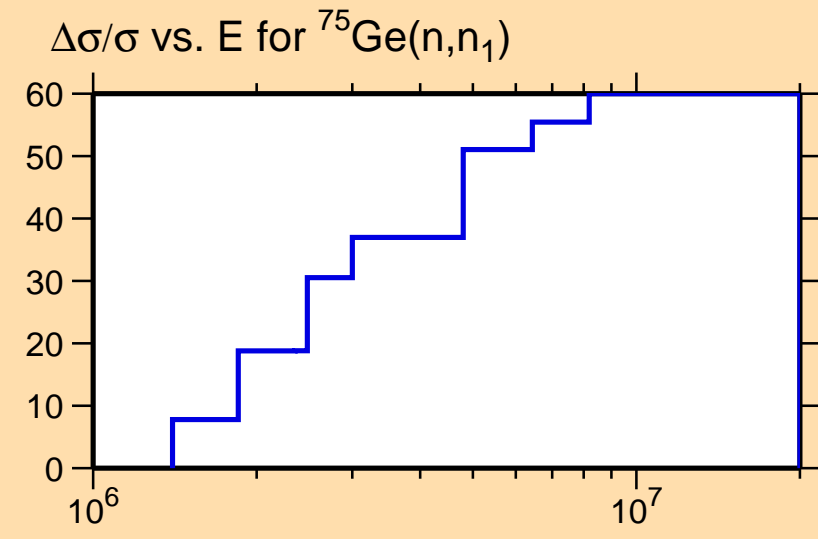

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\gamma)$

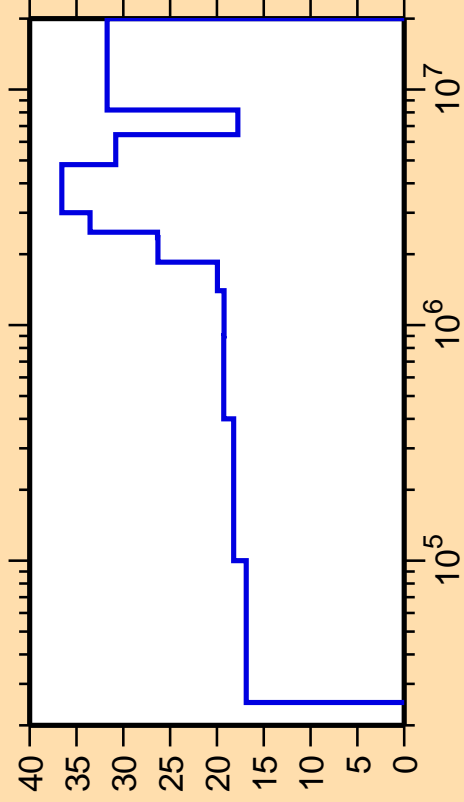

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n_1)$

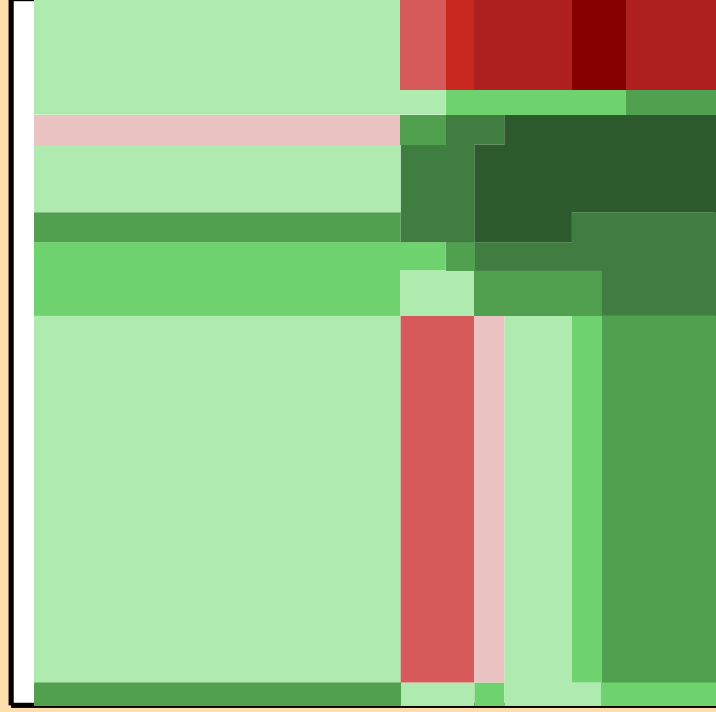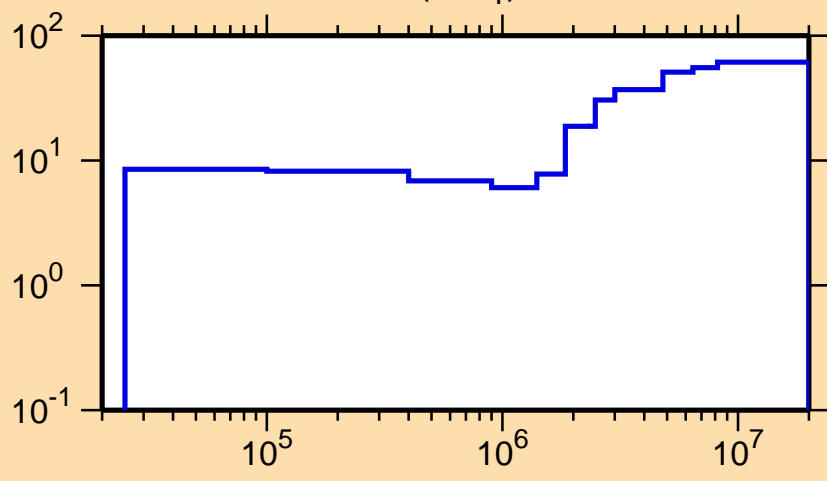

Correlation Matrix





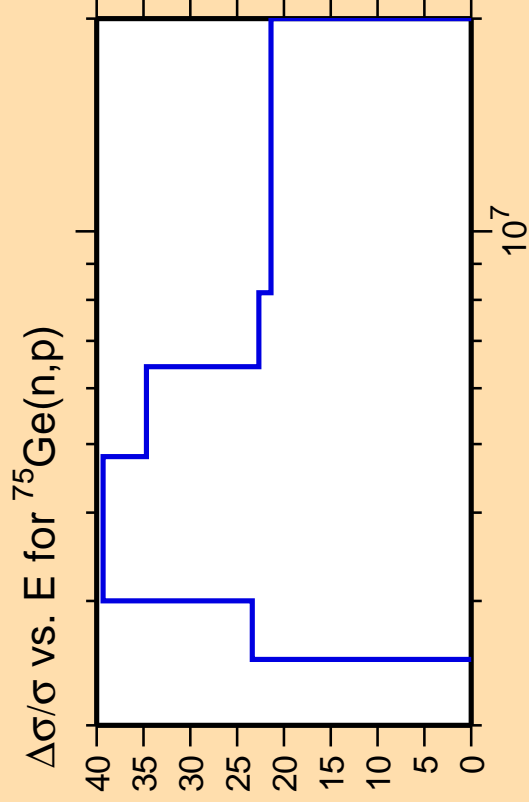

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

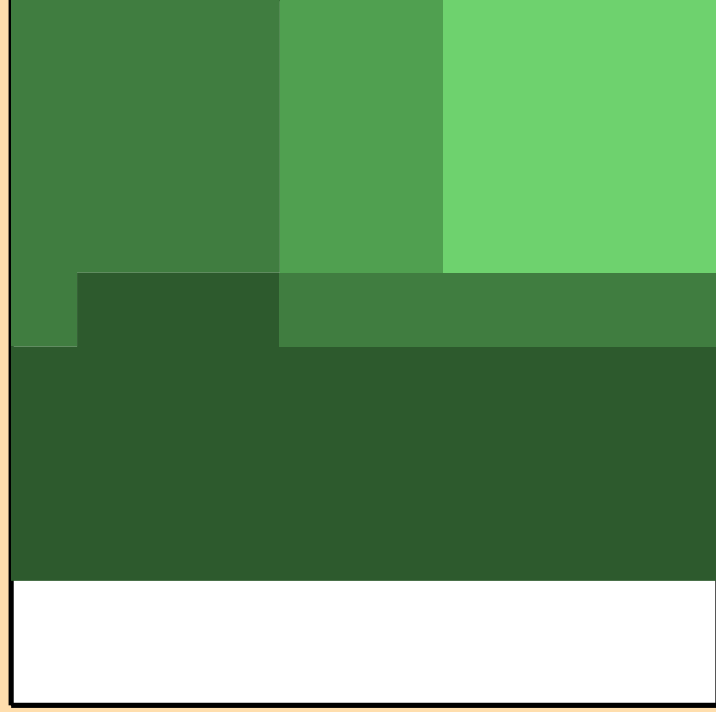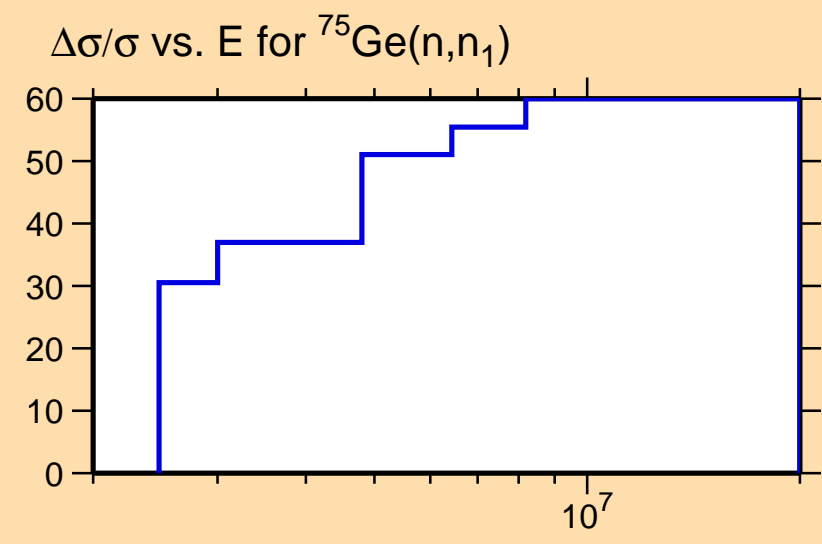


Correlation Matrix



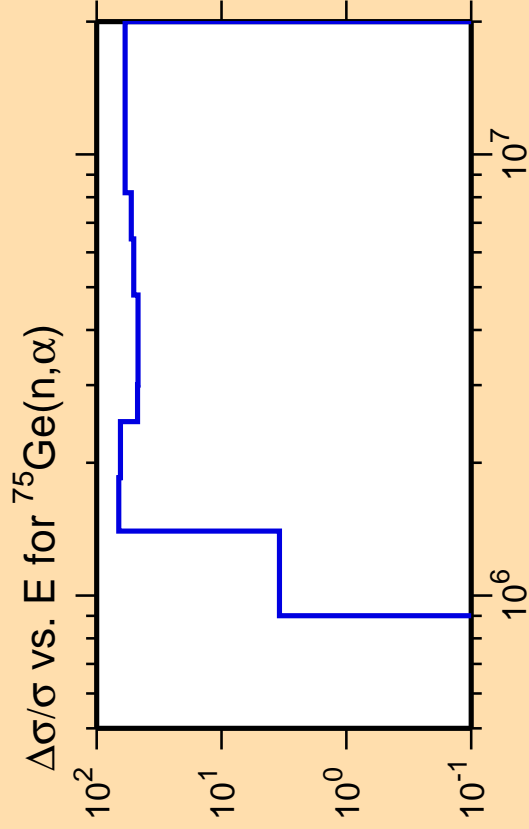


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

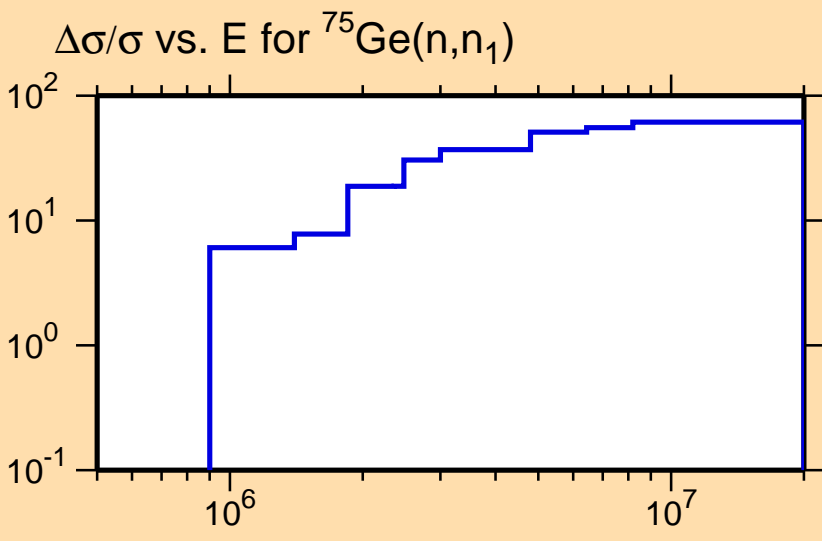


Correlation Matrix



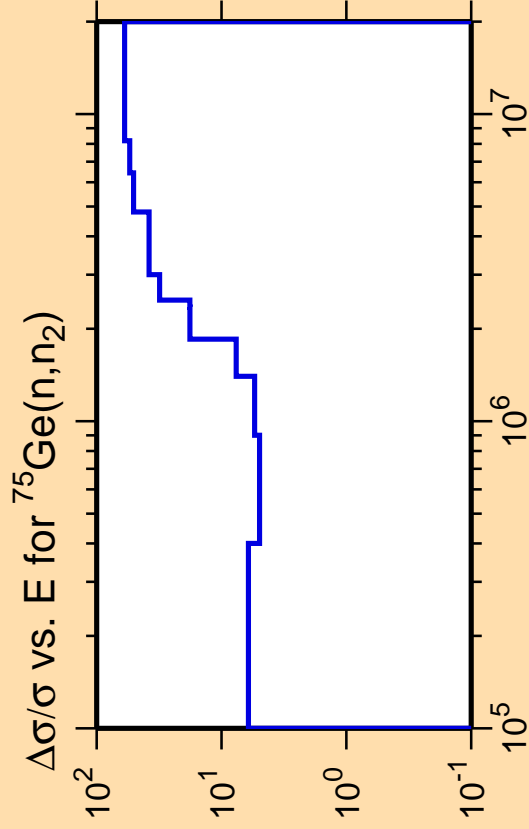


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

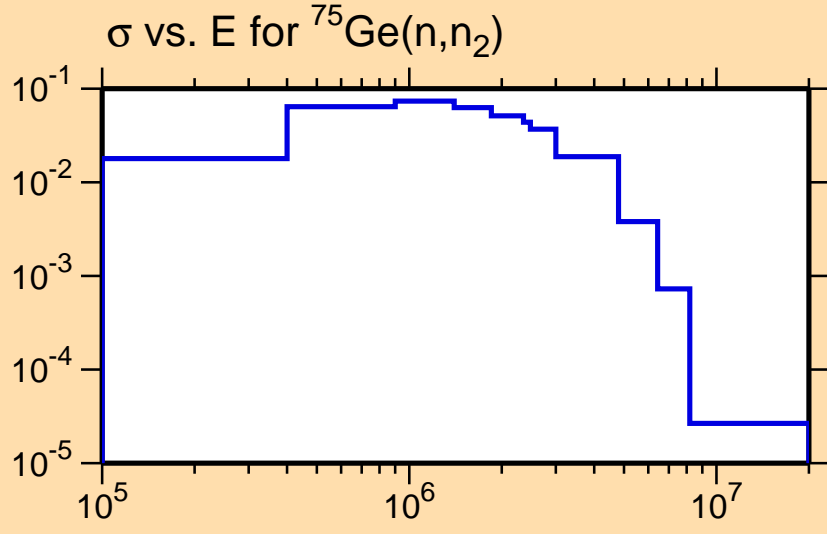


Correlation Matrix



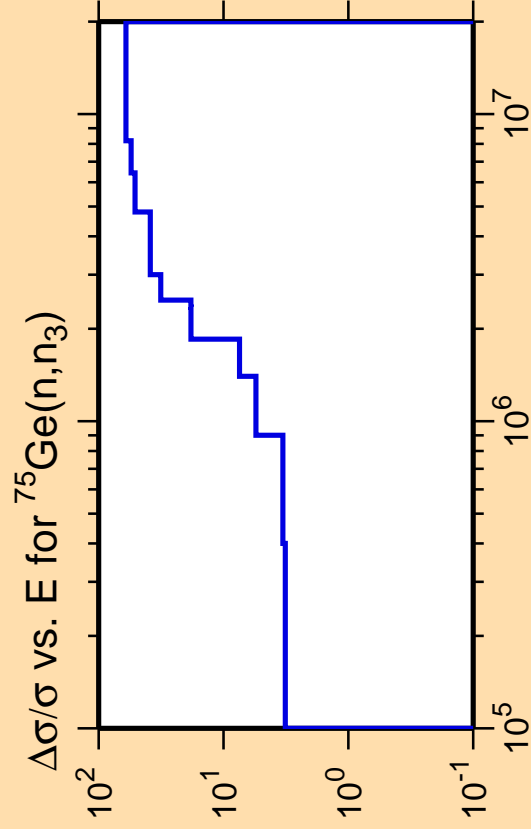


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

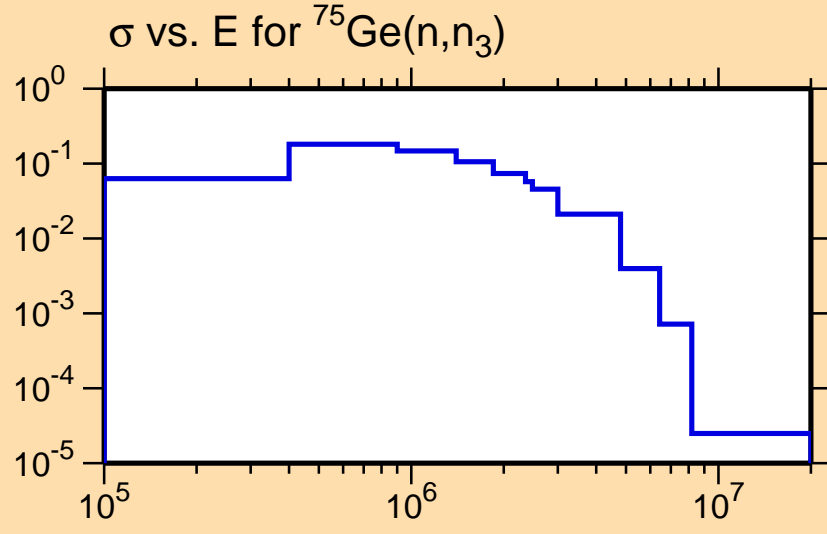



Correlation Matrix



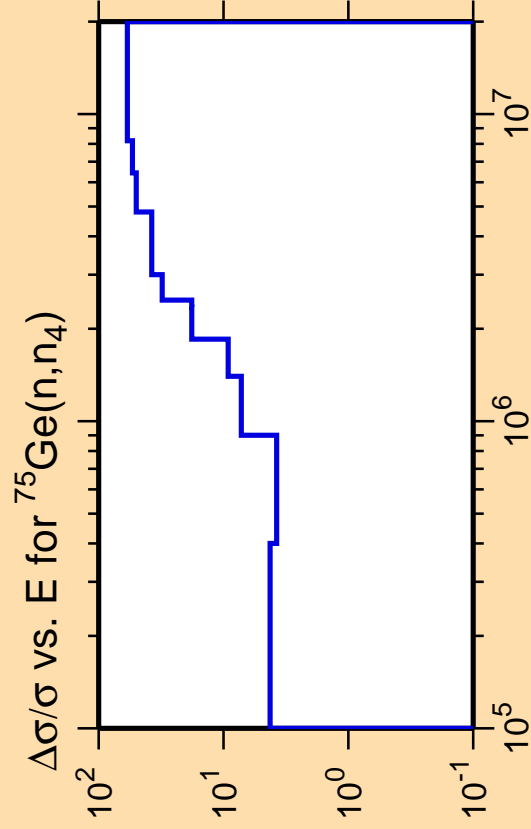


Ordinate scales are % relative standard deviation and barns.

Abcissa scales are energy (eV).

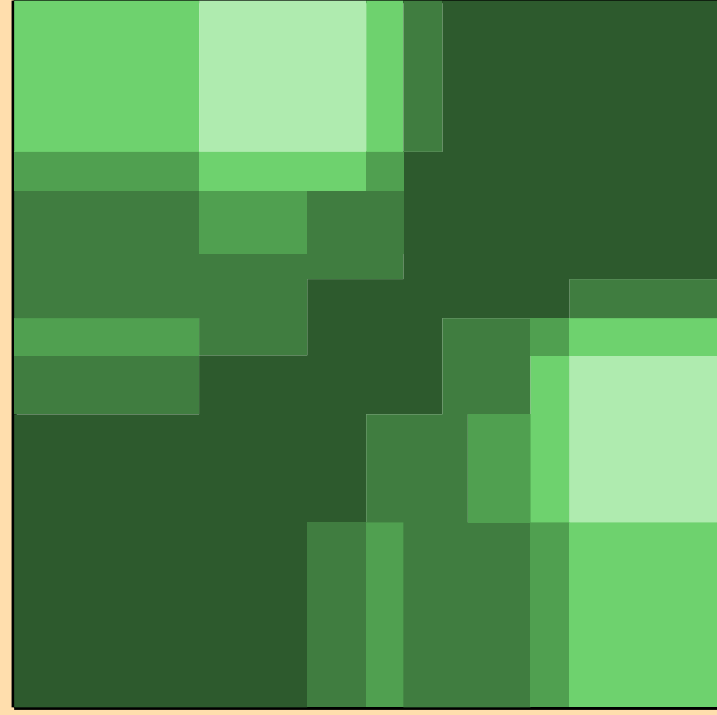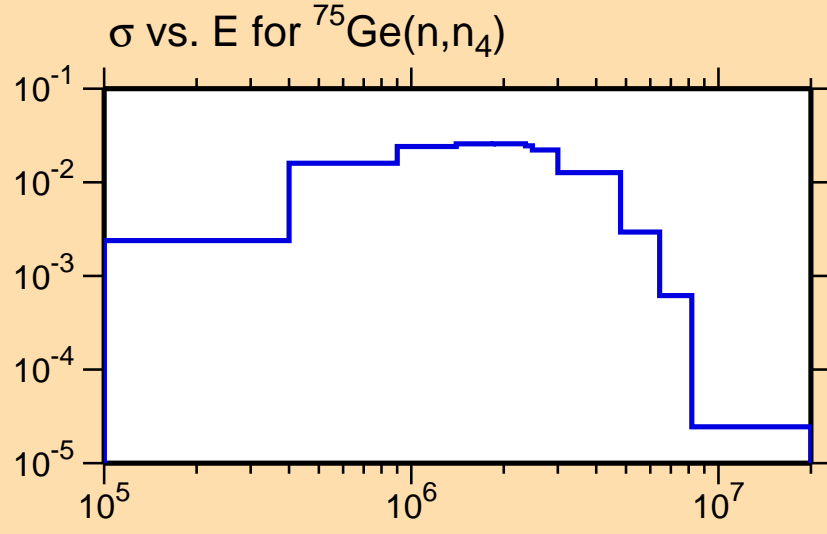



Correlation Matrix



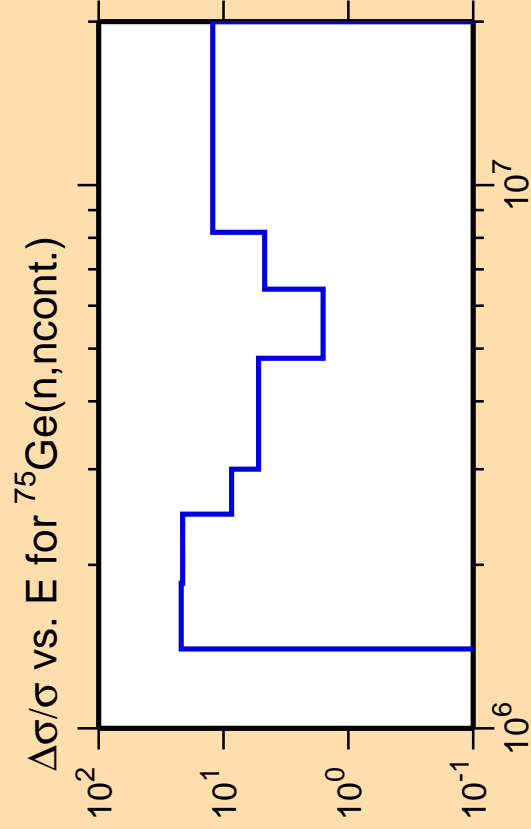


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

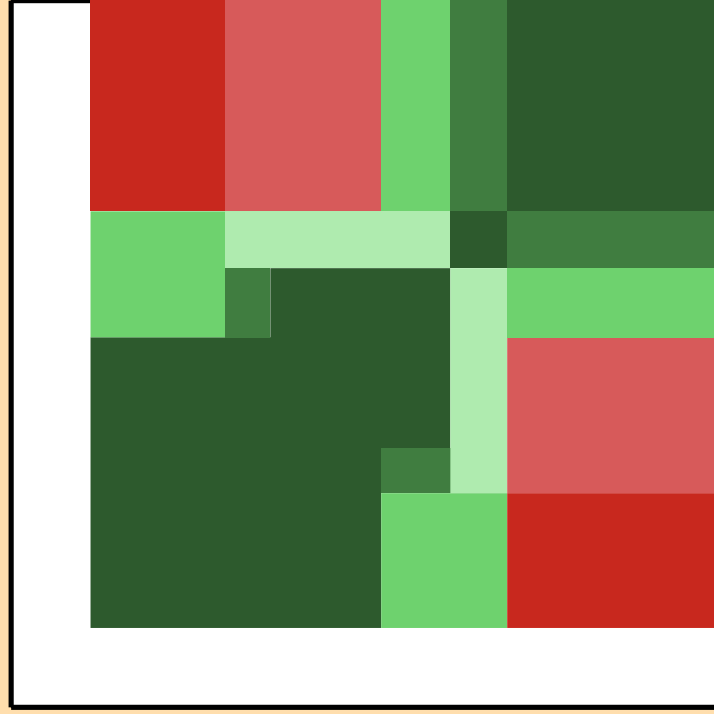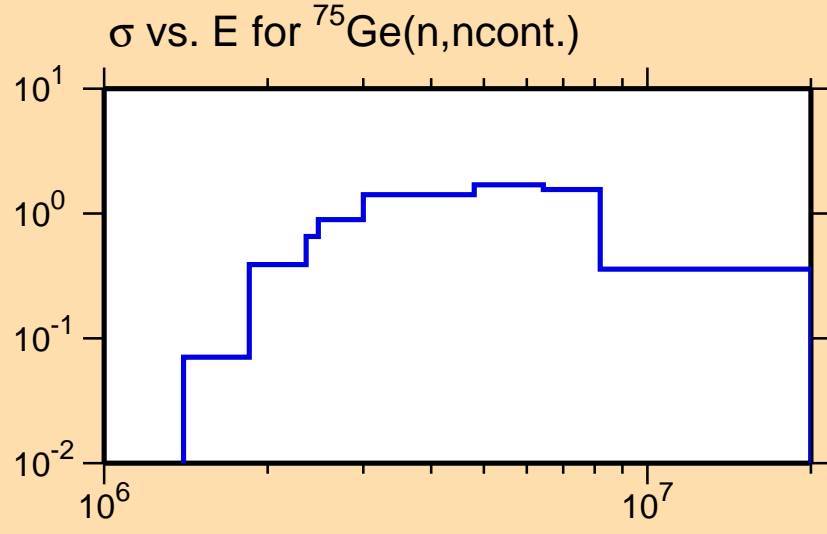



Correlation Matrix



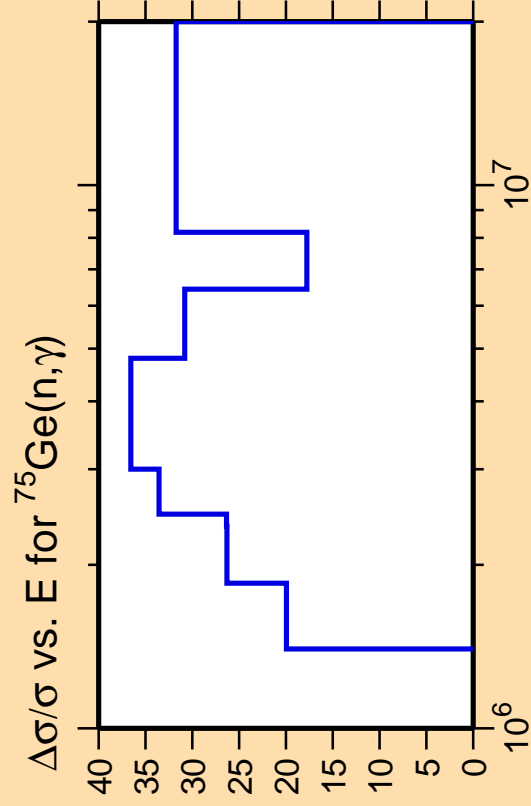


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

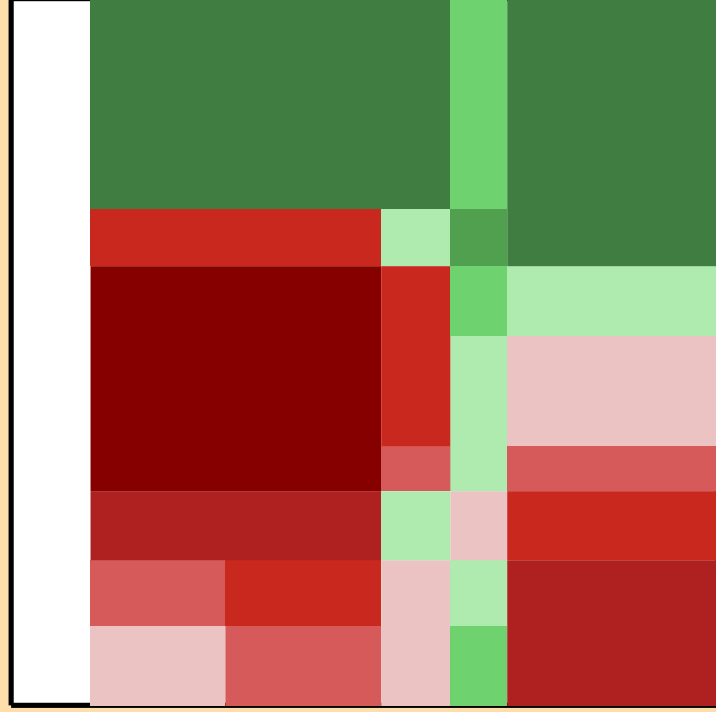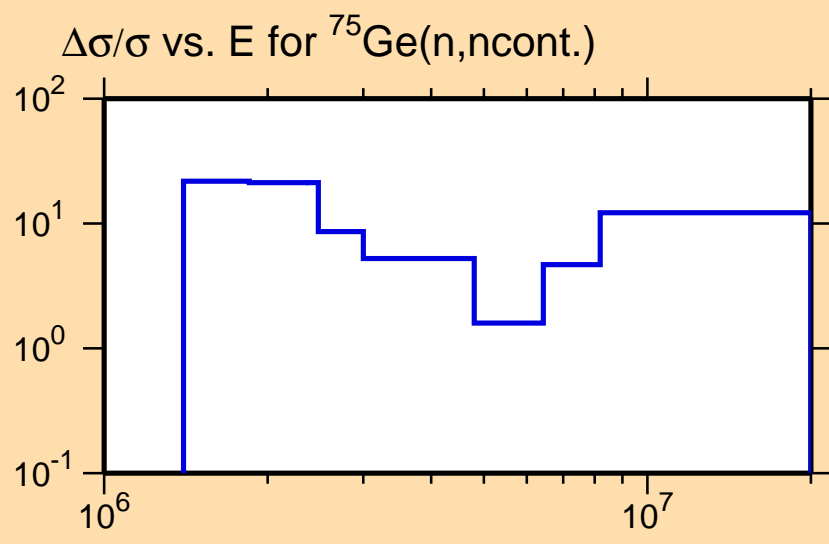

Correlation Matrix





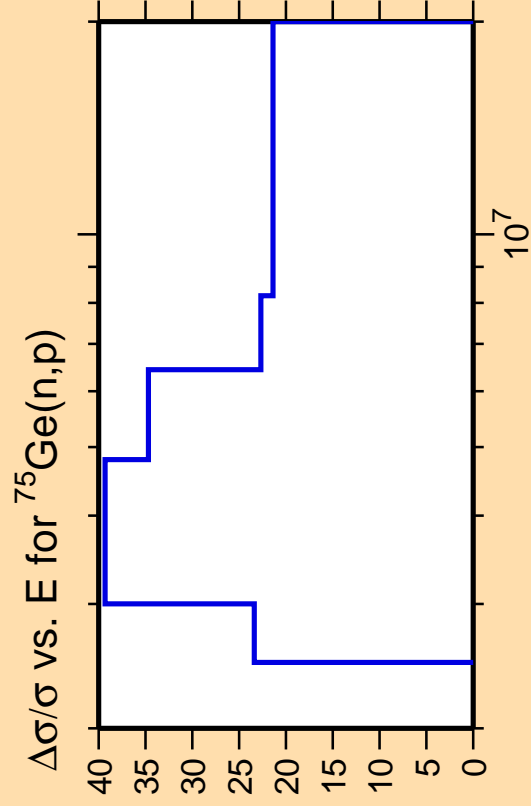

Ordinate scale is %
relative standard deviation.


Abcissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,n\text{cont.})$

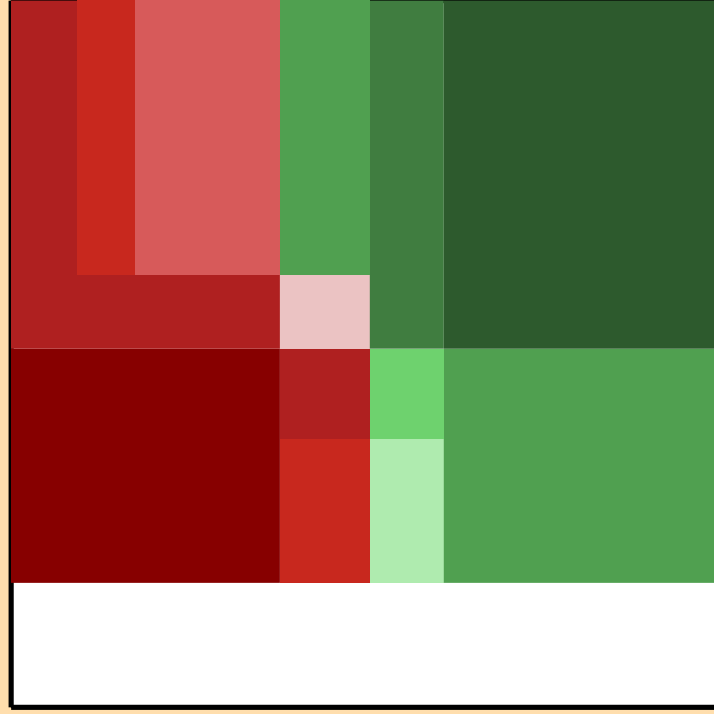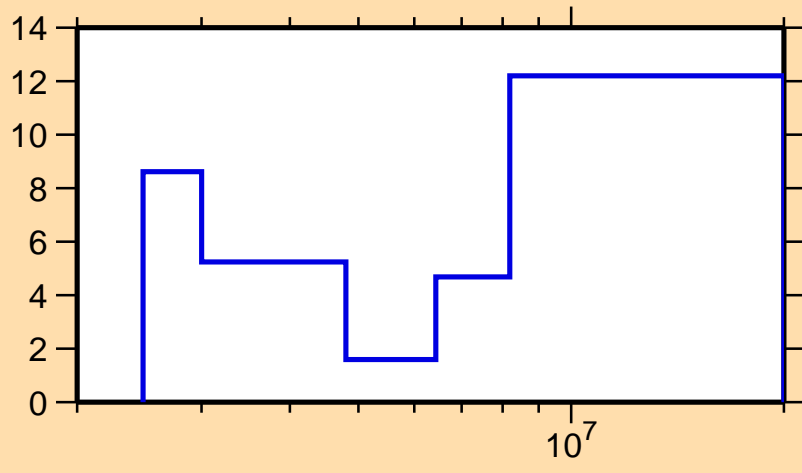

Correlation Matrix





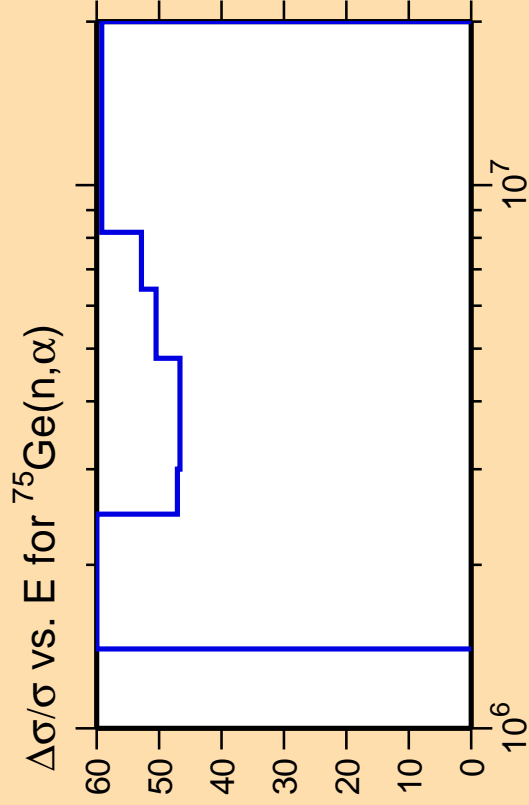

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

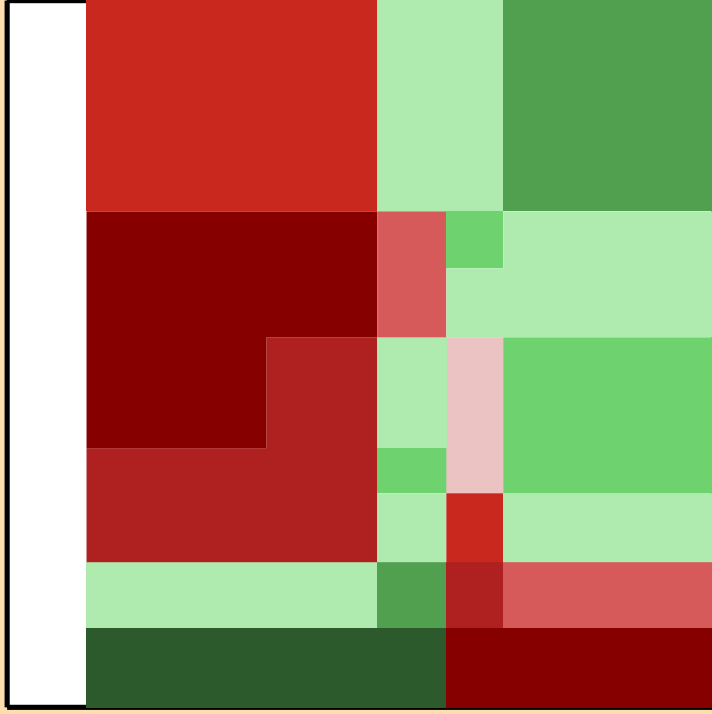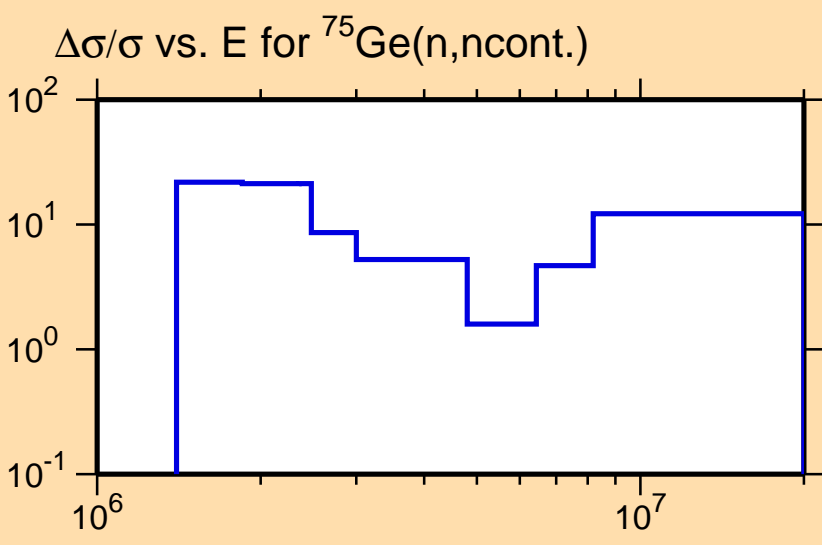



Correlation Matrix



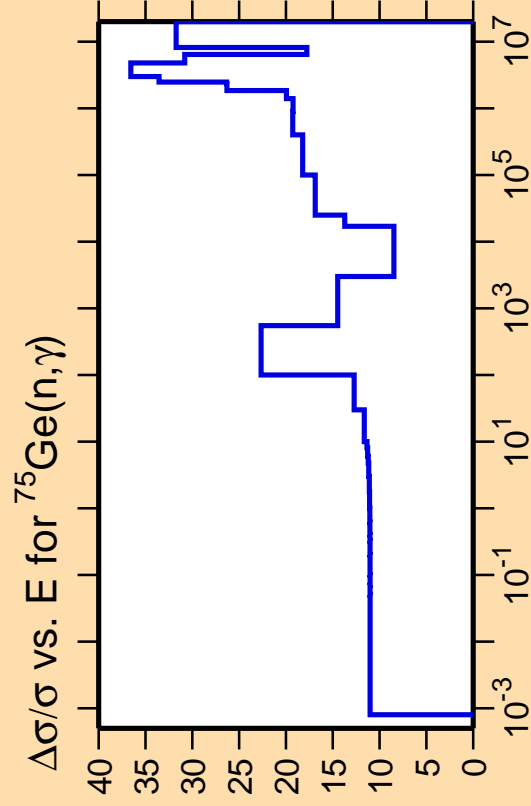


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

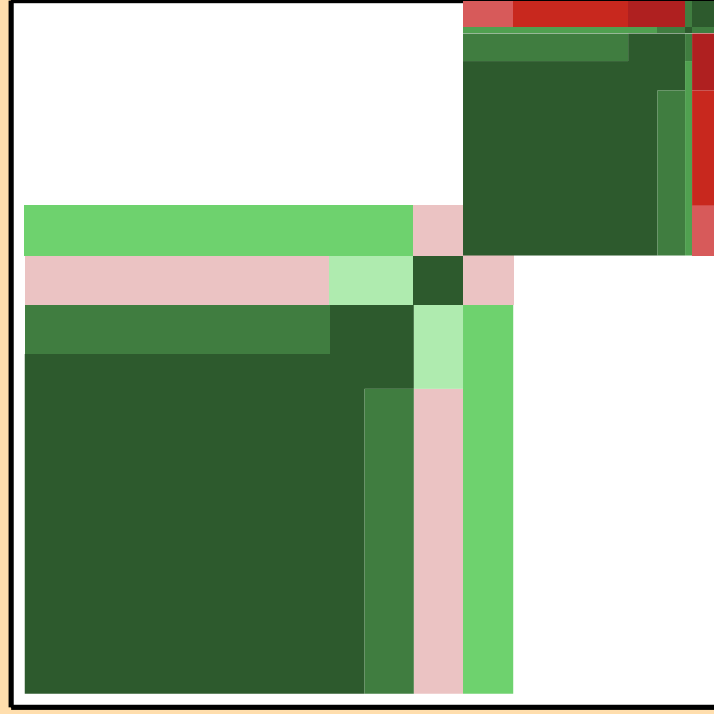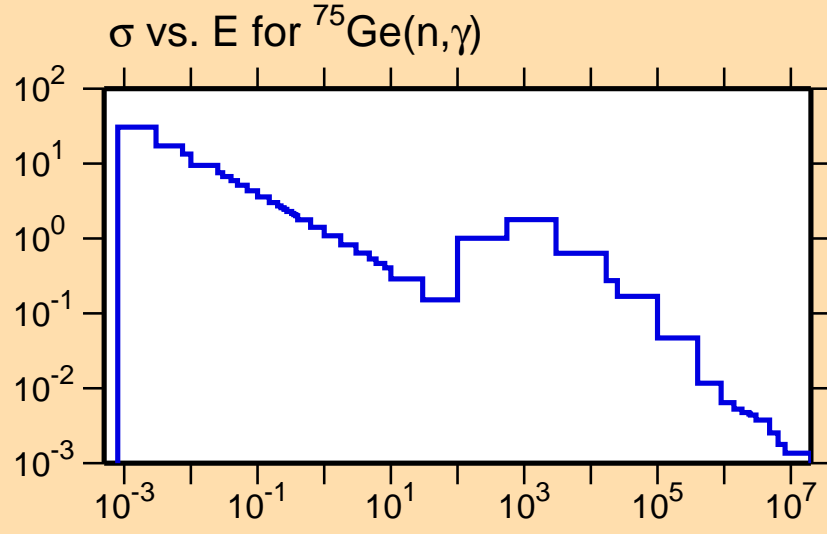



Correlation Matrix



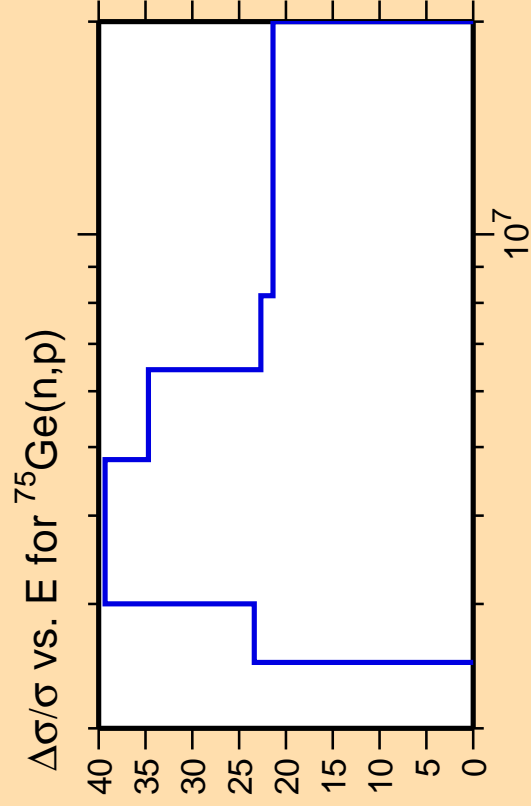


Ordinate scale is %
relative standard deviation.

Abcissa scales are energy (eV).

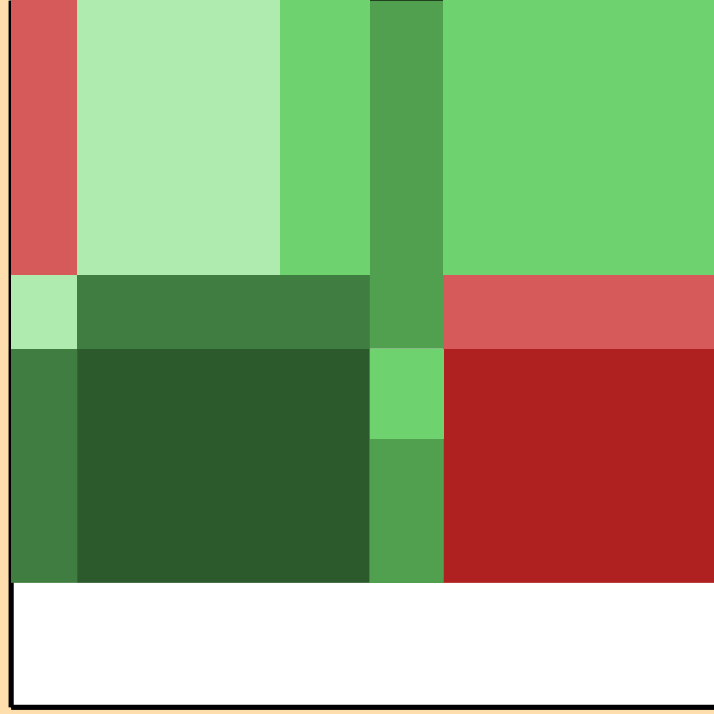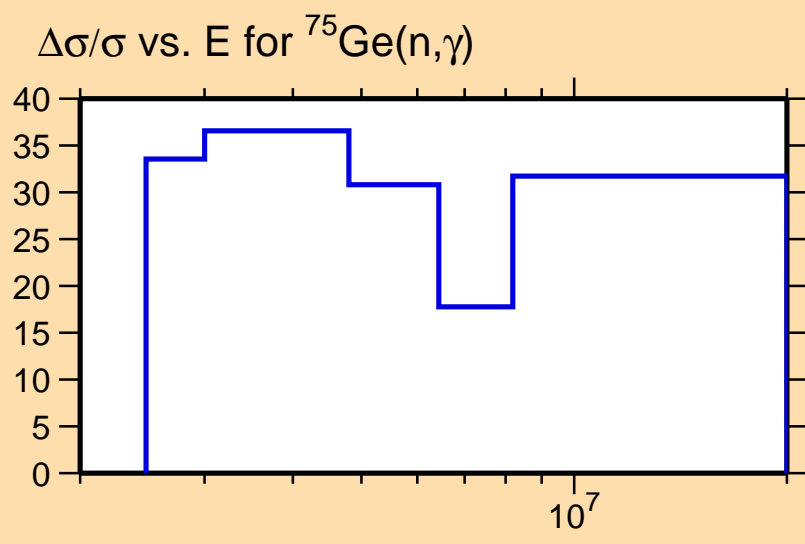

Correlation Matrix




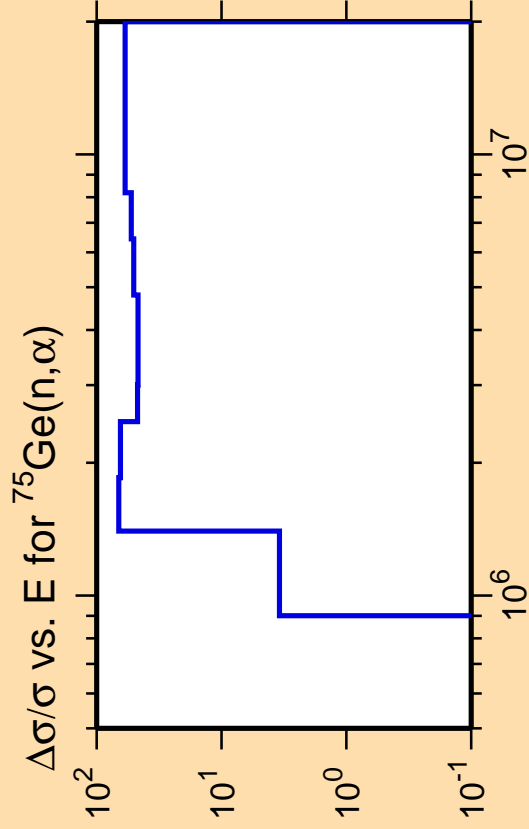

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\gamma)$

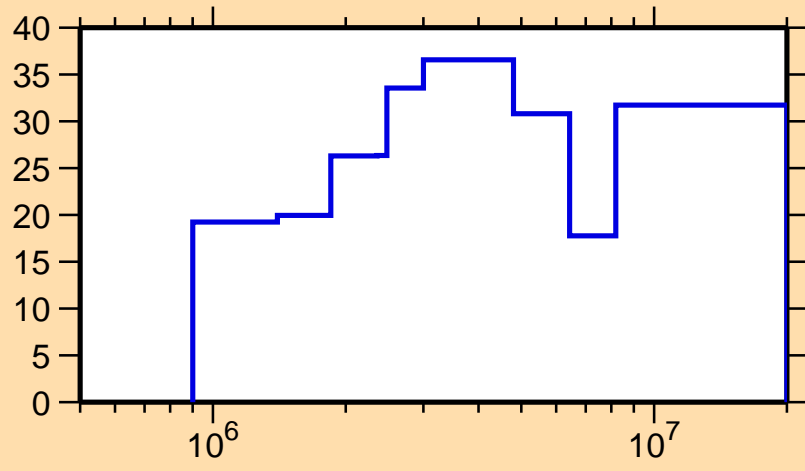



Correlation Matrix



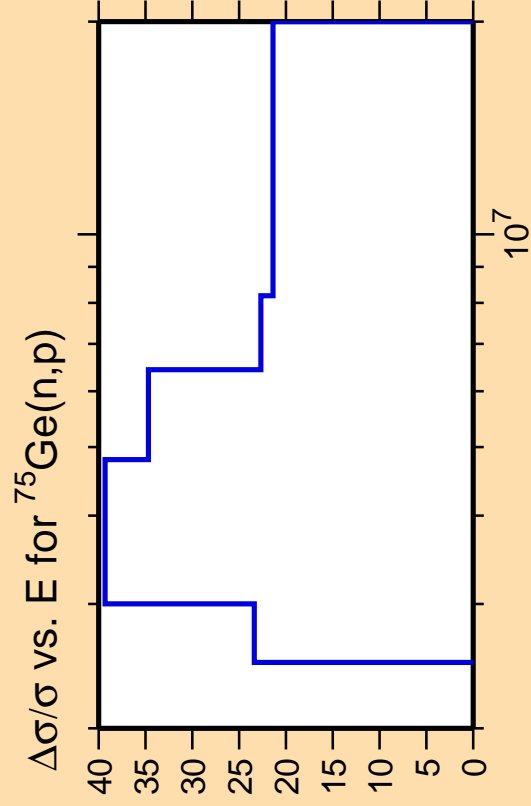


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

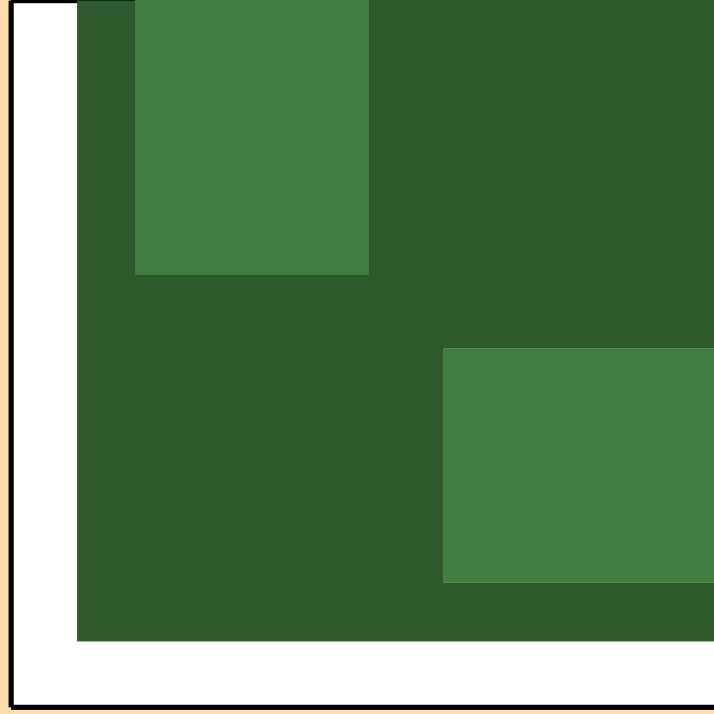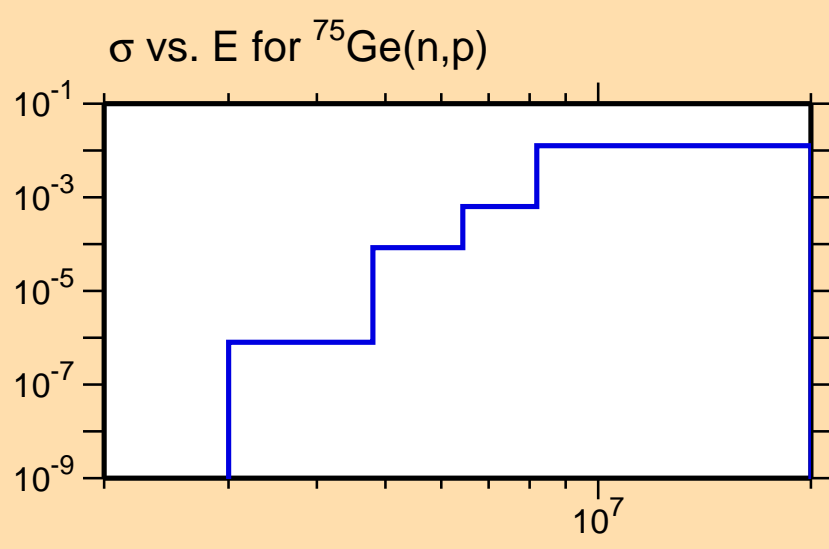



Correlation Matrix



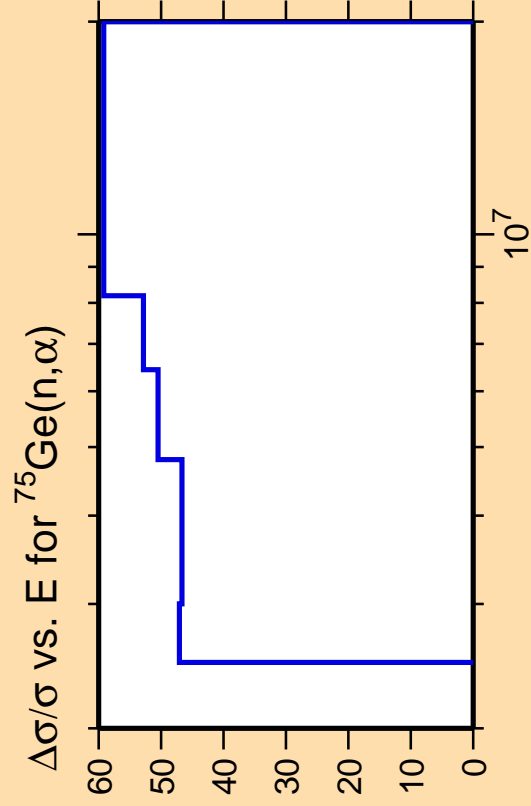

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

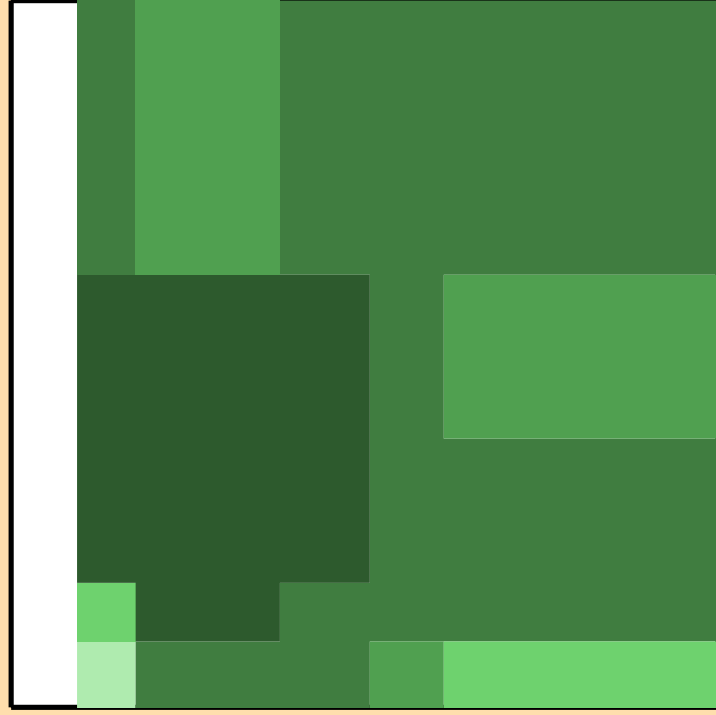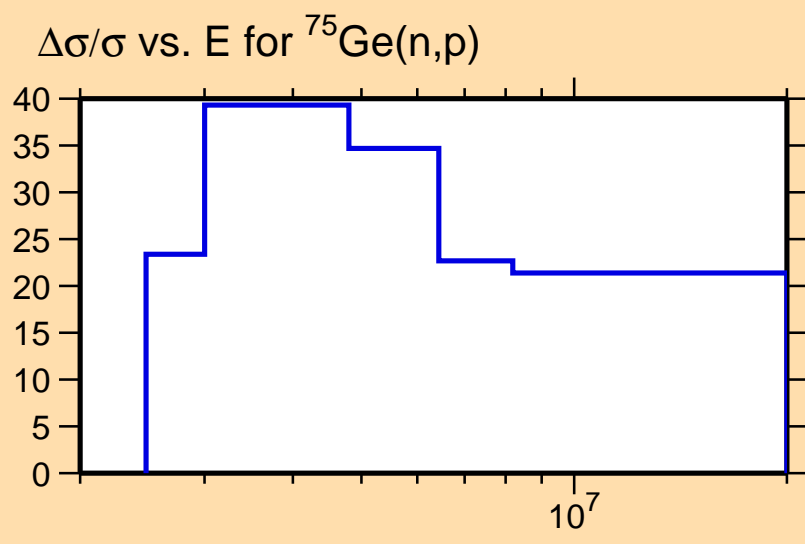

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,d)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{75}\text{Ge}(n,d)$

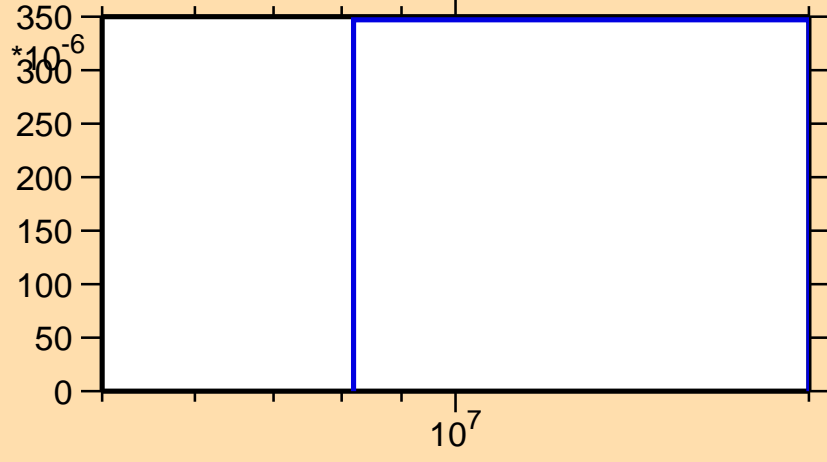

350
300
250
200
150
100
50
0

10^7



Correlation Matrix



1.0
0.8
0.6
0.4
0.2
0.0

-1.0
-0.8
-0.6
-0.4
-0.2
0.0

$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,t)$




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{75}\text{Ge}(n,t)$

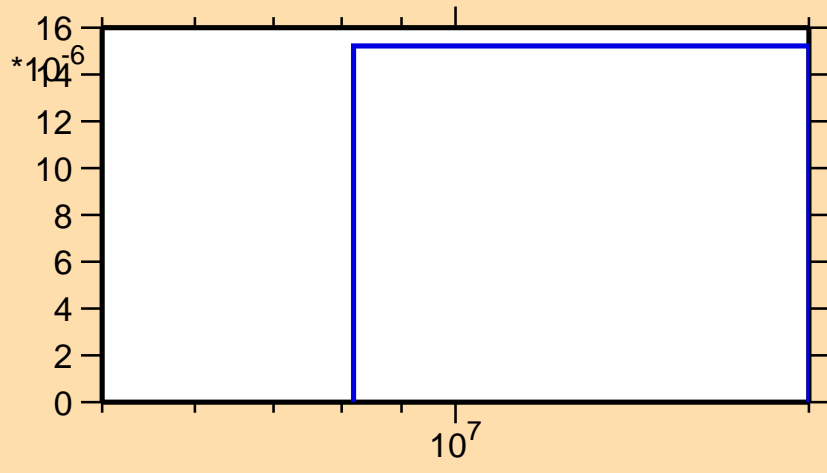


* 10^6


*



Correlation Matrix

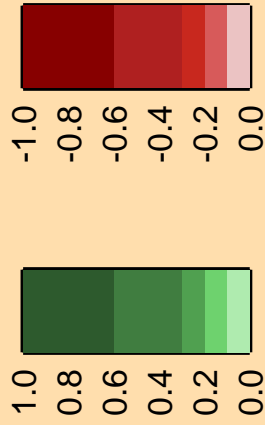


$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{He}3)$

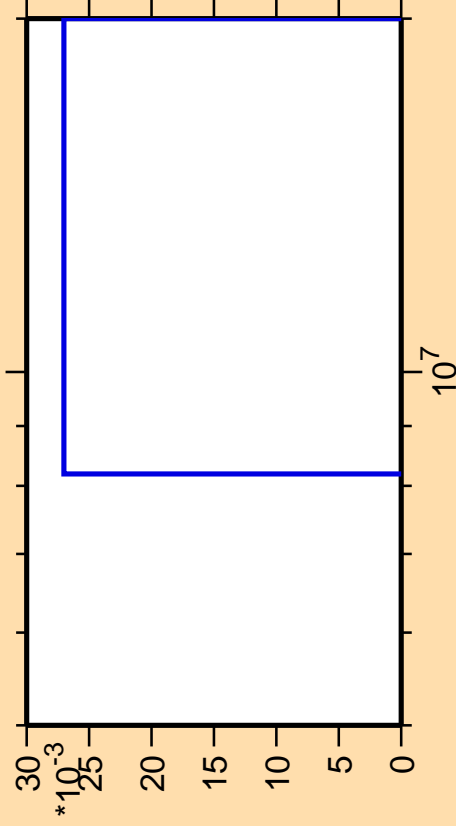

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{75}\text{Ge}(n,\text{He}3)$

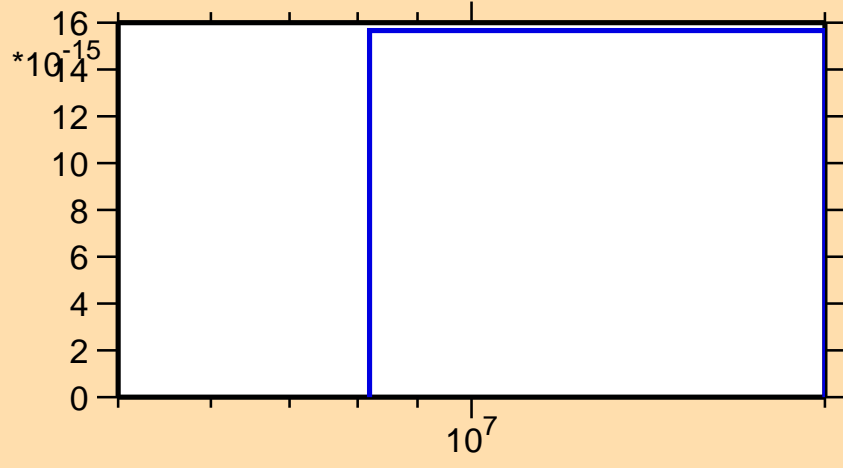



Correlation Matrix



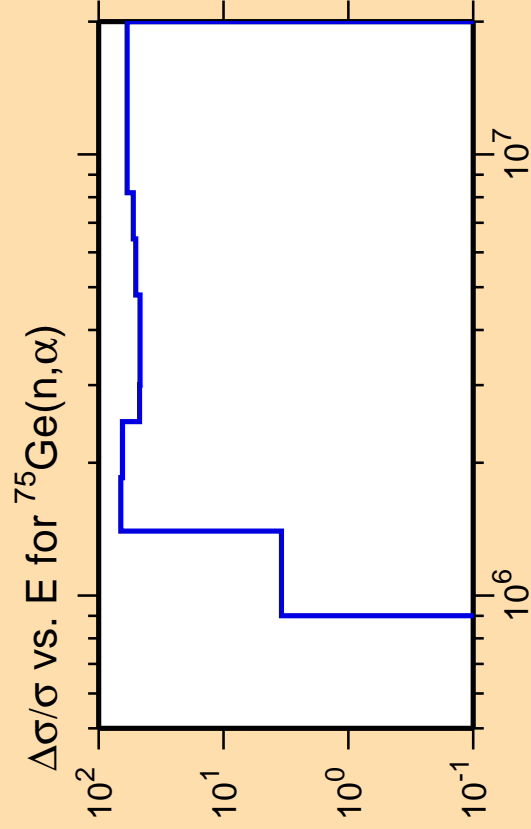

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

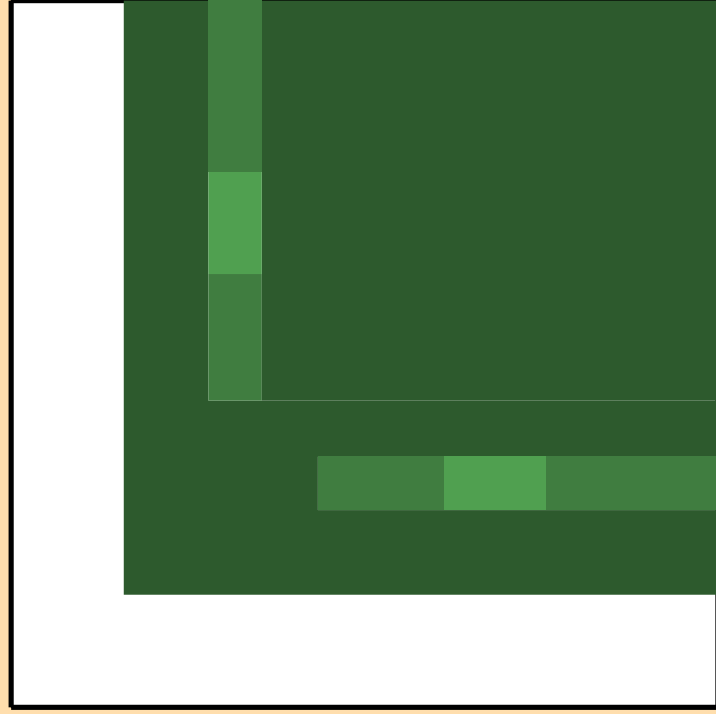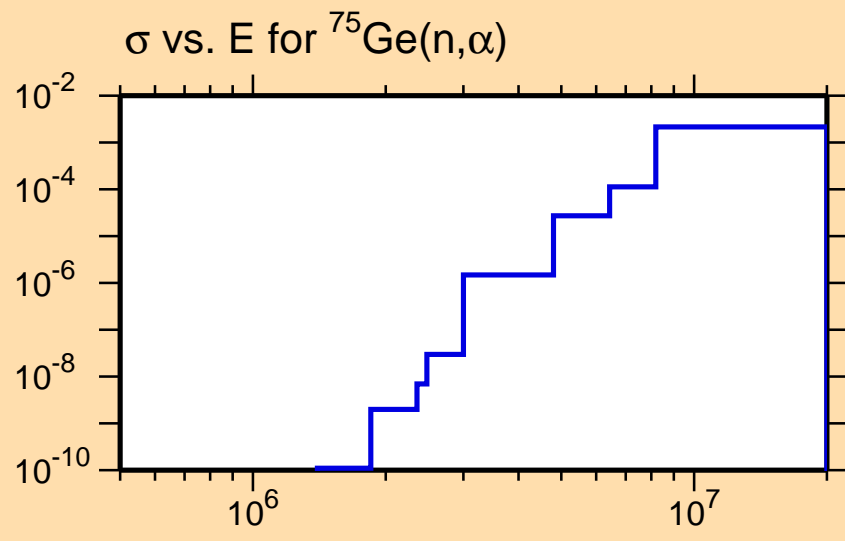

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,p\alpha)$

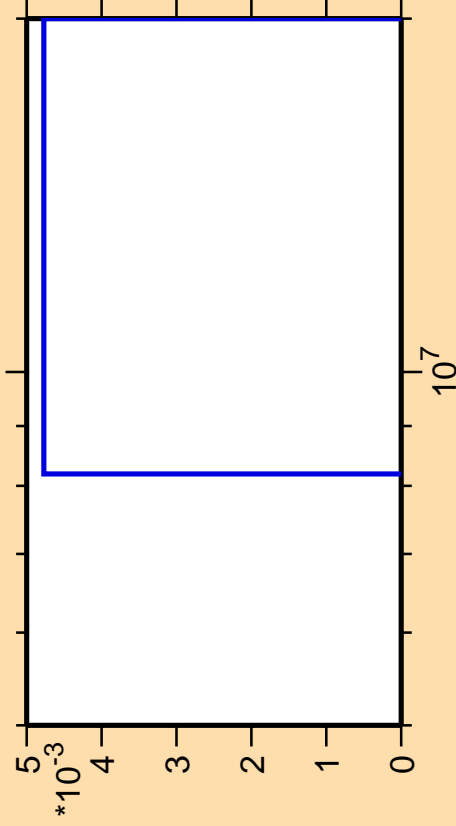

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{75}\text{Ge}(n,p\alpha)$

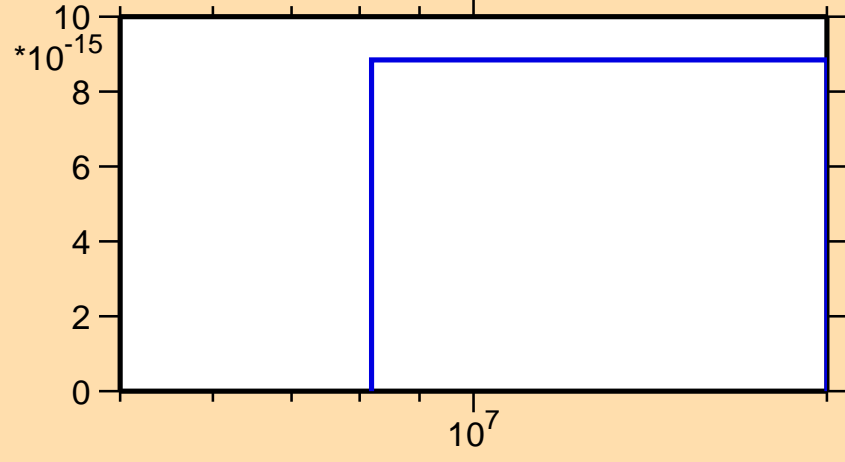

*10⁻¹⁵


10⁷



Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{75}\text{Ge}(n,\text{pt})$

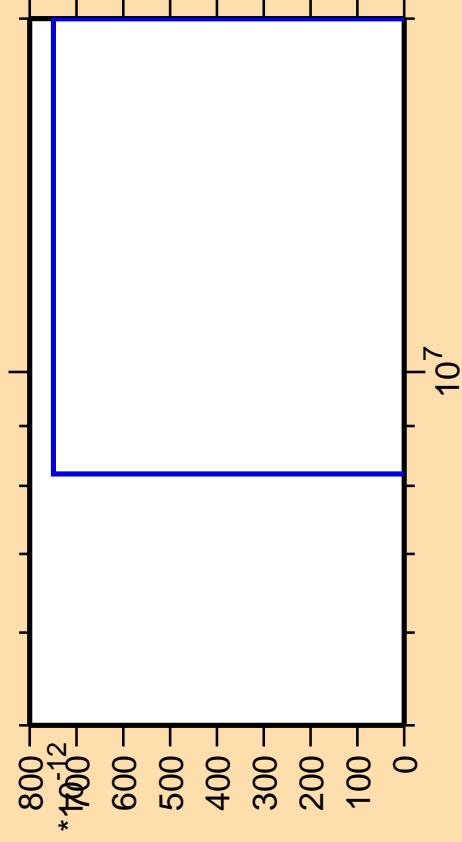

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{75}\text{Ge}(n,\text{pt})$

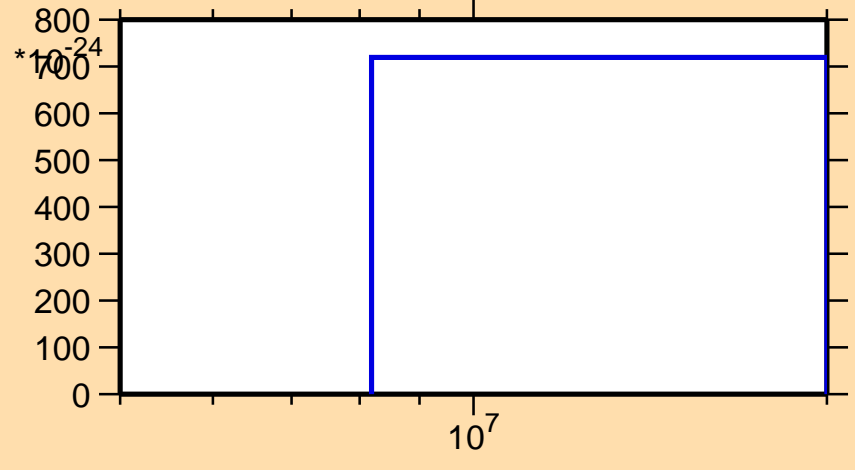

Correlation Matrix

