



Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

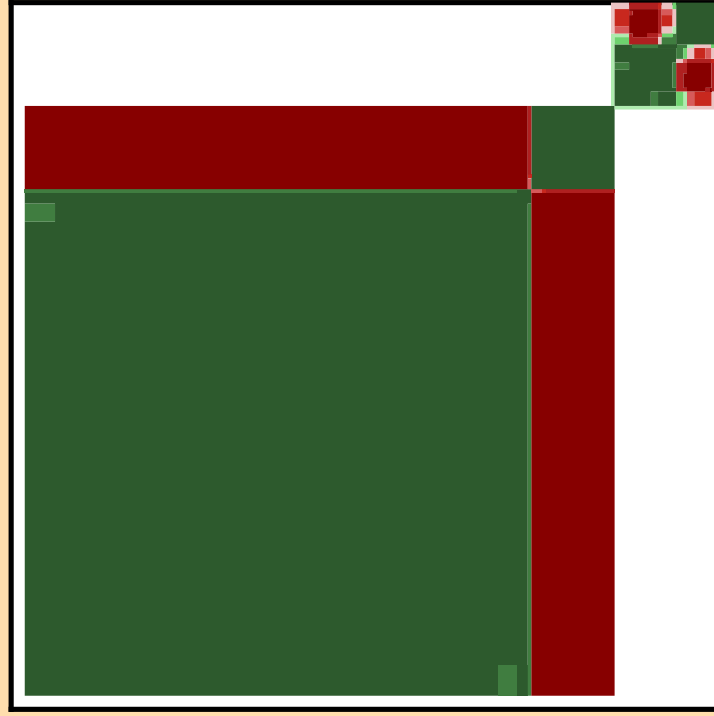

Correlation Matrix

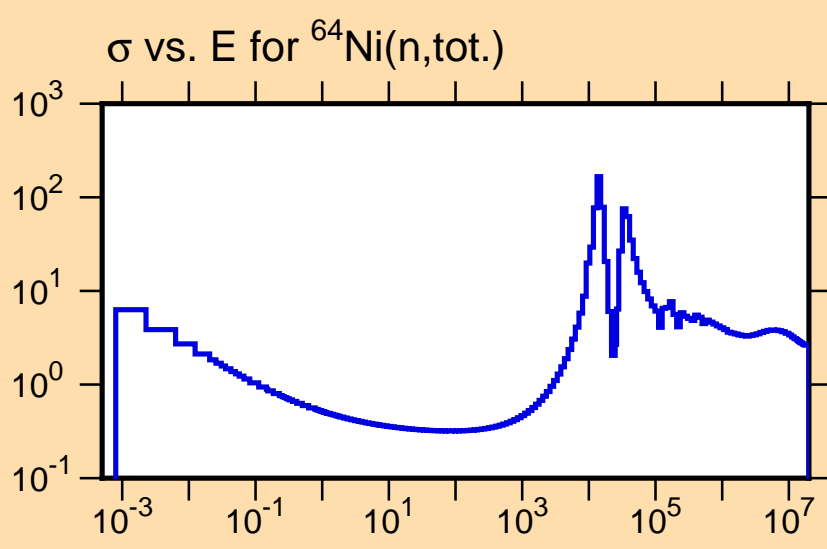



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

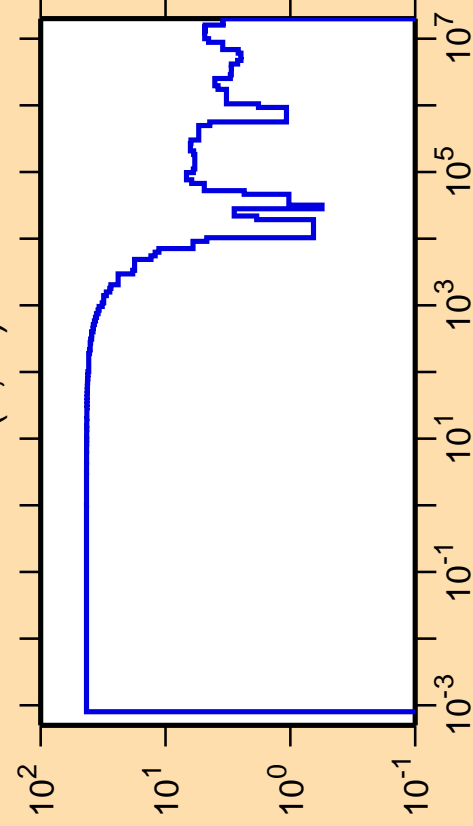


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{tot.})$

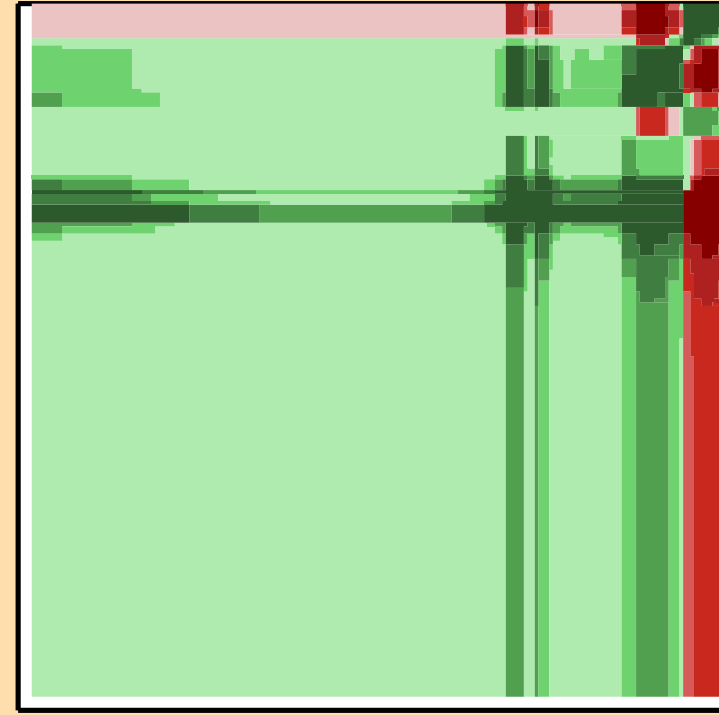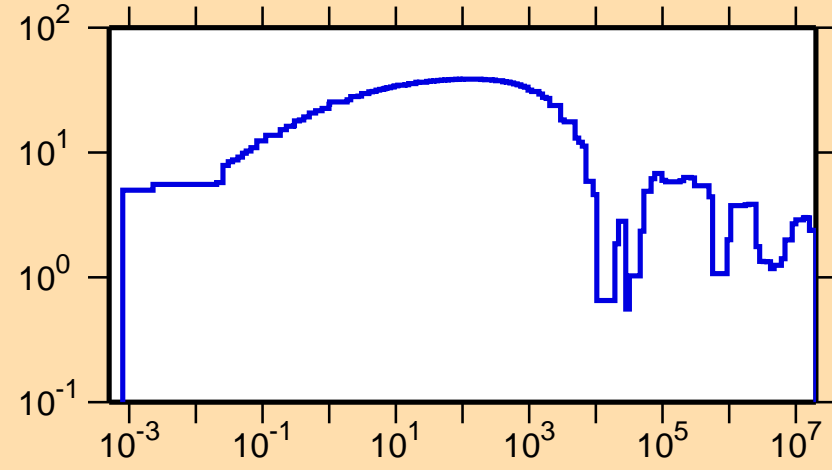

Correlation Matrix

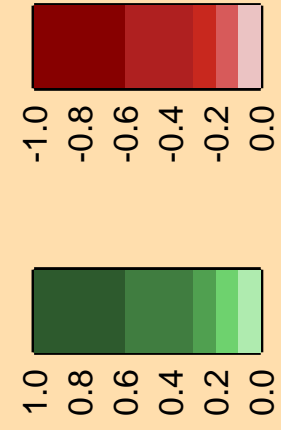


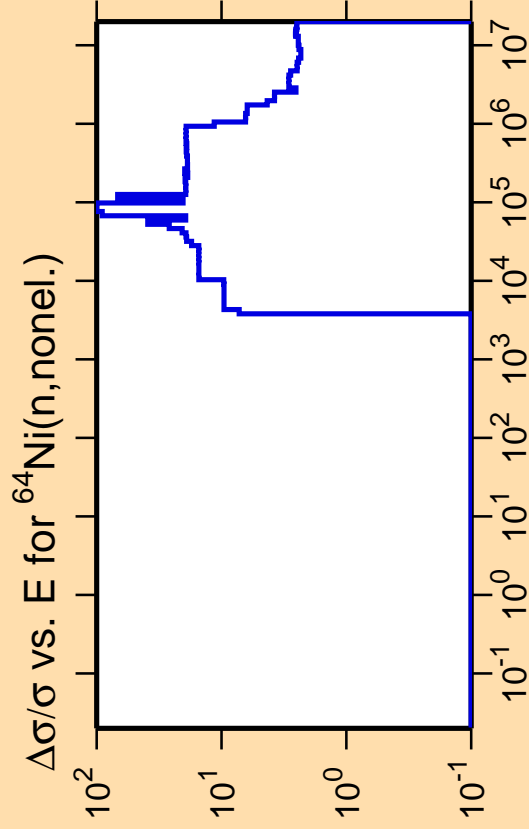

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

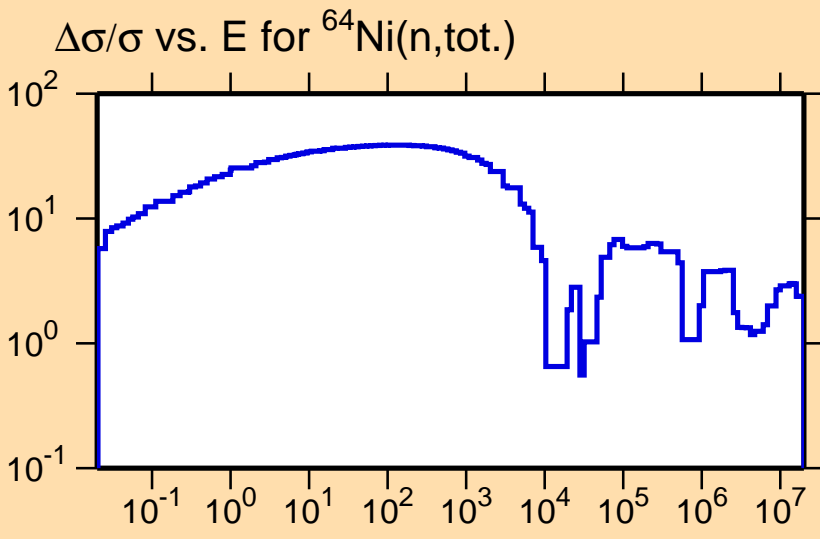

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

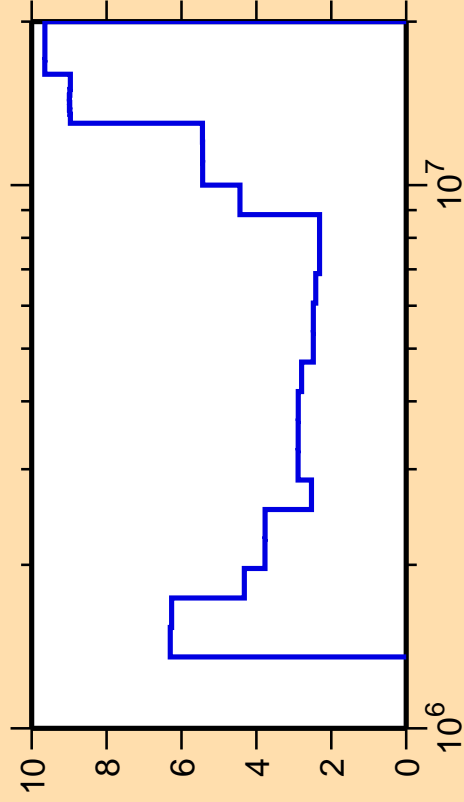

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{tot.})$

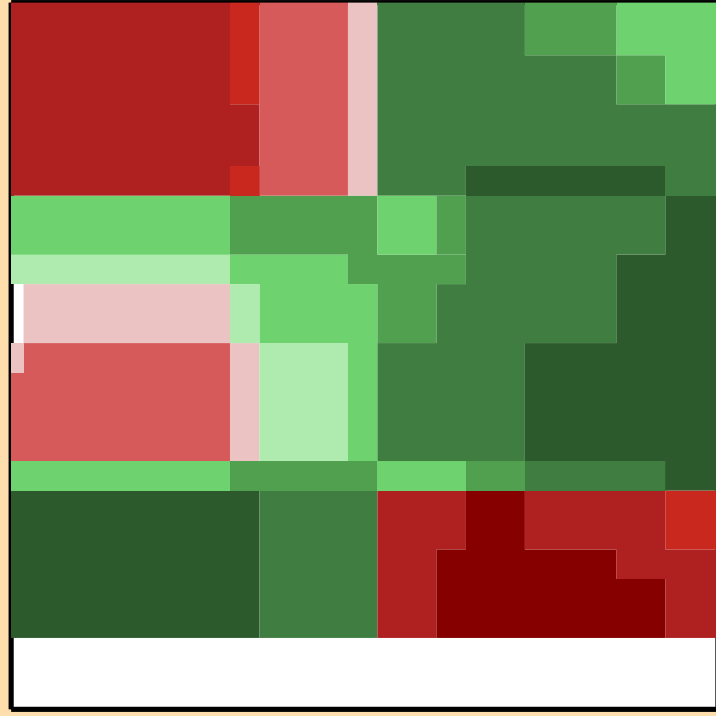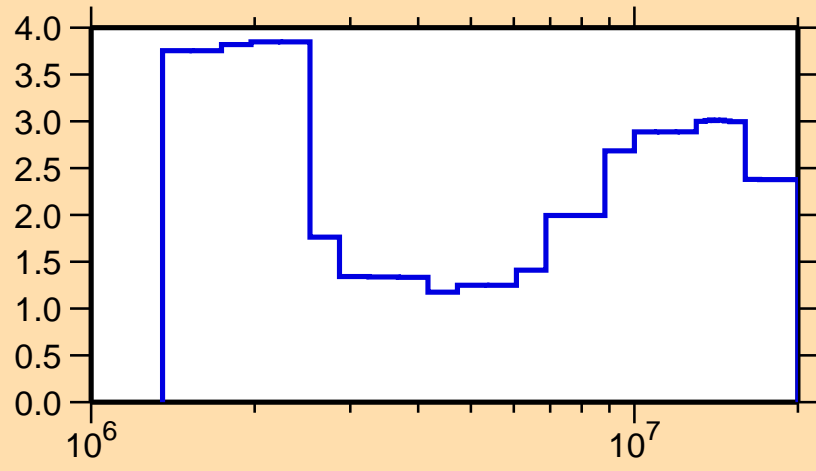

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

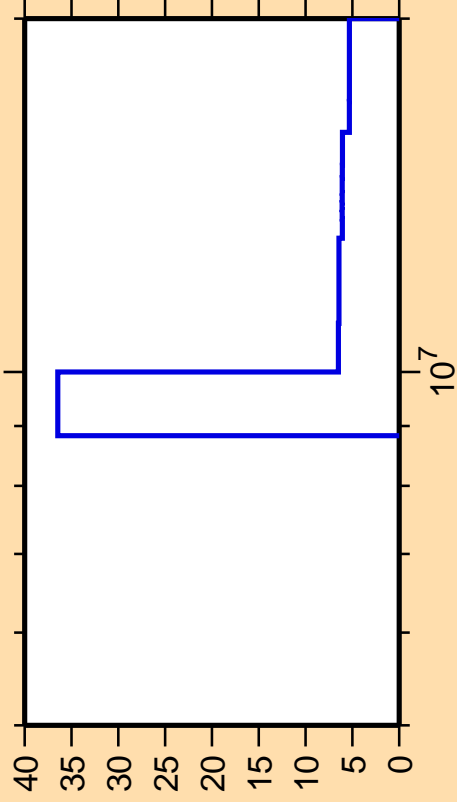

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{tot.})$

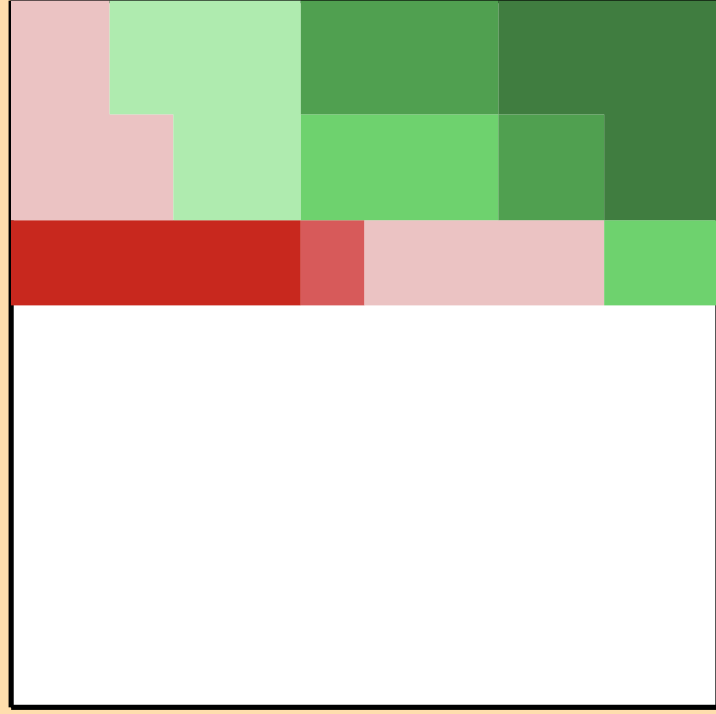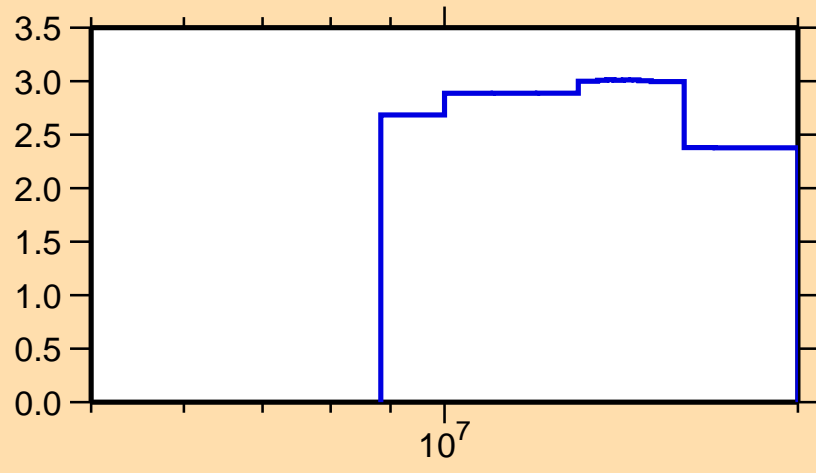



Correlation Matrix



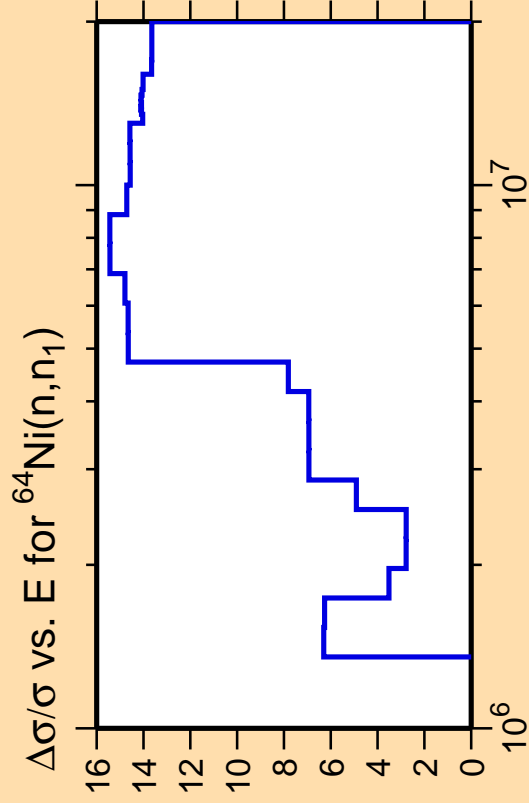

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

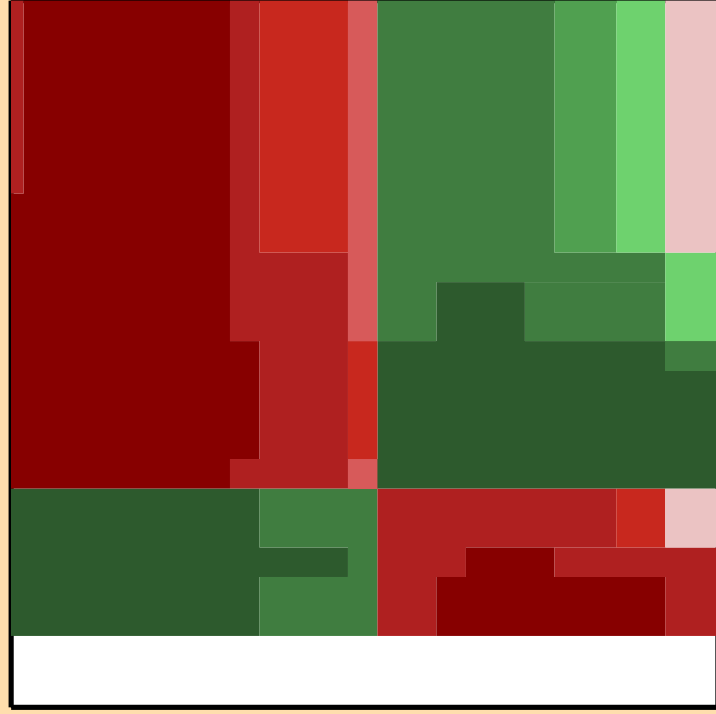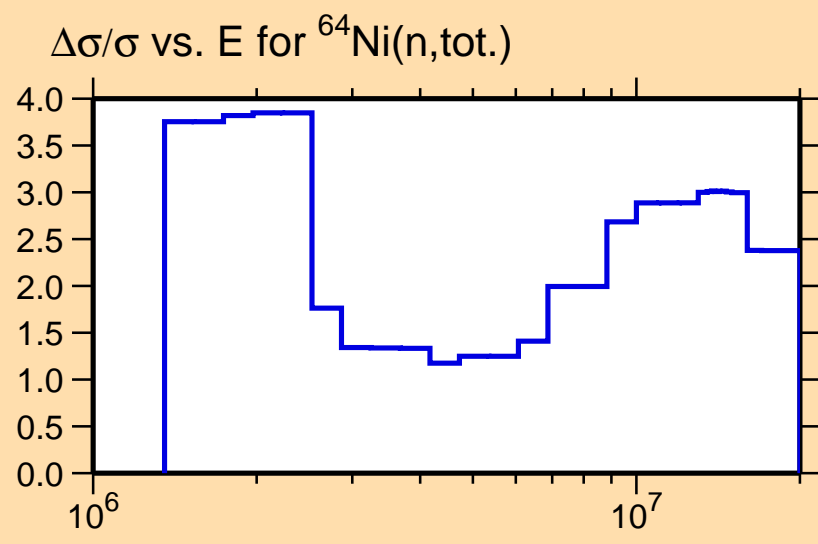

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

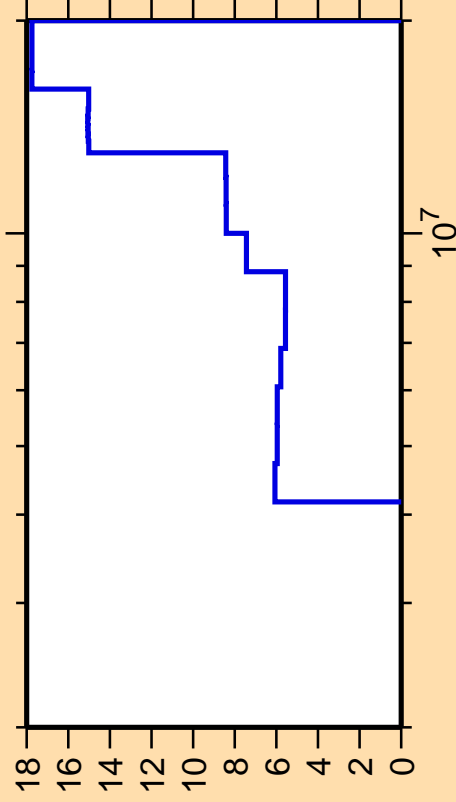

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{tot.})$

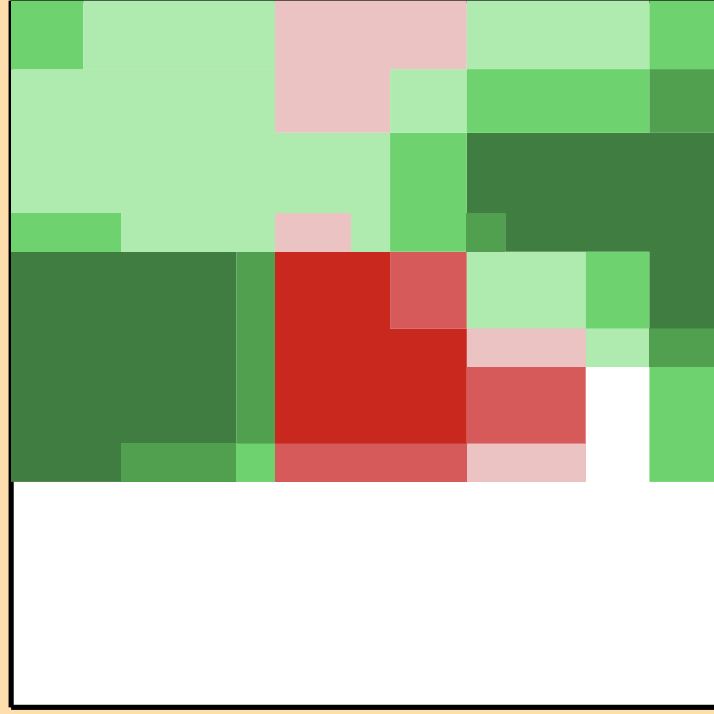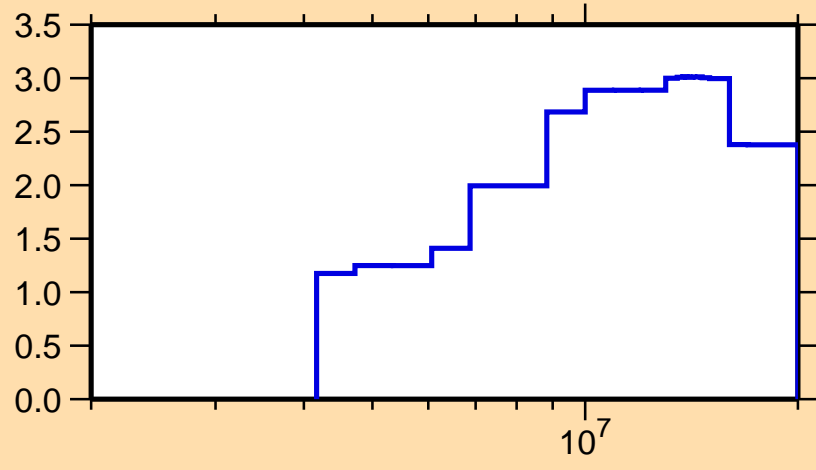

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\gamma)$

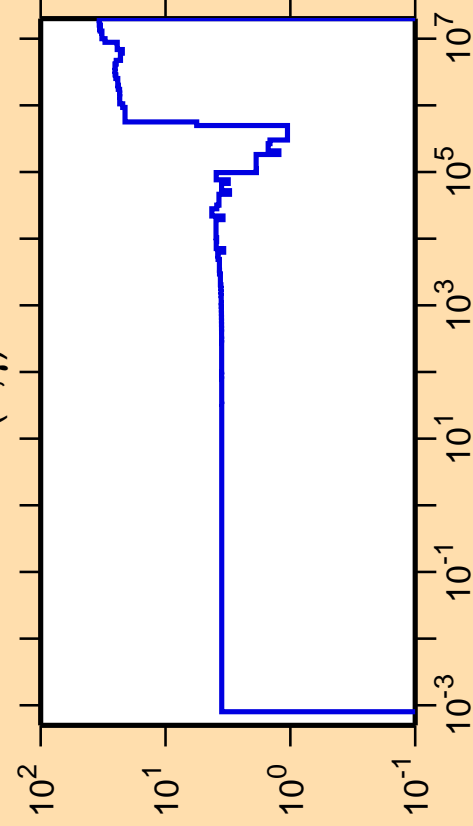

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{tot.})$

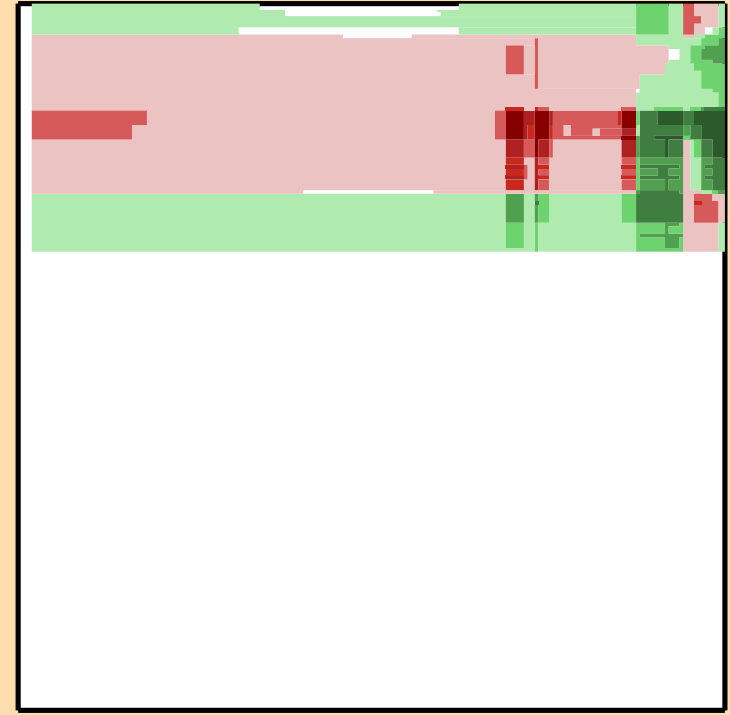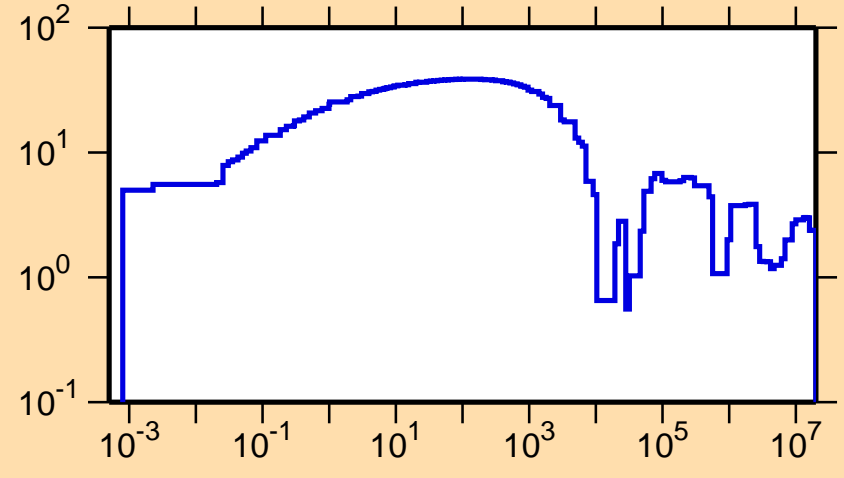

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

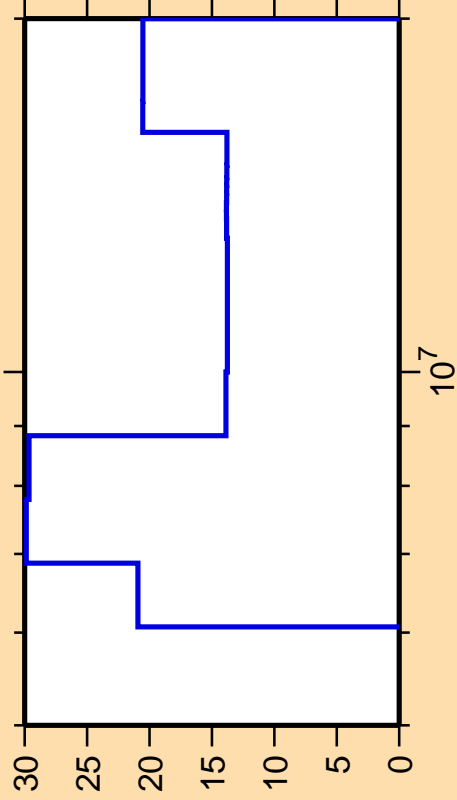

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{tot.})$

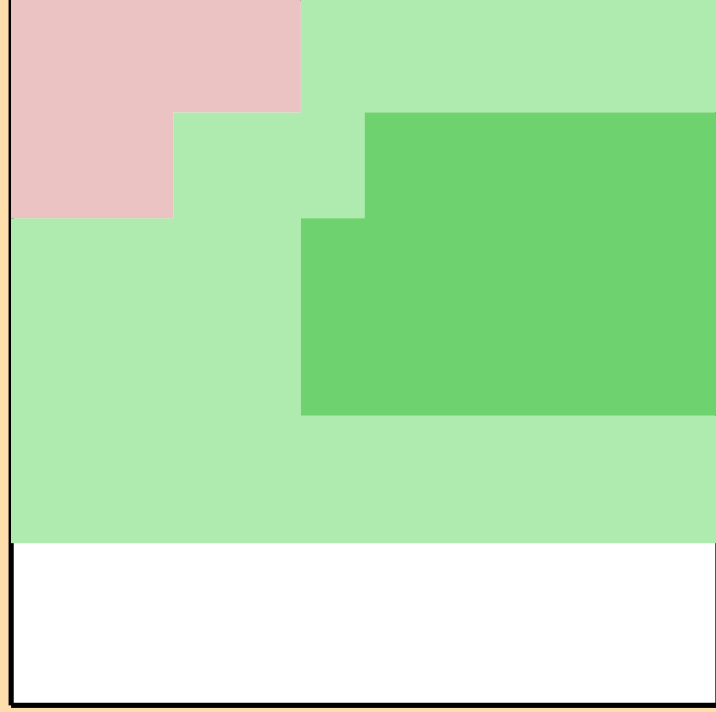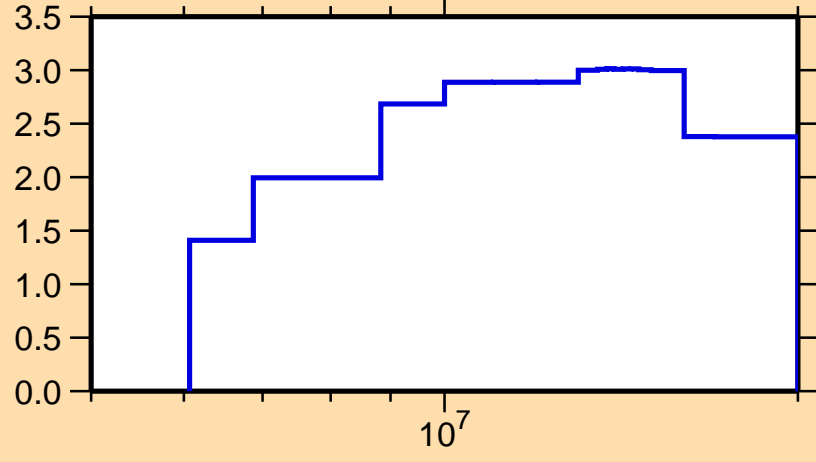

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\alpha)$


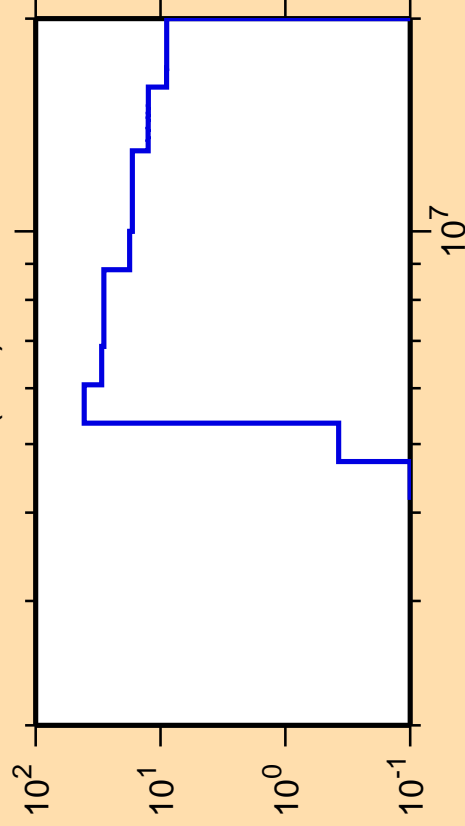


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{tot.})$

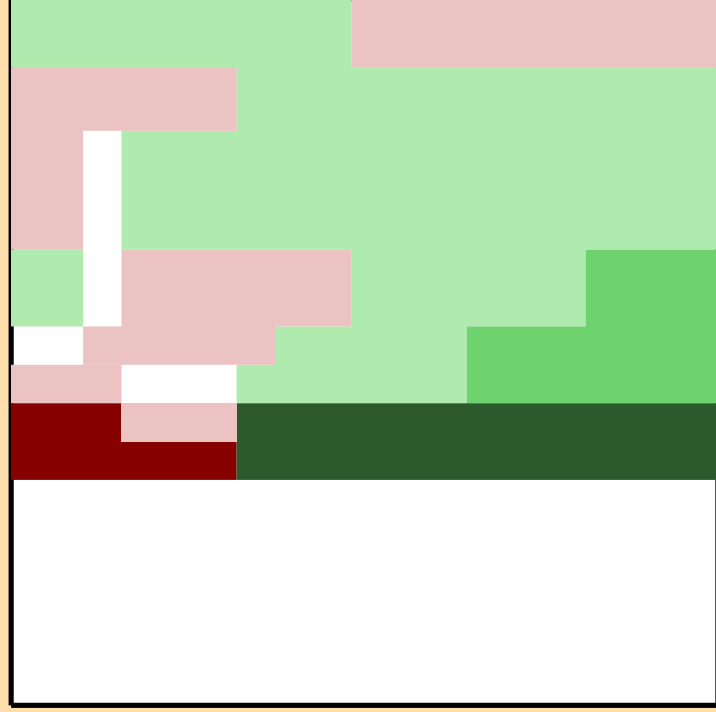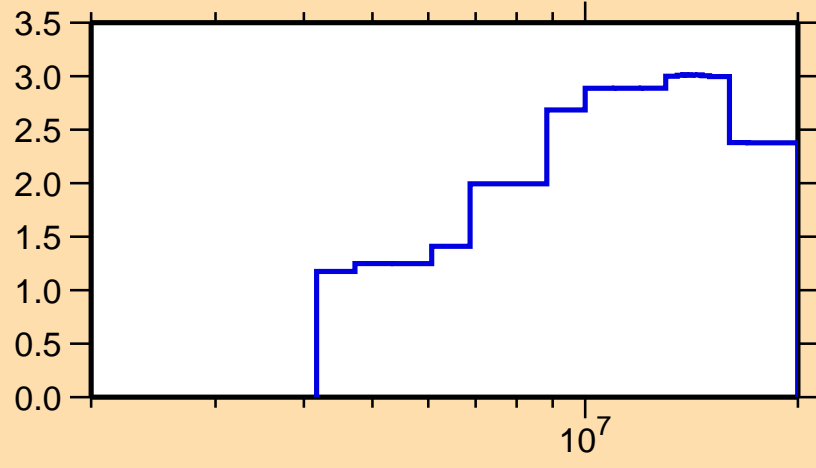



Correlation Matrix



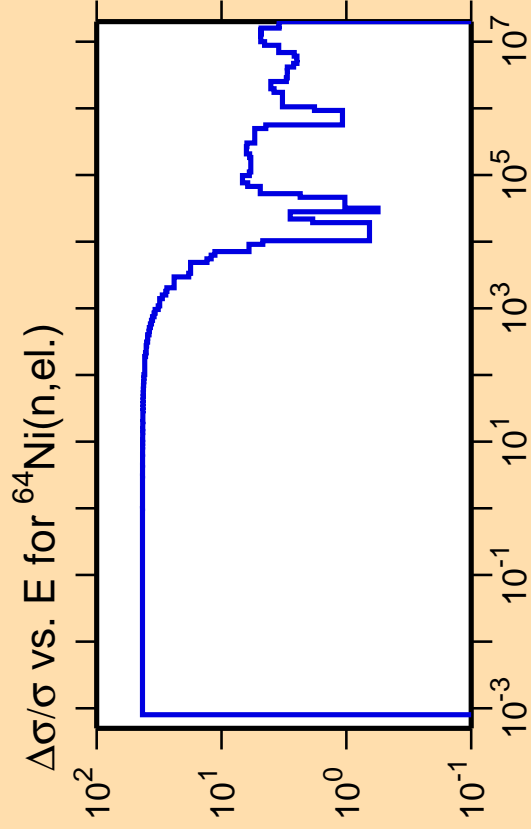


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

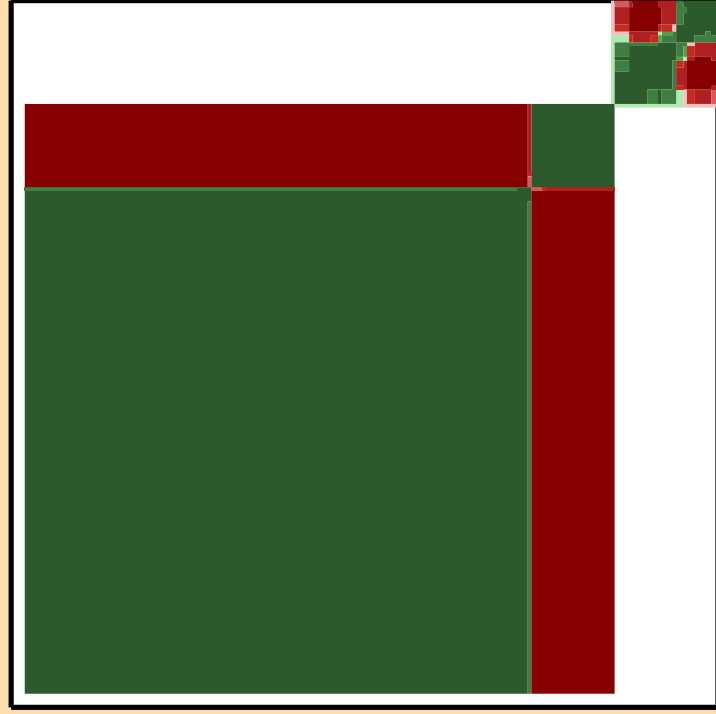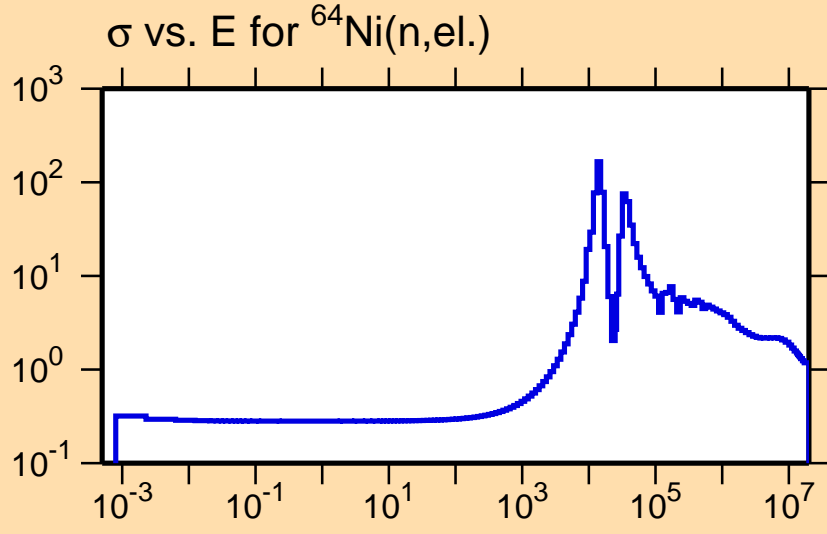

Correlation Matrix




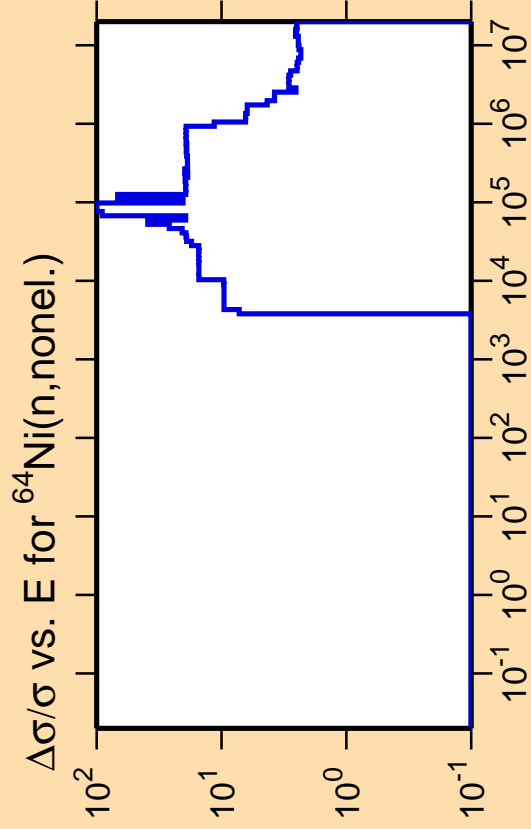


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

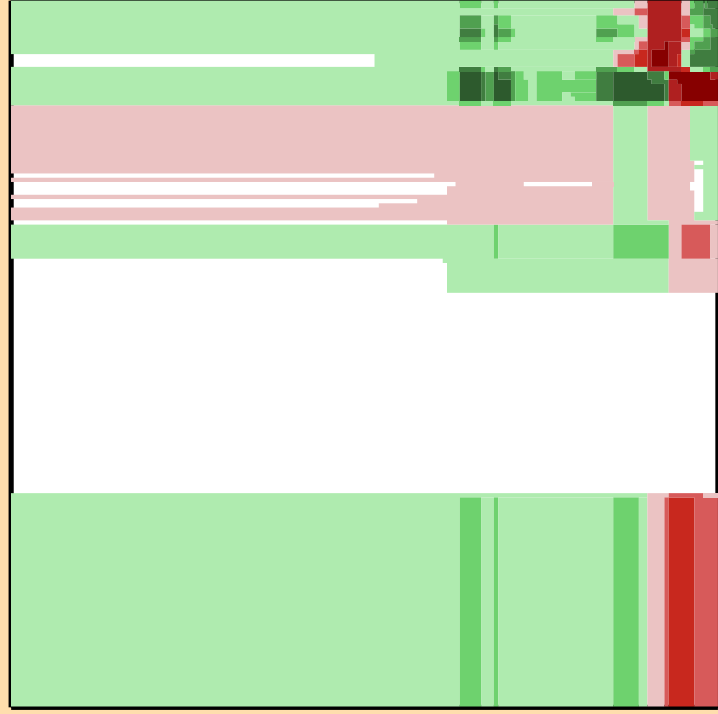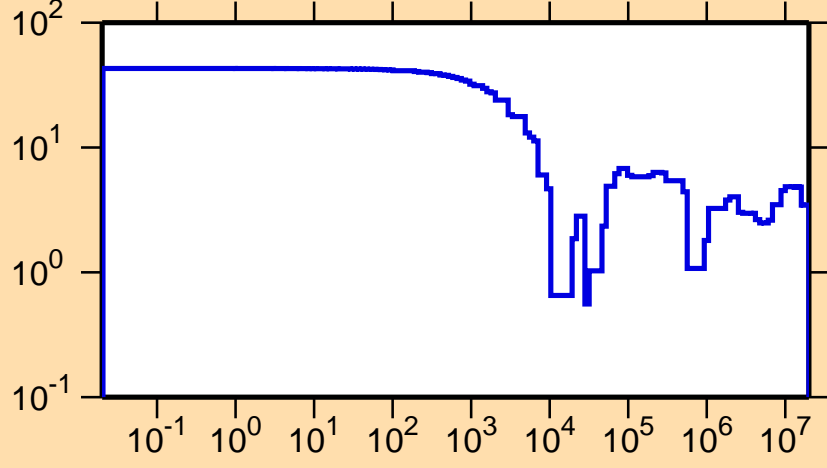

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

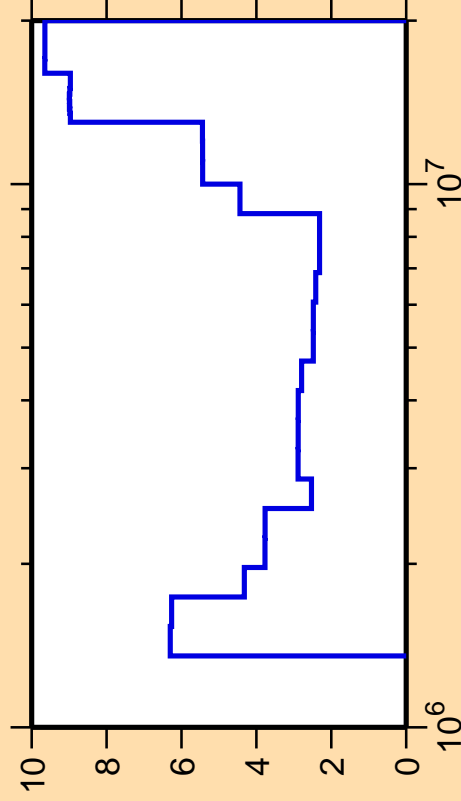

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

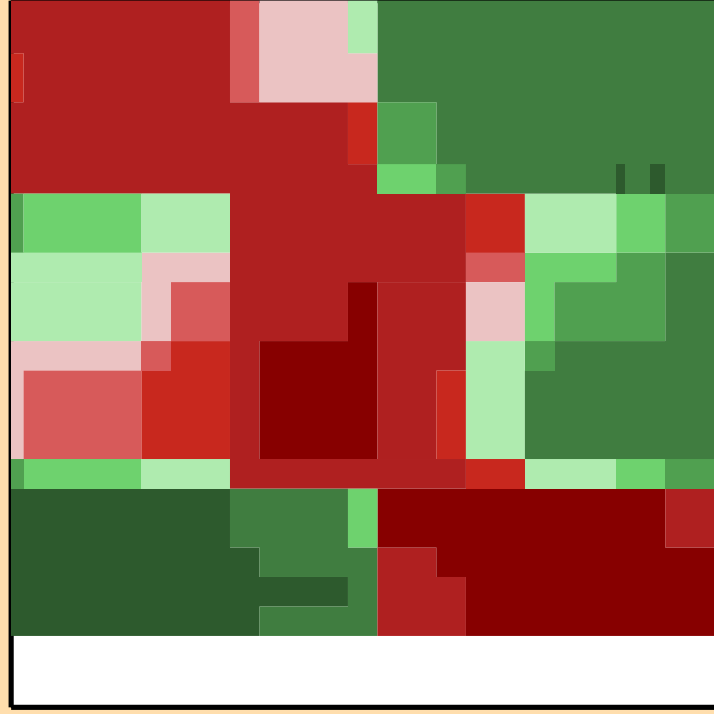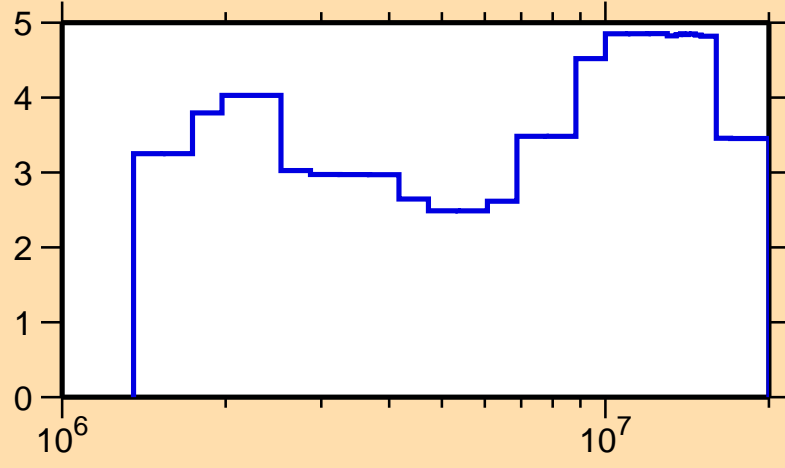

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

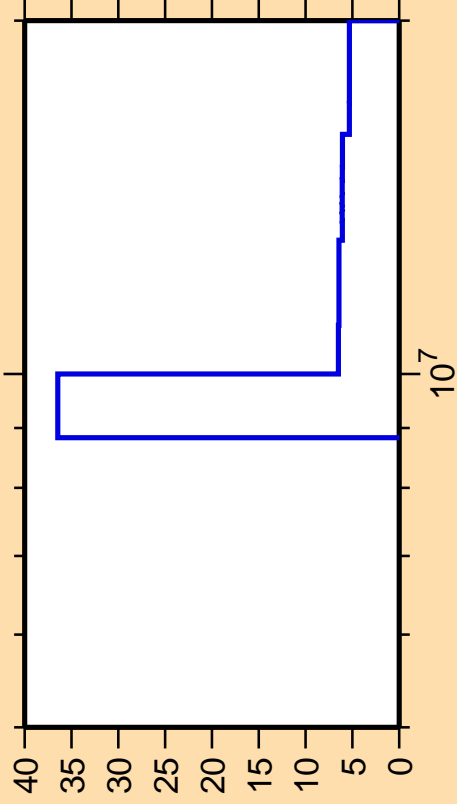

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

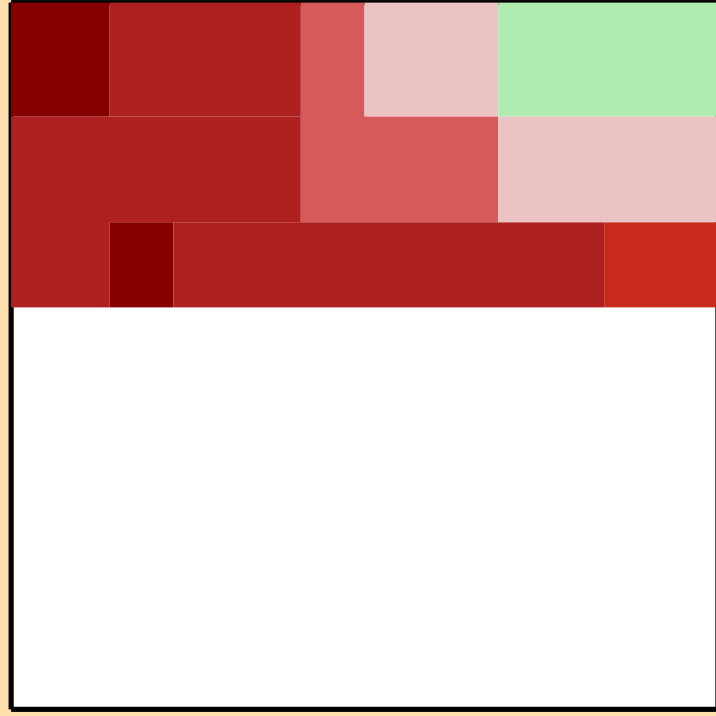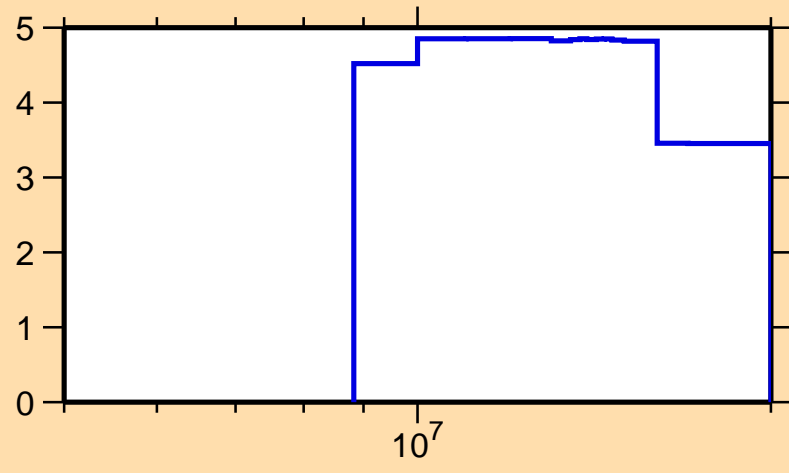

Correlation Matrix





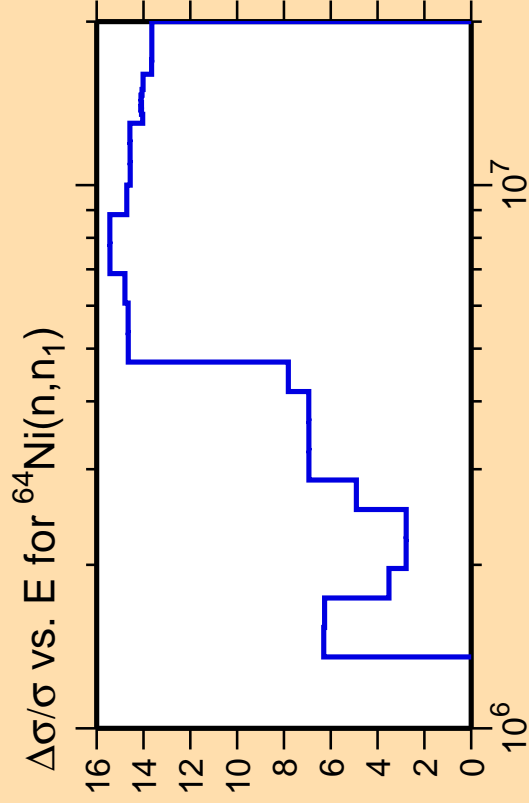

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

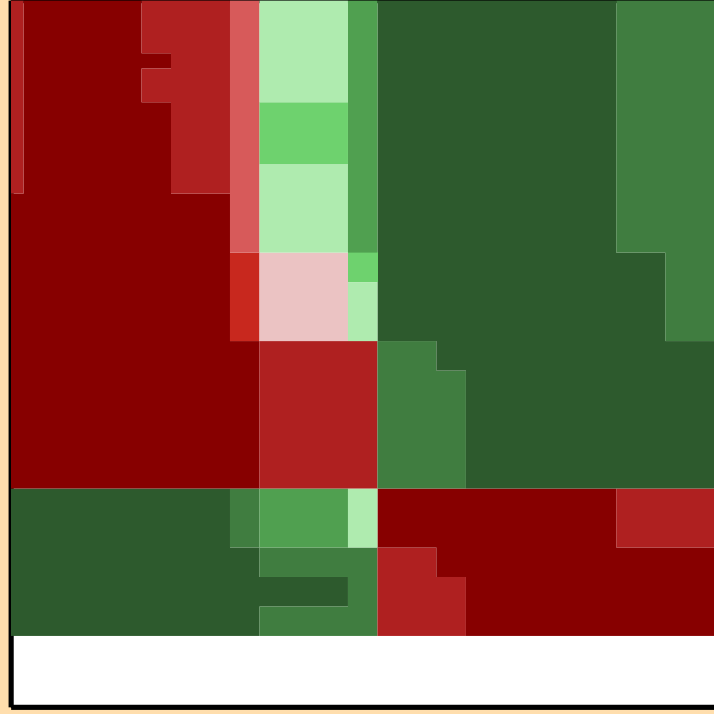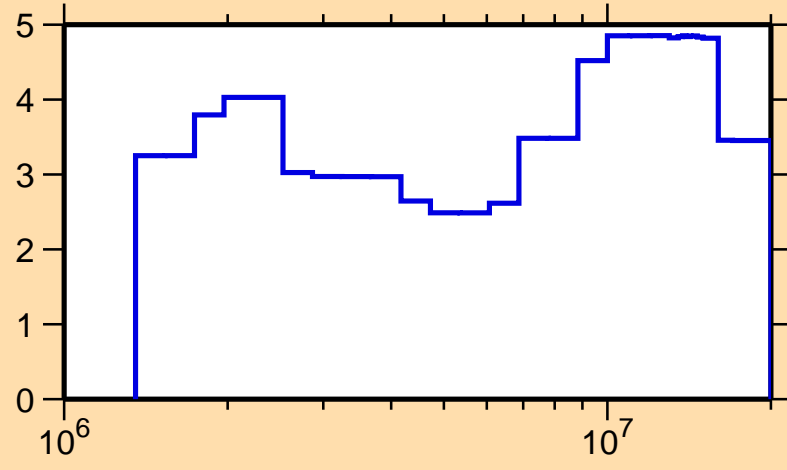

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

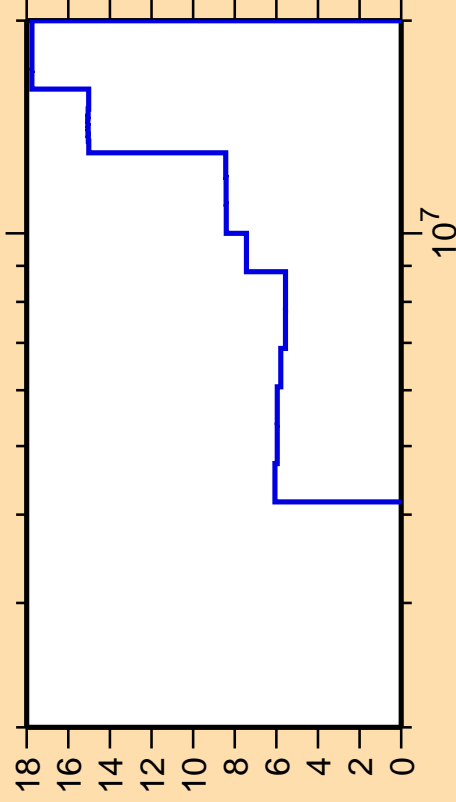

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

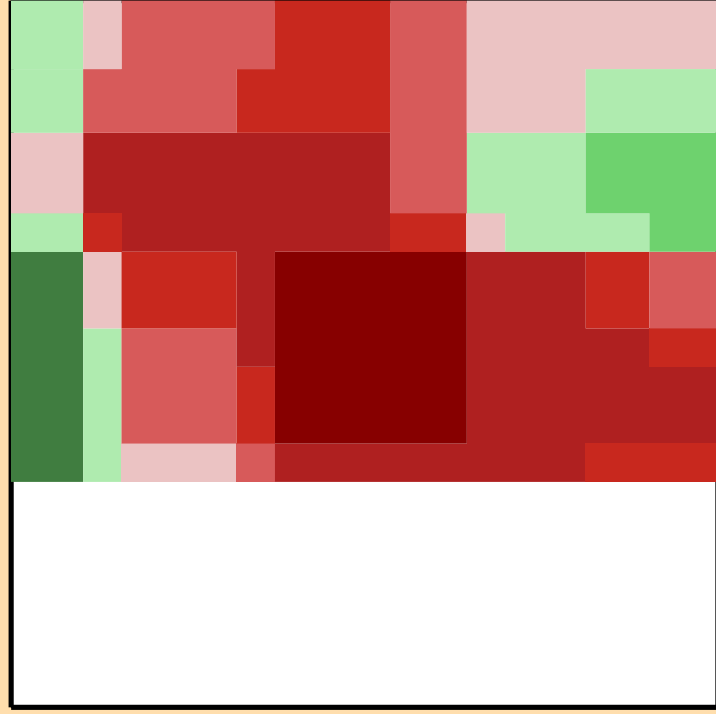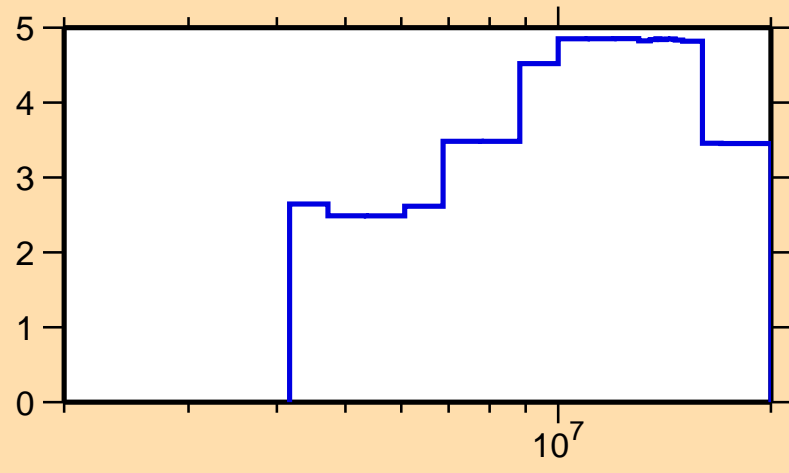

Correlation Matrix





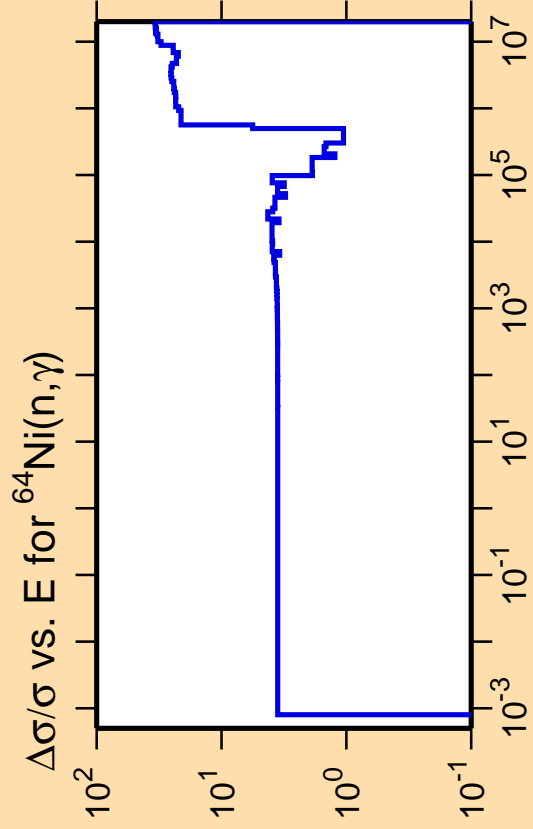


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

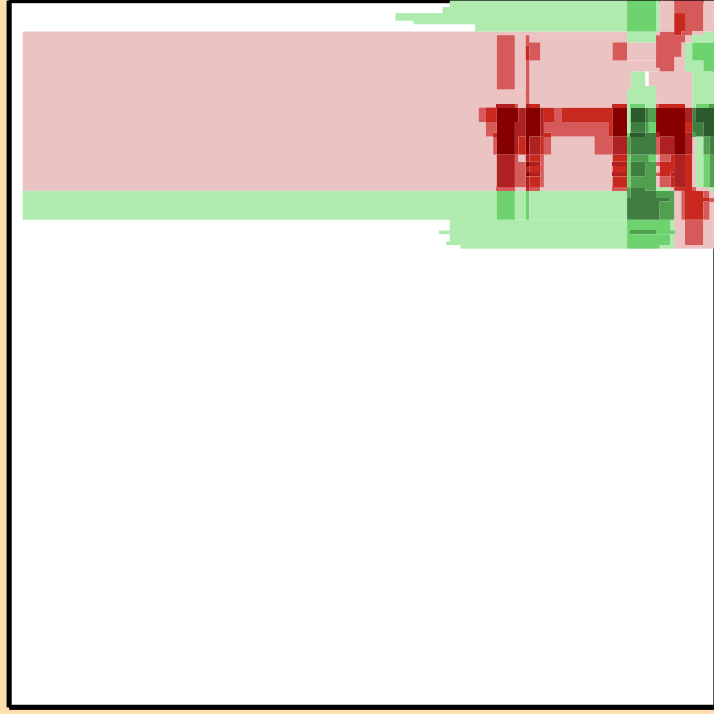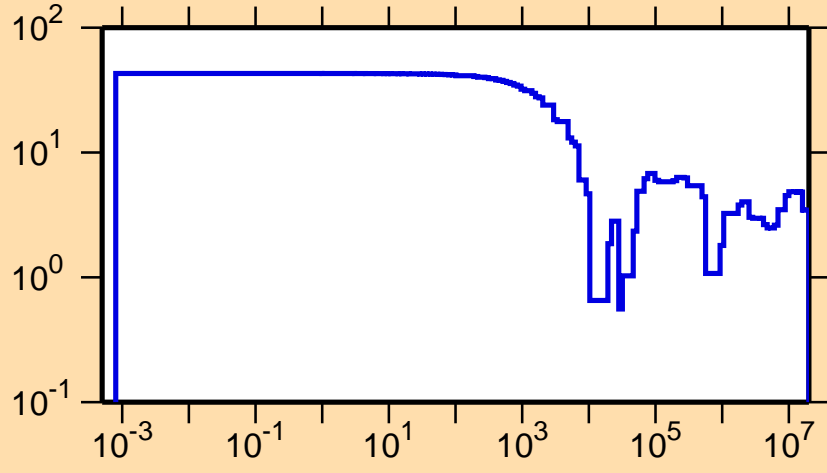

Correlation Matrix

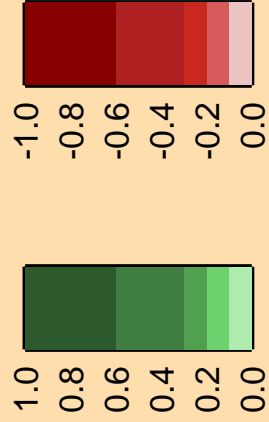



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

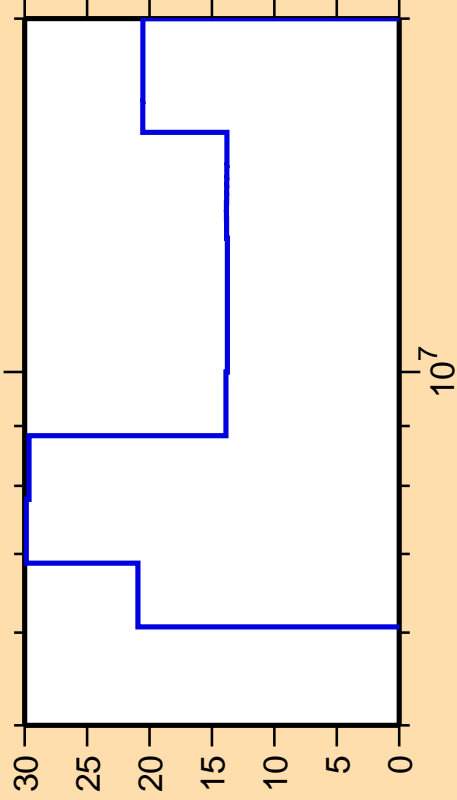

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

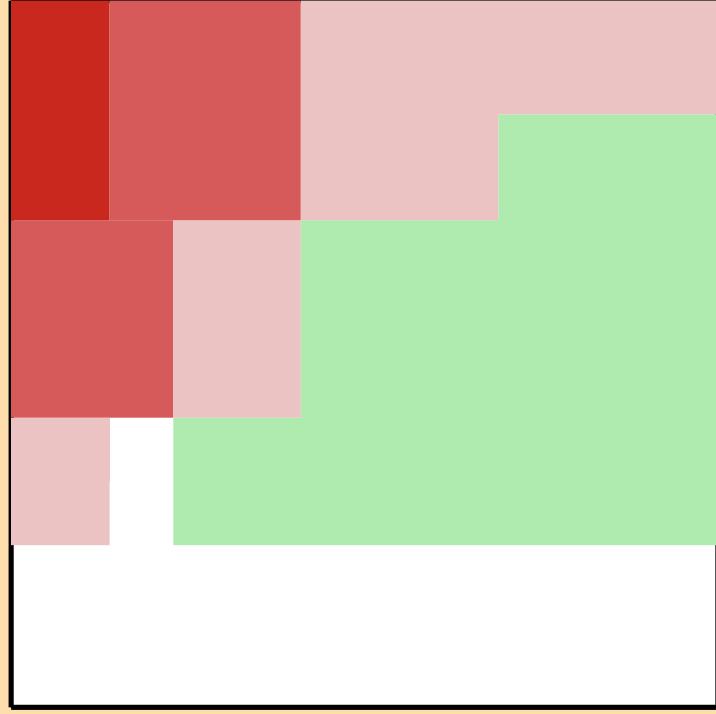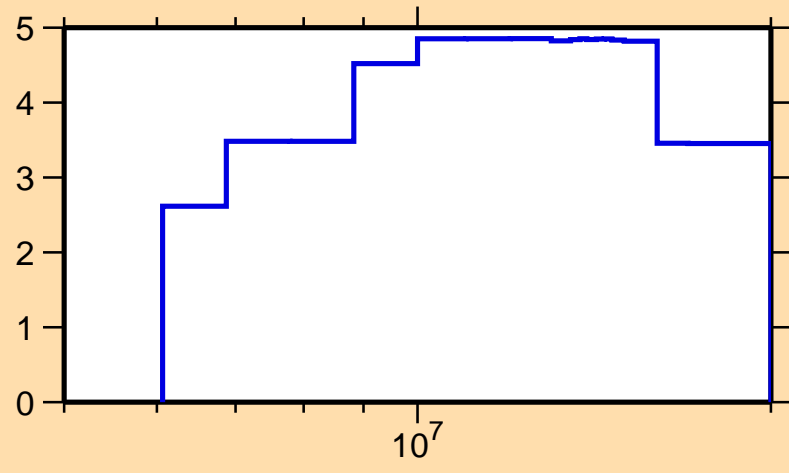

Correlation Matrix




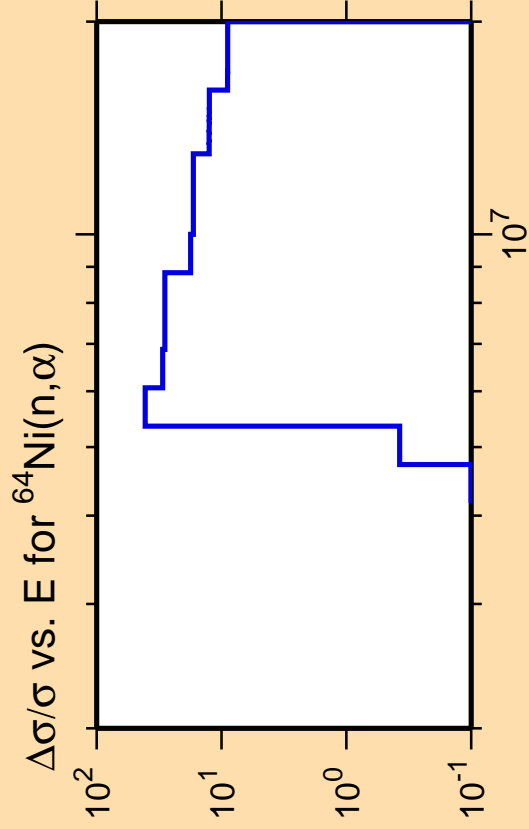


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{el.})$

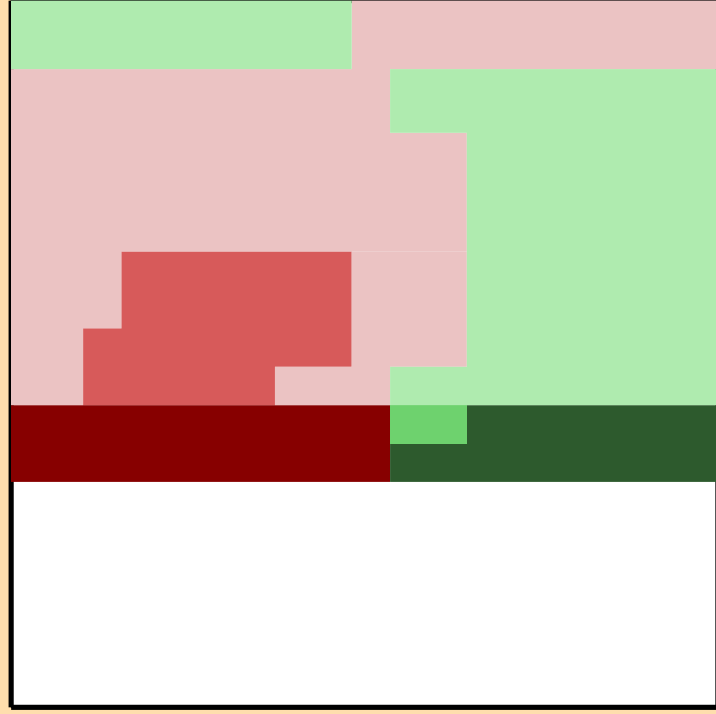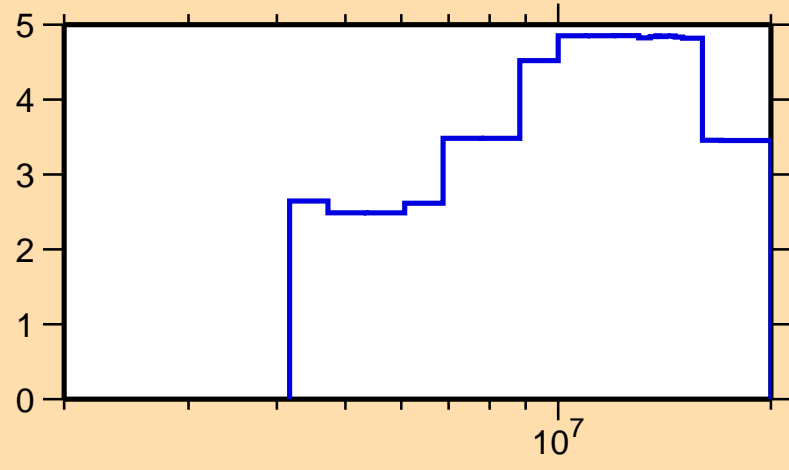

Correlation Matrix





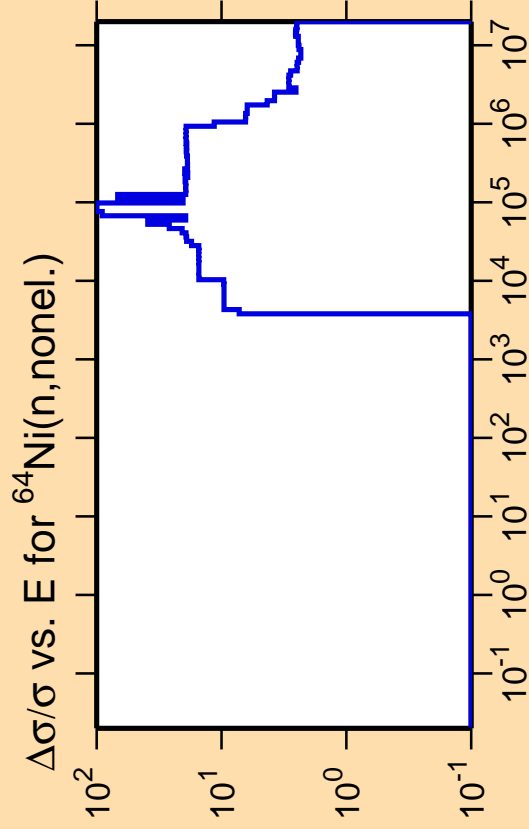

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

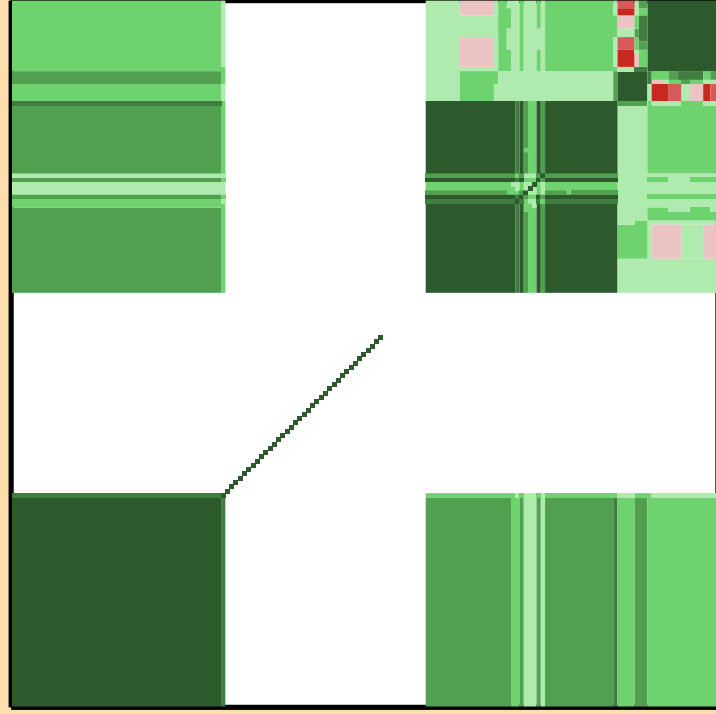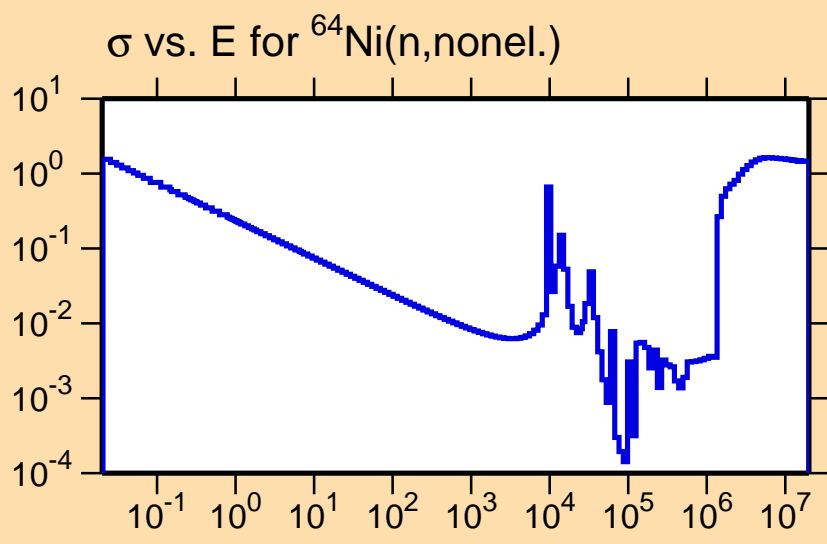

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

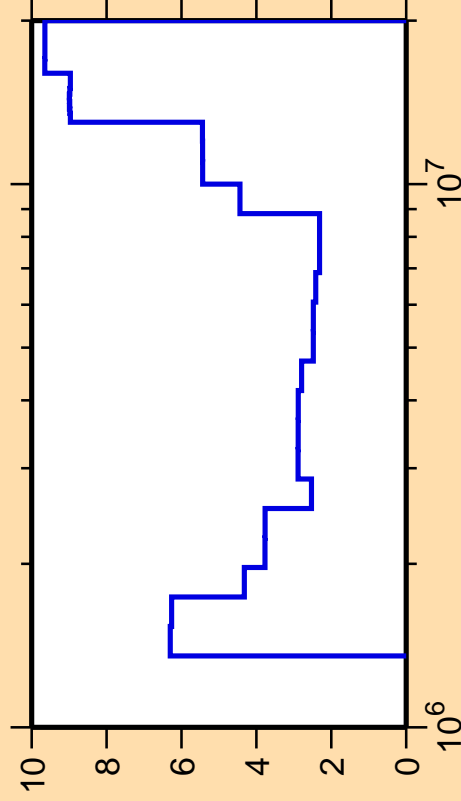

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{nonel.})$

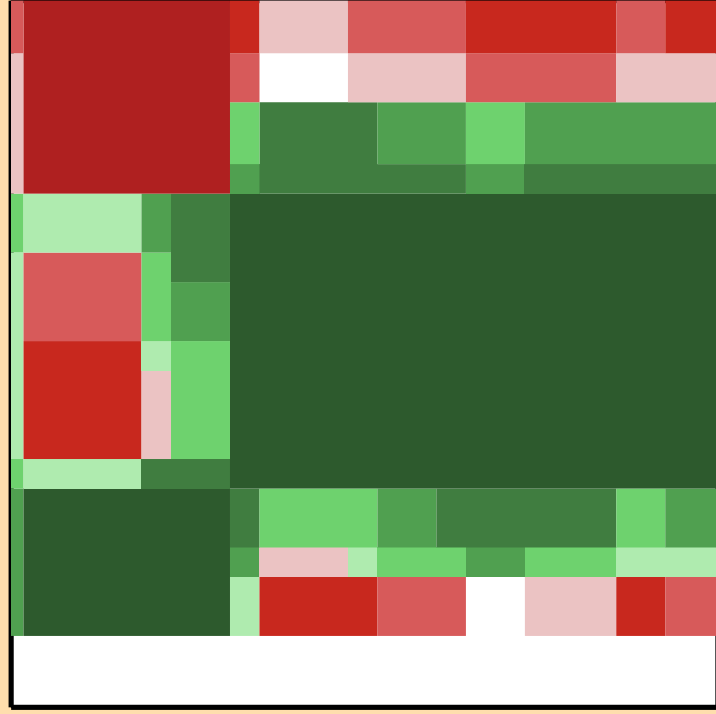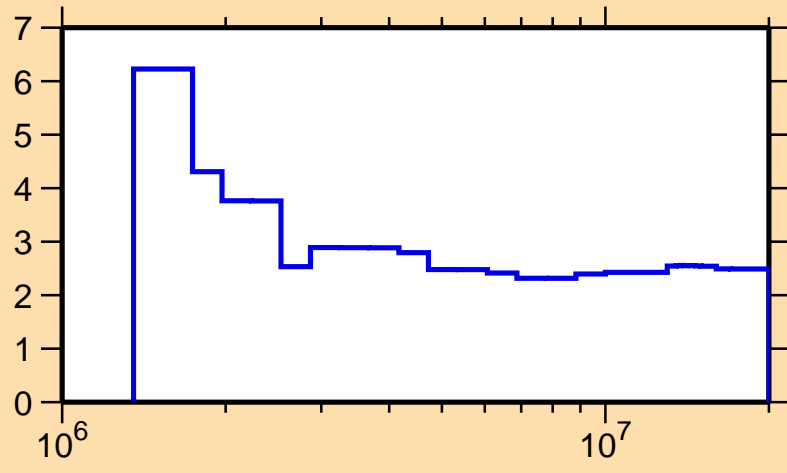

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

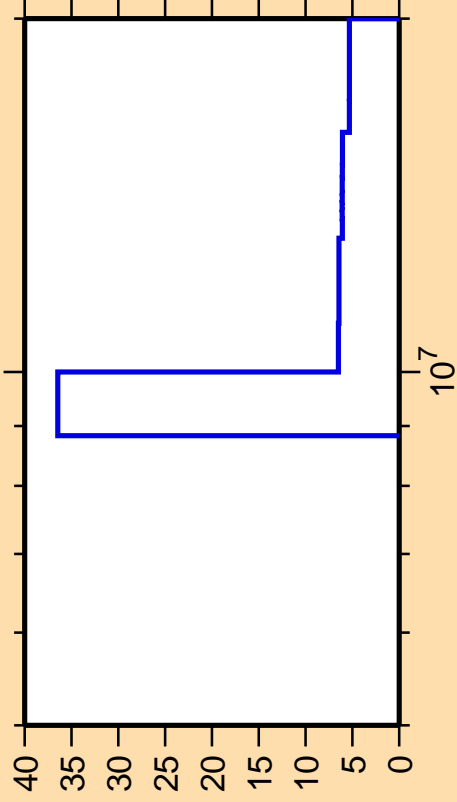

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{nonel.})$

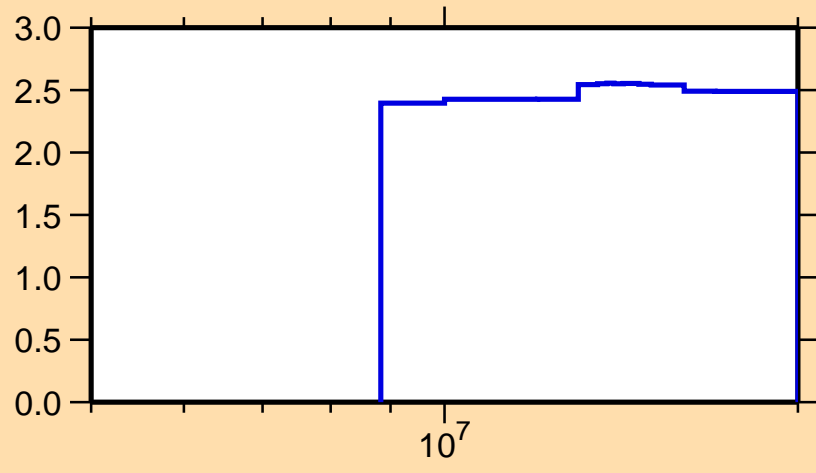

Correlation Matrix





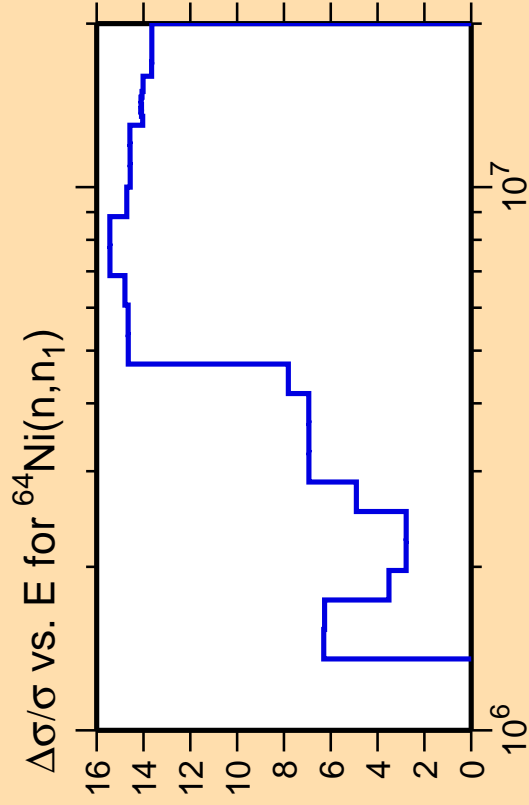

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{nonel.})$

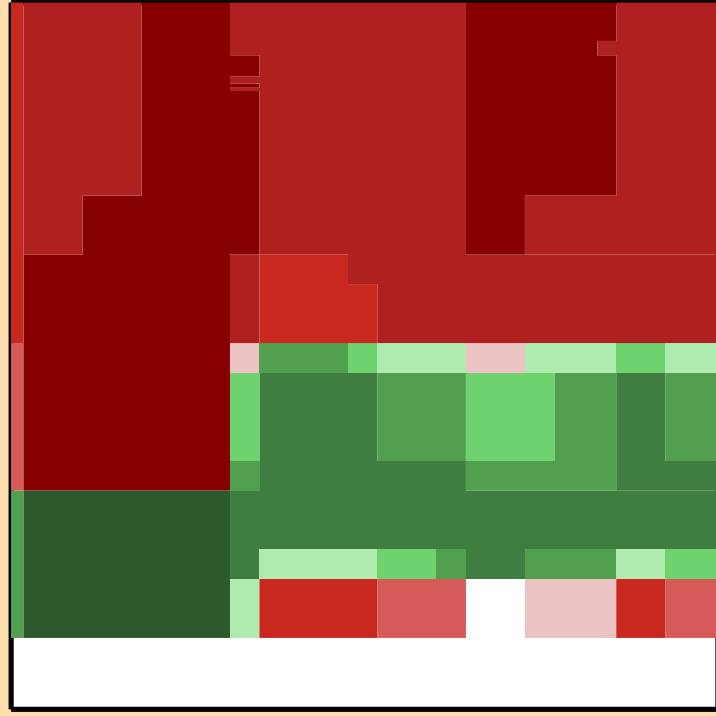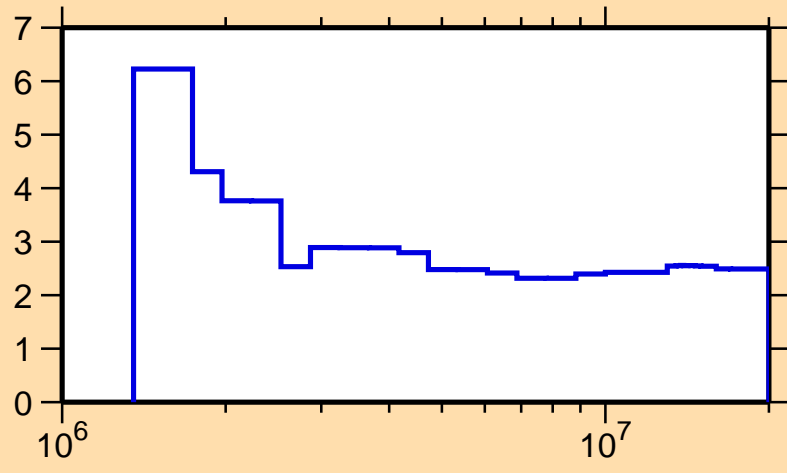

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

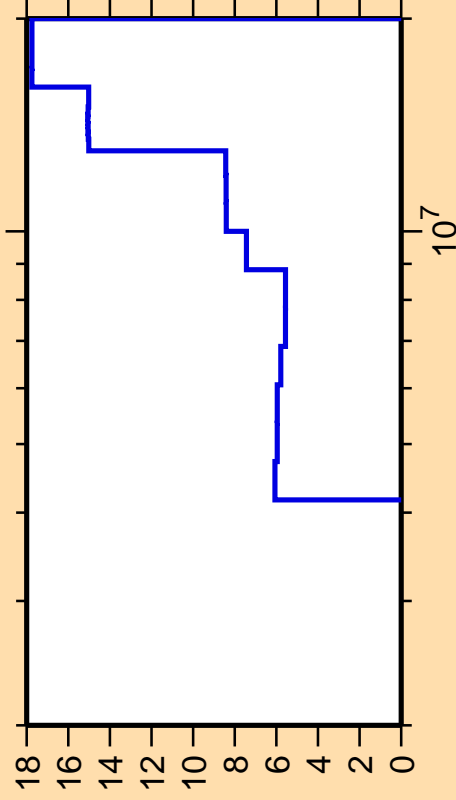

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{onel.})$

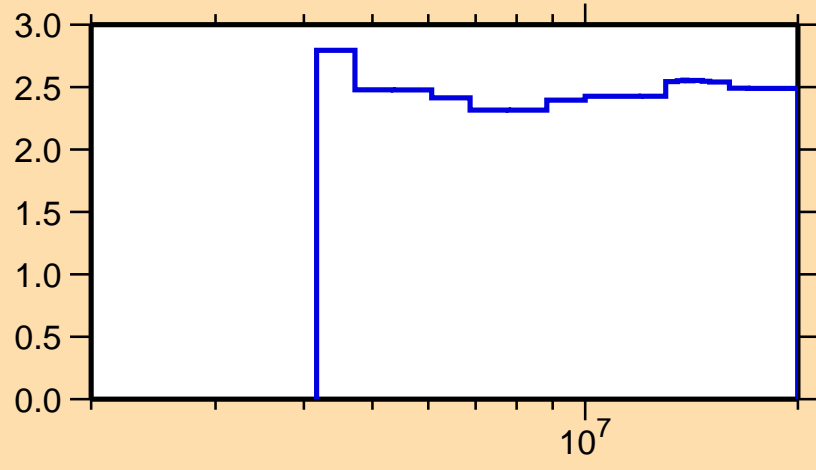

Correlation Matrix




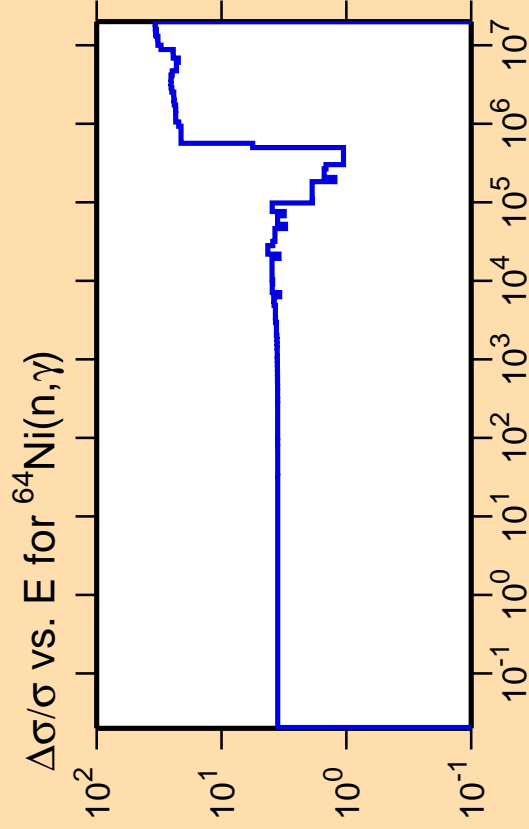


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{nonel.})$

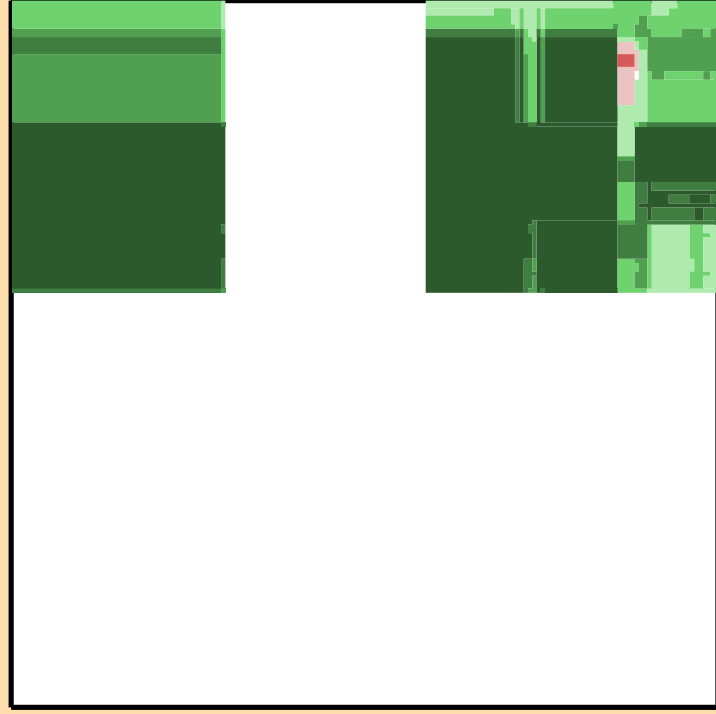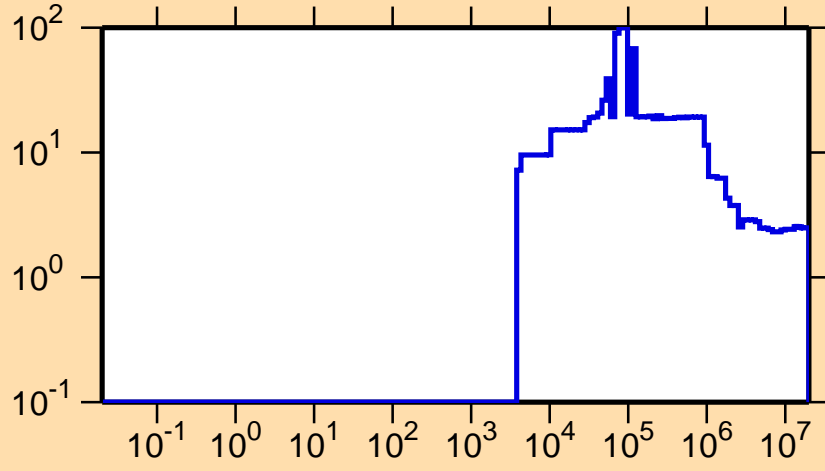

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

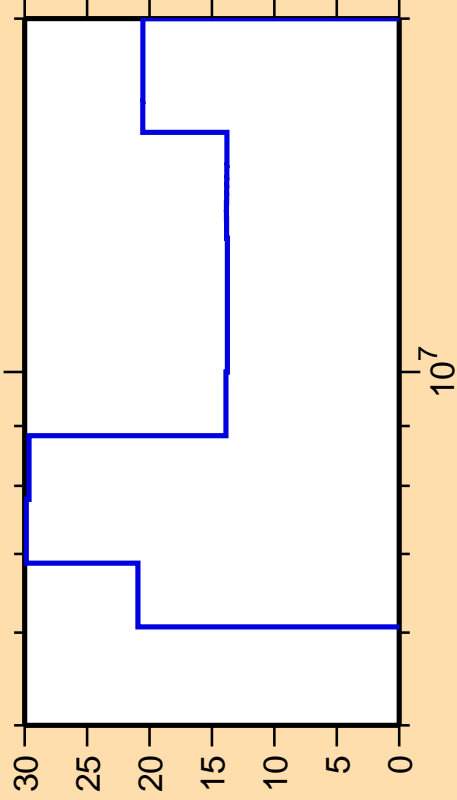

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{nonel.})$

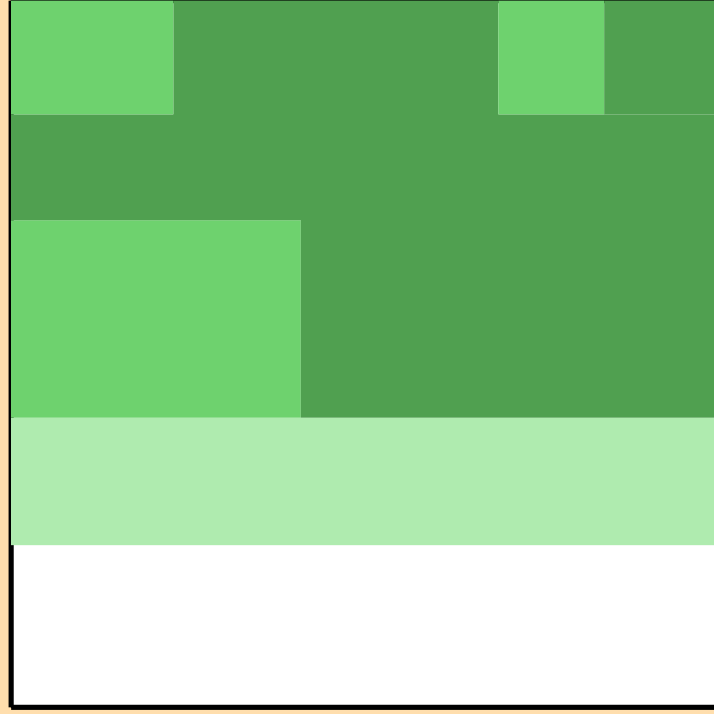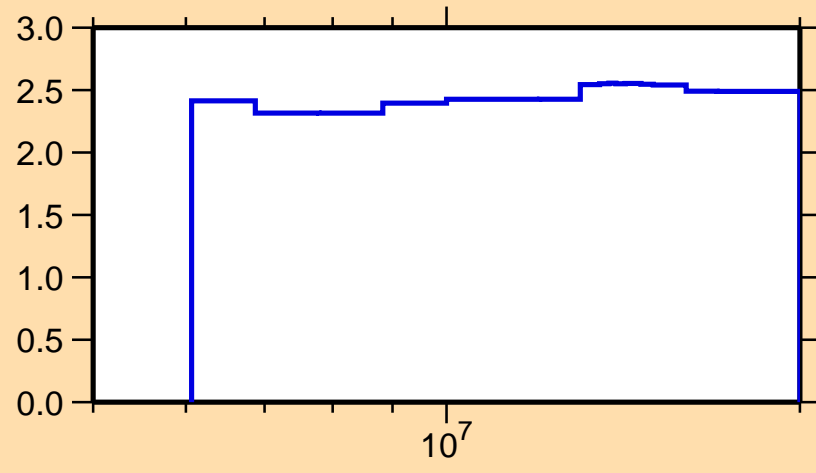

Correlation Matrix





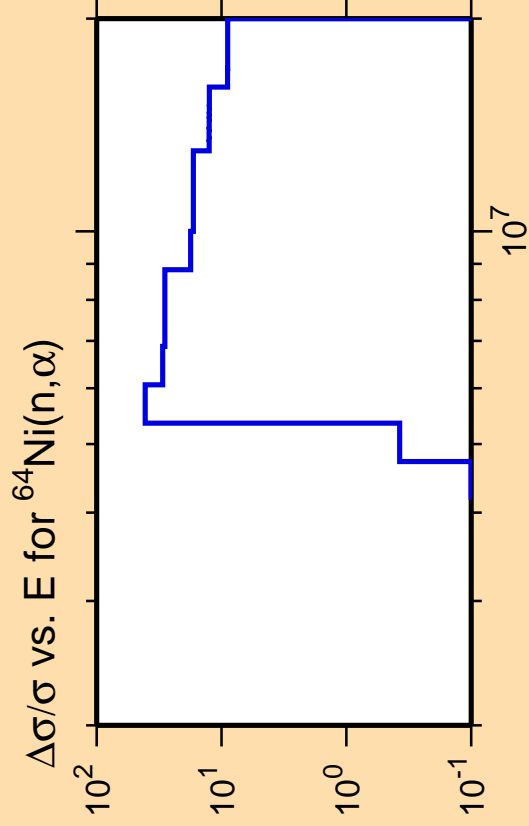

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

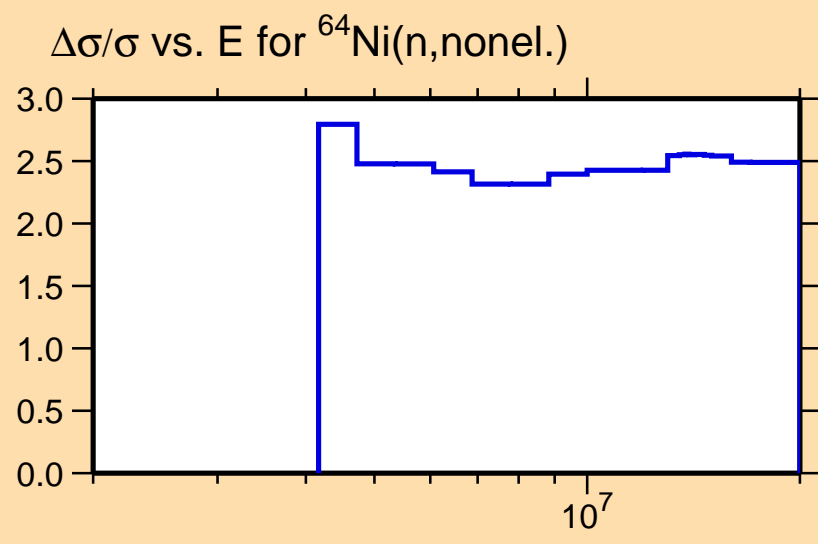

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

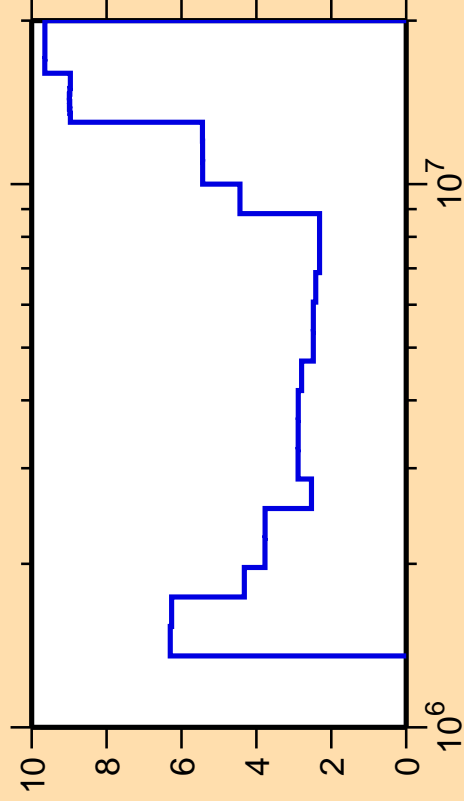

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

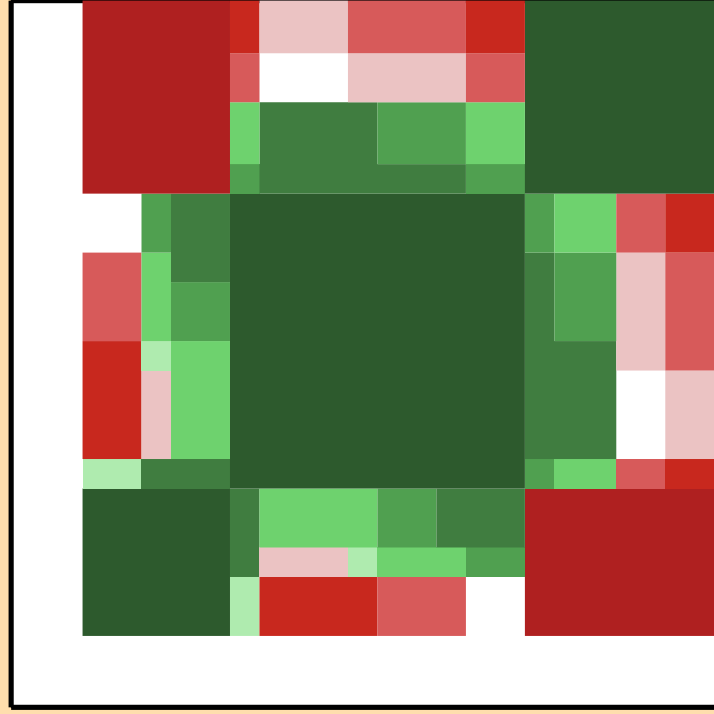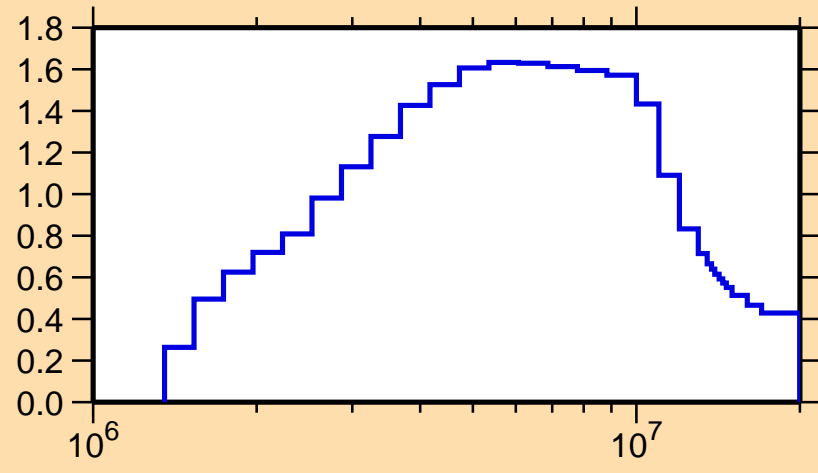

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

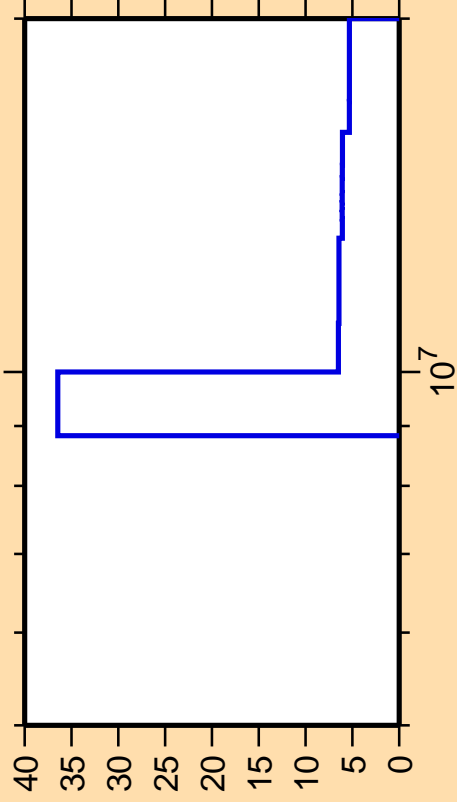

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

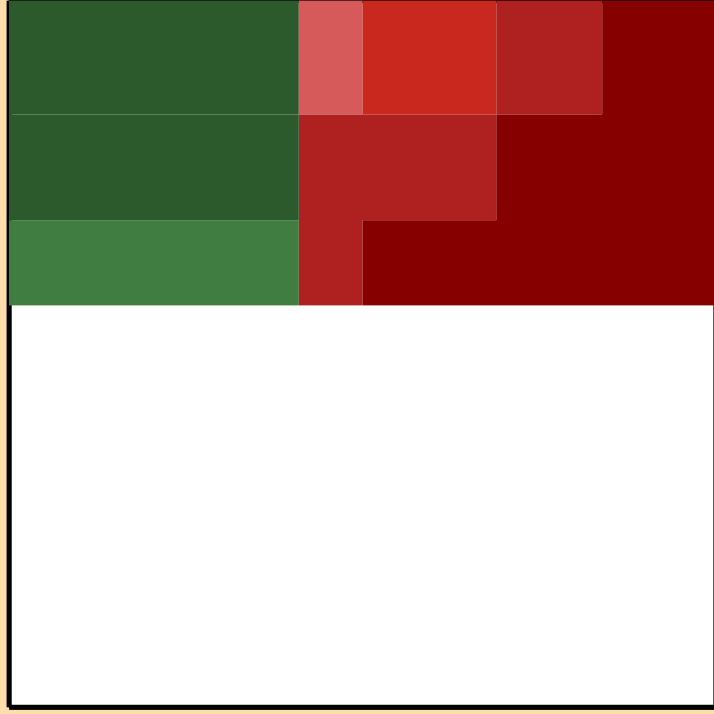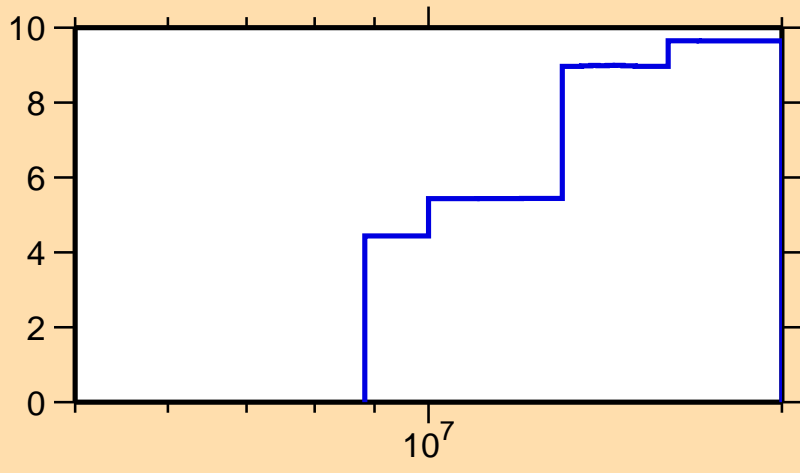

Correlation Matrix





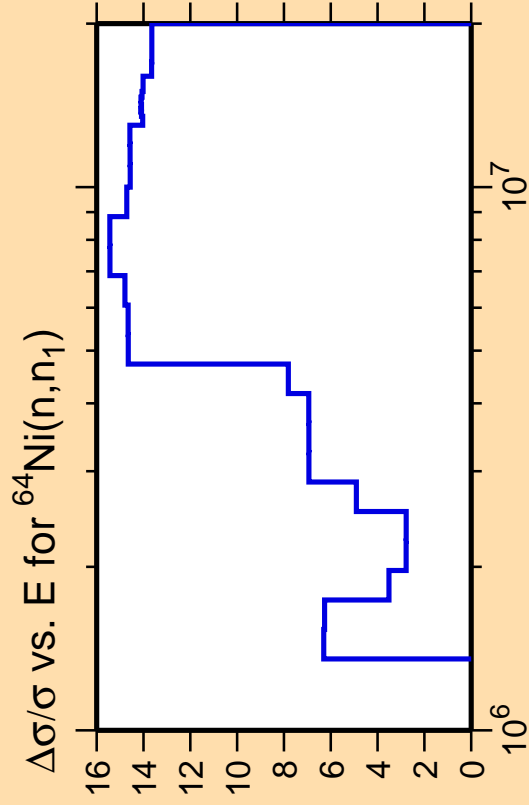

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

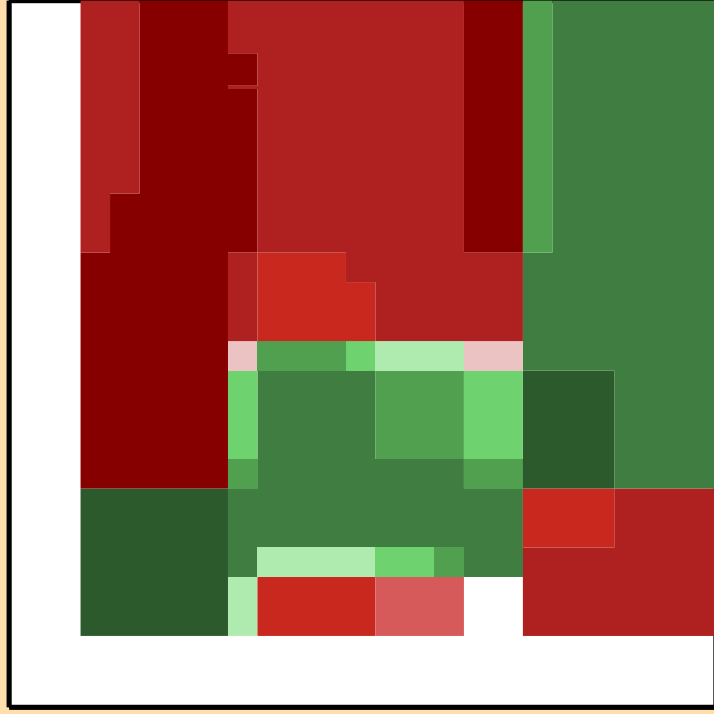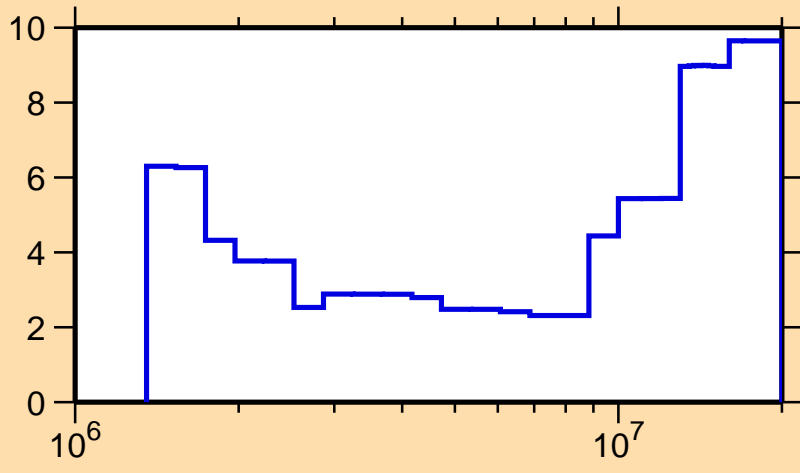

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

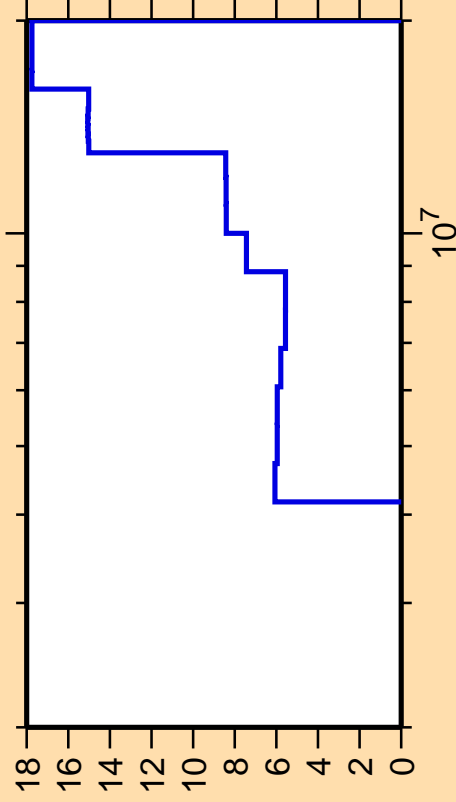

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

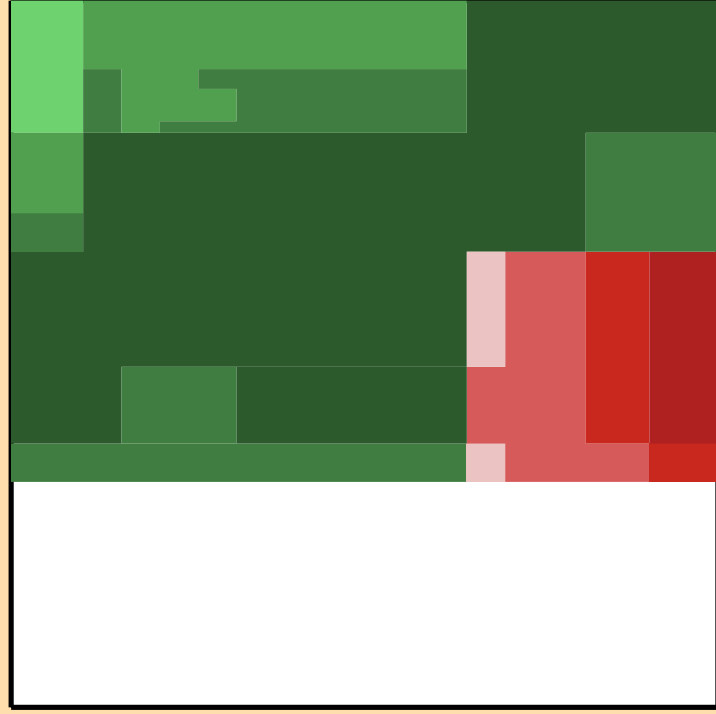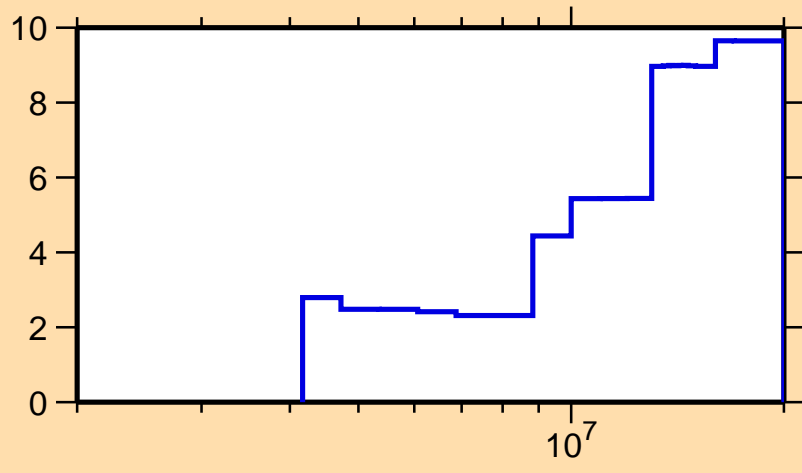

Correlation Matrix





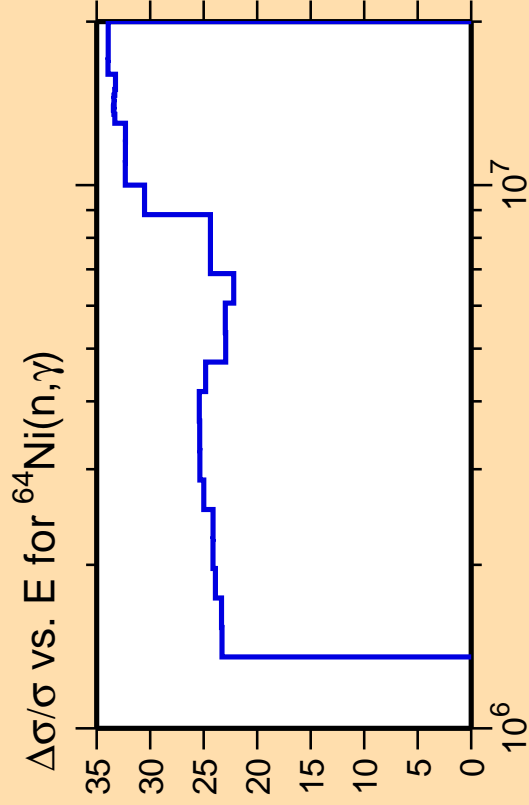

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

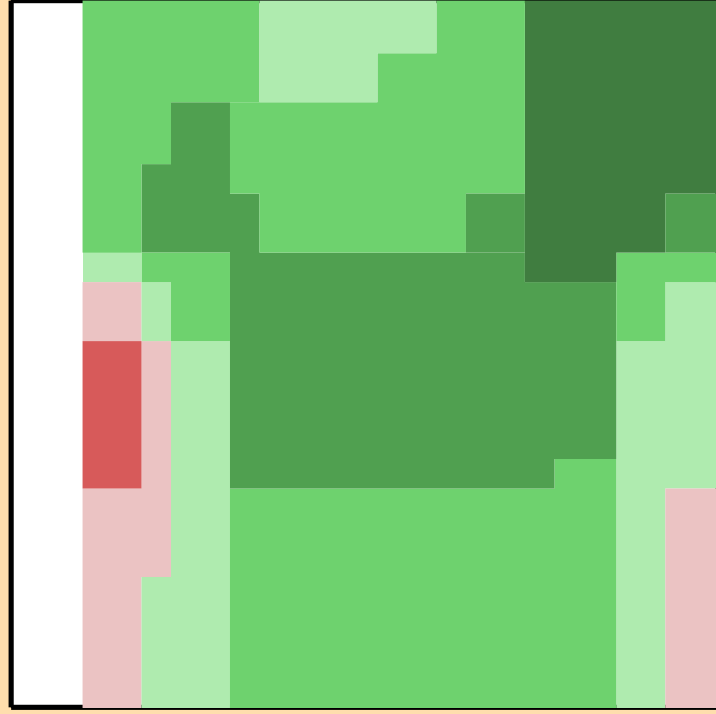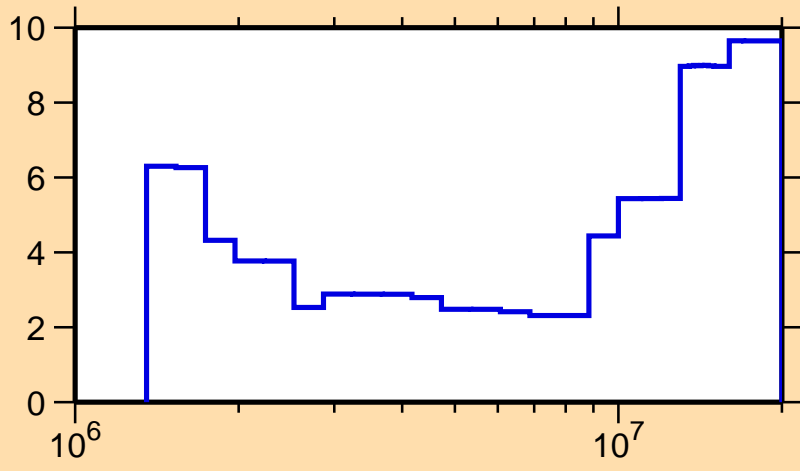

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

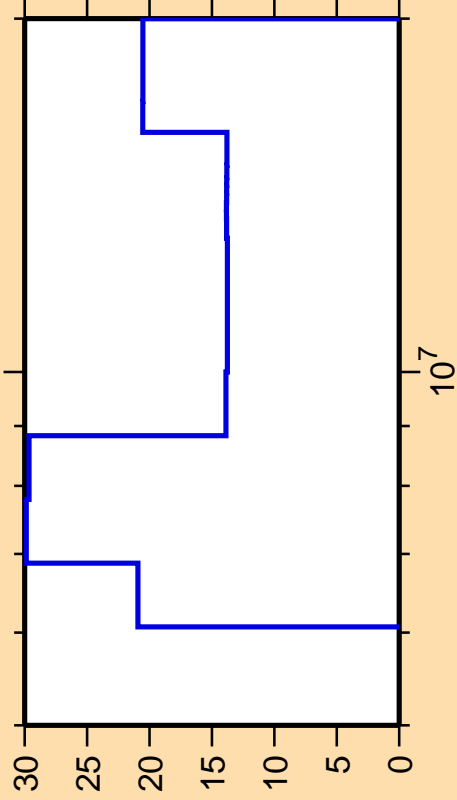

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{inel.})$

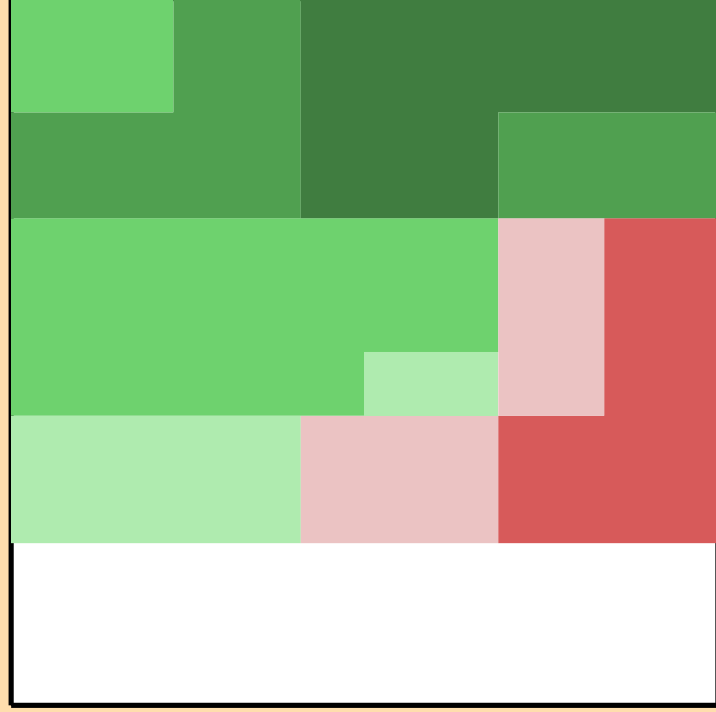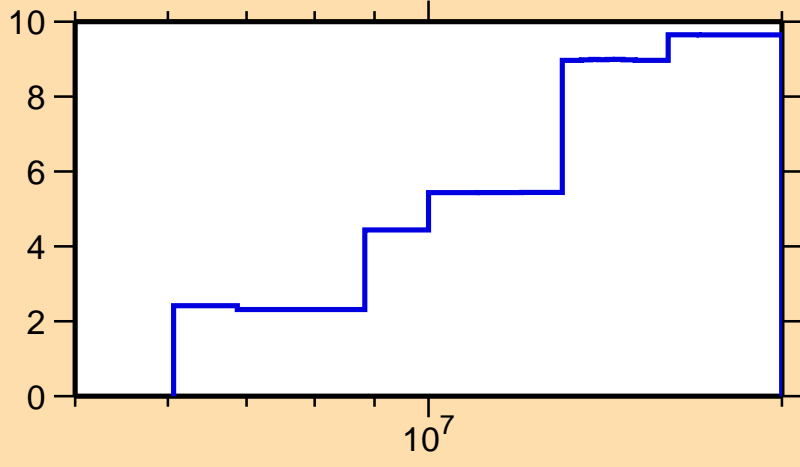

Correlation Matrix





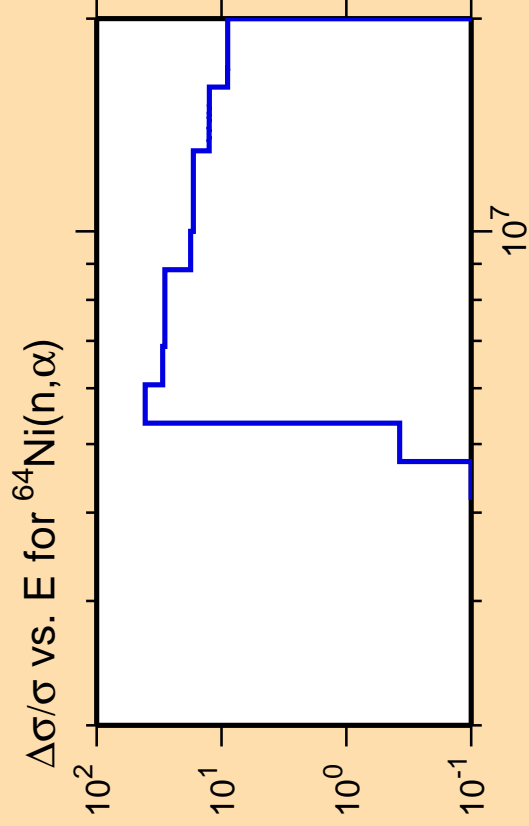

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

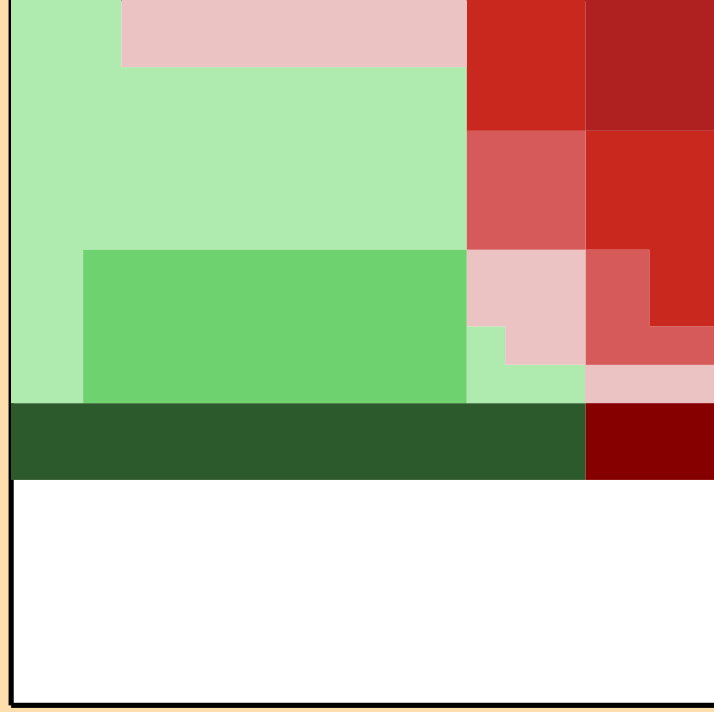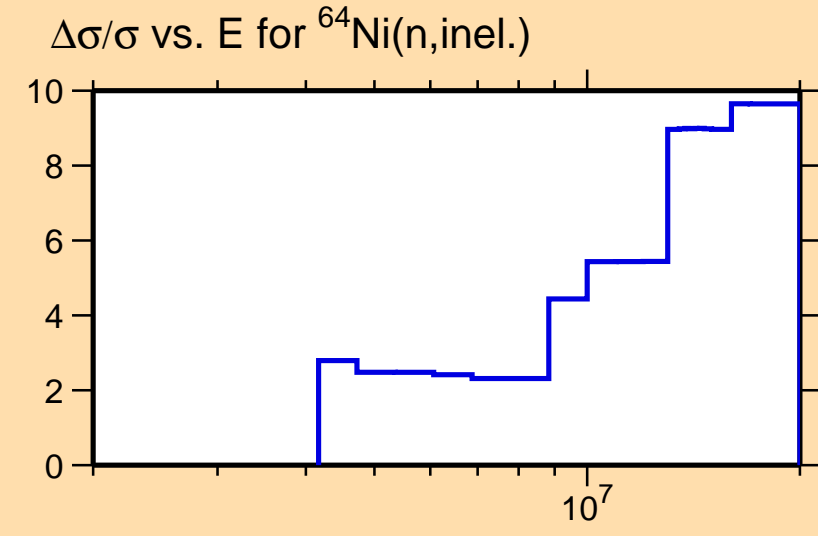

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

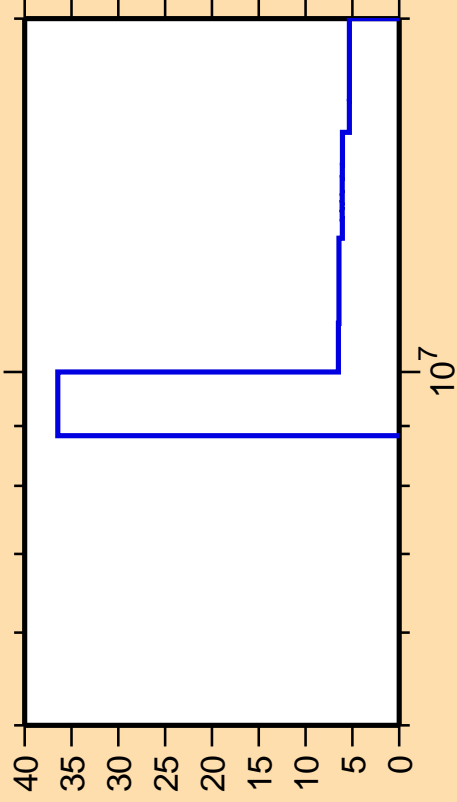

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{64}\text{Ni}(n,2n)$

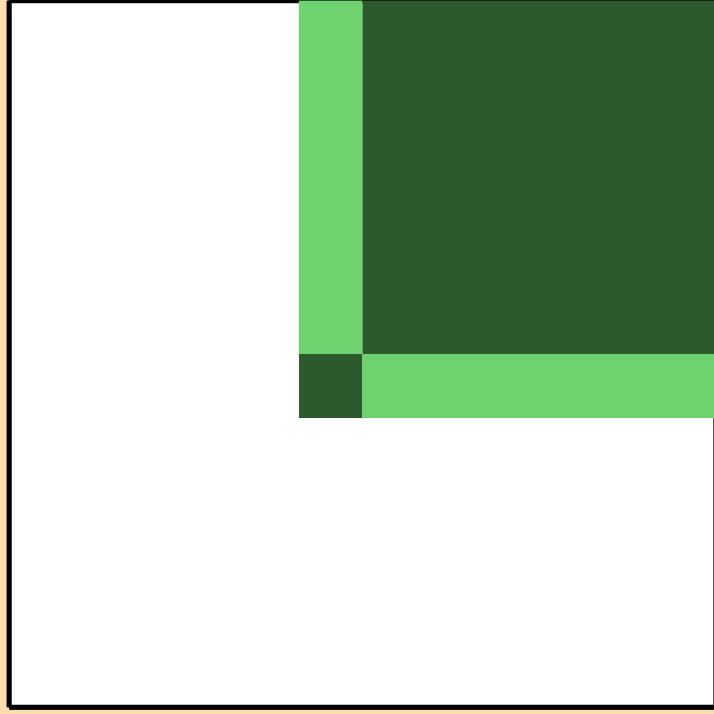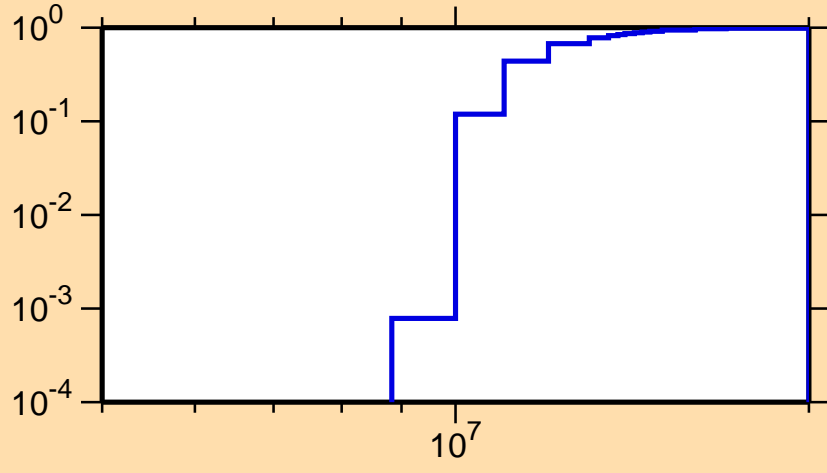

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n_1)$

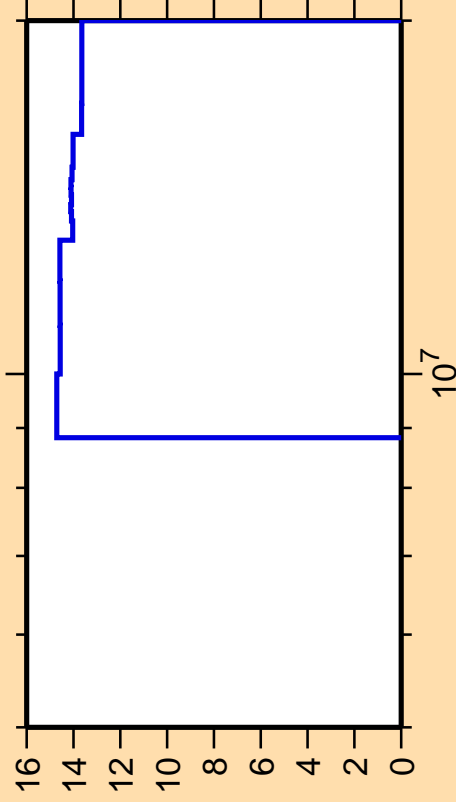

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

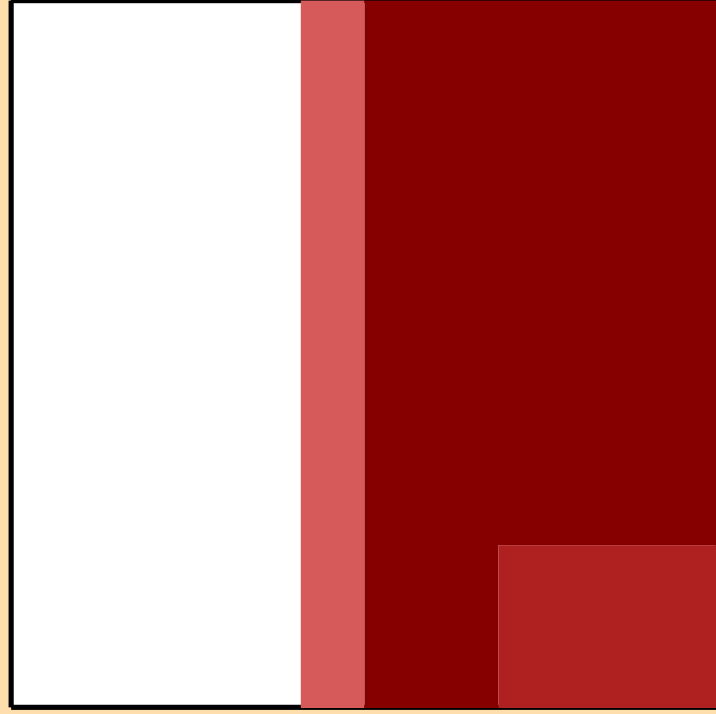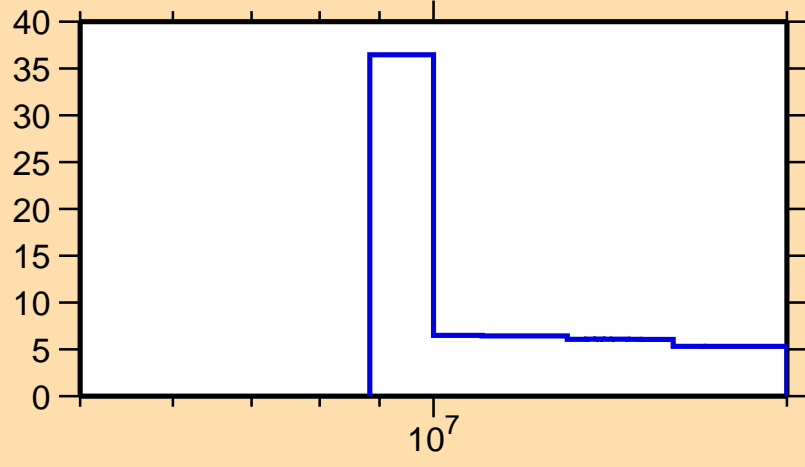

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n_{\text{cont}})$.

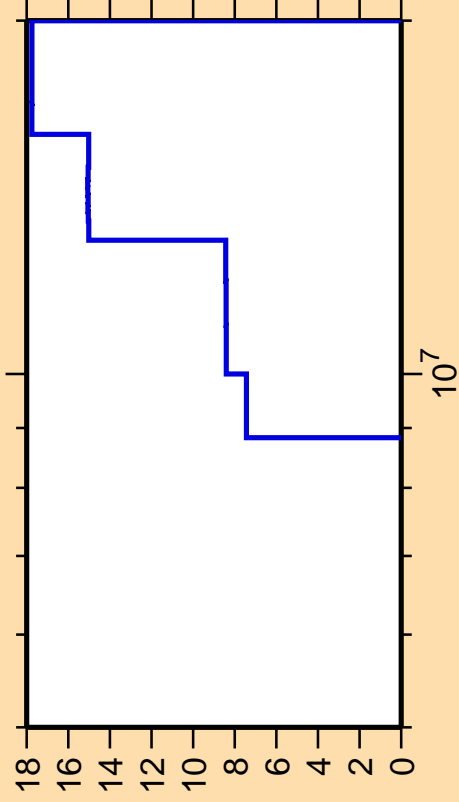

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

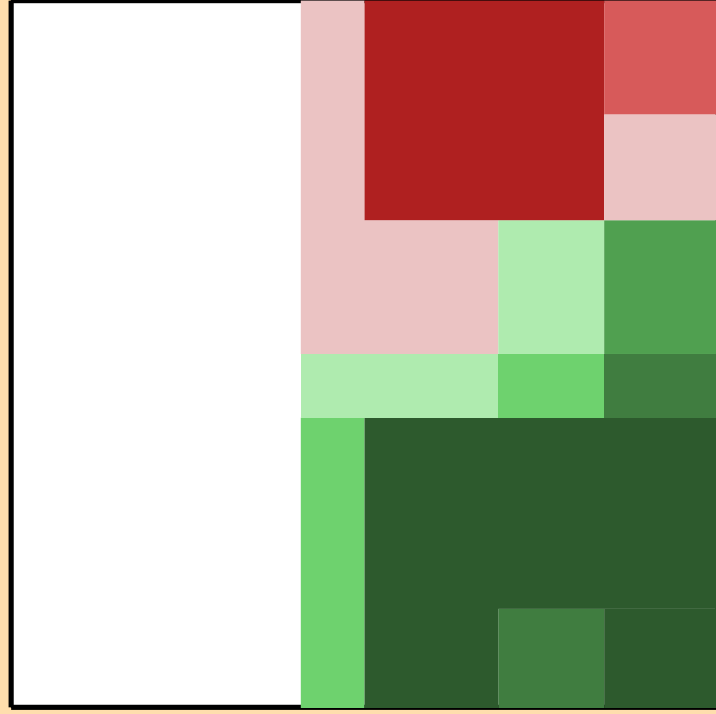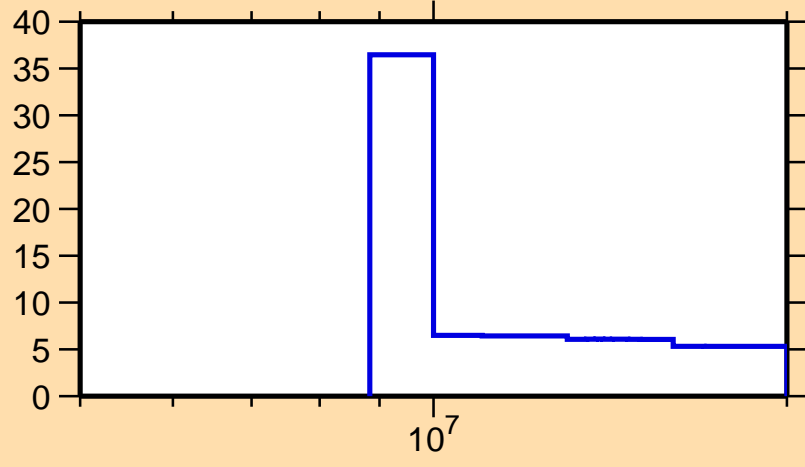



Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\gamma)$

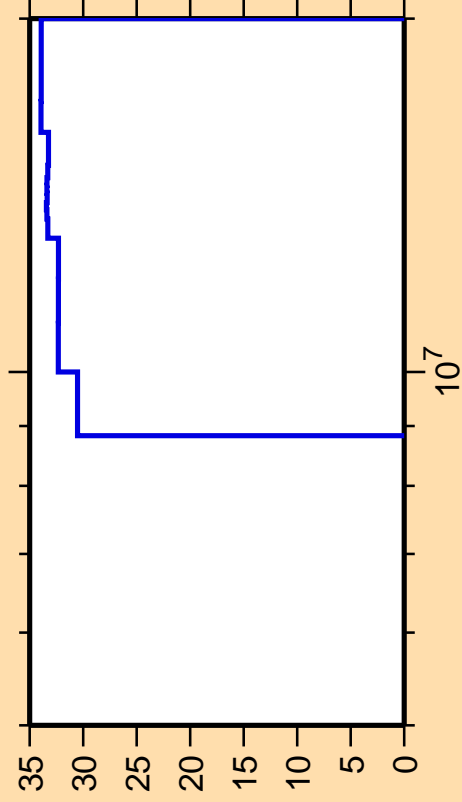


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

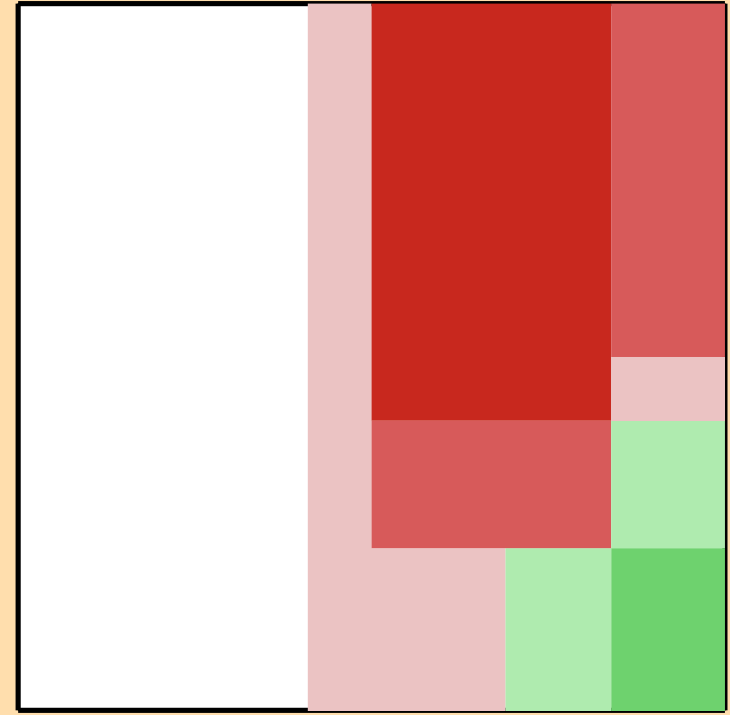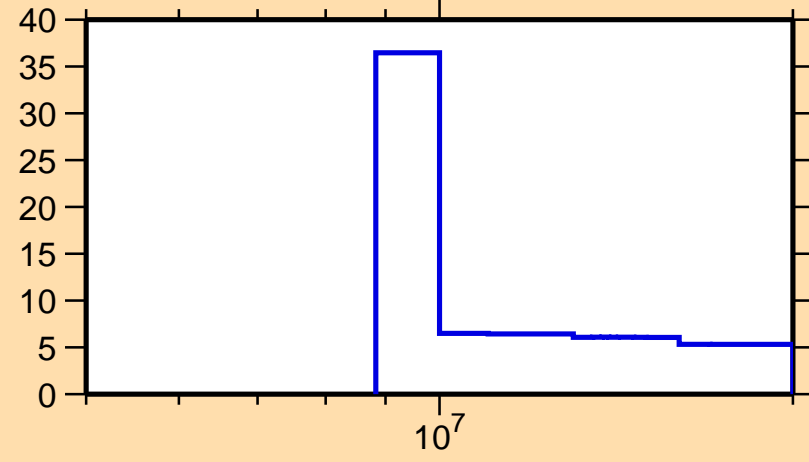

Correlation Matrix

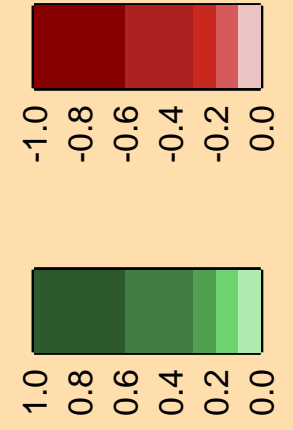



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

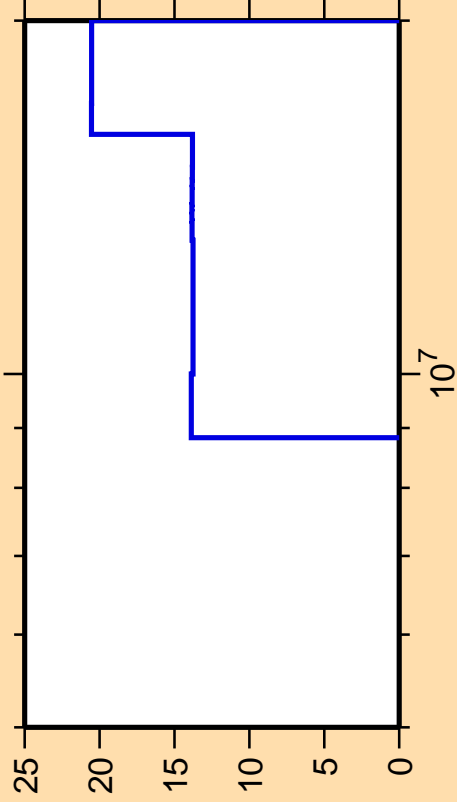

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

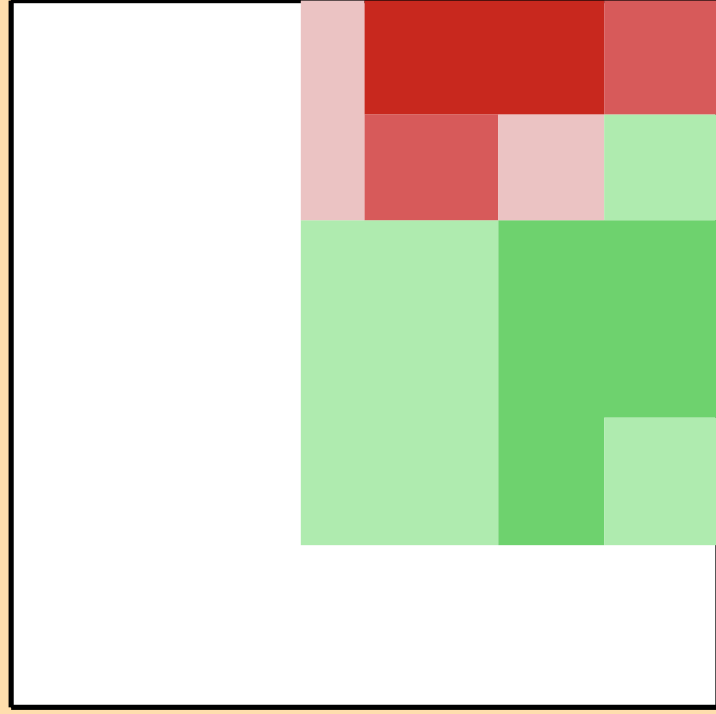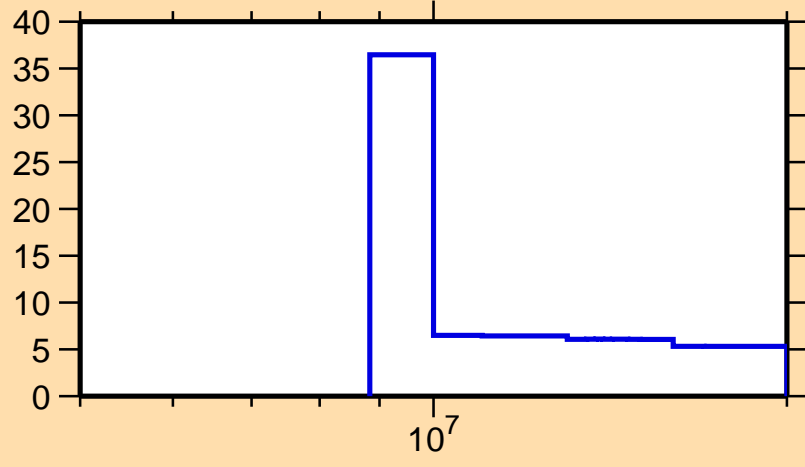

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\alpha)$

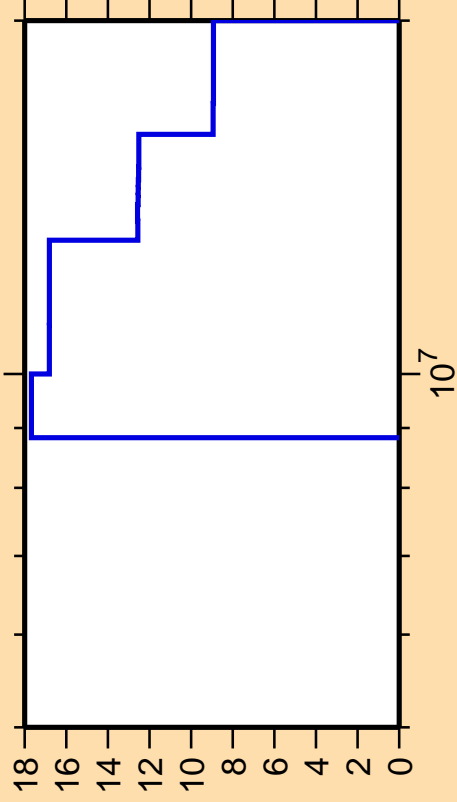

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,2n)$

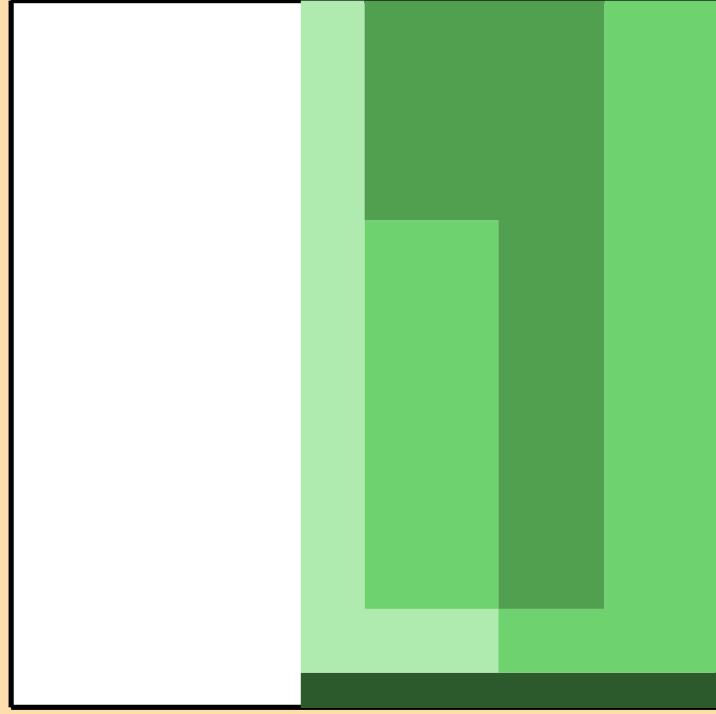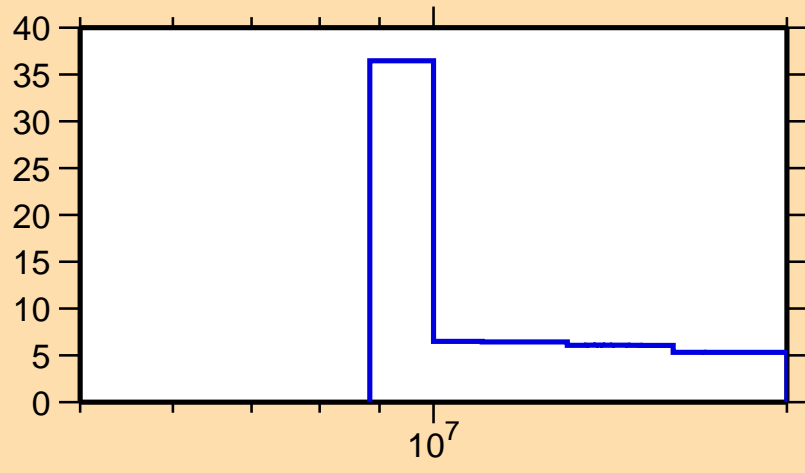

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,3n)$

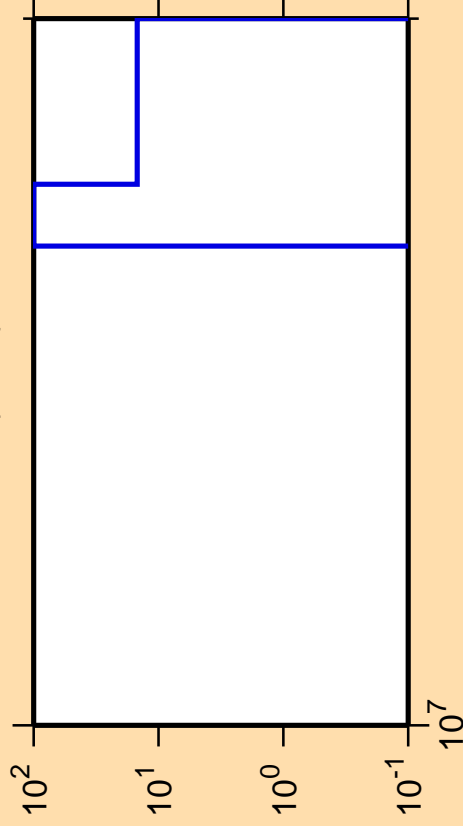


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{64}\text{Ni}(n,3n)$

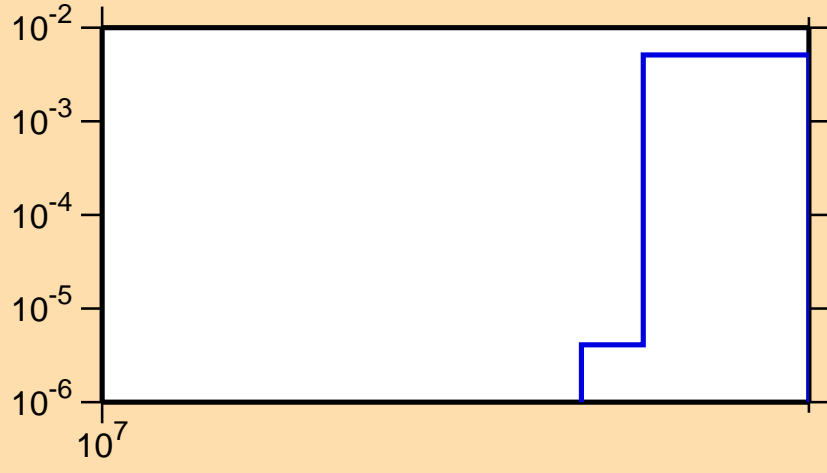


10^7



Correlation Matrix





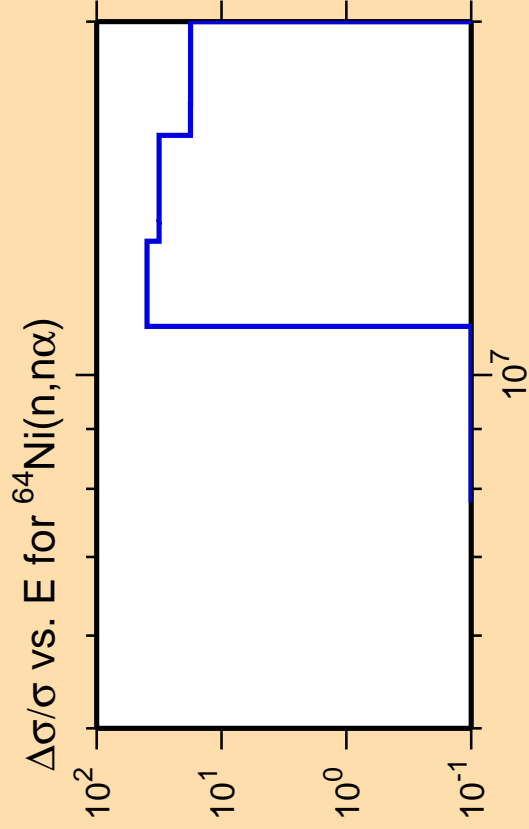

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

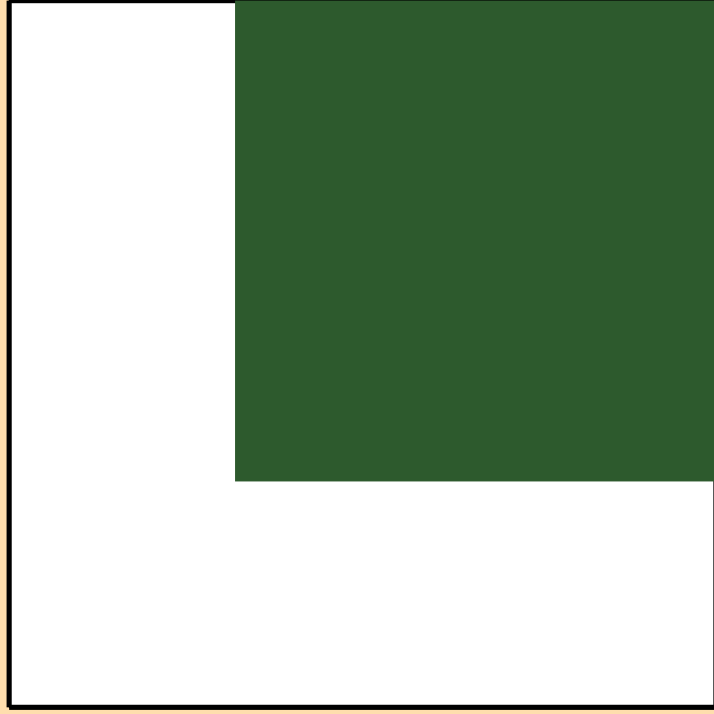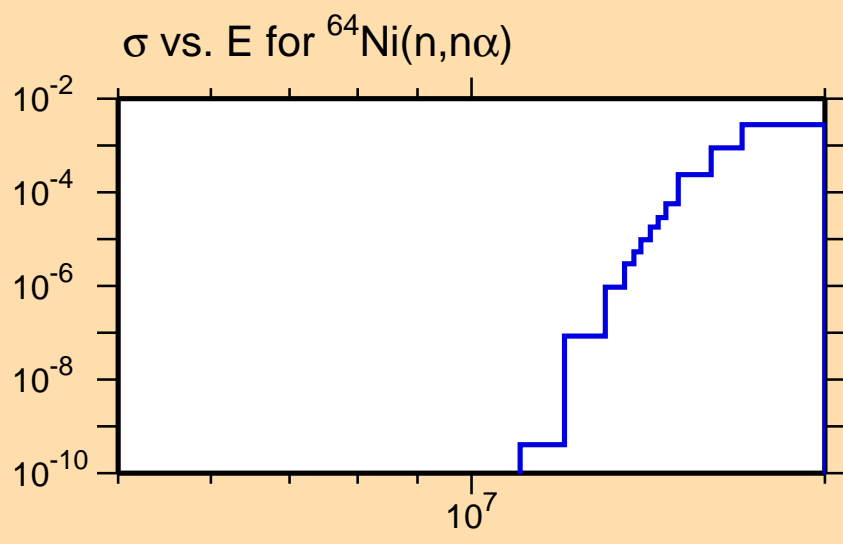

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,np)$

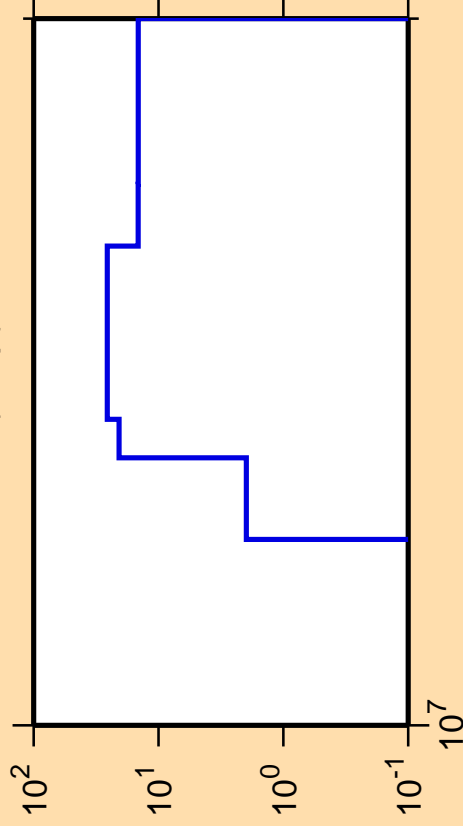

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{64}\text{Ni}(n,np)$

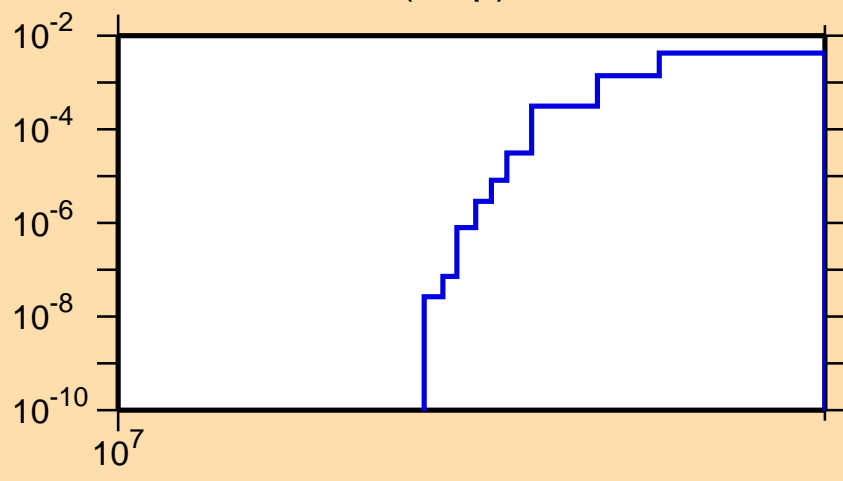

10^7


10^{-2}

10^{-4}

10^{-6}

10^{-8}


10^{-10}

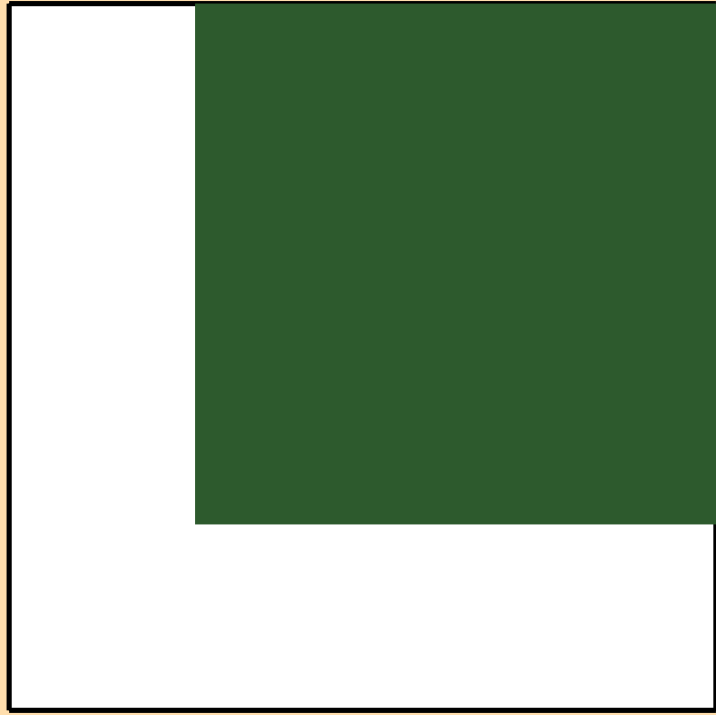

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{nd})$

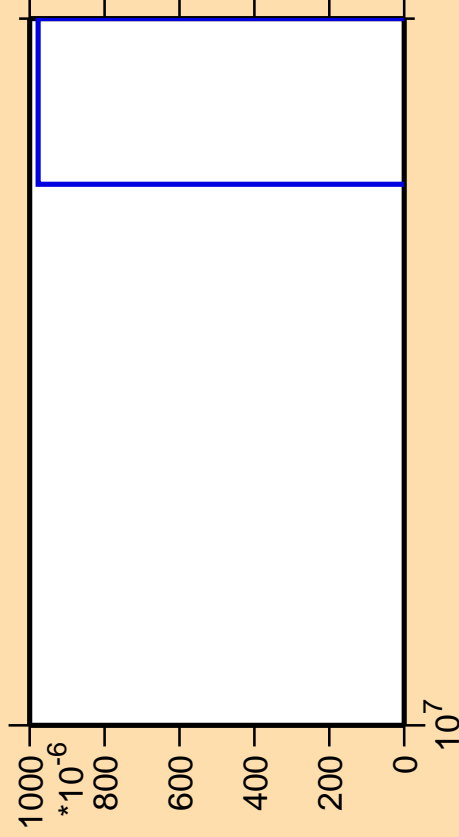

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{64}\text{Ni}(n,\text{nd})$

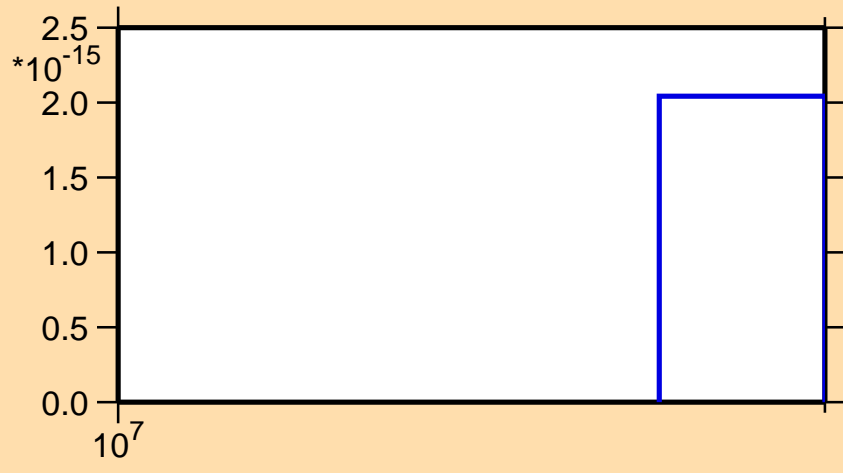

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{nt})$

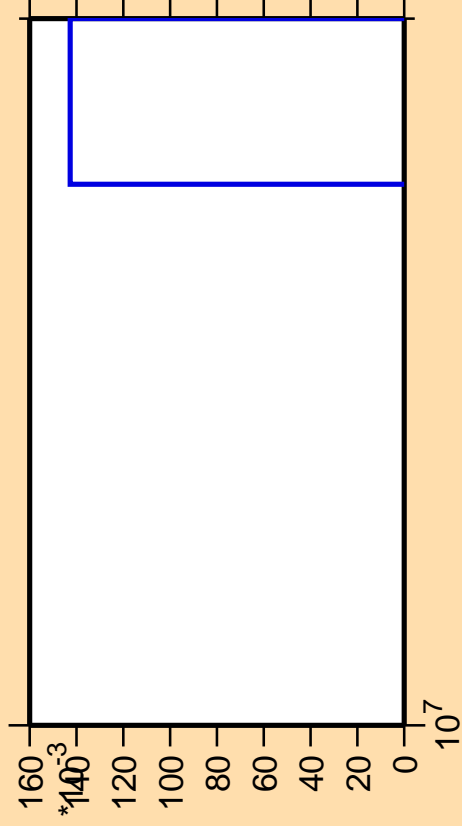

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{64}\text{Ni}(n,\text{nt})$





Correlation Matrix



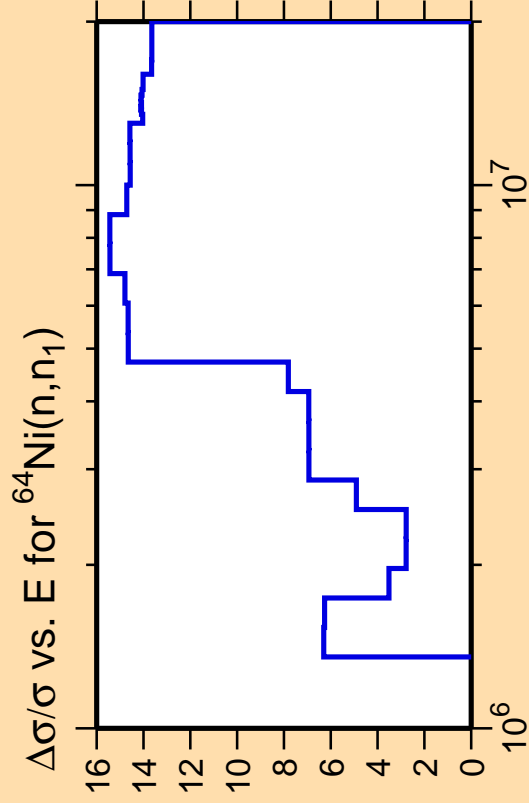

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

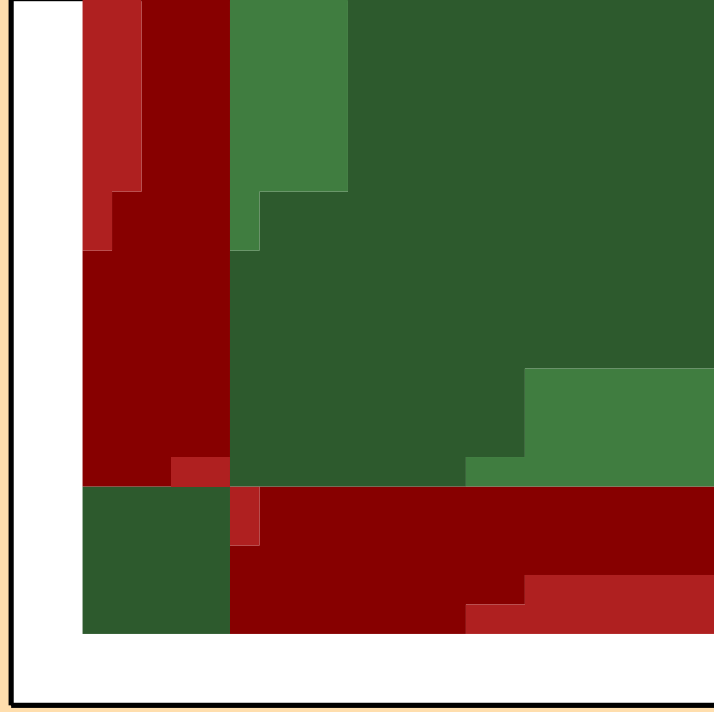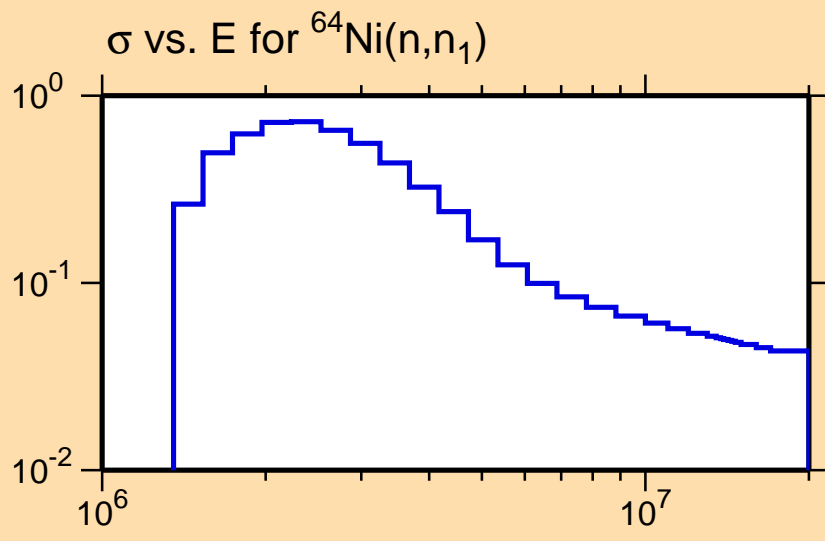

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n_{\text{cont}})$.

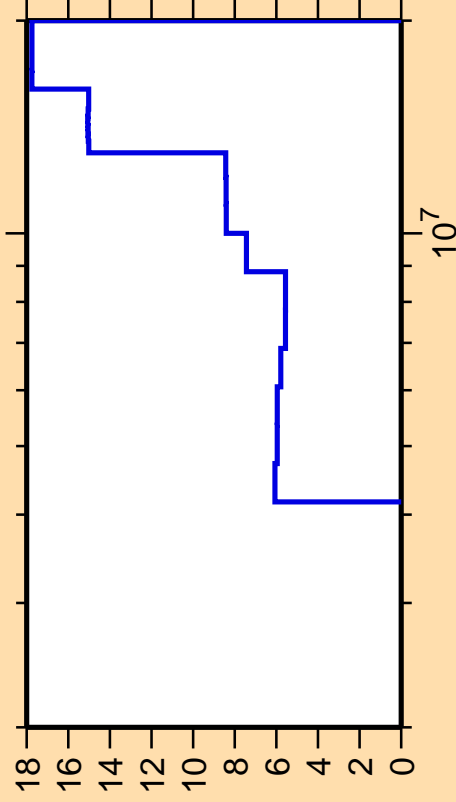

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n, n_1)$

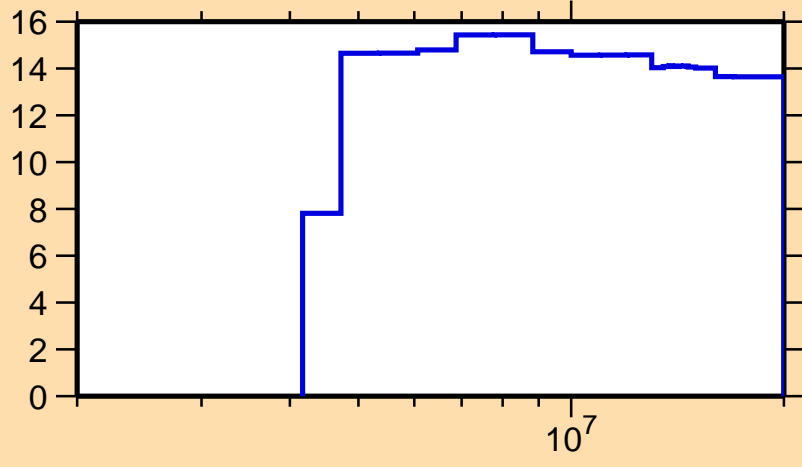

Correlation Matrix





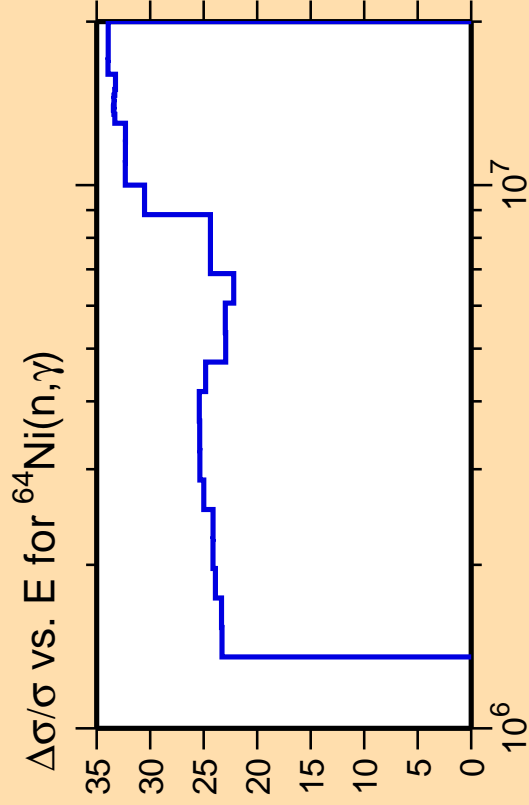

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n_1)$

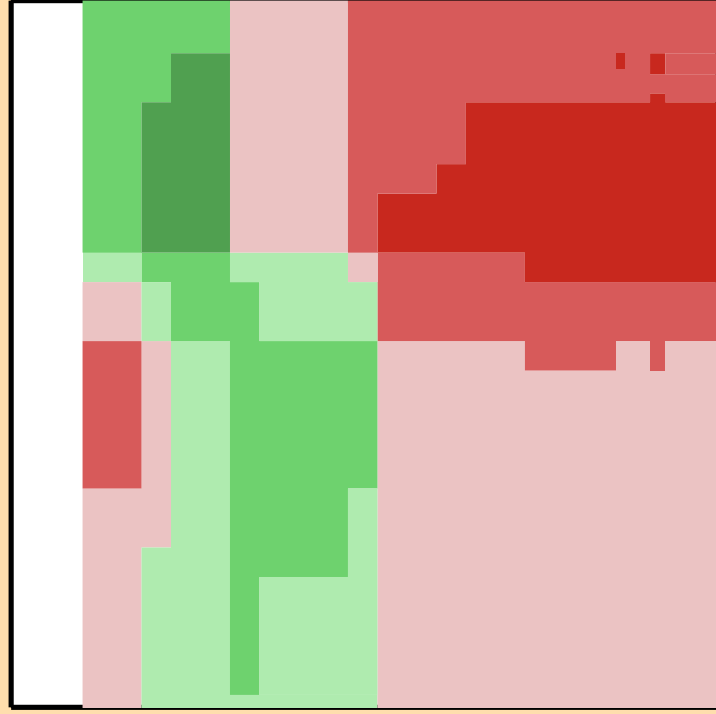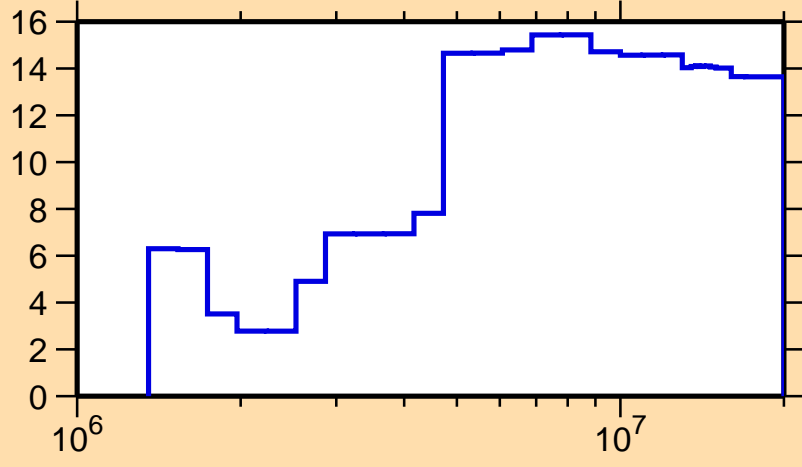

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

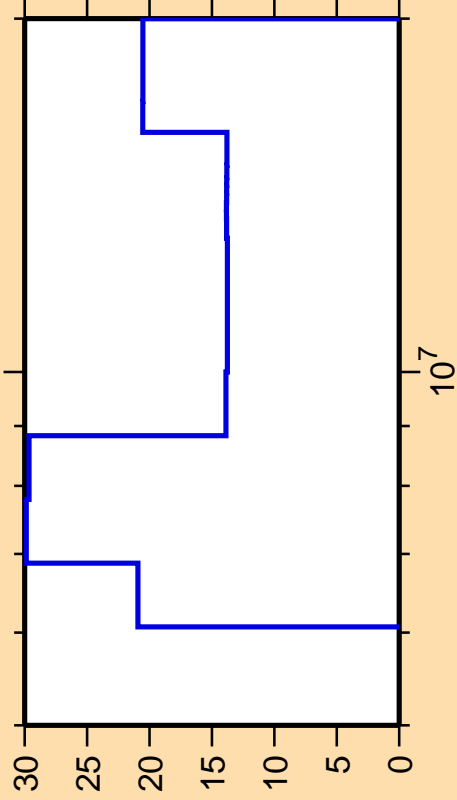

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n_1)$

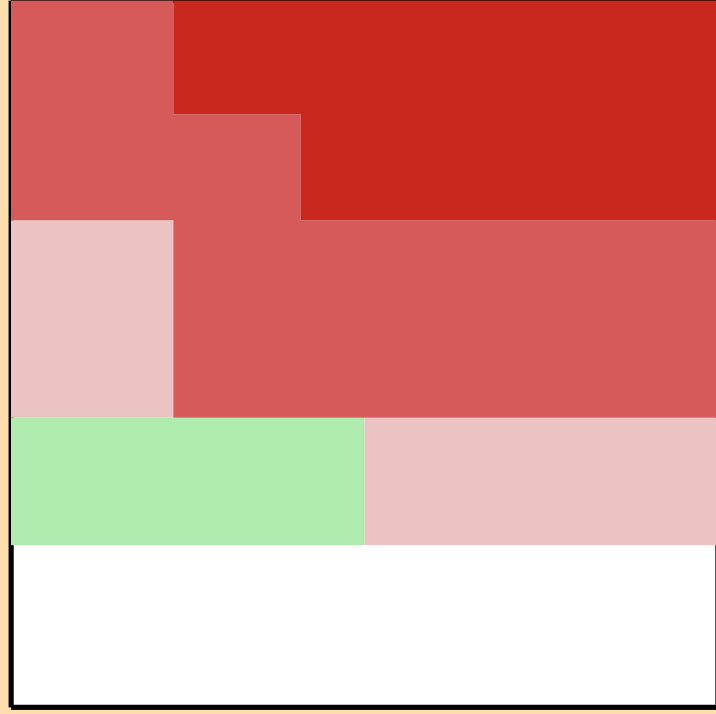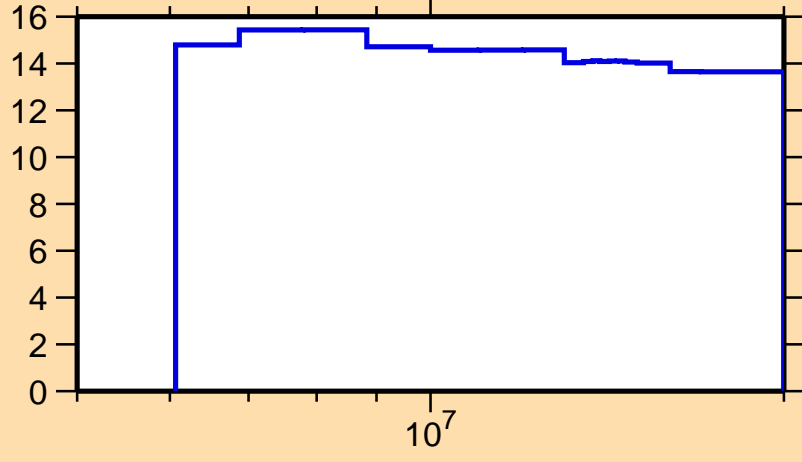

Correlation Matrix





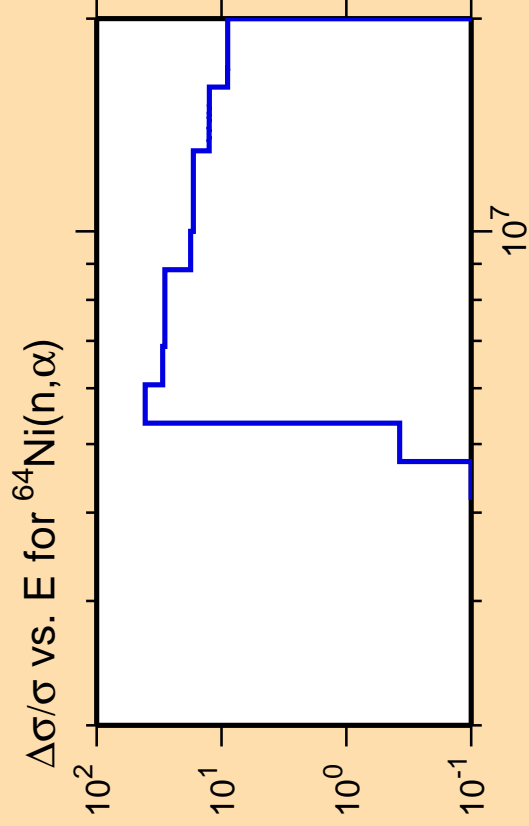

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

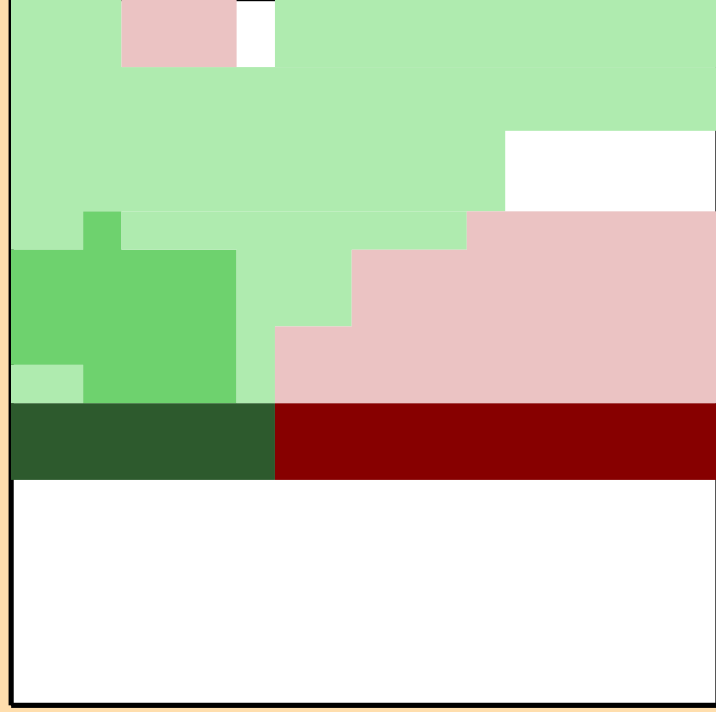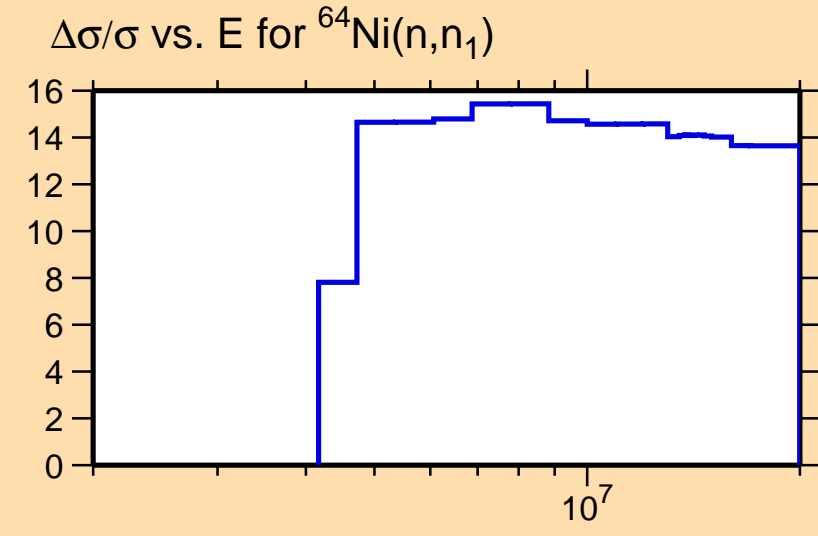

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n_2)$

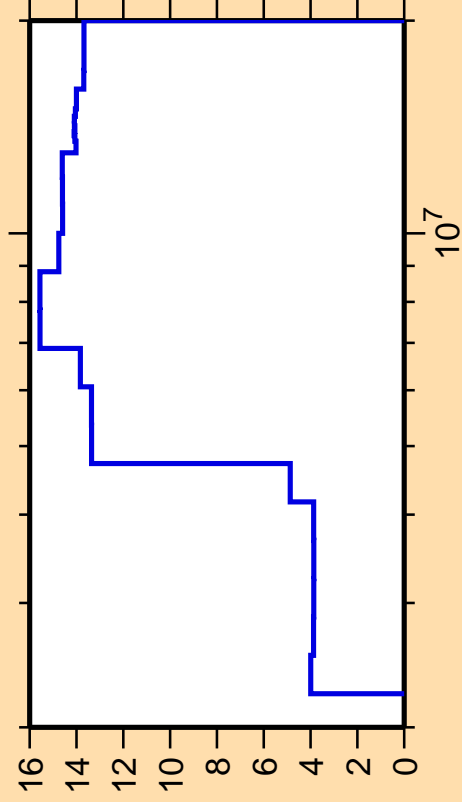

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{64}\text{Ni}(n,n_2)$

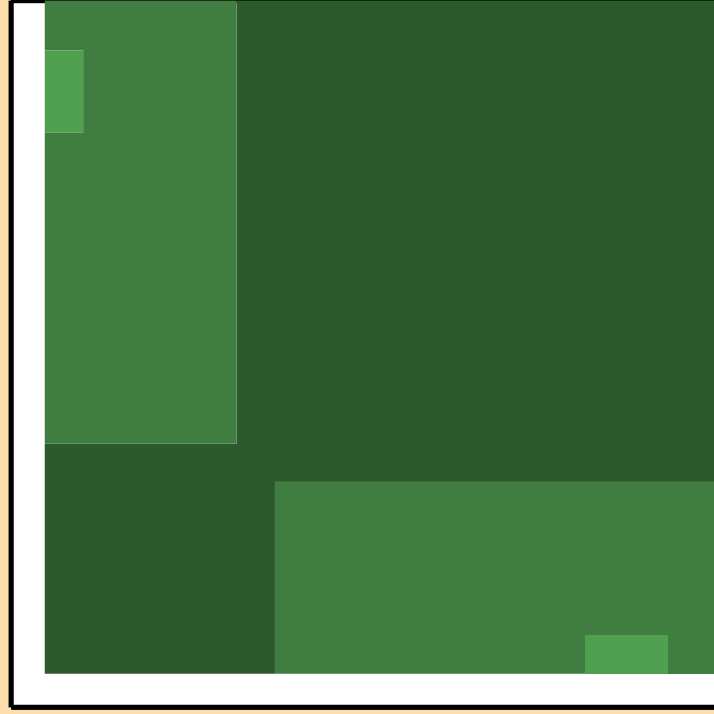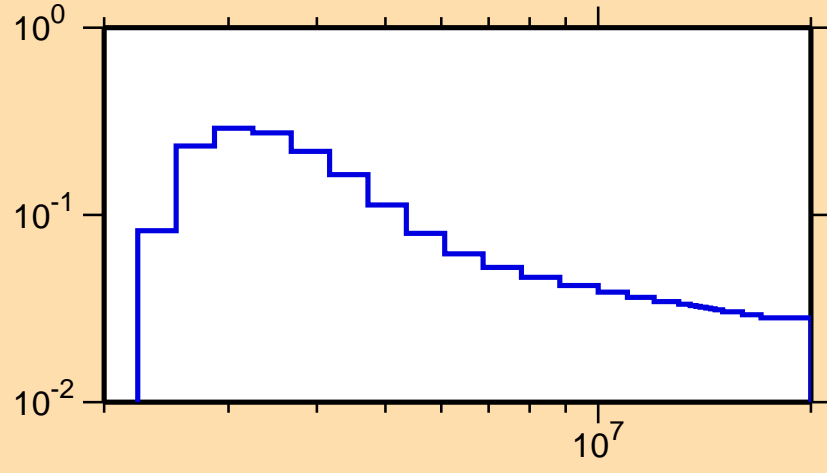

Correlation Matrix





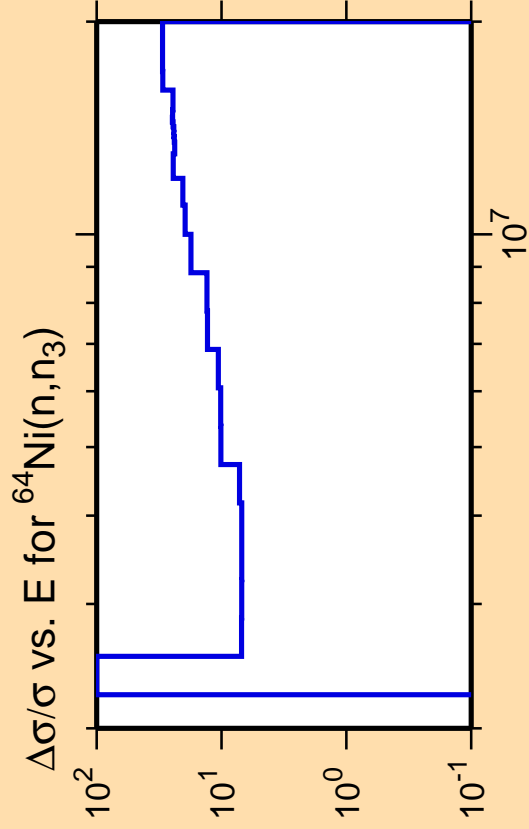

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

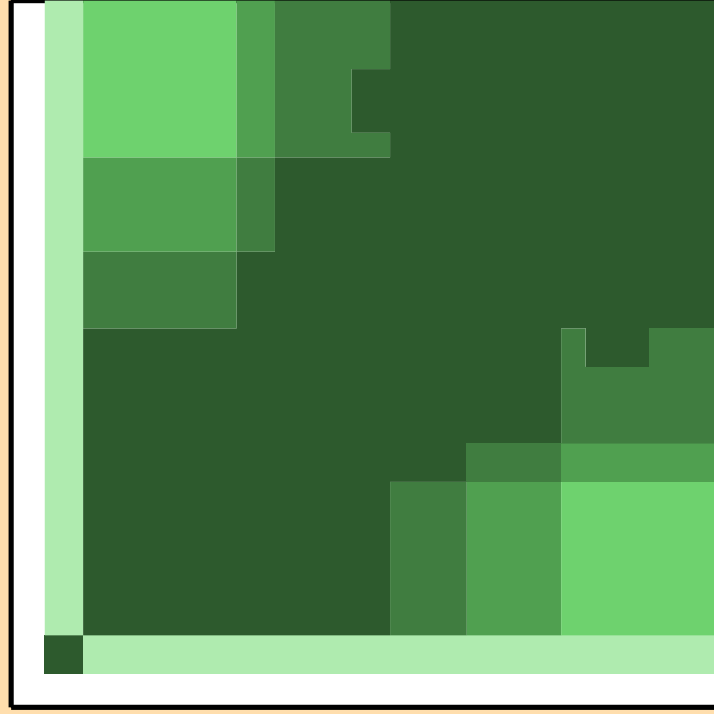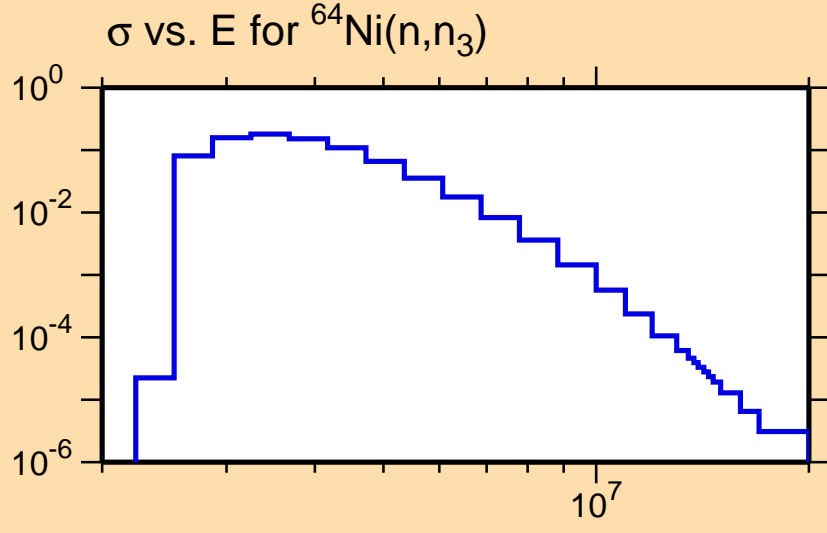

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n_4)$

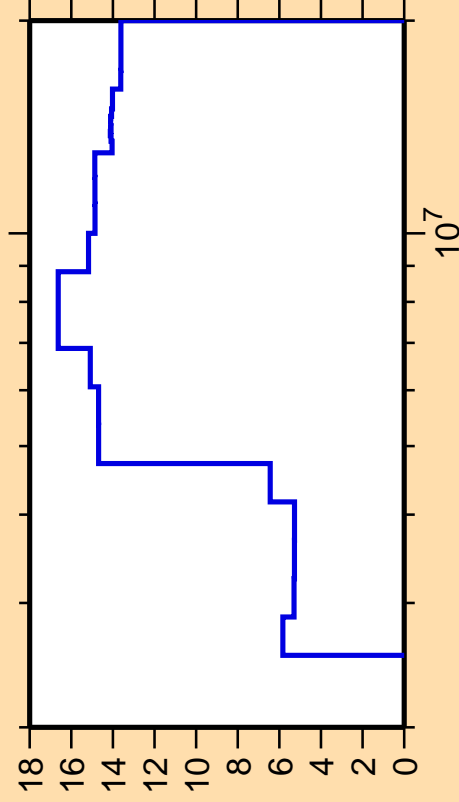

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{64}\text{Ni}(n,n_4)$

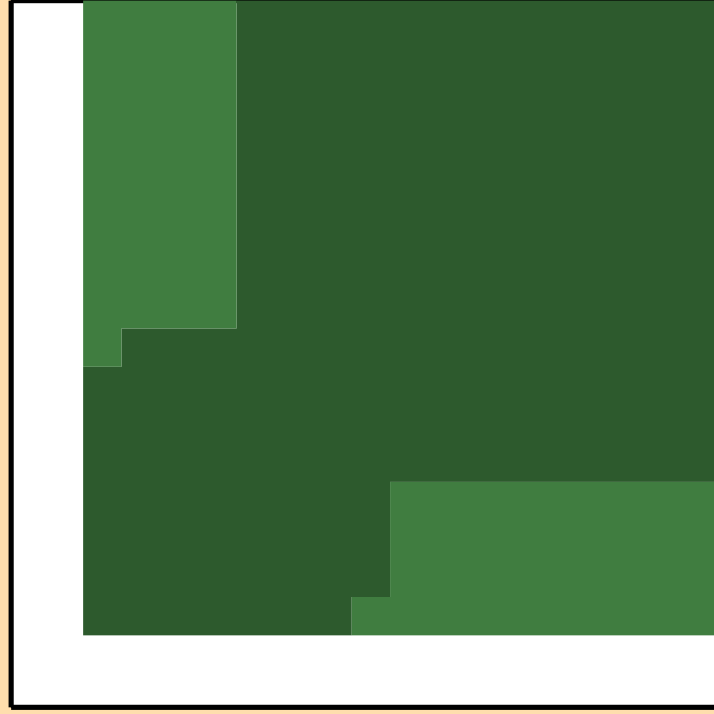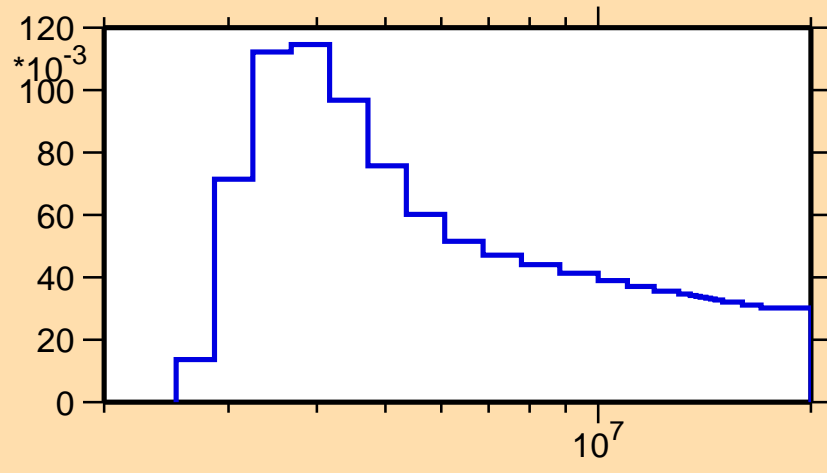

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

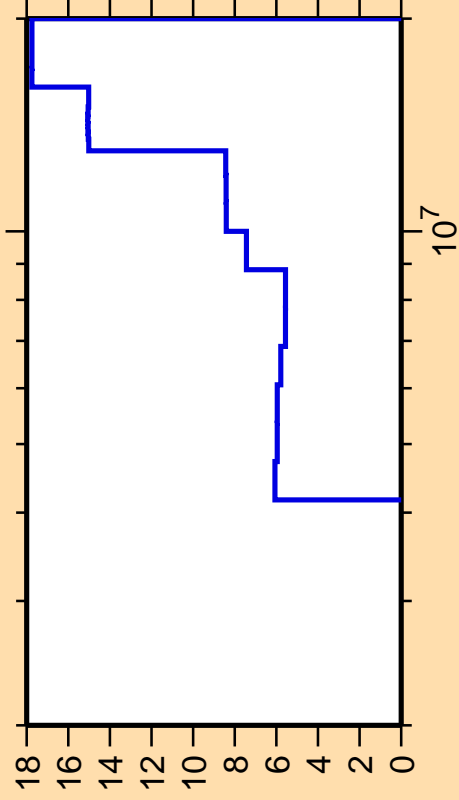

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

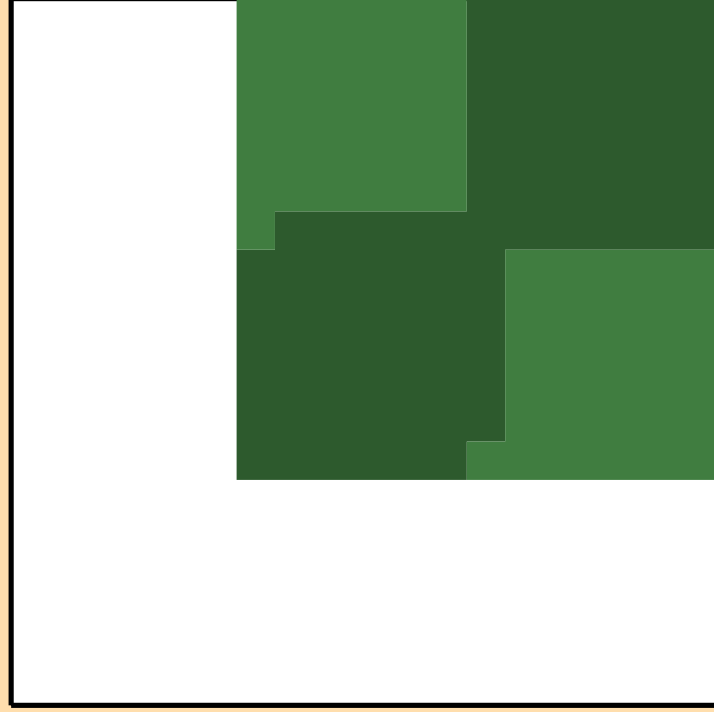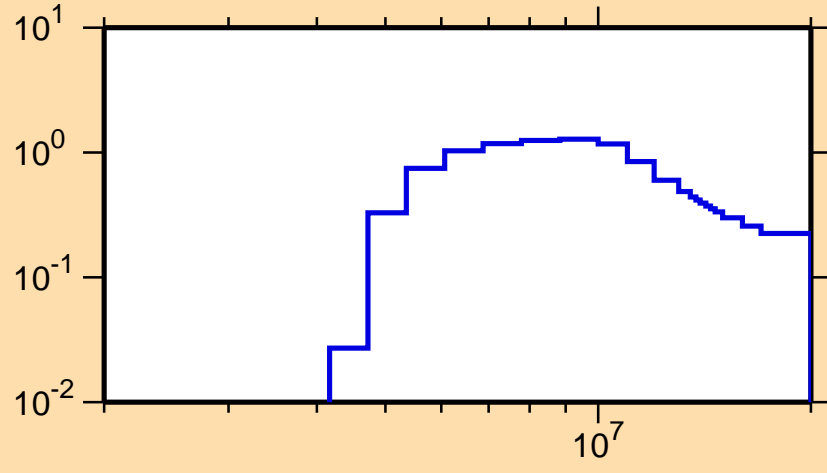

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\gamma)$

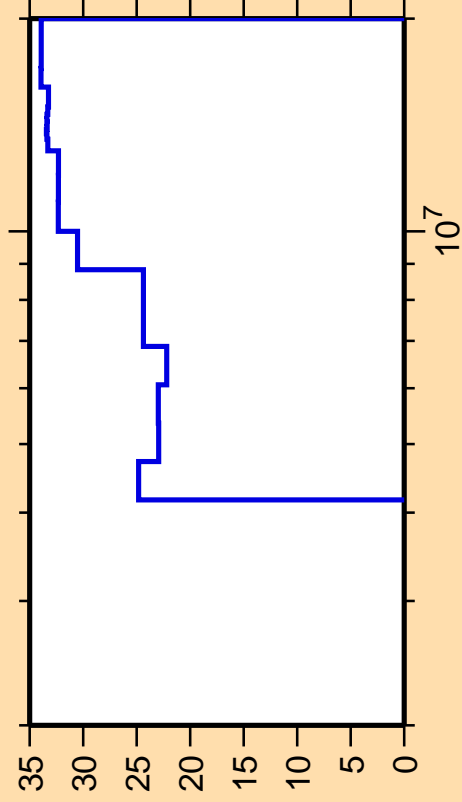

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

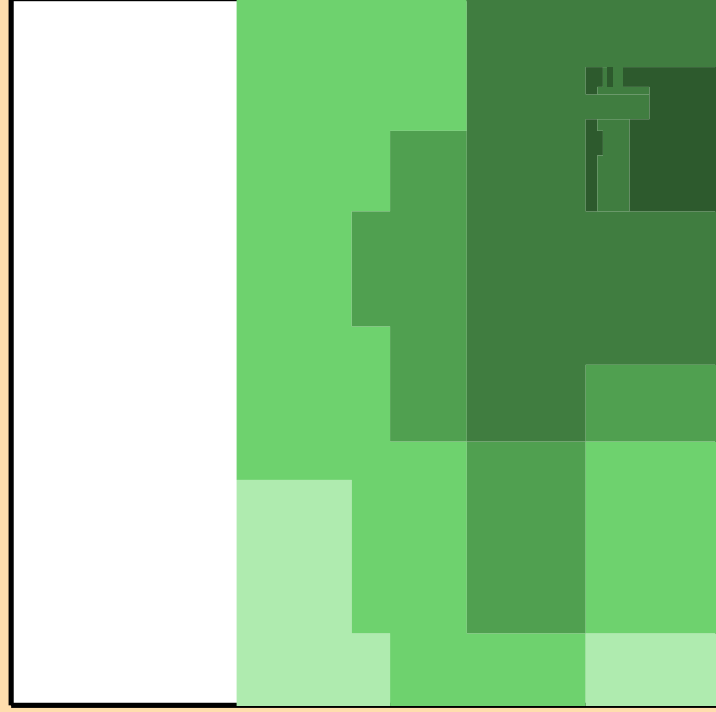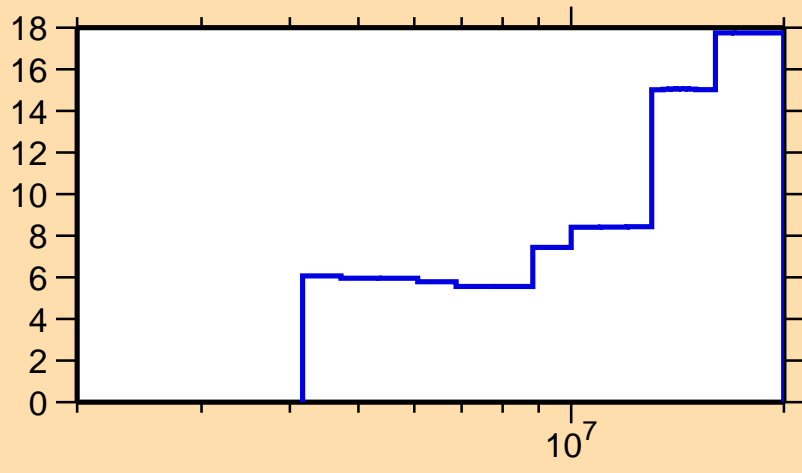

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

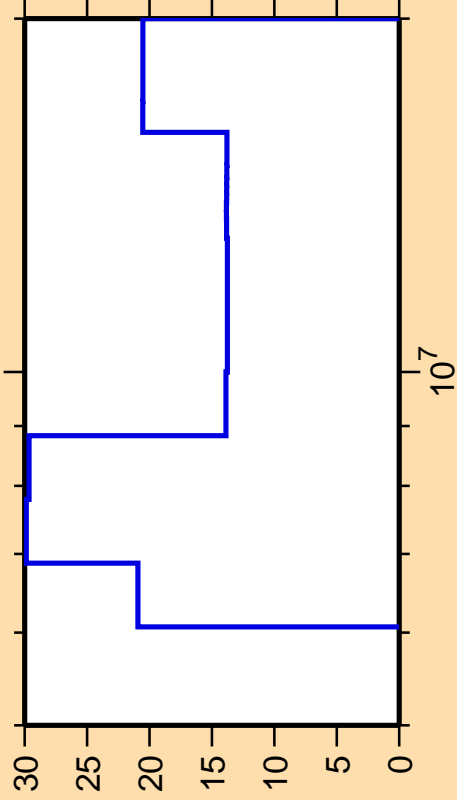

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,n\text{cont.})$

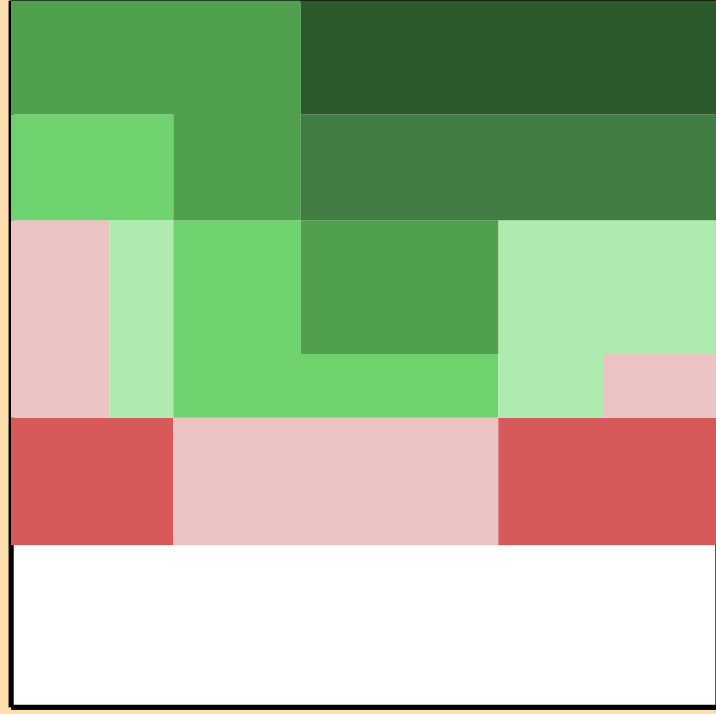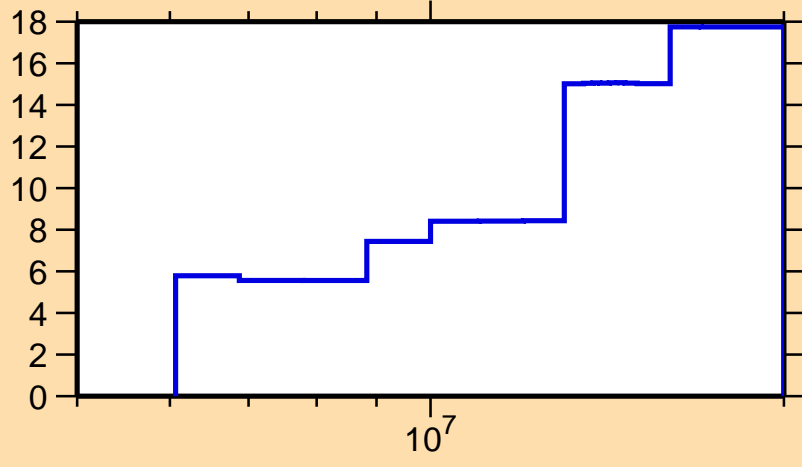

Correlation Matrix




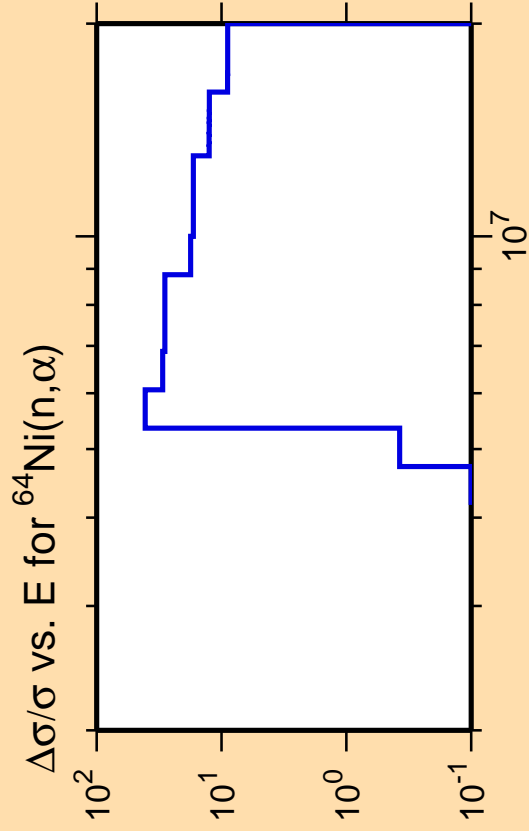


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n, n\text{cont.})$

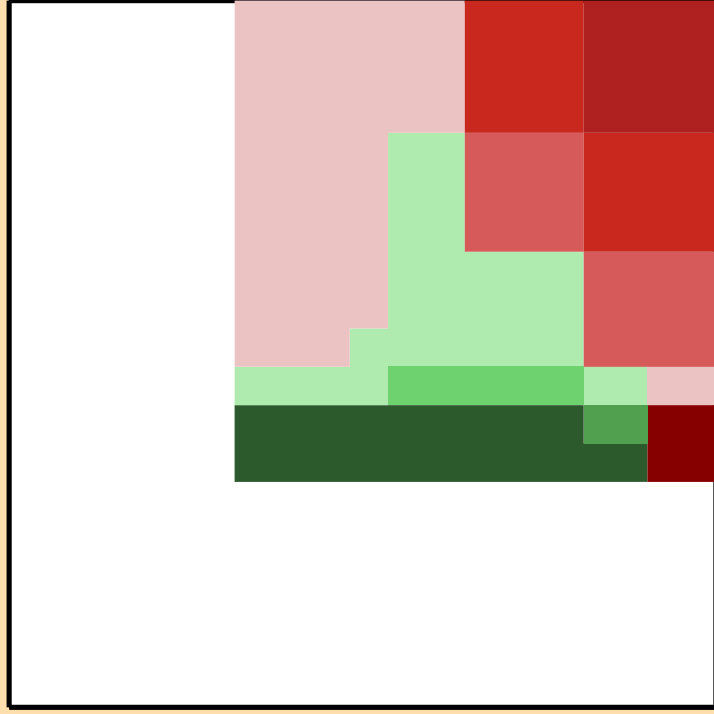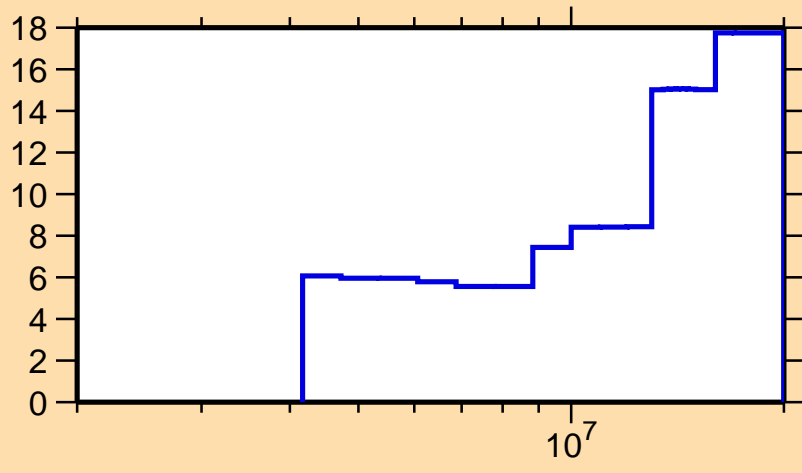



Correlation Matrix



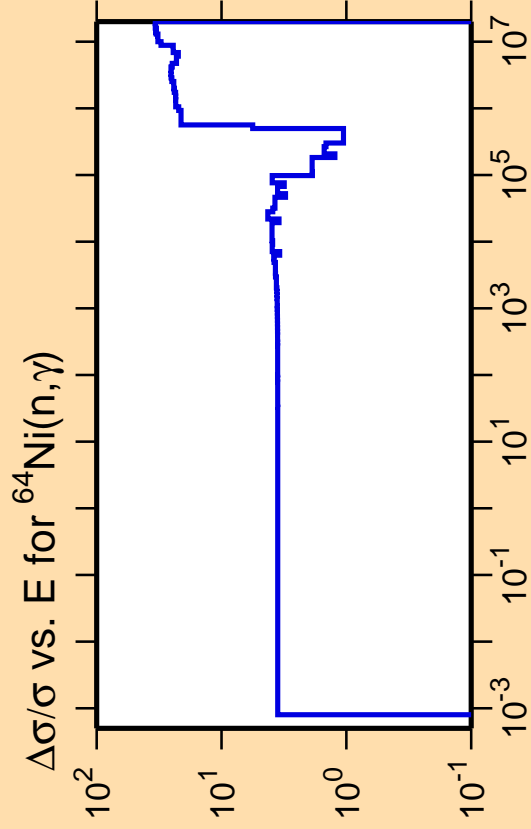

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

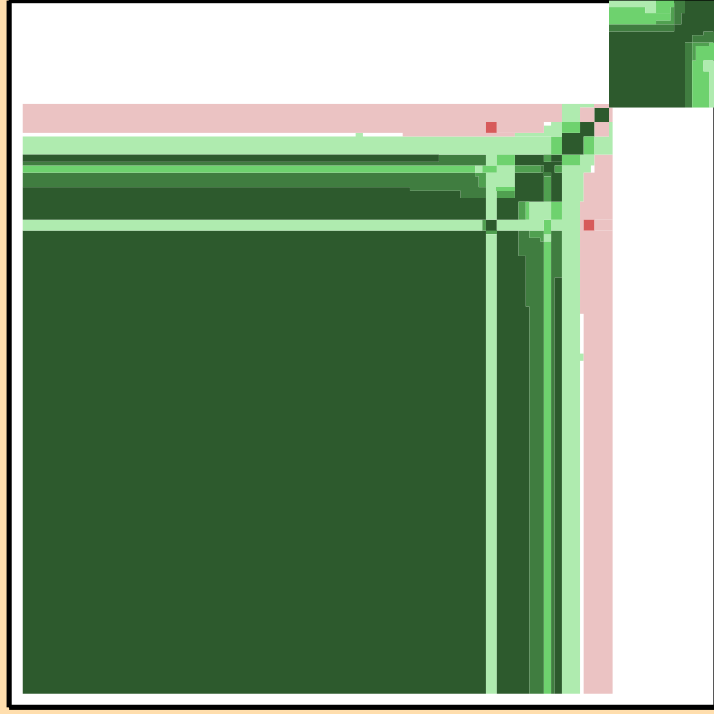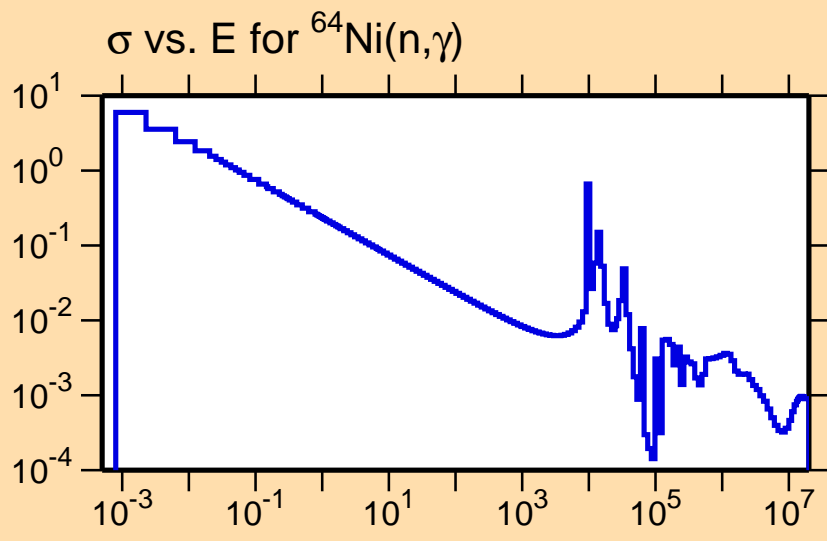

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

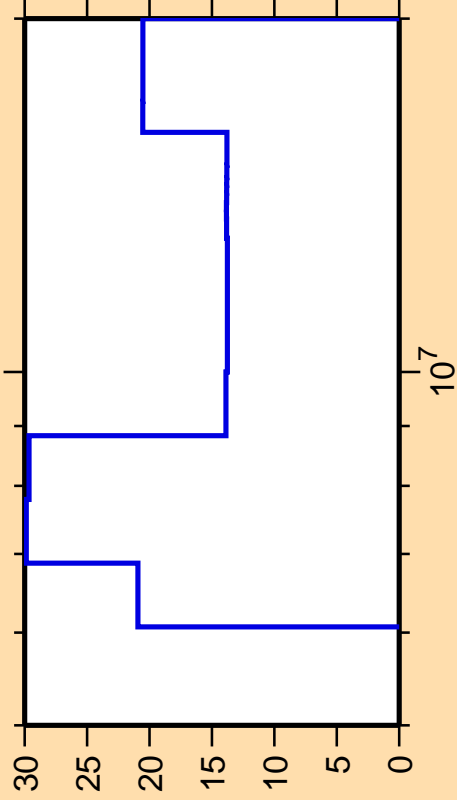

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\gamma)$

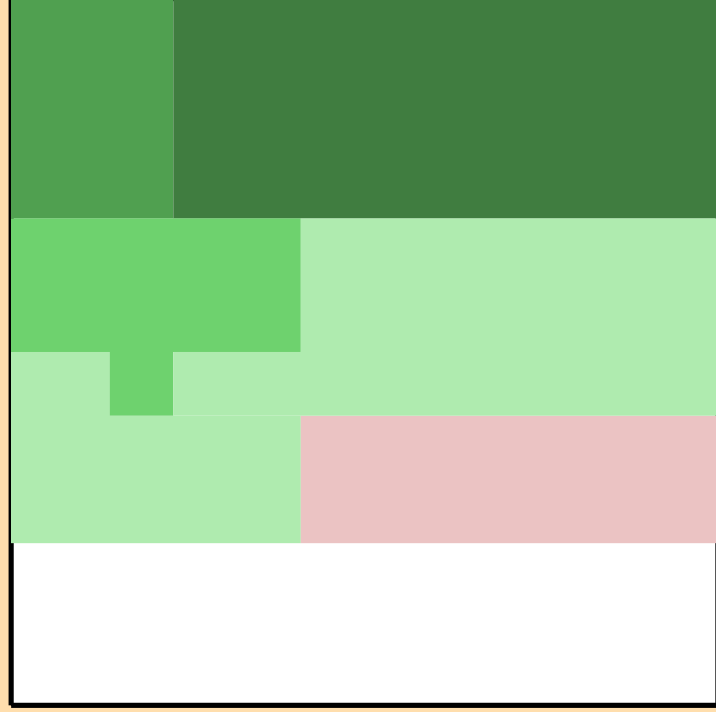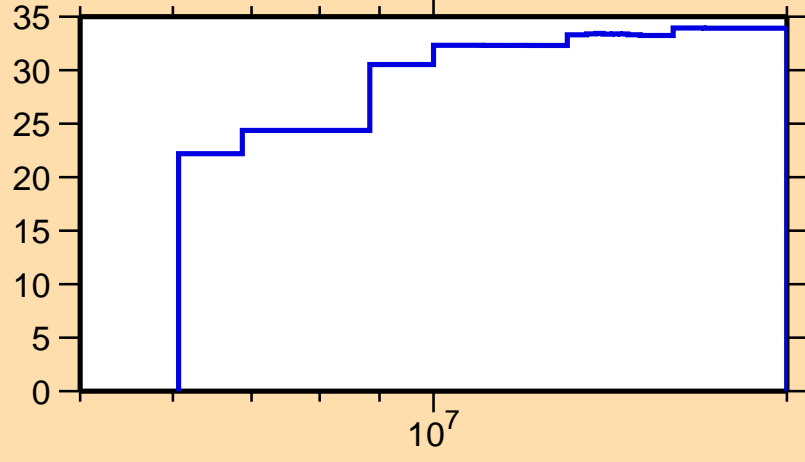

Correlation Matrix




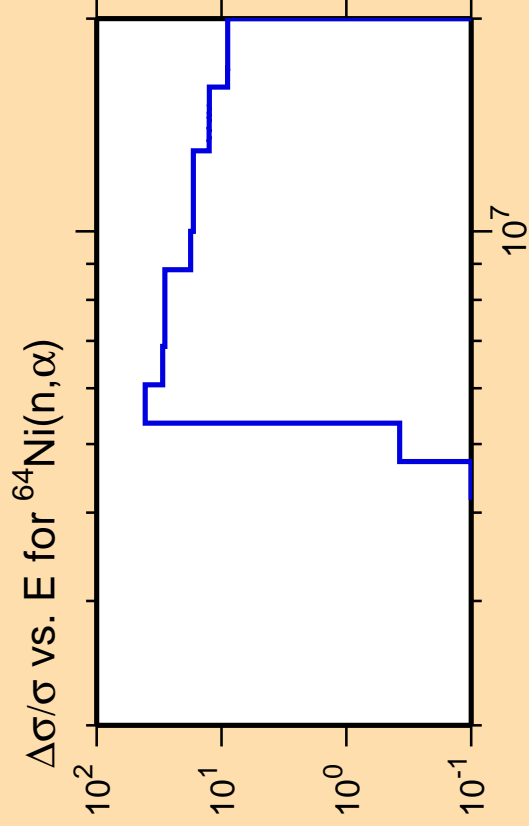


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\gamma)$

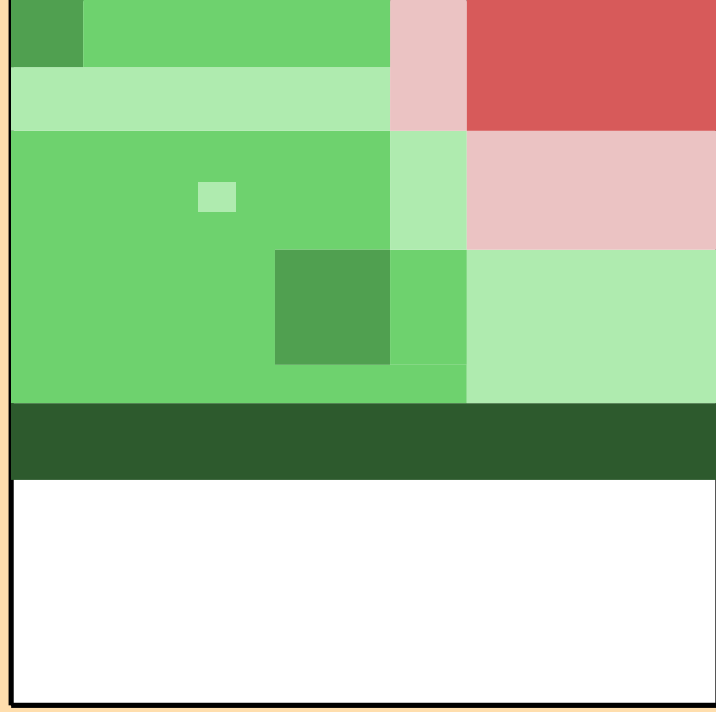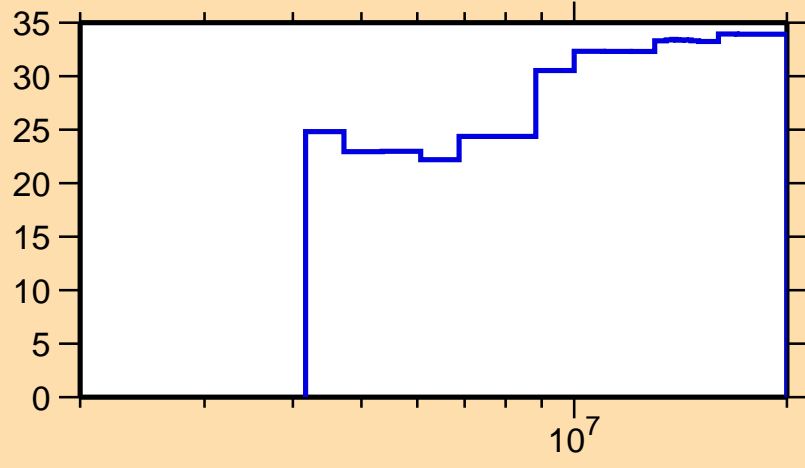

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

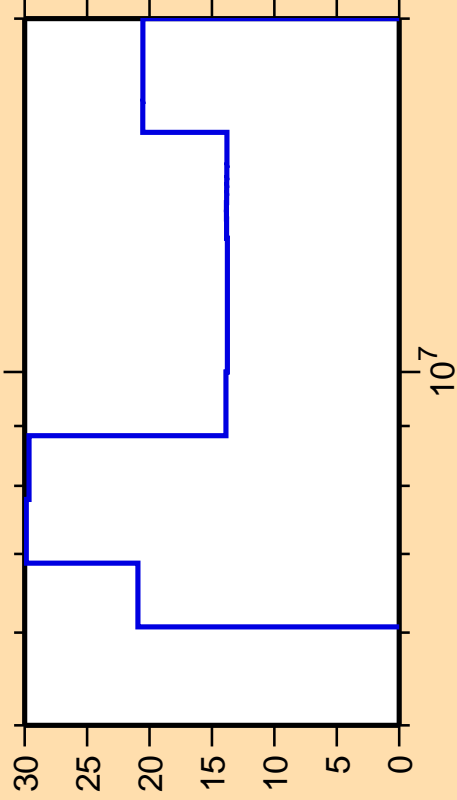

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{64}\text{Ni}(n,p)$

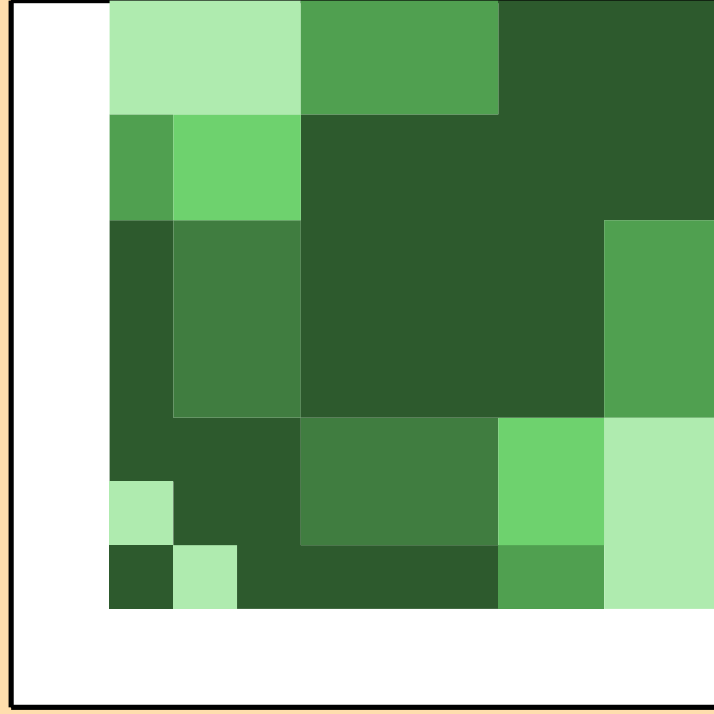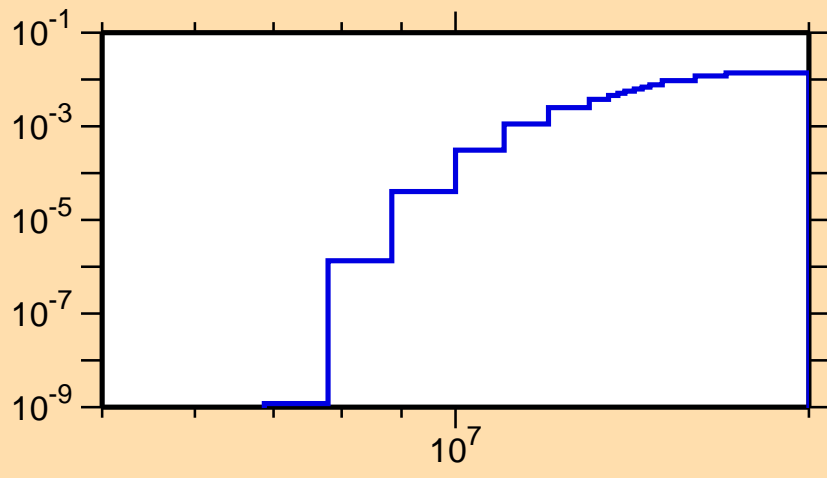

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\alpha)$

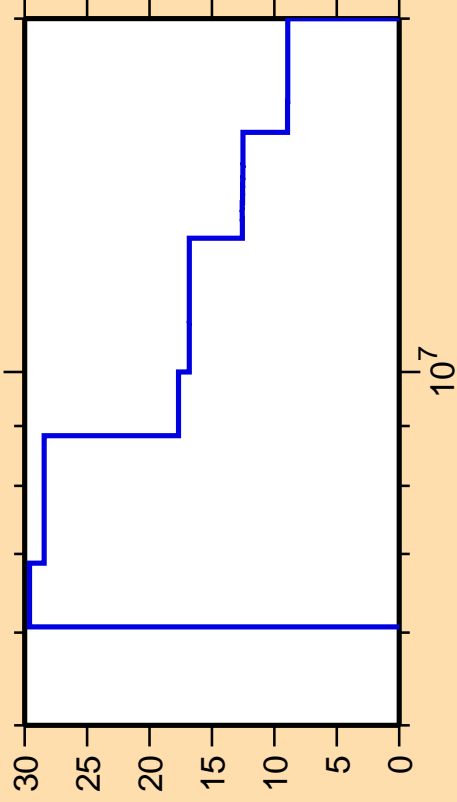

Ordinate scale is %
relative standard deviation.

Abcissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,p)$

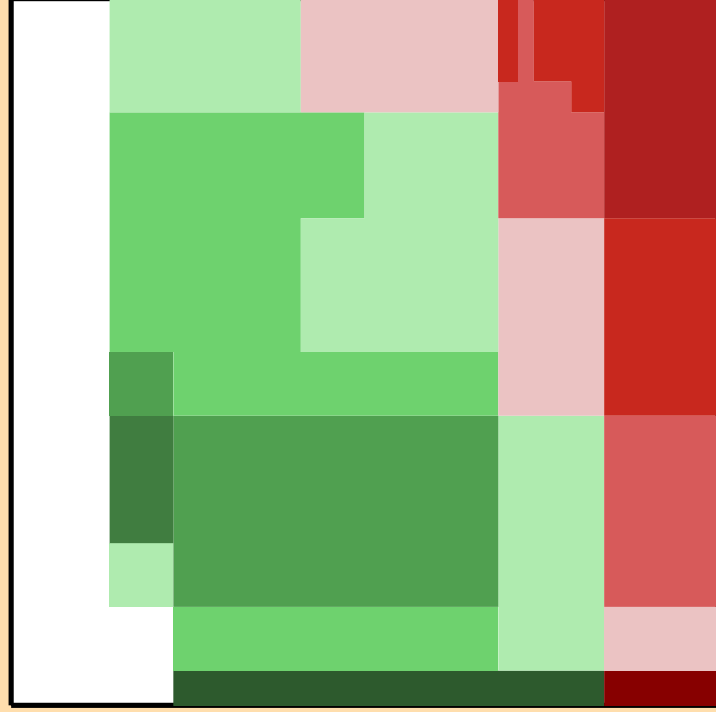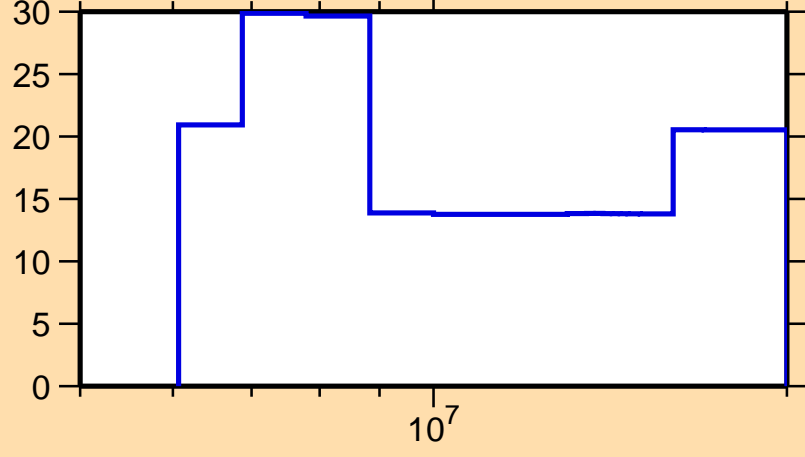

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,d)$


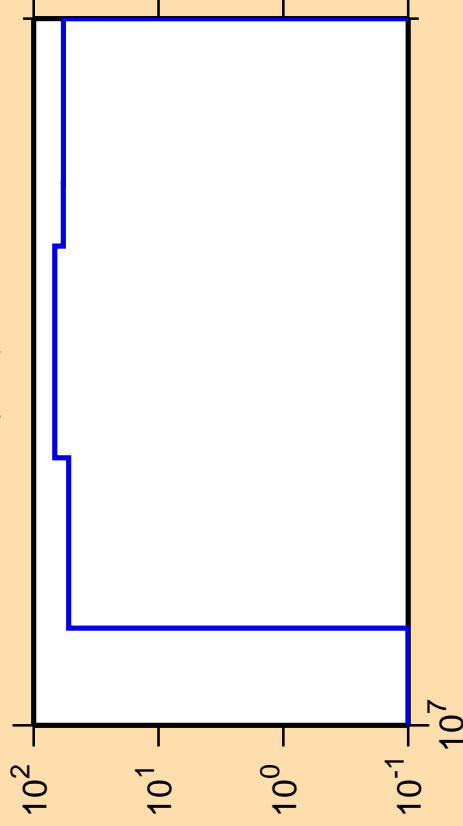


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{64}\text{Ni}(n,d)$

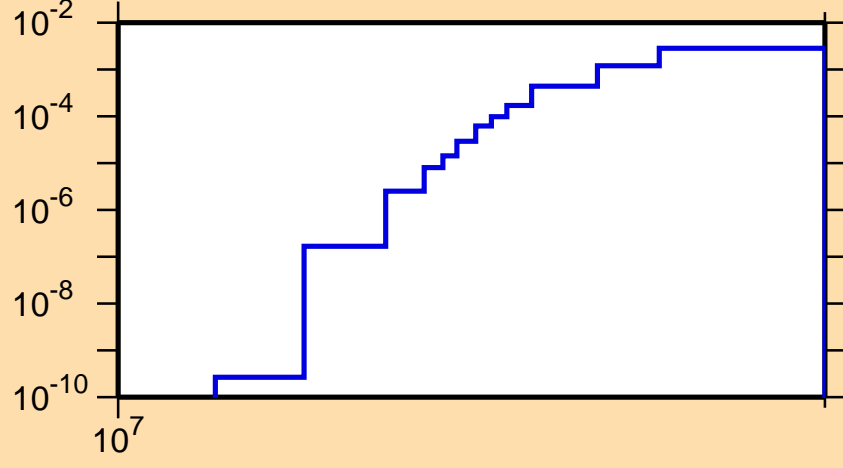

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,t)$

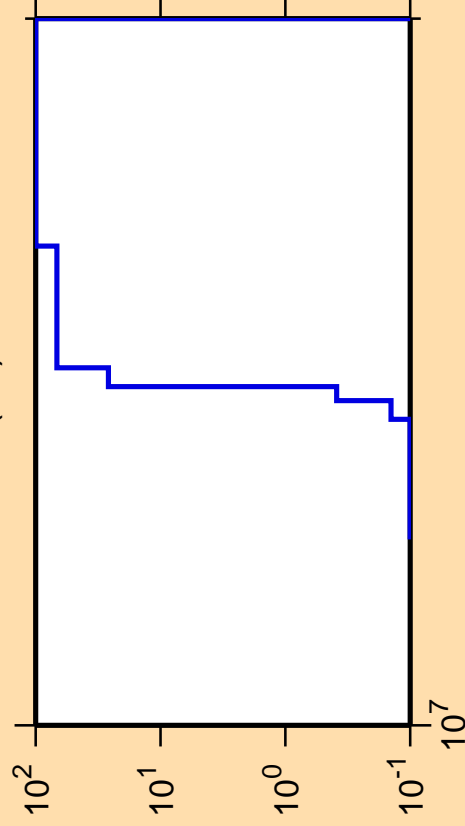


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{64}\text{Ni}(n,t)$

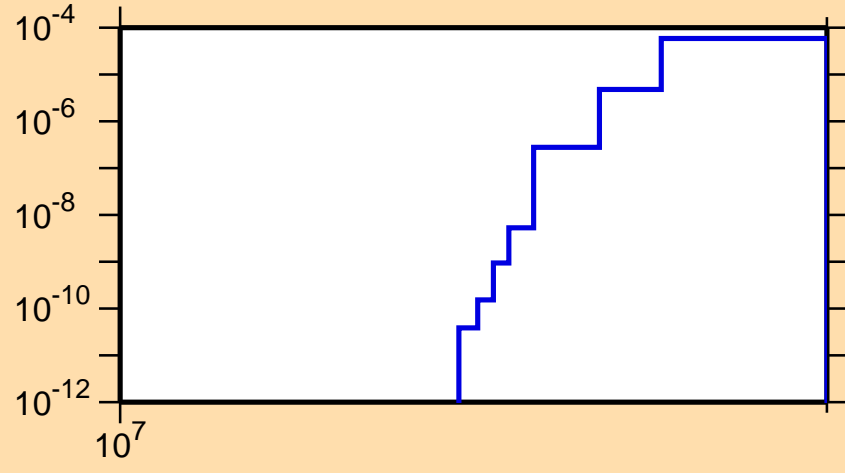

10^7

10^{-4}

10^{-6}

10^{-8}


10^{-10}

10^{-12}

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{64}\text{Ni}(n,\text{He3})$

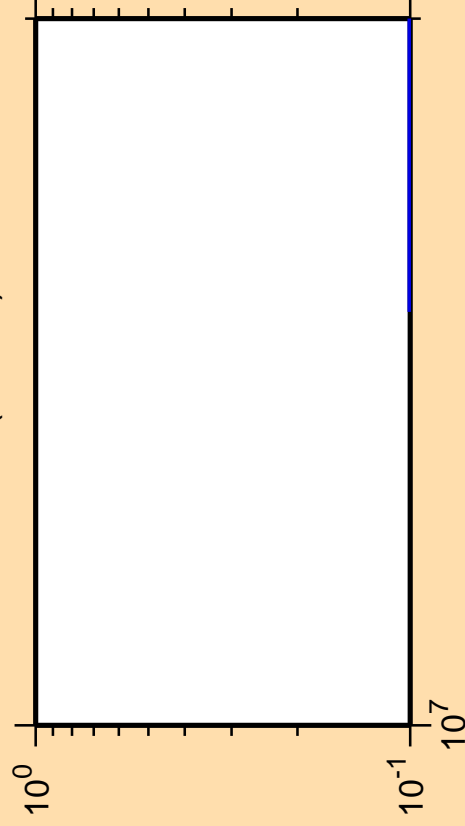


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{64}\text{Ni}(n,\text{He3})$

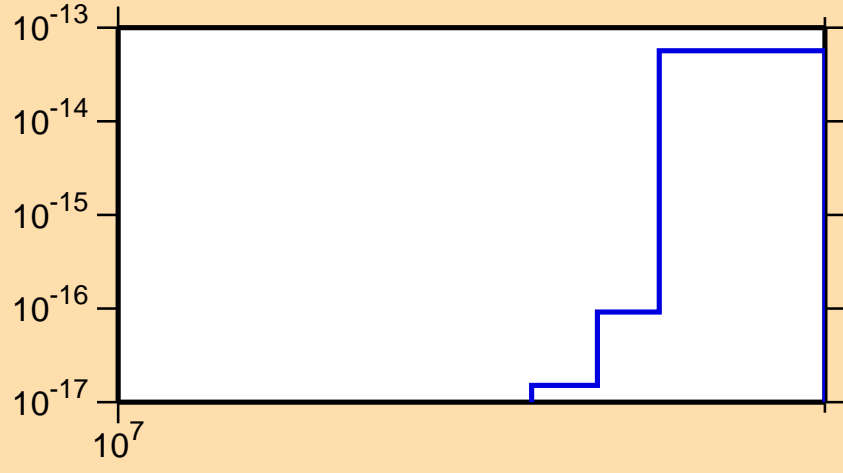


10^7

10^{-17}
 10^{-16}
 10^{-15}
 10^{-14}
 10^{-13}

Correlation Matrix


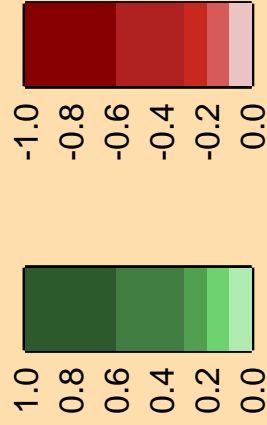


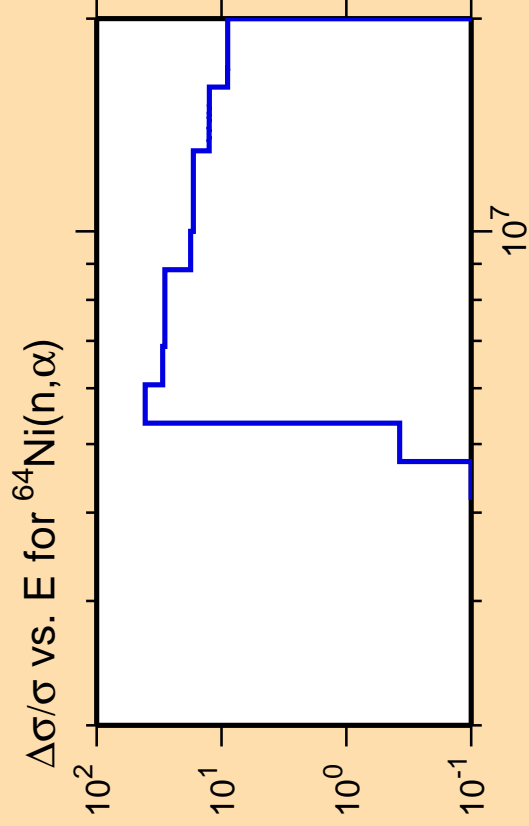

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

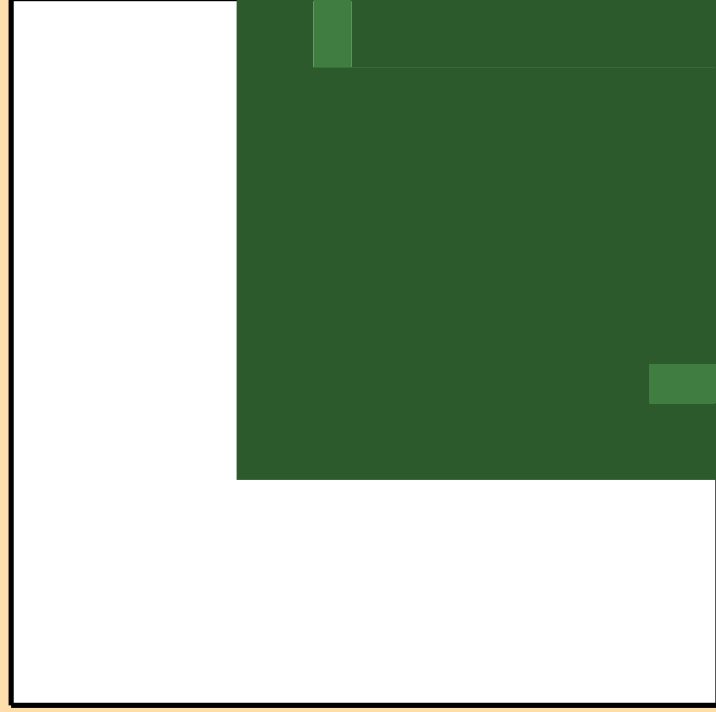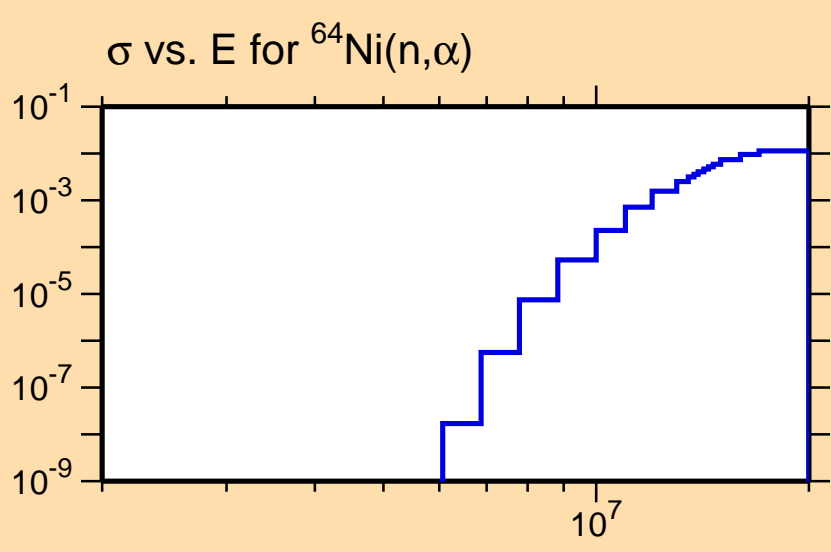

Correlation Matrix

