




$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{tot.})$

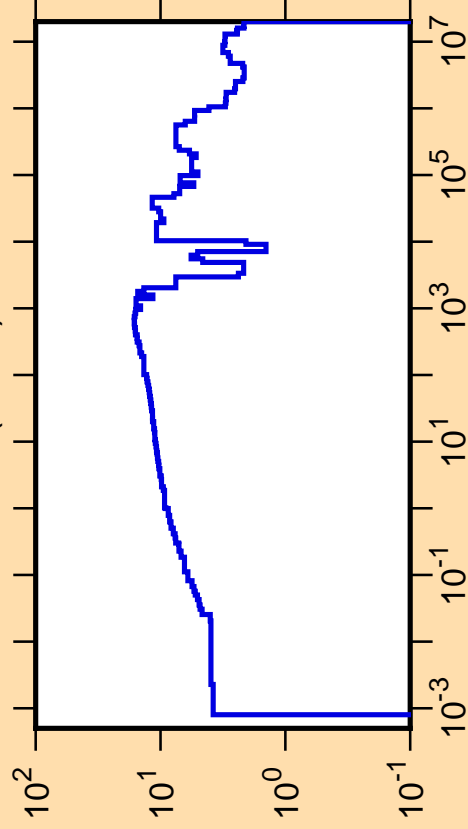

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{49}\text{Ti}(n,\text{tot.})$

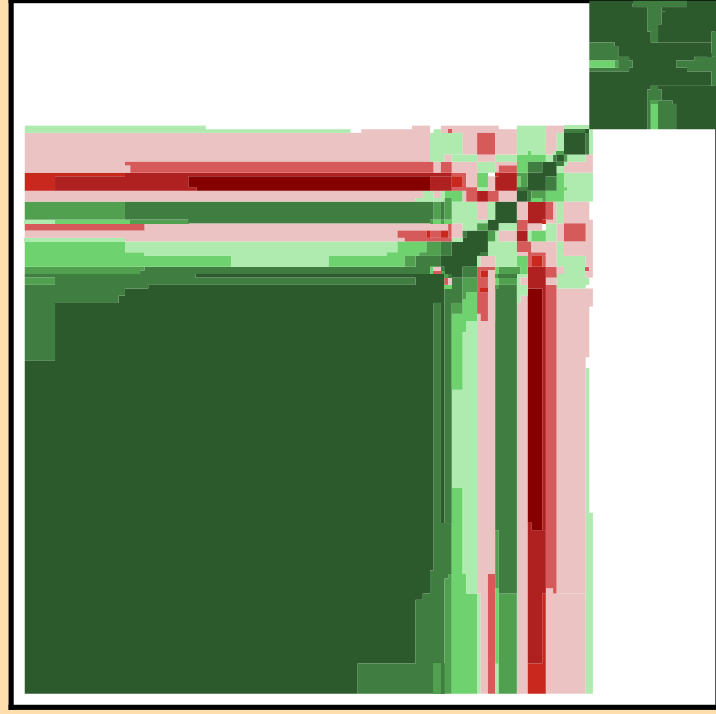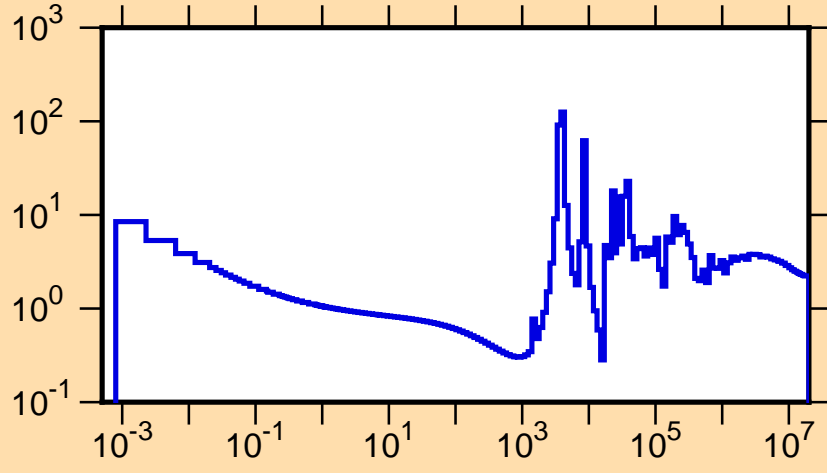

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

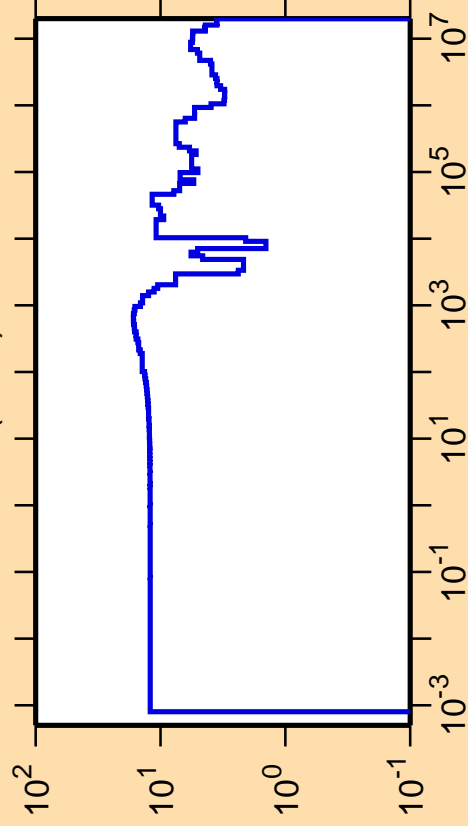

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{tot.})$

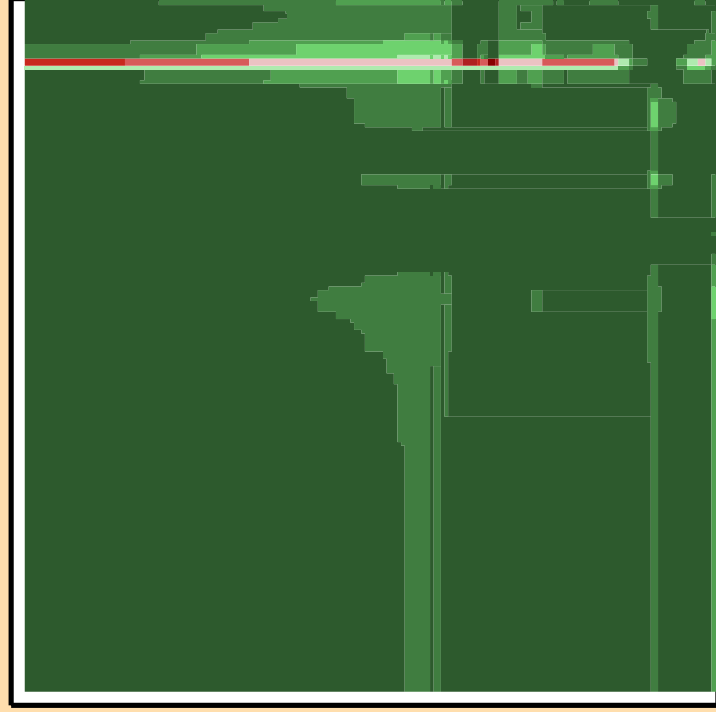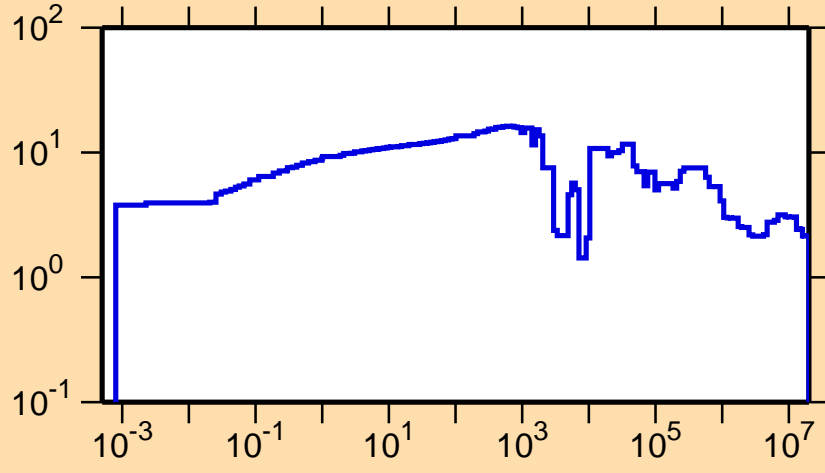

Correlation Matrix




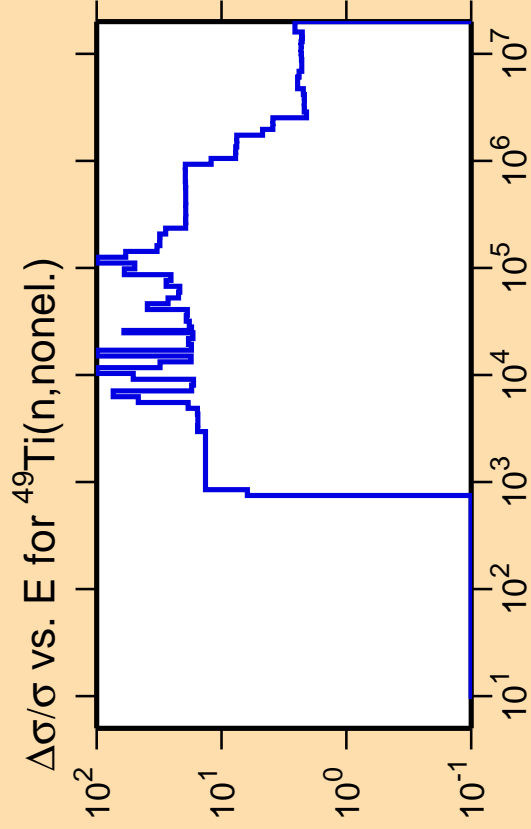


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{tot.})$

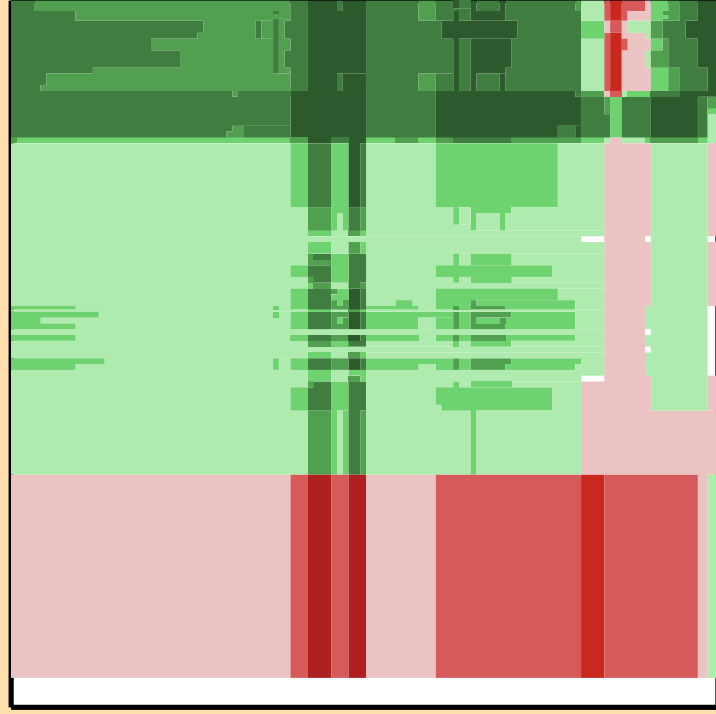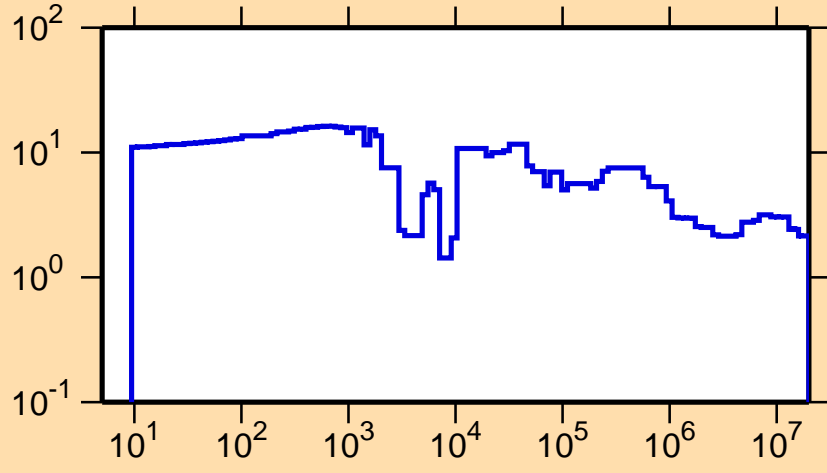



Correlation Matrix



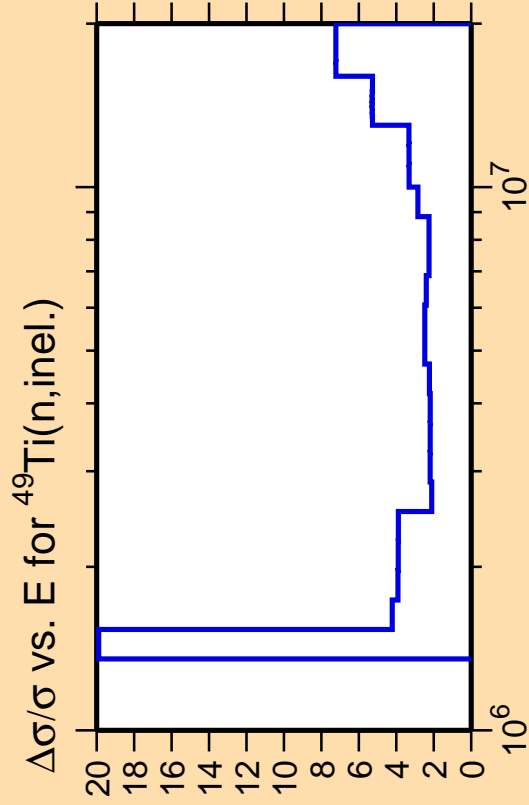

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

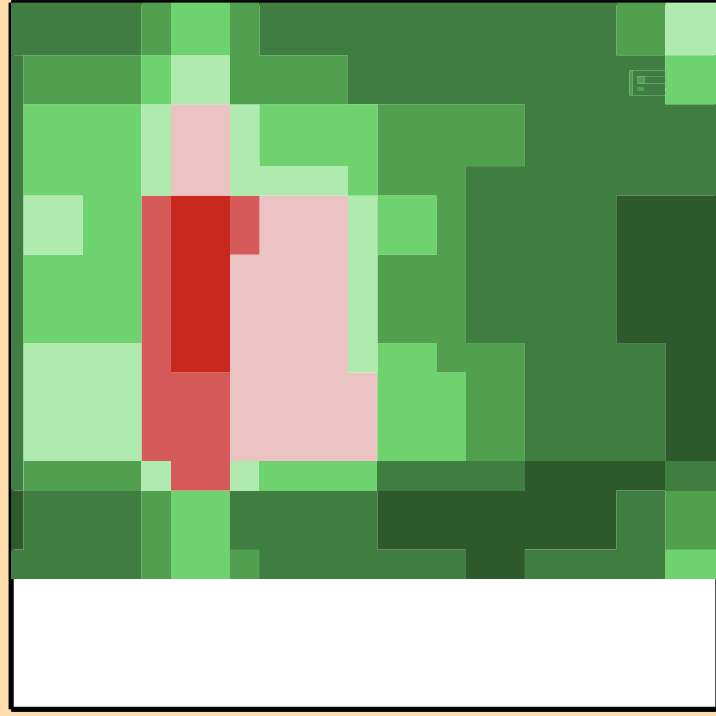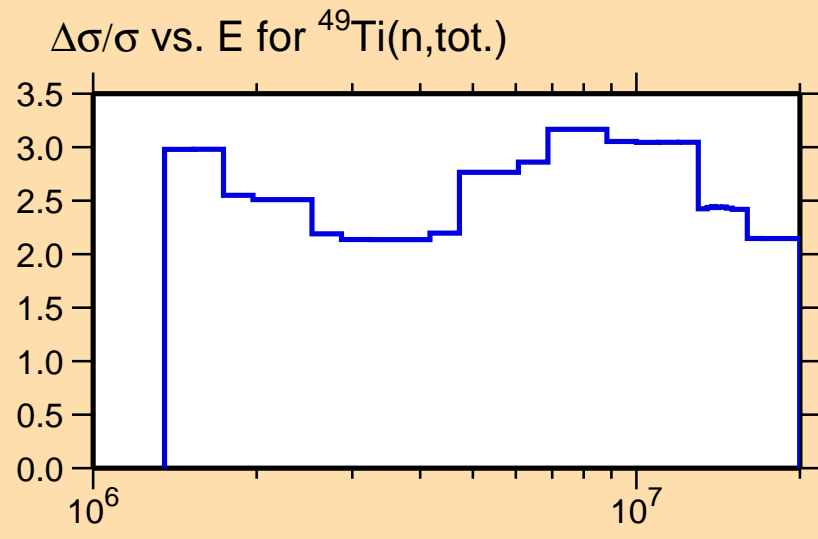

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,2n)$

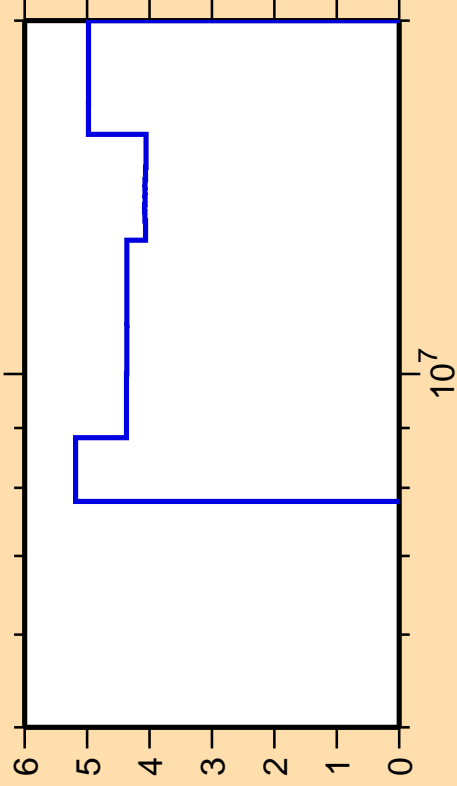

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{tot.})$

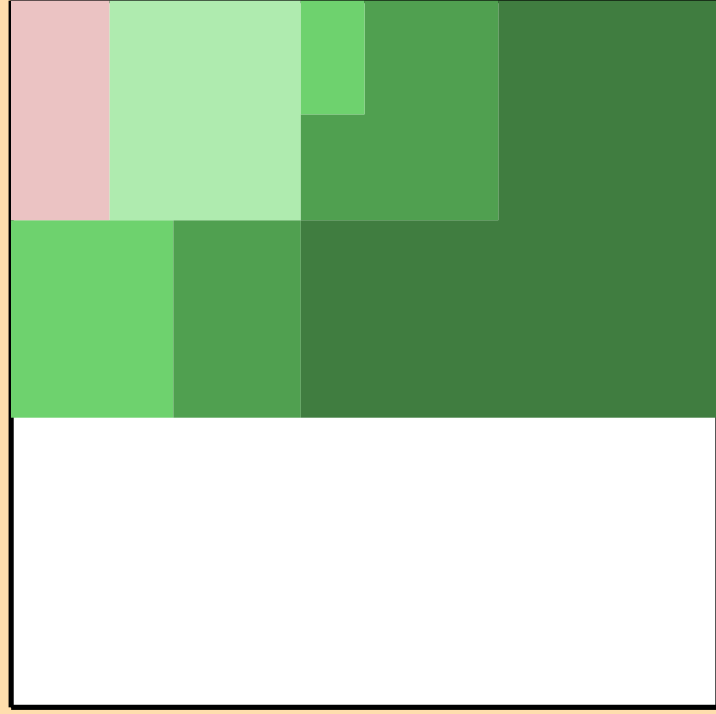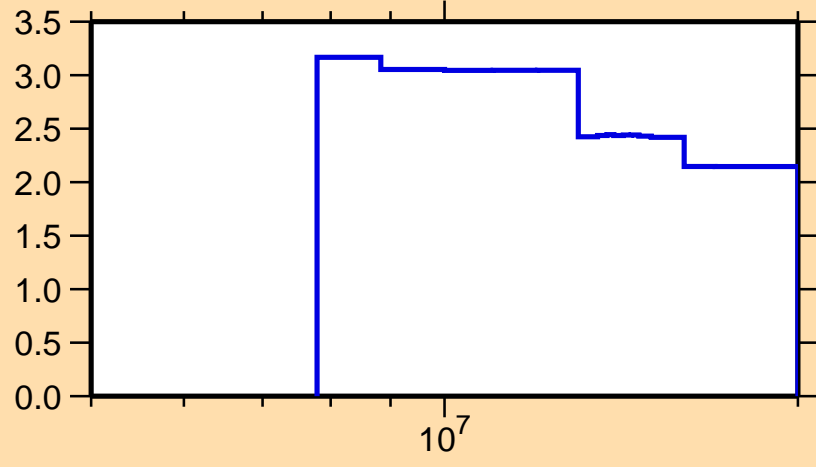



Correlation Matrix



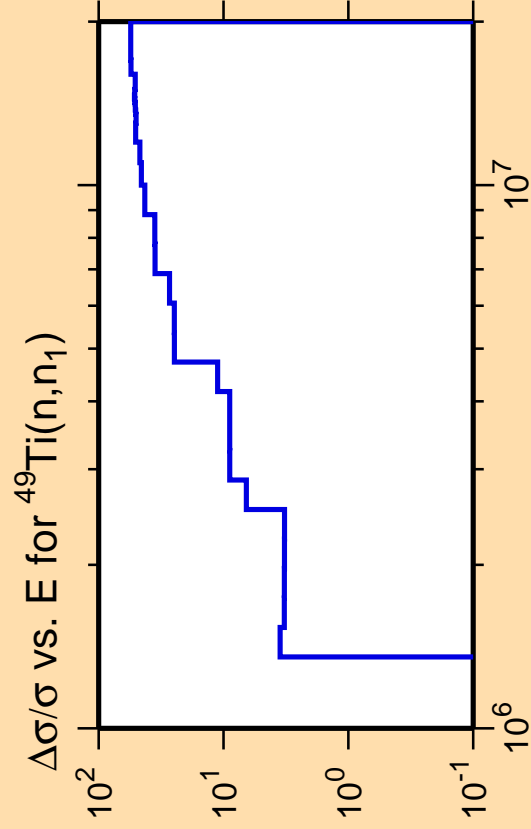


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

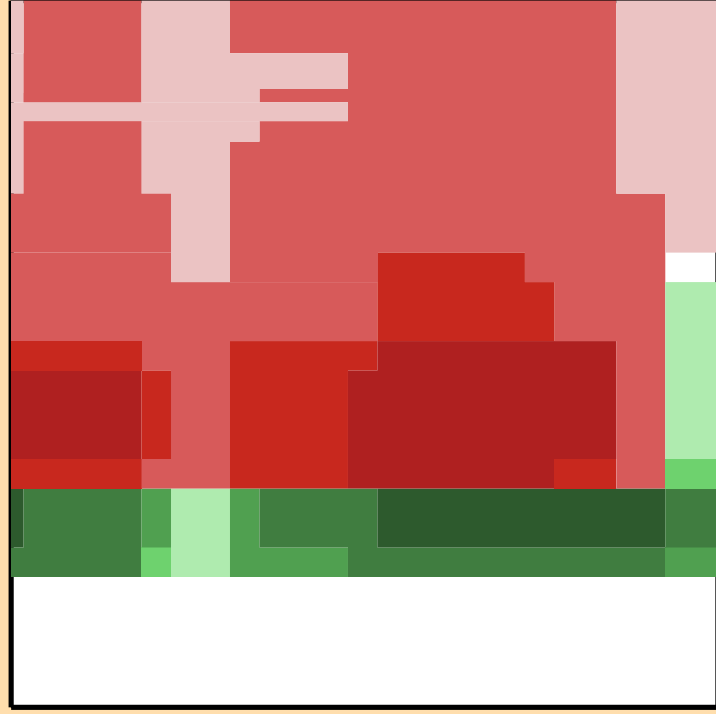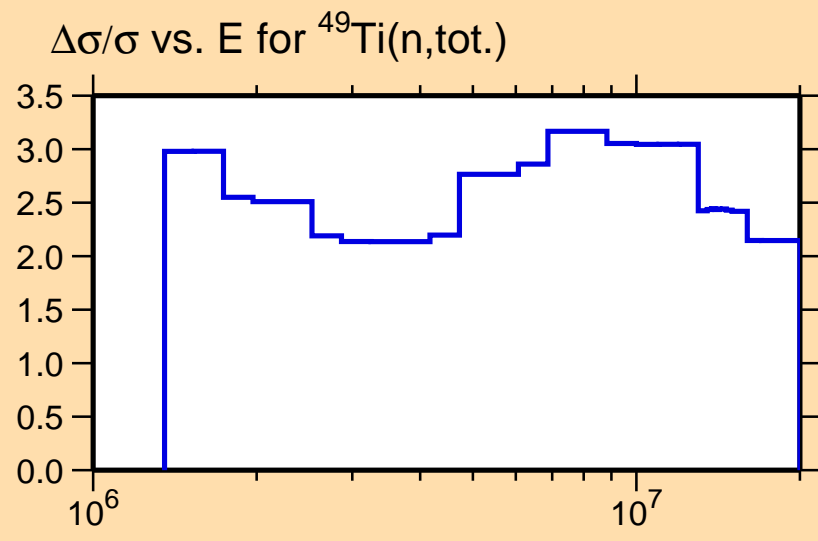



Correlation Matrix



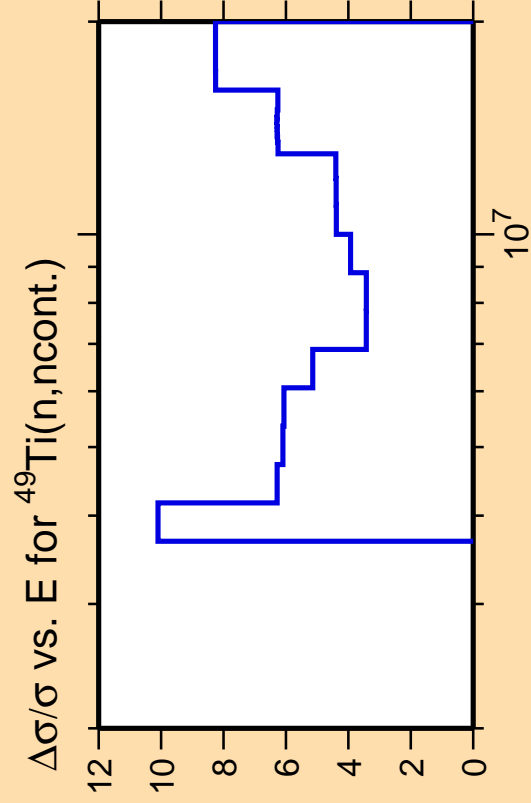


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

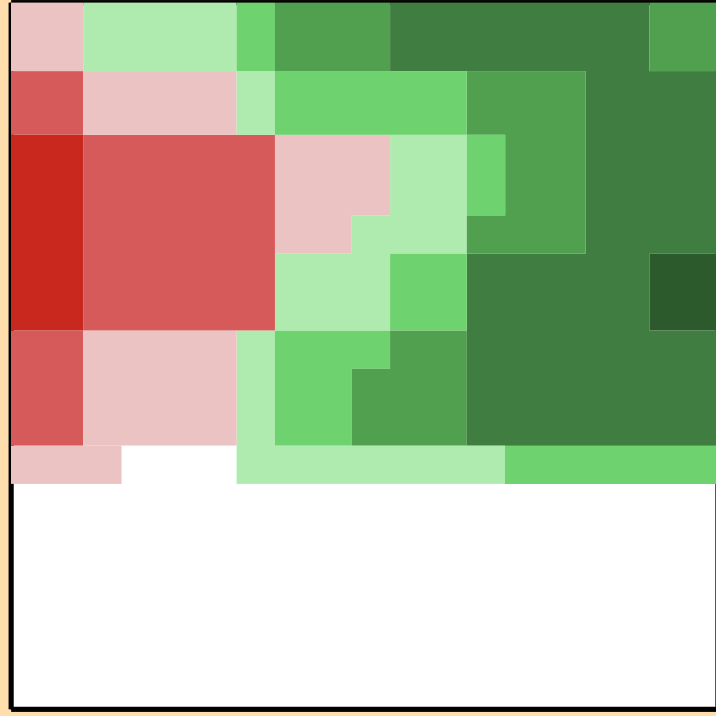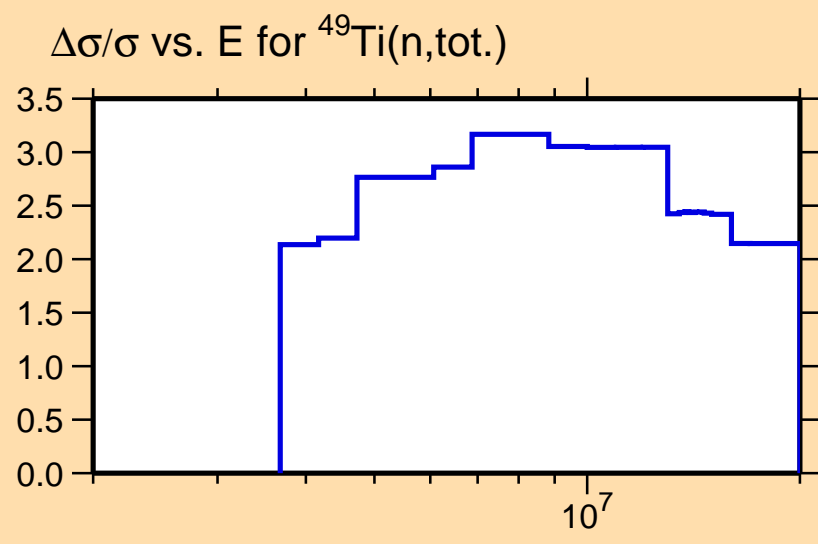

Correlation Matrix




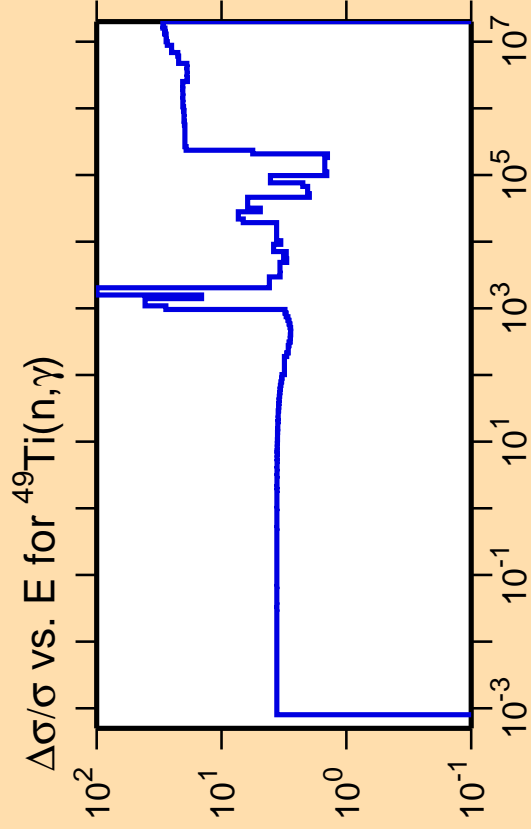


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{tot.})$

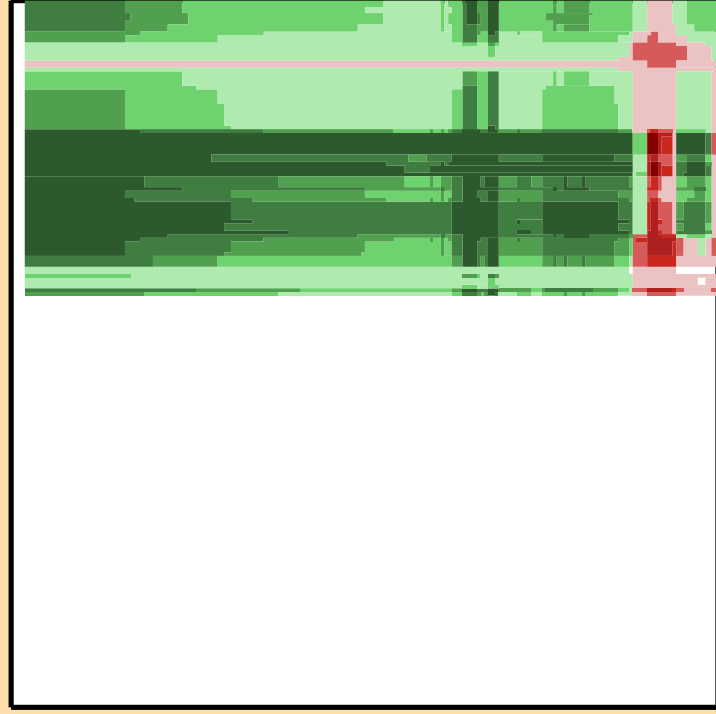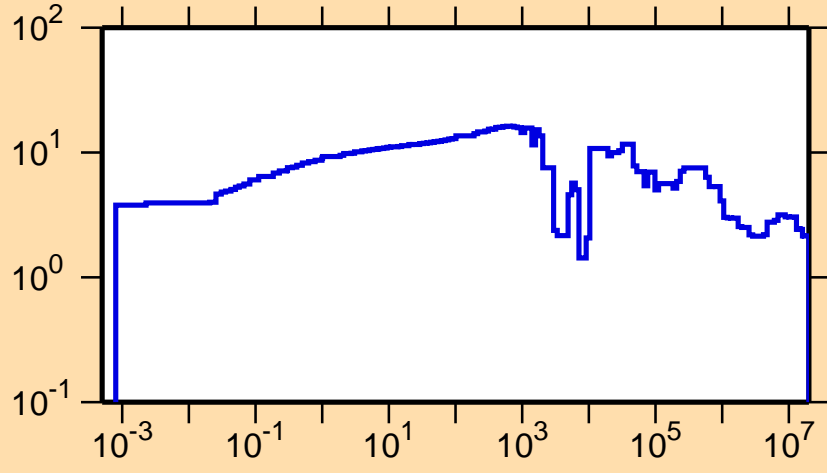



Correlation Matrix



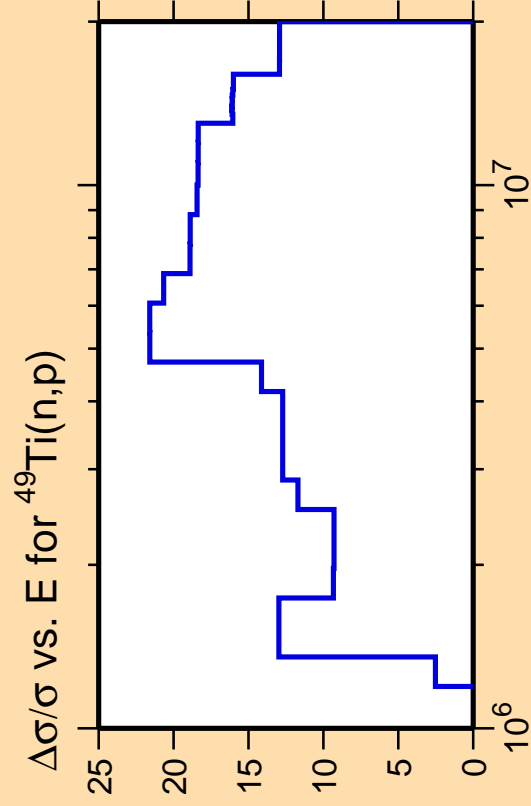


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

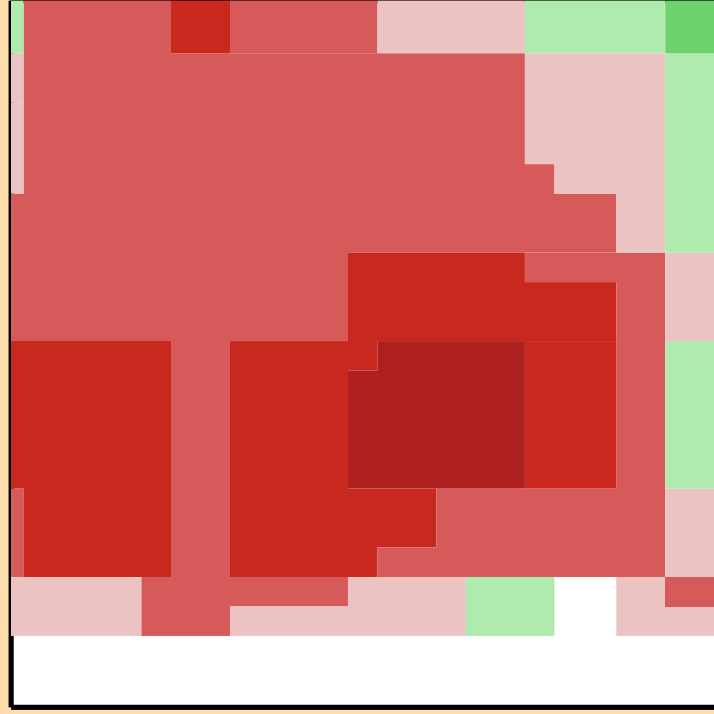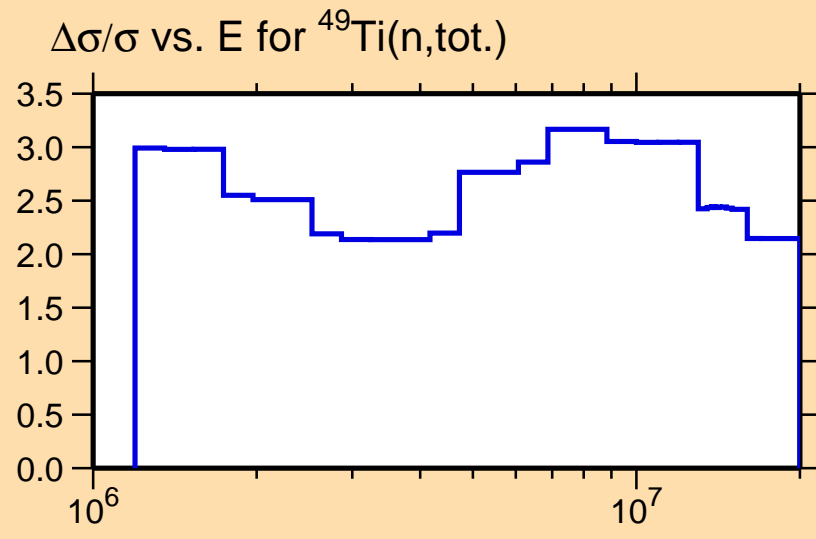

Correlation Matrix





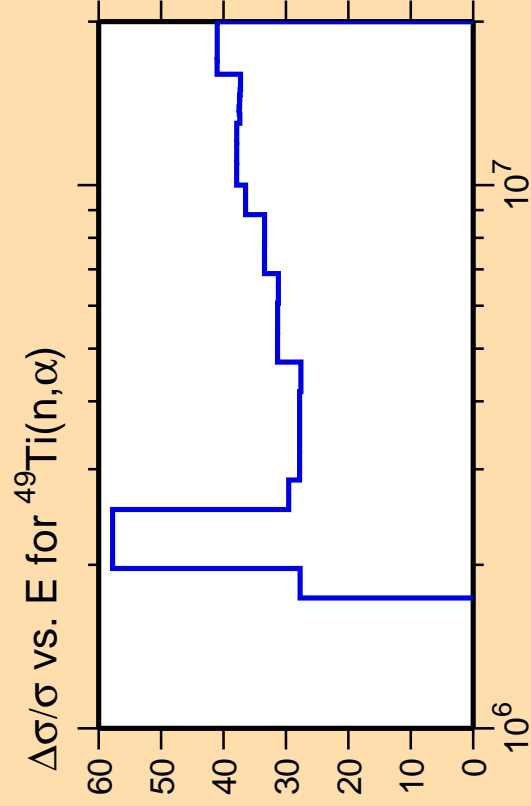

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{tot.})$

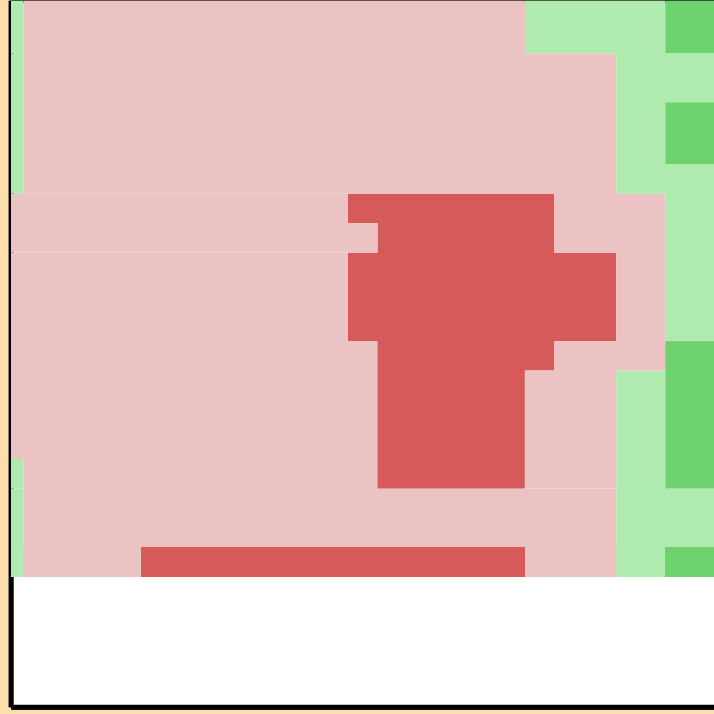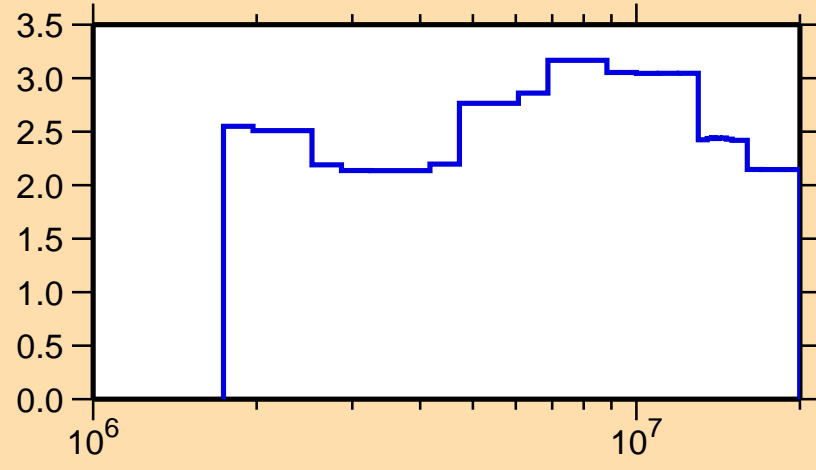

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

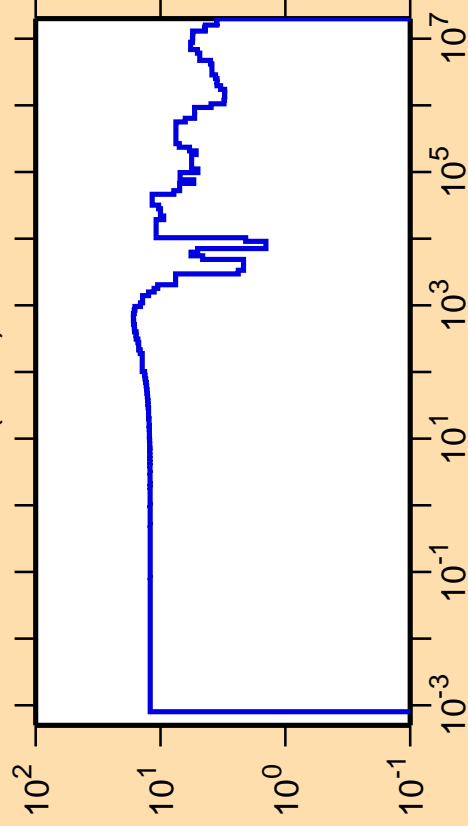

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{49}\text{Ti}(n,\text{el.})$

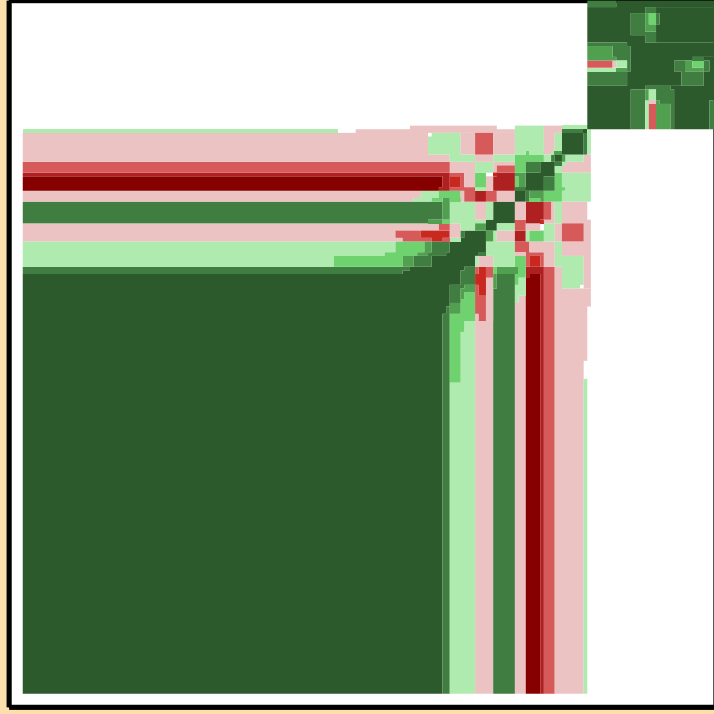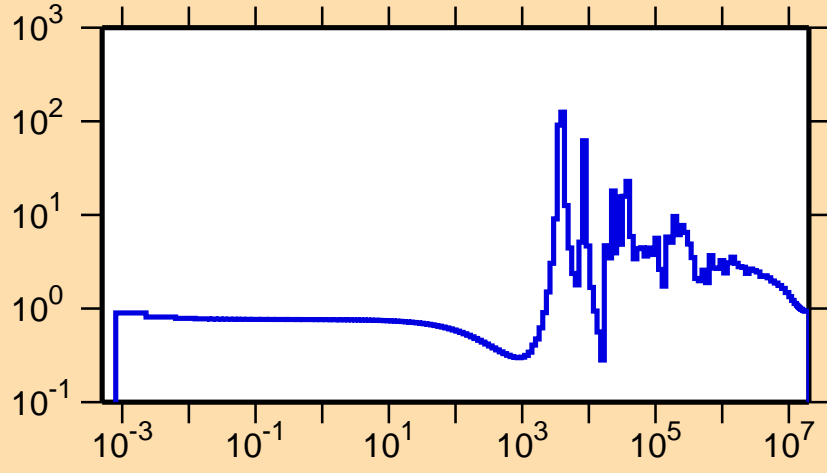

Correlation Matrix




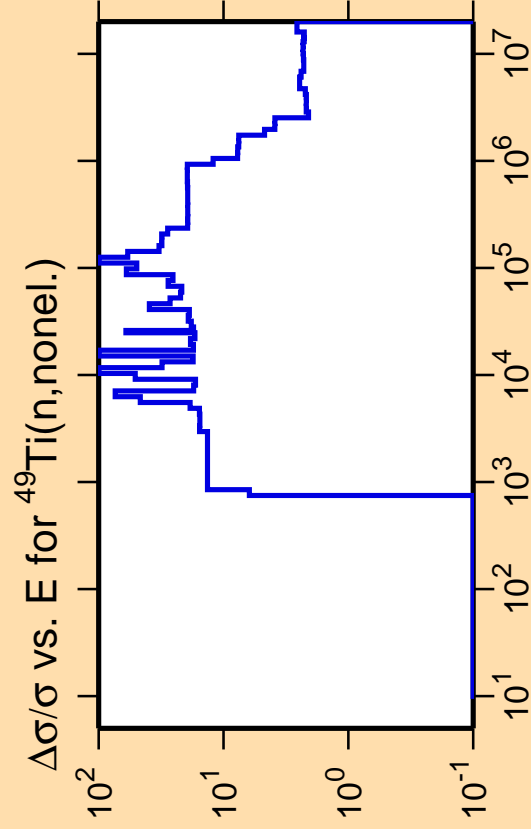


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

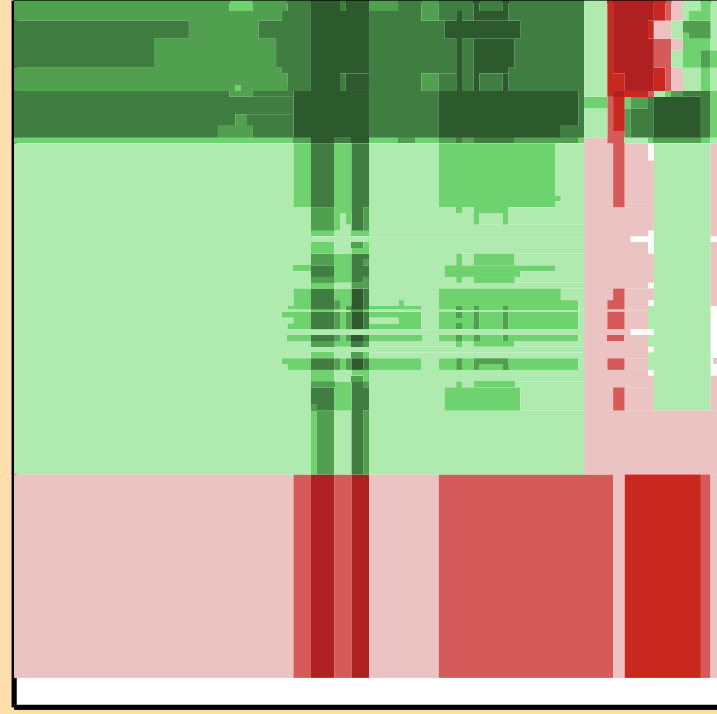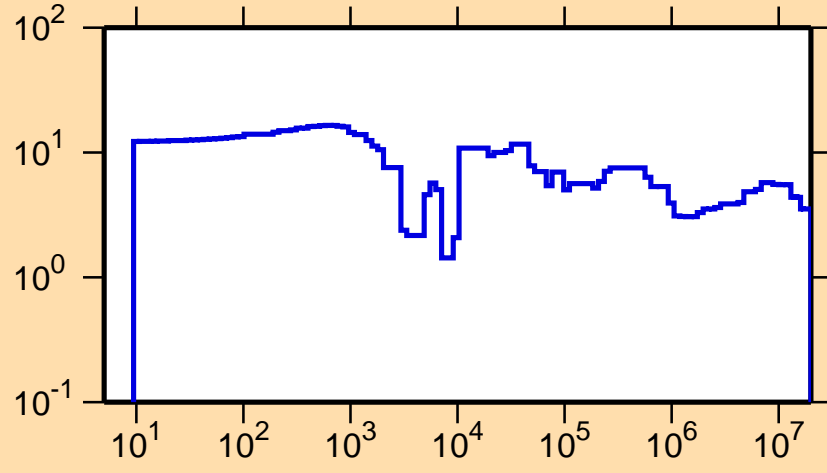

Correlation Matrix





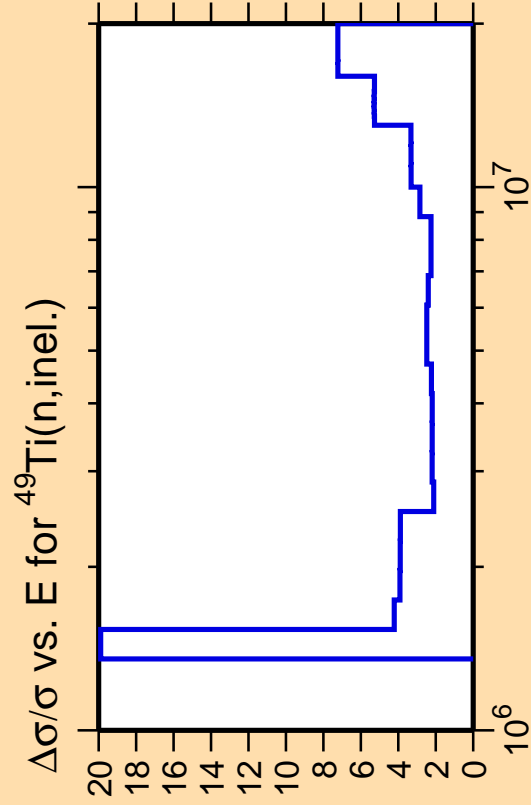

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

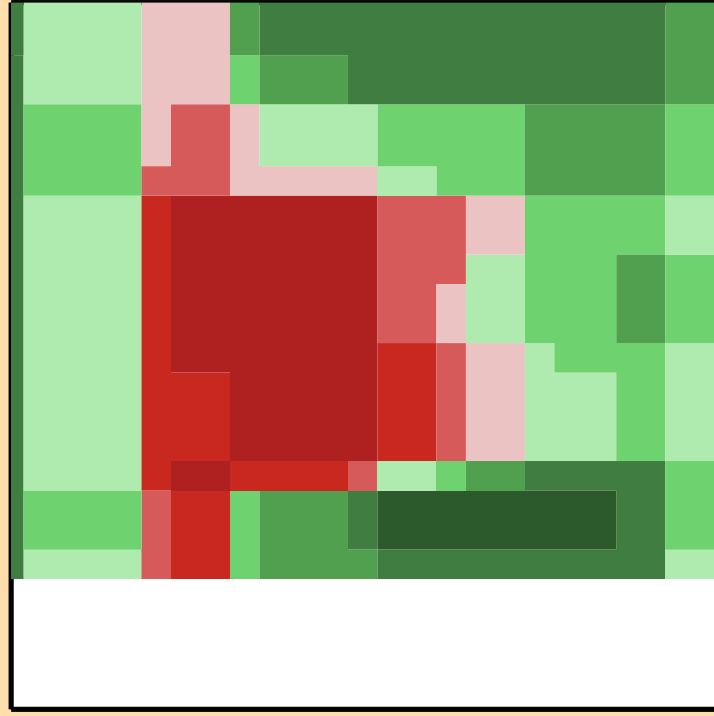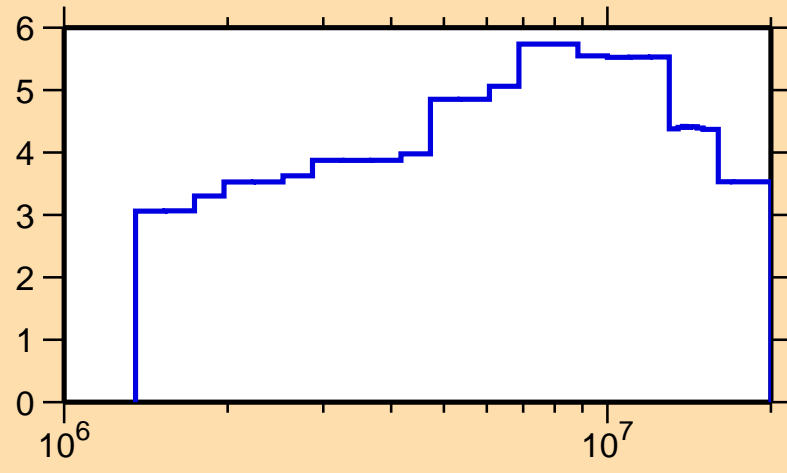

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,2n)$

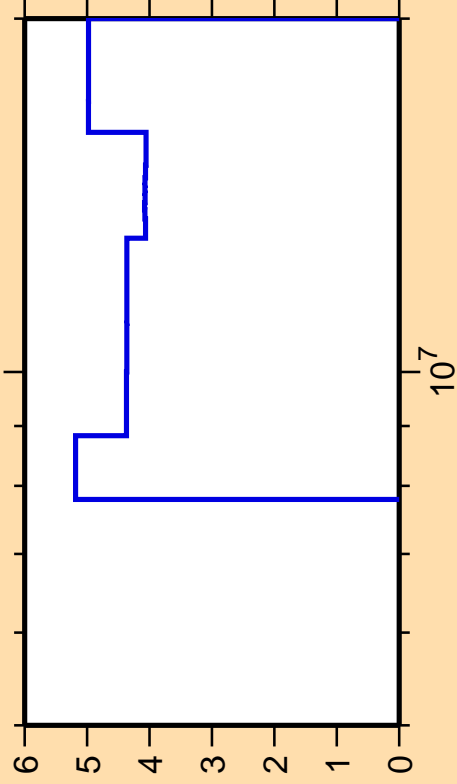

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

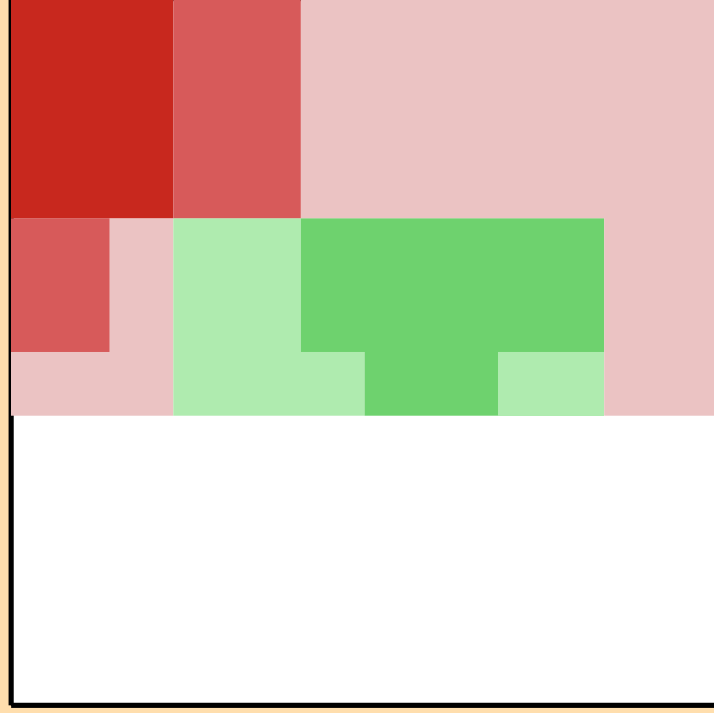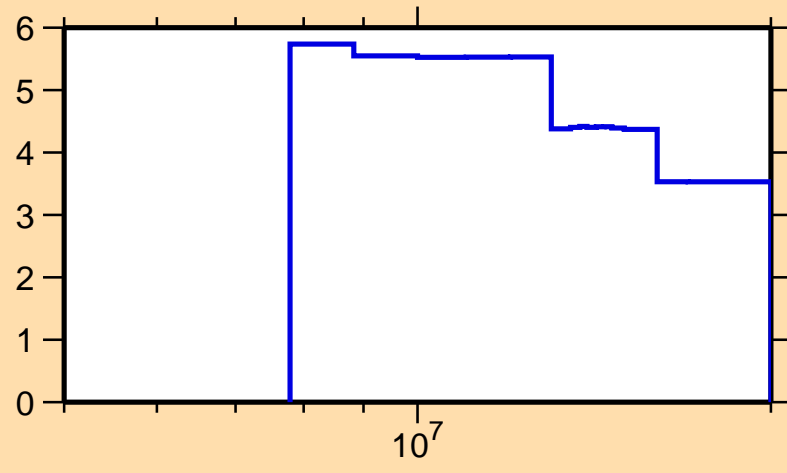

Correlation Matrix





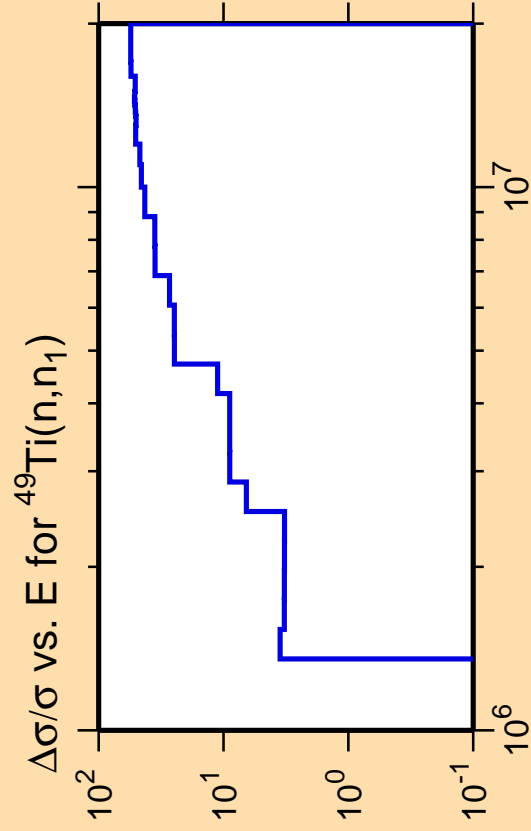

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

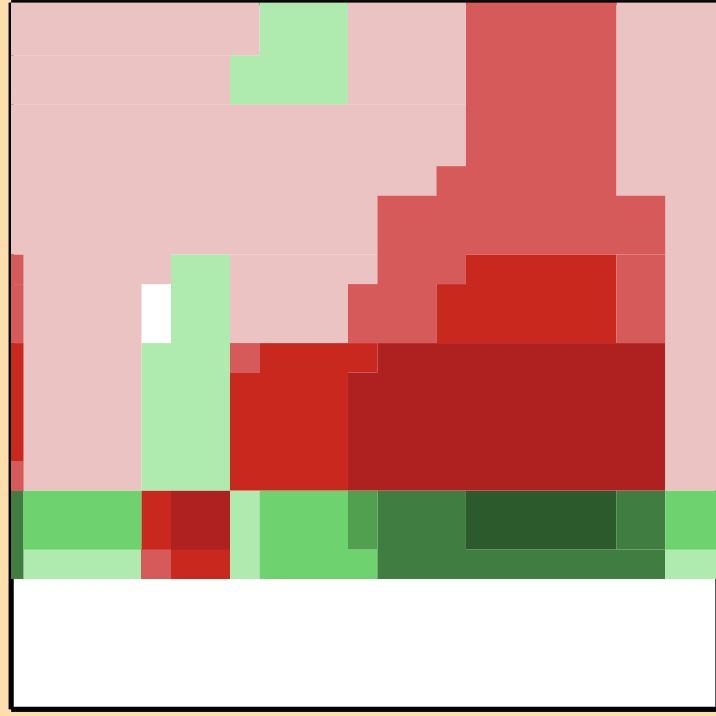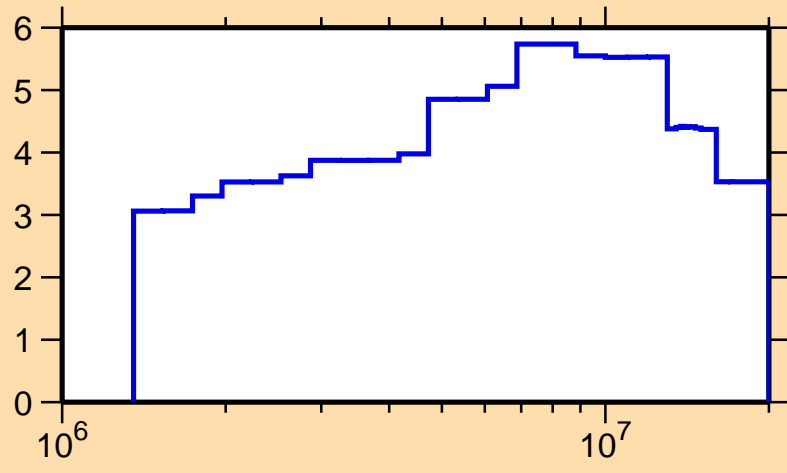



Correlation Matrix



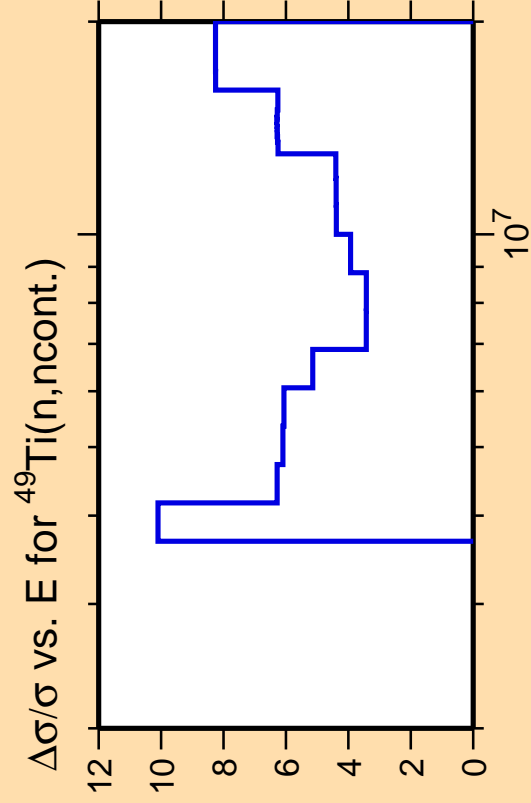


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

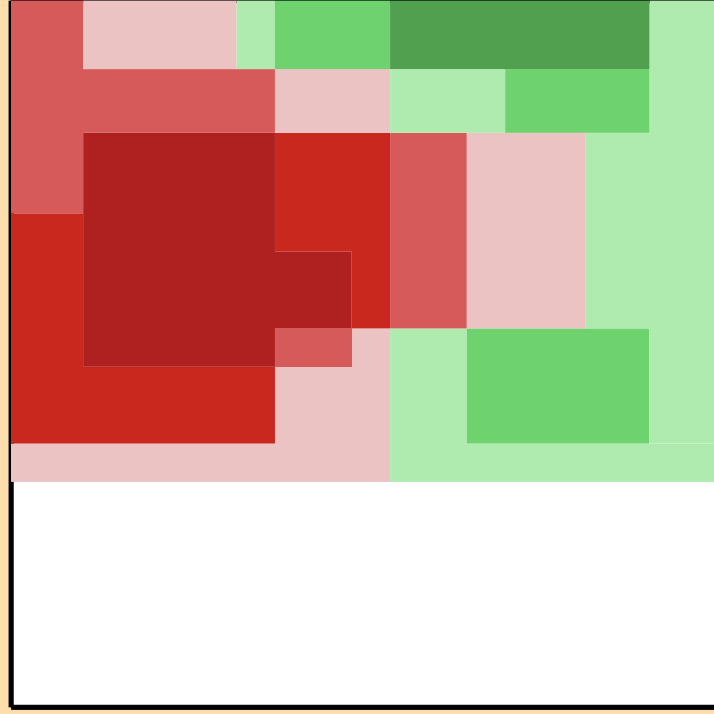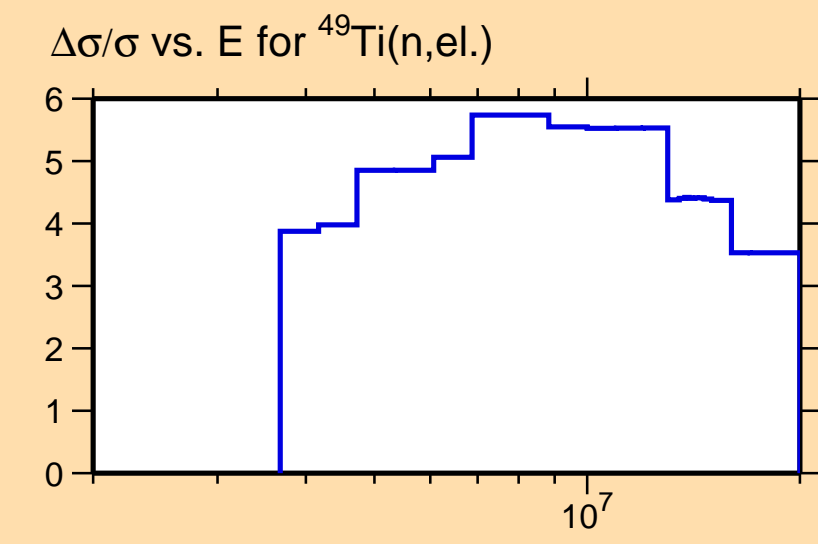

Correlation Matrix




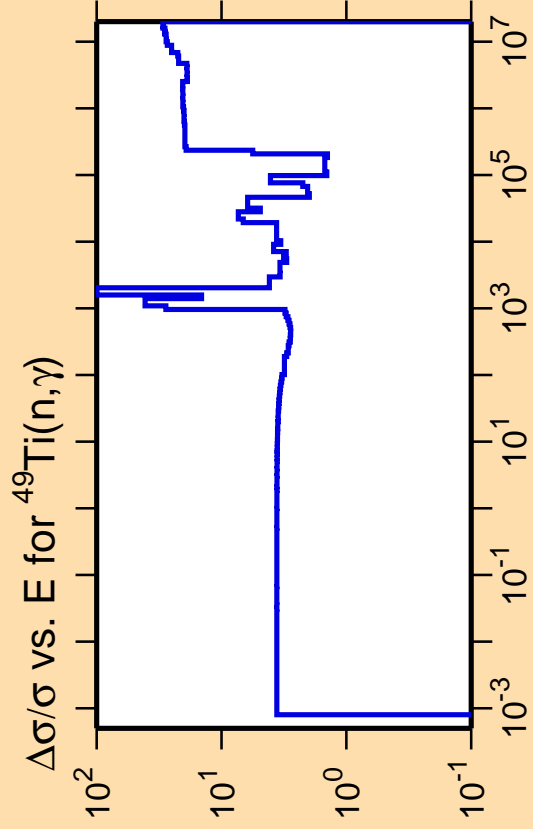


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

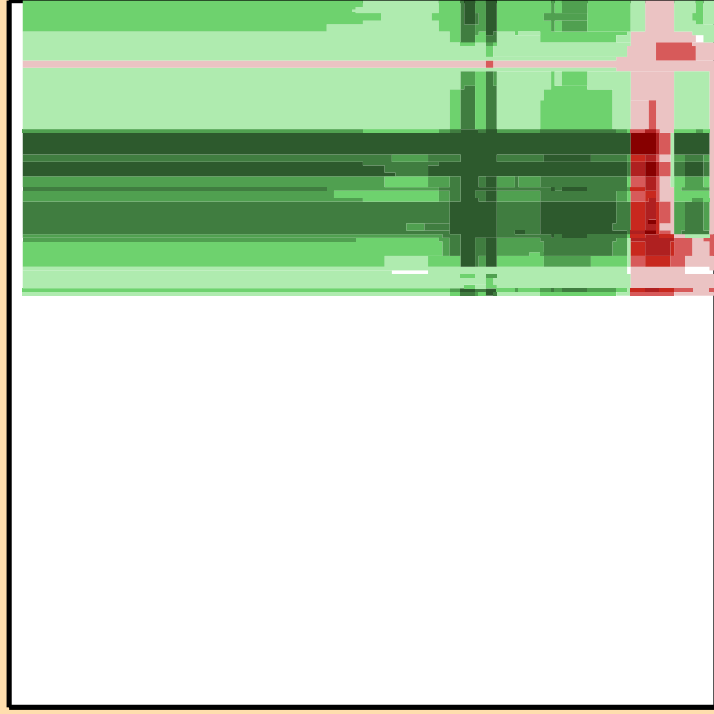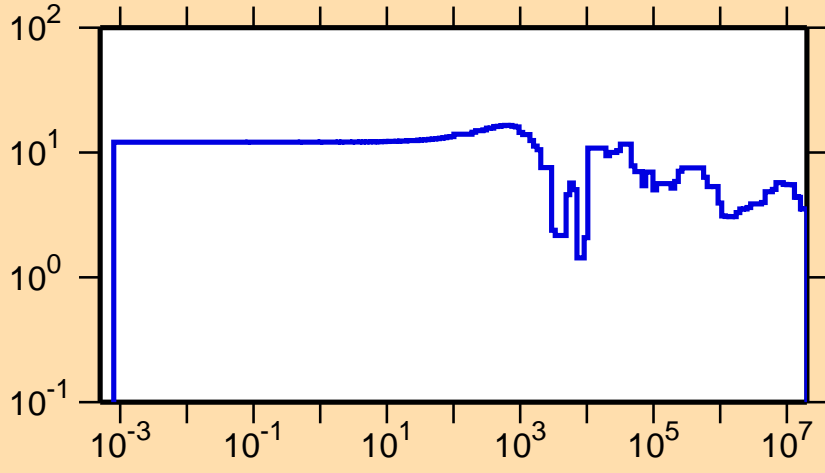

Correlation Matrix





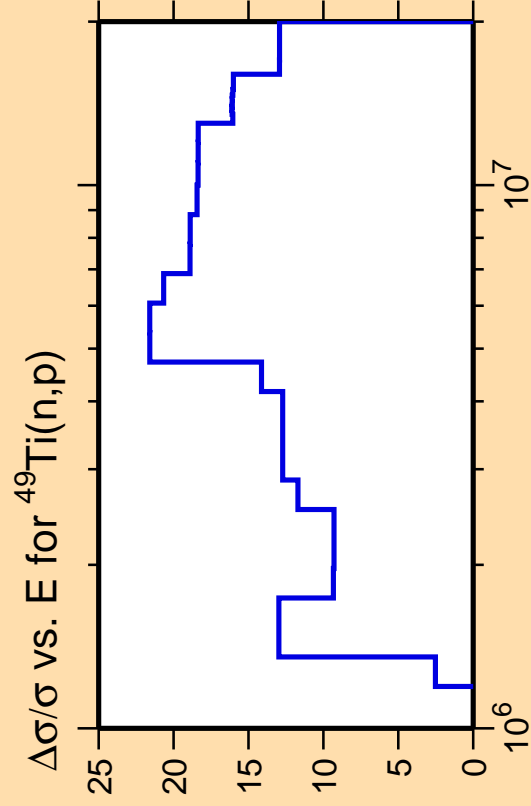


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

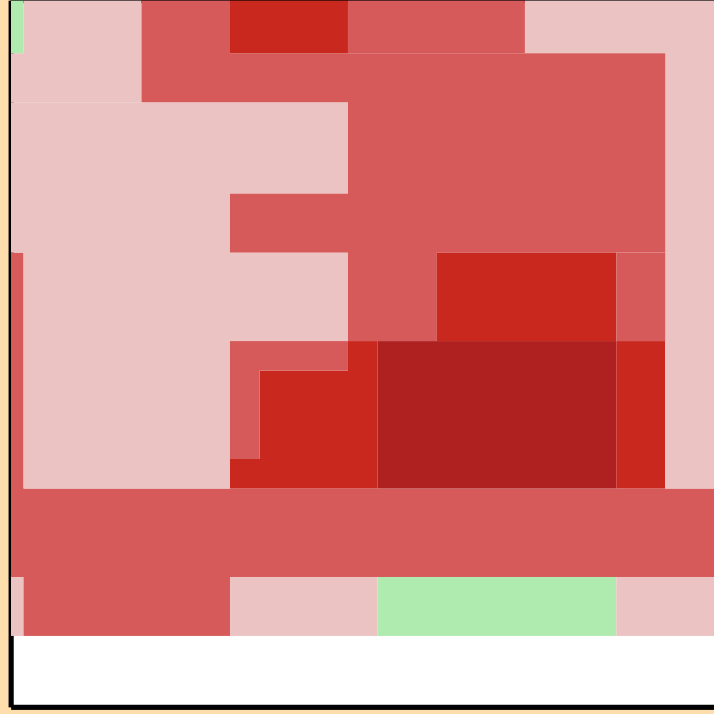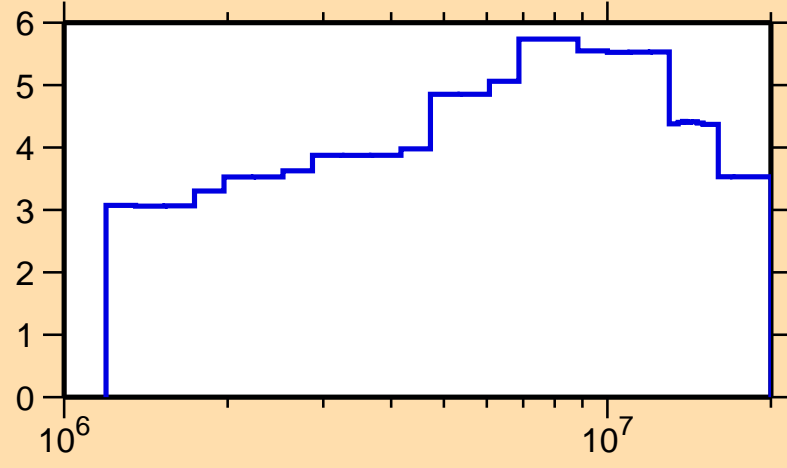

Correlation Matrix


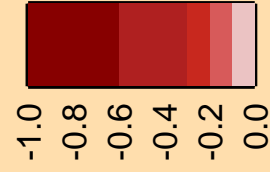


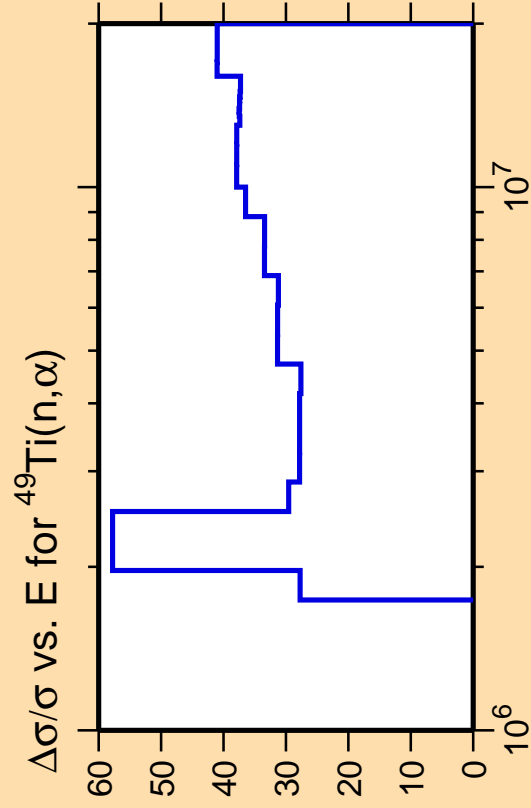

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{el.})$

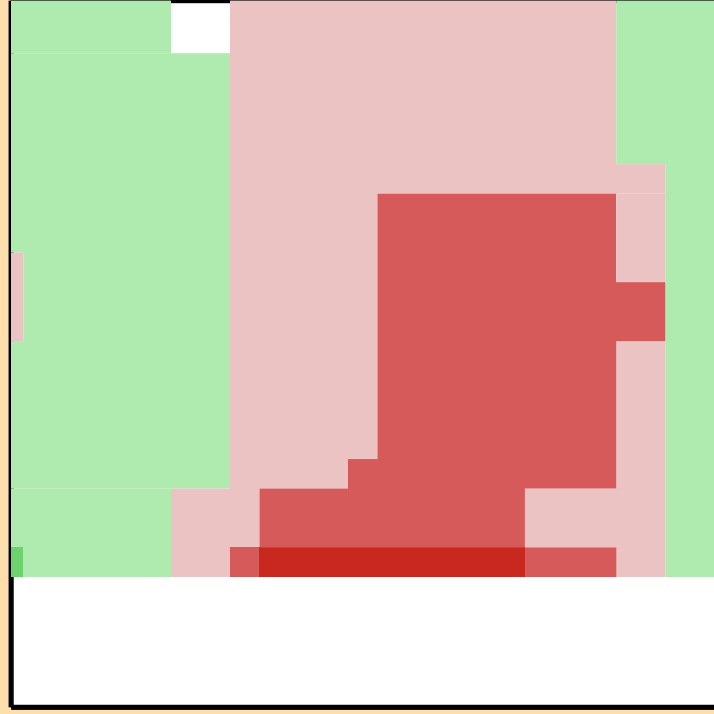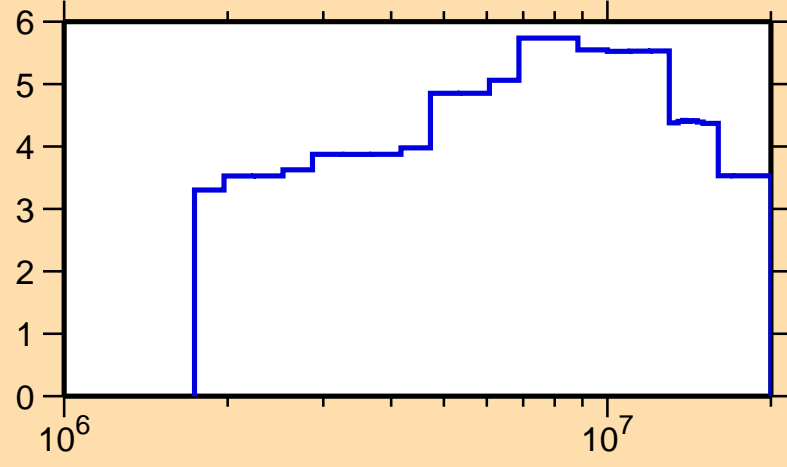

Correlation Matrix




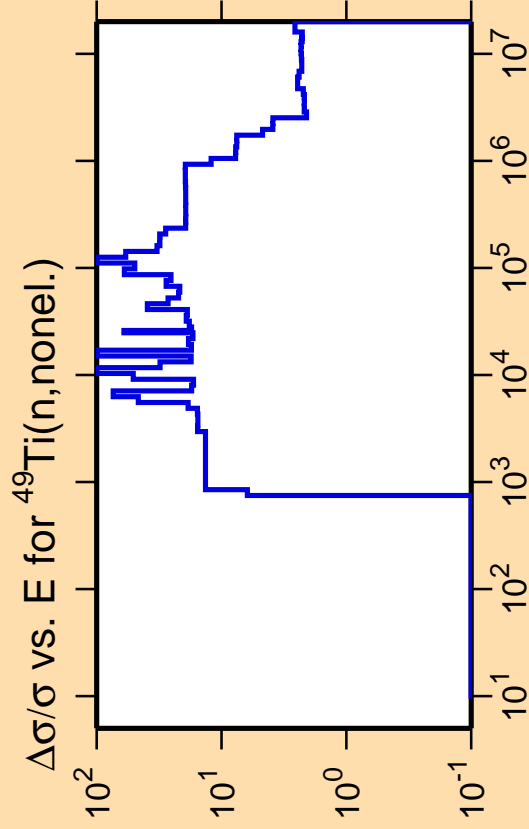


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

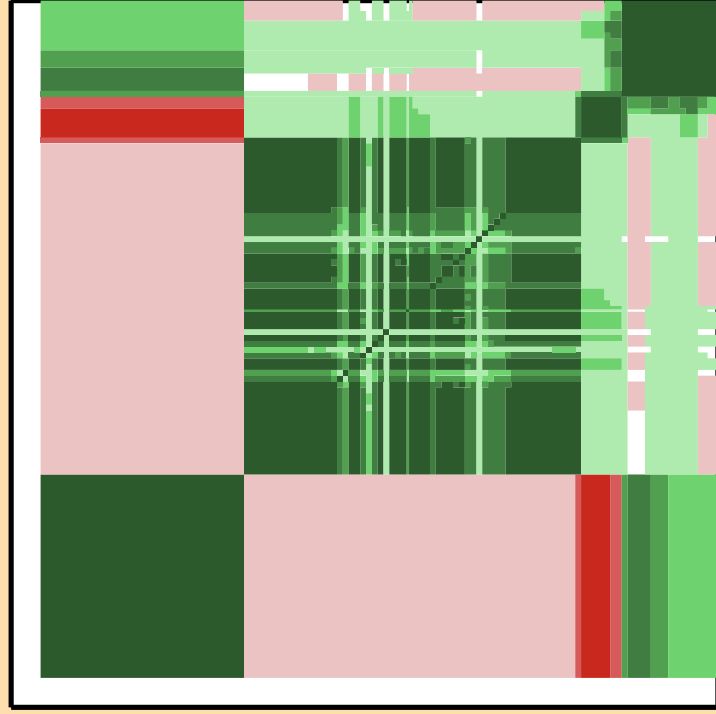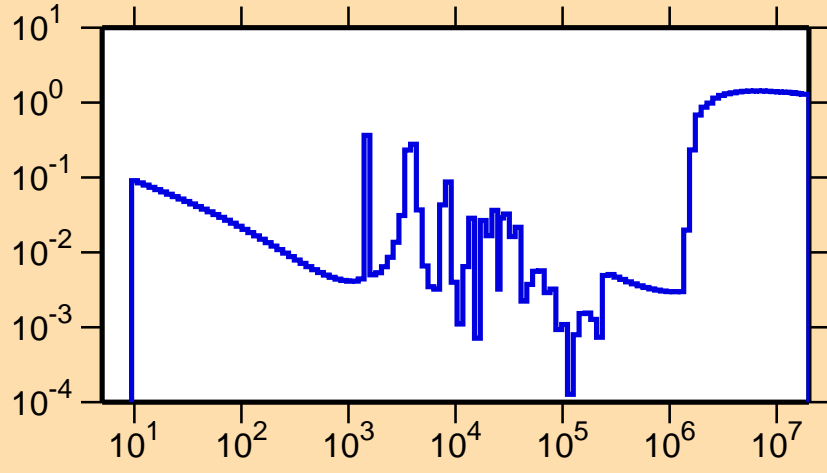

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{inel.})$

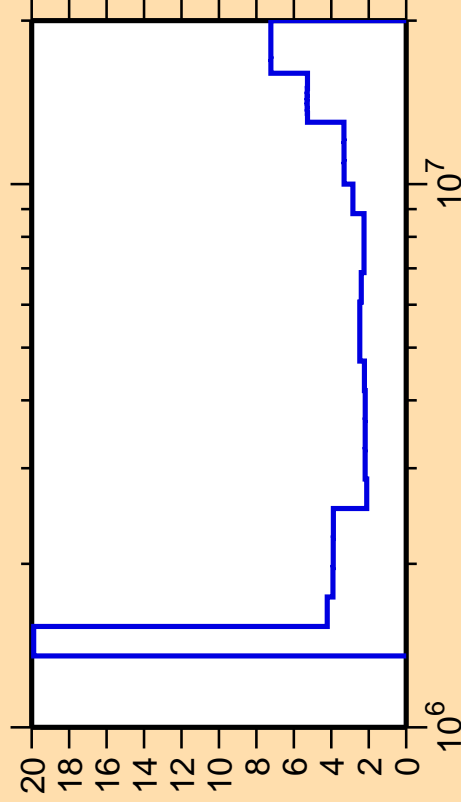

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

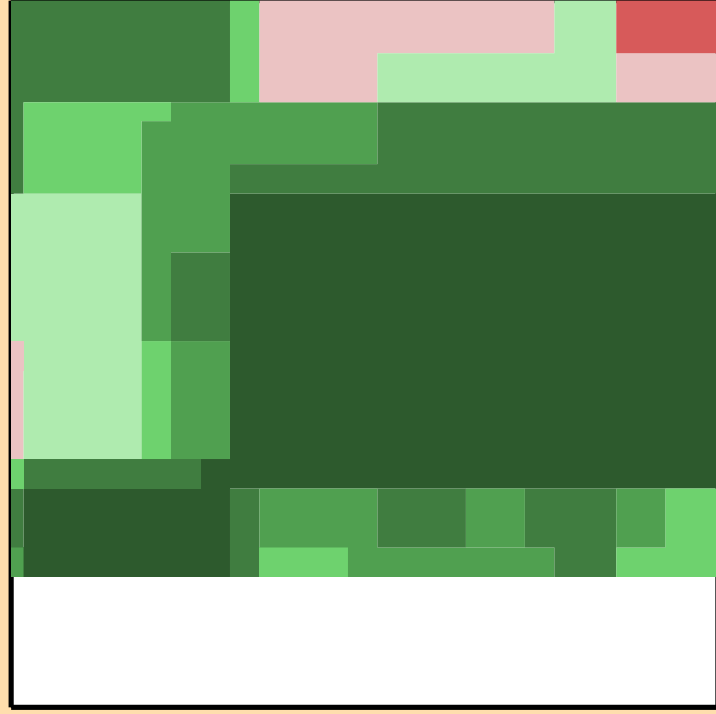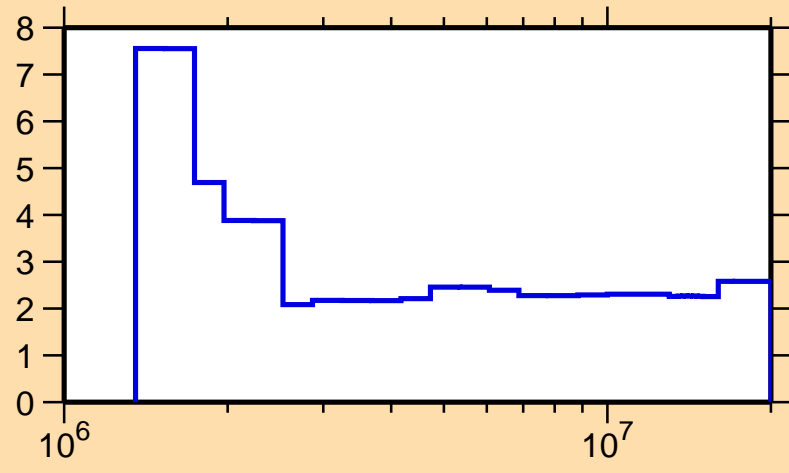

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,2n)$

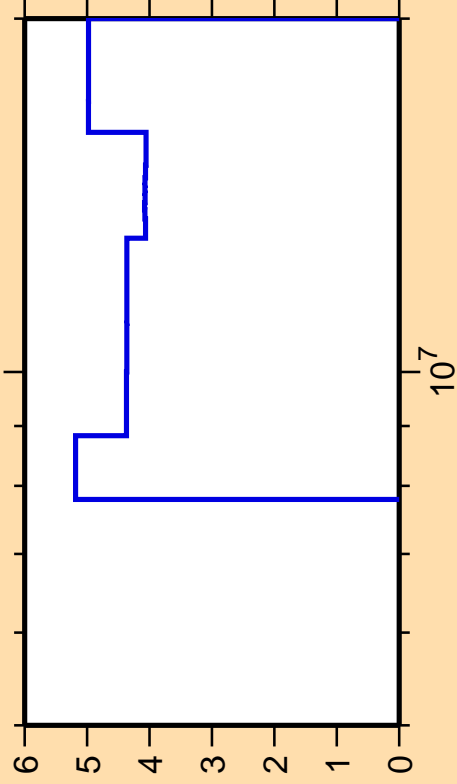

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

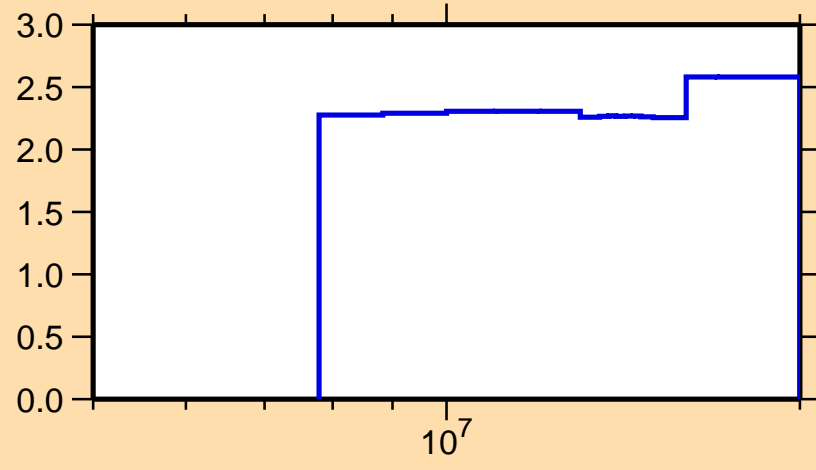

Correlation Matrix





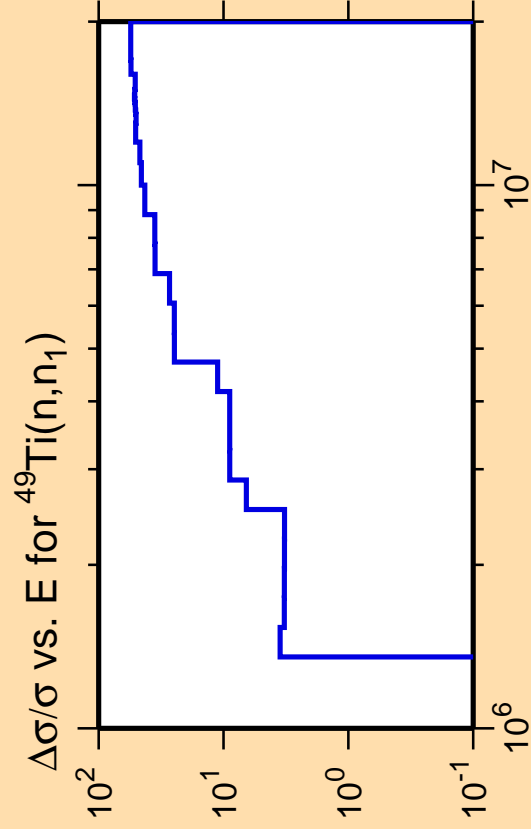

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

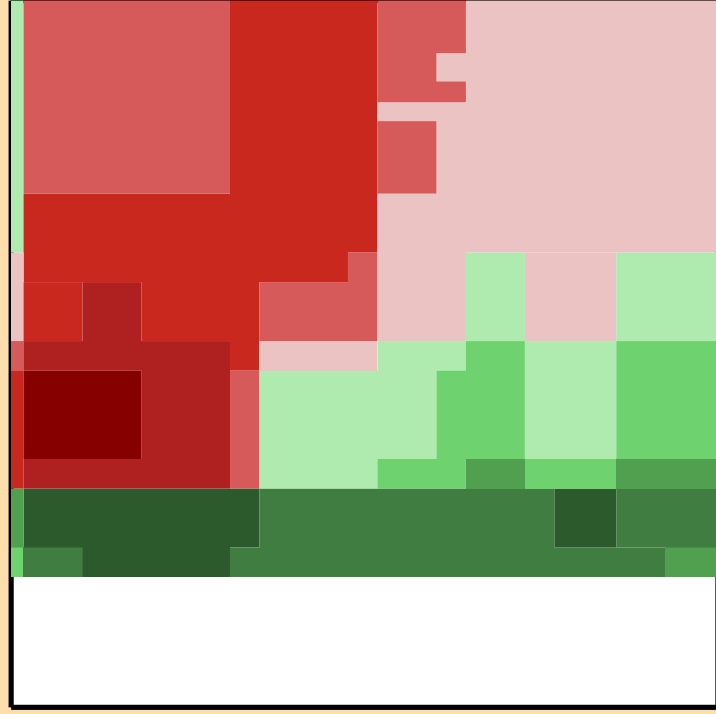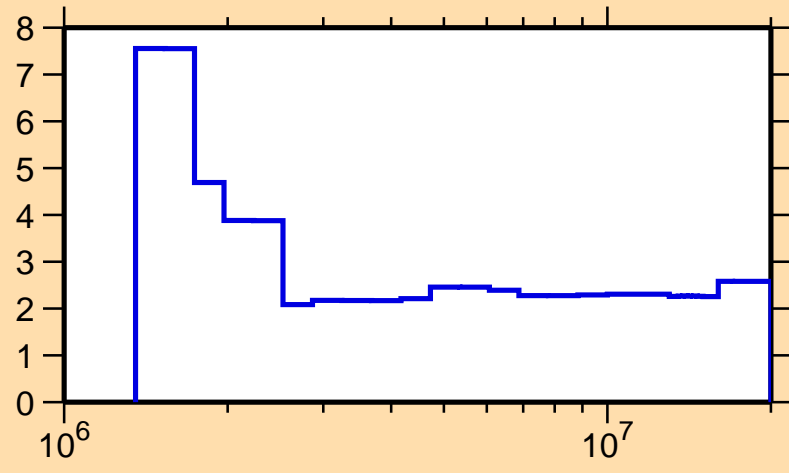

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n\text{cont.})$

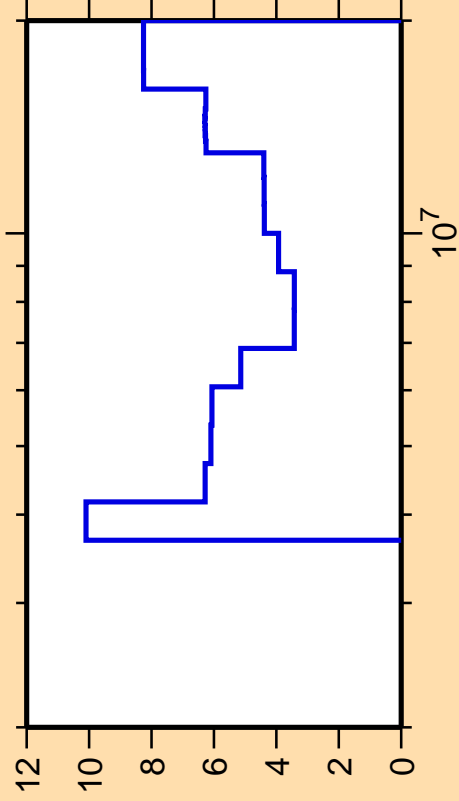

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

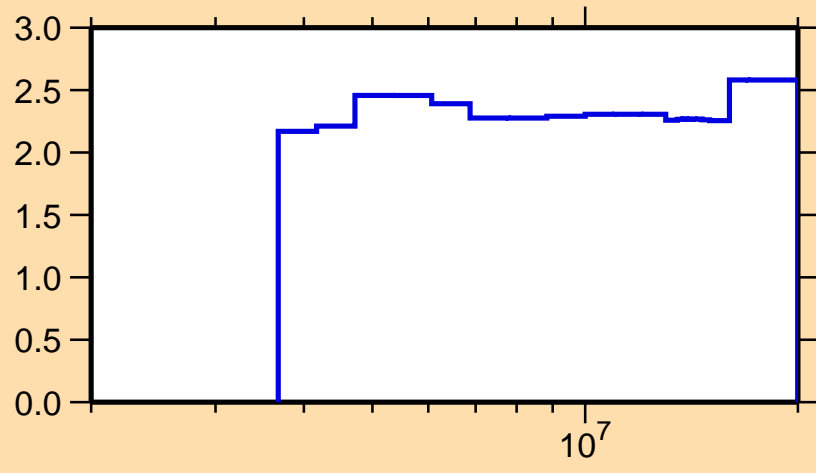

Correlation Matrix




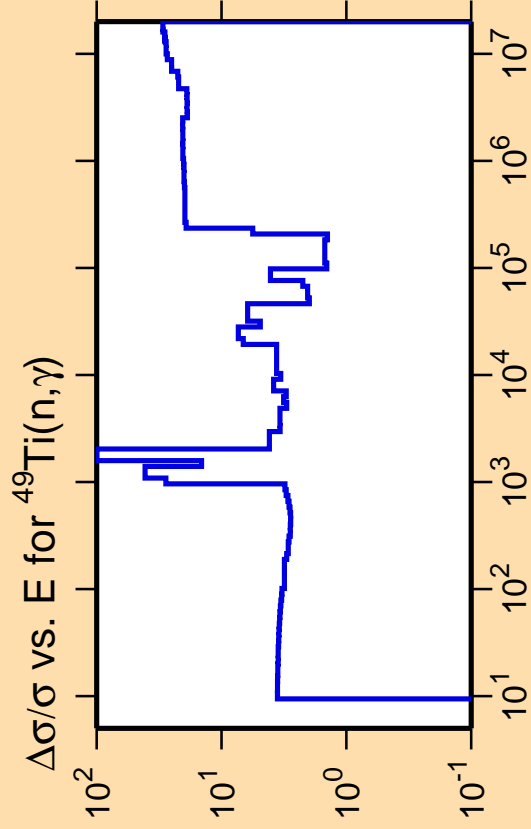


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

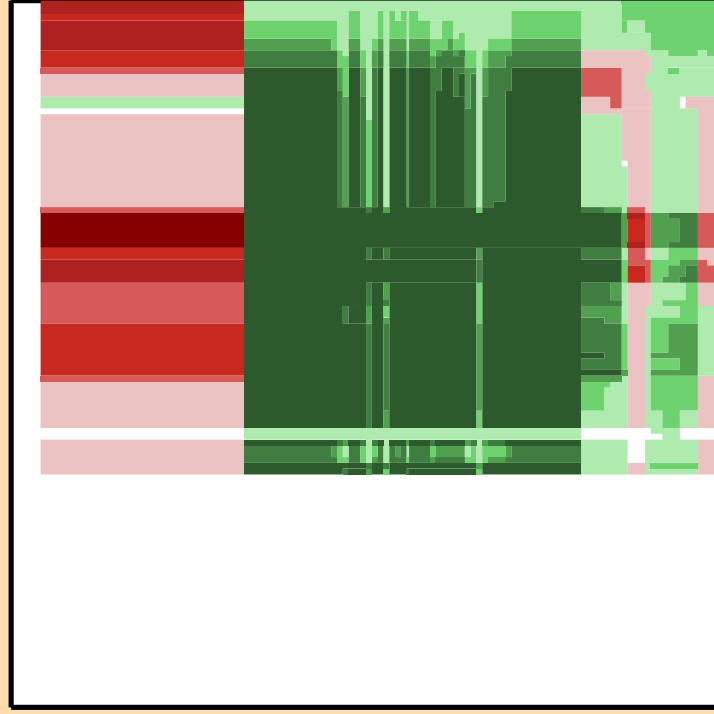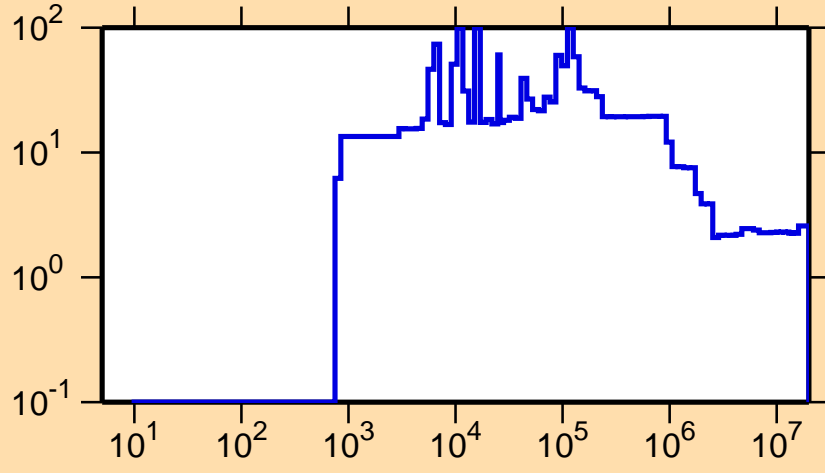

Correlation Matrix





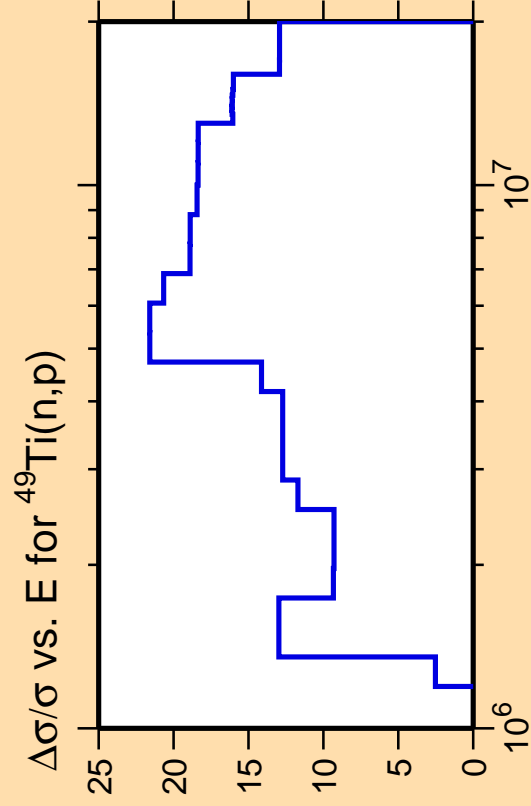

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

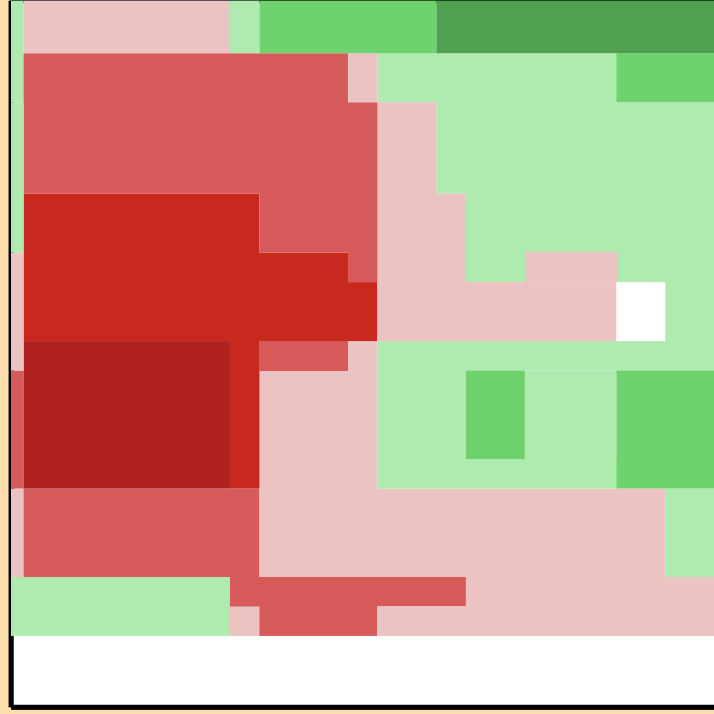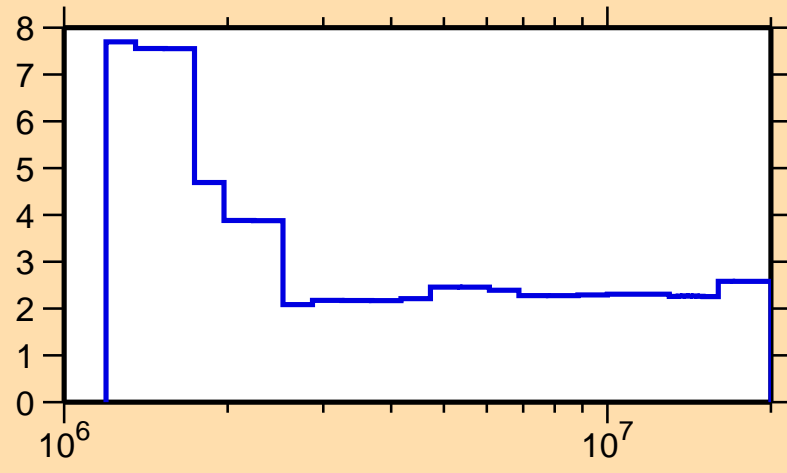

Correlation Matrix





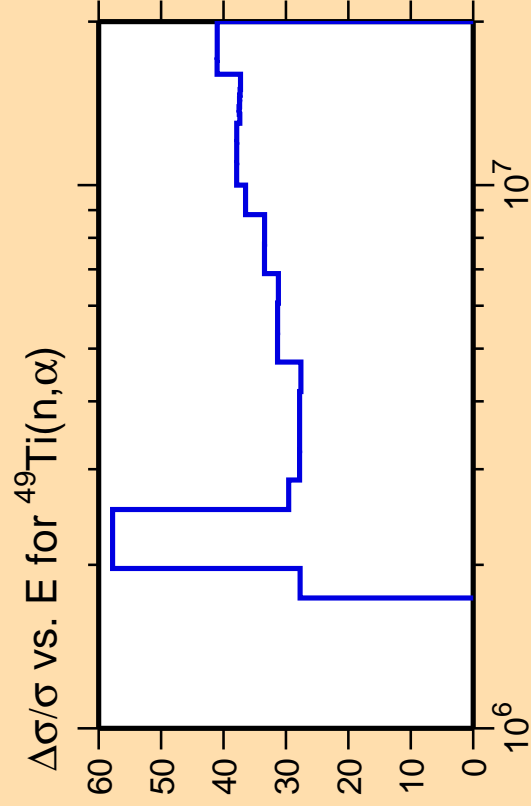

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nonel.})$

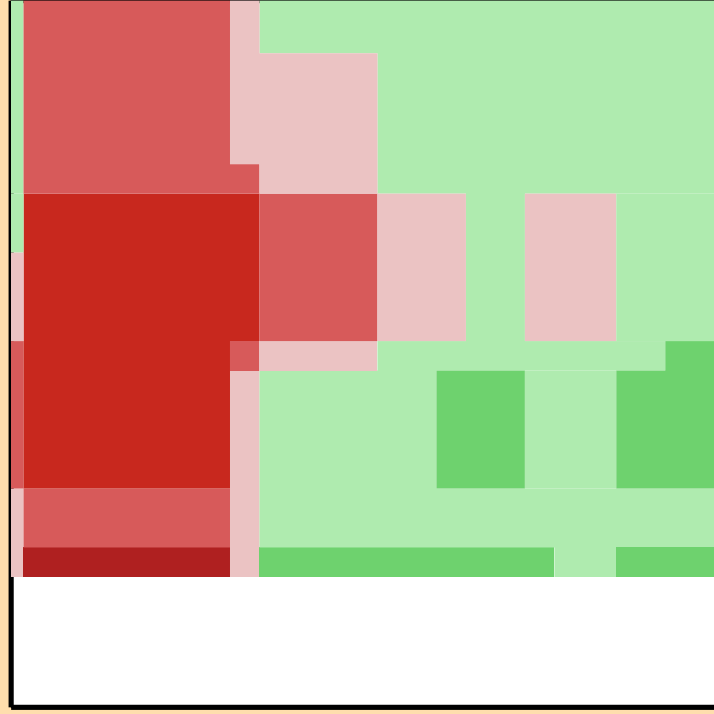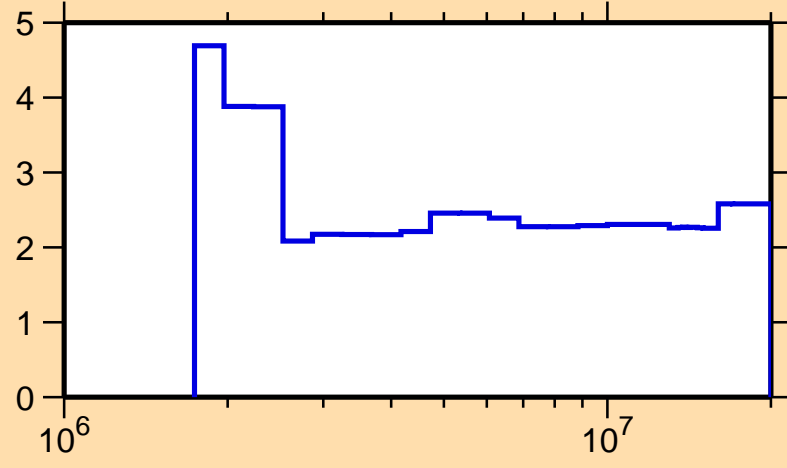

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{inel.})$

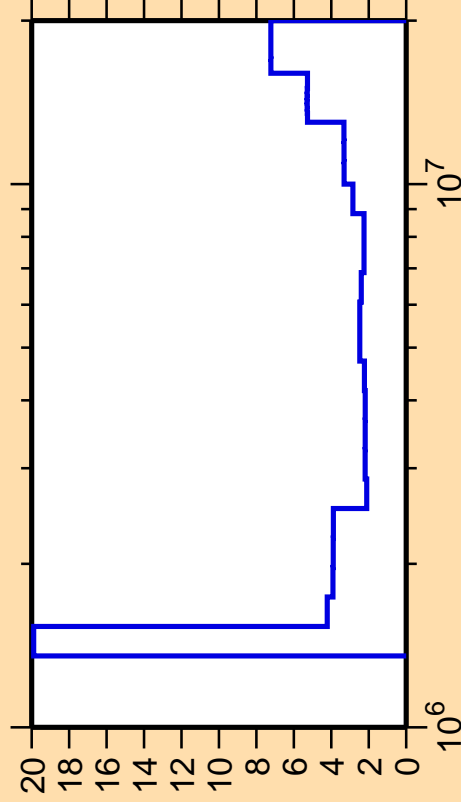

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{49}\text{Ti}(n,\text{inel.})$

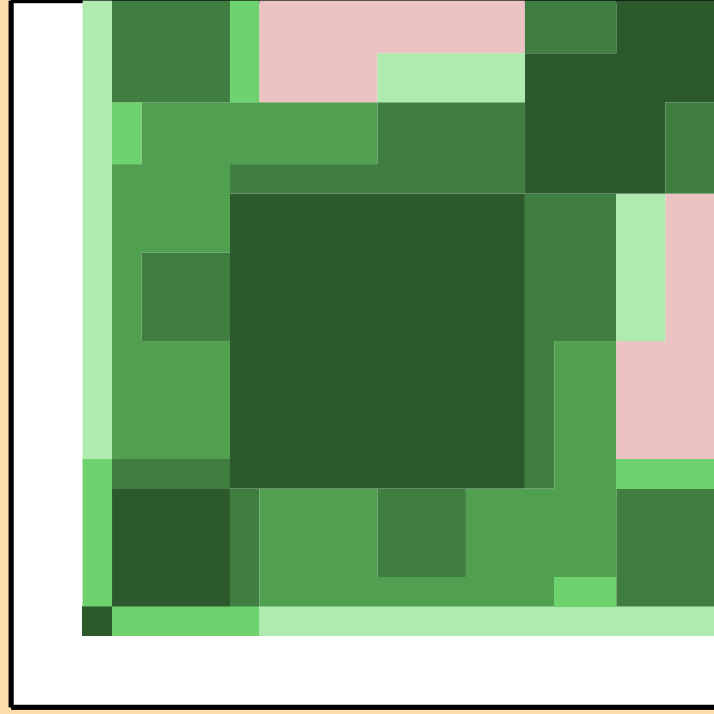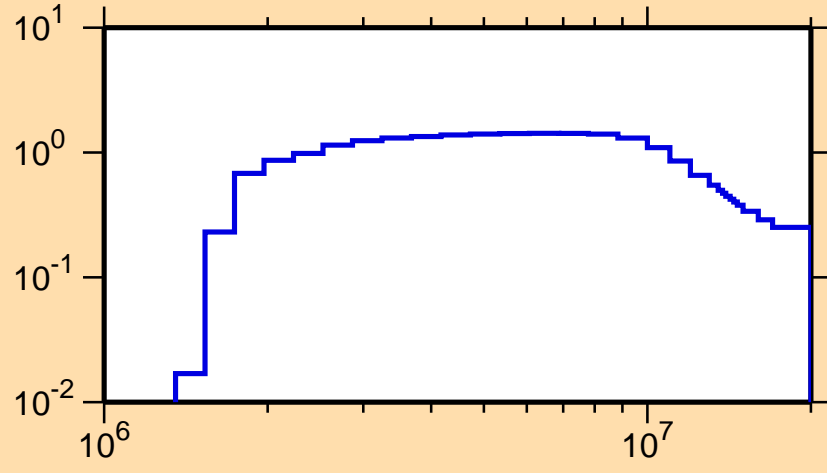

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,2n)$

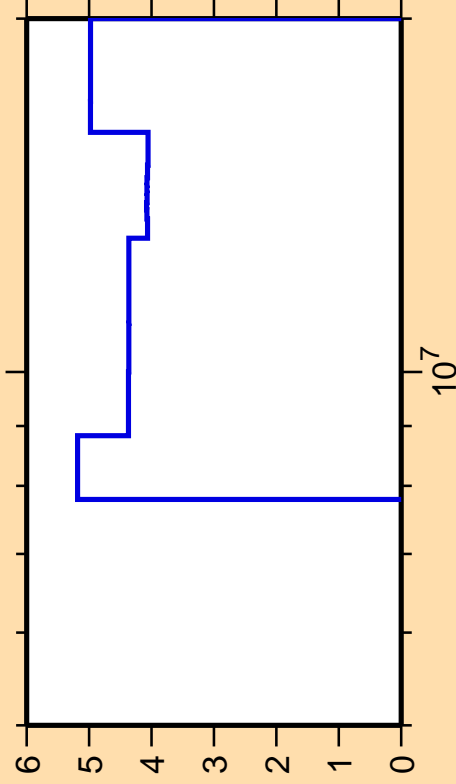

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{inel.})$

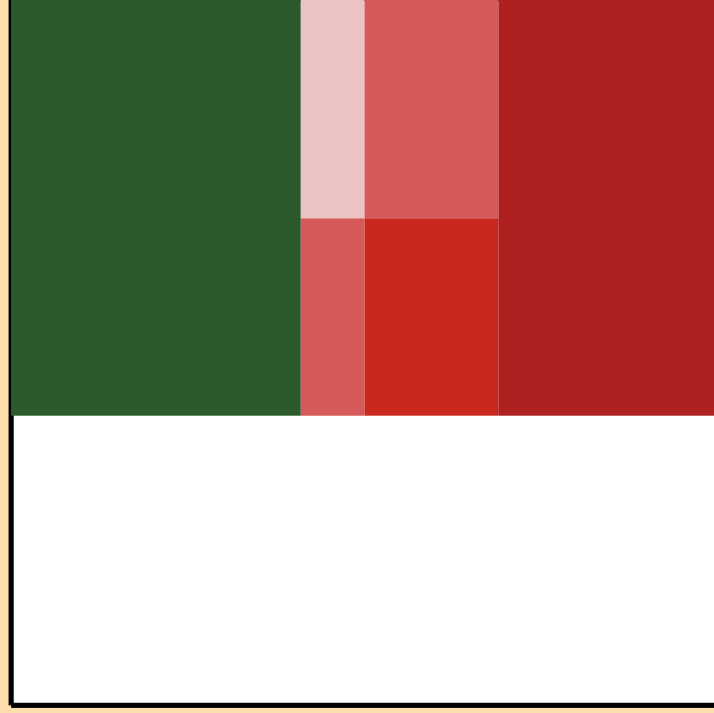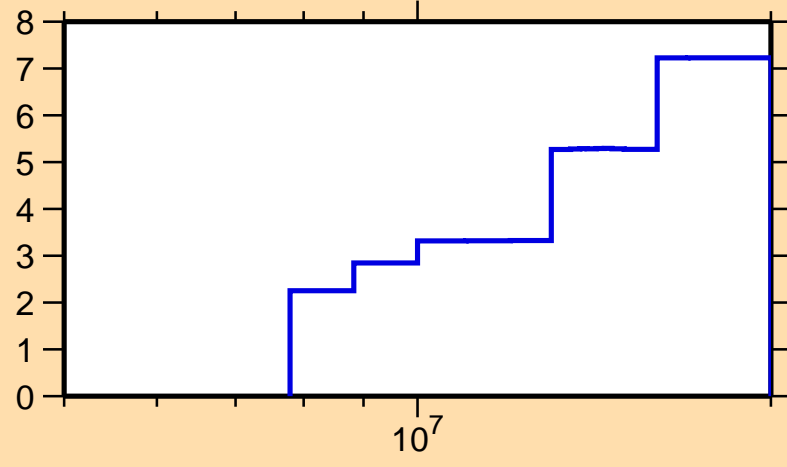



Correlation Matrix



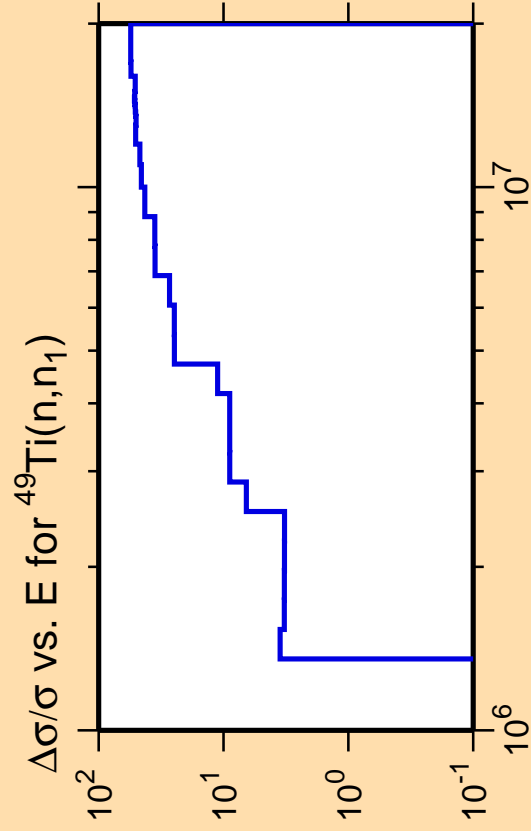

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

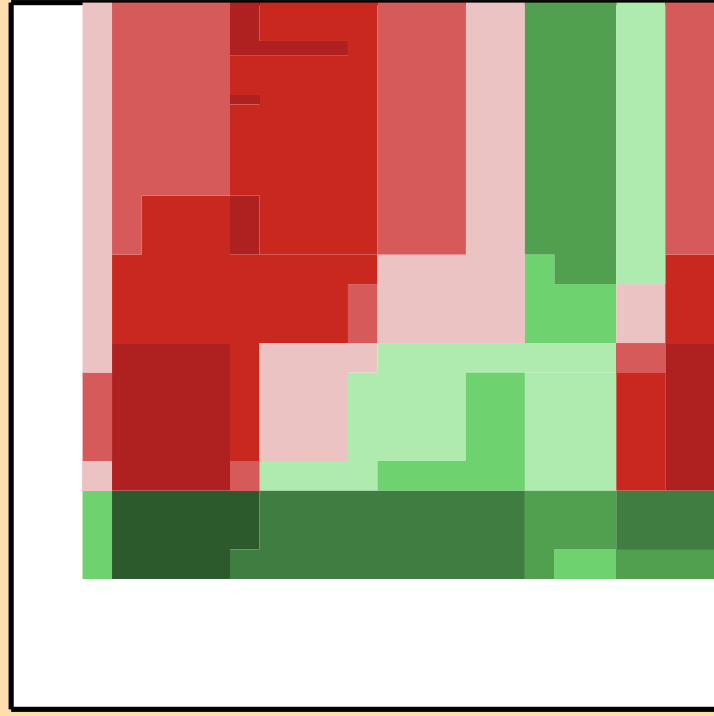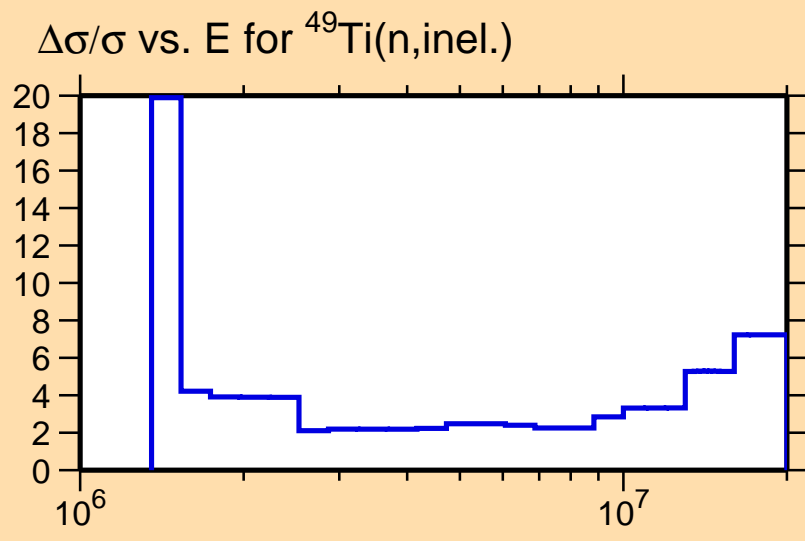

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{ncont.})$

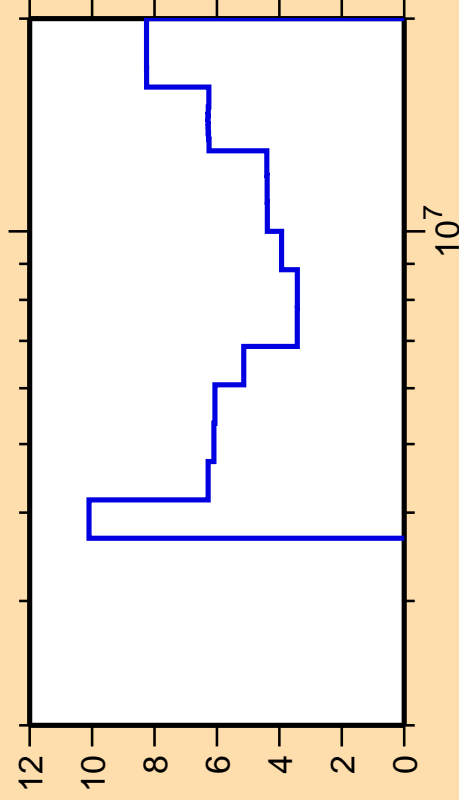

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{inel.})$

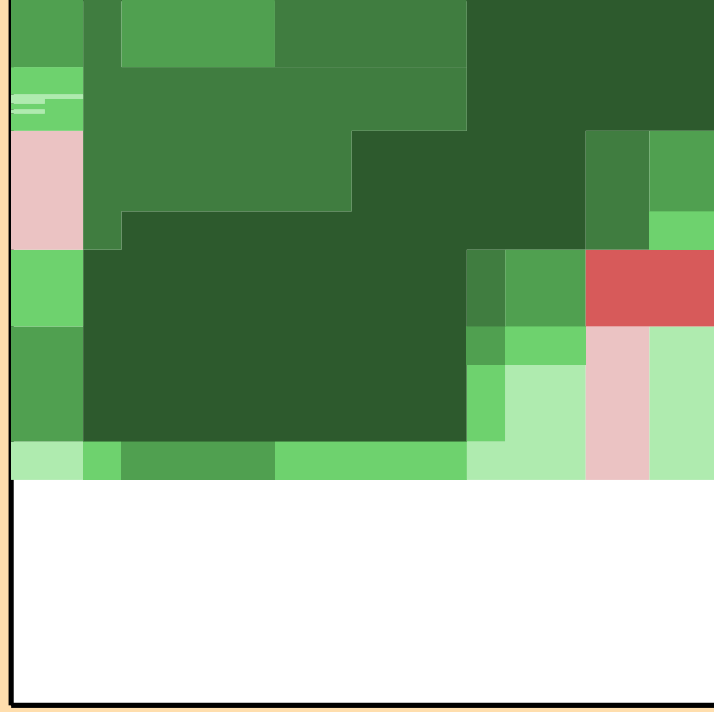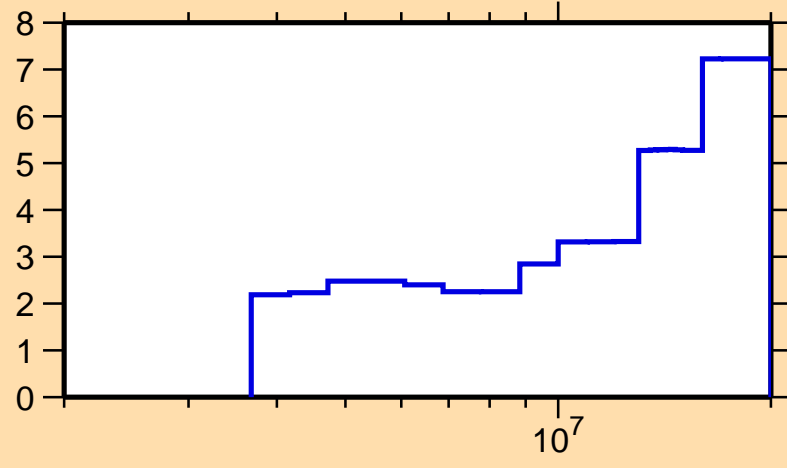



Correlation Matrix



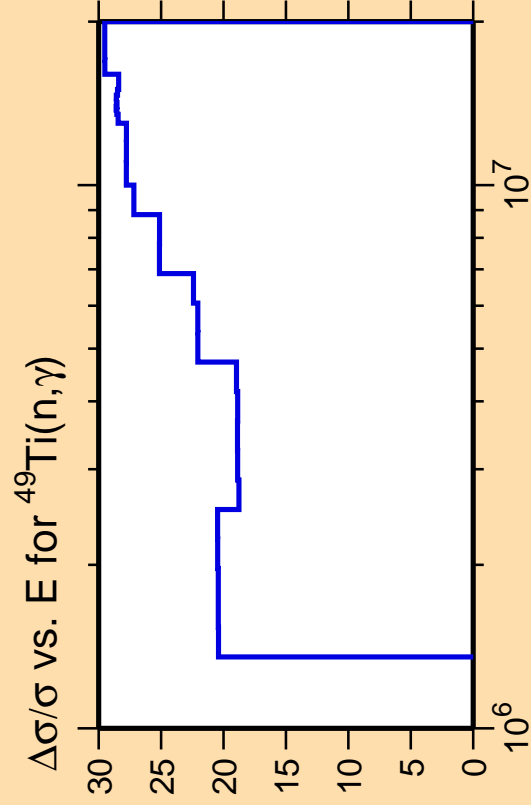


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

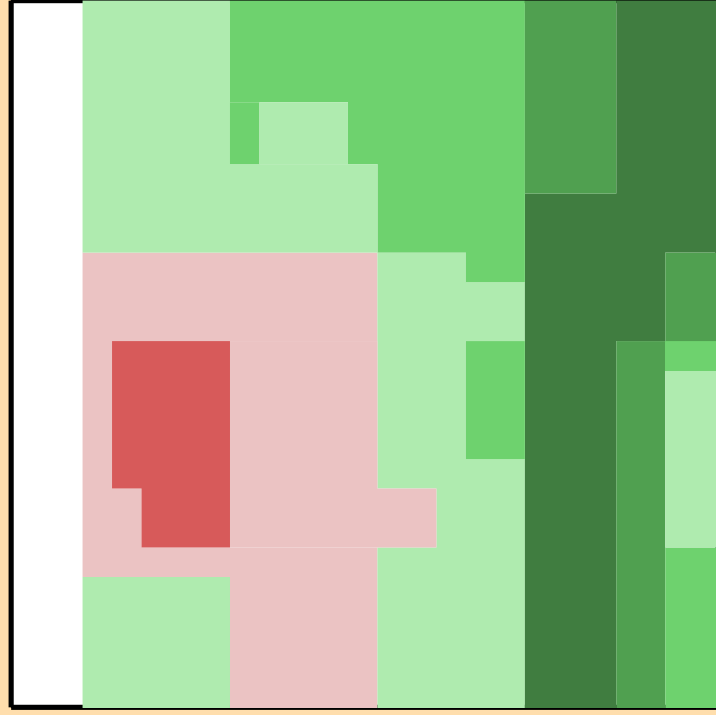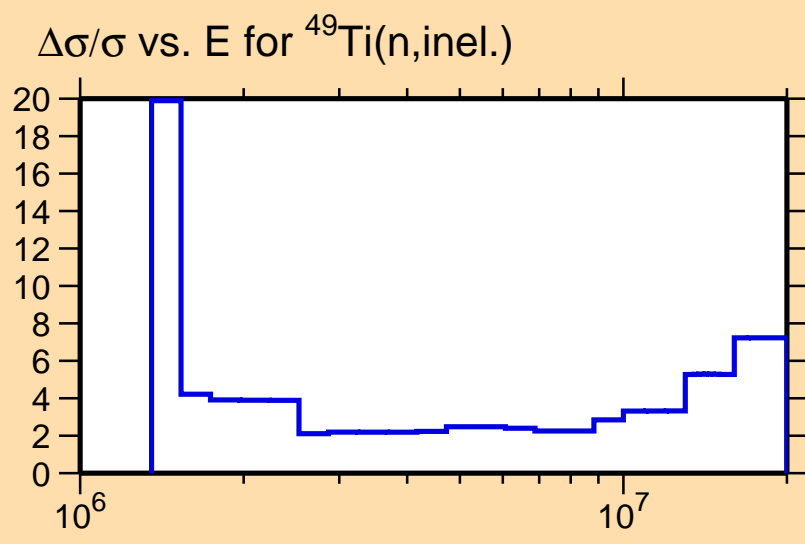

Correlation Matrix





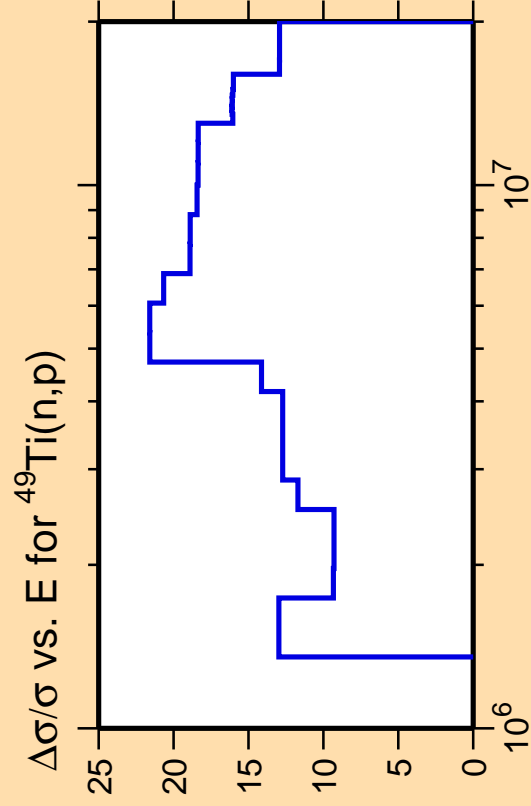

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{inel.})$

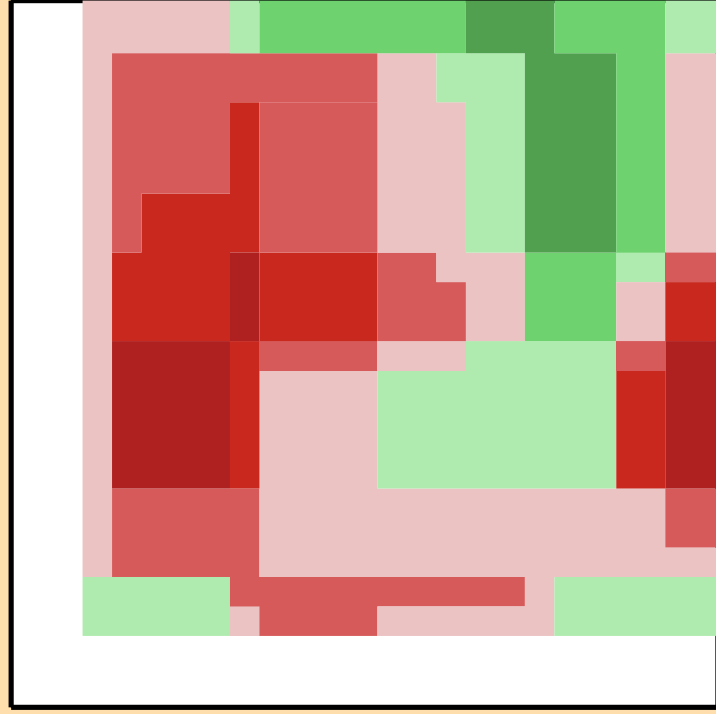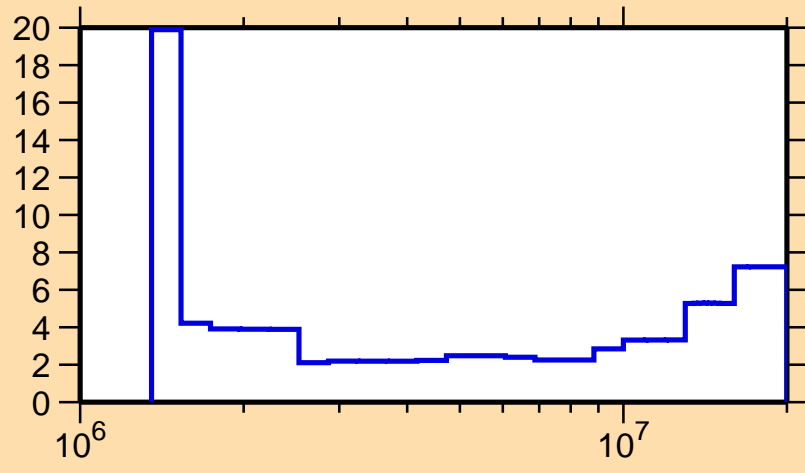

Correlation Matrix





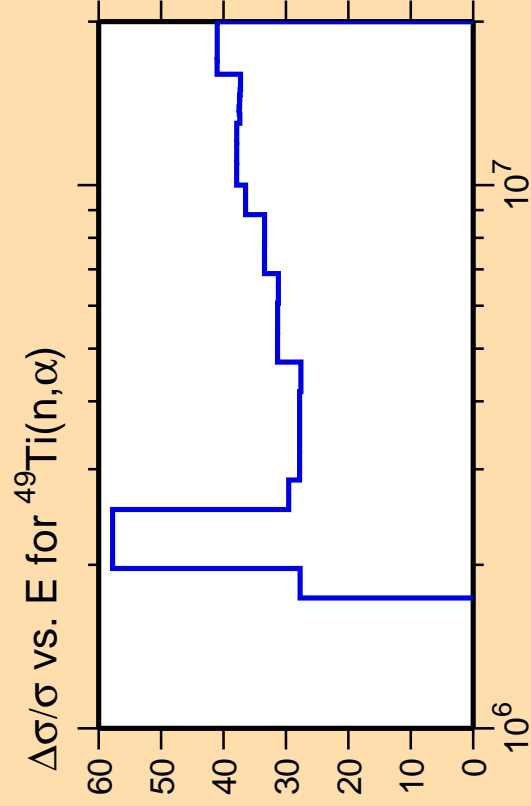

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{inel.})$

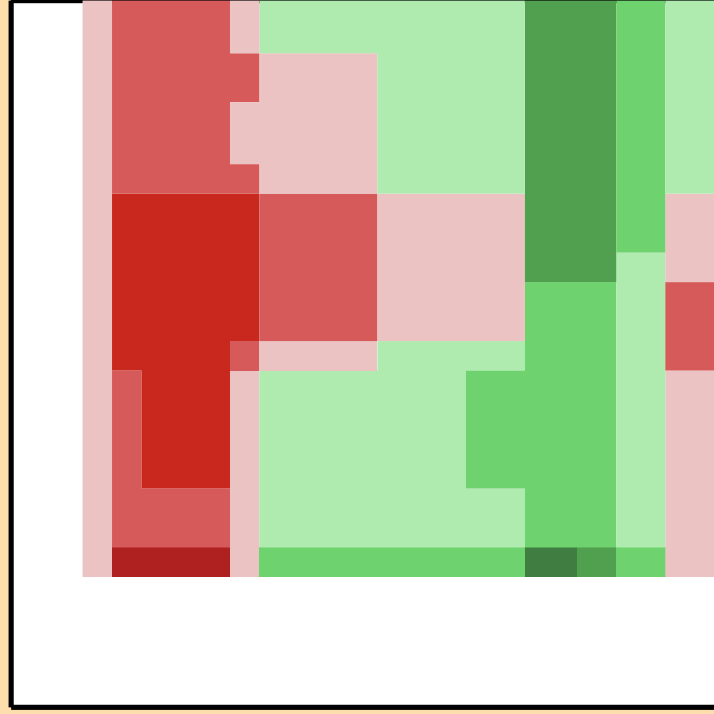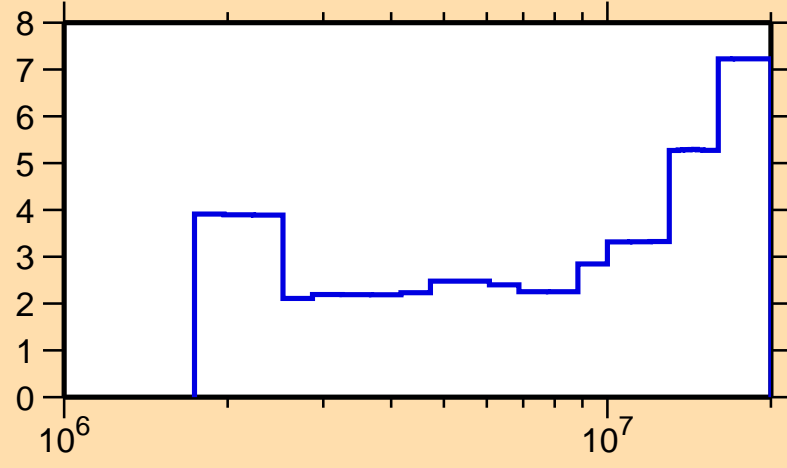

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,2n)$

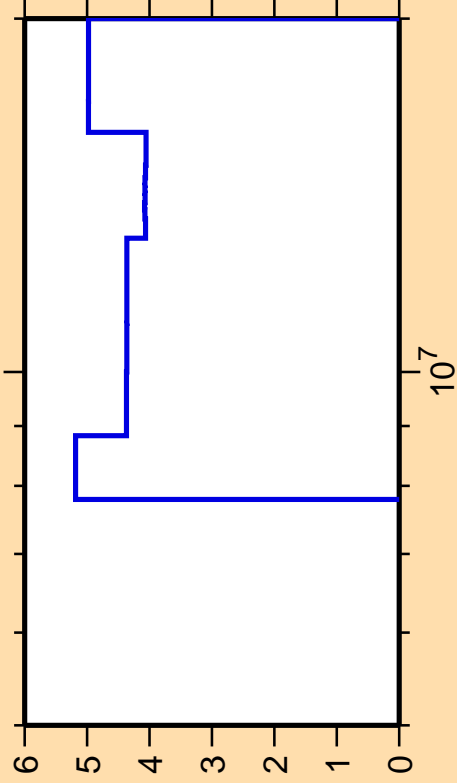

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{49}\text{Ti}(n,2n)$

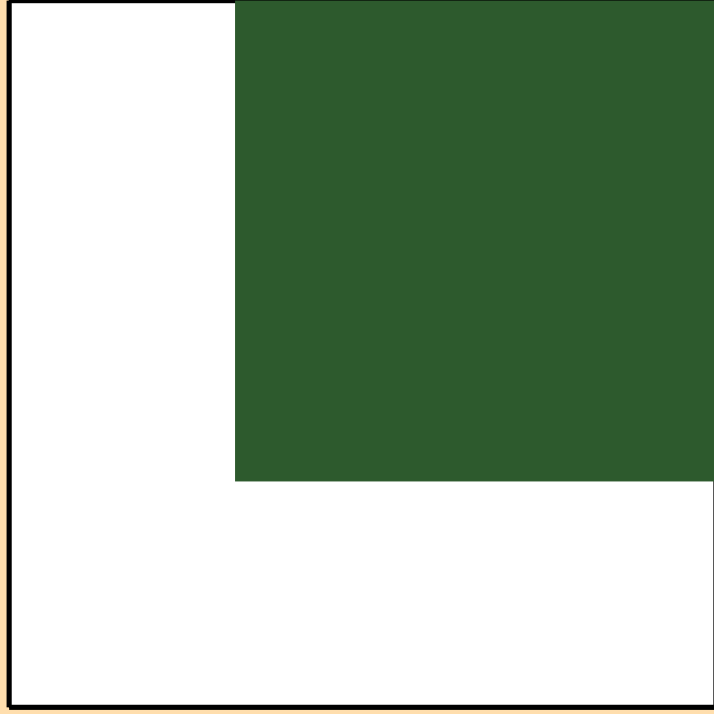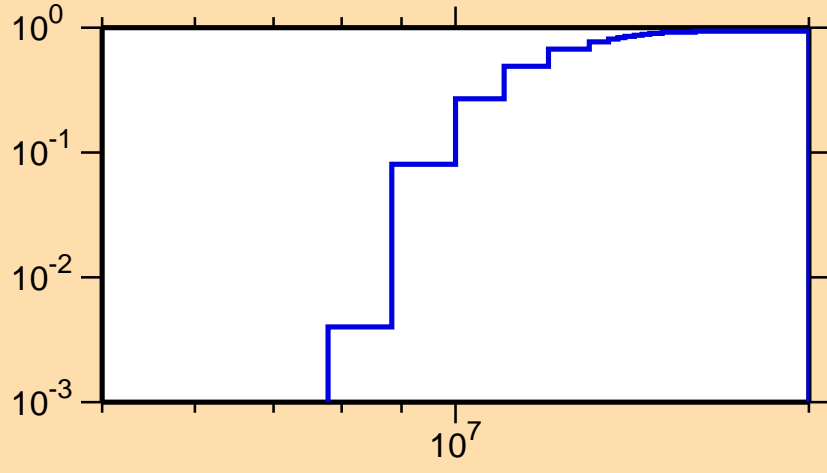

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n\alpha)$


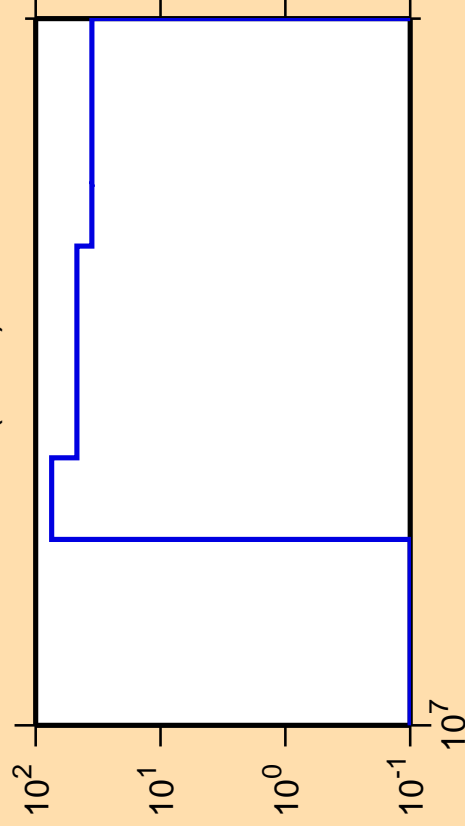


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{49}\text{Ti}(n,n\alpha)$

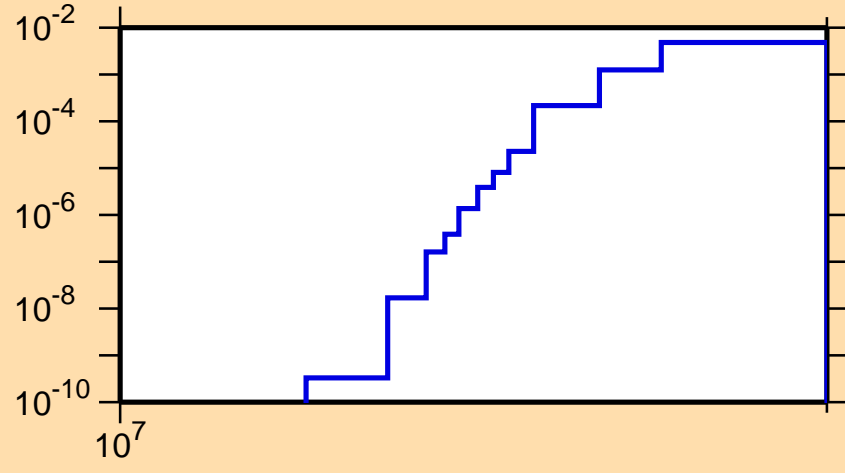

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,np)$

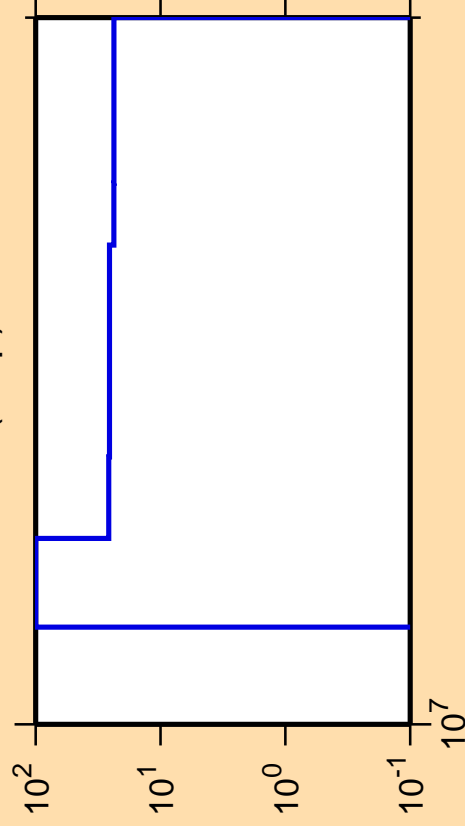


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{49}\text{Ti}(n,np)$

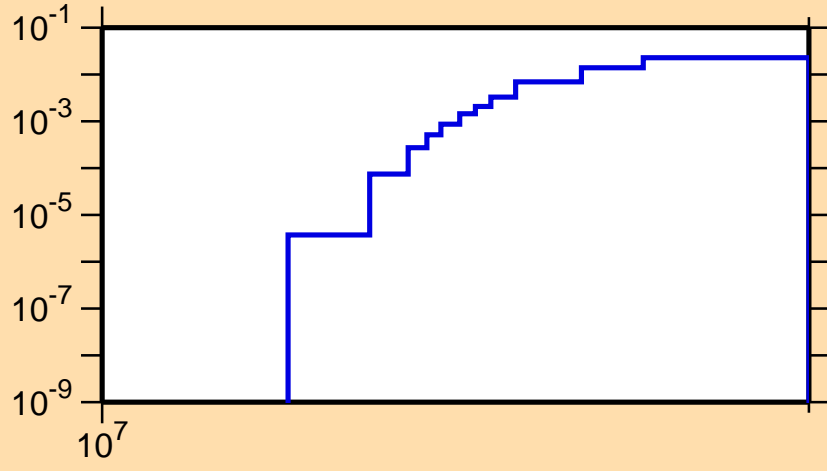

10^7

10^{-1}


10^{-9}

10^{-7}


10^{-5}

10^{-3}

Correlation Matrix

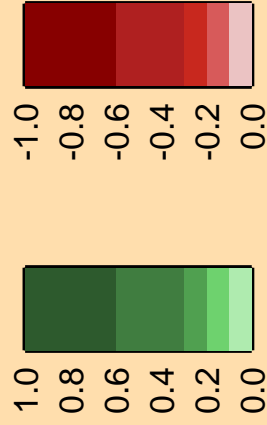


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{nd})$

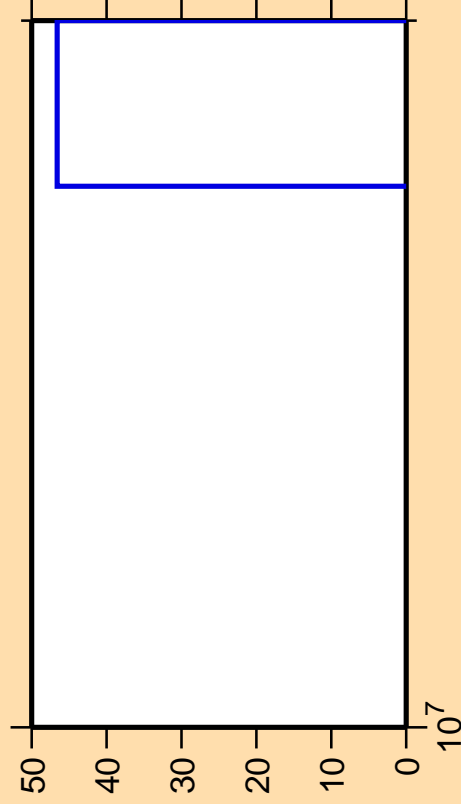

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{49}\text{Ti}(n,\text{nd})$

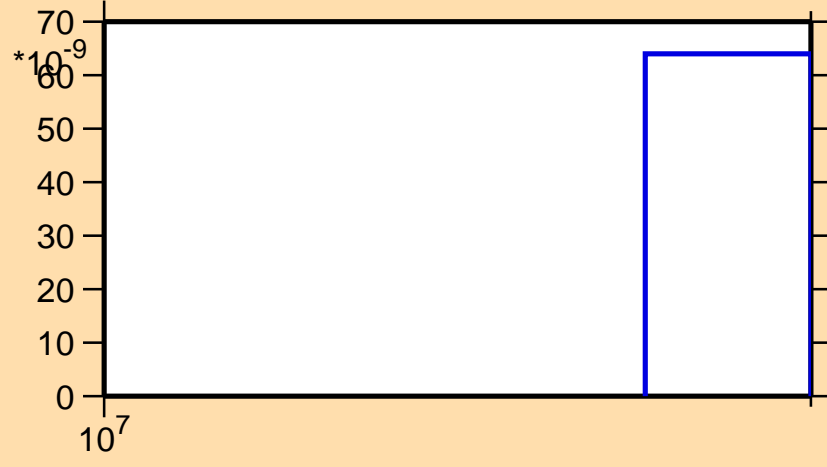


10^7

10^{-9}

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,2np)$

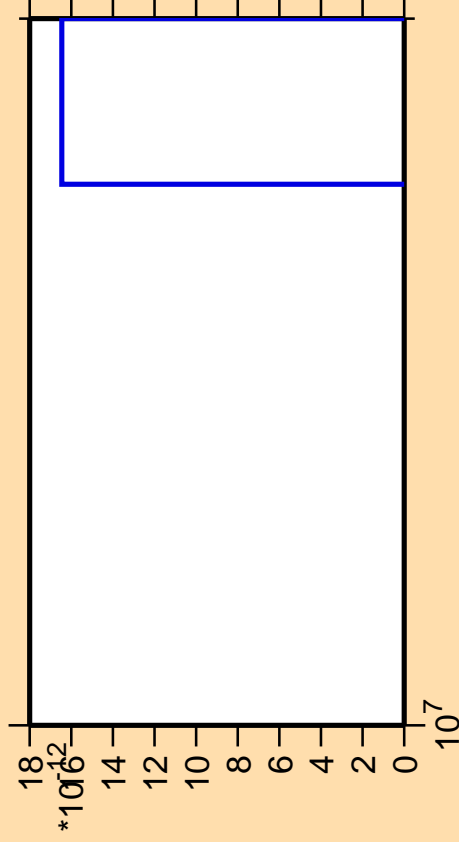

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{49}\text{Ti}(n,2np)$

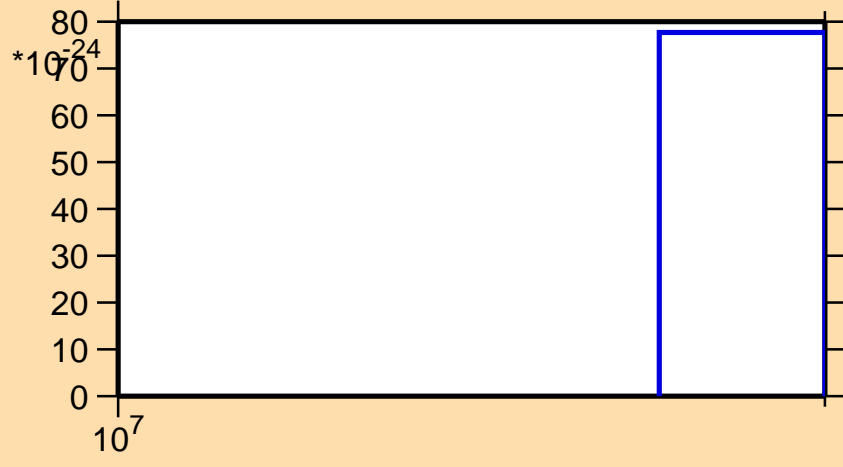



Correlation Matrix



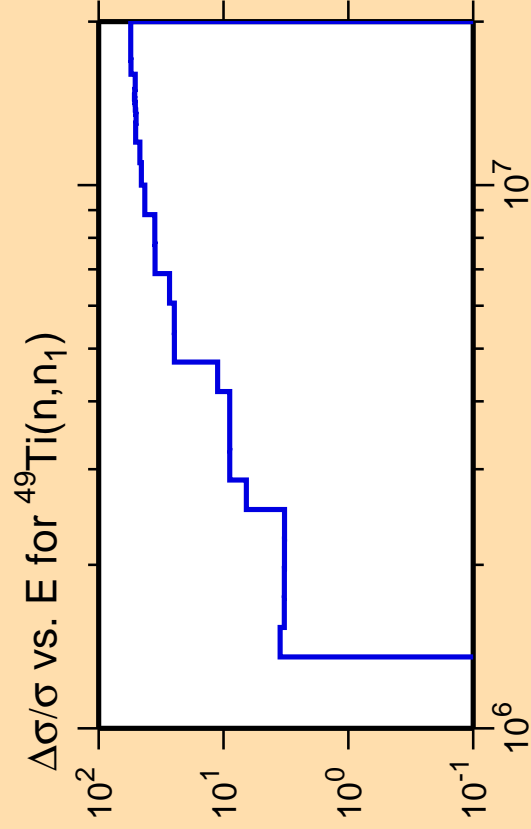

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

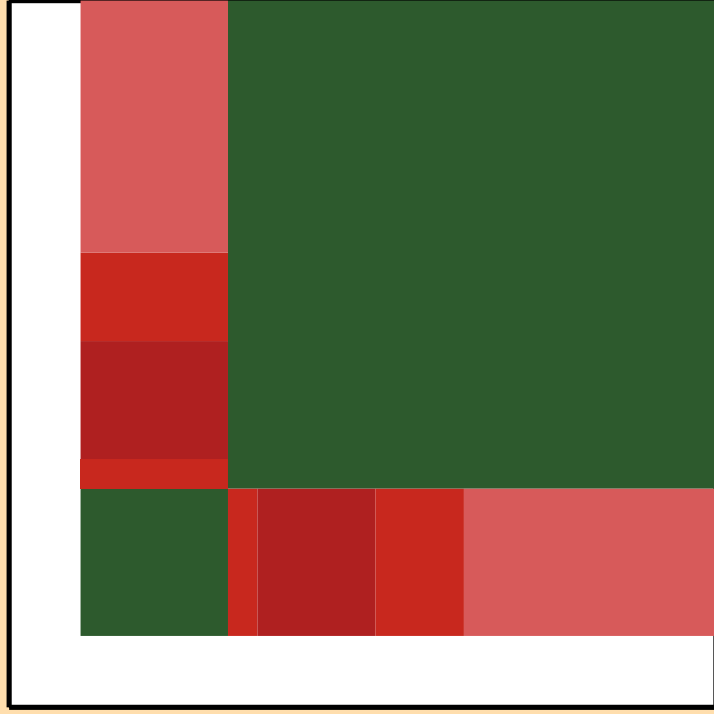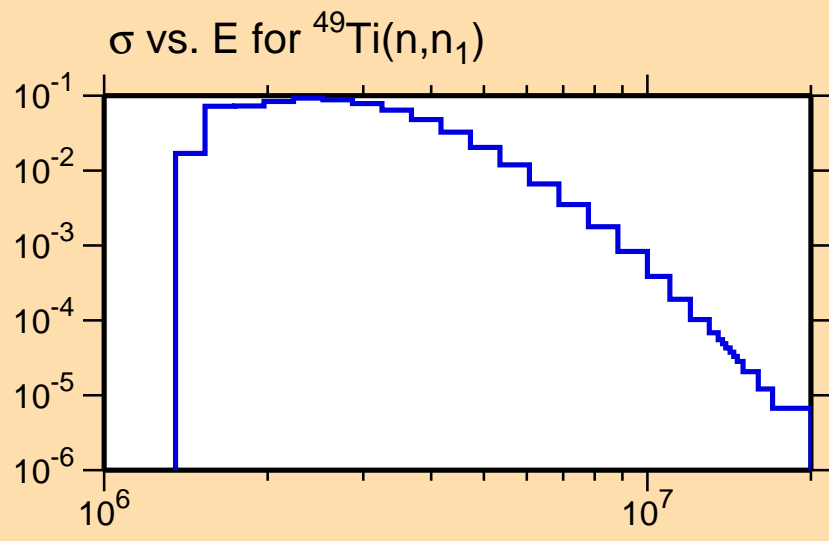

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n_{\text{cont}})$

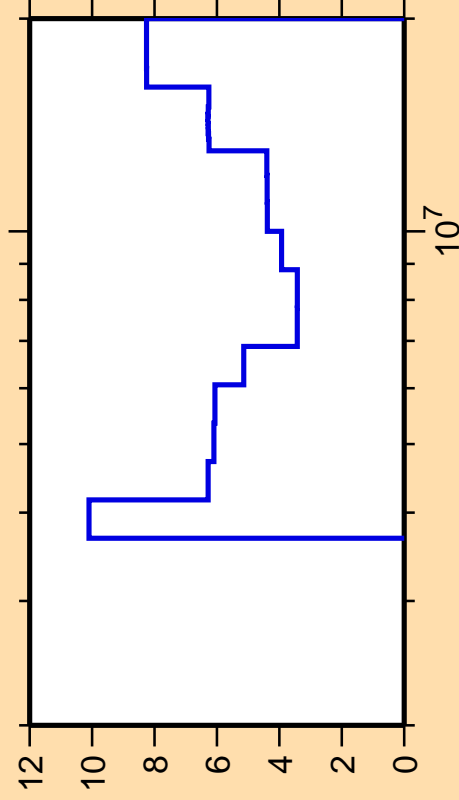

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n_1)$

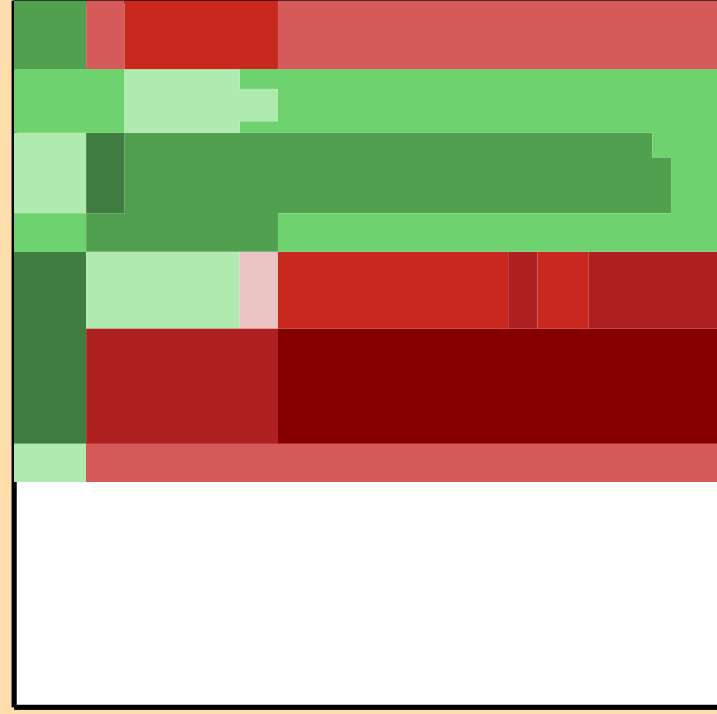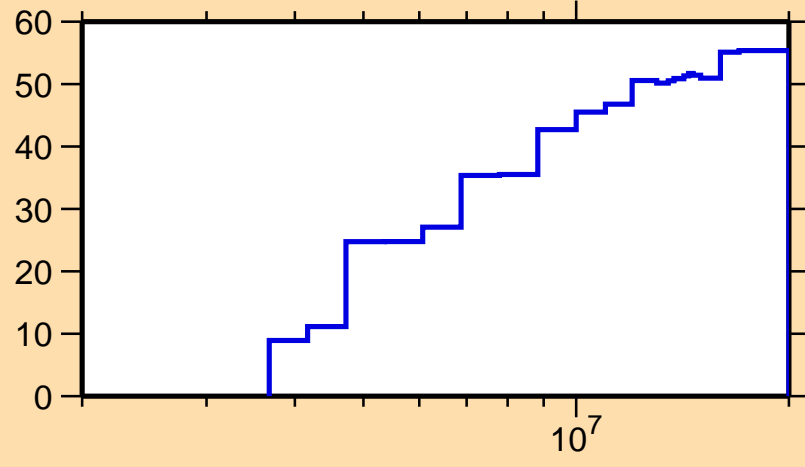

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\gamma)$

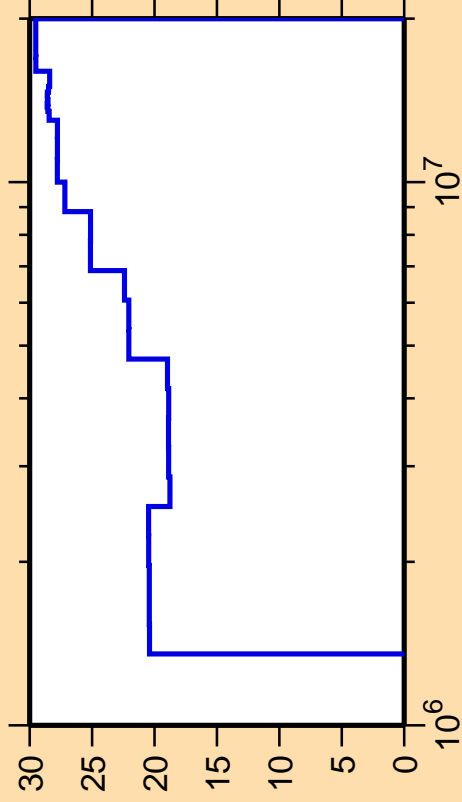

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n_1)$

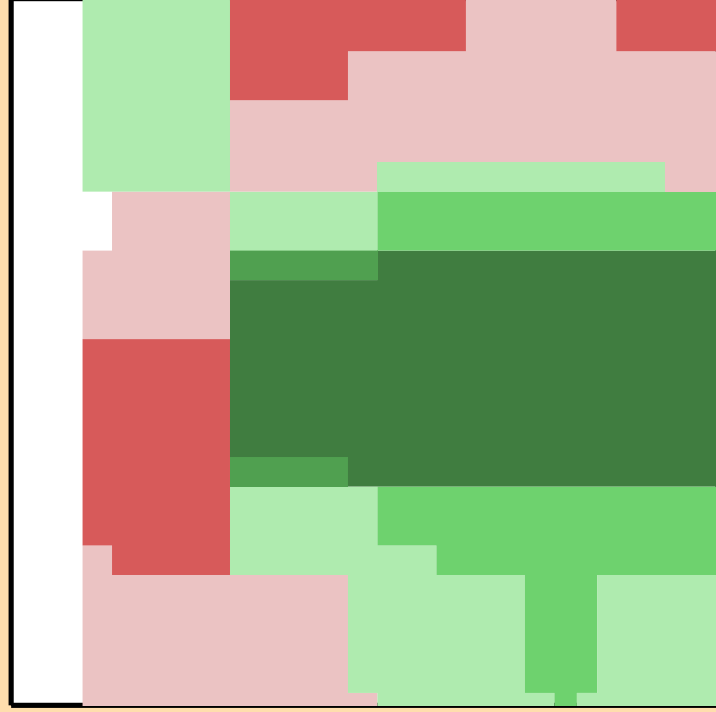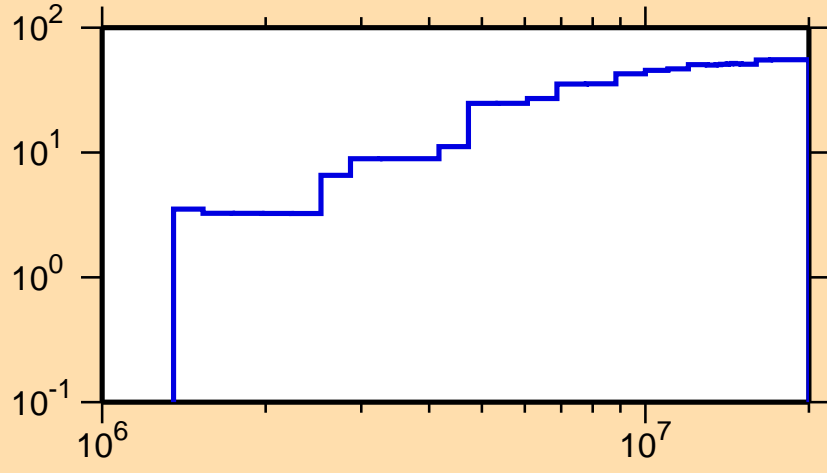



Correlation Matrix



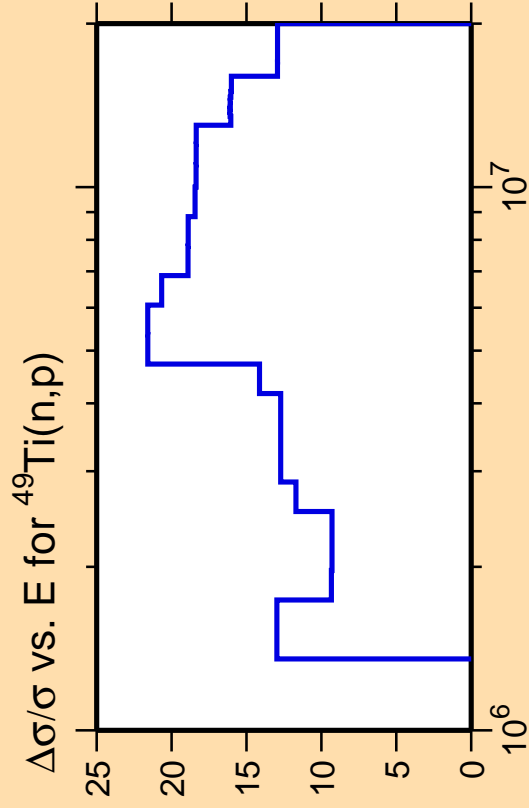


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

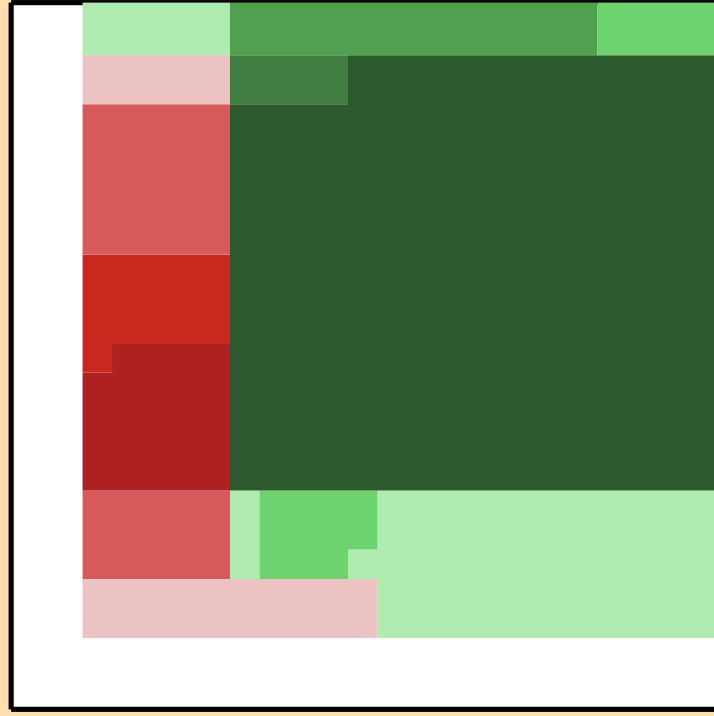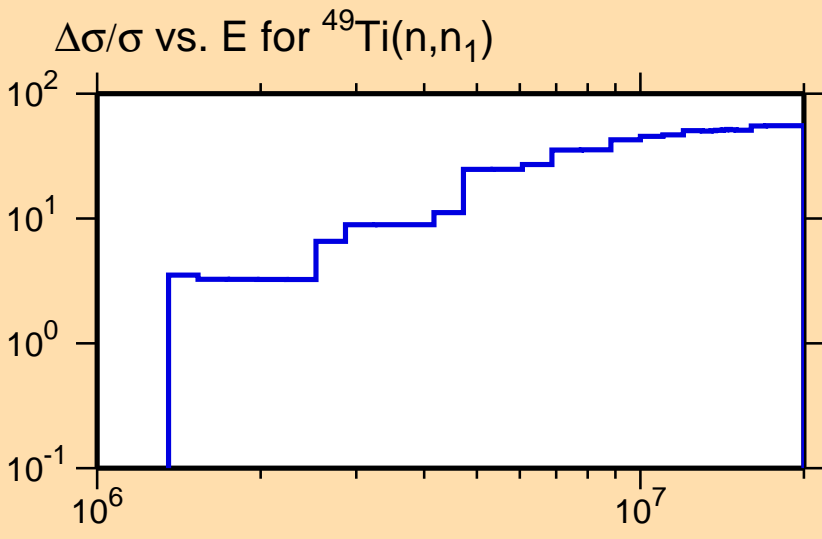



Correlation Matrix



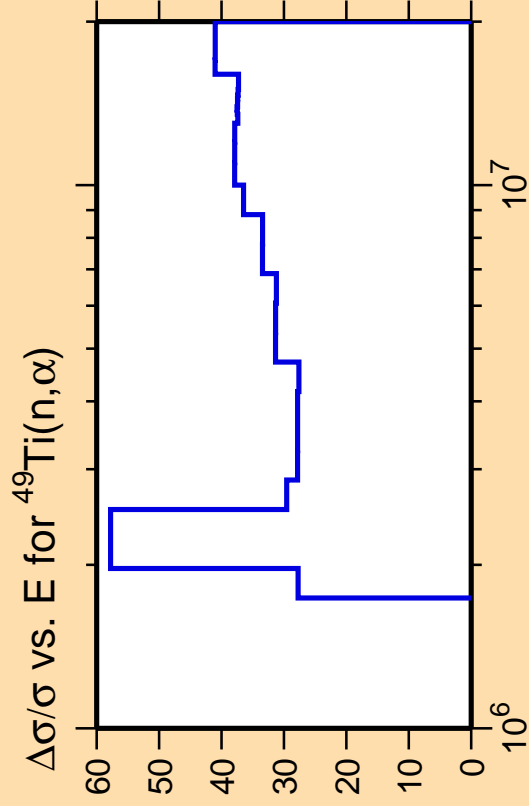


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

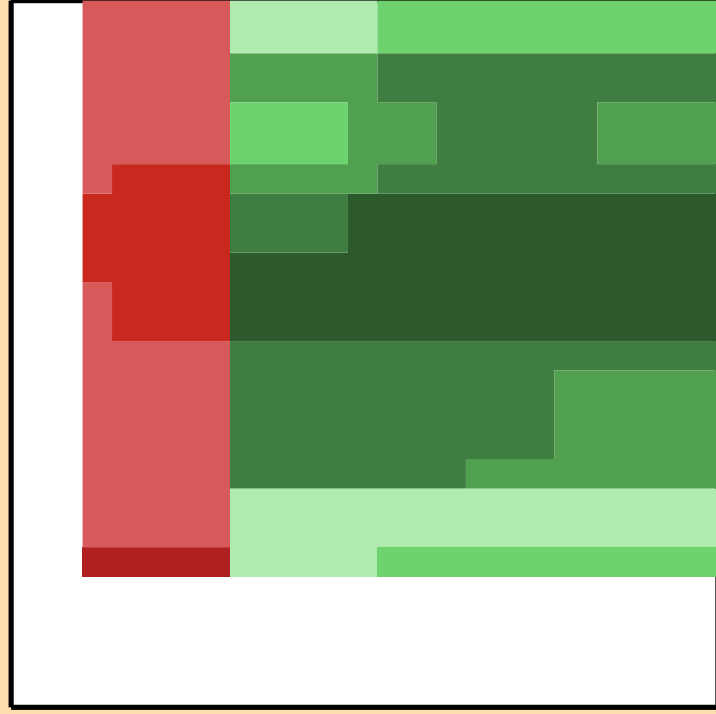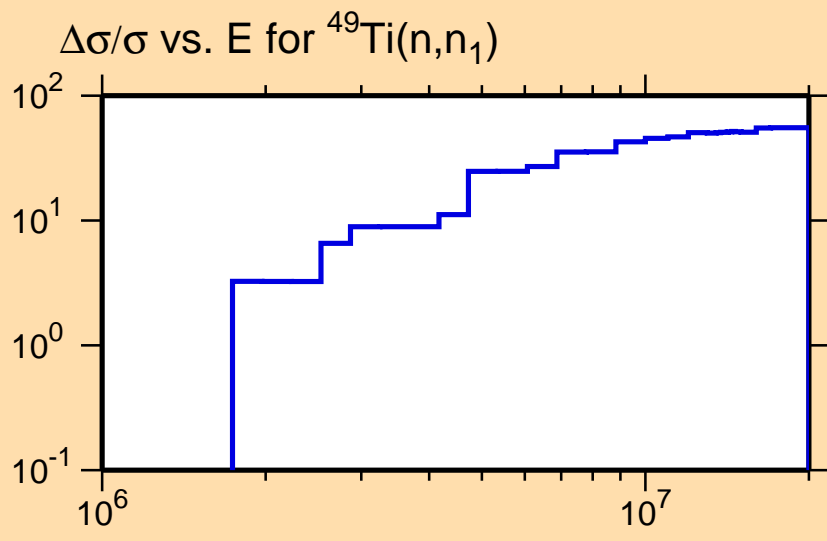



Correlation Matrix



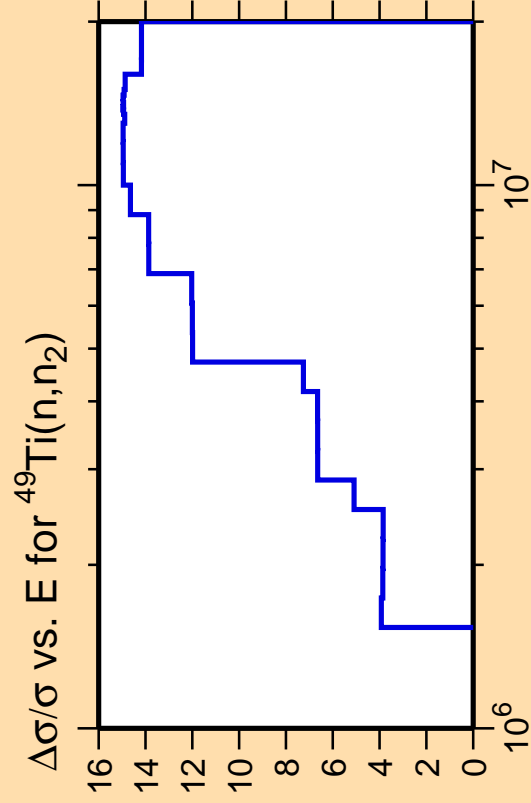

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

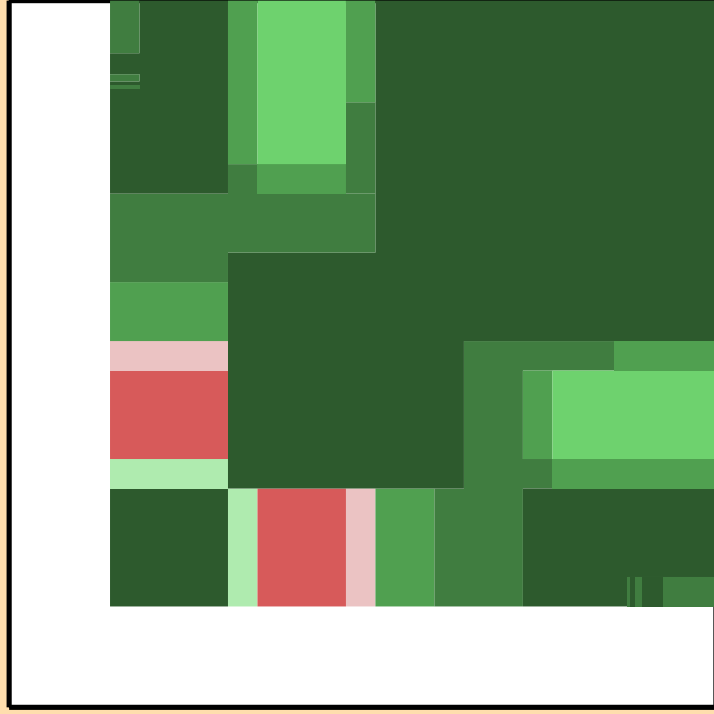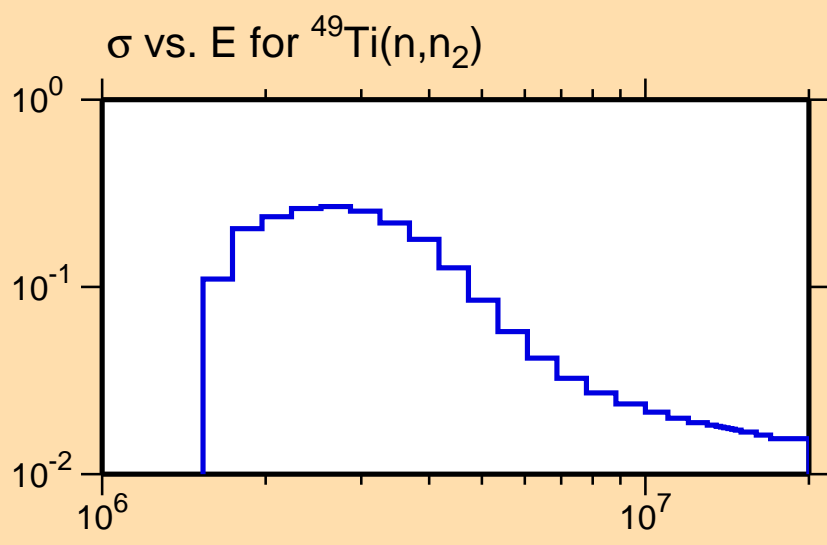

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n_3)$

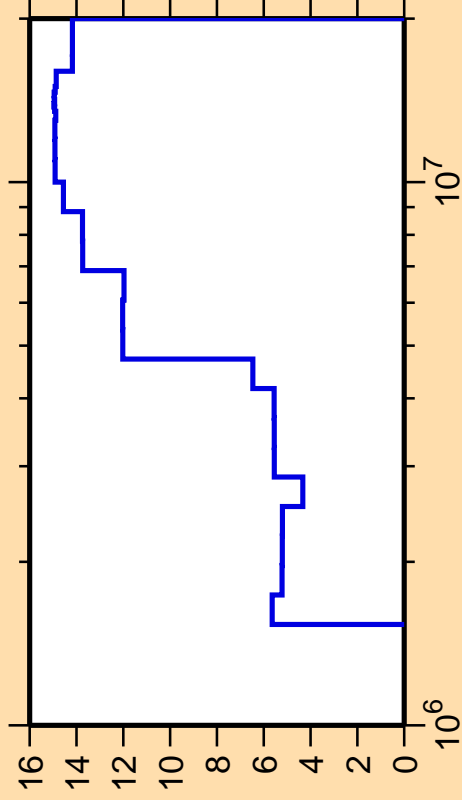

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{49}\text{Ti}(n,n_3)$

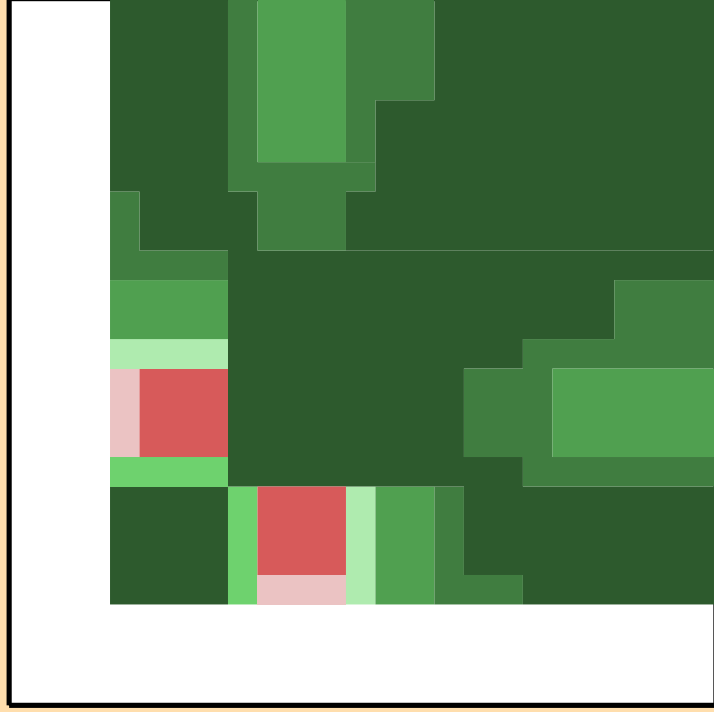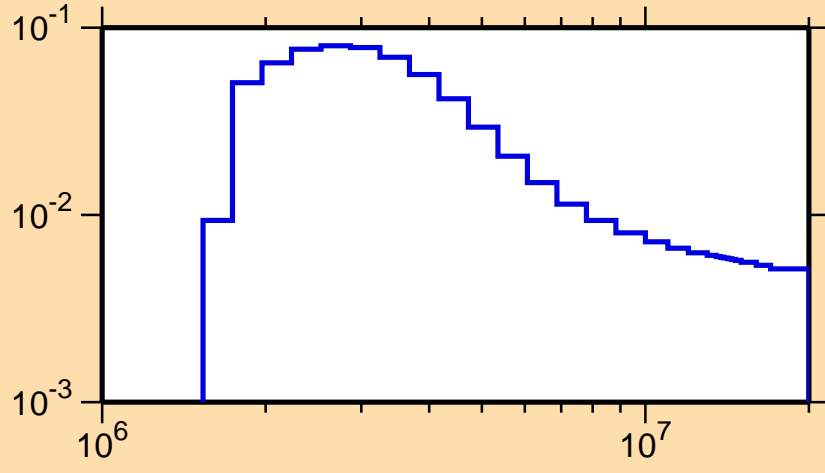



Correlation Matrix



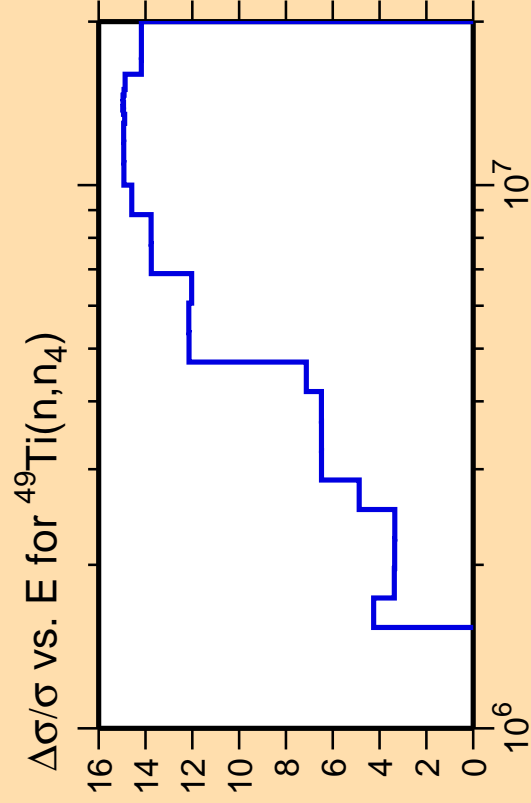

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

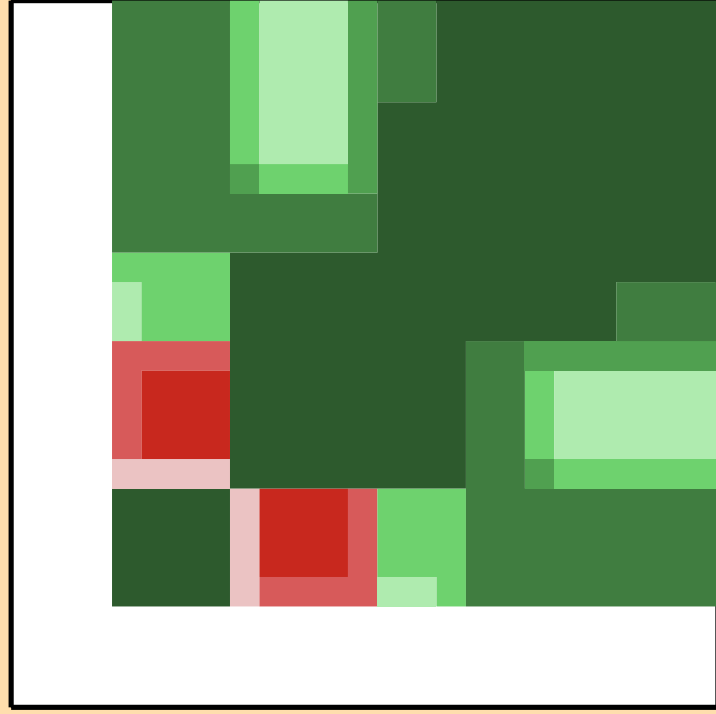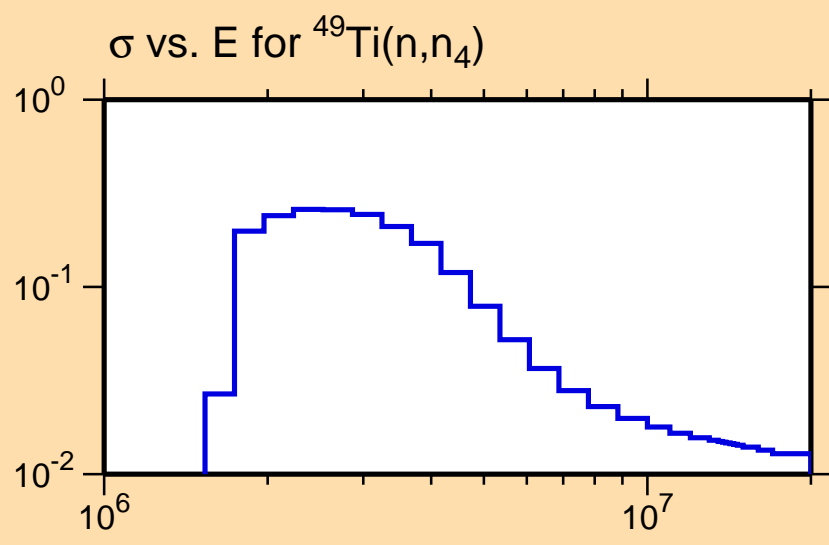

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n\text{cont.})$

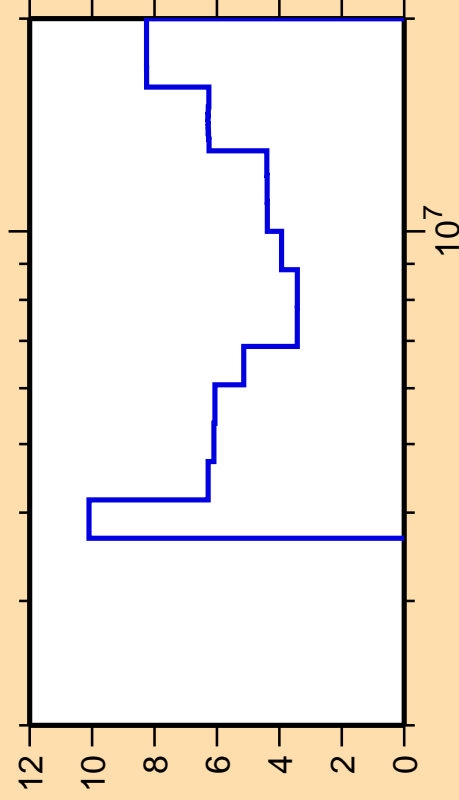

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{49}\text{Ti}(n,n\text{cont.})$

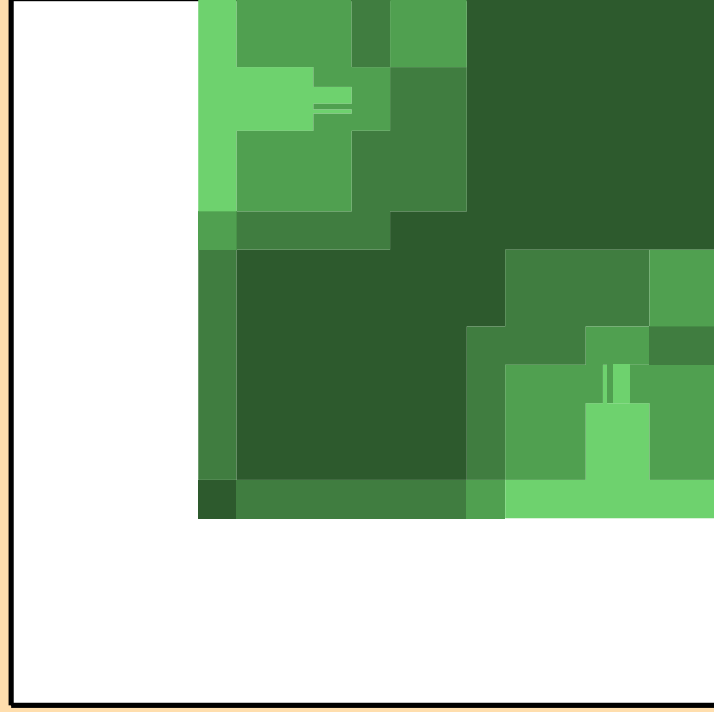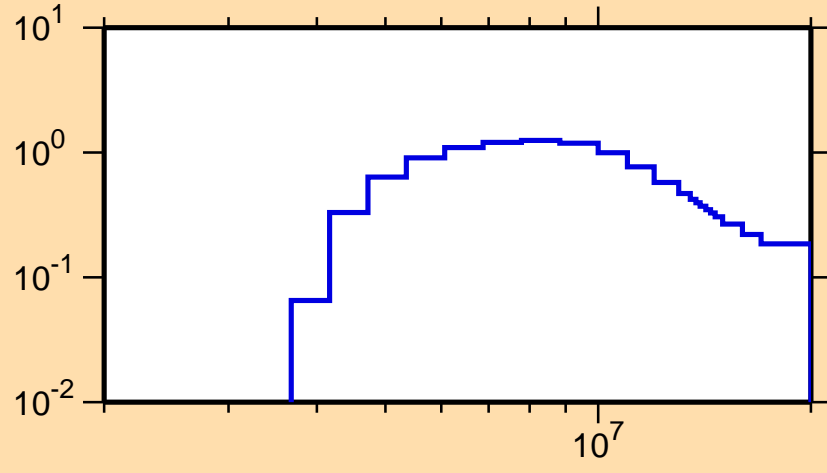

Correlation Matrix





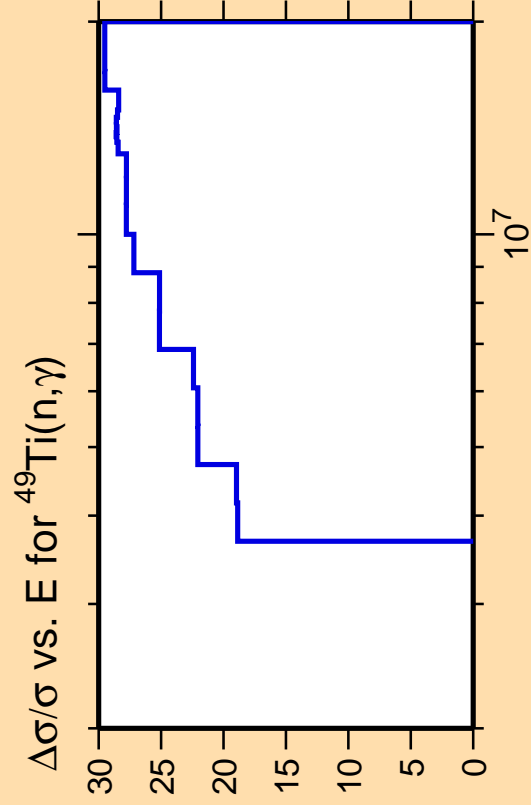

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n\text{cont.})$

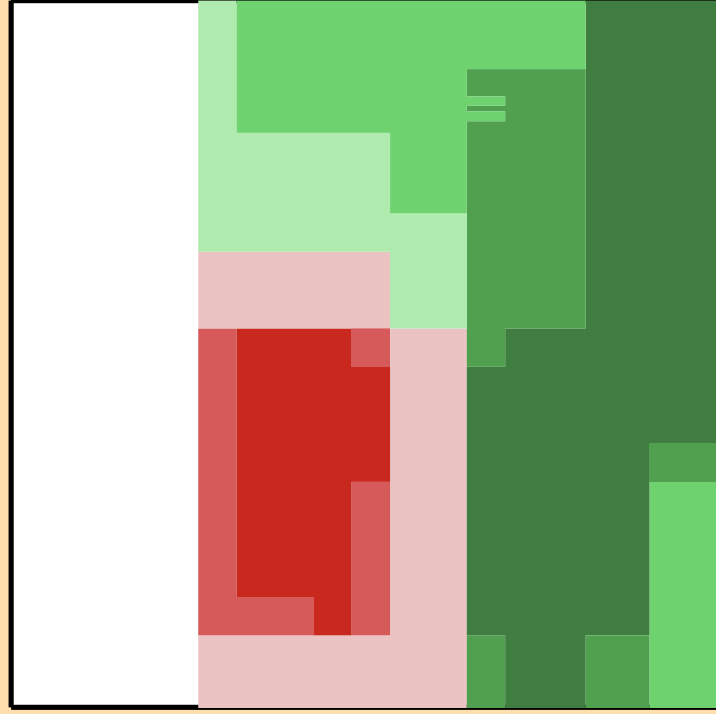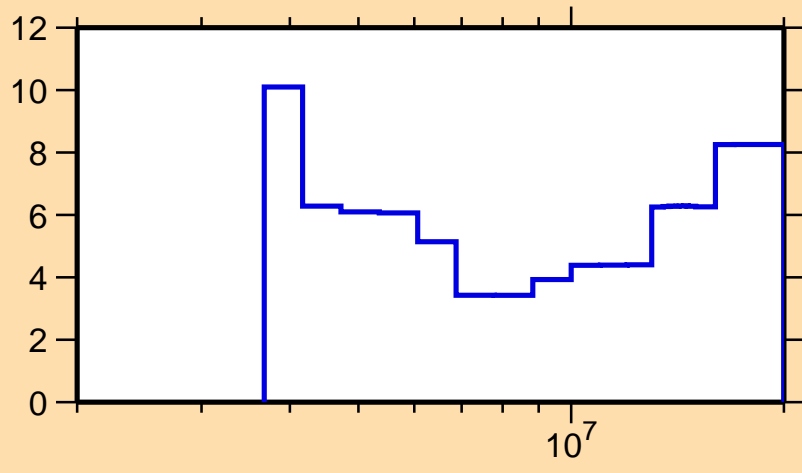



Correlation Matrix



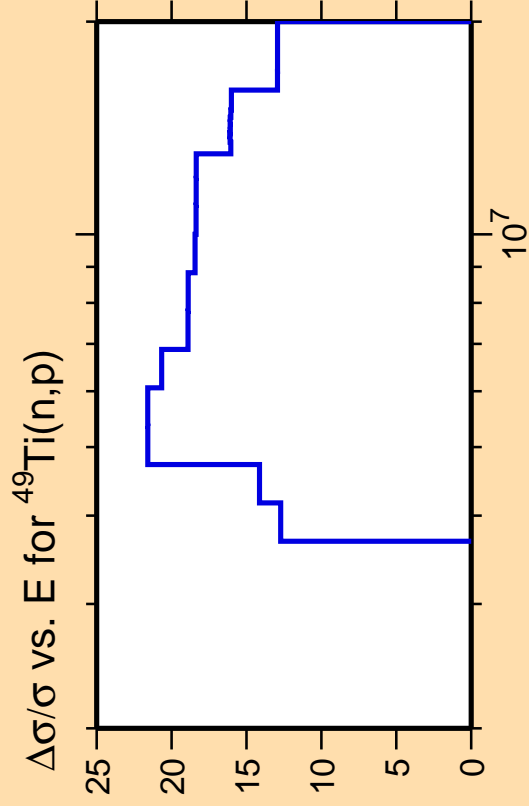


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

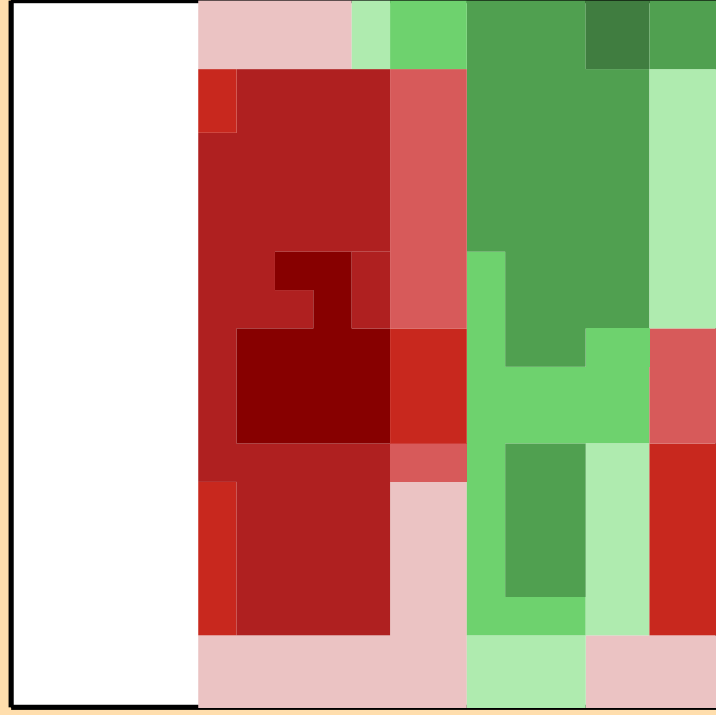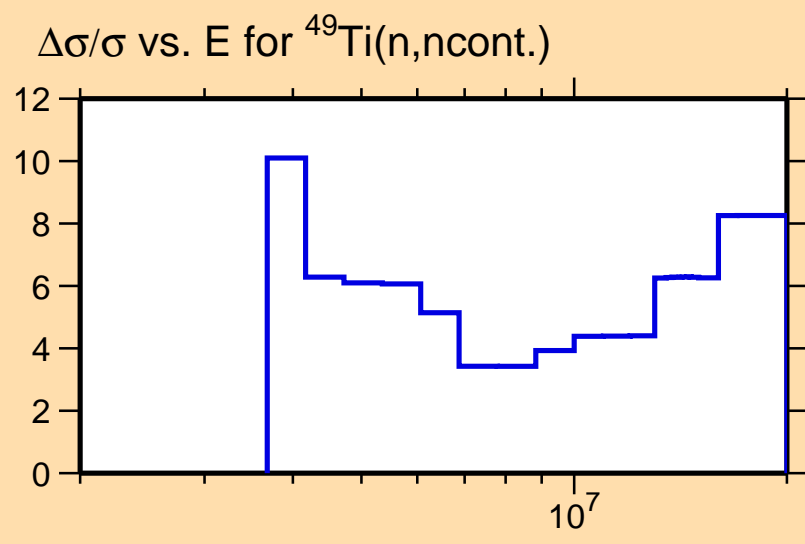

Correlation Matrix





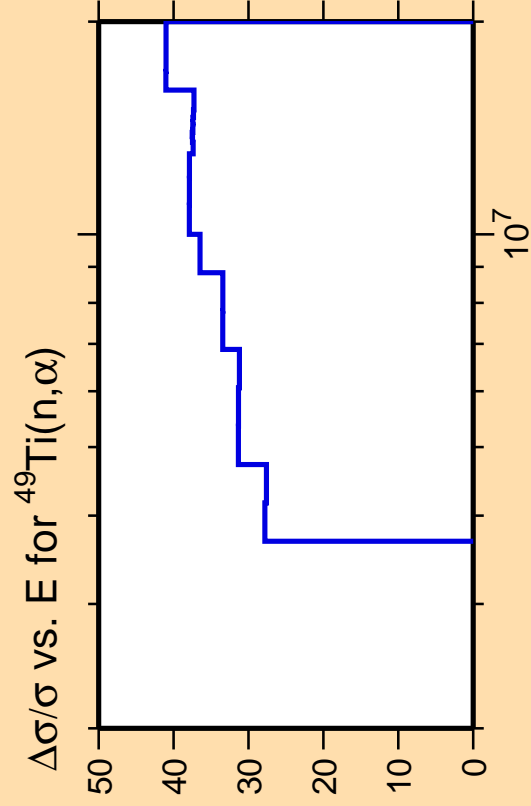

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,n\text{cont.})$

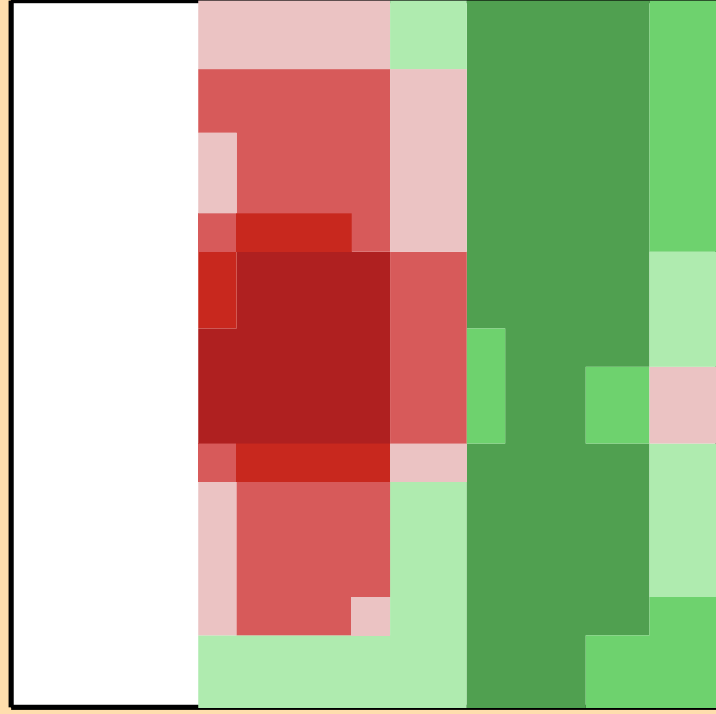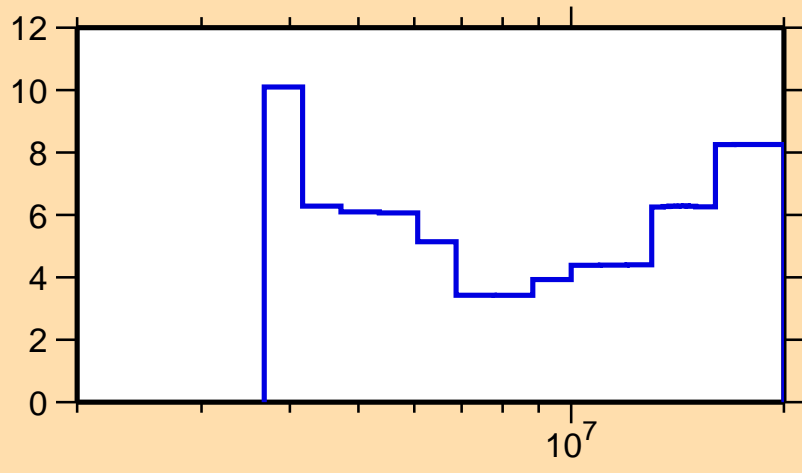

Correlation Matrix




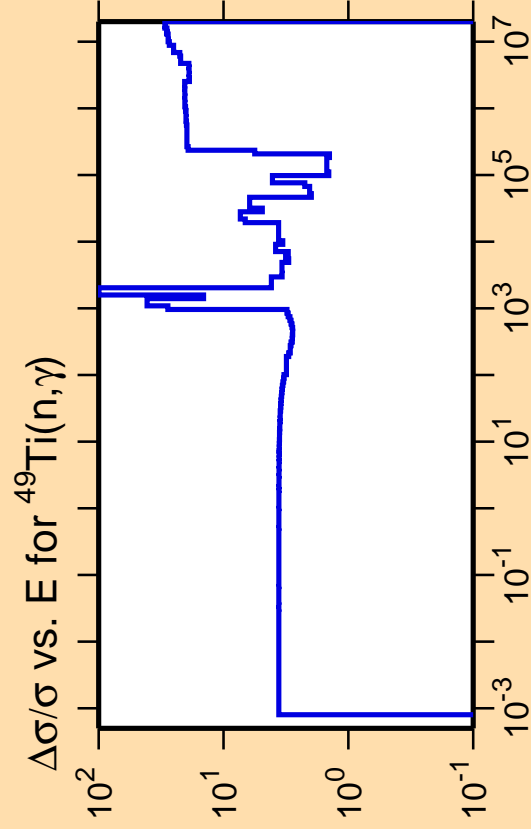

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

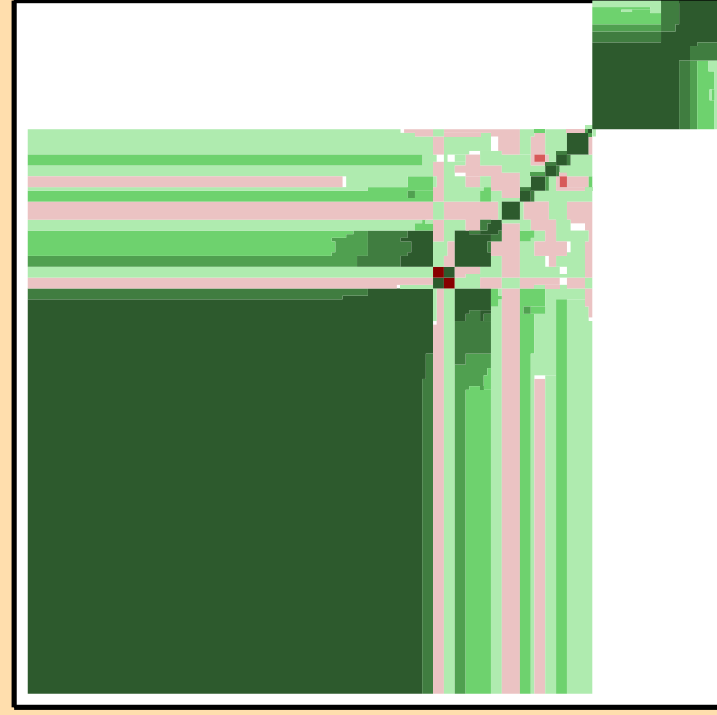


Correlation Matrix



σ vs. E for $^{49}\text{Ti}(n,\gamma)$


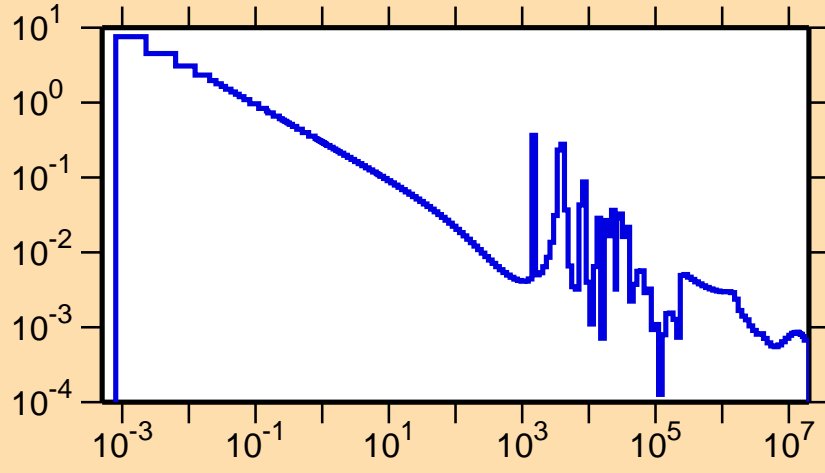


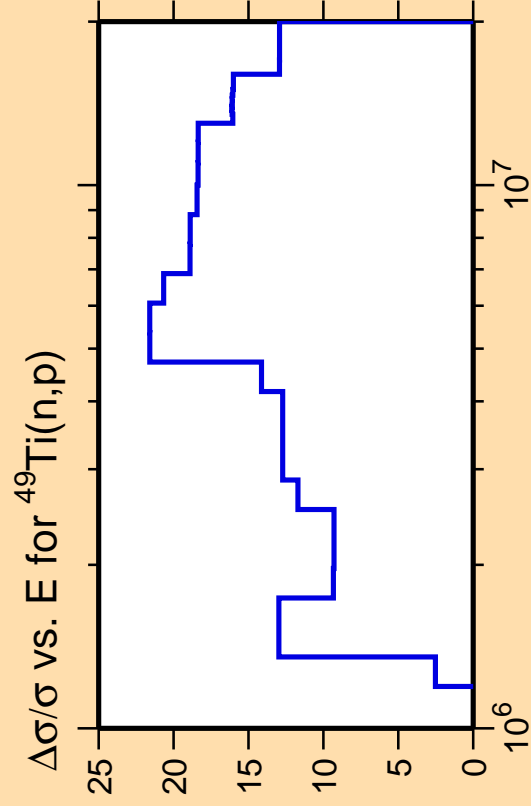

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\gamma)$

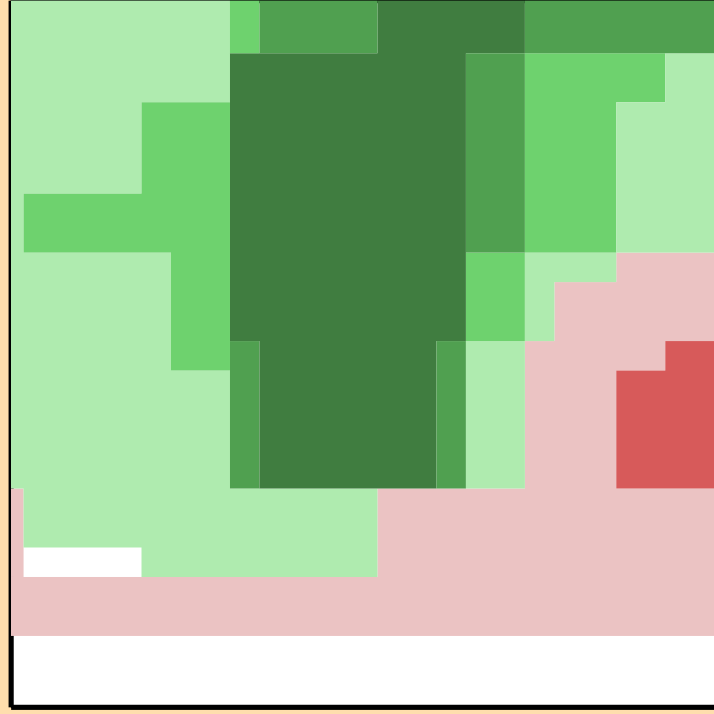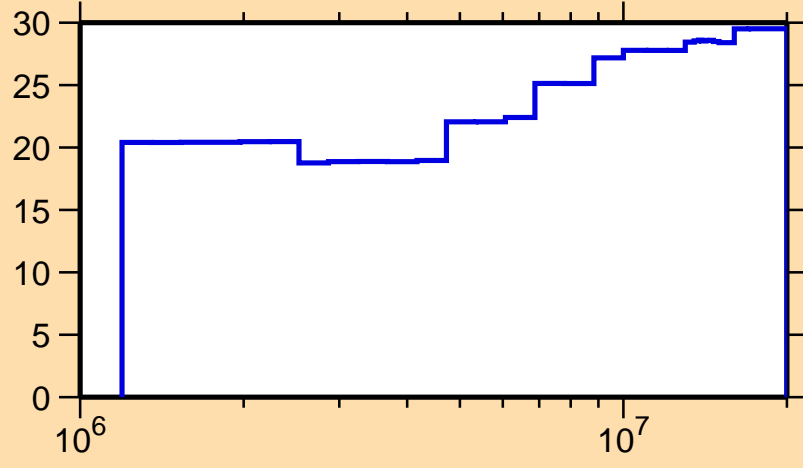

Correlation Matrix





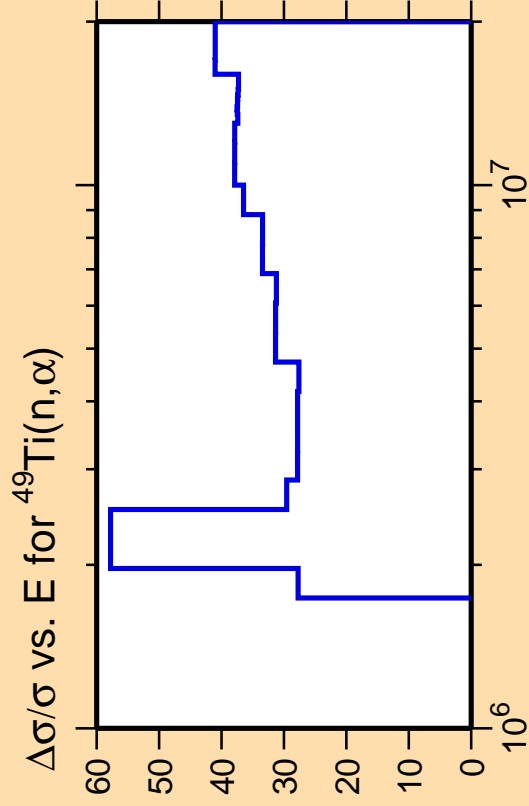

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\gamma)$

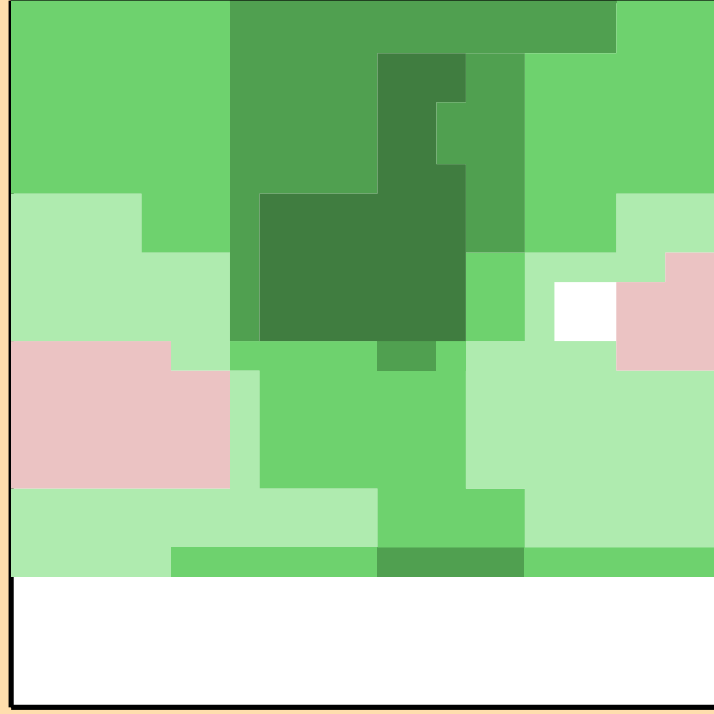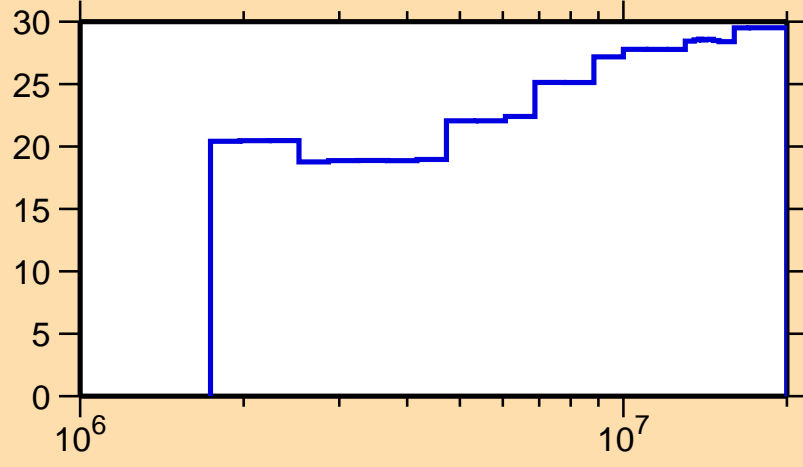



Correlation Matrix



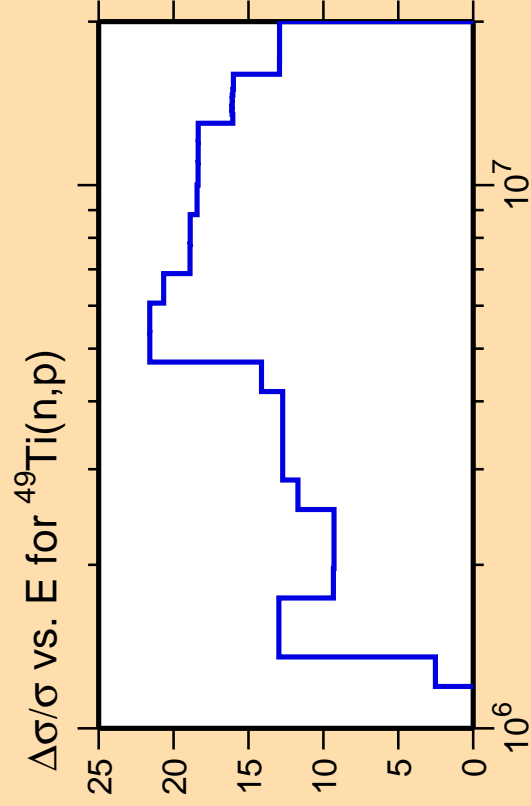

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

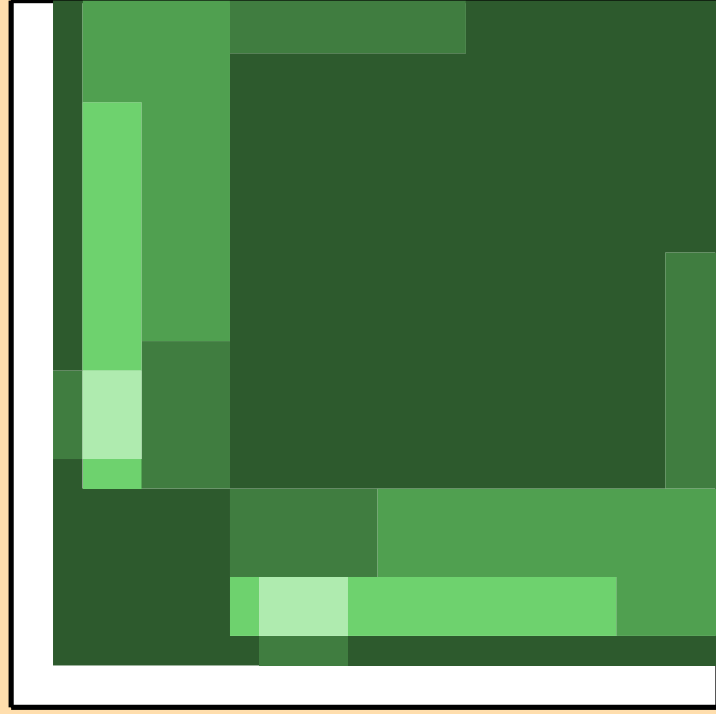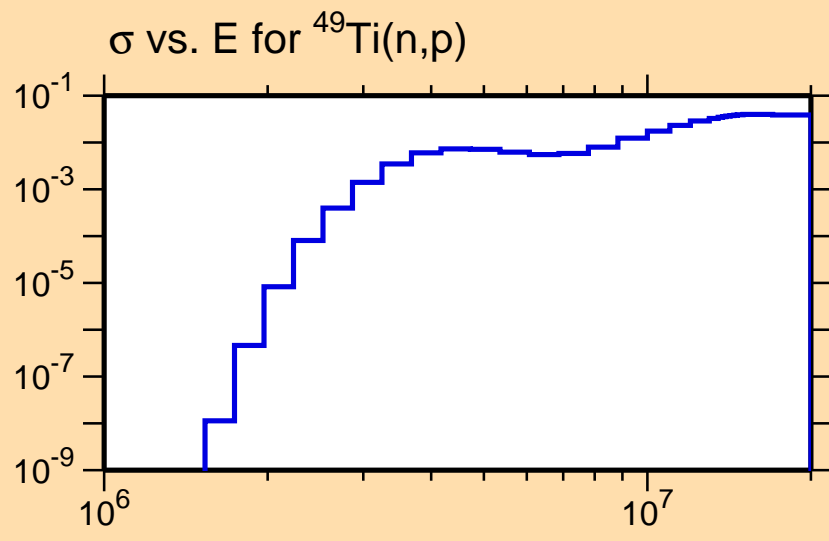

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\alpha)$

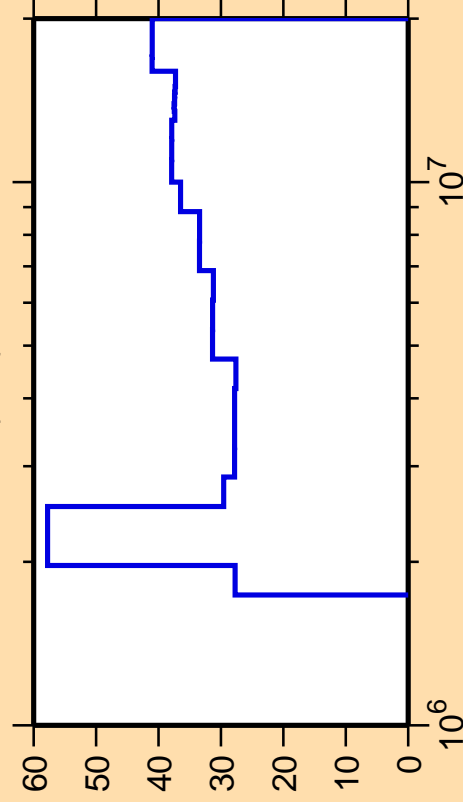

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,p)$

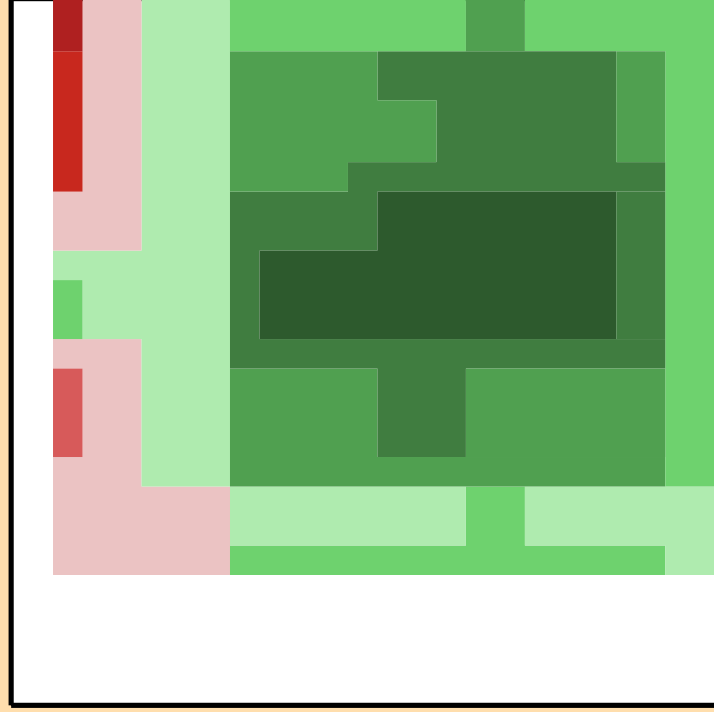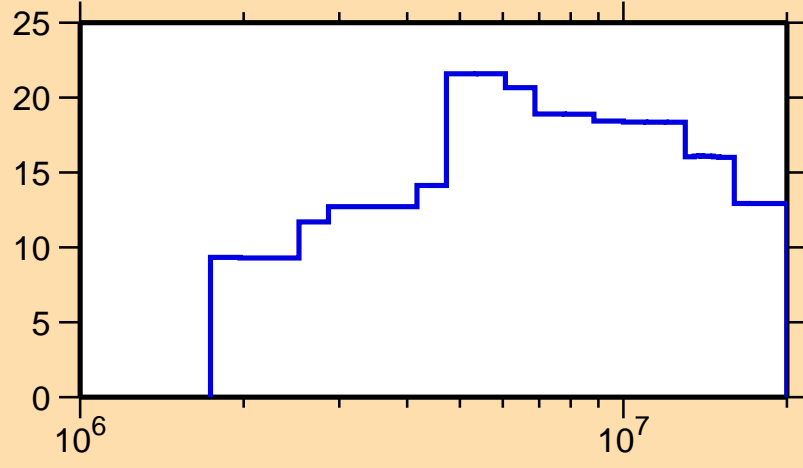

Correlation Matrix





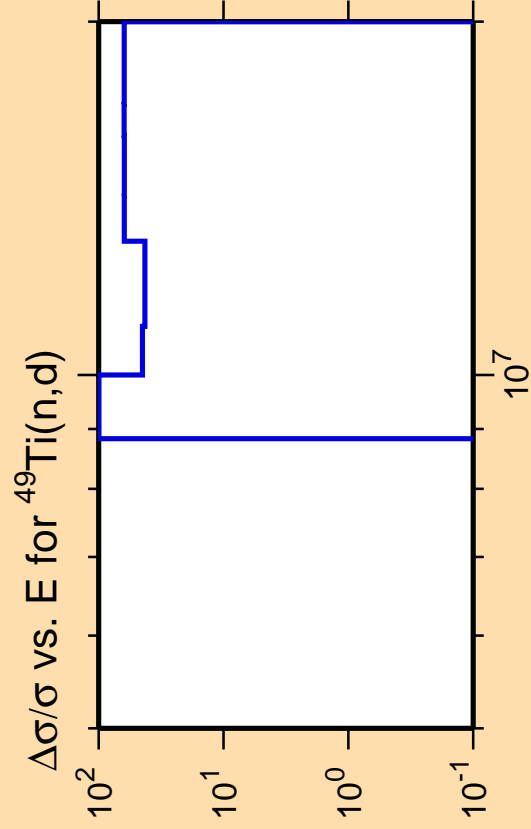

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

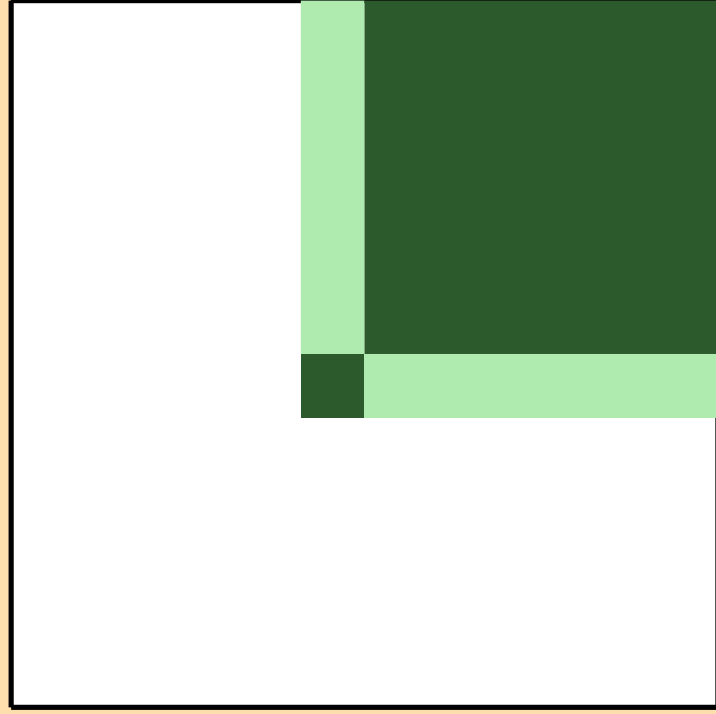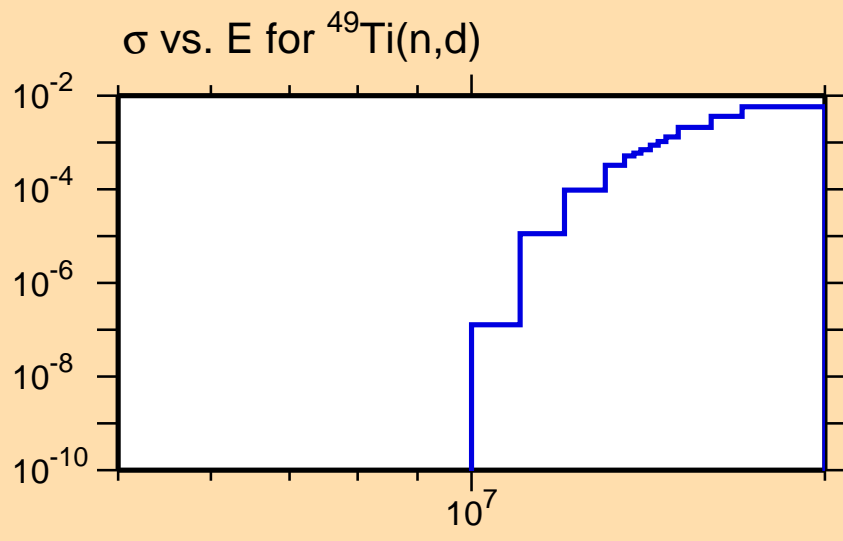

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,t)$


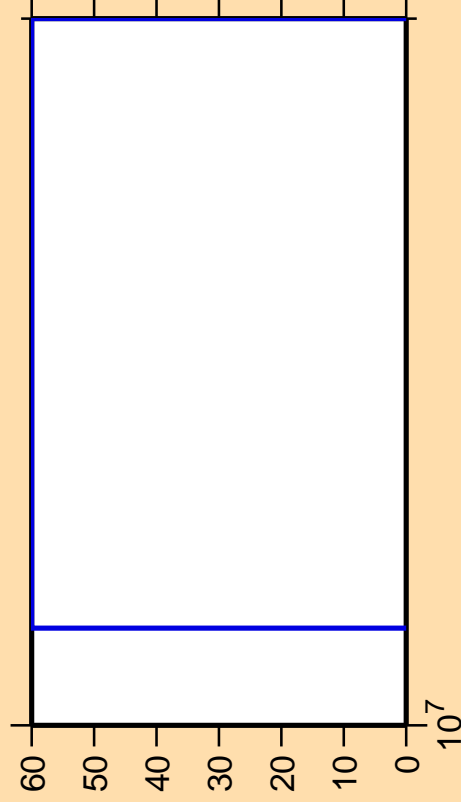


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{49}\text{Ti}(n,t)$

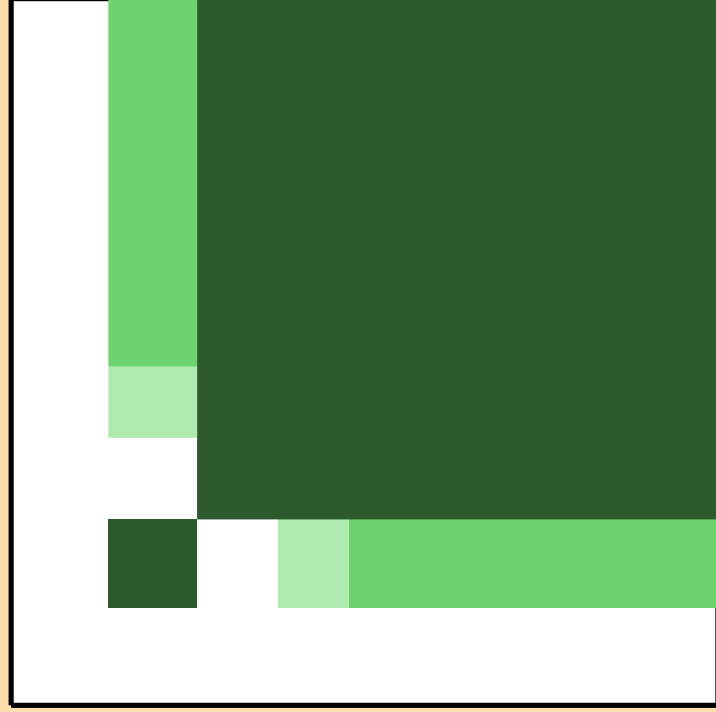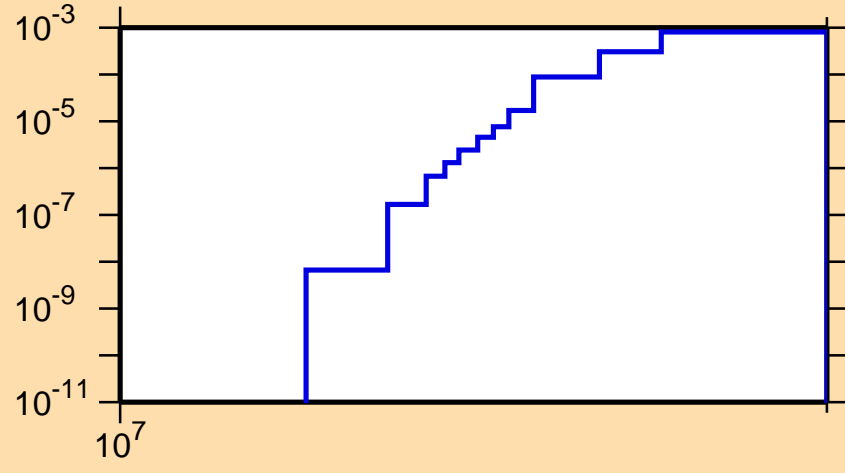

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{He}3)$

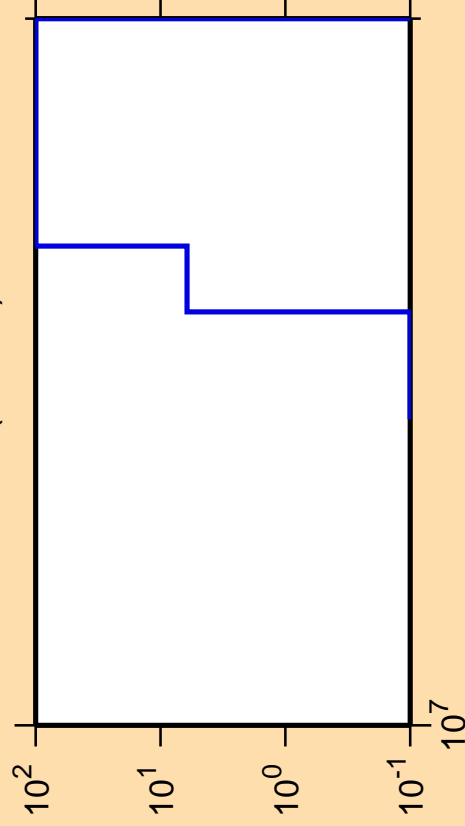


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.



σ vs. E for $^{49}\text{Ti}(n,\text{He}3)$

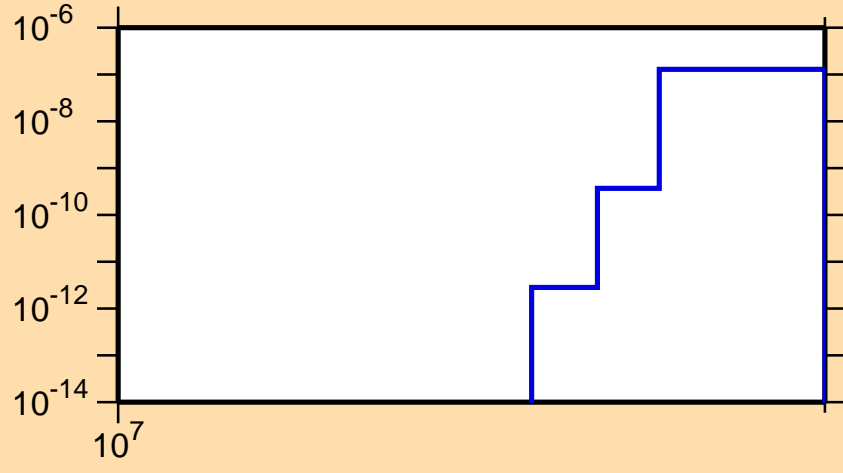


10^7





Correlation Matrix

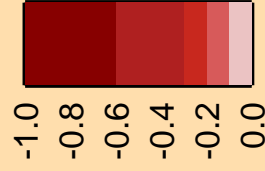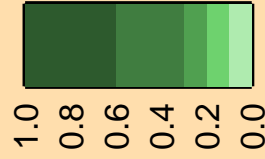

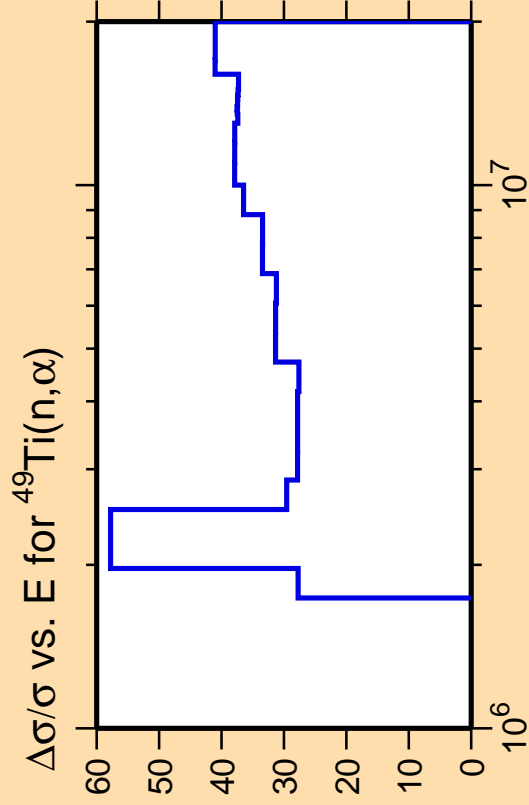

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

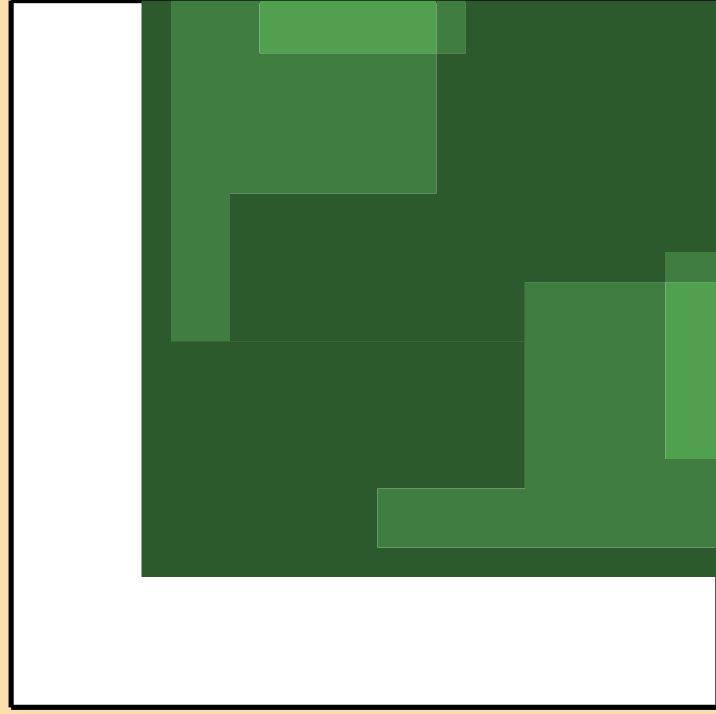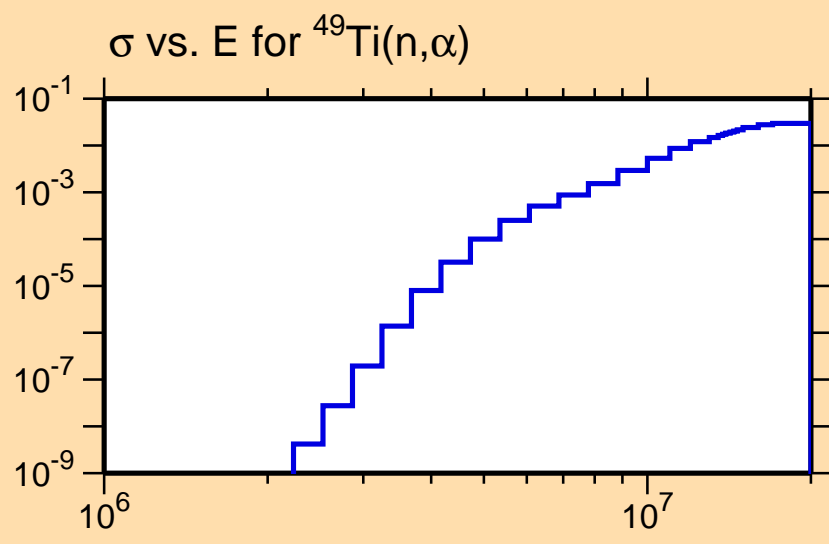

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,p\alpha)$

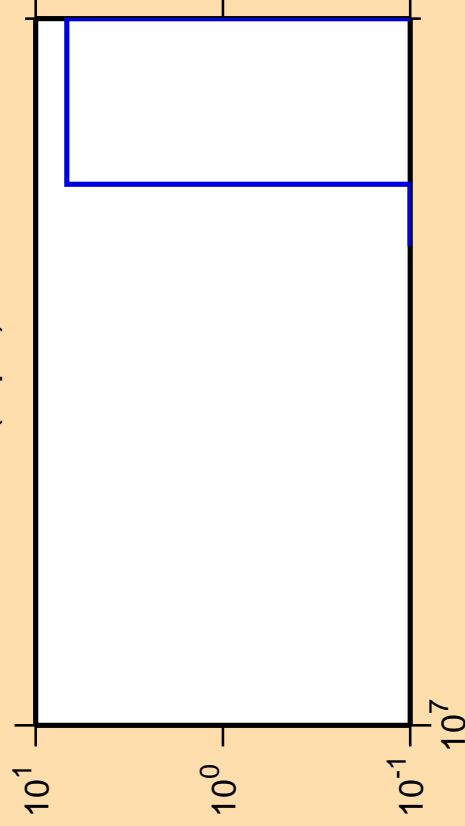


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{49}\text{Ti}(n,p\alpha)$

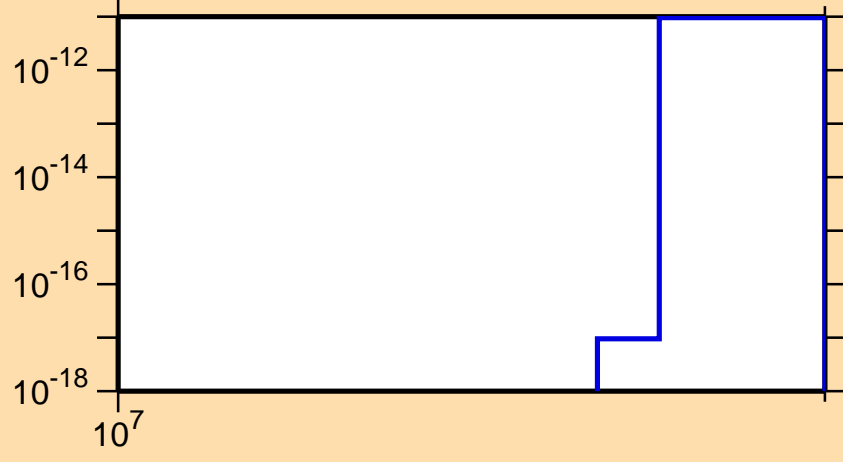


10^7

10^{-18}
 10^{-16}
 10^{-14}
 10^{-12}

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{pd})$

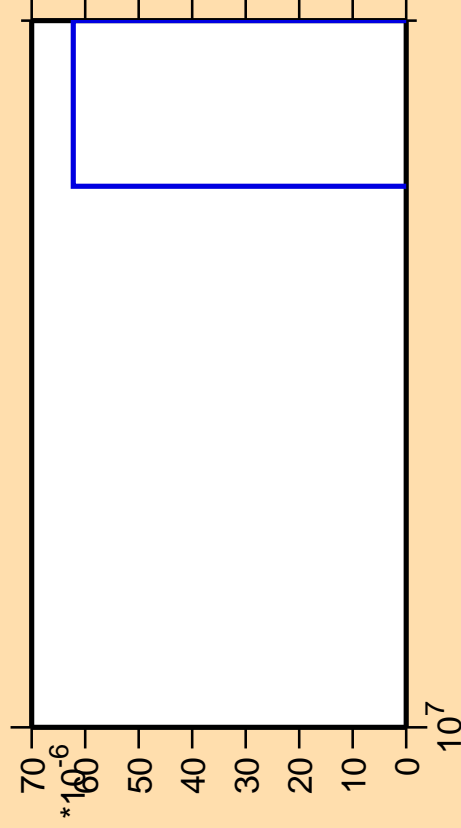

Ordinate scales are % relative standard deviation and barns.

Abcissa scales are energy (eV).


σ vs. E for $^{49}\text{Ti}(n,\text{pd})$



Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{49}\text{Ti}(n,\text{pt})$

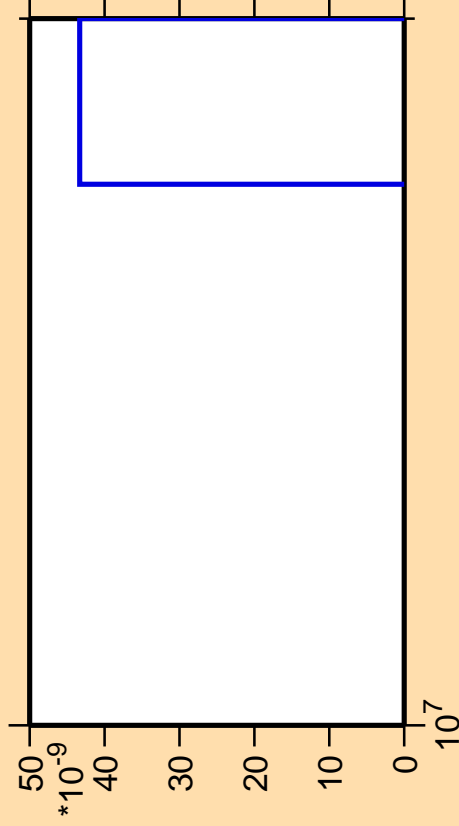

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

σ vs. E for $^{49}\text{Ti}(n,\text{pt})$



10^7

$\times 10^{-21}$

0

10

20


30

40

50

60

Correlation Matrix

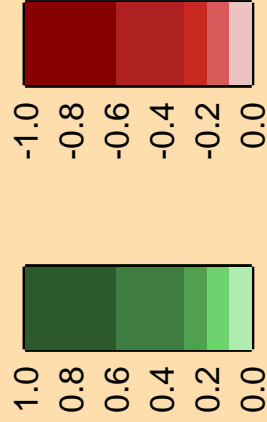

1.0

0.8

0.6

0.4

0.2

0.0

-1.0

-0.8

-0.6

-0.4

-0.2

0.0